FRONT PILLAR REMOVAL [PANEL REPLACEMENT]

id098008744700

Symbol Marks


SYMBOL MARK	MEANING
●	SPOT WELDING
⎓	ROUGH CUT LOCATION

am2zzb00000483

Removal Procedure

Caution

- **Remove the curtain air bag module to prevent damage before servicing.**

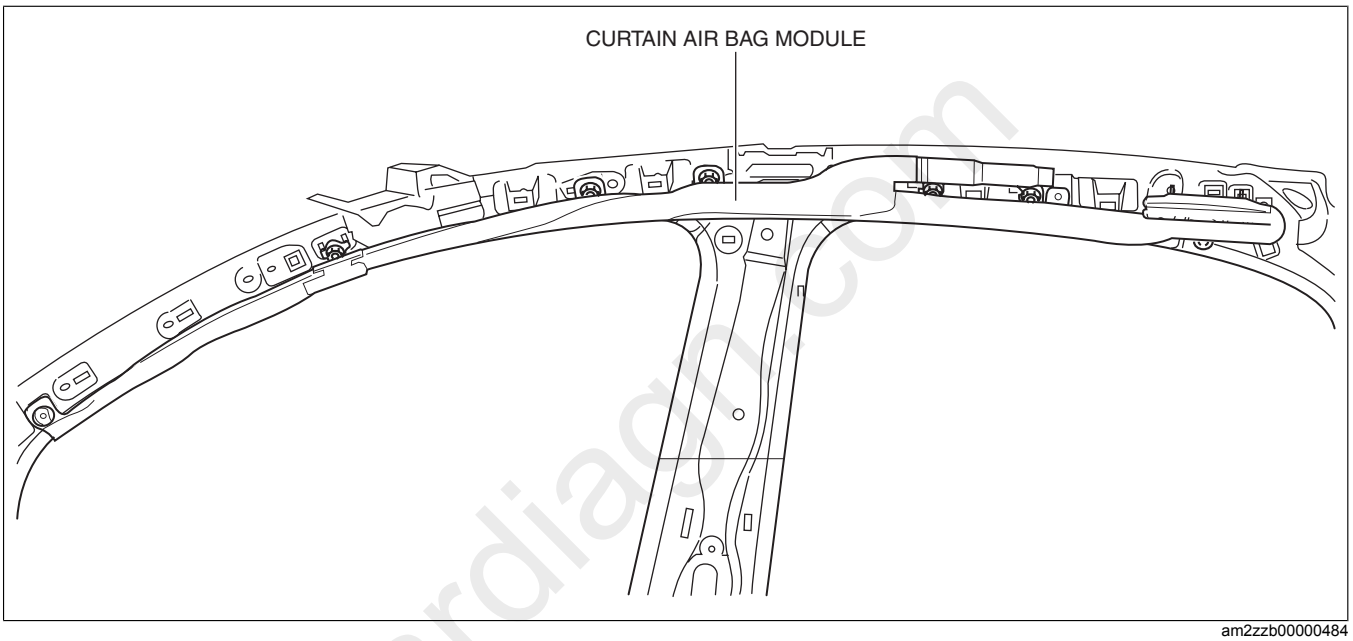


am2zzb00000484

Caution


- **Avoid cutting with a blowtorch or similar tools as the insulator is flammable shown in the figure.**

cardiagn.com

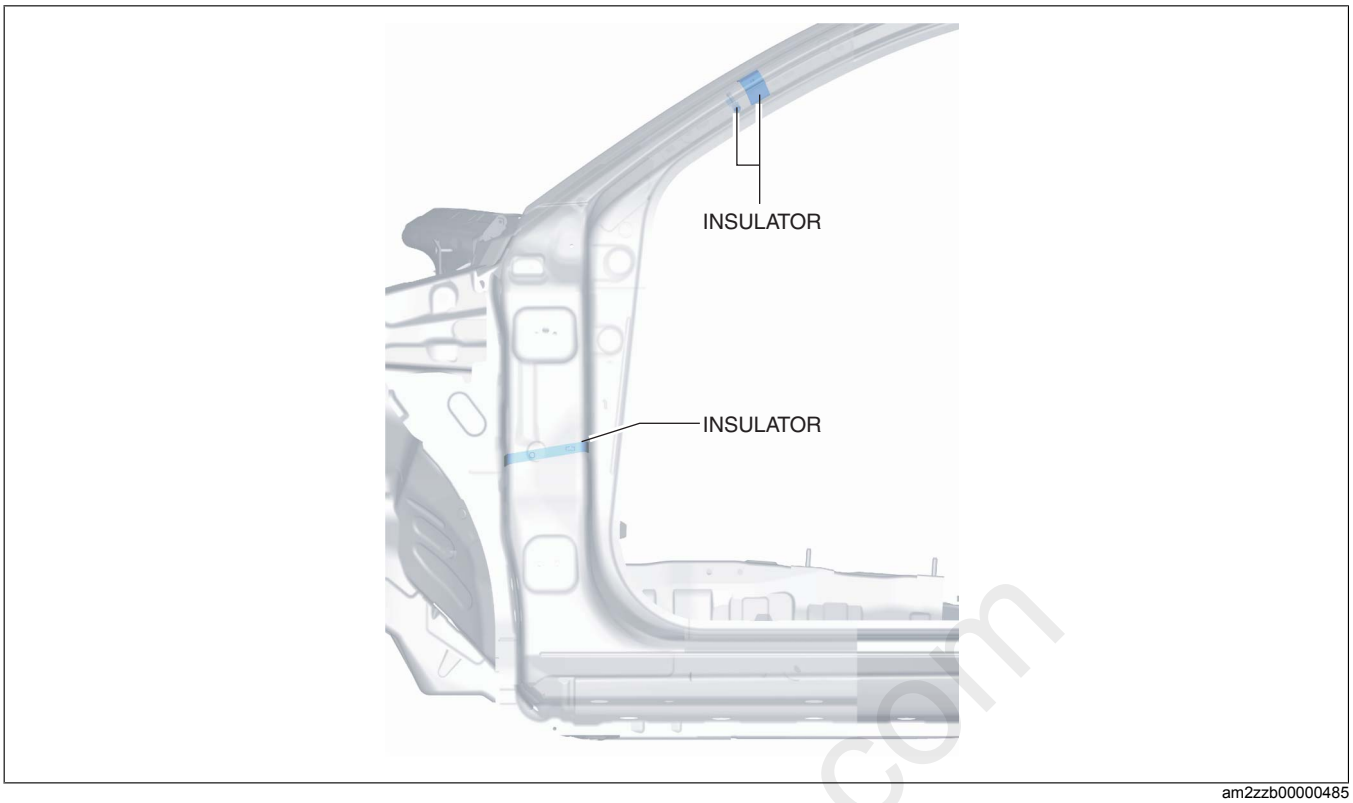


am2zzb00000485

1. Rough cut the 2 locations indicated by (A) shown in the figure.
2. Drill the 90 locations indicated by (B) shown in the figure, then remove the side frame (outer) (front pillar (outer)).

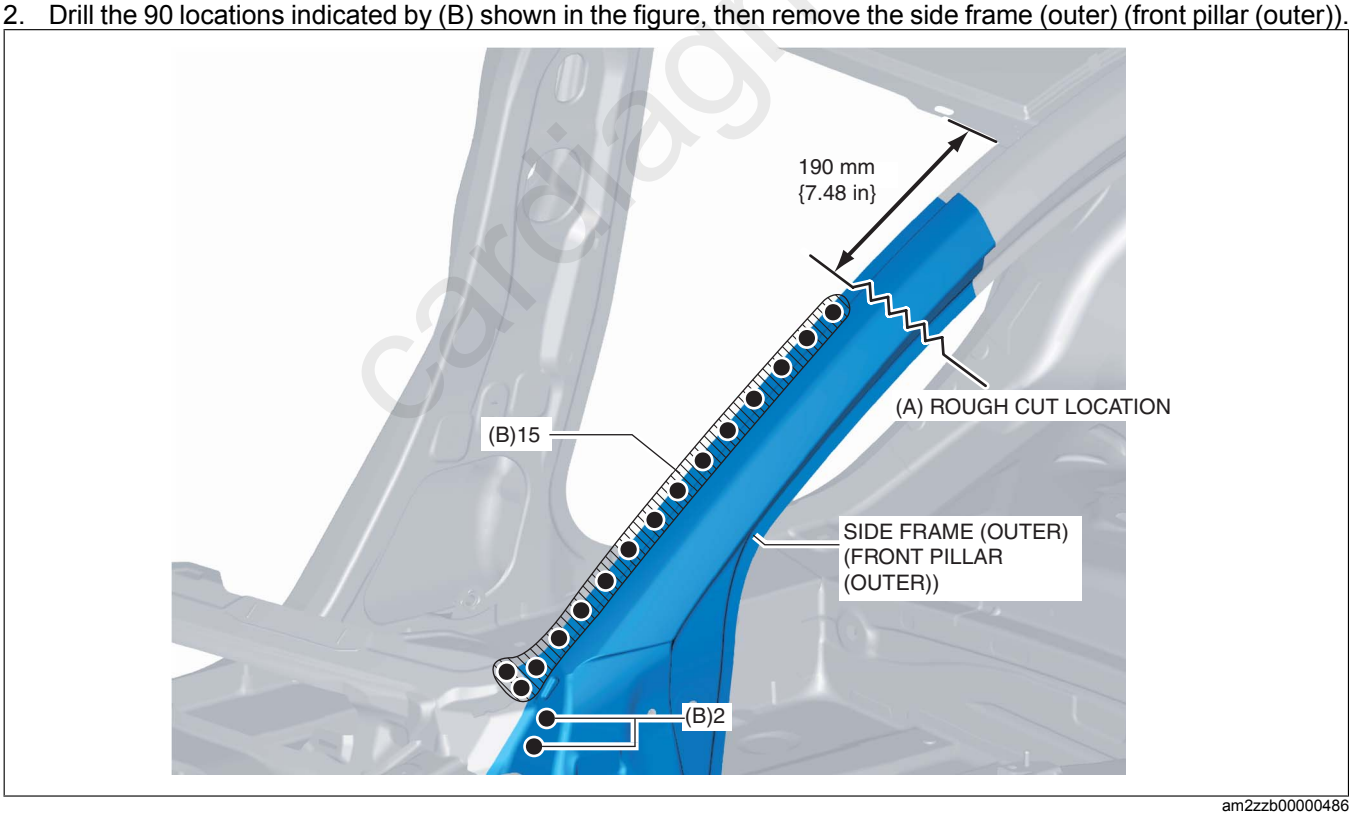


am2zzb00000486

cardiagn.com

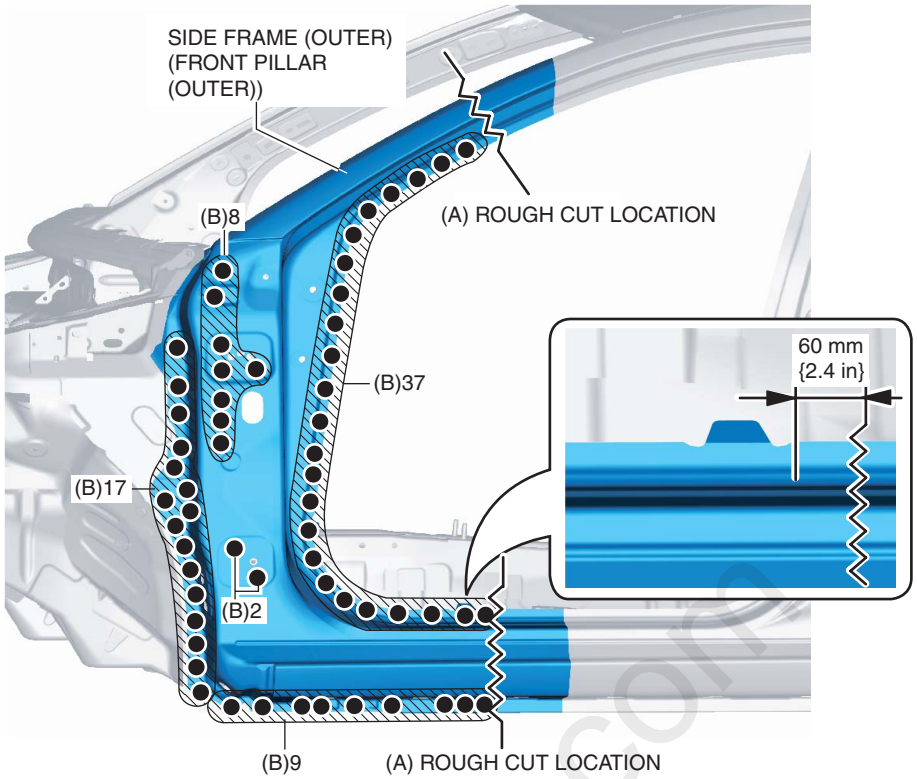


adejjb00000415

3. Drill the 19 locations indicated by (C) shown in the figure.
4. Drill the 5 locations indicated by (D) from the room side shown in the figure, then remove the front pillar reinforcement (lower) and hinge reinforcement as a single unit.

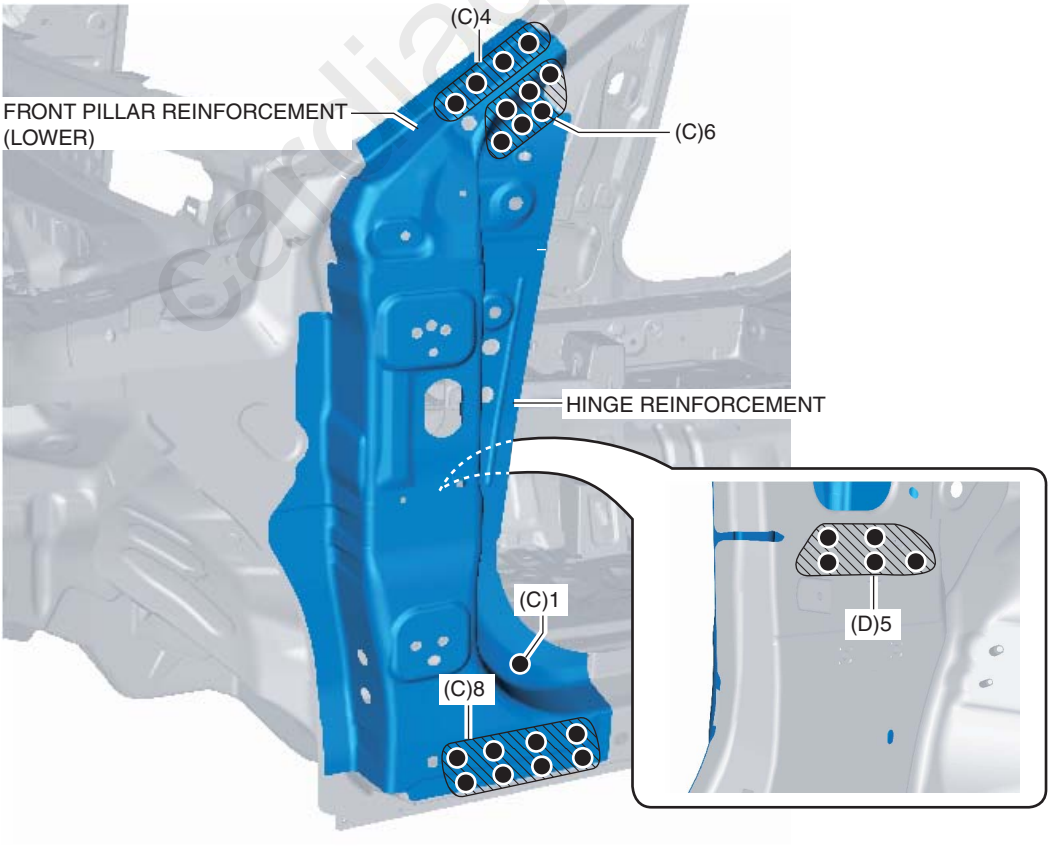


am2zzb00000487

5. Rough cut the location indicated by (E) shown in the figure, then remove the front pillar reinforcement (upper).

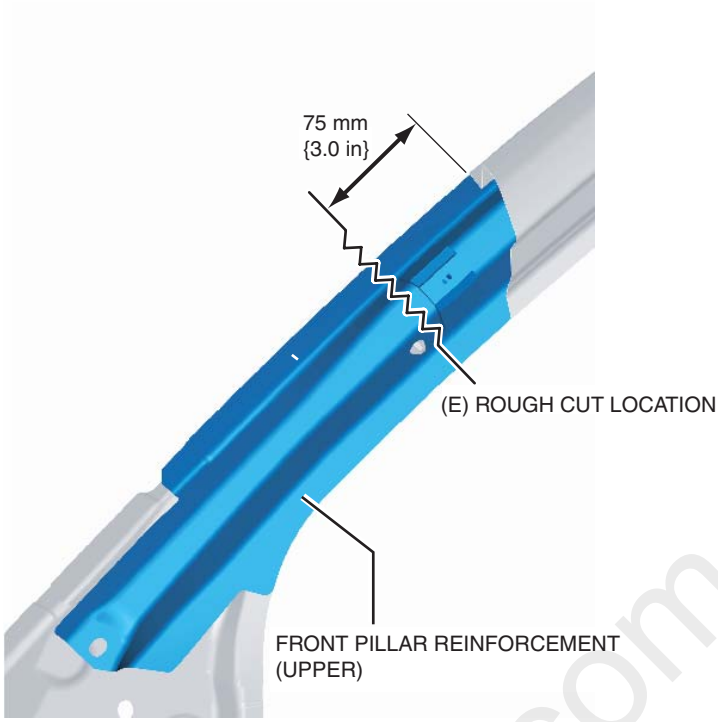


am2zzb00000488

6. Drill the 18 locations indicated by (F) shown in the figure, then remove the front pillar reinforcement (upper).

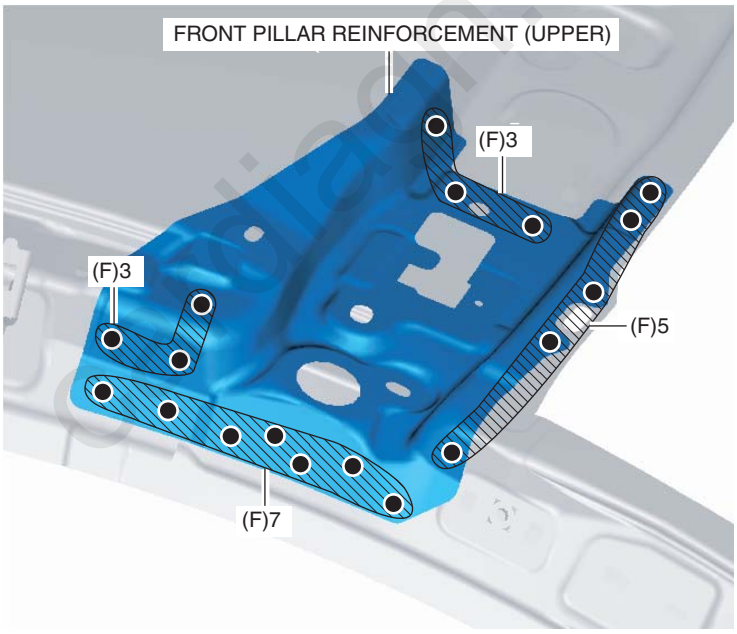

am2zzb00000625

7. Drill the 25 locations indicated by (G) from room side shown in the figure, then remove the front pillar (inner).

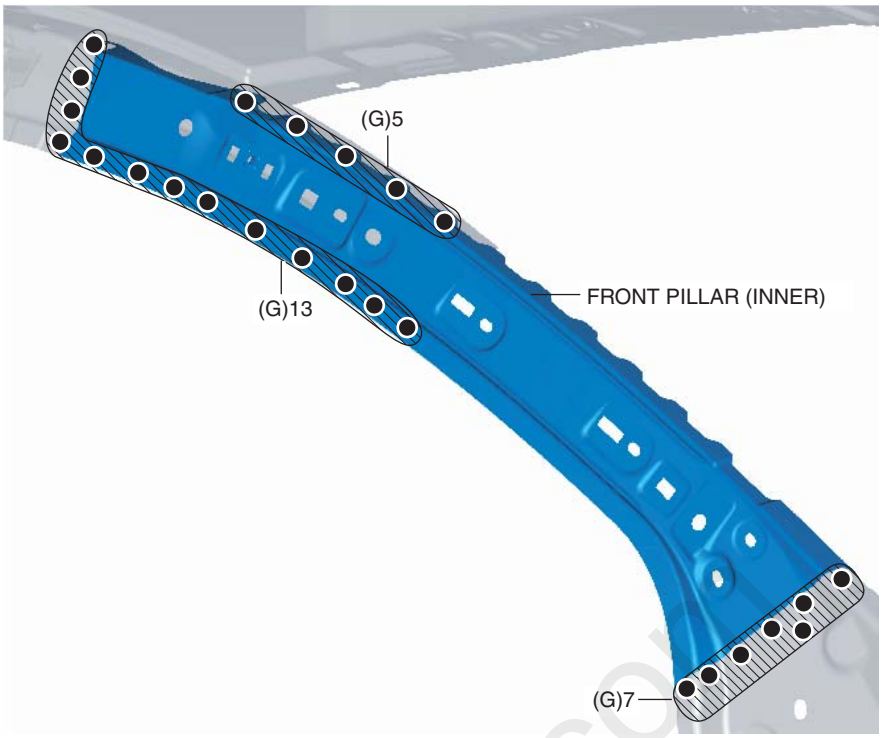

am2zzb00000489

cardiagn.com