PACKAGE GUSSET INSTALLATION [PANEL REPLACEMENT]

id098008820100

Symbol Marks


SYMBOL MARK	MEANING
■	PLUG WELDING (CO_2 ARC WELDING)
▬ ▬ ▬	FILLET WELDING

am3zzb00000182

Installation Procedure


4SD

1. When installing new parts, measure and adjust the body as necessary to conform with standard dimensions.
2. Drill holes for the plug welding before installing the new parts.
3. After temporarily installing new parts, make sure the related parts fit properly.
4. Plug weld the 22 locations indicated by (A) shown in the figure.

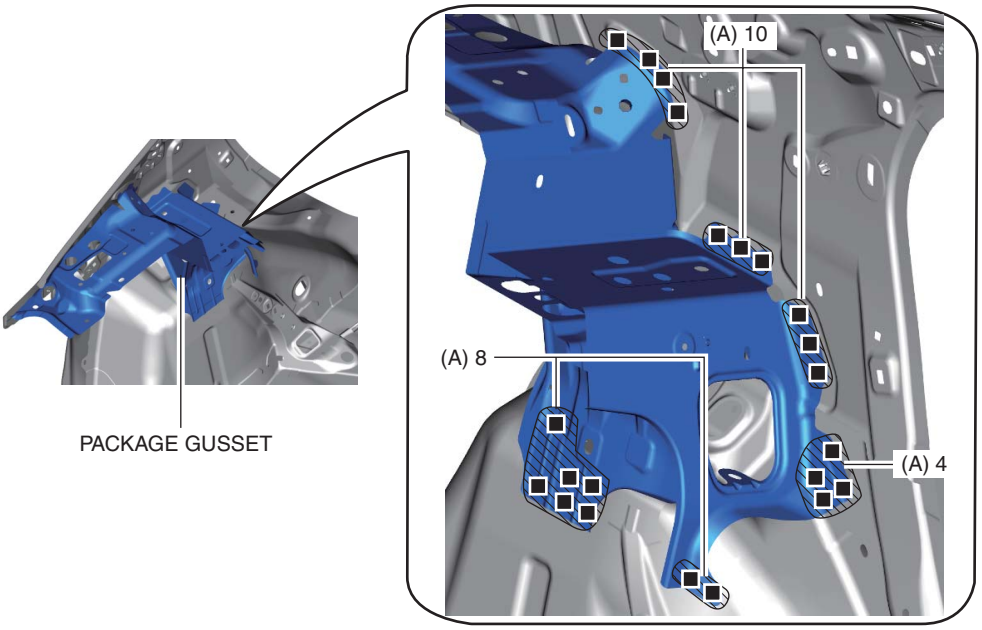


am2zzb00000726

5. Then, fillet weld the 6 locations indicated by (B) shown in the figure.

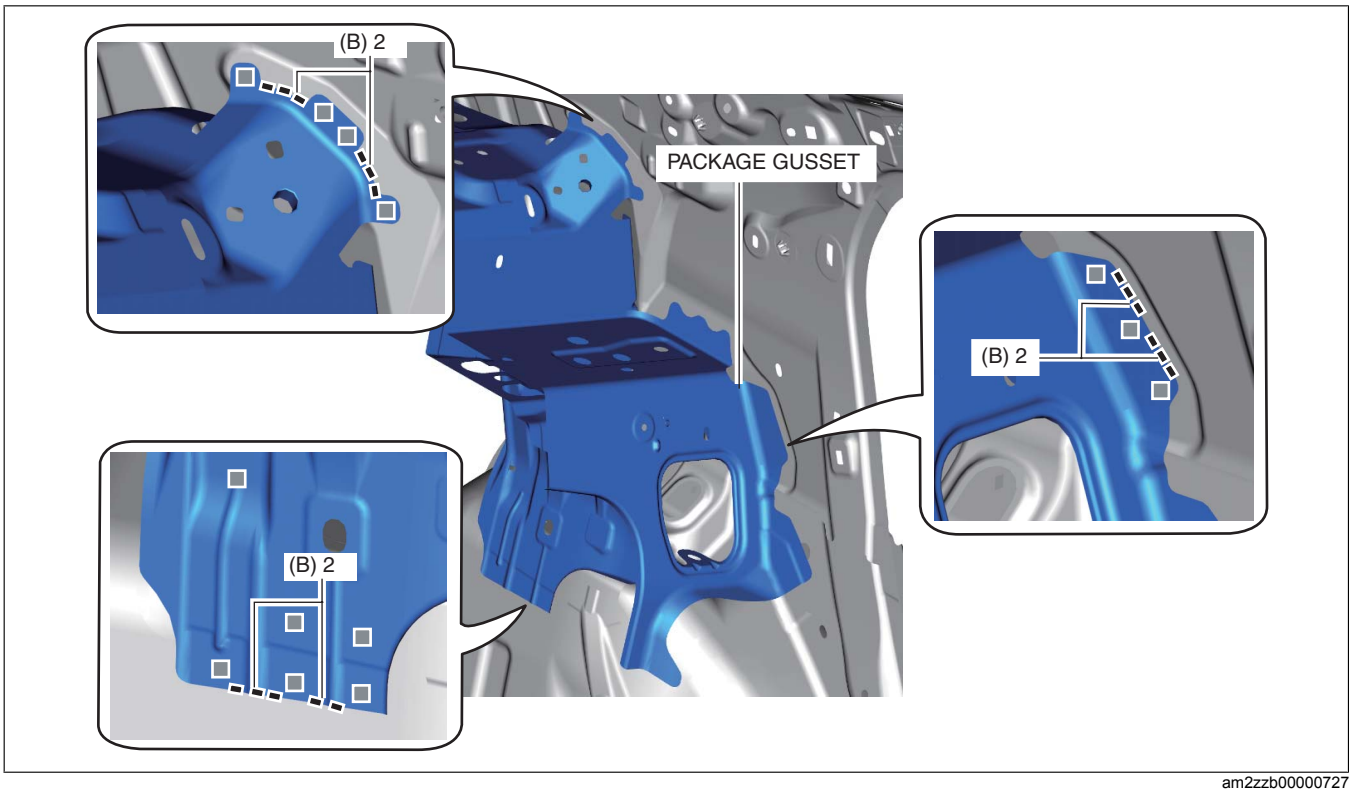

am2zzb00000727

6. Plug weld the 15 locations indicated by (C) shown in the figure, then install the package gusset.

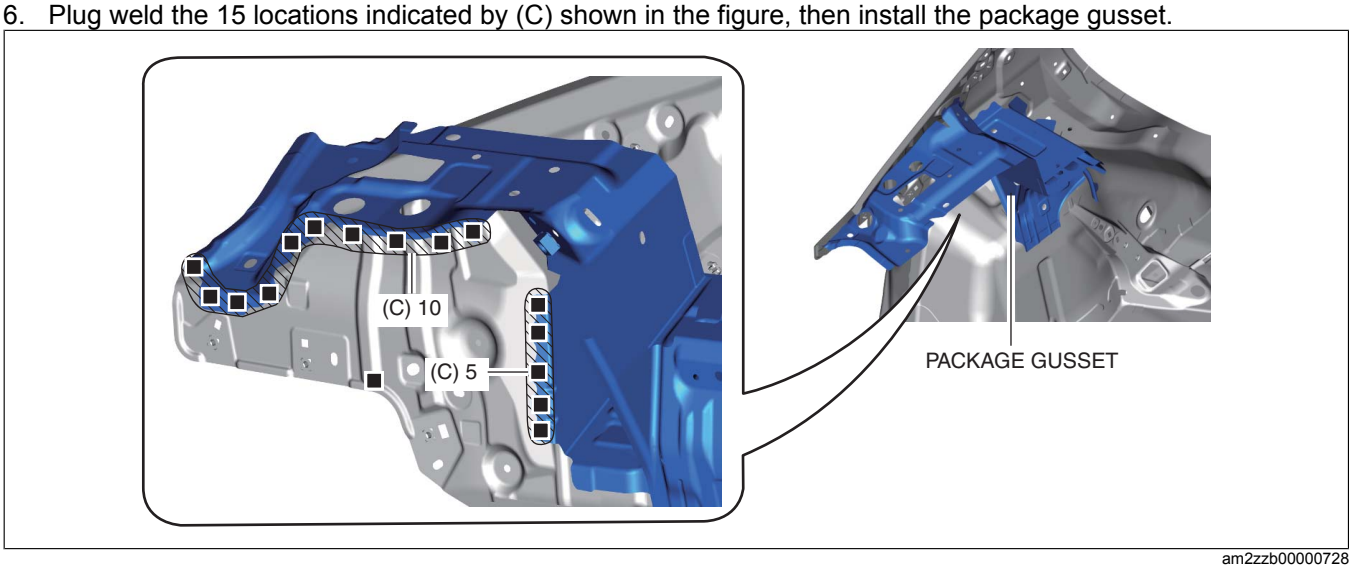


am2zzb00000728

5HB


1. When installing new parts, measure and adjust the body as necessary to conform with standard dimensions.
2. Drill holes for the plug welding before installing the new parts.
3. After temporarily installing new parts, make sure the related parts fit properly.
4. plug weld the 16 locations (LH), 9 locations (RH) indicated shown in the figure, then install the package gusset.

LH

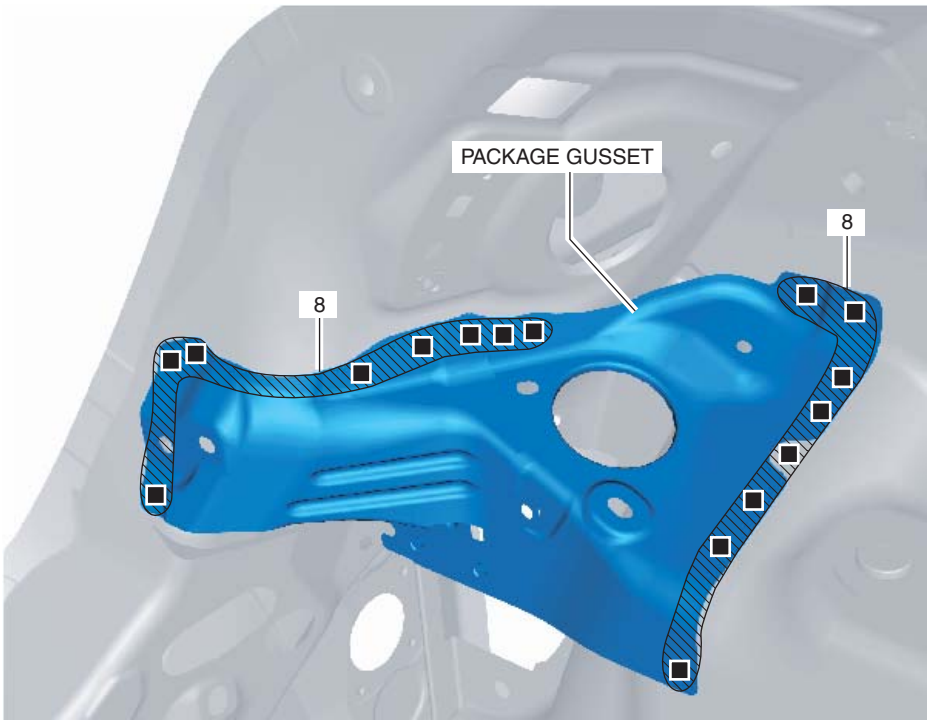

am2zzb00000538

RH

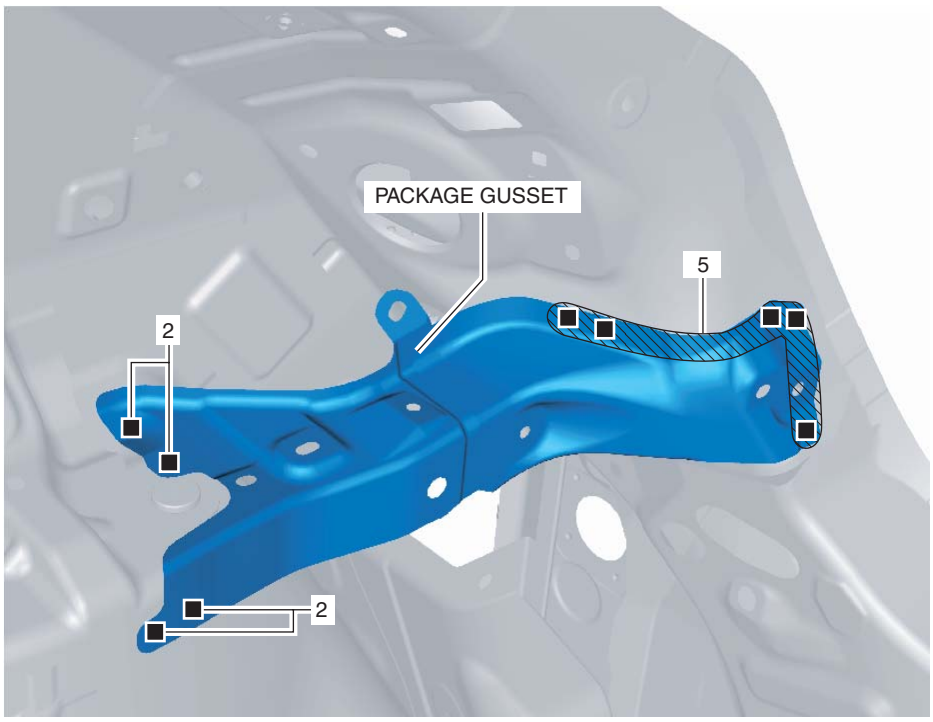

am2zzb00000539