COWL SIDE REINFORCEMENT (FRONT) COMPONENT REMOVAL [PANEL REPLACEMENT]

id098008950000


Symbol Marks

SYMBOL MARK	MEANING
●	SPOT WELDING

am2zzb00000444

Removal Procedure

1. Drill the 15 locations indicated by (A) shown in the figure.

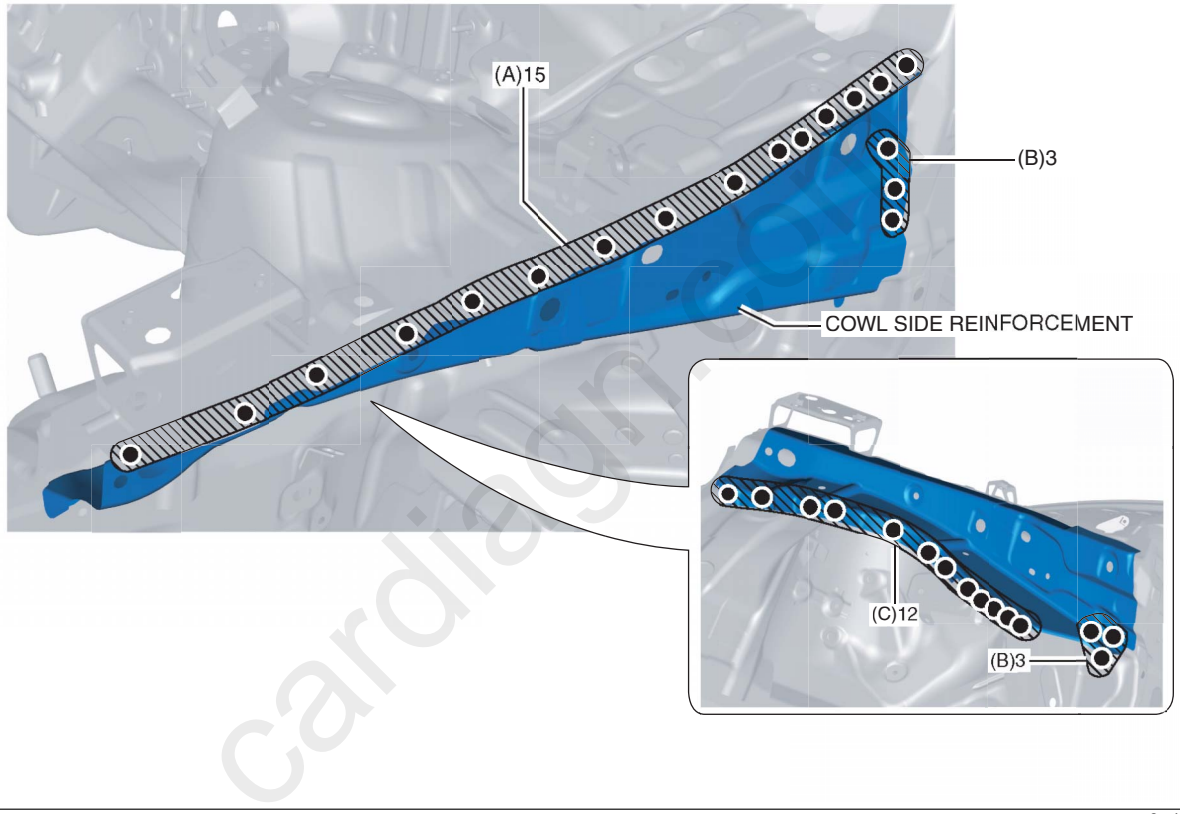

am2zzb00000445

2. Drill the 6 locations indicated by (B) shown in the figure.

Note

- When drilling the 6 locations indicated by (B) shown in the figure, do not drill a hole all the way through or there could be a problem when installing the new part.

3. Drill the 12 locations indicated by (C) shown in the figure, then remove the cowl side reinforcement.