# **GXCAS**

# **Technology**

### **DESCRIPTION**

The GXTS02L is GXCAS's new high accuracy digital temperature sensor. Its functionality includes enhanced signal processing, two distinctive and user selectable I2C addresses and communication speeds of up to 1 MHz. Additionally, the wide supply voltage range of 2.2 V to 5.5 V guarantees compatibility with a wide range of applications.

### **FEATURES**

- Fully calibrated and linearized digital output
- Wide supply voltage range, from 2.2V to 5.5 V
- I2C Interface with communication speeds up to 1MHz and two user selectable addresses
- Typical accuracy of ± 0.3 °C
- Very fast start-up and measurement time
- Measures Temperatures from -45~130 °C
- ±0.3°C Accuracy from 35°C to +45°C
   Thermometer Resolution is 15 Bits


# Content

1	Sensor Performance	2
2	Specifications	3
3	Pin Assignment	5
4	Operation and Communication	6
5	Packaging	12

# High-Accuracy Digital Temperature Sensor IC

- Converts Temperature to 15-Bit Digital Word in 12ms
- 8-Pin WLCSP package

### **PIN CONFIGURATIONS**



WLCSP

器件信息

器件型号	封装	标称尺寸
GXTS02L	WLCSP	1.38mm*1.81mm



### 1 Sensor Performance

### 1.1 Temperature Sensor Performance

Parameter	Condition	Value	Units
Accuracy tolerance	typ., 35°C to 45°C	±0.1	°C
Accuracy tolerance	typ., 0°C to 90°C	±0.3	°C
	Low	0.24	°C
Repeatability	Medium	0.12	°C
	High	0.06	°C
Resolution	Тур.	0.015	°C
Specified Range	-	-40 to 125	°C
Response time	τ63%	>1	S
Long Term Drift	max	<0.02	℃/y

 Table 1 Temperature sensor specification.

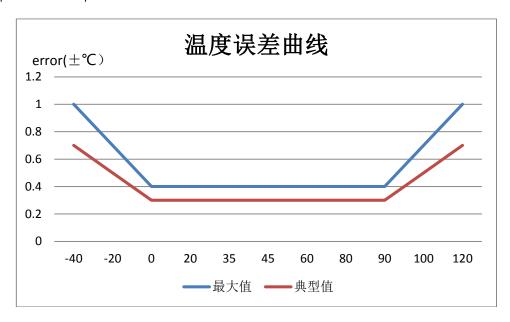


Figure 2 Temperature accuracy of the GXTS02L sensor.



### 2 Specifications

### 2.1 Electrical Specifications

Parameter	Symbol	Condition	Min.	Тур.	Max.	Units	Comments
Supply voltage	$V_{DD}$		2.2	3.3	5.5	V	
Power-up/down level	V <sub>POR</sub>		2.2	2.3	2.4	V	
Slew rate change of the supply voltage	V <sub>DD,slew</sub>		-	-	20	V/ms	Voltage changes on the VDD line between VDD,min and VDD,max should be slower than the maximum slew rate
		idle state (single shot mode)	-	0.15	2.0	μА	Current when sensor is not performing a measurement during single shot mode
Comple surrent	idle state (periodic data acquisition mode)  IDD Measuring  Average	data acquisition	-	45	70	μА	Current when sensor is not performing a measurement during periodic data acquisition mode
Supply current		Measuring	-	600	1200	μА	Current consumption while sensor is measuring
		-	2	5	μА	Current consumption (operation with one measurement per second at lowest repeatability, single shot mode)	
Alert Output driving strength	IOH		0.8x V <sub>DD</sub>	1.5x V <sub>DD</sub>	2.1x V <sub>DD</sub>	mA	See also section 3.5
Table 2 Flactrical specification	iono volid at	25°C and typical VIDI					

Table 2 Electrical specifications, valid at 25°C and typical VDD.

### 2.2 Timing Specification for the Sensor System

2.2 Tilling opecinication for the behavior bystem							
Parameter	Symbol	Conditions	Min.	Тур.	Max.	Units	Comments
Power-up time	<b>t</b> eu	After hard reset,  V <sub>DD</sub> ≥ V <sub>POR</sub>	-	0.5	1	ms	Time between V <sub>DD</sub> reaching V <sub>POR</sub> and sensor entering idle state
Soft reset time	tsr	After soft reset.	-	0.5	1	ms	Time between ACK of soft reset command and sensor entering idle state
Duration of reset pulse	tresetn		350	-	-	ns	See section 3.6
	t <sub>MEAS.I</sub>	Low repeatability		12	14	ms	The three repeatability modes
Measurement duration	t <sub>MEAS,m</sub>	Medium repeatability		24	48	ms	differ with respect to
ineasurement duration	t <sub>MEAS,h</sub>	High repeatability		48	96	ms	measurement duration, noise level and energy consumption
							-

**Table 3** System timing specification, valid from -40  $^{\circ}$ C to 125  $^{\circ}$ C and 2.4 V to 5.5 V.



### 2.3 Absolute Minimum and Maximum Ratings

Stress levels beyond those listed in Table 4 may cause permanent damage to the device or affect the reliability of the sensor. These are stress ratings only and functional operation of the device at these conditions is not guaranteed.

Parameter	Rating	Units
Supply voltage V <sub>DD</sub>	-0.3 to 6	V
Max Voltage on pins (pin 1 (SDA); pin 2 (ADDR); pin 3 (ALERT); pin 4 (SCL); pin 6 (nRESET))	-0.3 to VDD+0.3	V
Input current on any pin	±100	mA
Operating temperature range	-40 to 125	°C
Storage temperature range	-40 to 150	°C
ESD HBM (human body model) <sup>4</sup>	4	kV
ESD CDM (charge device model) <sup>5</sup>	750	V

Table 4 Minimum and maximum ratings; values may only be applied for short time periods.

<sup>&</sup>lt;sup>4</sup> Sensor in application configuration (pin 7 connected to VSS). ESD HBM 2 kV according to JEDEC JS-001.

<sup>&</sup>lt;sup>5</sup> According to JEDEC JS-002.




### 3 Pin Assignment

The GXT03 comes in a tiny 8-pin DFN package – see Table 5.

Pin	Name	Comments		
1	SDA	Serial data; input / output		
2	ADDR	Address pin; input; connect to either VDD or VSS, do not leave floating ADDR=0 12C_address is 0X44 ADDR=1 12C address is 0X45		
3	ALERT	Indicates alarm condition; output; must be left floating if unused		
4	SCL	Serial clock; input / output		
5	VDD	Supply voltage; input		
6	nRESET	Reset pin active low; input; if not used it is recommended to connect to VDD		
7	Р	No electrical function; recommended to connect to VSS		
8	G	Ground		

pull-up resistors (please refer to Figure 4). A device on the I2C bus must only drive a line to ground. The external pull-up resistors (e.g.  $R_\text{p}{=}10~\text{k}\Omega)$  are required to pull the signal high. For dimensioning resistor sizes please take bus capacity and communication frequency into account (see for example Section 7.1 of NXPs I2C Manual for more details<sup>6</sup>). It should be noted that pull-up resistors may be included in I/O circuits of microcontrollers. It is recommended to wire the sensor according to the application circuit as shown in Figure 4.

 $V_{DD}$ 

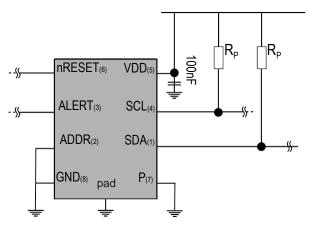

**Figure 4** Typical application circuit. Please note that the positioning of the pins does not reflect the position on the real sensor. This is shown in Table 5.



### 4 Operation and Communication

The GXTS02L supports I2C fast mode (and frequencies up to 1000 kHz). Clock stretching can be enabled and disabled through the appropriate user command. For detailed information on the I2C protocol, refer to NXP I2C-bus specification<sup>7</sup>.

All GXTS02L commands and data are mapped to a 16-bit address space. Additionally, data and commands are protected with a CRC checksum. This increases communication reliability. The 16 bits commands to the sensor already include a 3 bit CRC checksum. Data sent from and received by the sensor is always succeeded by a 8 bit CRC.

In write direction it is mandatory to transmit the checksum, since the GXTS02L only accepts data if it is followed by the correct checksum. In read direction it is left to the master to read and process the checksum.

### 4.1 Power-Up and Communication Start

The sensor starts powering-up after reaching the power-up threshold voltage  $V_{POR}$  specified in Table 2. After reaching this threshold voltage the sensor needs the time  $t_{PU}$  to enter idle state. Once the idle state is entered it is ready to receive commands from the master (microcontroller).

Each transmission sequence begins with a START condition (S) and ends with a STOP condition (P) as described in the I2C-bus specification. The stop condition is optional. Whenever the sensor is powered up, but not performing a measurement or communicating, it automatically enters idle state for energy saving. This idle state cannot be controlled by the user.

### 4.2 Starting a Measurement

A measurement communication sequence consists of a START condition, the I2C write header (7-bit I2C device address plus 0 as the write bit) and a 16-bit measurement command. The proper reception of each byte is indicated by the sensor. It pulls the SDA pin low (ACK bit) after the falling edge of the 8th SCL clock to indicate the reception. A complete measurement cycle is depicted in Table 7.

With the acknowledgement of the measurement command, the GXTS02L starts measuring the temperature.

## 4.3 Measurement Commands for Single Shot Data Acquisition Mode

In this mode one issued measurement command triggers the acquisition of a 16 bit temperature value. During transmission that value is always followed by a CRC checksum, see section 4.4.

In single shot mode different measurement commands can be selected. The 16 bit commands are shown in Table 7. They differ with respect to repeatability (low, medium and high) and clock stretching (enabled or disabled).

The repeatability setting influences the measurement duration and thus the overall power consumption of the sensor. This is explained in section 2.2.

### 4.4 Readout of Measurement Results for Single Shot Mode

After the sensor has completed the measurement, the master can read the measurement result by sending a START condition followed by an I2C read header. The sensor will acknowledge the reception of the read header and send one bytes of data (temperature) followed by one byte CRC checksum. Each byte must be acknowledged by the microcontroller with an ACK condition for the sensor to continue sending data. If the sensor does not receive an ACK from the master after any byte of data, it will not continue sending data.

After receiving the checksum for the temperature value a NACK and stop command should be send by the master (see Table 7).

The I2C master can abort the read transfer with a NACK condition after any data byte if it is not interested in the CRC.

In case the user needs the temperature data but does not want to process CRC data, it is recommended to read the two temperature bytes, then the read transfer can be aborted with a with a NACK.

#### No Clock Stretching

When a command without clock stretching has been issued, the sensor responds to a read header with a not acknowledge (NACK), if no data is present.


### **Clock Stretching**

When a command with clock stretching has been issued, the sensor responds to a read header with an ACK and subsequently pulls down the SCL line. The SCL line is pulled down until the measurement is complete. As soon as the measurement is complete, the sensor releases the SCL line and sends the measurement results.



Condit	Hex. code		
Repeatability	Clock stretching	MSB	LSB
High	enabled	0x2C	06
Medium			0D
Low			10
High	disabled		00
Medium		0x24	0B
Low			16

## e.g. 0x2C06: high repeatability measurement with clock stretching enabled

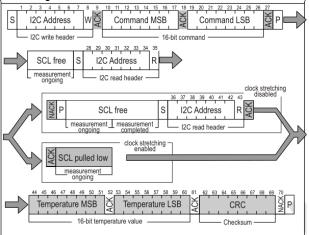

**Table 7** Measurement commands in single shot mode (Clear blocks are controlled by the microcontroller, grey blocks by the sensor)

# 4.5 Measurement Commands for Periodic Data Acquisition Mode

In this mode one issued measurement command yields a stream of 16 bit temperature values.

In periodic mode different measurement commands can be selected. The corresponding 16 bit commands are shown in Table 8. They differ with respect to repeatability (low, medium and high) and data acquisition frequency (0.5, 1, 2, 4 & 10 measurements per second, mps). Clock stretching cannot be selected in this mode.

The data acquisition frequency and the repeatability setting influences the measurement duration and the current consumption of the sensor. This is explained in section 2.2 of this datasheet.


If a measurement command shall be issued, while the sensor is busy with a measurement (measurement durations see Table 3), it is recommended to issue a break command first (see section 4.7). Upon reception of the break command the sensor will finish the ongoing measurement and enter the single shot mode.

Condition	Hex. c	ode			
Repeatability	mps	MSB	LSB		
High			32		
Medium	0.5	0x20	24		
Low			2F		
High			30		
Medium	1	0x21	26		
Low			2D		
High			36		
Medium	2	0x22	20		
Low			2B		
High			34		
Medium	4	0x23	22		
Low			29		
High			37		
Medium	10	0x27	21		
Low			2A		
e.g. 0x2130: 1 high repeatability mps - measurement per					
second					
1 2 3 4 5 6 7 8 9 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18     S   12C Address   W   Command MSB   Command LSB					

**Table 8** Measurement commands for periodic data acquisition mode (Clear blocks are controlled by the microcontroller, grey blocks by the sensor). N.B.: At the highest mps setting self-heating of the sensor might occur.

### 4.6 Readout of Measurement Results for Periodic Mode


Transmission of the measurement data can be initiated through the fetch data command shown in Table 9. If no measurement data is present the I2C read header is responded with a NACK (Bit 9 in Table 9) and the communication stops. The fetch data command will deliver the same data until a new measurement updates the temperature value.

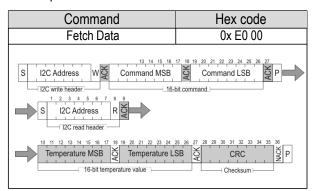

**Table 9** Fetch Data command (Clear blocks are controlled by the microcontroller, grey blocks by the sensor)

# 4.7 Break command / Stop Periodic Data Acquisition Mode

he periodic data acquisition mode can be stopped using the break command shown in Table 10. It is recommended to stop the periodic data acquisition prior to sending another command (except Fetch Data command) using the break command. Upon reception of the break command the sensor enters the single shot mode, after finishing the ongoing measurement. This can take up to 15 ms, depending on the selected repeatability.



**Table 10** Break command (Clear blocks are controlled by the microcontroller, grey blocks by the sensor).

#### 4.8 Reset

A system reset of the GXTS02L can be generated externally by issuing a command (soft reset) or by sending a pulse to the dedicated reset pin (nReset pin). Additionally, a system reset is generated internally during power-u. During the reset procedure the sensor will not process commands.

In order to achieve a full reset of the sensor without removing the power supply, it is recommended to use the nRESET pin of the GXTS02L.

#### Interface Reset

If communication with the device is lost, the following signal sequence will reset the serial interface: While leaving SDA high, toggle SCL nine or more times. This must be followed by a Transmission Start sequence preceding the next command. This sequence resets the interface only. The status register preserves its content.

### Soft Reset / Re-Initialization

The GXTS02L provides a soft reset mechanism that forces the system into a well-defined state without removing the power supply. When the system is in idle state the soft reset command can be sent to the GXTS02L. This triggers the sensor to reset its system controller and reloads calibration data from the memory. In order to start the soft reset procedure the command as shown in Table 11 should be sent.

It is worth noting that the sensor reloads calibration data prior to every measurement by default.



Command	Hex Code	
Soft Reset	0x30A2	
1 2 3 4 5 6 7 8 9 1 2 3 4 5   S   I2C Address   WO   Command   C	MSB Z Command LSB Z P	

**Table 11** Soft reset command (Clear blocks are controlled by the microcontroller, grey blocks by the sensor)

### Reset through General Call

Additionally, a reset of the sensor can also be generated using the "general call" mode according to I2C-bus specification. This generates a reset which is functionally identical to using the nReset pin. It is important to understand that a reset generated in this way is not device specific. All devices on the same I2C bus that support the general call mode will perform a reset. Additionally, this command only works when the sensor is able to process I2C commands. The appropriate command consists of two bytes and is shown in Table 12.

Command	Code
Address byte	0x00
Second byte	0x06
Reset command using the general call address	0x0006
S General Call 1st byte	9 1 2 3 4 5 6 7 8 9  Reset Command  General Call 2 <sup>nd</sup> byte

**Table 12** Reset through the general call address (Clear blocks are controlled by the microcontroller, grey blocks by the sensor).

### Reset through the nReset Pin


Pulling the nReset pin low (see Table 5) generates a reset similar to a hard reset. The nReset pin is internally connected to VDD through a pull-up resistor and hence active low. The nReset pin has to be pulled low for a minimum of 350 ns to generate a reset of the sensor.

#### **Hard Reset**

A hard reset is achieved by switching the supply voltage to the VDD Pin off and then on again. In order to prevent powering the sensor over the ESD diodes, the voltage to pins 1 (SDA), 4 (SCL) and 2 (ADDR) also needs to be removed.


### 4.10 Status Register

The status register contains information on the operational status of the heater, the alert mode and on the execution status of the last command and the last write sequence. The command to read out the status register is shown in Table 14 whereas a description of the content can be found in Table 16.

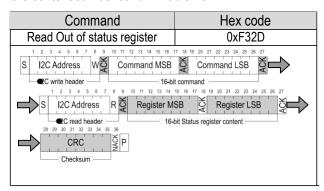

### **Clear Status Register**

All flags (Bit 15, 10, 4) in the status register can be cleared (set to zero) by sending the command shown in Table 15.



**Table 15** Command to clear the status register (Clear blocks are controlled by the microcontroller, grey blocks by the sensor)



Bit	Field description	Default
		value
15	Alert pending status	'1'
	'0': no pending alerts	
	'1': at least one pending alert	
14	Reserved	'0'
13	Heater status	,0,
	'0' : Heater OFF	
	'1' : Heater ON	
12:11	Reserved	'00'
10	T tracking alert	,0,
	'0' : no alert	
0.5	'1' . alert	,
9:5	Reserved	'XXXXX'
4	System reset detected	'1'
	'0': no reset detected since last	
	'clear status register' command	
	'1': reset detected (hard reset, soft	
	reset command or supply fail)	
3:2	Reserved	'00'
1	Command status	'0'
	'0': last command executed	
	successfully	
	'1': last command not processed. It	
	was either invalid, failed the integrated	
	command checksum	
0	Write data checksum status	,0,
	'0': checksum of last write transfer was	
	correct	
	'1': checksum of last write transfer	
	failed	

Table 16 Description of the status register.

### 4.11 Checksum Calculation

The 8-bit CRC checksum transmitted after each data word is generated by a CRC algorithm. Its properties are displayed in Table 17. The CRC covers the contents of the two previously transmitted data bytes. To calculate the checksum only these two previously transmitted data bytes are used.

Property	Value
Name	CRC-8
Width	8 bit
Protected data	read and/or write data
Polynomial	$0x31(x^8 + x^5 + x^4 + 1)$
Initialization	0xFF
Reflect input	False
Reflect output	False
Final XOR	0x00
Examples	CRC (0xBEEF) = 0x92

Table 17 I2C CRC properties.

### 4.12 Conversion of Signal Output

Measurement data is always transferred as 16-bit values (unsigned integer). These values are already linearized and compensated for supply voltage effects. Converting those raw values into a physical scale can be achieved using the following formulas.

Temperature conversion formula (result in °C & °F):

$$T [^{\circ}C] = -45 + 175 \cdot \frac{S_{\tau}}{2^{16} - 1}$$
  
 $T [^{\circ}F] = -49 + 315 \cdot \frac{S_{\tau}}{2^{16} - 1}$ 


 $S_{\text{T}}$  denotes the raw sensor output for temperature. The formulas work only correctly when  $S_{\text{T}}$  is used in decimal representation.



### 4.13 Communication Timing

Parameter	Symbol	Conditions	Min.	Тур.	Max.	Units	Comments
SCL clock frequency	fscL		0	-	1000	kHz	
Hold time (repeated) START condition	thd;sta	After this period, the first clock pulse is generated	0.24	-	-	μs	
LOW period of the SCL clock	tLow		0.65	-	-	μs	
HIGH period of the SCL clock	<b>t</b> HIGH		0.26	-	-	μs	
SDA hold time	t <sub>HD;DAT</sub>		60	-	250	ns	Transmitting data
SDA Hold time			0	-		ns	Receiving data
SDA set-up time	tsu;dat		100	-	-	ns	
SCL/SDA rise time	t <sub>R</sub>		-	-	300	ns	
SCL/SDA fall time	t <sub>F</sub>		-	-	300	ns	
SDA valid time	tvd;dat		-	-	0.9	μs	
Set-up time for a repeated START condition	t <sub>SU;STA</sub>		0.6	-	-	μs	
Set-up time for STOP condition	tsu;sto		0.6	-	-	μs	
Capacitive load on bus line	СВ		-	-	400	pF	
Low level input voltage	VIL		-0.5	-	0.3xV <sub>DI</sub>	V	
High level input voltage	VIH		0.7xV <sub>DD</sub>	-	1xV <sub>DD</sub>	V	
Low level output voltage	Vol	3 mA sink current	-	-	0.66	V	

**Table 18** Communication timing specifications for I2C fm (fast mode), Specification are at 25°C and typical VDD. The numbers above are values according to the I2C Specification (UM10204, Rev. 6, April 4, 2014).

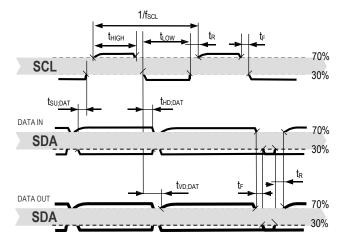

**Figure 5** Timing diagram for digital input/output pads. SDA directions are seen from the sensor. Bold SDA lines are controlled by the sensor, plain SDA lines are controlled by the micro-controller. Note that SDA valid read time is triggered by falling edge of preceding toggle.




### 5 Packaging

### 5.1 Package Outline

**WLCSP** 

Dimensions: um

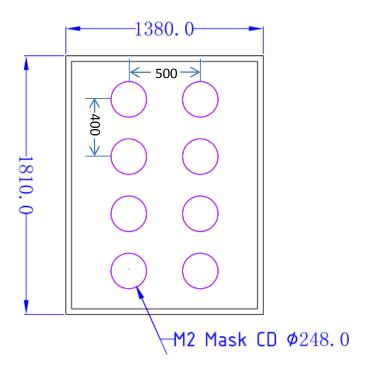



### History

REVISION DATE	VERSION	DESCRIPTION
2020/08/01	First Version	release