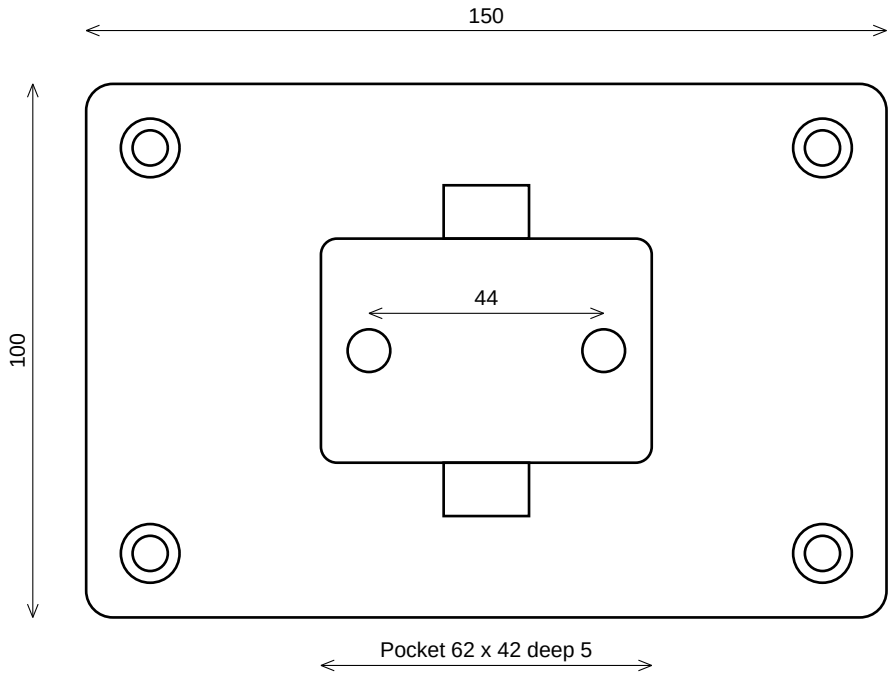

NOTES

1. 2x dowel pin D8 h6, pressed, 12 above pocket floor.
2. 4x M6 counterbore D11 x 6.5 deep, thru D6.6.
3. Plate thickness 20. Break all edges 1 x 45 deg.
4. Finger slots 16 wide both sides of pocket.
5. Nest fits bracket BRK-100 (60 x 40) with 1 mm clearance per side.

FX-201 Locating Fixture

CAD model: CAD/FX-201_Locating_Fixture.step
Material: Aluminium 6061-T6 / dowels steel h6
Used on: BRK-100 Motor Bracket Assembly
All dimensions in mm. General tolerance ISO 2768-m

Drawing: DRW-FX-201
Rev: C Scale: 1:1.4

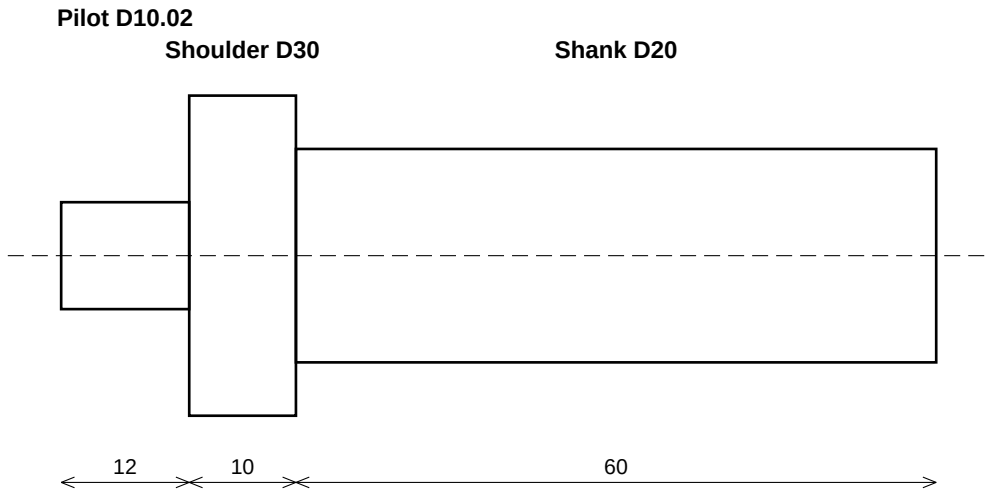

NOTES

1. Pilot D10.02 +/-0.01 - check weekly, replace below D10.01 (NCR-0042).
2. Chamfer pilot 1 x 45 deg, shank 1.5 x 45 deg.
3. 2 flats on shank, 2 deep x 25 long.
4. Use with arbor press AP-501. Max force 4 kN.

PT-301 Bushing Press Punch

CAD model: CAD/PT-301_Bushing_Press_Punch.step
Material: Tool steel 1.2379, 58-62 HRC
Used on: BRK-100 Motor Bracket Assembly
All dimensions in mm. General tolerance ISO 2768-m

Drawing: DRW-PT-301
Rev: C Scale: 1.4:1

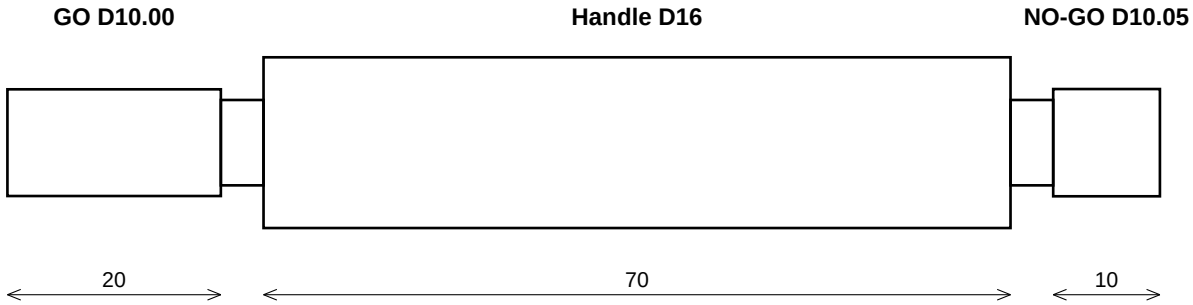

NOTES

1. GO D10.000 +0.002/-0, NO-GO D10.050 +0/-0.002.
2. Identification groove 2 wide x 0.8 deep next to the NO-GO end.
3. Checks the BU-12 bushing bore D10.00 +0.05 after pressing (step 40).
4. Calibration every 12 months - see Tooling Register.

GA-401 Go/No-Go Pin Gauge

CAD model: CAD/GA-401_Go_No-Go_Pin_Gauge.step
Material: Gauge steel, hardened
Used on: BRK-100 Motor Bracket Assembly
All dimensions in mm. General tolerance ISO 2768-m

Drawing: DRW-GA-401
Rev: C Scale: 1.4:1