



ISE 430/530: Manufacturing Systems and Facilities Design

Dr. Cheng (Erick) Chen
Industrial & Systems and Engineering Management
Department

Cheng.chen@uah.edu

GROWTH MINDSET

SUCCESS BEGINS WITH BELIEVING YOU CAN



How did you get good at this activity? If someone wanted to get good at this, what advice would you give them?

Updates:

For the final project, all students will have flexibility in how they present their work. You may choose to:

- Present your project **in class**
- Create a **podcast** (Must have visual)
- Create a **YouTube-style video**

The goal is to give you different ways to communicate your work clearly and professionally. You are also encouraged to share your final project on **LinkedIn** as part of your professional portfolio.

Facilities Planning Process

- Define products to be manufactured and/or assembled
- Specify required manufacturing and/or assembly processes and related activities
- Determine interrelationships among all activities
- Generate alternative facilities plans
- Evaluate the alternative facilities plans
- Select the preferred facilities plan
- Implement the facilities plan
- Maintain and adapt the facilities plan
- Update products to be manufactured and/or assembled and redefine the objective of the facility

Overview

Route sheet, assembly chart, operations process chart, precedence diagram

Determining the Production Requirements

- How many pieces are needed as inputs and outputs to each process, consider rework (if appropriate)
- Reject allowance (small volume)
- Number of required machines
- Machine assignment

Reject Allowance Problem

1. When producing small batches, the use of average values is less appropriate
2. Concerns
 - Cost, revenues, and probabilities associated with making good and bad products
3. Objective
 - Determine the number of additional units to allow when scheduling low-volume production where rejects occur randomly
4. For instance, consider a foundry that produces small numbers of custom-designed castings.
5. If the foundry has only one chance to produce the number of castings required, then the probability of a casting being good should be considered when determining the batch size to be produced.

Reject Allowance Problem

Determining the number of additional units to allow when scheduling low-volume production where rejects randomly occur is called the reject allowance problem.

x = the number of good units produced

$p(x)$ = probability of producing x good units

Q = quantity of units to produce

$C(Q, x)$ = cost of producing Q units, of which x are good units

$R(Q, x)$ = revenue from producing Q units, of which x are good units

$P(Q, x)$ = profit from producing Q units, of which x are good units

$$= R(Q, x) - C(Q, x)$$

$E[P(Q)]$ = expected profit from producing Q units

$$= \sum_{x=0}^Q P(Q, x) p(x)$$

The expected profit from producing Q units can be determined as follows:

$$E[P(Q)] = \sum_{x=0}^Q \{R(Q, x) - C(Q, x)\} p(x) \quad (2.4)$$

Reject Allowance Problem – Example:

An order for 20 custom-designed castings has been received. Each casting costs \$1100 to produce and has a recycle value of \$200 if unsold. The customer will pay \$2500 per casting for exactly 20 castings —no more, no less!. Based on historical data, Table 2.6 provides the probability distributions.

1. How many castings should be produced to maximize expected profit?

2. What is the probability of losing money at this production level?

Table 2.6 *Probability Distributions for the Number of Good Castings (x) out of Q*

# Good Castings (x)	Number of Castings Produced (Q)										
	20	21	22	23	24	25	26	27	28	29	30
12	0.05	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
13	0.05	0.05	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
14	0.05	0.05	0.05	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
15	0.05	0.05	0.05	0.05	0.00	0.00	0.00	0.00	0.00	0.00	0.00
16	0.10	0.05	0.05	0.05	0.05	0.00	0.00	0.00	0.00	0.00	0.00
17	0.10	0.10	0.05	0.05	0.05	0.05	0.00	0.00	0.00	0.00	0.00
18	0.15	0.10	0.10	0.05	0.05	0.05	0.05	0.00	0.00	0.00	0.00
19	0.20	0.15	0.10	0.10	0.05	0.05	0.05	0.05	0.00	0.00	0.00
20	0.25	0.20	0.15	0.10	0.10	0.05	0.05	0.05	0.05	0.00	0.00
21	0.00	0.25	0.20	0.15	0.10	0.10	0.05	0.05	0.05	0.05	0.00
22	0.00	0.00	0.25	0.20	0.15	0.10	0.10	0.05	0.05	0.05	0.05
23	0.00	0.00	0.00	0.25	0.20	0.15	0.10	0.10	0.05	0.05	0.05
24	0.00	0.00	0.00	0.00	0.25	0.20	0.15	0.10	0.10	0.05	0.05
25	0.00	0.00	0.00	0.00	0.00	0.25	0.20	0.15	0.10	0.10	0.05
26	0.00	0.00	0.00	0.00	0.00	0.00	0.25	0.20	0.15	0.10	0.10
27	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.25	0.20	0.15	0.10
28	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.25	0.20	0.15
29	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.25	0.20
30	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.25

Reject Allowance Problem – Example:

The revenue and cost functions can be given as follows:

$$R(Q, X) = \begin{cases} 200Q & x < 20 \\ 2500(20) + 200(Q - 20) & 20 \leq x \leq Q \end{cases}$$

$$C(Q, x) = 1,100Q \quad 0 \leq x \leq Q$$

$$P(Q, x) = \begin{cases} -900Q & x < 20 \\ 46,000 - 900Q & 20 \leq x \leq Q \end{cases}$$

Therefore, the expected profit can be given as follows:

$$E[P(Q)] = -\sum_{x=0}^{19} 900Qp(x) + \sum_{x=20}^Q (46,000 - 900Q)p(x)$$

The expected profit expression can be shown to reduce to

$$E[P(Q)] = -900Q + 46,000 \sum_{x=20}^Q p(x)$$

Plug in the numbers in Table 2.6

Table 2.7 *Profit from Producing Q Castings, with Exactly x Being Good*

# of Good Castings	Number of Castings Produced (Q)										
	20	21	22	23	24	25	26	27	28	29	30
12	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
13	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
14	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
15	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
16	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
17	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
18	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
19	-18,000	-18,900	-19,800	-20,700	-21,600	-22,500	-23,400	-24,300	-25,200	-26,100	-27,000
20	28,000	27,100	26,200	25,300	24,400	23,500	22,600	21,700	20,800	19,900	19,000
21		27,100	26,200	25,300	24,400	23,500	22,600	21,700	20,800	19,900	19,000
22			26,200	25,300	24,400	23,500	22,600	21,700	20,800	19,900	19,000
23				25,300	24,400	23,500	22,600	21,700	20,800	19,900	19,000
24					24,400	23,500	22,600	21,700	20,800	19,900	19,000
25						23,500	22,600	21,700	20,800	19,900	19,000
26							22,600	21,700	20,800	19,900	19,000
27								21,700	20,800	19,900	19,000
28									20,800	19,900	19,000
29										19,900	19,000
30											19,000

Table 2.8 *Expected Profit from Producing Q Castings*

Number of Castings Produced (Q)										
20	21	22	23	24	25	26	27	28	29	30
-6,500	1,800	7,800	11,500	15,200	16,600	18,000	19,400	20,800	19,900	19,000

MAXIMUM

Number of Required Machines

Man & machine balancing

Machine (equipment) fraction

- Number of machines of one type required to produce the required volume of products
 - Some machines used for multiple operations
 - Some machines may not be able to perform the required operations fast enough
- Calculation based upon ALL operations the machine will perform

Number of Required Machines

The machine fraction for an operation is determined by dividing the total time required to perform the operation by the time available to complete the operation. The total time required to perform an operation is the product of the standard time for the operation and the number of times the operation is to be performed.

1. Are the parts actually being made to the 0.5 hour per part standard time?
2. Is the machine available when needed during the two-hour period?
3. Are the standard time, the number of parts, and the time the machine takes known with certainty and fixed over time?

$$F = \frac{SQ}{EHR}$$

Diagram illustrating the formula for Machine Fraction (F):

- S : Standard time per unit
- Q : Number of units
- E : Machine Fraction
- H : Reliability of machine, expressed as percent uptime
- R : Time available per machine

Number of Required Machines - Example

See Eq. 2.5 and Example 2.5

- Standard machining time of 2.8 minutes per part, 200 units needed in 8-hour shift, milling machine will be operating 80% of time. During operational time, parts are produced at 95% rate

$$F = \frac{SQ}{EHR} = \frac{2.8\text{min} * 200}{0.8 * 480\text{min} * 0.95} = 1.54 \text{ machines needed}$$

Number of Required Machines

Combine requires for identical machine types

Table 2.9 *Total Equipment Requirement Specification Example*

Operation Number	Equipment Fraction	Next Highest Whole Number
109	1.1	2
206	2.3	3
274	0.6	1

It may be seen that a minimum of four and a maximum of six machines are required.

With no further information, a specific recommendation on the number of required machines cannot be made.

How many machines are needed?

Unclear, need more information

Job Shop/Production Line

Cost, Set-ups, Inventory, etc.

Future growth

Overview

Determining the Production Requirements


- How many pieces are needed as inputs and outputs to each process, consider rework (if appropriate)
- Reject allowance (small volume)
- Number of required machines
- Machine assignment

Machine Assignment Problems

Considers the assignment of machines (semi-automated) to operators

Human-machine chart (aka. multiple activity chart)

- Relationship of multiple activities and machines (non-identical) with the operators

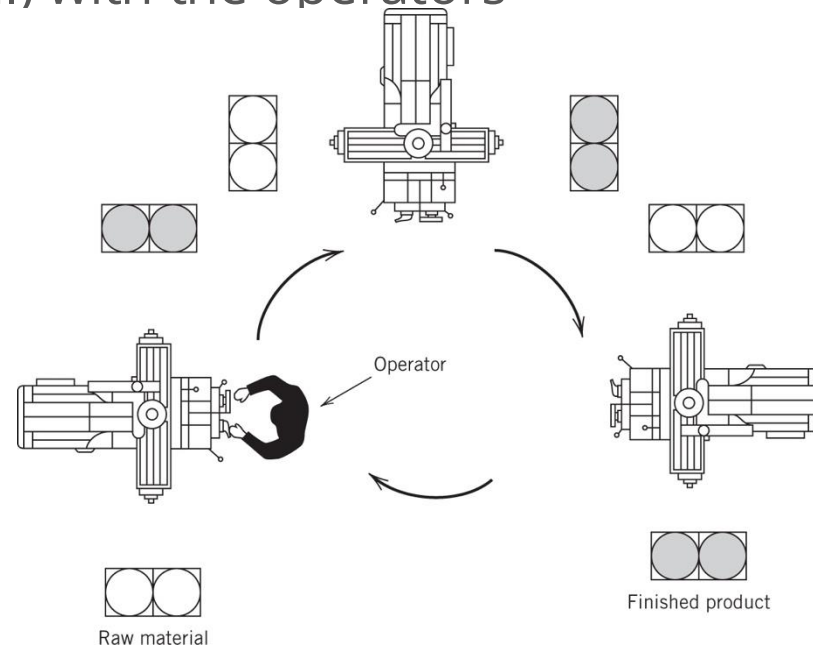

Time	Operator	Machine 1	Machine 2	Machine 3			
0	L-1	Loaded	Idle	Idle	↑ Transient State (12 min)		
1	T-2	Machining	Idle				
2	L-2		Loaded				
3	T-3		Machining			Loaded	
4	L-3						
5	T-1						
6	Idle		Machining	Machining			
7	UL-1	Unloaded					
8	L-1	Loaded					
9	I&P-1	Idle					
10	T-2	Machining			Idle		
11	UL-2					Unloaded	
12	L-2		Loaded				
13	I&P-2		Machining	Unloaded			
14	T-3						
15	UL-3						
16	L-3	Machining	Loaded				
17	I&P-3			Idle			
18	T-1						
19	UL-1				Unloaded		
20	L-1				Loaded		
21	I&P-1				Machining	Idle	
22	T-2	Unloaded					
23	UL-2	Loaded					
24	L-2	Machining	Machining				
25	I&P-1			Idle			
26	T-2			Machining			Unloaded
27	UL-2				Loaded		
28	L-2				Machining	Machining	
29	I&P-1						
30	T-2	Machining	Unloaded				
31	UL-2						
32	L-2			Machining			Machining
33	I&P-1						
34	T-2				Machining	Unloaded	
35	UL-2						
36	L-2	Machining	Machining				
37	I&P-1						
38	T-2			Machining			Unloaded
39	UL-2						
40	L-2				Machining	Machining	
41	I&P-1						
42	T-2	Machining	Unloaded				
43	UL-2						
44	L-2			Machining			Machining
45	I&P-1						
46	T-2				Machining	Unloaded	
47	UL-2						
48	L-2	Machining	Machining				
49	I&P-1						
50	T-2			Machining			Unloaded
51	UL-2						
52	L-2				Machining	Machining	
53	I&P-1						
54	T-2	Machining	Unloaded				
55	UL-2						
56	L-2			Machining			Machining
57	I&P-1						
58	T-2				Machining	Unloaded	
59	UL-2						
60	L-2	Machining	Machining				
61	I&P-1						
62	T-2			Machining			Unloaded
63	UL-2						
64	L-2				Machining	Machining	
65	I&P-1						
66	T-2	Machining	Unloaded				
67	UL-2						
68	L-2			Machining			Machining
69	I&P-1						
70	T-2				Machining	Unloaded	
71	UL-2						
72	L-2	Machining	Machining				
73	I&P-1						
74	T-2			Machining			Unloaded
75	UL-2						
76	L-2				Machining	Machining	
77	I&P-1						
78	T-2	Machining	Unloaded				
79	UL-2						
80	L-2			Machining			Machining
81	I&P-1						
82	T-2				Machining	Unloaded	
83	UL-2						
84	L-2	Machining	Machining				
85	I&P-1						
86	T-2			Machining			Unloaded
87	UL-2						
88	L-2				Machining	Machining	
89	I&P-1						
90	T-2	Machining	Unloaded				
91	UL-2						
92	L-2			Machining			Machining
93	I&P-1						
94	T-2				Machining	Unloaded	
95	UL-2						
96	L-2	Machining	Machining				
97	I&P-1						
98	T-2			Machining			Unloaded
99	UL-2						
100	L-2				Machining	Machining	
101	I&P-1						
102	T-2	Machining	Unloaded				
103	UL-2						
104	L-2			Machining			Machining
105	I&P-1						
106	T-2				Machining	Unloaded	
107	UL-2						
108	L-2	Machining	Machining				
109	I&P-1						
110	T-2			Machining			Unloaded
111	UL-2						
112	L-2				Machining	Machining	
113	I&P-1						
114	T-2	Machining	Unloaded				
115	UL-2						
116	L-2			Machining			Machining
117	I&P-1						
118	T-2				Machining	Unloaded	
119	UL-2						
120	L-2	Machining	Machining				
121	I&P-1						
122	T-2			Machining			Unloaded
123	UL-2						
124	L-2				Machining	Machining	
125	I&P-1						
126	T-2	Machining	Unloaded				
127	UL-2						
128	L-2			Machining			Machining
129	I&P-1						
130	T-2				Machining	Unloaded	
131	UL-2						
132	L-2	Machining	Machining				
133	I&P-1						
134	T-2			Machining			Unloaded
135	UL-2						
136	L-2				Machining	Machining	
137	I&P-1						
138	T-2	Machining	Unloaded				
139	UL-2						
140	L-2			Machining			Machining
141	I&P-1						
142	T-2				Machining	Unloaded	
143	UL-2						
144	L-2	Machining	Machining				
145	I&P-1						
146	T-2			Machining			Unloaded
147	UL-2						
148	L-2				Machining	Machining	
149	I&P-1						
150	T-2	Machining	Unloaded				
151	UL-2						
152	L-2			Machining			Machining
153	I&P-1						
154	T-2				Machining	Unloaded	
155	UL-2						
156	L-2	Machining	Machining				
157	I&P-1						
158	T-2			Machining			Unloaded
159	UL-2						
160	L-2				Machining	Machining	
161	I&P-1						
162	T-2	Machining	Unloaded				
163	UL-2						
164	L-2			Machining			Machining
165	I&P-1						
166	T-2				Machining	Unloaded	
167	UL-2						
168	L-2	Machining	Machining				
169	I&P-1						
170	T-2			Machining			Unloaded
171	UL-2						
172	L-2				Machining	Machining	
173	I&P-1						
174	T-2	Machining	Unloaded				
175	UL-2						
176	L-2			Machining			Machining
177	I&P-1						
178	T-2				Machining	Unloaded	
179	UL-2						
180	L-2	Machining	Machining				
181	I&P-1						
182	T-2			Machining			Unloaded
183	UL-2						
184	L-2				Machining	Machining	
185	I&P-1						
186	T-2	Machining	Unloaded				
187	UL-2						
188	L-2			Machining			Machining
189	I&P-1						
190	T-2				Machining	Unloaded	
191	UL-2						
192	L-2	Machining	Machining				
193	I&P-1						
194	T-2			Machining			Unloaded
195	UL-2						
196	L-2				Machining	Machining	
197	I&P-1						
198	T-2	Machining	Unloaded				
199	UL-2						
200	L-2			Machining			Machining
201	I&P-1						
202	T-2				Machining	Unloaded	
203	UL-2						
204	L-2	Machining	Machining				
205	I&P-1						
206	T-2			Machining			Unloaded
207	UL-2						
208	L-2				Machining	Machining	
209	I&P-1						
210	T-2	Machining	Unloaded				
211	UL-2						
212	L-2			Machining			Machining
213	I&P-1						
214	T-2				Machining	Unloaded	
215	UL-2						
216	L-2	Machining	Machining				
217	I&P-1						
218	T-2			Machining			Unloaded
219	UL-2						
220	L-2				Machining	Machining	
221	I&P-1						
222	T-2	Machining	Unloaded				
223	UL-2						
224	L-2			Machining			Machining
225	I&P-1						
226	T-2				Machining	Unloaded	
227	UL-2						
228	L-2	Machining	Machining				
229	I&P-1						
230	T-2			Machining			Unloaded
231	UL-2						
232	L-2				Machining	Machining	
233	I&P-1						
234	T-2	Machining	Unloaded				
235	UL-2						
236	L-2			Machining			Machining
237	I&P-1						
238	T-2				Machining	Unloaded	
239	UL-2						
240	L-2	Machining	Machining				
241	I&P-1						
242	T-2			Machining			Unloaded
243	UL-2						
244	L-2				Machining	Machining	
245	I&P-1						
246	T-2	Machining	Unloaded				
247	UL-2						
248	L-2			Machining			Machining
249	I&P-1						
250	T-2				Machining	Unloaded	
251	UL-2						
252	L-2	Machining	Machining				
253	I&P-1						
254	T-2			Machining			Unloaded
255	UL-2						
256	L-2				Machining	Machining	
257	I&P-1						
258	T-2	Machining	Unloaded				
259	UL-2						
260	L-2			Machining			Machining
261	I&P-1						
262	T-2				Machining	Unloaded	
263	UL-2						
264	L-2	Machining	Machining				
265	I&P-1						
266	T-2			Machining			Unloaded
267	UL-2						
268	L-2				Machining	Machining	
269	I&P-1						
270	T-2	Machining	Unloaded				
271	UL-2						
272	L-2			Machining			Machining
273	I&P-1						
274	T-2				Machining	Unloaded	
275	UL-2						
276	L-2	Machining	Machining				
277	I&P-1						
278	T-2			Machining			Unloaded
279	UL-2						
280	L-2				Machining	Machining	
281	I&P-1						
282	T-2	Machining	Unloaded				
283	UL-2						
284	L-2			Machining			Machining
285	I&P-1						
286	T-2				Machining	Unloaded	
287	UL-2						
288	L-2	Machining	Machining				
289	I&P-1						
290	T-2			Machining			Unloaded
291	UL-2						
292	L-2				Machining	Machining	
293	I&P-1						
294	T-2	Machining	Unloaded				
295	UL-2						
296	L-2			Machining			Machining
297	I&P-1						
298	T-2				Machining	Unloaded	
299	UL-2						
300	L-2	Machining	Machining				
301	I&P-1						
302	T-2			Machining			Unloaded
303	UL-2						
304	L-2				Machining	Machining	
305	I&P-1						
306	T-2	Machining	Unloaded				
307	UL-2						
308	L-2			Machining			Machining
309	I&P-1						
310	T-2				Machining	Unloaded	
311	UL-2						
312	L-2	Machining	Machining				
313	I&P-1						
314	T-2			Machining			Unloaded
315	UL-2						
316	L-2				Machining	Machining	
317	I&P-1						
318	T-2	Machining	Unloaded				
319	UL-2						
320	L-2			Machining			Machining
321	I&P-1						
322	T-2				Machining	Unloaded	
323	UL-2						
324	L-2	Machining	Machining				
325	I&P-1						
326	T-2			Machining			Unloaded
327	UL-2						
328	L-2				Machining	Machining	
329	I&P-1						
330	T-2	Machining	Unloaded				
331	UL-2						
332	L-2			Machining			Machining
333	I&P-1						
334	T-2				Machining	Unloaded	
335	UL-2						
336	L-2	Machining	Machining				
337	I&P-1						
338	T-2			Machining			Unloaded
339	UL-2						
340	L-2				Machining	Machining	
341	I&P-1						
342	T-2	Machining	Unloaded				
343	UL-2						
344	L-2			Machining			Machining
345	I&P-1						
346	T-2				Machining	Unloaded	
347	UL-2						
348	L-2	Machining	Machining				
349	I&P-1						
350	T-2			Machining			Unloaded
351	UL-2						
352	L-2				Machining	Machining	
353	I&P-1						
354	T-2	Machining	Unloaded				
355	UL-2						
356	L-2			Machining			Machining
357	I&P-1						
358	T-2				Machining	Unloaded	
359	UL-2						
360	L-2	Machining	Machining				
361	I&P-1						
362	T-2			Machining			Unloaded
363	UL-2						
364	L-2				Machining	Machining	
365	I&P-1						
366	T-2	Machining	Unloaded				
367	UL-2						
368	L-2			Machining			Machining
369	I&P-1						
370	T-2				Machining	Unloaded	
371							


Machine Assignment Problems

Deterministic model (Example 2.7)

For the situation illustrated in Figure 2.18, it takes 0.5 minute to travel between machines, 1 minute to load a machine, 1 minute to unload a machine, 6 minutes of automatic machine time, and 0.5 minute to inspect and pack a finished part. As shown, the analysis begins with each machine empty and the operator standing in front of Machine 1 (M-1).

The operator loads M-1, walks to M-2, loads M-2, walks to M-3, loads M-3, walks to M-1, unloads M-1, loads M-1, inspects and packs the part removed from M-1, travels to M-2, and so forth.

As shown in Figure 2.18, it takes 12 minutes for the operator and three machines to achieve a steady-state condition; thereafter, a repeating cycle of 9 minutes in duration occurs. (In other words, if nothing interrupts the activities of the operator and the three machines, the 9-minute cycle will repeat indefinitely.)

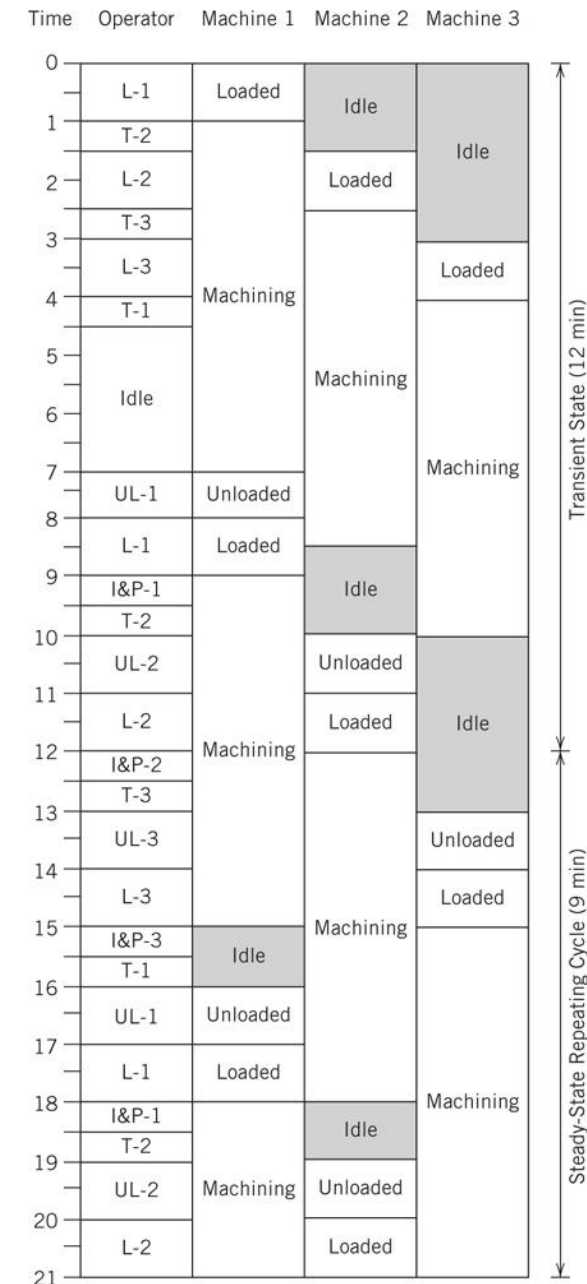

Machine Assignment Problems

a = concurrent activity time (man and machine)

b = independent operator time

t = independent machine time

n' = ideal number of identical machines to assign an operator

m = number of identical machines assigned

T_c = repeating cycle time

I_o = idle operator time during a cycle

I_m = idle time for each machine during a cycle

Excluding idle time, each machine cycle requires $a + t$ minutes to complete a cycle. Likewise, the operator devotes $a + b$ minutes to each machine during a cycle. Hence, an ideal assignment is

$$n' = (a + t)/(a + b) \quad (2.6)$$

For the example, a equals two minutes, b equals one minute, and t equals six minutes. Therefore, n' equals 2.67 machines.

2 would cause the operator idle time

3 would cause the machine to have idle time

Machine Assignment Problems

Since a fractional number of machines cannot be assigned to an operator, consider what will happen if some integer number of machines, m , is assigned. The work content for the operator will total $m(a + b)$, while a machine cycle will be $(a + t)$ in duration. The repeating cycle will be the larger of the two, and the difference in the two will be idle time. If $m > n'$, then the repeating cycle will be $m(a + b)$ in duration; if $m < n'$, then the repeating cycle will be $(a + t)$ in duration. Therefore,

$$T_c = \begin{cases} (a + b) & m \leq n' \\ m(a + b) & m > n' \end{cases} \quad (2.7)$$

$$I_m = \begin{cases} 0 & m \leq n' \\ T_c - (a + t) & m > n' \end{cases} \quad (2.8)$$

$$I_o = \begin{cases} T_c - m(a + b) & m \leq n' \\ 0 & m > n' \end{cases} \quad (2.9)$$

For the example, with $m = 3$ and $n' = 2.67$, the repeating cycle is $3(2+1)$, or nine minutes as observed in Figure 2.18. The idle time for each machine during a repeating cycle equals $9 - (2+6)$, or one minute, again as observed in Figure 2.18. As shown in Figure 2.19, the work cell must be designed carefully to provide adequate access for incoming and outgoing material, machine maintenance, and operator movement.

You want to find out how many CNC Machines to assign to each operator. Time to unload one part and load the next part is 3 minutes. During this time the machine is stopped. It takes 20 minutes to run a part. The operator must inspect each part which takes 5 minutes. The inspection is done on the work bench. It takes 0.5 minutes to travel between machines.

Calculate the total cost for 2 and for 3 machines find the lower cost (min T_c):

For $m < n'$: $T_c(m) = (C_o + mC_m)(a+t)/m$

For $m > n'$: $T_c(m) = (C_o + mC_m)(a+b)$

The cost to run the machine is \$55/hr

The cost of an employee is \$40/hr

2 machines per employee:

$m=2$

$TC = (C_o + mC_m)(a+t)/m = (40+255)*(3+20) / 2. = 1725$ • min at $m=2$

3 machines per employee


$m = 3$

$TC = (C_o + mC_m)(a+b) = (40+355)(3+5.5) = 1745.5$

The **Seven** management and planning tools


Gained acceptance as a methodology for improving planning and implementation:

- Affinity diagram
- Interrelationship digraph
- Tree diagram
- Matrix diagram
- Contingency diagram
- Activity network diagram
- Prioritization matrix

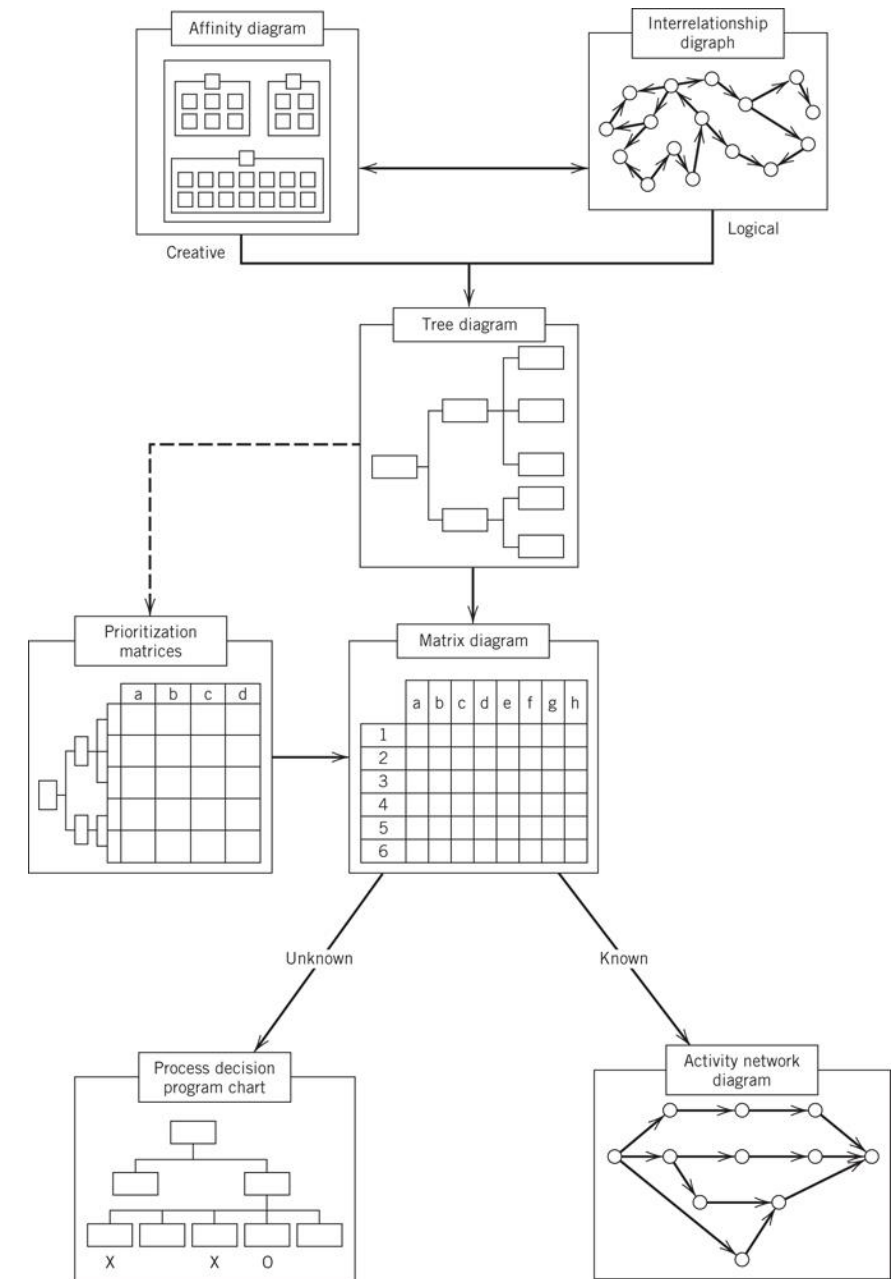

Affinity Diagram

- Verbal data for the system/process under study.
- Take discussion to reduce manufacturing lead time

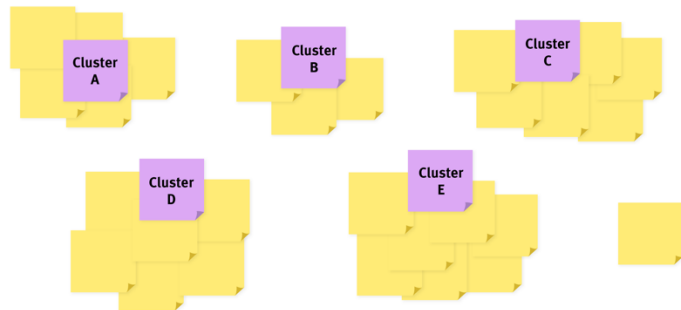


Issues in reducing manufacturing lead time

Facilities design	Equipment issues	Quality	Setup time	Scheduling
1. Form product families 2. Assign families to cells 3. Assign raw mtl's to their point of use 4. Keep receiving and shipping close to production	1. Operator certification program 2. Sit technicians closer to production 3. Monitor breakdowns to predict future occurrences 4. Recruit enough technicians per shift	1. Provide training on how to use process documentation 2. Implement successive inspection with feedback 3. Develop mistake-proof devices 4. Develop capabilities for monitoring key machine parameters	1. Provide documentation on setup procedures 2. Locate fixtures and tooling close to machines 3. Provide training so operators can participate 4. Provide information on daily sequence	1. Provide visibility to daily product sequence 2. Do not authorize products for which the needed parts are not available 3. Negotiate frequent and smaller lots to customers


Interrelationship Digraph

- Map the logical links among related items, and identify which items impact others the most.
- Take the facilities design tab in the affinity diagram for example.

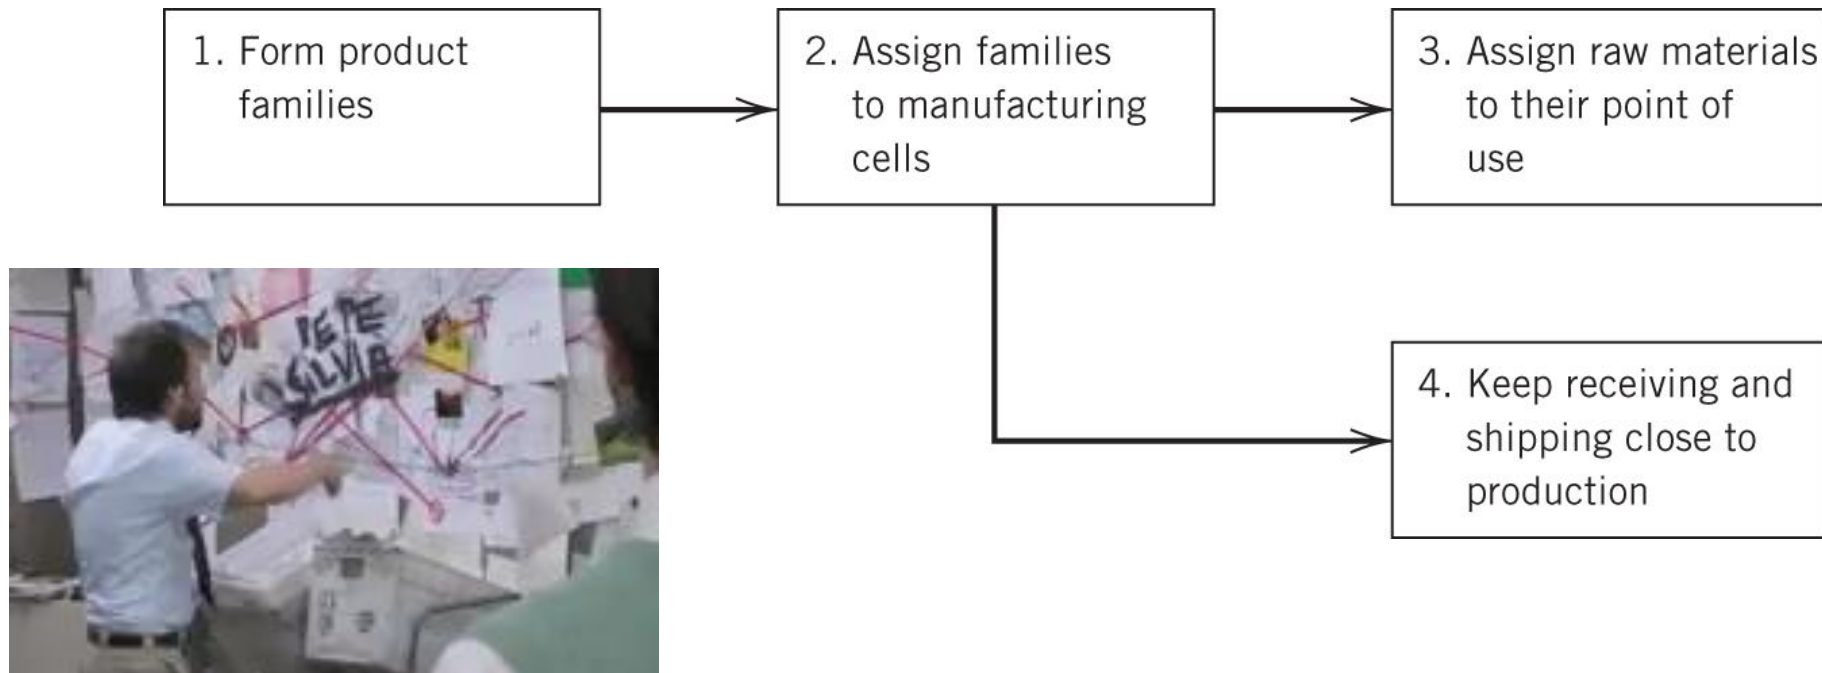

Tree Diagram

- Map in increasing detail the actions to be performed for an objective.
- For instance, to form the product family in the interrelationship diagram:

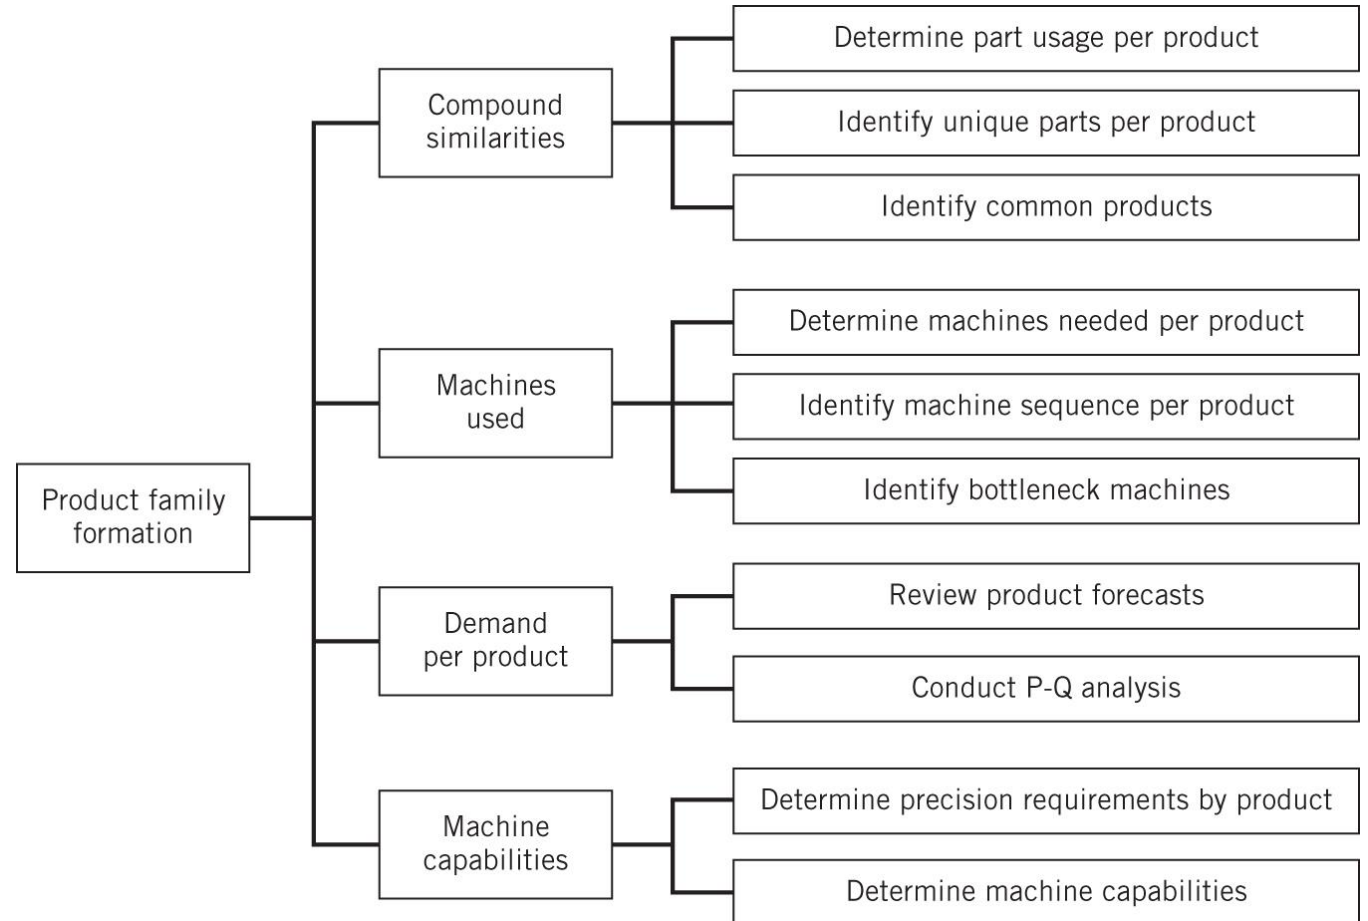

Matrix Diagram

- Organize information into sets of characteristics, functions, and tasks for comparison.
- E.g.: the table below summarizes the participants and their role within the small teams (to allocate the jobs).

Team\Participants	Joe	Mary	Jerry	Lou	Linda	Daisy	Jack
Part usage team	P	C	P	L			P
Machine use & cap team	L		C				P
Demand forecast team				P	C	L	

Note:


L: Team Leader

C: Team Coordinator

P: Team Participant

Contingency Diagram (Process Decision Program Chart)


- Map conceivable events and contingencies that might occur during implementation
- Useful when the project being planned includes unfamiliar tasks

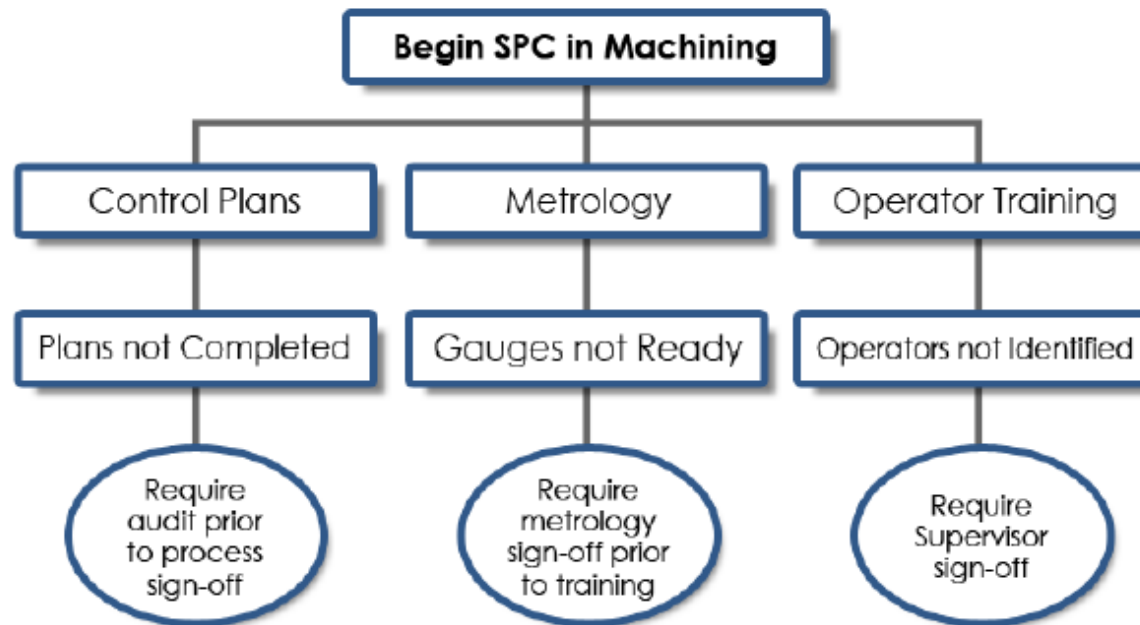

<http://www.sixsigmadaily.com/process-decision-program-charts-pdpc/>

Activity Network Diagram

- Develop a *work schedule* for the facilities design effort (can be replaced by Gantt chart).
- A well-thought timetable is needed to understand the length of the facilities design project.

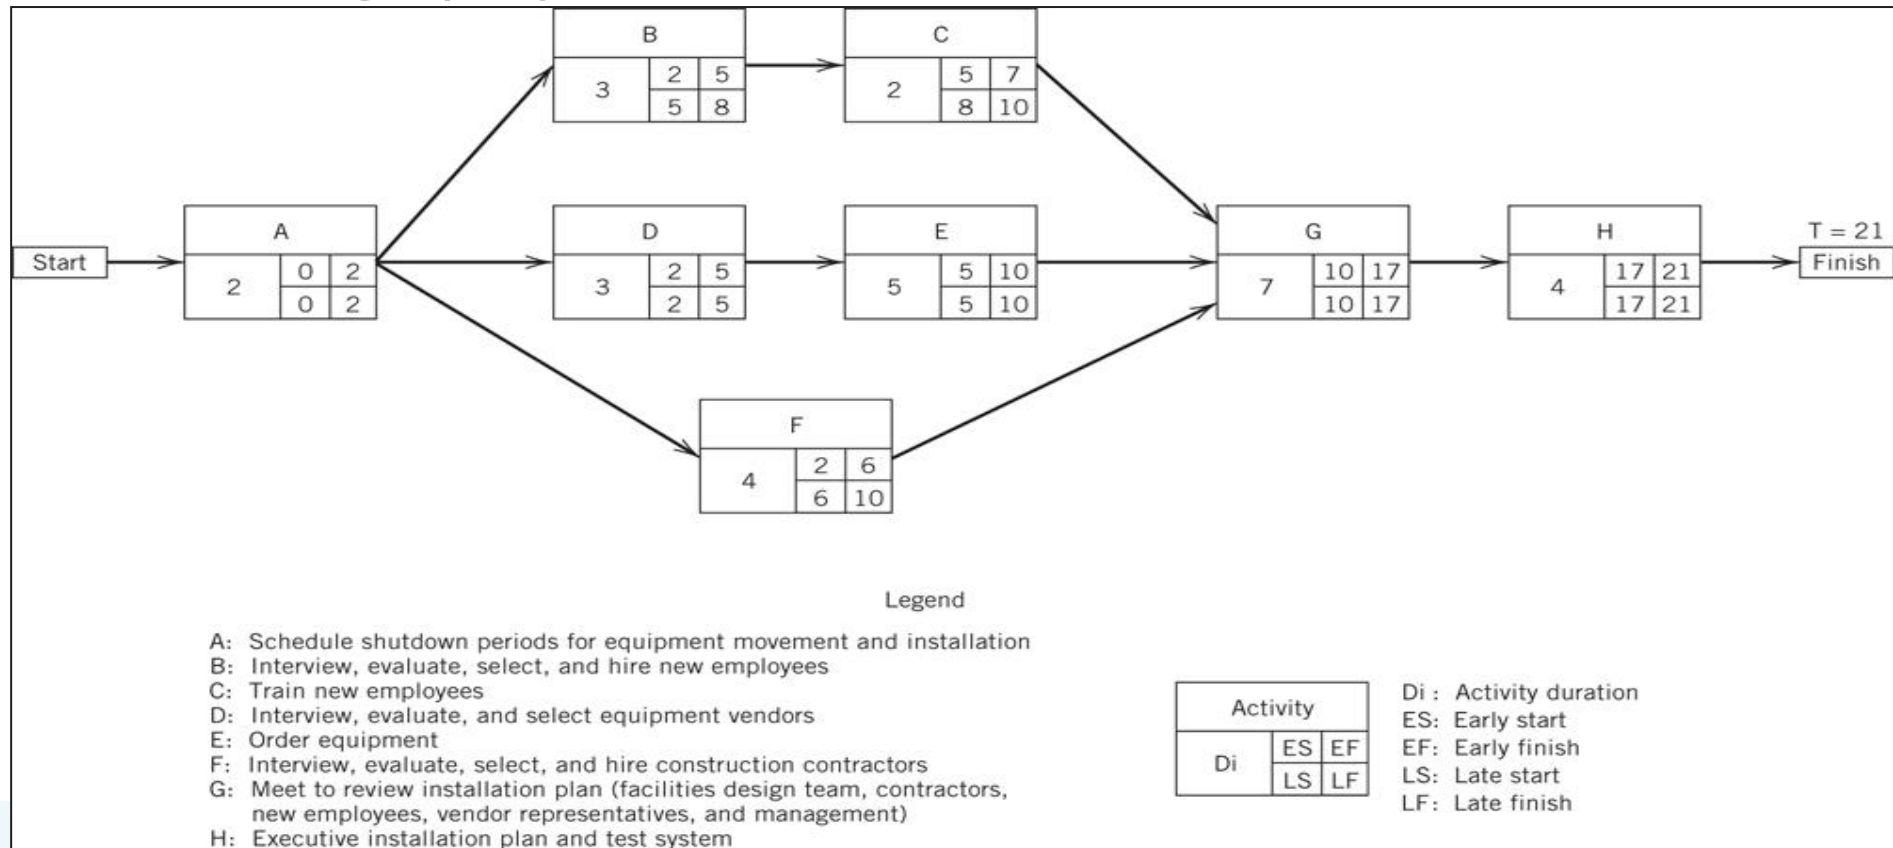

Prioritization Matrix

- Be used to judge the relative importance of each criterion as compared to the others

		Criteria being compared to								Row	
		Low cost	Use of technology	Potential Savings	Increased speed	Decreased defects	Customer Satisfaction	Minimal impact	Easy to implement	Quick Results	
Criteria		a.	b.	c.	d.	e.	f.	g.	h.	i.	
a.	Low Cost		5								
b.	Use of Technology	0.2									
c.	Potential Saving										
d.	Increased Speed										
e.	Decreased Defects										
f.	Customer Satisfaction										
g.	Minimum Impact										
h.	Easy to Implement										
i.	Quick Results										
Column Total											

Prioritization Matrix


- Example:

Criteria	Cost effective	Decreased defects	Increased productivity	User friendly		
↓ Options / Weight →	0.85	0.8	1.75	0.6	Weighted scores	Rank
New equipment 1	3	2	2	3	9.45	3
New equipment 2	2	3	3	4	11.75	1
New equipment 3	1	2	4	2	10.65	2
New equipment 4	4	1	1	1	6.55	4

<https://citoolkit.com/articles/prioritization-matrix/>

Seven Management and Planning Tools

- All tools can be used to support an integrated facilities design process, or they can also be used independently.
- An example of the applications of these tools:

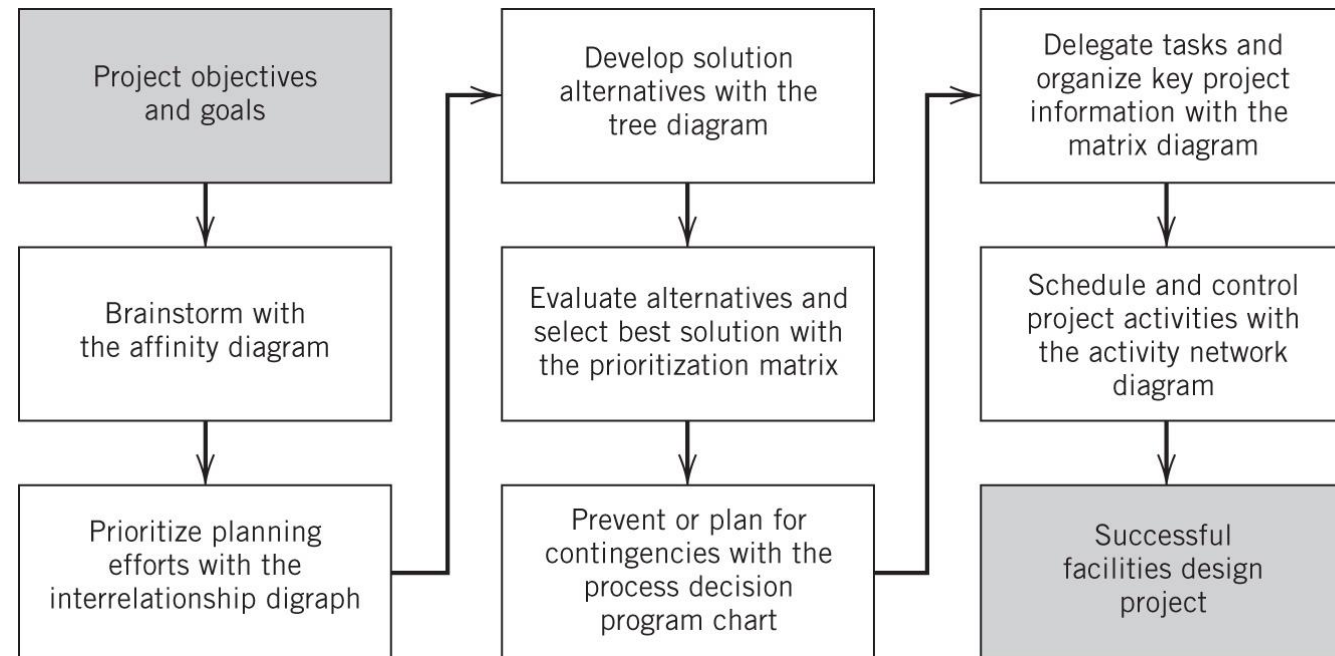



Introduction

Three important considerations in determining facility requirements

- Flow systems
 - Movements of goods, materials, energy, information, and/or people
- Activity relationships
 - Quantitative or qualitative measure of the relationships between departments
- Space requirements
 - Determination of space requirements for facility, department, workstations, etc.


Flow Systems

- Flow is the movement of goods, materials, energy, information, people
- Product Flow **P**rocess
 - Movement of refrigerators from manufacturer through distribution centers, and ultimately to customer
- Information Flow **P**rocess
 - Transmission of sales orders from sales department to production control department
- Flow Process Involving **P**eople
 - Movement of patients, staff, visitors at hospital

Types of Flow Processes


- Discrete flow processes (primary emphasis in this course): discrete items move through the flow process, such as machine, products, cans, etc.
- Continuous flow processes: products continuously move through successive production states, such as electric current, oil, etc.
- Discrete flow systems can be categorized supply, manufacture, and distribution stages:
 - Materials management system
 - Material flow system
 - Physical distribution system

Logistics system

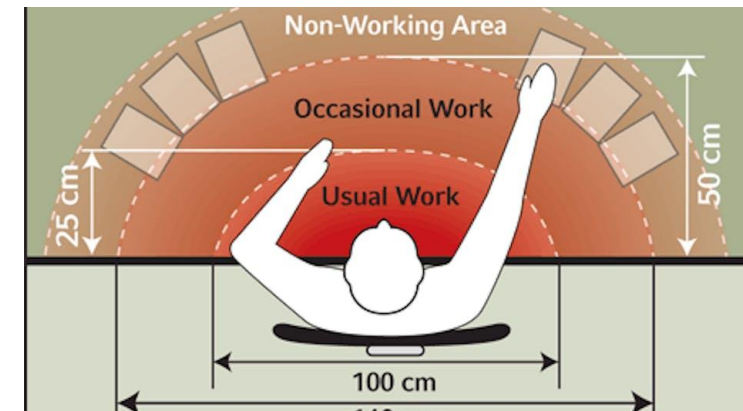


Flow and Data

- Logistics system

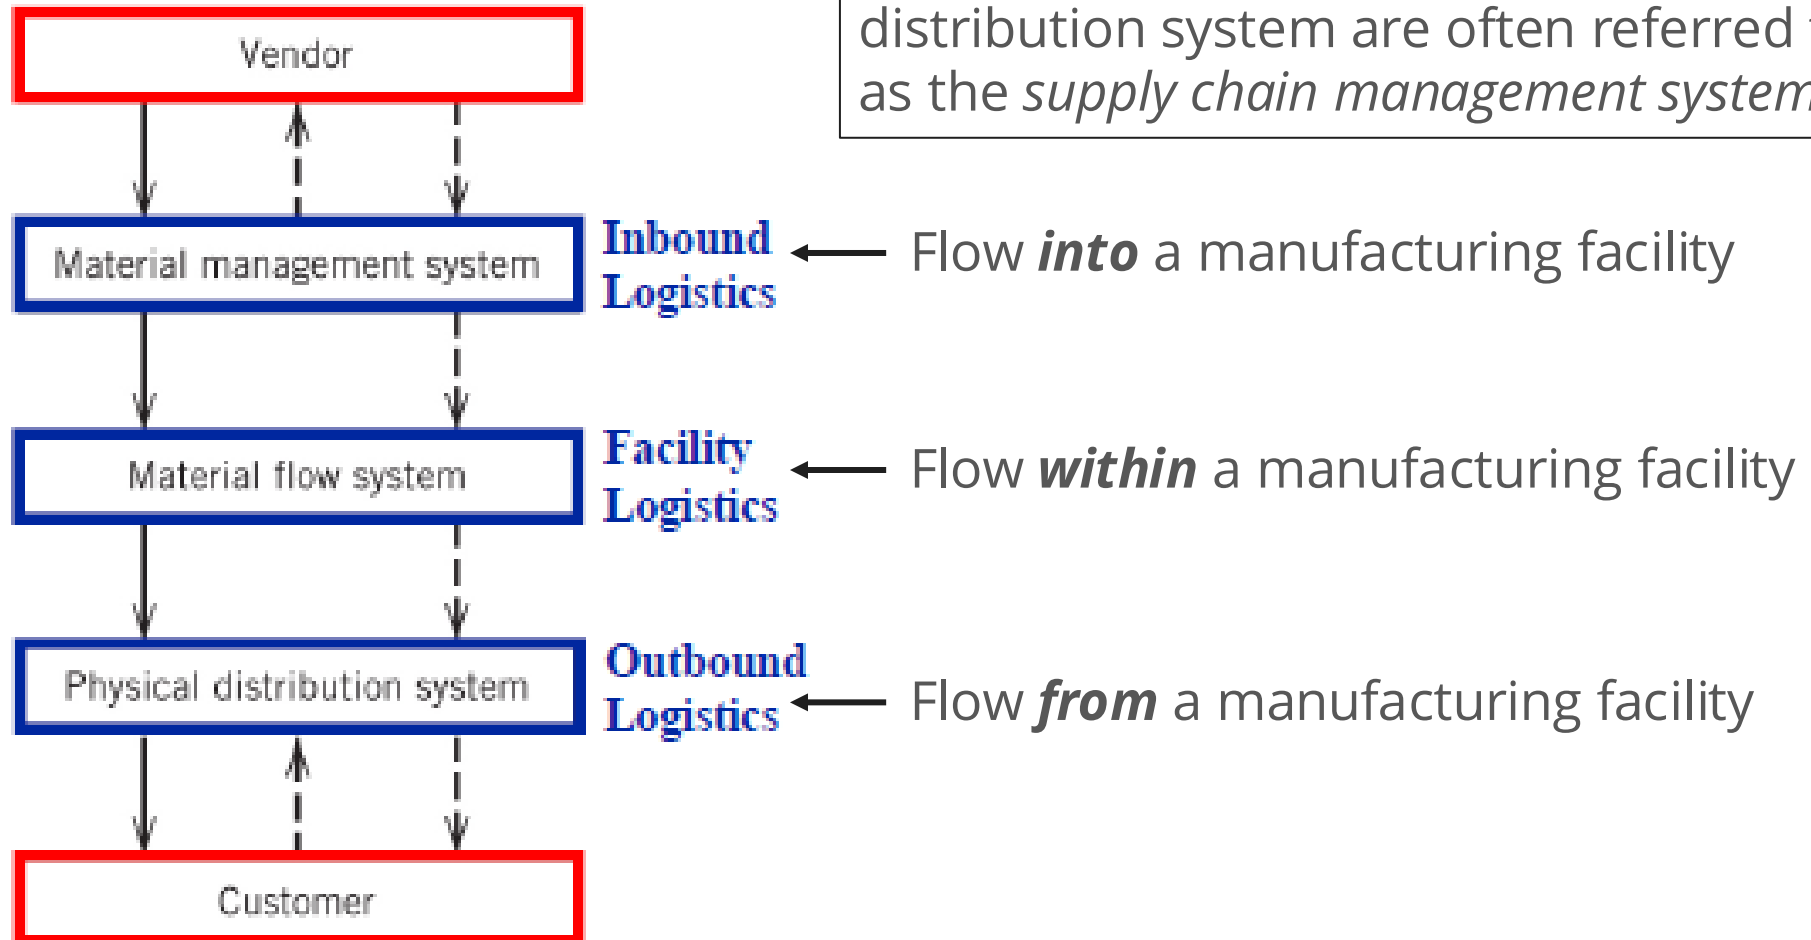


Materials Management System

- Flow of materials **into** a manufacturing facility
- Resources: production control and purchasing functions; vendors; transportation and material handling equipment; receiving, storage, and accounting functions.
- Communications: production forecasts, inventory records, stock requisitions, purchase orders, bills of lading, electronic data interchange (EDI), etc.

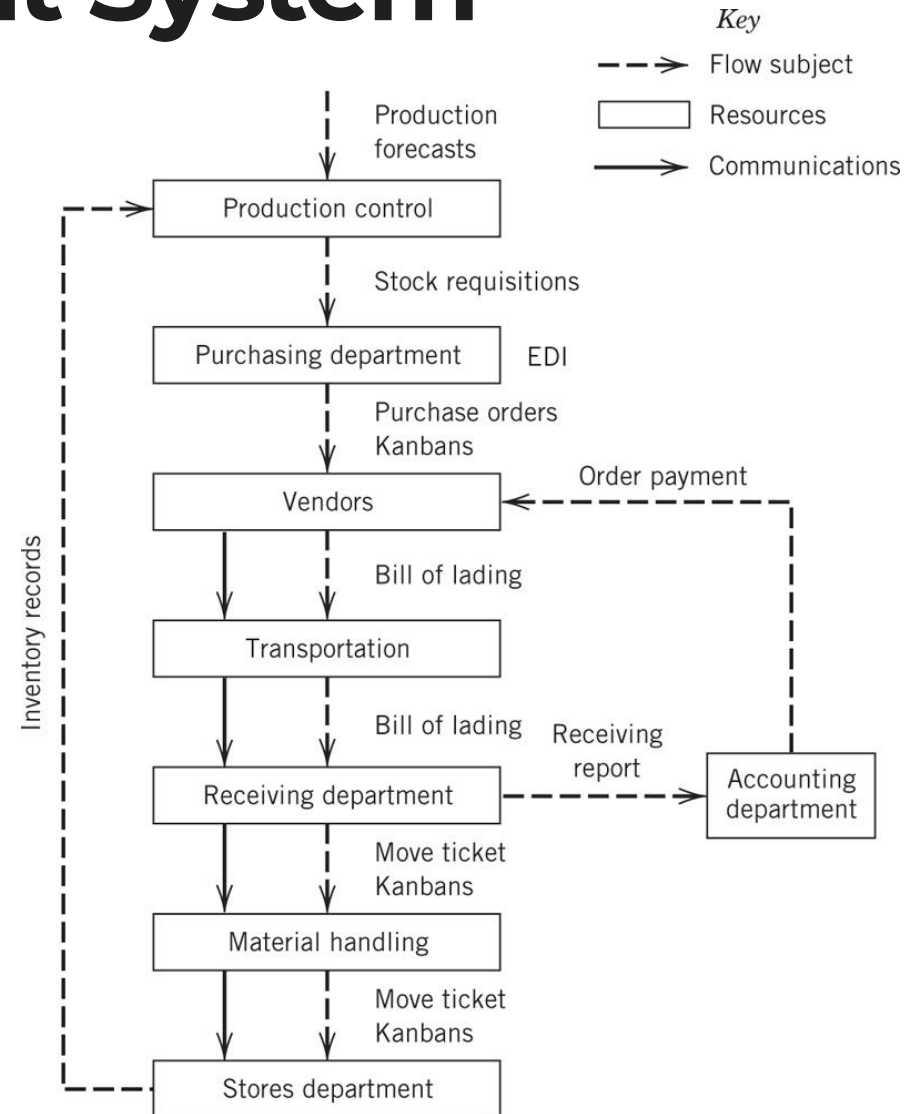


Materials Management System

- Flow of materials, parts, and supplies **within** a manufacturing facility.
- Resources: production control and quality control departments; manufacturing, assembly, and storage departments; material handling equipment; factory warehouse.
- Communications: production schedules, work order releases, move tickets, kanbans, etc.

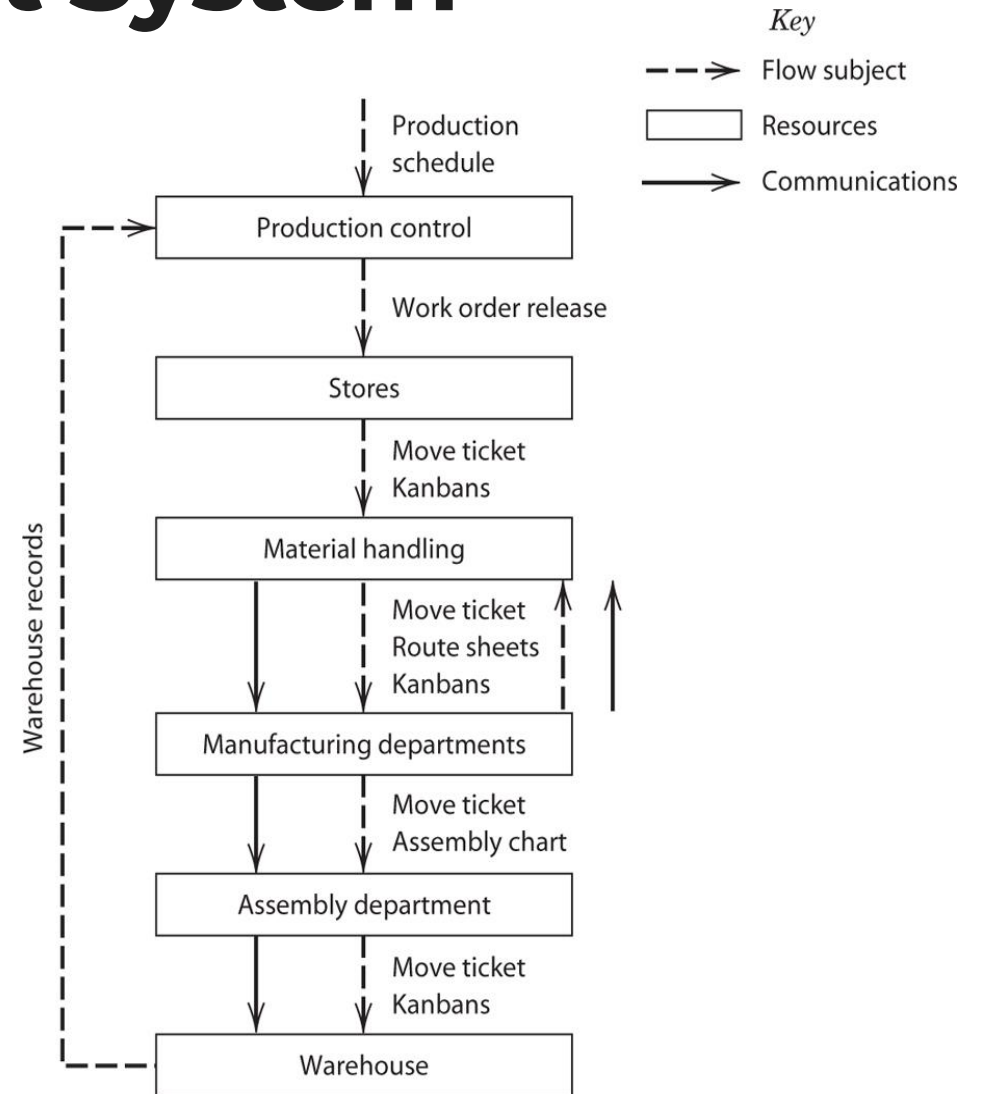


Physical Distribution System

- Flow of products **from** a manufacturing facility, the subjects are the finished goods produced by a firm.
- Resources: customer; sales and accounting departments, and warehouses; material handling and transportation equipment; distributors
- Communications: sales orders, packing lists, shipping reports, etc.

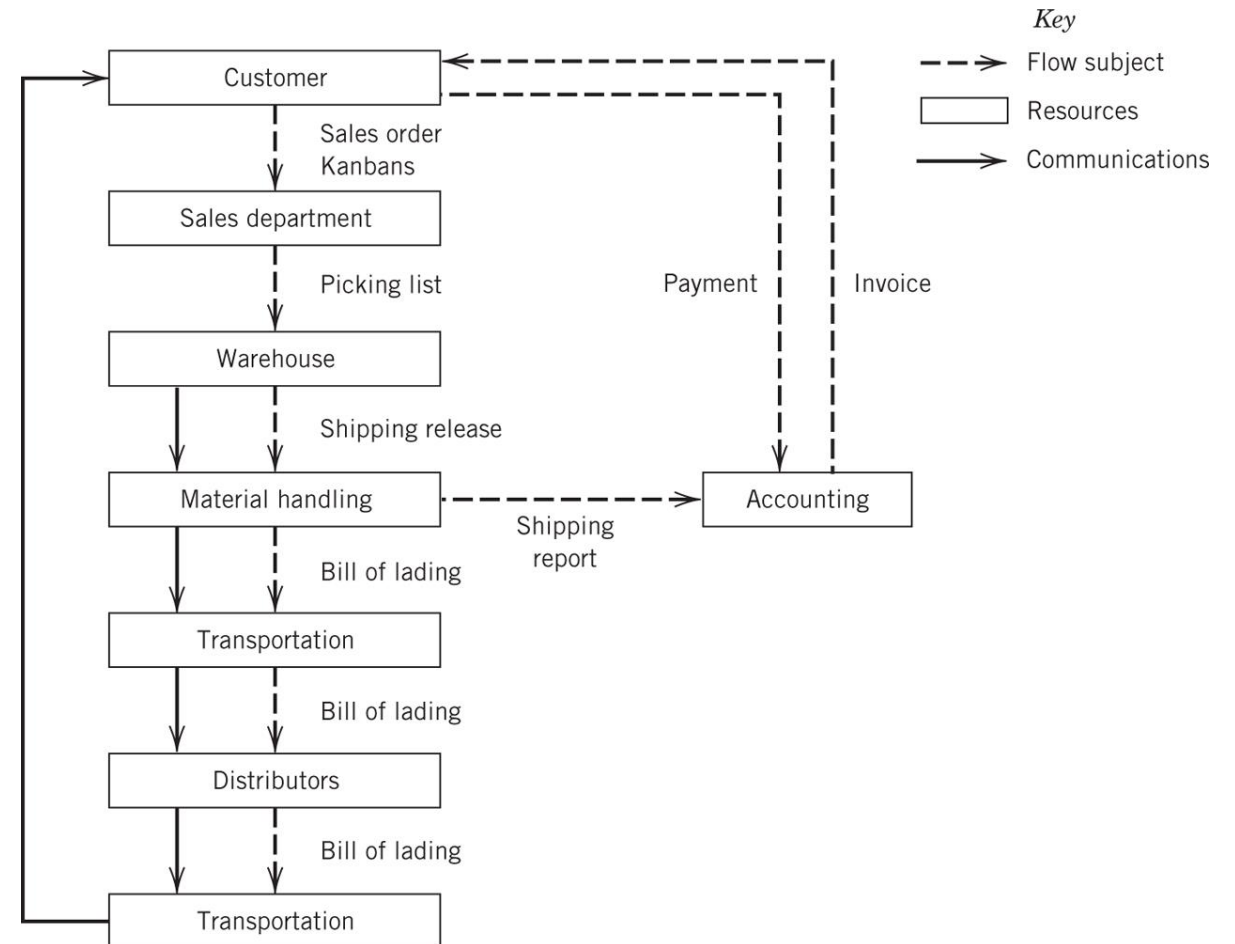


Flow Planning

- Process of arranging activities in combinations of basic flow patterns (based on flow analysis), both quantitative (from-to chart) and qualitative (activity relationship diagram).
- Hierarchical decomposition (material flow system)
 1. Flow between departments (inter-cell)
 2. Flow within product departments (intra-cell)
 3. Flow within workstations

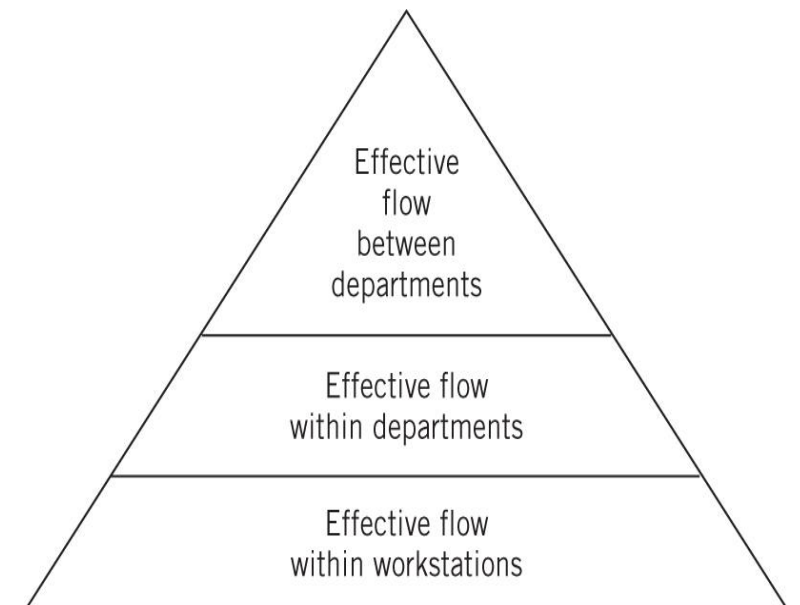

Flow Planning

- Flow between departments (inter-cell)
 - Is used to evaluate overall flow within a facility
 - Flow patterns determines the entrance (receiving) and exit (shipping)

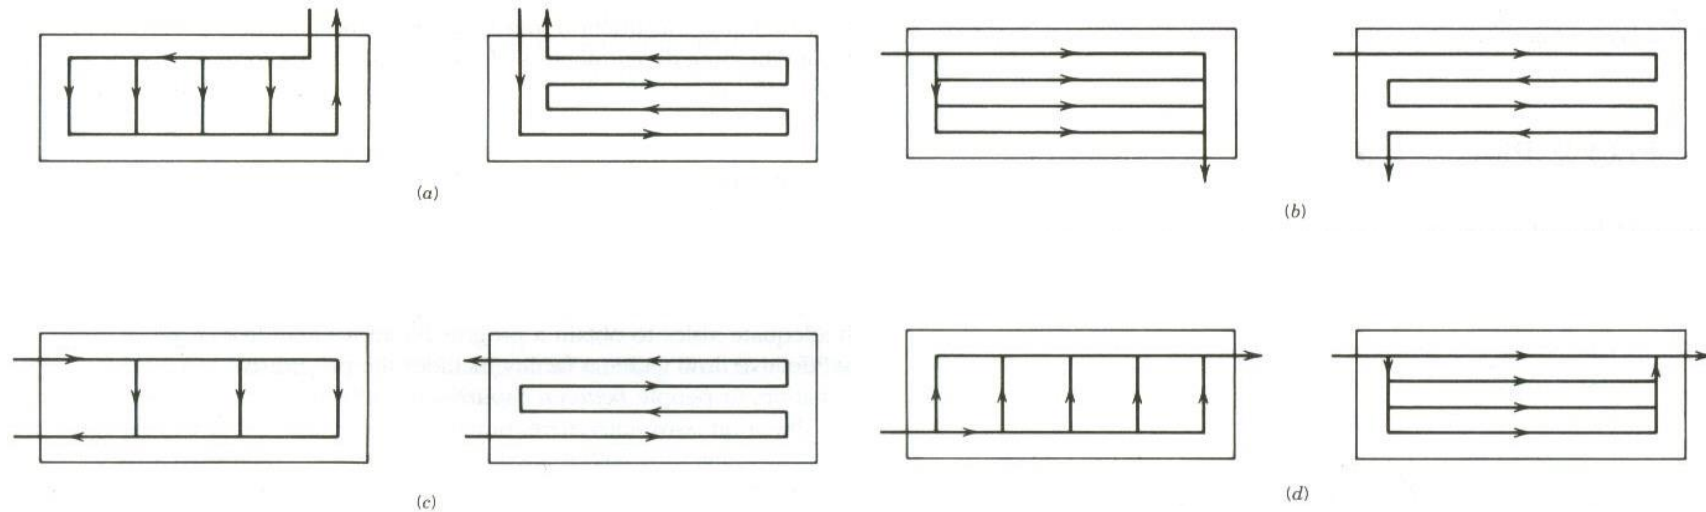

Flow within a department considering the locations of input/output points.
(a) At the same location. (b) On adjacent sides. (c) On the same side. (d) On opposite sides

Flow Planning




Flow Planning




Flow Planning


- Determination of best structure requires mathematical models and simulation – will be introduced later.

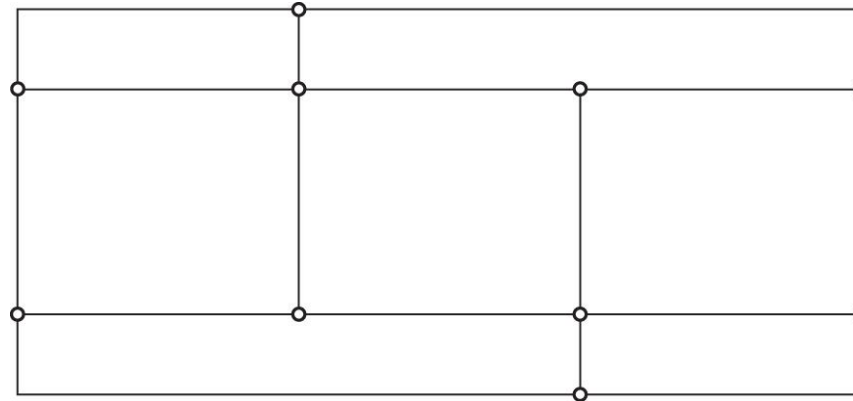

Conventional between-department flow structure

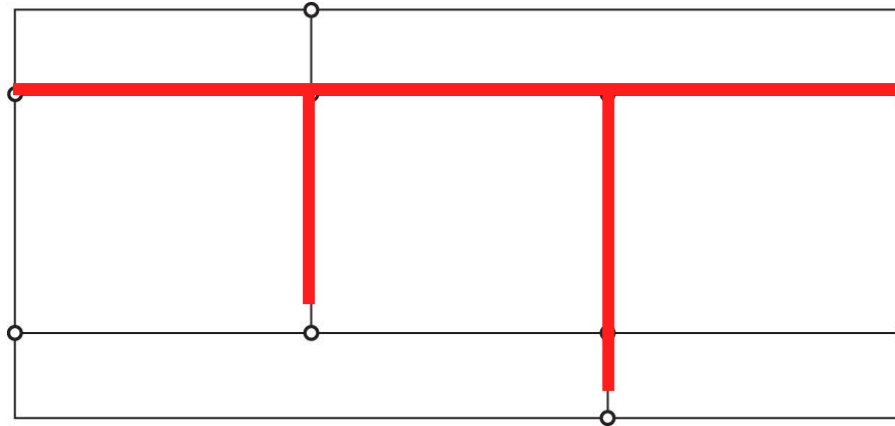


Spine between-department flow structure

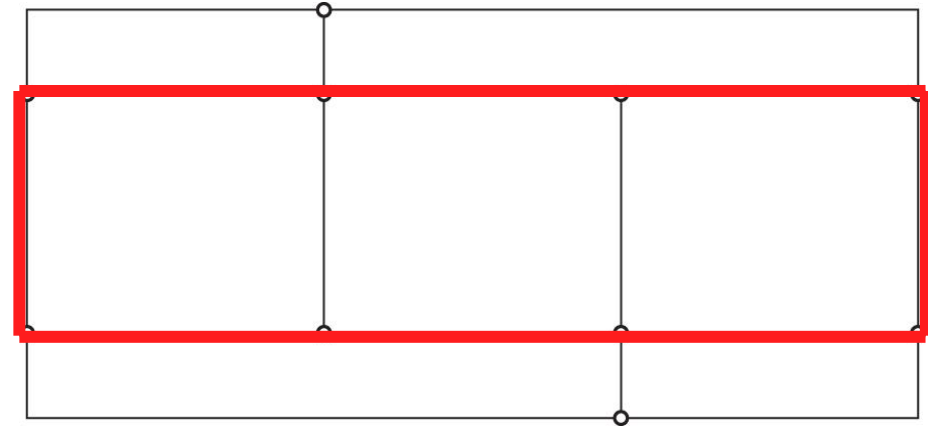

Loop between-department flow structure

Flow Planning


- Flow within a department (intra-cell)
- Depends on the type of department (product, process, product family, etc.)
- Flow patterns

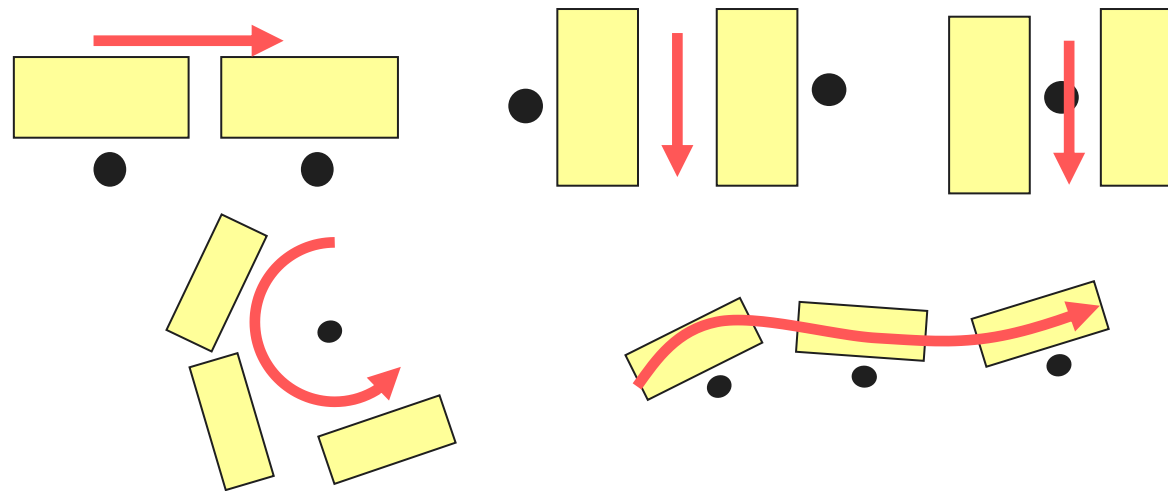


Flow within product departments. (a) End-to-end. (b) Back-to-back. (c) Front-to-front. (d) Circular. (e) Odd-angle. Dots: operator.

Flow Planning


- Flow within a process department
 - Similar or identical machines are grouped in the same department, where minimal amount of flow should occur
 - Workstation – aisle arrangements
 - Depends upon available space, interactions among workstations, and size of materials to be handled

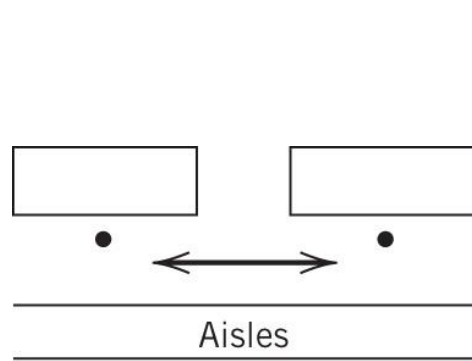

1 machine/operator
END-TO-END

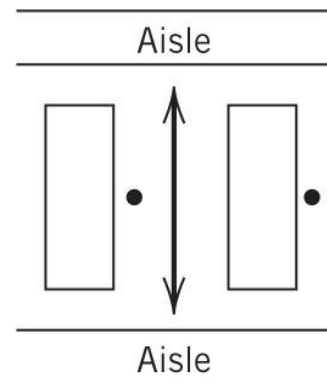

1 machine/operator
BACK-TO-BACK

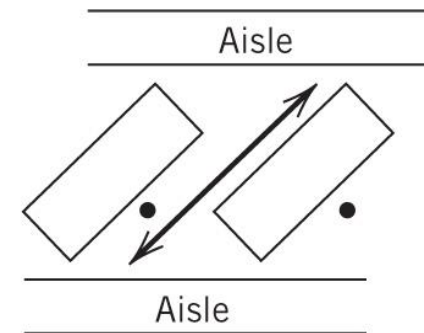


2 machine/operator
FRONT-TO-FRONT

Flow within process departments. (a) Parallel. (b) Perpendicular. (c) Diagonal.

Flow Planning


- Flow within product and process departments considering material handling.

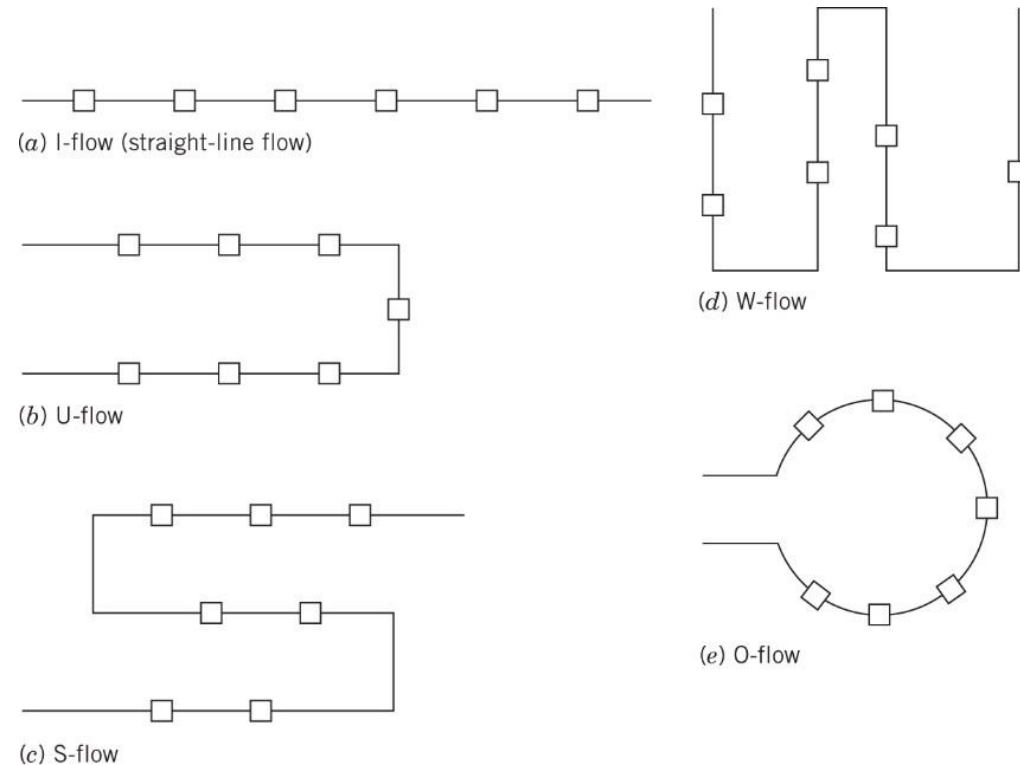


The line flow patterns

Flow Planning


- Other flow patterns considering material handling:

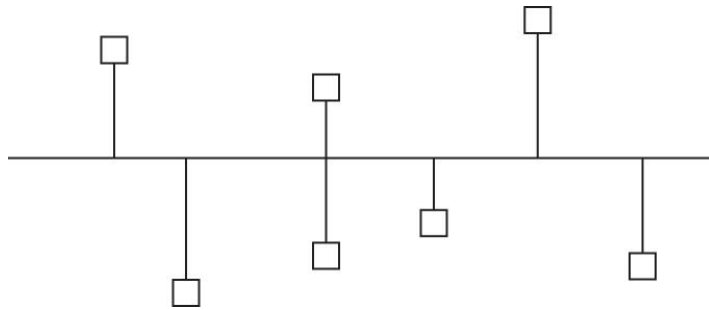

The spline flow pattern

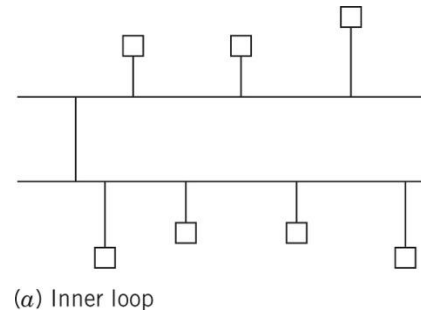


(a) Inner loop

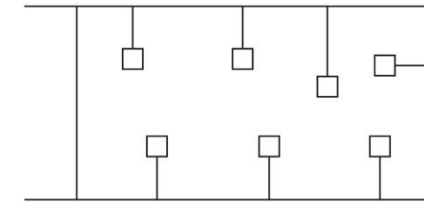

(b) Outer loop

The loop flow pattern

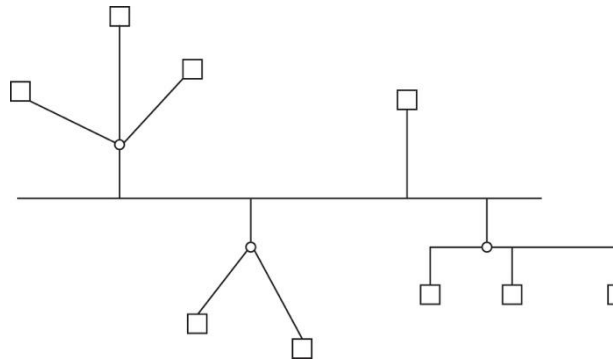

The tree flow pattern

Flow Planning

- Flow within workstations
 - Motion studies and ergonomic considerations are important in establishing the flow within workstations.
 - Flow should be simultaneous, symmetrical, natural and rhythmical.






Motion Study

Flow Planning

- Principle 1:
 - Uninterrupted (no intersection with other paths) flow path directly from origin to destination
 - No backtracking

- Example: backtracking impacts

Compare A – B – C – D vs. A – B – A – C – D

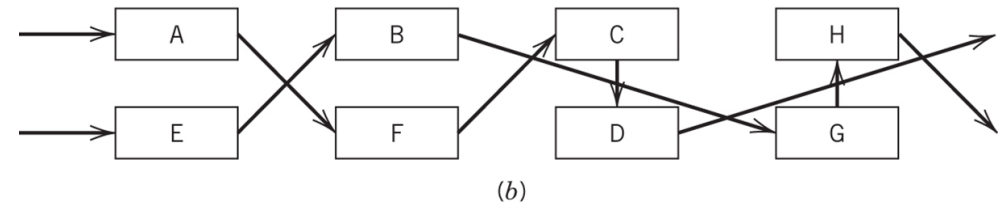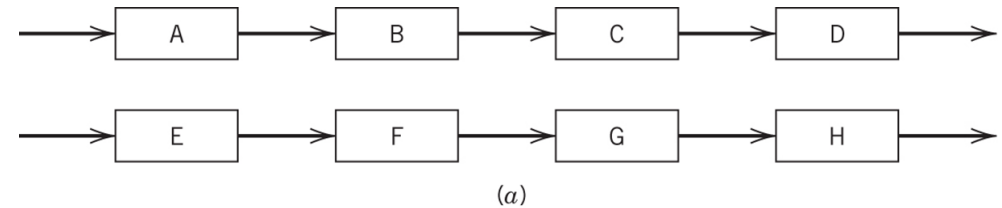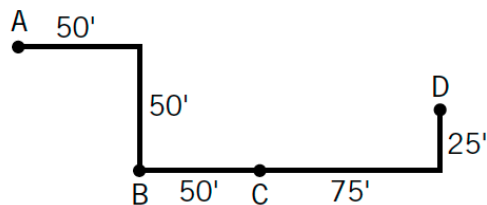

Flow path A – B – C – D
 $(50' + 50') + 50' + (75' + 25') = 250 \text{ feet}$

Flow path A – B – A – C – D
 $(50' + 50') + (50' + 50') + (50' + 50') + 50' + (75' + 25') = 450 \text{ feet}$




Backtracking penalty

Flow Planning

- Principle 1:
 - Uninterrupted (no intersection with other paths) flow path directly from origin to destination
 - No backtracking

- Example: backtracking impacts

Compare A – B – C – D vs. A – B – A – C – D

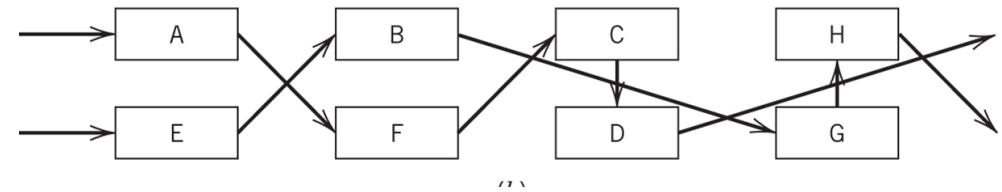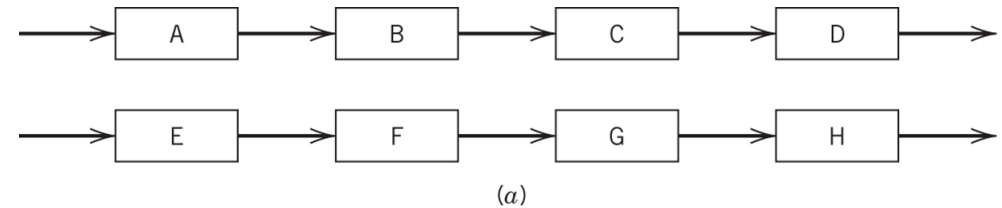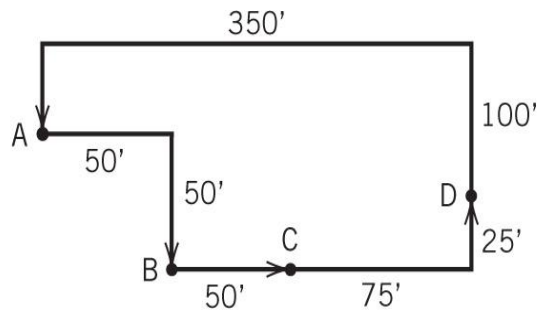

For path A – B – C – D

$$\begin{aligned} \text{Total path} &= (50' + 50') + (50') + (75' + 25') \\ &= 250 \text{ feet} \end{aligned}$$

For path A – B – A – C – D

$$\begin{aligned} \text{Total path} &= (50' + 50') + [50' + (75' + 25') + 450'] + (50' + 50') + 50' + (75' + 25') \\ &= 950 \text{ feet} \end{aligned}$$

Backtracking penalty

Flow Planning

- Principle 2:
 - Deliver directly to the point of use - eliminate waste
 - Plan appropriate unit of load, use pallets to minimize trips
 - Combine flows and operations, e.g. automobile assembly
- Principle 3:
 - Minimize travel distances
 - Mechanize or automate transfer



Achieving Effective Flow

- Must consider flow patterns and structures
- Adequate aisles to accommodate desired flow
- Must consider flow
 - Between departments
 - Within departments
 - Within workstations

Departmental Planning

- **Fixed material location:** product is fixed, materials/machines are moved. For very large products.
 - Examples: Shipbuilding, aerospace
- **Product planning:** product line departments, flow shop. For standardized products with large & stable demand.
 - Examples: Automotive industry
- **Product family (Group layout):** group technology/cellular manufacturing. Parts can be divided into part families.
 - Examples: gears, nut/screws
- **Process:** layout of resources by function, job-shop. Small to medium-sized metal cutting industry.
 - Examples: job shop


Departmental Planning




Product
Planning

Product
Family


Process
Planning

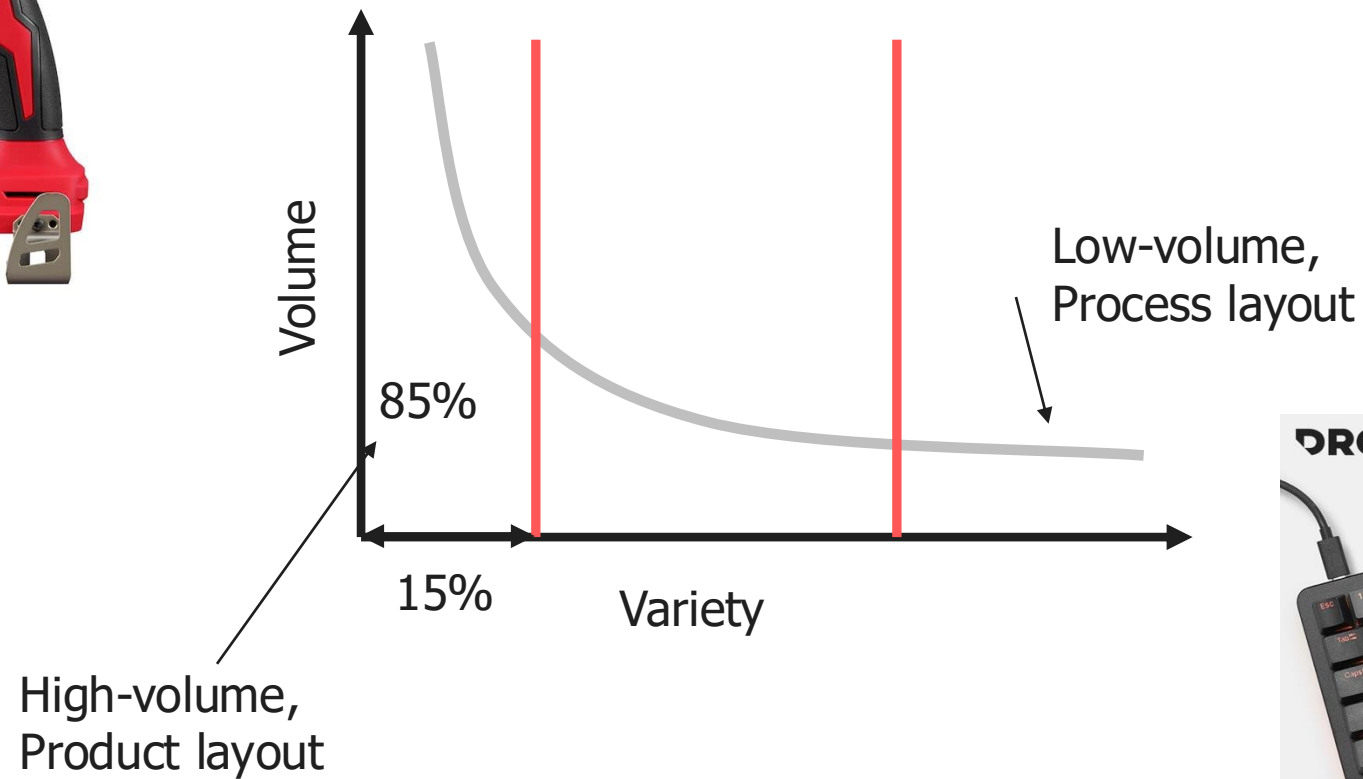

Departmental Planning

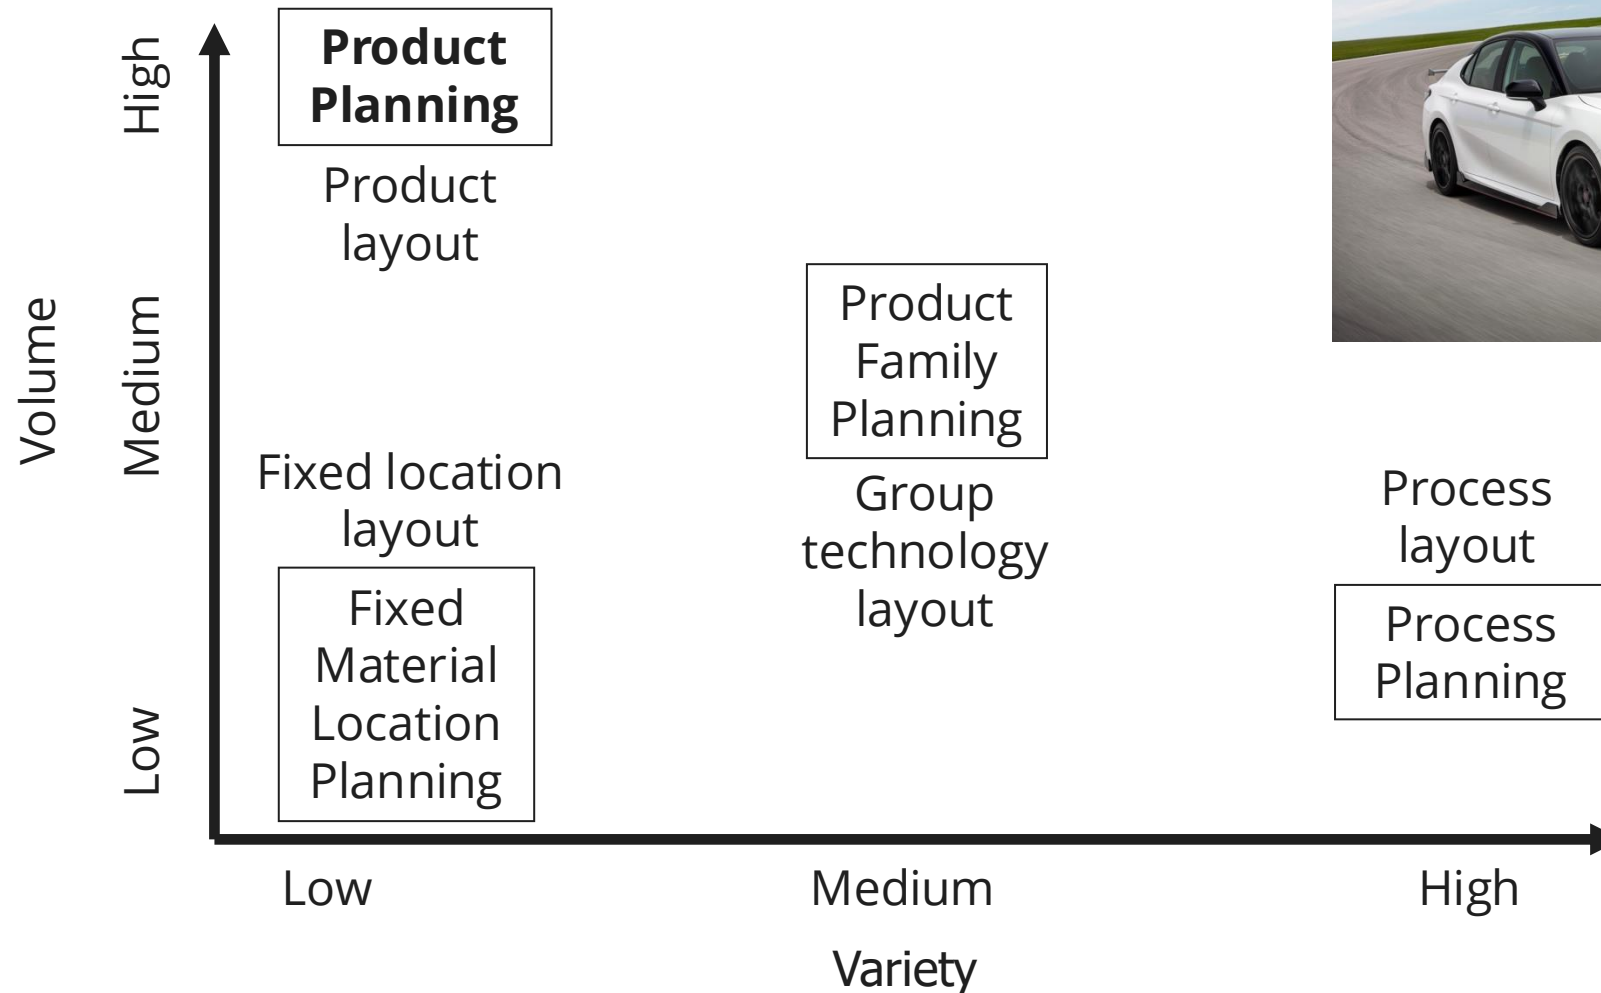

Product Layout

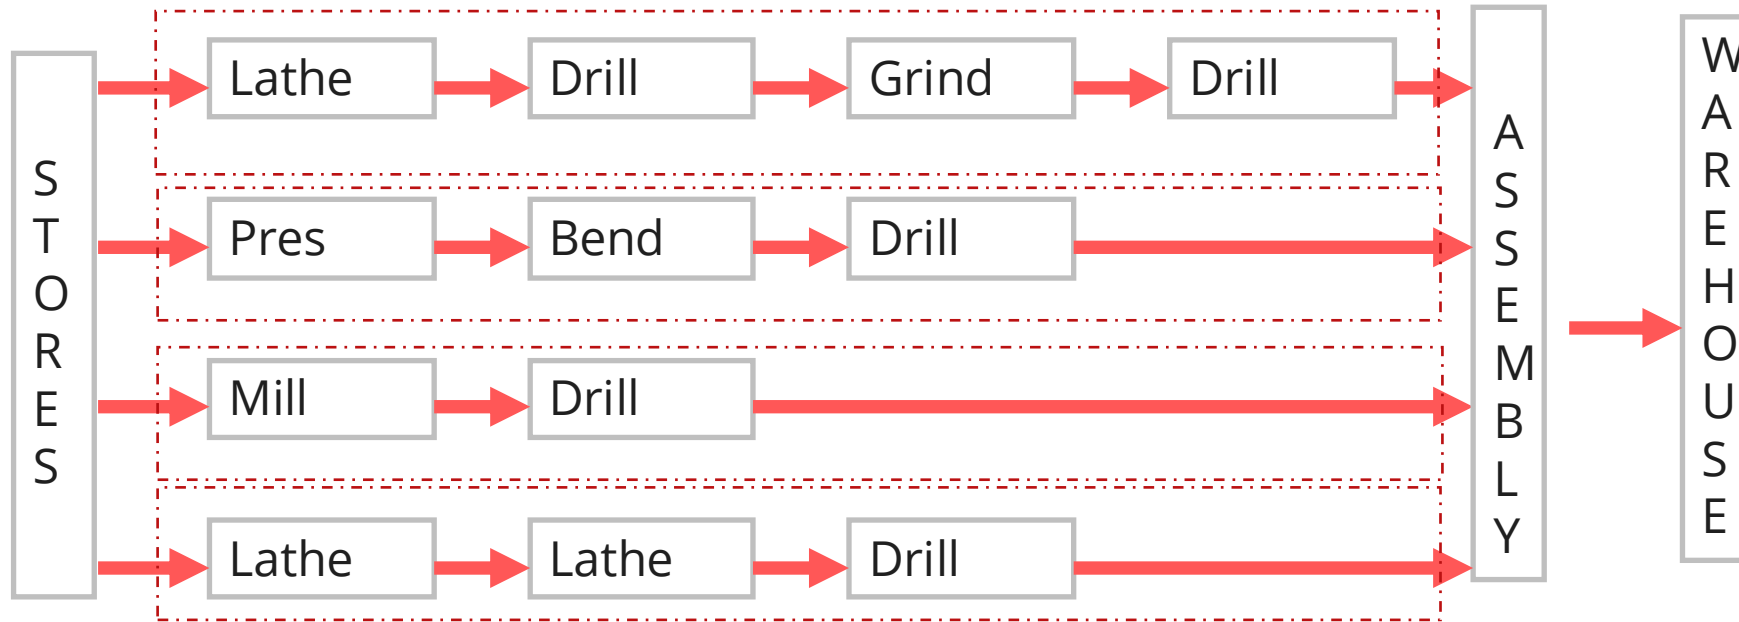

(a) Product layout

- Based on processing sequences online
- Automobile
- Materials flow from workstation to next
- High volume, low variety
- “flow shop” layout

We have one product department for Product A, but it has 4 operations or stations (since drill is repeated, we may also say the department for Product A has 3 operations or stations)


Advantages and Limitations of Layouts

Product layout

Advantages	Limitations
1. Smooth, simple, logical, and direct flow lines result. 2. Small work-in-process inventories should result. 3. Total production time per unit is short. 4. Material handling requirements are reduced. 5. Less skill is required for personnel. 6. Simple production control is possible. 7. Special-purpose equipment can be used.	1. Machine stoppage stops the line. 2. Product design changes cause the layout to become obsolete. 3. Slowest station paces the line. 4. General supervision is required. 5. Higher equipment investment usually results.


Source: Facilities Planning (Tompkins, White, Bozer, Tanchoco) Table 3.2, pp.112-113

Departmental Planning

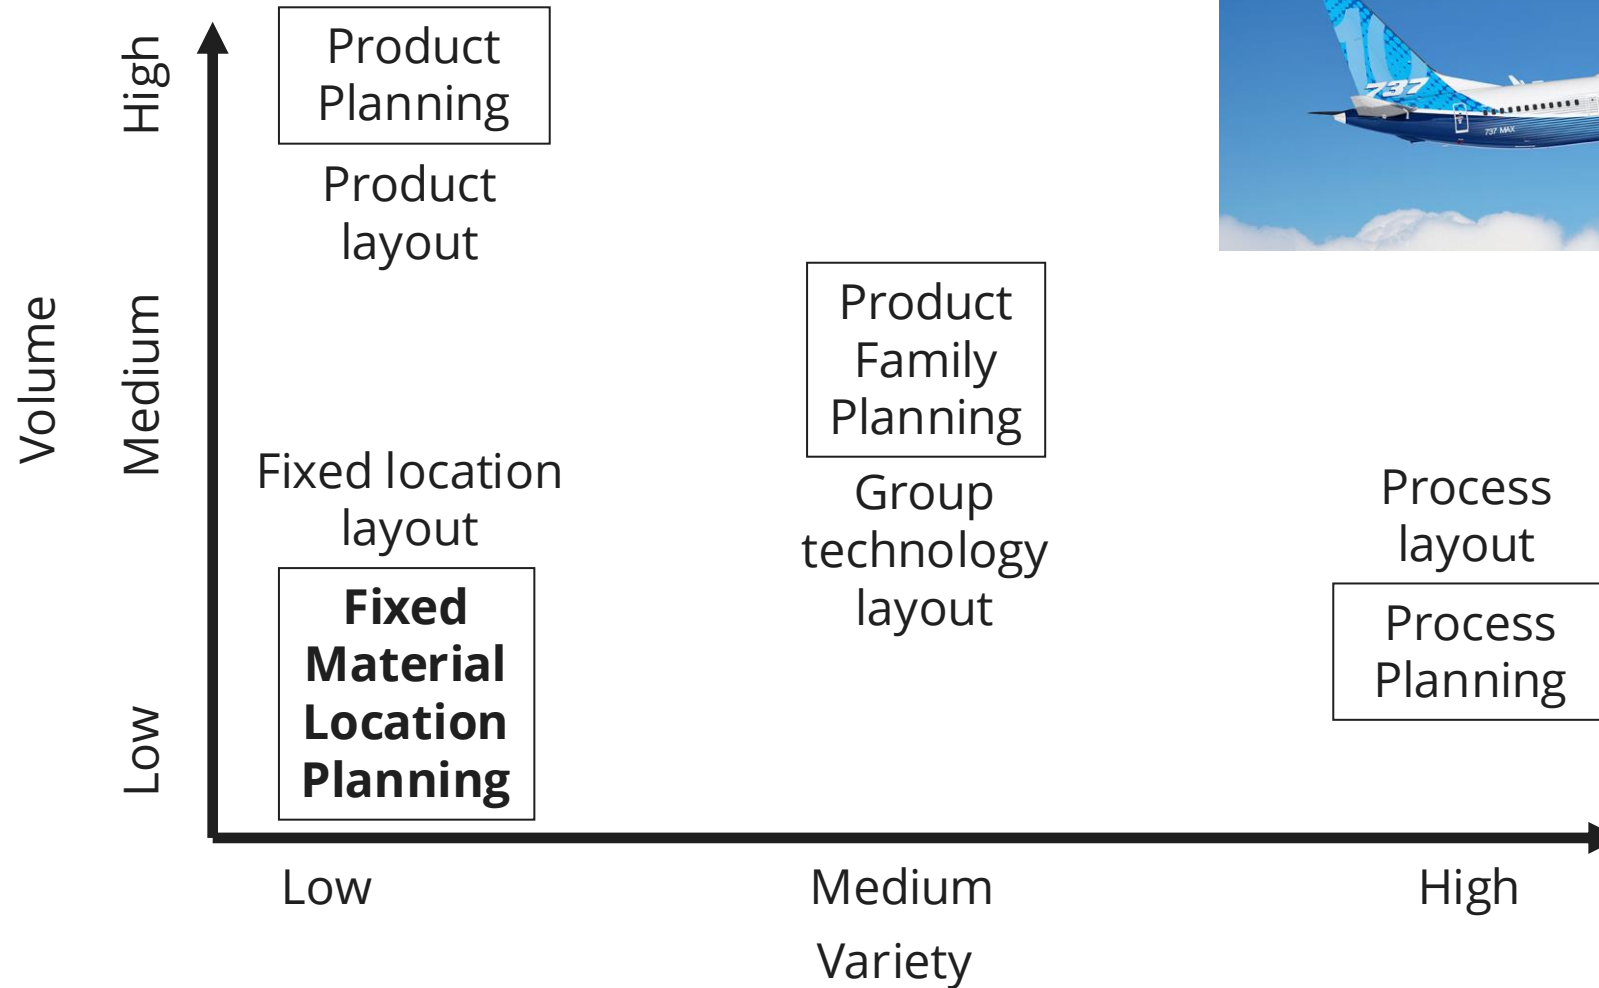


Fixed Location Layout

- Workstations are brought to material
- Aircraft assembly, shipbuilding, construction
- Sequencing, placement of workstations
- Low volume, low variety

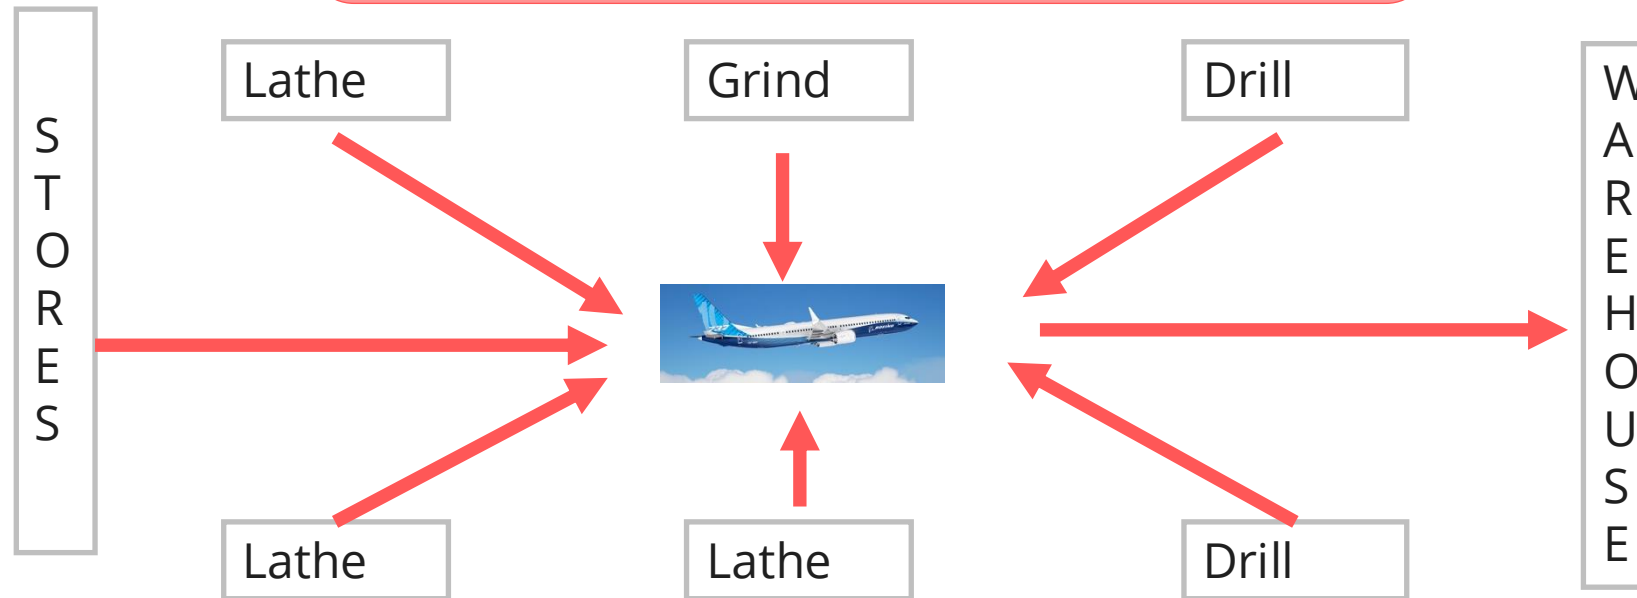


(b) Fixed location layout

Departmental Planning

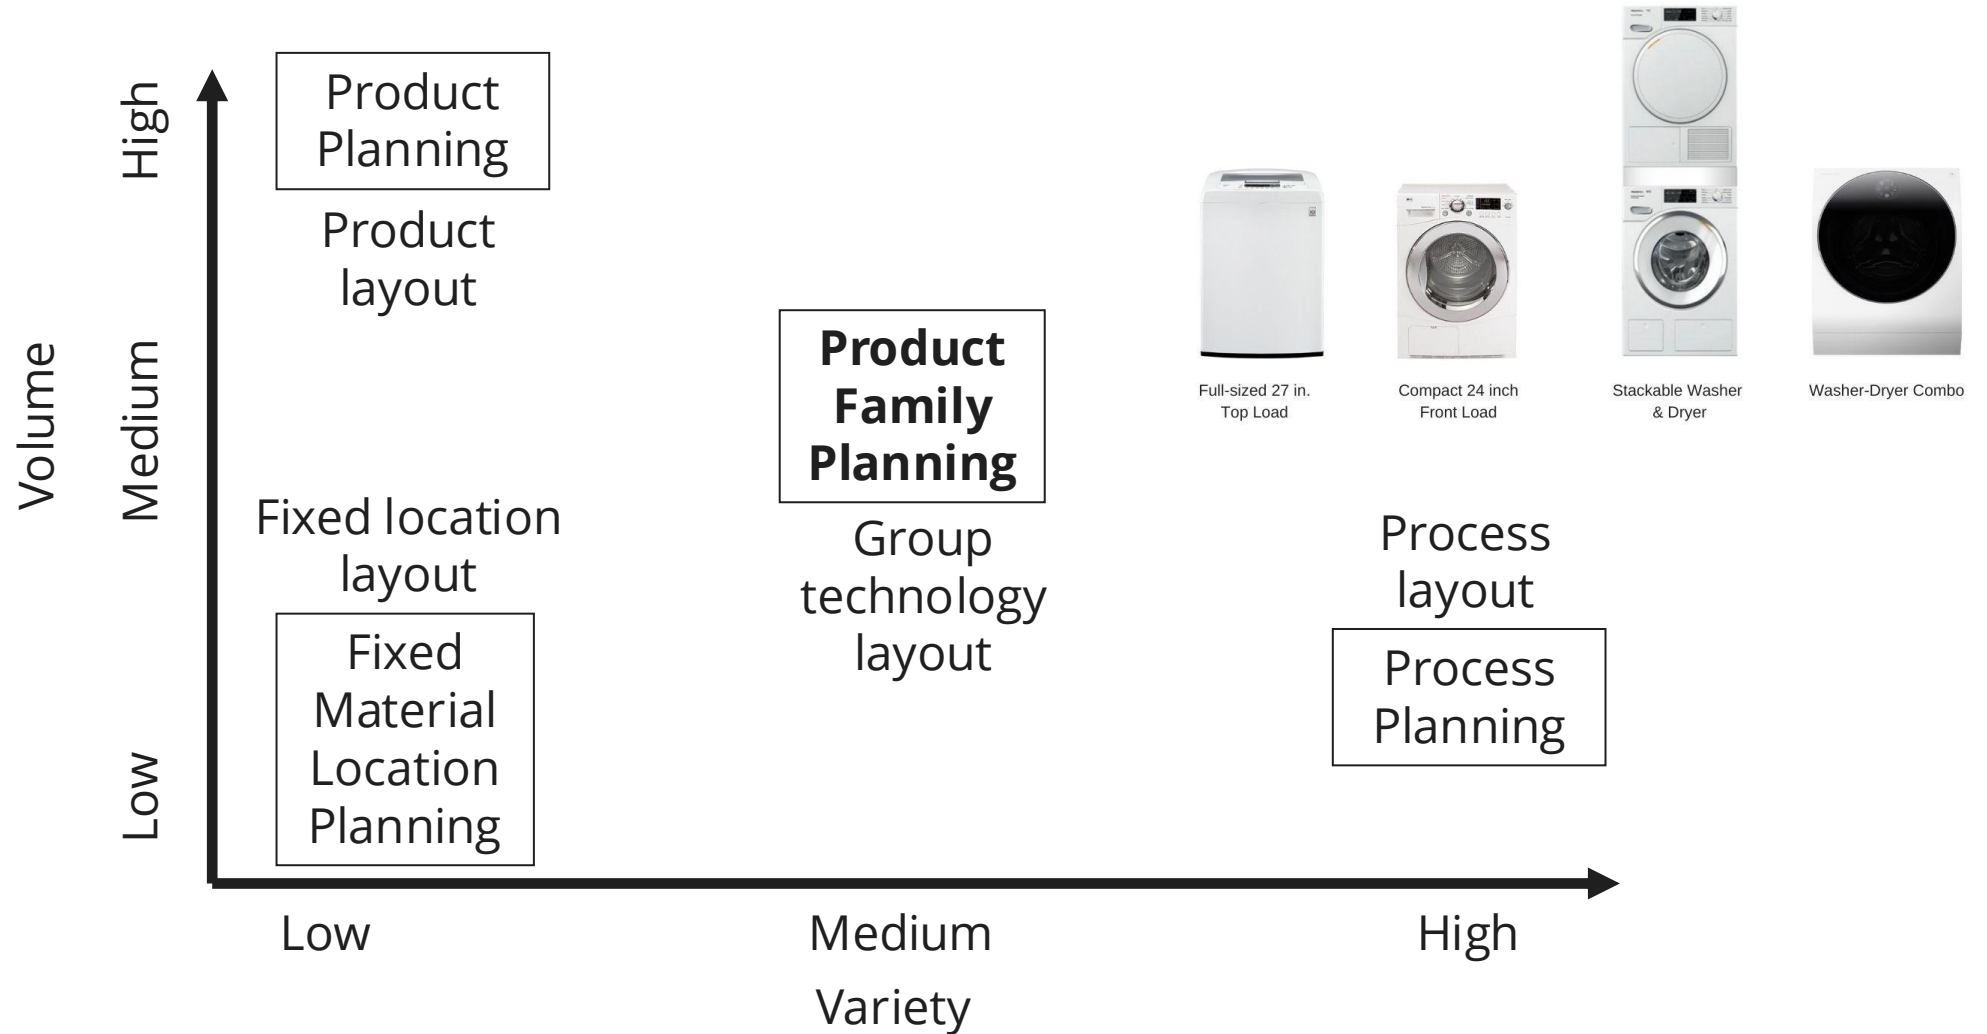

Group Layout

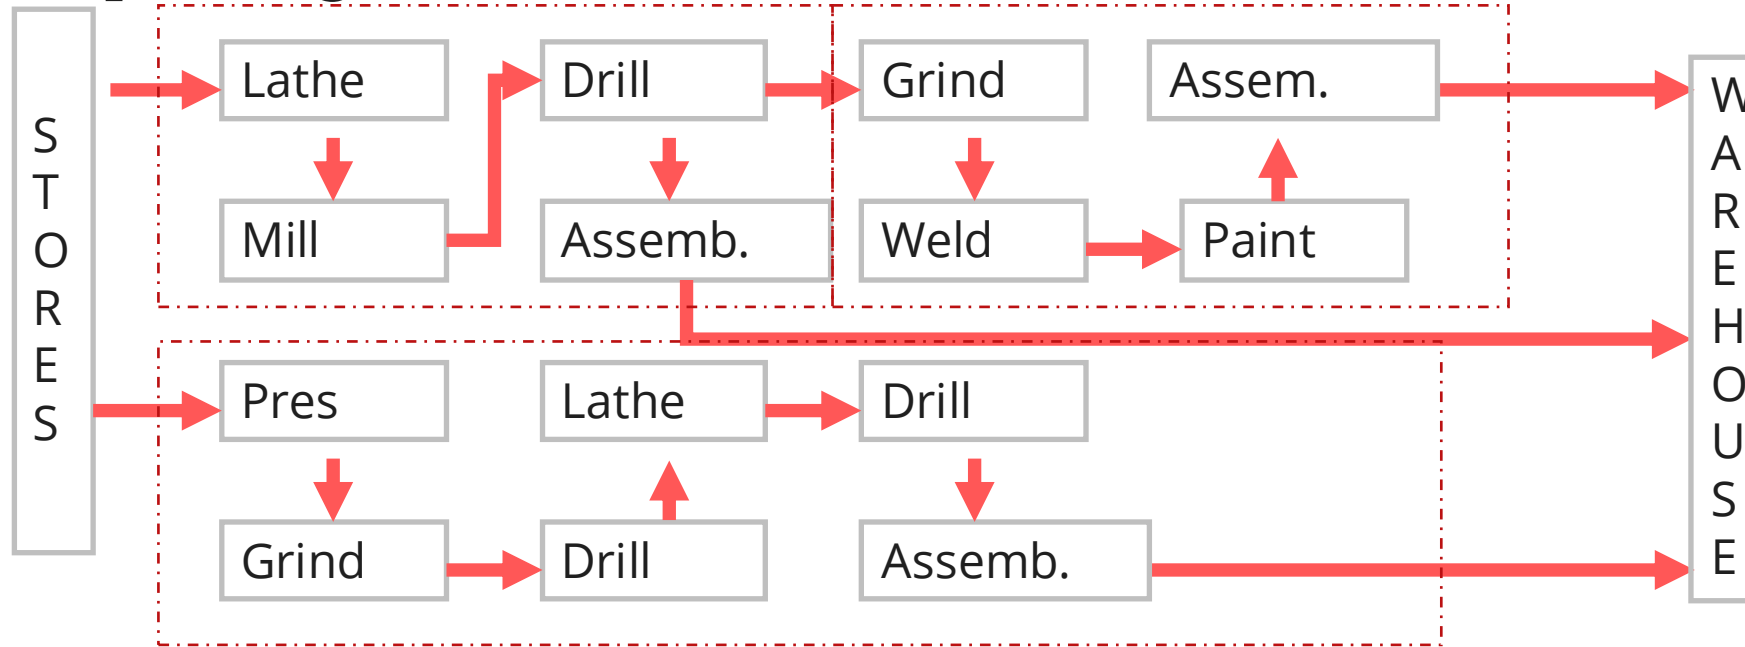

(c) Group layout

- Grouping of non-identical parts to form production families (pseudo-product)
- Common processing sequences
- Medium variety, medium volume
- Electronics
- “batch” production



Advantages and Limitations of Layouts

- **Group layout**

Advantages	Limitations
1. By grouping products, higher machine utilization can result. 2. Smoother flow lines and shorter travel distances are expected than for process layouts. 3. Team atmosphere and job enlargement benefits often result. 4. Has some of the benefits of product layouts and process layouts; it is a compromise between the two. 5. Encourages consideration of general-purpose equipment.	1. General supervision is required. 2. Greater labor skills required for team members to be skilled on all operations. 3. Critically dependent on production control balancing the flows through the individual cells. 4. If flow is not balanced in each cell, buffers and work-in-process storage are required in the cell to eliminate the need for added material handling to and from the cell. 5. Has some of the disadvantages of product layouts and process layouts; it is a compromise between the two. 6. Decreased the opportunity to use special-purpose equipment.

Source: Facilities Planning (Tompkins, White, Bozer, Tanchoco) Table 3.2, pp.112-113

Departmental Planning

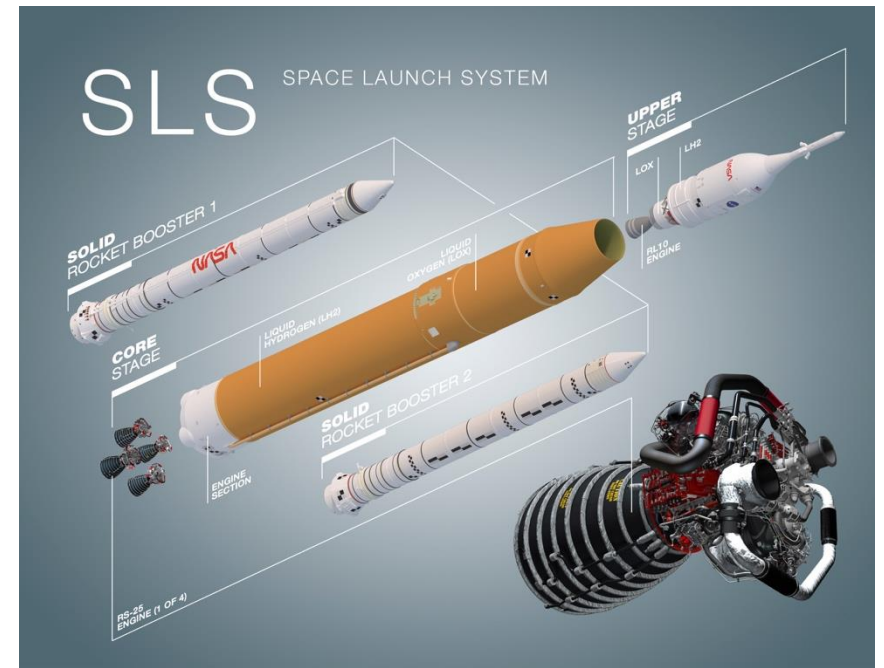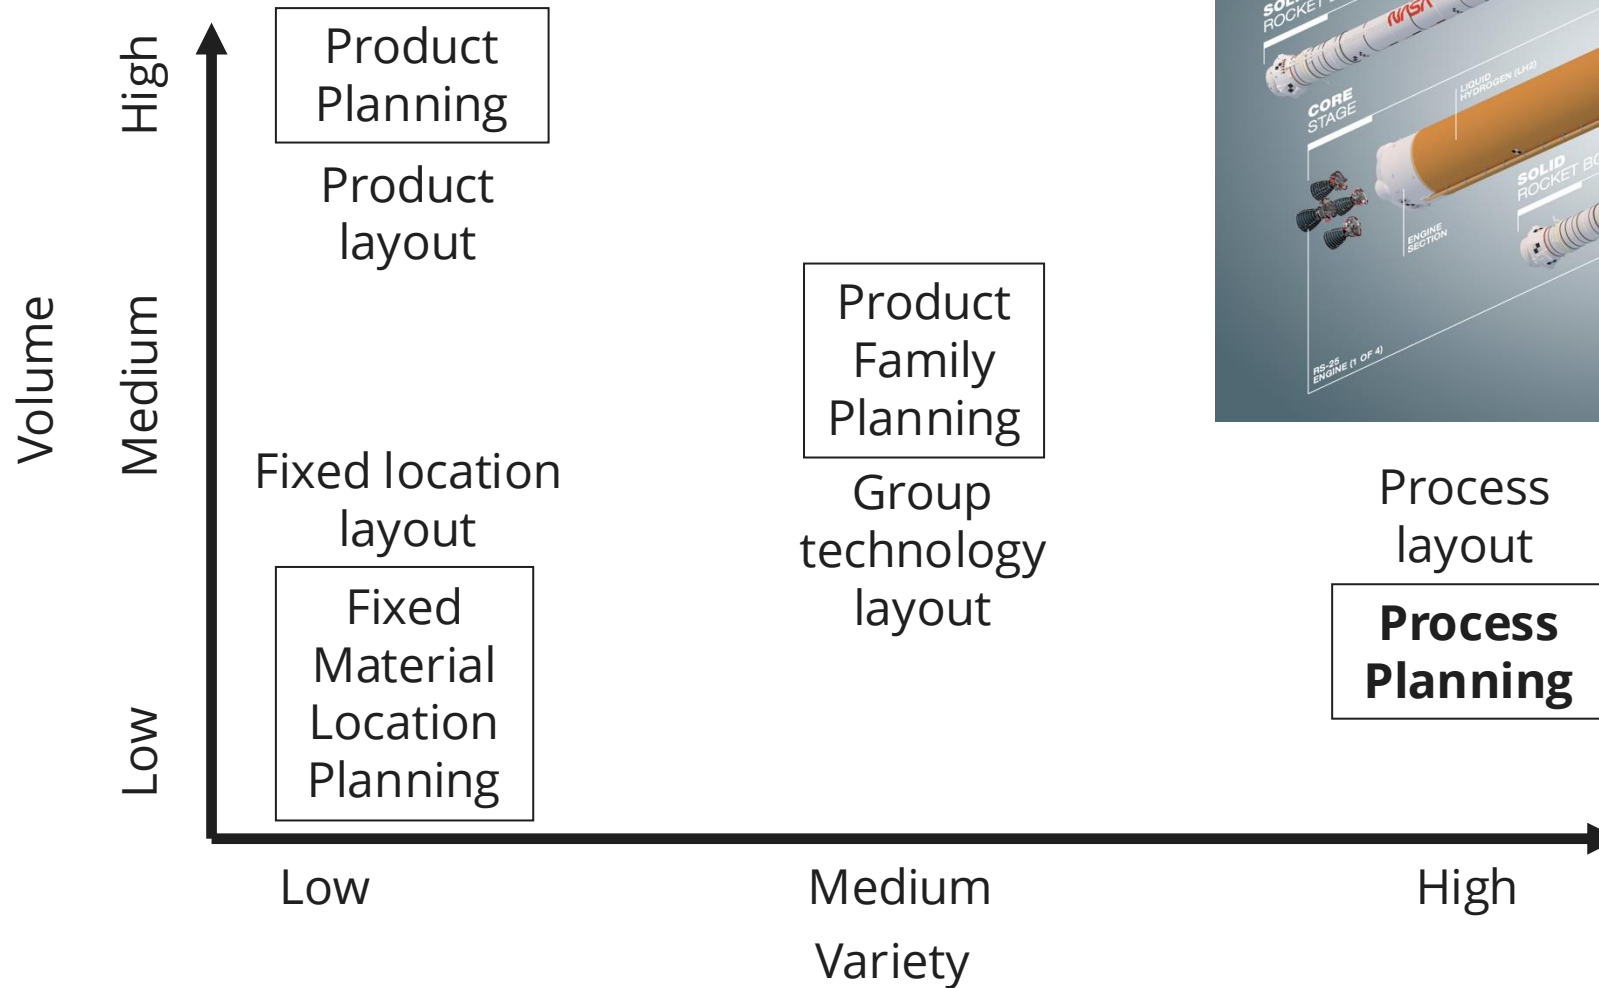

FTZ vs Bonded Warehouse:



Feature	FTZ Warehouse	Bonded Warehouse
Duty Deferral	Duties and taxes are deferred until goods enter the domestic market.	Duties are deferred until goods leave the warehouse for domestic distribution.
Manufacturing & Manipulation	Allows repacking, relabeling, light assembly, and sometimes full manufacturing.	Limited to basic storage and repacking.
Export Benefits	Ideal for goods that will be re-exported, potentially avoiding duties altogether.	Allows duty drawback if goods are re-exported.
Domestic Distribution	Requires customs clearance before goods enter the local market.	More suitable for domestic distribution as goods are already within the customs territory.
Setup Costs & Complexity	Higher setup costs and regulatory requirements.	Easier and less expensive to set up.
Storage Duration	Varies by country; often unlimited in the U.S.	Typically has a time limit (e.g., 5 years in the U.S. and EU, shorter in some Asian countries).

FTZ vs Bonded Warehouse:

FTZ vs. Bonded Warehouse United States

FTZ has full control of goods. 24 hours a day.	Surveillance 	Under continuous CBP surveillance.
Movement of goods is relatively unrestricted in and out of an FTZ. Consolidate weekly imports into one entry, lowering Merchandise Processing Fees due to capped fees.	Movement of Goods 	Movement of goods is limited in a bonded warehouse. Specific customs approval is required for each movement.
Allowed, with potential duty savings based on finished product.	Reforming Goods 	Not allowed.
Duty is reported when goods leave the FTZ.	Reporting 	Duty reported upon withdrawal of goods from the bonded warehouse for domestic use.
Customs formalities deferred until goods exit the FTZ for consumption.	Customs Clearance & Declaration 	Customs clearance required before goods enter or leave the bonded area.
No set limit.	Storage Limits 	Up to five years.
Various types of goods including raw materials, components, finished goods, etc.	Storage Goods Category 	General merchandise, goods subject to duties, taxes, or other restrictions.

FREE TRADE ZONE	VS	BONDED WAREHOUSE
Within US territory but outside US Customs territory.	Location 	Inside US territory and US Customs border.
Typically located near ports, airports, or international borders. US FTZs can be created within existing warehouses.	Customs Jurisdiction 	Secured facilities throughout the US.
Governed by the Foreign-Trade Zones Board under the U.S. Department of Commerce.	Competent Authority 	Managed by U.S. Customs and Border Protection (CBP).
Established under the Foreign Trade Zones Act of 1934.	Foundation of Law 	Governed by Title 19 of the U.S. Code and CBP regulations.
Goods considered outside U.S. customs territory.	In/Out Warehouse 	Imported goods awaiting customs clearance.
Foreign and domestic goods may be placed in a FTZ.	Permissible Cargo 	Only foreign goods may be placed in a bonded warehouse.
Duties and taxes are deferred, reduced, or eliminated on imported goods.	Tax Concession 	Duties and taxes are deferred until goods leave the bonded area for consumption.
Secure perimeter with CBP oversight, specific requirements vary by zone.	Security 	Security measures in place to prevent theft, loss, or unauthorized access.

Summary of Module 2

- Product design: which products will be produced and their detailed design
- Process design: how the product will be produced
- Schedule design: when and how much to produce
- Information gathering and representation
- Requirement calculation

