SHEET 1 OF 1

## **HISTORY**

CORNER ORIGINALLY SET BY JOSEPH AND JOHN TRUTCH UNDER GLO CONTRACT #50 DECEMBER 23, 1855.

TRUTCH SET A POST FOR CORNER WITH THE FOLLOWING REFERENCES:

12" MAPLE N35°W AT 7 LINKS

8" MAPLE N77°E AT 32 LINKS

12" MAPLE S50°E AT 40 LINKS

8" FIR S43°W AT 17 LINKS

#### MARCH 23, 1948 LONGVIEW FIBRE CO. SURVEY CS #3384 SURVEYOR: UNKNOWN

NOTED ON SURVEY, CORNER SEARCHED FOR NOT FOUND.

### JUNE 10, 1952 BEARING TREE BK. LF PG. 2 BY O.R. MILLER

FOUND THE ORIGINAL FIR BEARING TREE FOR THE SECTION CORNER. THIS BEARING TREE IS DOWN AND DEAD. CRUISER MARKS SHOWN ON THE TRUNK OF THE TREE. THESE MARKS WERE WELL OVERGROWN INDICATING THAT THEY WERE PLACED THERE MANY YEARS AGO. THE ORIGINAL FACE ON THIS TREE IS DECAYED AND BURNED. NO SCRIBE MARKS SHOW. ROLAND MASTEN'S CRUISER MARK ARE PRESENT ON A STUMP, EAST OF CORNER APPROX. 10 TO 15' WE ARE CONVINCED BEYOND A DOUBT THAT THIS IS THE WITNESS TREE FOR THIS SECTION CORNER. FROM THE BEARING AND DISTANCE AS RECORDED IN THE ORIGINAL FIELD NOTES WE DROVE AN IRON PIPE AT THE POSITION OF SECTION CORNER.REFERENCED THIS CORNER AS FOLLOWS:

20" FIR STUMP N42°W AT 45.5' SCRIBED [S13BT] WITH YELLOW LOCATION TAG 8" FIR STUB S81°E AT 20.0' SCRIBED [S19BT] WITH YELLOW LOCATION TAG 4" CHERRY N76°E AT 30.2' SCRIBED [S18BT] WITH YELLOW LOCATION TAG

NOTE: NO OTHER REFERENCES AVAILABLE. THIS CORNER IS LOCATED 57' WEST OF A NORTH SOUTH ROAD AND APPROX. 10' NORTH OF AN EAST WEST FENCE. WITNESS: J.G. RODGERS

ALSO FOUND IN BEARING TREE BK. B PG. 216

JULY 1978 LONGVIEW FIBRE CO. SURVEY CS #3057 SURVEYOR: C. WAYNE COOK

NOTED ON SURVEY FOUND 1 1/4" IRON PIPE

MARCH 1979 CROWN ZELLERBACH & LONGVIEW FIBRE CO. SURVEY CS #3082 SURVEYOR: C. WAYNE COOK

NOTED ON SURVEY FOUND 1 1/4" IRON PIPE


NOVEMBER 1979 OREGON DEPT. OF FORESTRY SURVEY CS #3157 SURVEYOR: LOREN STEELE

NOTED ON SURVEY FOUND 1 1/2" IRON PIPE SET BY LONGVIEW FIBRE CO. 1952

# **CORNER RESTORATION SURVEY**

SECTION CORNER COMMON TO SECTIONS 18,19,13 & 24 T5N, R3W & RW4, W.M.

AUGUST 15, 2016

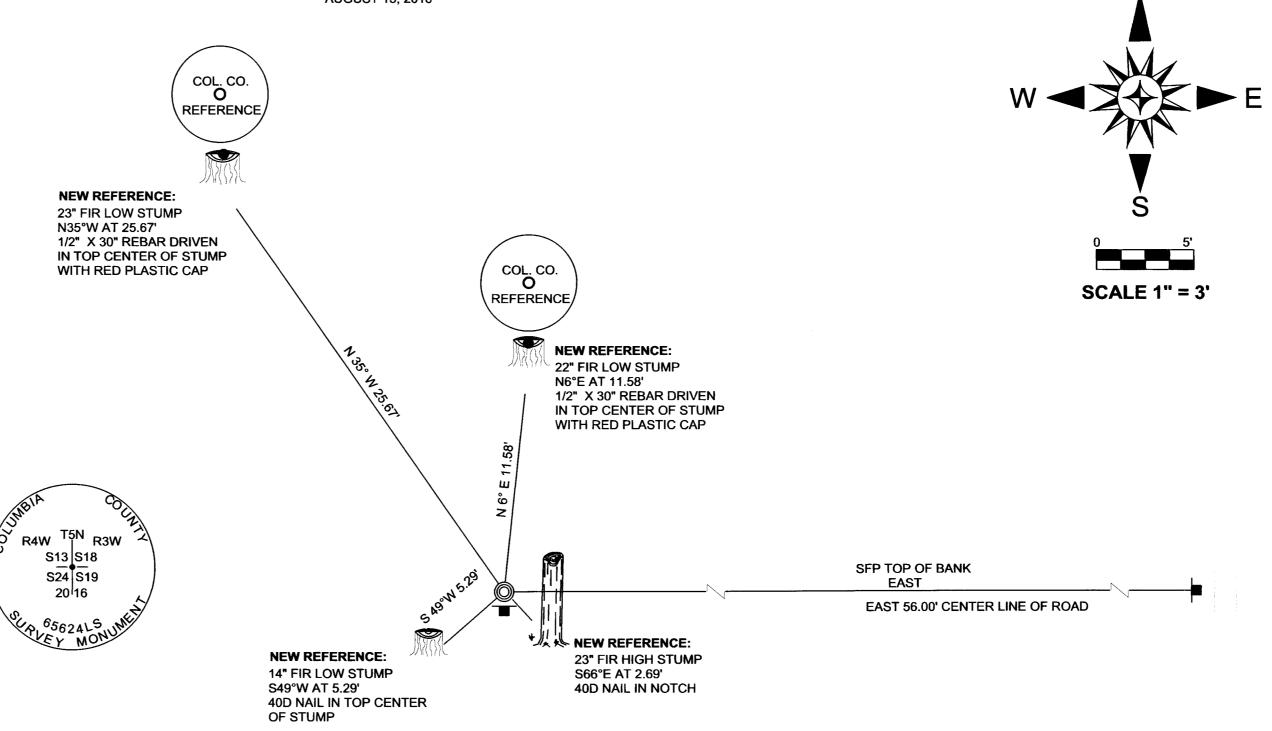

THE PURPOSE OF THIS CORNER RESTORATION WAS TO ADD ADDITIONAL REFERENCES FOR THE LOCATION OF THE SECTION CORNER COMMON TO SECTION 18, 19, 13, AND 24, TOWNSHIP 5 NORTH RANGE 3 AND 4 WEST. THE REHAB OF CORNER WAS PERFORMED TO PERPETUATE THE LOCATION OF ORIGINAL GOVERNMENT LAND CORNER SET DURING GLO CONTRACT #50. WE ALSO ESTABLISHED GPS COORDINATES AS PART OF AN ON GOING GIS MAPPING PROJECT FOR COLUMBIA COUNTY. WE SET A 1 1/4" GALVANIZED IRON PIPE OVER EXISTING FOUND 1" STAINLESS STEEL PIPE. A 3 1/4" ALUMINUM CAP STAMPED AS SHOWN ABOVE FIRMLY ATTACHED TO TOP OF NEW PIPE.

**NARRATIVE** 

# LEGEND

SET 1/2" X 30" REBAR WITH RED PLASTIC CAP
MARKED "COL. CO. REFERENCE"

SET 1 1/4" X 30" GALVANIZED IRON PIPE
WITH 3 1/4" ALUMINUM CAP STAMPED AS SHOWN

STEEL FENCE POST SOUTH 1.0'

STEEL FENCE POST EAST AT 24.9'

## NAD83(91) STATE PLANE COORDINATES; ZONE 3601

COLUMBIA COUNTY SURVEYOR'S OFFICE

**CORNER RESTORATION SURVEY** 

N 828792.33 E 7536964.21 (IFT)



(503) 397-2322

FIELD CREW

Nathan A. Woodward
David Leader Jr

SCALE:
DATE:
5 Ft/In

AUGUST 15, 2016

David Leader Jr
: 5 Ft/In DATE:
AUGUST 15, 2016

CHECKED BY: DRAFTED BY: SHEET
Nathan A. Woodward Robert L. Johnson 1/1

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
NATHAN A. WOODWARD
JULY 12, 2005
65624LS

EXPIRES: 06/30/2018