INCH-POUND

MIL-V-28936A(MC)

September 30, 1994

SUPERSEDING
MIL-V-28936(MC)
29 October 1969

MILITARY SPECIFICATION

VEST, MAN'S, DRESS, BACKLESS (OFFICER'S)

1. SCOPE

1.1 Scope. This specification covers requirements for optional backless vests in scarlet (General Officer's) and white for special occasions.

1.2 Classification. The vests are provided in one type, two classes (colors) and one size.

Class 1 - Scarlet (General Officer's)
Class 2 - White (Officer's-Special Occasions)

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and Standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications (DODISS) and supplement thereto, cited in the solicitation. (see 6.2)

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

SPECIFICATION

FEDERAL

A-A-50196	-	Thread, Silk
A-A-50198	-	Thread, Cotton Gimp, Buttonhole
A-A-52094	-	Thread, Cotton
A-A-55126	-	Fastener Tape, Hook and Pile, Synthetic
DDD-L-20	-	Label; For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	-	Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-368	-	Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-3461	-	Buttons, Insignia, Metal, Uniform and Cap
MIL-W-5664	-	Webbing, Textile, Elastic, Cotton
MIL-C-21115	-	Cloth, Tropical, Wool, Polyester/Wool
MIL-C-44296	-	Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191	-	Textile Test Methods
FED-STD-751	-	Stitches, Seams and Stitchings

MILITARY

MIL-STD-105	-	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	-	Marking for Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications and standards are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094).

2.2 Non-Government publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise specified, the issues of documents which are DOD adopted shall be those listed in the issue of the DODISS cited in the solicitation.

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951- Standard Practice for Commercial Packaging

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

(Application for copies should be addressed to American Society for Testing of Materials, 1916 Race Street, Philadelphia, PA 19103.)

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents may also be available through libraries or other informational services.)

2.3 Order of precedence. In the event of conflict between the text of this document and the references cited herein, the text of this document shall take precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor. Variation from the specification may appear in the sample, in which case the specification shall govern.

3.2 First article. Unless otherwise specified (see 6.2), before production is commenced, a finished vest shall be submitted to the contracting officer or his authorized representative for approval. The approval (see 6.4) of the first article authorizes the commencement of production, but does not relieve the contractor of responsibility for compliance with all provisions of this specification. The first article shall be manufactured in the same facilities to be used for the manufacturer of production items.

3.3 Materials.

3.3.1 Basic material. The basic materials for the two classes of vests shall be as follows:

Class - 1 Cloth, wool, tropical, scarlet shade 2502, 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

Class - 2 Cloth, cotton, pique , single and plied yarns, white shade 2401, mercerized finish, 5.4 ounce, preshrunk, with a minimum of 120 threads per inch in the warp and 138 per inch in the filling. The warp shall be made up of 2 ply and singles yarn and the filling shall be singles yarn with a minimum of 36 stuffer threads in the warp and 102 threads in the filling (ground). The color shall be white shade 2401.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

3.3.2 Cloth, rayon, twill. The material for the pockets, eyelet reinforcement and inside eyelet opening shall be rayon, scarlet shade 2506, for class 1 vest and white shade 2401 for class 2 vest, 4.5 ounce, conforming to class 3 of MIL-C-368.

3.3.3 Cloth, fusible. The fronts, facings and pocket welts shall be interlined with fusible cloth conforming to type 5, class 1, style B of MIL-C-44296.

3.3.4 Elastic Webbing. The elastic webbing for the rear adjustment straps shall be 1-1/8 inches wide in black for the class 1 vest and white for the class 2 vest. The webbing shall conform to class 1 of MIL-W-5664 except for the width requirement.

3.3.5 Tape. The tape for the breakline of the lapel and for reinforcing the folded edge of the pocket welt shall be cotton, 1/4 inch wide, conforming to type III, class 2 of DDD-T-86. The color shall be white or natural shade.

3.3.6 Fastener tape. The fastener tape (velcro) for closing the neck straps shall be red No. 3852 for class 1 and white No. 3054 for class 2, 1/2 inch wide, cut 4-1/2 to 4-3/4 inches long and conform to type I class 1 of A-A-55126.

3.3.7 Thread. The thread for the class 1 vest shall be silk for machine sewing conforming to type I, size A, 3 ply of A-A-50196 and cotton, mercerized finish ticket No. A, 3 ply conforming to type III of A-A-52094 for inside seaming and stitching. The color shall be scarlet shade W, Cable No. 66040. The thread for the class 2 vest shall be cotton soft finish, white (bleached), ticket No. 40, 3 ply conforming to A-A-52094.

3.3.8 Gimp. The buttonhole gimp shall be cotton, scarlet shade for class 1 and white for class 2, ticket No. 8, soft or glazed finish, conforming to type I or type II of A-A-50198.

3.3.9 Buttons. The buttons shall be metal, gold plated, 22-line, regular shank, conforming to type I, style 4, class A of MIL-B-3461. Each button will be attached to the vest using a ring fastener or toggle.

3.3.10 Hardware. The buckle and slides shall be made of brass or bronze, nickel plated, and shall conform to the design and dimensions shown on figure 1. Custom Crafters, Inc., 815 North Mountain Road, Newington, CT, 06111 style No's Z-301 buckle and Z-200 slide meet these requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

3.3.11 Label. Each vest shall be provided with an identification label conforming to type VI, class 1 of DDD-L-20. The content and format shall be as follows:

Nomenclature
Name of contractor
Fiber products identification

3.4 Design. The vest shall be the U. S. Marine Corps design shown on figures 2 and 3, a backless style with adjusting rear waist straps of elastic, worked eyelets for detachable buttons on the right front and matching buttonholes on left front, two hanging pockets with welts, shawl type lapel and adjustable neck strap.

3.5 Patterns. A standard pattern will be furnished to the contractor by the Government. The pattern will not be altered in any manner and shall be used as a guide in cutting the working patterns. The standard pattern provides for a 1/4 inch allowance for all seams and are marked and notched for cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. The vests shall be cut from the specified materials in accordance with the pattern parts as follows:

Pattern Nomenclature

Item	Material: basic	No. of Cut Parts
1.	Front	2
2.	Front facing	2
3.	Pocket welt	2
	Material: interlining (fusible)	
4.	Front	2
5.	Facing	2
6.	Pocket welt	2
	Material: rayon lining	
7.	Eyelet reinforcement	1
8.	Eyelet opening, Bearer	1
9.	Pockets	4

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

3.6 Construction

3.6.1 Manufacturing requirements. The vests shall be manufactured in accordance with the operations and the stitch, seam and stitching type specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in table I, but all operations specified shall be used in the manufacturing of the vests.

3.6.1.1 Stitches, seams and stitchings. The stitch, seam and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I indicate the minimum and maximum number permitted.

3.6.1.2 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch; thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of the vest shall be shade marked to insure a uniform shade throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive type tickets where adhesive causes discoloration or whose adhesive mass adheres to the material upon removal of the tickets.
(d) Any marking medium which tends to leave a permanent mark.

3.6.3. Fusing operation. The fusing operations for fusing the interlining to the basic fabric should be performed on a fusing press. Specific settings for the machines used should be obtained from the supplier of the fusible material. Tests shall be as specified in 4.5.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut vest in strict accordance with patterns furnished. b. Cut all materials in the direction indicated by the directional lines on the pattern. c. Cut all component parts of the vest from one piece of material except the eyelet reinforcement pieces and pocket stays may be cut from ends. d. Cut the elastic webbing 24 inches long. e. Cut the velcro fastening tape 4-1/2 to 5 inches long. f. The use of drill holes is prohibited.					
2	Replacement of damaged parts. a. Replace at time of cutting any part damaged, such as holes, or seriously weakening defects such as smashes, multiple floats and slubs likely to develop into holes. b. Replace any part damaged during manufacturing process by needle chews, which may develop into a hole,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. (cont'd) scissors of knife cuts, tears holes, mends or burns.					
3	Shade marking. a. Mark or ticket component parts cut from basic material in order to ensure proper assembly and a uniform shade throughout. b. Adhesive tickets, when used shall be adhered to the inside.					
4	Make welt. Finished appearance. The welt shall be uniformly made and stitched, and shall finish smooth and flat without twists, puckers or pleats. a. The welt shall be made of a single ply of basic material, with fusible, folded in half lengthwise and reinforced at the inside with 1/4 inch wide cotton tape. b. Position the tape lengthwise on the welt piece with one edge even with the fold notch and seam 1/16 inch from the inside edge.	301	SSaa-1	10-14	40	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make welt. (cont'd)					
	c. Fold the welt lengthwise to the outside and close the end of the welt with a 1/4 inch seam. Trim the corners for turning.	301	SSe-2 (a)	10-14	40	40
	d. Turn the welt to the right side completely working out the seamed edges and corners. Top stitch the welt uniformly 1/16 inch from the seamed and folded edges. In the finished vest, the welt shall finish with the reinforcement tape stitched to the welt.	301	SSe-2 (b) OSf-1 (fold)	10-14	40	40
5	Make fronts.					
	a. Position the left and right front interlining on the underside of the respective vest front and fuse.					
	b. Position facing rayon eyelet reinforcement piece on the inside of right front with front bottom edges even. Stitch the plies together 1/8 inch from bottom and front edges.	301	SSa-1	10-14	40	40
	c. Position a 1-inch wide by 6 inch long strip of fusible material on the upper back edge of lining covering the raw edges and fuse.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Set welt and hanging pocket. Finished appearance. The welt and hanging pocket shall be set to the fronts smooth and flat without twists, gathers, puckers, raw edges or distortion. a. Mark the fronts for the positioning of the pockets in accordance with marks on the pattern. Mark the welt 1 ± 1/8 inch from the folded edge for proper seaming to fronts. b. Position the welt on the outside of the front with the pocket stay on the underside and with the mark on the welt and front matching.					
	c. Seam the welt to the front at the mark through the stay piece.	301	SSa-1	12-16	40	40
	d. Position one piece of pocket fabric on the outside of the front with one edge placed under the welt and abutting the welt seam. Seam the pocket through the pocket stay 3/8 inch from the raw edge of the pocket.	301	SSa-1	12-16	40	40
	e. Cut the pocket opening midway between the seams and tongue notch each end of the opening. The cutting of the opening shall not extend beyond					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I. MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Set welt and hanging pocket. (cont'd)					
	the ends of the welt.					
	f. Turn the pocket and the raw edge of the welt through the opening with the folded edge of the welt toward the top of the front.					
	g. Position the other piece of pocket on the inside of front, even with the raw edge of welt. Seam together 3/8 inch from raw edge.	301	SSa-1	12-16	40	40
	h. Close the pocket along the side and bottom edges. The distance between the lines of tacking at the sides shall be the width of the pocket opening. The bottom edge shall be 3/8 to 1/2 inch from the raw edge.	301	SSa-1	12-16	40	40
	i. Tack the ends of welt to the front through the pocket stays. The stitching shall be over the edgestitching of the welt.	301	SSa-1	12-16	40	40
7	Dress left front and left facing.					
	a. Dress left front and left facing the full length of the eyelet stand as indicated by the mark on the pattern. This operation may be performed					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Dress left front and left facing. (cont'd)					
	in the cutting operation.					
8	Stitch bridle tape to lapel.					
	Finished appearance. The bridle tape shall be stitched along the breakline with the proper tensions to allow the lapel to roll properly in the finished vest.					
	b. Position the 1/4 inch wide bridle tape on the underside of the fronts along the breakline of lapel and with the front edge of the tape in line with the breakline. The tape shall extend from the gorge to approximately 1 inch above the lower edge of lapel.					
	c. Stitch the tape through the front of the vest evenly, smoothly and with normal tension, holding the tape taut and working in 1/2 to 5/8 inch of fullness along the breakline. The tape shall be stitched 1/16 inch from each edge.	301	SSau-2	12-16	40	40
9	Make eyelet opening.					
	a. Position the eyelet opening bearer on the outside of the right front facing in accordance with	301	SSe-2 (a)	12-16	40	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I. MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Make eyelet opening. (cont'd) the marks on the pattern. Stitch lining piece to facing from upper to lower marks with two rows of stitching 3/8 inch apart. Cut an opening through the lining and facing between the stitch lines, tongue notching both ends.					
	b. Turn lining to the inside of the facing and edgestitch 1/16 to 1/8 inch from the seamed edge. Tack each end of eyelet opening.	301	SSe-2 (b)	12-16	40	40
	c. Stitch the back raw edge of lining to the front edge of eyelet stand with 1/8 inch seam. Trim excess lining if necessary.	301	SSa-1	12-16	40	40
10	Make eyelets in right front. Finished appearance. The eyelets shall be worked with the purling on the outside of the front and shall finish with 1/8 inch diameter opening. All stitches shall be securely caught in the fabric. Eyelets shall be 5/8 inch from the front edge and evenly spaced. a. Mark location of four eyelets, (using the marker) in right front for					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Make eyelets in right front. (cont'd)					
	removable buttons to properly align with eyelet buttonholes in left front, in accordance with marks on the patterns.					
	b. Make an eyelet at each mark on the right front, through front and reinforcement stay positioned on the underside of front.	Eyelet		22 min per eyelet	40	40
11	Join facing-lining to front with tapes.					
	Finished appearance. The facings and the fronts shall be joined in such a way to produce smooth flat seams without pleats, puckers or gathers in the vest.					
	a. Position facing-lining on the outside of the respective fronts, with the upper edge of neck extension and front edges even.					
	b. Join facing-lining to the front with a 1/4 inch seam with the stay tape on the inside of the front 1/8 inch from the edge and caught in the stitching. The line of stitching shall extend from the ends of the neck extension, along the front and bottom edge, to the side edge.	301	SSab-1	12-16	40	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I. MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11	Join facing-lining to front with tapes. (cont'd) Continue closing and taping the back edge of the front and facing, leaving an opening between the notches in the armhole for turning. The stay tape is not required along the right front where the eyelet reinforcement stay is located.					
12	Finish front. Finished appearance. Fronts shall finish smooth and flat without distortion. The edgestitching shall be of uniform width without twisting, pleating or puckering.					
	a. Edgestitch the vest along the armhole, top, front and bottom edges. The edge stitching shall be 1/16 inch from all edges.	301	SSa-1	12-16	40	40
	b. Press the edges of lapel, top, front and bottom edges of vest with a heated pressing machine, removing the fullness. Turn lapel back and crease along the breakline smooth and flat.					
	c. Tack the upper and lower rounded corners of the lapel to the fronts,	301	SSa-1	12-16	40	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Finish front. (cont'd) through all plies, in line with the edgestitching for a distance of approximately one inch.					
13	Attach slides.					
	a. Attach a slide to each bottom side edge of the vest front by inserting the end into the first loop of the slide for 1/2 inch and topstitch to the inside front with a 1/16 to 1/8 inch stitch.	301	SSa-1	12-16	40	40
14	Attach webbing.					
	a. Attach the 24 inch piece of elastic webbing to the left front slide by looping the elastic through the open loop, turning the webbing under and top stitching with a 1/16 to 1/8 inch stitch. The other end of the elastic shall be turned under and topstitched.	301	SSa-1	12-16	40	40
15	Attach the third slide.					
	a. Feed the end of the elastic through both loops of the third slide, then through the loop on the right side and back through the underside of the third loop. (see Figure 1)					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I. MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Attach velcro to neck straps.					
	a. Attach the pile piece of velcro to the underside of the right neck strap extension and the hook piece to the topside of the left neck strap extension. Velcro to be centered on their respective neck extensions, 1/4 inch from the ends and stitched 1/16 inch around all edges without causing any bulging or distortions.	301	SSa-1	12-16	40	40
17	Make buttonholes.					
	Finished appearance. The buttonholes shall be clean-cut, well made and correctly positioned. The stitching shall be securely caught in the fabric.					
	a. Mark the location for four buttonholes on the left front. Marks will be in accordance with the buttonhole marker provided.					
	b. Make a horizontal, eyelet-end, square-bar type buttonhole, cut 5/8 inch at each mark. The inside edge of the buttonhole eyelet shall finish 5/8 inch ± 1/16 from the front edge.	Buttonhole		60 per button-hole	40	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Make buttonholes. (cont'd)					
	c. The buttonholes shall be well worked over gimp to fit the 22-line button. The gimp shall be pulled through to the underside. The purling shall be on the outside.					
	d. Securely bartack the end of each buttonhole and trim the ends of the gimp.	Bartack		21 per bartack	40	40
18	Attach buttons.					
	Finished appearance. The buttons shall be properly attached/aligned with the buttonholes to secure a smooth closure without bulging or fullness.					
	a. Insert the buttons through the eyelets and attach with rings or toggle pins.					
19	Clean vest.					
	a. Trim all ends of stitchings and remove all loose threads from the vest.					
	b. Remove all spots, shade tickets, and stains from the vest without injury to the vest.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Press vest. Finished appearance. Pressing shall be done with a heated pressing machine of a type suitable to obtain the required shape and appearance in accordance with good manufacturing practice. a. Press the entire vest removing all wrinkles.					

3.7 Workmanship. The vests shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4)
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Inspection shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated vest for all provisions of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. (see table II)

4.5.2 In-process inspection. Inspection will be made at any point or during any phase of the manufacturing process to determine whether operations or assemblies are performed as specified herein. The Government reserves the right to exclude from consideration for acceptance any material or service for which in-process inspection has indicated non conformance.

4.5.3 Examination of end item. The end item shall be examined for defects listed in 4.5.3.1 and 4.5.3.2.

4.5.3.1 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes and eyelets (construction)	a. One or more omitted/added.	101		
	b. Wrong type buttonhole or eyelet.	102		
	c. Buttonhole or eyelet not securely caught on fabric causing stitching to pull away from fabric.	103		
	d. Not proper size: - too small or too large for button.	104		
	e. Bartack omitted or loose.	105		
	f. Bartack misplaced.	106		
	g. One or more broken stitches in: - one buttonhole.			301
	- two or more buttonholes.		201	
	- one eyelet.			302
	- two or more eyelets.		202	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes and eyelets (construction) (cont'd)	h. More than two skipped stitches in one or more buttonholes or eyelets:			
	- buttonholes.		203	
	- one eyelet.			303
	- two or more eyelets.		204	
	i. Gimp omitted in buttonhole(s).			304
	j. Ragged edges affecting appearance.			305
	k. Poorly made affecting appearance.		205	
	l. Ends of gimp not pulled through to the underside of one or more buttonholes.			306
	m. Stitches per buttonhole less than minimum specified:			
	- one or two stitches.			307
	- three stitches.		206	
	- four or more stitches.	107		
	n. Any uncut buttonhole.	108		
Buttons or toggles	a. Missing, loose or defective:			
	- one button or toggle.	109		
	b. Not specified size or type.		207	

Note: Buttons shall be considered defective if they have sharp, rough or cracked edges, scratches, blemishes or imbedded foreign matter on face side of button, loose shank or badly shaded.

Cleanness	a. One or more removable spots or stains clearly noticeable:			
	- on outside.	110		
	- on inside.			308
	b. One or more spots or stains obvious permanent nature.	111		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine		Defects	Classification Major	Minor A	Minor B
Cleanness (cont'd)	c.	Thread ends not trimmed, loose threads, two or more shade tickets not removed.			309
Components and assembly	a.	Any defective component or assembly defect.		208	
	b.	Any component part or required operation omitted.		209	
Cutting	a.	Any component part of basic material not cut in accordance with directional lines on pattern or per specification requirement.	112		
Material defects and damages	a.	Any weakening defect such as smash, multiple float, loose slub etc, that may develop into a hole.		210	
	b.	Any hole.		211	
	c.	Shade bars,unsightly slubs.		212	
	d.	Needle chews which might develop into holes.		213	
	e.	Scissors or knife cut, tear, mend or burn.		214	

Note: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening on non-weakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defects - No defect
Workmanship damages - Minor B defect

Pressing	a.	Burned or scorched.		215	
	b.	Pressing omitted (entire garment).		216	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Pressing (cont'd)	c. Poorly pressed.		217	
	d. Basting or pressing impressions not removed on major portion of vest.			310
Seams and stitching	a. Accuracy of seaming.			
	1. Seams twisted, puckered or pleated affecting appearance.		218	
	2. Part of garment caught in unrelated stitching.		219	
	3. Thread breaks or ends of all stitching (when not caught in other seams/ stitching not securely backstitched.		220	
	4. Wrong shade or two shades of thread used on outside of vest.	113		
	b. Gage of stitching.			
	1. Irregular, i.e, uneven gaged or various stitching not uniform affecting appearance.		221	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			311
	c. Open seams.			
	1. On outside: - up to 1/4 inch inclusive. - more than 1/8 inch but not more than 1/4 inch. - more than 1/2 inch.	114	222	312

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	2. On inside: - up to 1/4 inch or more but not more that 1/2 inch.			313
	- more than 1/2 inch.		223	
	d. Raw edges.			
	1. On outside: - up to 1/8 inch inclusive.			314
	- more than 1/8 but not more than 1/4 inch.		224	
	- more than 1/4 inch.	115		
	2. On inside: - more than 1/4 inch but not more than 1/2 inch.			315
	- more than 1/2 inch		225	

Note: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under on overedge stitched.

	e. Seam and stitch type.			
	1. wrong seam type.			316
	2. wrong stitch type.			317
	f. Stitch tension.			
	1. loose, resulting in loose seam.			318
	2. loose tension on edge or raised stitching resulting in loosely exposed bobbin thread or top thread.		226	
	3. tight tension (stitches break when normal strain is applied to seam or stitching).		227	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
	Note: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting normal pull in the lengthwise direction of seam on stitching.			
	g. Stitches per inch less than minimum:			
	- one or two stitches.			319
	- three stitches.		228	
	- four or more.	116		
	Note: To be scored when condition exists on major portion of seam.			
	h. Stitches skipped or broken.			
	1. More than 1/4 inch but not more than 3/4 inch.			320
	2. More than 3/4 inch.		229	
Shaded parts	Any outside part shaded.			321

4.5.3.2 Detailed defects applicable to specific parts. Detailed defects shall be classified as follows:

Alignment and position of buttonholes	Outside of vest.			
	a. Buttonhole not in same horizontal line as eyelet by more than 1/4 inch.	117		
	b. Position of buttonhole from front edge:			
	- less than 1/2 inch or more than 3/4 inch.	118		
Lapels	a. Lapel facings.			
	1. Twisted, short or tight, causing lapels to curl out affecting appearance.	119		
	2. Fullness or puckers affecting appearance.	120		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Lapels (cont'd)	b. Lapel edges.			
	1. Bulky or irregular or not properly forced out causing crooked edges, affecting appearance.	121		
	2. Front part exposed on lapel edge affecting appearance.		230	
	c. Bridle tape.			
	1. Misplaced, not serving intended purpose.	122		
	2. Tape partly on creased edge or on lapel side.	123		
	d. Lapel shape.			
	1. Not uniform, i.e., left and right top edge varies in length by 1/4 inch or more.	124		
	2. Lapels poorly shaped or not of uniform size or shape.		231	
Welt pockets	a. Construction and setting.			
	1. Top edge of welt short, causing puckers in front to be loose causing welt to gap, affecting appearance.		232	
	2. Tape along creased edge omitted.		233	
	3. Tape stitching exposed and visible on outside of vest.		234	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Welt pockets (cont'd)	4. Poorly shaped or not uniform in shape or size, affecting appearance.		235	
	5. Irregular in width by more than 1/8 inch.		236	
	6. Topstitching of welt omitted.		237	
	b. Pocket alignment and dimensions.			
	1. Welt pockets out of horizontal alignment: - by more than 1/4 inch.	125		
	2. Finished width of welt less than 7/8 or more than 1-1/8 inch.		238	
Front and bottom edges	a. Front edges stretched, affecting appearance.		239	
	b. Bottom edge stretched, puckered or uneven, affecting appearance.			322
	c. Fronts rolling outward below lower button.		240	
	d. Front edge irregular or not properly forced out causing crooked or curved edges, affecting appearance.		241	
	e. Facing exposed on left front edge affecting appearance (score only when clearly noticeable and the condition exists along major portion of seam).		242	
	f. Bottom corner of one or both fronts poorly shaped affecting appearance.	126		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front facings	a. Short, tight or twisted causing excessive fullness or twists on front.	127		
	b. Facing long, causing bottom corner to curl up.	128		
Identification label	a. Omitted.	129		
	b. Incorrect or illegible.		243	
	c. Not stitched on four sides.			323

4.5.3.3 Inspection levels and AQL's. Inspection levels and acceptable quality levels will be as stated in the contract or purchase order.

4.5.4 Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outer fabric shall be tested once every 4 hours as follows at each fusing press to determine that adequate fusing is being obtained. Prepare a test sample by fusing the fusible specified under the same fusing conditions to be used for the manufacturer of the vest. Determine the bond strength of the test sample with a commercial string scale (see 6.7). If the bond strength on any test sample is less than 22 ounces per inch of width, the fusing conditions shall be corrected and the bond strength test shall be repeated. Those units represented by this test shall be fused and retested again. If they fail, they shall be rejected.

5. PACKAGING

5.1 Preservation. Preservation shall be commercial in accordance with ASTM D 3951.

5.2 Packing. Vests preserved as specified in 5.1 shall be commercial packed in accordance with ASTM D 3951.

5.3 Marking. In addition to any special marking required by the contractor or purchase order, shipping containers shall be marked in accordance with MIL-STD-129.

6. NOTES

(Information in this section is of a general or explanatory nature which may be helpful, but is not mandatory).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

6.1 Intended use. The class 1 vest covered by this specification is for wear by Marine Corps General officer's with the evening dress uniform and the class 2 vest is for wear by officer's during special occasions as required.

6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number and date of this specification.

(b) When first article is required.

6.3 Guide sample. The guide sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 First article. Examination, tests and approval shall be as specified by the contracting officer.

6.5 Figures. Figures 1 through 3 show the general design of the vest and are furnished for information only. In the event of conflict between the figures and the text of this specification, the specification shall govern.

6.6 Fusing conditions. Specific machine settings should be obtained from the supplier of the particular fusible material for optimum results. The following fusing conditions include the recommendations of several suppliers of fusibles and are furnished for guidance only:

(a) Temperature between pressing surfaces of 300° F maximum, at the fuseline (not the temperature at the clock).

(b) Pressure between pressing surfaces of 6 pounds force per square inch (1 lb_f/in^2) minimum and 7 lb_f/in^2 maximum.

(c) Pressing time of 12 seconds minimum and 14 seconds maximum.

(d) Heat-dry.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

6.7 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material, and shall be accomplished 2 hours after fusing.

6.8 Subject term (key word) listing.

Evening dress
Officer's
Waist-coat

Preparing Activity
Navy-MC
Project No. 8405-N234

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

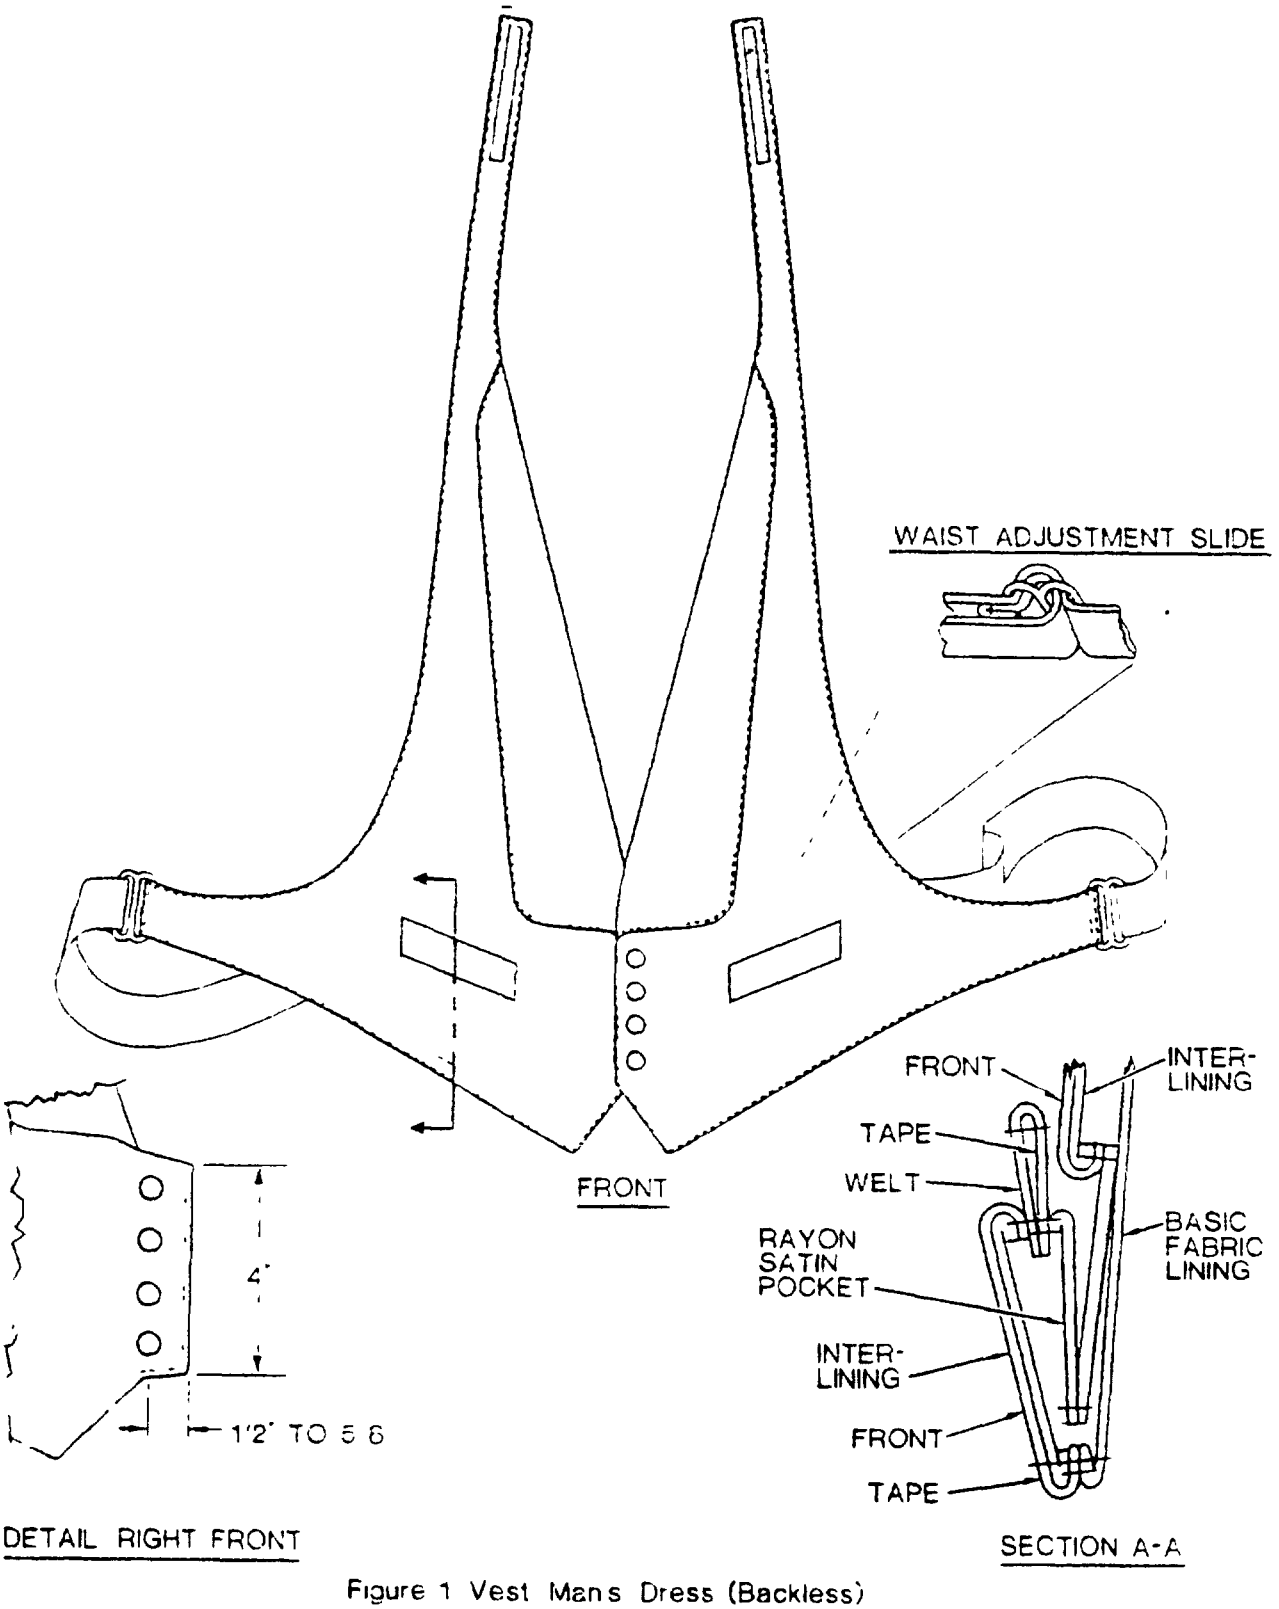


Figure 1 Vest Mans Dress (Backless)

/AGV[illegible]/PALMER/6 CLOTHING VEST001 G4
12 SEP-1994 09 54

True Size 44 x 52 pices = 7 4" x 8 6"
Plot Scale Factor 1 00

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER	2 DOCUMENT DATE (YYMMDD)
	MIL-V-28936A(MC)	30 September 1994

3 DOCUMENT TITLE

VEST, MAN'S, DRESS BACKLESS (OFFICER'S)

4 NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5 REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER	703-640-4584	278-4584
c. ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE, (PSE-C/S), MARCORSYSCOM, 2033 BARNETT AVE SUITE 315, QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

DD Form 1426, OCT 89 *Previous editions are obsolete* 198-290

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:01Z
Check the source to verify that this is the current version before use.