MIL-C-28950A(MC)
6 April 1978

SUPERSEDING
MIL-C-28950(MC)
21 May 1970

MILITARY SPECIFICATION

COAT, MAN'S:DRESS; BLUE (OFFICER'S)

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Department and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for a blue dress coat, with belt.

1.2 Classification. The coats shall be of one type in the following sizes as specified (see 6.2):

Schedule of sizes

Short	Regular	Long	Extra Long
36	36	36	36
38	38	38	38
40	40	40	40
42	42	42	42
	44	44	44
	46	46	

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except the detailed requirements of Section 3, Table I may be modified to the extent necessary for good custom tailoring practices.

2. APPLICABLE DOCUMENTS

*2.1 Issue of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMO-1), Headquarters, U. S. Marine Corps, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic).
V-T-276	- Thread, Cotton.
V-T-280	- Thread, Gimp, Cotton, Buttonhole.
V-T-301	- Thread, Silk.
UU-P-268	- Paper, Kraft, Wrapping.
CCC-C-438	- Cloth, Buckram, Cotton.
DDD-L-20	- Label, For Clothing, Equipage, and Tentage (General Use).
DDD-T-86	- Tape, Textile; Cotton, General Purpose (Unbleached, Bleached or Dyed).

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton.
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon.
MIL-B-371	- Braid, Textile, Tubular
MIL-F-495	- Finish Chemical, Black, For Copper Alloys.
MIL-B-3461	- Buttons, Insignia, Metal, Uniforms and Cap.
MIL-C-3738	- Cloth, Elastique, Wool.
MIL-L-15040	- Labels, Garment (Woven, Rayon).
MIL-C-15062	- Cloth, Flannel, Wool, Undercollar Cloth.
MIL-P-15064	- Pads, Shoulder and Sleeve-Head.
MIL-F-15065	- Coat Fronts.
MIL-B-17757	- Box, Shipping Fiberboard, (Modular Sizes).
MIL-C-43718	- Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon.
MIL-I-45208	- Inspection Systems Requirements.

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods.
FED-STD-751	- Stitch, Seam, and Stitching.

MILITARY

MIL-STD-129	- Marking for Shipment and Storage.
MIL-STD-1490	- Provisions for Evaluating Quality of Coats, Men's Dress

(Copies of specifications and standards required by contractor in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

*2.2. Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the Manual may be obtained from the Superintendent of Documents, U. S. Government Printing Office, Washington, D. C. 20402.)

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D. C. 20036.)

Department of Defense (DOD) Standard Shades for Buttons, 1966

Department of Defense (DOD) Standard Color Card of
Official Standardized Shades for Sewing Threads, 1968

(Copies may be obtained from the Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

3. REQUIREMENTS

*3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

*3.2 First article. When specified (see 6.2), the contractor shall furnish sample coats for first article inspection and approval.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, elastique, conforming to MIL-C-3738, type II, 16 ounce, blue shade 2309, or any other blue cloth of adopted standard (see 6.3 and 6.4).

3.3.2 Lining. The material for lining the coat, standard belt, pocket flaps, buttonhole tab for sword slit, collar and vent; for making the belt fastener; and for the facing of the inside pocket shall be cloth rayon, twill, 3.7 ounce, conforming to class 1 of MIL-C-368. The color of the cloth shall be black shade 2604 (see 6.3).

3.3.3 Undercollar cloth. The sword slit patch and collar tab shall be made of wool flannel, undercollar cloth, conforming to MIL-C-15062. The color of the cloth shall be of an approved shade to closely match the basic material of the coat (see 6.3).

3.3.4 Bias binding. The binding for the upper edge of the front pockets, the back edge of the facings, the raw edge of the button turnup, and the raw edge of seam allowances shall be bias-cut out of the lining material specified in 3.3.2. The bias binding for the seams, facings and bottom turnup shall be 3/4 inch wide, and for the top edge of pockets shall be 1-1/8 inches wide. The binding shall have sized edges.

*3.3.5 Silesia or polyester and cotton. The material for making the inside breast pocket, stay pieces for the front pockets, stays for the armhole and shoulder seams and the lower edge of armhole, inside pocket support, collar interlining, and the reinforcement pieces for the upper front pocket snap fasteners shall be cloth, cotton, silesia conforming to type III of MIL-C-326 or polyester and cotton conforming to type I, of MIL-C-43718. The silesia or polyester and cotton shall be black, The requirements for nonfibrous material and seam efficiency shall not apply.

3.3.6 Belt interlining. The material for interlining the standard belt shall be cloth, cotton, buckram, natural color, conforming to type I, class 2 of CCC-C-438.

3.3.7 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table IV.

*3.3.7.1 Buckram material. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification, thoroughly cleaned, well carded, drawn and evenly spun.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.3.7.2 Weave. The weave of the single plies of the cloth shall be four harness, 2 up and 2 down,herringbone twill, 20 ends right and 20 ends left.

3.3.7.3 Yarns per inch. The two plies of the cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the filling.

3.3.7.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause an objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests specified in Section 4, Table IV.

*3.3.7.4.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests, shall conform to the following when tested as specified in Section 4, Table IV.

Stiffness, inch-pound	Minimum	Maximum
- original	0.60	0.95
- after accelerated aging	0.70	0.95
- after wet (dry) cleaning	0.50	0.85
- after perspiration	0.50	0.85

3.3.7.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see Section 4, Table IV for required tests).

3.3.7.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength. The tests shall be as specified in Section 4, Table IV.

3.3.8 Coat fronts. The coat front shall conform to the requirements for type XI of MIL-C-15065.

3.3. 9 Shoulder pads. The shoulder pads shall conform to type I, class 2, of MIL-P-15064.

3.3.10 Sleevehead pads. The sleevehead pads shall conform to type IV of MIL-P-15064.

*3.3.11 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.3.12 Tape, cotton. The cotton tape shall conform to type III of DDD-T-86; 1/4 inch wide for armholes, back vent and waistseam and 3/8 inch wide for front edges of coat.

3.3.13 Thread.

*3.3.13.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and size F for buttonhole, needle and looper threads, respectively; and size O for machine felling. The thread for hand sewing shall be type III, class 3, size C, 2-ply of V-T-301.

3.3.13.2 Cotton thread. The cotton thread shall conform to V-T-276; type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, overedge stitching, and for belt and belt fastener buttonholes; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes, The thread for basting shall be a good commercial grade.

*3.3.13.3 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

*3.3.13.4 Color and colorfastness. All thread shall be black AA, Cable No. 66043, (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968) except cotton thread for basting and for machine tacking armholes may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

*3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or type II of V-T-280. The color of the gimp shall be black AA, Cable No. 66043 showing good fastness to wet (dry) cleaning.

3.3.15 Buttons.

3.3.15.1 Insignia buttons. The insignia buttons shall be metal, gold plated, officer design, 27-line and 40-line, regular shank conforming to type I, style 4, class A, subclass 1 of MIL-B-3461. Ring toggles for securing buttons to pockets shall conform to MIL-B-3461.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

*3.3.15.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish, conforming to type II, class D, style 4, 22 line, style 20, 34 line, and style 25, 16 line of V-B-871. The color shall be white for the collar, and black shade BT cable No. 62001 for the rest of the coat. (See DOD Standard Shades for Buttons 1966.)

*3.3.16 Fasteners, snap. The snap fasteners for the upper pockets and flaps shall be brass, black japanned finish or black chemical finish in accordance with MIL-F-495, followed by clear lacquer coating, round or square style, rolled edge, size 1/0, sew-on type (see Section 4, Table IV for required tests.).

*3.3.17 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, followed by clear lacquer coating and shall conform to the requirements shown in Figure 1 and the following.

*3.3.17.1 Closure finish. All surfaces and edges of the hook and eye shall be clean, smooth, and free from burrs, tool marks, sharp edges and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in Section 4, Table IV. All apertures of the finished lacquered hook and eye shall be completely open and free of any lacquer film or black chemical finish.

3.3.18 Labels. Each coat shall have an identification label and a size label conforming to DDD-L-20 and a woven instruction lable conforming to MIL-L-15040 and the following. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.18.1 Identification label. The identification label shall be type I, class 1 of DDD-L-20 and shall measure not less than 2-1/2 by 1-1/2 inches. The content and format shall be as follows:

Nomenclature (item description)
Contract Number
Name of contractor
Wool Products Act Information

Note: Size of character for "Name of Contractor" shall be minimum 8 point (approximately 3/32 inch).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.3.18.2 Size label. The size label shall be type I, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long, and Extra Long, and the stock number as shown by the following example:

40R
Stock Number

The stock number may be omitted from the size label but, when omitted, it shall be incorporated in the identification label.

3.3.18.3 Woven instruction label. The woven instruction label shall conform to size C of MIL-L-15040. The content and format shall be as shown in Figure 2. The letters for the caption shall be not less than 5/32 inch in height and all other letters and figures shall not be less than 1/8 inch in height.

3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 3, 4 and 5, a five-button, single breasted, quarter-lined coat with separate belt, having a skirt-type front with side body pieces, waist seam and waist darts, upper patch pockets and lower bellows pockets with worked eyelets for detachable insignia buttons and with flaps to button, a four-piece back with lined vent, ornamental sleeve cuffs, one inside breast pocket with vertical piped opening, shoulder straps to button, and a stand-up collar with single hook and eye for front closure. Coats shall have a sword slit in waist seam at left side with a lined tab on inside to button.

*3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns provide 3/16-inch allowance for seams at the top and front edges of coat, and for pocket flap and shoulder strap seams; 3/4-inch allowance for side seams; 5/8-inch allowance for center back seam and 3/8-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

*3.5.1 Pattern parts. Coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Item	Pattern Nomenclature	No. of cut parts
	Material: Basic	
1.	Front, upper	2
2.	Front, lower	2
3.	Facing, right	1
4.	Side body (front)	2
5.	Facing, left	1
6.	Center back	2
7.	Side back	2
8.	Topsleeve	2
9.	Undersleeve	2
10.	Sleeve cuff	2
11.	Collar (outer ply)	1
12.	Shoulder strap, top ply	2
13.	Shoulder strap, under ply	2
14.	Pocket, upper	2
15.	Pocket, lower	2
16.	Pocket flap, upper	2
17.	Pocket flap, lower	2
18.	Belt (standard)	1
19.	Belt (optional)	1
20.	Sword slit tab	1
	Material: Cloth, rayon lining	
21.	Front	2
22.	Yoke	1
23.	Topsleeve	2
24.	Undersleeve	2
25.	Pocket flap, upper	2
26.	Pocket flap, lower	2
27.	Vent lining	1
28.	Sword slit tab lining	1
29.	Inside breast pocket facing	2
30.	Collar lining	1
31.	Belt lining (standard belt)	1
	Material: Silesia or Polyester and Cotton	
32.	Inside breast pocket	2
33.	Stay, snap fastener	4
34.	Stay, upper pocket	2
35.	Stay, lower pocket	2
36.	Collar interlining	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of cut parts
	Material: Cloth, buckram, cotton (double textured; double ply)	
37.	Collar interlining	1
	Material: Cloth, cotton buckram (single ply)	
38.	Belt interlining (standard belt)	1
	Material: Cloth, flannel, wool	
39.	Sword slit patch	1
40.	Collar tab	1
	Shapers	
41.	Finished pocket shaper, upper	
42.	Finished pocket shaper, lower	
43.	Finished pocket flap shaper, upper	
44.	Finished pocket flap shaper, lower	
45.	Left vent shaper	
	Marker	
46.	Sleeve cuff marker	

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1. Stitches, seams and stitching. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to form the raw edge without cutting the material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitchings shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic material, and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
1.	Cutting. a. Cut coats in strict accordance with patterns furnished. b. Cut all materials in the direction indicated by the directional lines on the patterns. The straight of the cloth indicates the warp direction. c. Cut all wool parts of the coat, including belts, from one piece of basic material, except the following parts may be cut from ends, but when so cut, the parts shall harmonize with the shade of the coat: underply of shoulder straps, sword slit buttonhole tab, belt loops and belt keeper. Belt loops and belt keeper may be banded 1 inch wide. d. Cut fronts, yoke, collar and vent lining parts of the coat and facing for inside pocket from one piece of rayon lining material. All					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
1.	Cutting. (cont'd)					
	other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. The belt lining shall be cut 2-1/4 inches wide, and the belt fastener shall be cut 1-5/8 inches wide. Bias binding shall be cut 3/4 inch wide for edge of bottom turnup, back edge of facings, and for edges of seam allowances and 1-1/8 inches wide for top edge of pockets.					
	e. Cut silesia or polyester/cotton stays for armhole and shoulder seams and lower edge of armholes on the bias. Cut stays for armhole and shoulder seams and lower edge of armholes, 3/4 inch wide and 4-1/2 ± 1/4 inches long for the shoulder and armhole seams and 1-1/4 to 1-1/2 inches long for the lower edge of the armhole.					
	f. Cut belt interlining on the straight 1-5/8 inches wide.					
	g. Cut collar interlining in accordance with the pattern furnished.					
	h. Dress the left vent in accordance with the shaper furnished.					
	i. The use of drill holes is prohibited.					
2.	Replacement of damaged parts.					
	a. Replace at time of cutting any part containing damages such as holes or seriously weakening defects such as smashes, multiple floats, and slubs likely to develop into holes.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
2.	Replacement of damaged parts. (cont'd)					
	b. Replace any part damaged during the manufacturing process by needle chews which may be expected to develop into a hole, scissor or knife cuts, tears, holes, mends, and burns.					
3.	Shade marking.					
	a. Mark all component parts cut from one piece of basic and lining materials, and the pairs of sleeve linings when cut from ends, to insure uniform shade and size throughout the coat.					
	b. The use of tickets with metal fastening devices or sewn-on tickets is prohibited on the rayon lining. (see 3.6.2).					
4.	Make belt loops and keeper.					
	Finished appearance. The belt loops and keeper shall finish 1/2 inch wide and shall finish smooth and flat without pleats, gathers, puckers, or other distortions. The stitching shall be uniformly 1/8 inch from the finished edges.					
	a. The belt loops and keeper shall be made from a 1-inch-wide strip of basic material.					
	b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges, and join the edges together with a covering stitch.	406	EFh-1	12-16	A (silk)	A
	c. Cut the loop for the left and right sides of the coat 5-1/2 inches and 3-1/2 inches long, respectively.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
4.	Make belt loops and keeper. (cont'd)					
	d. Cut the keeper 4-1/2 inches long, fold in half, end to end, and join the ends with a bartack across the width of the keeper. The finished keeper shall measure 2-1/8 ± 1/8 inches from bartack to folded end.	Bar-tack		28 per bartack	A	A
5.	Make belt fastener (standard belt only)(see Figure 6).					
	Finished appearance. The belt fastener shall finish 1/2 to 5/8 inch wide and shall finish smooth and flat without pleats, gathers, puckers or other distortions. The buttonhole shall be clean cut and well made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the fastener.					
	a. The belt fastener shall be made from a 1-5/8-inch-wide strip of rayon lining material.					
	b. Fold the strip in half lengthwise, turn in the raw edges, and stitch 1/8 inch from each side, catching the turned edges in the stitching to form a 1/2- to 5/8-inch-wide band. Cut the fastener 6-1/2 inches long.	301	EFp-2	10-14	A	A
	c. Turn under one end of the fastener 1-1/2 inches and make a horizontal straight type buttonhole cut 5/8 inch long through the center of the turned under portion. The ends of the buttonhole shall be securely tacked.	But-ton-hole		50 per button-hole includ-ing tack)	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
6.	Make standard belt (see Figure 6).					
	Finished appearance. The belt shall be uniformly stitched and shall finish smooth and flat without twists, pleats, puckers or raw edges. The pointed end of the belt shall be well formed with the turned in edges securely caught in the stitching. The buttonhole shall be clean cut and well made.					
	a. The standard belt shall be made of one piece of basic material, lined with rayon lining and interlined with buckram.					
	b. Place the interlining material between the basic and lining materials and seam together uniformly 1/8 inch from upper and lower edges, with the raw edges of lining and basic materials turned in and caught in the stitching. The stitching shall extend from one end of belt to approximately 1-1/4 inches from the opposite end. The lining shall be 1/16 inch back from the finished edge of the belt.	301		12-16	A (silk)	A
	c. Turn the lining and basic materials back at the top and bottom unseamed edges of the belt and trim the interlining approximately 1-1/4 inch back from the end.					
	d. Fold the end of the basic material in half lengthwise to the outside, and stitch across the width of the basic material 1/8 inch from the end.	301	SSa-1	12-16	A (silk) -or- A	A A
	e. Turn the end of the belt, working out the point. Turn under the upper and lower edges of the lining, and seam the lining to the belt 1/8 inch from the folded edges of the belt	301	SSc-1	12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
6.	Make standard belt (see Figure 6). (cont'd)					
	closing the end and forming a point at the center of the finished end.					
	f. Close the opposite end of the belt with serge stitching.	502 or	EFd-1	10-14	A	A
		503	EFd-1	10-14	A	A
	g. The finished width of the belt shall be 1-3/4 (+1/16, -1/8) inches. The finished length of the belt for each size coat shall be as shown in Table II.					
	h. Make a horizontal, straight type buttonhole, cut 5/8 inch long, midway between upper and lower finish edges of the belt to fit a 22 line sewing hole button, with the center of the buttonhole 1 ± 1/8 inch from the buckle end, and with both ends of buttonhole securely tacked. The purling of the buttonhole shall be on the outside of the belt.	But-ton-hole		50 per button-hole (including tack)	A	A
	i. Mark location for sewing two 22-line sewing hole buttons to lining side of belt. The center of the button for the buckle end shall be 3-5/8 ± 1/8 inches from the overedge stitched end of belt. The button for the belt fastener shall be positioned in accordance with mark on pattern for each size belt. The buttons shall be securely sewn to the belt with the end of the stitching securely tacked.					
	j. Securely sew one button at each mark. The button for the buckle end shall properly engage buttonhole in buckle end and shall be sewn through all plies of material. The button	101		21 per button	24/4	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
6.	Make standard belt (see Figure 6). (cont'd)					
	for the belt fastener shall be sewn through the lining and interlining only.					
	k. Mark location for sewing belt fastener to lining side of belt, in accordance with mark on pattern for each size belt.					
	1. Turn under the raw end of the fastener 1/2 inch and bartack the fastener to the belt through all plies 1/8 to 3/16 inch from the folded edge. The bartack shall be across the entire width of the fastener and shall be finely stitched in order to not have an objectionable appearance on the outside of the belt. The fastener, when buttoned, shall be smooth and flat without twisting or bulging.	Bar-tack		28 per bar-tack	A	A (silk)
	m. Clean and press belt as specified in operation 7.k and 7.1.					
7.	Make optional one piece belt (see Figure 7).					
	Finished appearance. The belt shall finish smooth and flat without twists, pleats, puckers or raw edges. The pointed end of the belt shall be well formed. The buttonhole shall be clean cut and well made. The ends of the buttonhole shall be securely tacked.					
	a. The optional belt shall be made of one piece of basic material.					
	b. Fold the piece in half lengthwise forming two plies. Join the two plies together with a 3/8-inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
7.	Make optional one-piece belt (see Figure 7). (cont'd)					
	c. Spread open the seam and press the belt smooth and flat with a heated pressing iron.					
	d. Close the pointed end of the belt with a 1/4-inch seam along the slanted edges.	301	SSe-2(a)	12-16	A	A
	e. Evenly trim the pointed end of the belt for proper turning. Turn the belt through the open end, completely working out the point.					
	f. Topstitch the belt uniformly 1/8 inch from top and bottom folded edges and seamed end, turning in the square end of the belt 1/4 inch and catching the turned-in portion in the stitching. The seam of the belt shall finish off center.	301	OSf-1 (top and bottom edges) SSe-2(b) (pointed end) SSc-1 (square end)	12-16	A (silk) or A (silk)	A A
	g. The finished width of the belt shall be 1-3/4 (+ 1/16, - 1/8) inches. The finished length of the belt for each size coat shall be as shown in Table II.					
	h. Make a horizontal eyelet-end taperbar type buttonhole, cut 5/8 inch long, in the center of the belt. The inside edge of the eyelet-end of the buttonhole shall be 1/2 to 5/8 inch from the buckle end of belt. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the belt.	Buttonhole		60 per buttonhole (including tack)	B (silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
7.	Make optional one-piece belt (see Figure 7). (cont'd)					
	i. Mark the location for sewing one 22 line sewing hole button to the underside of the belt. The button shall be sewn to the belt with the end of the stitching securely tacked.					
	j. Securely sew the button at the mark on the belt to properly engage buttonhole in buckle end. On the finished belt, the button shall be 3-5/8 ± 1/8 inches from square end of belt.	Hand		6 per button (double thread)	24/4	
	k. Trim the ends of the stitching and remove all loose ends of thread from the belt. Remove all spots and stains from the belt without injury to the material.					
	l. Place the belt keeper on the belt at the square end and secure by buttoning the end. Press the belt smooth and flat with a heated pressing iron or pressing machine. Ends of the keeper shall be spread open and pressed flat on the underside at the center of the belt.					
8.	Attach snap fasteners.					
	Finished appearance. The snap fasteners shall be securely attached to the belt. On the finished coat, the belt ends shall be fastened without misalignment or gap. On the standard belt, the fasteners shall be stitched through the interlining only. On the optional belt, the stitching shall not show on the opposite side of the belt.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
8.	Attach snap fasteners. (cont'd)					
	a. Sew the socket part of the snap fastener to the inside point of the belt 1/2 to 5/8 inch from the point.	101 or		21 per fastener (minimum)	A	
		301 or		21 per fastener (minimum)	A	A
		Hand		3-4 (double thread)	A	
	b. Sew the stud part of the snap fastener 3-1/2 to 3-3/4 inches from the folded end of the belt on the outside. When stud part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or		21 per fastener (minimum)	A	
		301 or		21 per fastener (minimum)	A	A
		Hand		3-4 (double thread) (not including tack)	C (silk)	
9.	Make upper and lower pocket flaps.					
	Finished appearance. The pocket flaps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The seamed edges, the corners and point of the flaps shall be well worked out and the lining shall not be visible on the outside of the flaps. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The ends of the gimp shall be pulled through to					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
9.	Make upper and lower pocket flaps. (cont'd)					
	the underside of the buttonholes and the purling of the buttonholes shall be on the outside of the flaps. The buttonholes shall be the cut-first type.					
	a. The pocket flaps shall be made of one ply of basic material, lined with rayon lining.					
	b. Securely sew the stud part of the snap fastener to the lower corners of the lining of the upper pocket flaps, through a small triangular shaped silesia stay piece. On the finished flap, the fastener shall be midway between the side and bottom finished edges 3/8 to 1/2 inch back from the corners. When stud part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or 301 or Hand		21 per fastener (minimum) 16 per fastener (minimum) 3-4 (double thread) (not including tack)	A A	A
	c. Seam the lining to the basic material 3/16 inch from the side and bottom edges, evenly trimming and edges for proper turning.	301	SSe-2(a)	10-14	A -or- A (silk)	A A
	d. Turn the flaps, working the edges, corners and point out completely. Topstitch the flaps uniformly 1/8 inch from seamed edges, working the lining back from the finished edge of the flaps.	301	SSe-2(b)	12-16	A -or- A (silk)	A (silk) A
	e. Press the flaps smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
9.	Make upper and lower pocket flaps. (cont'd)					
	f. Mark and trim top edge of flaps so that in the finished coat the length of the flaps at center point and sides shall conform to measurements shown in Table III.					
	g. Join the raw edges of the lining and flap together with overedge stitching.	504 or 505	EFd-1	8-10	A	A
			EFd-1	8-10	A	A
	h. Make a vertical eyelet-end square-bar type buttonhole, cut 3/4 inch long through the center of each pocket flap with the inside edge of the eyelet 5/8 ± 1/8 inch above the center point.	But-ton-hole		38 per button-hole (minimum) (not including bartack)	B (silk)	F
	i. Securely bartack the end of buttonholes, and trim the ends of the gimp.	Bar-tack		21 per bartack (minimum)	A (silk)	A
10.	Make upper pockets.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats; the basic material and both edges of binding shall be securely caught in the stitching. The pleats shall be vertically centered and the folded side edges of the pleats shall be parallel. The pockets shall be uniform in shape and size in accordance with the pattern.					
	a. Form a vertical box pleat on the outside center of upper pockets with a heated creasing machine. The pleat shall be 1-1/2 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
10.	Make upper pockets. (cont'd)					
	b. Secure the pleat with a row of stitches 1/16 inch from top and bottom edges, respectively. Trim the lower corners of the pockets.	301	SSe-1	10-14	A	A
	c. Tack the abutted edges of the pleat together on the inside of the pocket with blindstitching.	103	SSm-1	6-8	A	-
	d. Bind the upper edge of the pockets with 1-1/8-inch-wide bias binding, with the pleat closed and both edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	e. Turn under and crease the side and bottom edges of the pockets in a heated edge creasing machine.					
	-or-					
	f. Fold the pocket in half lengthwise and stitch 1-1/2 inches from folded edge.	301	OSf-1	10-14	A	A
	g. Form the pleat and seam across the top and bottom edges, respectively, 1/16 to 1/8 inch from edge.	301	SSa-1	10-14	A	A
	h. Baste the center of pleat by machine.	301	Hopper			
	i. Press pleat flat and smooth with heated pressing iron or machine.					
	j. Bind the upper edge of pockets with 1-1/8-inch-wide binding, with the pleat closed and both edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
10.	Make upper pocket. (cont'd)					
	k. Mark the patch pocket in accordance with the pocket shaper and trim the lower corners of the pocket for better turning.					
	1. Turn under side and bottom edges of pocket at the marks and baste along the edges.	101 or Hand				
11.	Make lower pockets.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats. The basic material and both edges of binding shall be securely caught in the stitching. The pockets shall be uniform in shape and size in accordance with finished pocket shaper.					
	a. Overedge stitch the raw edges of sides, bottom corners and bottom of pockets.	503 or 504	SSa-1	6-10	A	A
	b. Bind the upper edge of the pockets with 1- to 1-1/8-inch-wide bias binding, with both edges of binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	c. Seam lower corners of pockets 3/8 inch from the serged edges.	301	SSa-1	10-14	A	A
	d. Spread open the corner seams of pockets and press smooth and flat with a heated pressing iron.					
	e. Trim the corners and turn pockets, working out the corners completely.	301	OSf-1	12-16	A	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
11.	Make lower pockets. (cont'd) Turn under side and botton edges of pockets to form bellows, and topstitch uniformly 1/8 inch from folded edges. f. Press entire pocket smooth and flat with a heated pressing iron or pressing machine, evenly creasing the edges. g. The pockets shall be uniform in shape and size in accordance with the finished pocket shaper.					
12.	Make shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole, and the purling of the buttonholes shall be on the outside of the shoulder straps. a. The shoulder straps shall be made of two pieces of basic material.					
	b. Seam the two pieces together 3/16 inch from the edges at the front, back and collar end, evenly trimming all edges of the strap for proper turning.	301	SSe-2(a)	10-14	A	A
	c. Turn the straps, working the seams out to the edges. Topstitch the strap uniformly 1/8 inch from the seamed edges.	301	SSe-2(b)	12-16	A	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
12.	Make shoulder straps. (cont'd)					
	d. Make a horizontal eyelet-end, squarebar type buttonhole, cut 3/4 inch long, in each strap midway between the back and front edges and with the inside edge of the eyelet placed so that in the finished coat, the edge of the shoulder strap button will be 1/4 to 3/8 inch from the edge of the collar and with the purling to finish on the outside of the strap.	Buttonhole		38 per buttonhole (minimum) (not including bartack)	B (silk)	F
	e. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside of the buttonhole.					
	f. Securely bartack the end of the buttonholes and trim the ends of the gimp.	Bartack		21 per bartack (minimum)	A (silk)	A
	g. Press the straps smooth and flat with a heated pressing iron or pressing machine. The strap shall be uniform in shape and size in accordance with the pattern. The seams shall finish at the edges of the straps.					
	h. On the finished coat, the straps shall measure 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the eyelet end of the buttonhole.					
13.	Make collar (see Figure 8).					
	Finished appearance. The completed collar shall finish smooth and flat without distortion. Edges shall be uniformly even. The edgestitching shall be uniform.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
13.	Make collar (see Figure 8). (cont'd)					
	a. The collar shall be made of one ply each of basic material, silesia, or polyester/cotton, cotton duck and lining.					
	b. Seam silesia or polyester/cotton and cotton duck together 1/8 to 1/4 inch from all edges and trim silesia or polyester/cotton even with edges of duck.	301	SSa-1	10-14	A	A
	c. Lap the upper edge of silesia or polyester/cotton side of interlining approximately 1/2 inch on the inside of the upper edge of the collar outer ply and seam together 1/4 inch from the raw edge of interlining. The outer ply shall extend not less than 1 inch at each end of collar interlining.	301	LSa-1	10-14	A	A
	d. Smoothly fold the outer ply over the upper and lower edges of the interlining. Tack the portion of outer ply folded to inside at the lower edge to silesia or polyester/ cotton interlining. Stitching shall not be through outer ply of collar.	Hand		2-3	C (silk)	
	e. Fold ends of outer ply to inside over ends of interlining and tack to silesia or polyester/cotton with over-cast stitching, turning under the upper and lower edges sufficiently so as not to be visible in the finished collar.	Hand		2-3	C (silk)	
	f. Lap approximately 1/2 inch of the top inside edge of the collar on the raw top edge of the collar lining with the lining face up. Stitch collar uniformly 1/8 inch on both front and	301	LSa-1 (top edge) OSf-1 (ends)	12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
13.	Make collar (see Figure 8). (cont'd)					
	top edges, catching the collar lining in the stitching at the upper edge. The lining shall extend a minimum of 1 inch beyond each end of the collar.					
	g. Turn collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.					
	h. Make one eyelet through all plies at each end of the collar midway between top and bottom edges and 1-3/4 ± 1/8 inches from finished ends. The eyelets shall be well worked with the purling on the outside of the collar and shall finish with a 1/8-inch diameter opening.	Eyelet		20 per eyelet (minimum)	A (silk)	A
14.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top and under sleeves with notches matching and join at the forearm with a 3/8-inch seam.	301	SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
15.	Join cuffs to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs shall be uniformly stitched to sleeves.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
15.	Join cuffs to sleeve. (cont'd)					
	a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges. Turn cuff completely, working out the point.	301	SSa-1	12-16	A	A
	b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the upper edge of cuff, or the cuff may be basted instead of pressed.	101		4-6		
	c. Mark the sleeve in accordance with the pattern for positioning the cuffs, with notch matching the forearm seam line and with the lower raw edge of the sleeve and marker even.					
	d. Position the cuffs at the mark on the sleeve and seam uniformly 1/8 inch from the upper finished edge of cuff.	301	LSd-1	12-16	A (silk)	A
16.	Seam sleeve at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the topsleeve to the undersleeve at the backarm with a 3/8-inch seam, catching the ends of the cuffs in the seam.	301	SSa-1	12-16	A	A
	b. Spread open the sleeve and cuff seams and press flat with a heated pressing iron. Trim ends of cuff if necessary.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
17.	Tack cuff to sleeve.					
	a. Turn the cuff outlet to the inside, in accordance with notches, against the bottom end of sleeves, and baste along the turned edge of cuff.	Hand or 101		4-6		
	b. Tack the raw edge of the cuff to the body of the sleeve with blind-stitching.	103	SSm-1	4-6	A	
	c. On the finished coat, the length of the cuff shall be 3-1/4 ± 1/4 inches at the front and back creased edges and 6 ± 1/4 inches at the point.					
18.	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position the top and undersleeve lining pieces in accordance with notches on pattern and join at the forearm and backarm, respectively, with a 3/8-inch seam.	301	SSa-1	10-14	A	A
19.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers or pleats.					
	a. Properly position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
19.	Assemble sleeve and sleeve lining. (cont'd)					
	b. Seam sleeve lining to topsleeve, backarm and forearm seam allowance respectively, commencing approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches below armhole edge at the backarm and approximately 4-1/2 inches below armhole edge at the forearm.	301	SSa-1	6-8	A	A
20.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve linings shall not be short, tight or twisted at bottom of sleeves.					
	a. Pull sleeves through lining and turn under the bottom edge of sleeve lining to finish approximately 1-1/4 inches above the finished end of the sleeve, and baste to turnup of cuff.	Hand or 101		4-6		
	b. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching. The bottom of sleeve lining may be felled without basting.	301 or Hand	EFc-1(b)	6-8 8-10	0 (silk) C (silk)	0
	c. Turn sleeves and assemble in pairs. The lower half of sleeve may be pressed smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam.					
21.	Hem yoke and front linings.					
	Finished appearance. The hem shall be uniformly stitched, uniform in width, and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/8 ± 1/8 inch wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
21.	Hem yoke and front linings. (cont'd)					
	a. Hem the bottom edge of the yoke and front linings, respectively, with the raw edge turned under and caught in stitching 1/16 inch from the folded upper edge of the hem.	301	EFb-1	10-14	A	A
22.	Make center pleat in yoke lining.					
	Finished appearance. The pleat shall be uniform in width and shall finish smooth and flat without puckers or pleats.					
	a. Fold the yoke lining in accordance with the notches on the pattern to form a 1/2-inch-wide pleat at the center back. Tack lengthwise along the pleat in line with the notches for a distance of 1 to 1-1/2 inches at the top end.	301	OSf-1	10-14	A	A
	-or-					
	b. Form the pleat by stitching across top of pleat at neckline. Press the pleat smooth and flat from the top to the bottom edges of the yoke lining with a heated pressing iron. The folded edge of the pleat on the outside of the yoke shall be towards the left side.	301	OSf-1	10-14	A	A
23.	Stitch dart in front lining.					
	Finished appearance. The dart shall be tapered to a point at the lower end and shall finish without gathers, puckers or pleats.					
	a. Fold the front lining, matching the cut edge of the underarm dart. Stitch lengthwise along the dart	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
23.	Stitch dart in front lining. (cont'd)					
	tapering from 1/4 inch at the armhole to a point at the lower end as indicated by the mark on the pattern.					
24.	Seam wool facing to front lining.					
	Finished appearance. The lining shall be carefully and properly aligned and seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion.					
	a. Position the lining on the wool facing with the top edges even and bottom finished edge of the lining matched with the notch in the back edge of the facing to insure proper seaming.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge.	301	SSa-1	10-14	A	A
	c. Press the facing-lining seam, the underarm dart, and the bottom edge of the lining smooth and flat with a heated pressing iron with the raw edges of the underarm dart and facing lining seam toward the side.					
25.	Assemble inside pocket on left facing (see Figure 9).					
	a. The inside pocket shall be made of two pieces of silesia with a facing of rayon lining at the vertical piped pocket opening.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
25.	Assemble inside pocket on left facing (see Figure 9). (cont'd)					
	b. Position the rayon facing on the two pieces of pocket material with the top and front edges even. Turn under the inside and bottom edges, respectively, of the facing and seam to the pocket 1/16 to 1/8 inch from the folded edges, catching the lower edge of the identification label in the stitching at the inside edge of facing.	301	LSd-1 (each edge)	10-14	A	A
	c. Seam the remaining three edges of label to pocket material 1/16 inch from each edge.	301	SSa-1	10-14	A	A
	d. Mark the left wool facing for the position of the pocket opening as indicated by the marks on the patterns					
	e. Position the two front edges of pocket in line with the mark for the pocket opening, with the pocket facing next to the front facing.					
	f. Seam the pocket to the wool facing through all plies, with one row of stitches 3/16 to 1/4 inch on each side of the mark for the pocket opening.	301	SSv-2	10-14	A	A
	g. Cut the wool facing only for the pocket opening midway between the two rows of stitches. Tongue notch each end of the opening.					
	h. Turn the pocket through the opening to the inside. Form the piping at the front and back edge of the opening. Topstitch the front and back edges of the pocket opening adjacent to the seamed outer edges of the piping.	301		10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
25.	Assemble inside pocket on left facing (see Figure 9). (cont'd)					
	i. Tack the ends of the piping at the underside, catching the tongue notches at each end of the pocket opening in the tacking.	301	SSa-1	10-14	A	A
	j. Turn back the front part of pocket and seam to the back part along the side and bottom raw edges, catching the tongue notch at each end of pocket opening. Continue to stitch along the folded edge of the front pocket as close as possible to the piping seam to complete the pocket.	301	SSa-1	10-14	A	A
	-or-					
	k. The pocket opening may be cut and piped with the use of an approved automatic type sewing machine specifically designed to position the component parts, cut the opening, stitch and form the piped edges in one operation.					
	l. In the finished coat, the width of the pocket opening shall be 5-3/4 ± 1/4 inches.					
26.	Bind facings.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
26.	Bind facings. (cont'd)					
	a. Bind the raw back edge of the facing with 3/4-to 7/8-inch-wide bias binding, turning under the outside raw edge of binding only, and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the bottom edge of facing to not less than 1 inch above bottom finished edge of lining.	301	BSb-1	10-14	A	A
27.	Bind center and side back.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats; the basic material and edges of binding shall be caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw edge of the center back with 3/4-to 7/8-inch-wide bias binding from the top edge of backs to the top end of vent. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. When binding the left center back, continue to bind the raw edge of the vent for the left back from the top to the bottom end. The binding is not required along the top edge of the vent.	301	BSb-1	10-14	A	A
	b. Bind the raw side edges of the left and right side-backs, respectively, from the top to the bottom edge of the coat with 3/4-to 7/8-inch-wide bias	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
27.	Bind center and side back. (cont'd)					
	binding. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge.					
28.	Seam lining to right vent.					
	Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Fold vent lining piece in half lengthwise and stitch across the top of the vent with 1/4-inch seam.	301	SSa-1	10-14	A	A
	b. Turn vent lining inside out, forcing the corner out.					
	c. Position the raw edges of lining on the outside of right vent, and seam together 3/8 inch from the back edge. The lining shall extend from the bottom turnup to approximately 1 inch beyond the top end of the vent.	301	SSe-2(a)	10-14	A (silk)	A
	d. Turn the lining to the inside of the vent and topstitch uniformly 1/8 inch from the folded edge, with the lining 1/16 inch back from the folded edge.	301	SSe-2(b)	10-14	A (silk)	A
29.	Join back.					
	Finished appearance. The backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in line with the center back seam. In the finished coat, the left back shall overlap the right back 3 to 3-1/4 inches measured at the bottom edge of the coat, and the left vent					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
29.	Join back. shall be 1-3/8 to 1-1/2 inches wide, measured at the bottom bound edge. The backstitching across top end of vent shall not be through vent lining.					
	a. Stitch the 1/4-inch-wide stay tape to the left back along the vent with the edge of the tape positioned approximately 1/8 inch in back of the fold notch to the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join at the center with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch across the vent to the bound edges of the vents.	301	SSa-1	12-16	A	A
	c. Turn the left vent to the inside of the left center back in accordance with the notches and topstitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam.	301	OSf-1	12-16	A (silk)	A
	d. Stitch and back stitch across the top end of the vent on the outside through all plies for a distance of 1-1/2 ± 1/8 inches from the center back seam. The stitching shall not be through the vent lining.	301	SSa-1	12-16	A (silk)	A
	e. Join the left and right side backs to the respective center backs with 3/8-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
30.	Press side and center back seams and vent lining.					
	a. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right center back to lower end of the stitching for the center back seam.					
	b. Spread the side and center back seam open, respectively, and press flat with a heated pressing iron.					
31.	Fell vent lining.					
	Finished appearance. The folded edge of the lining shall be accurately aligned with the center seam allowance of the right back part. The felling shall not be visible on the outside of the coat.					
	a. Baste top edge of vent lining to coat.	Hand or 101 or 301	Hopper			
	b. Fell vent lining to coat across the top edge and on both sides for a distance of not less than 1 inch from the top end.	Hand			C (silk)	
32.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The silesia reinforcement stays shall be sewn to the armhole and sholder edges of the front without gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
32.	Seam reinforcement stay to armhole and shoulder. (cont'd)					
	a. Seam the 3/4-inch-wide silesia stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The top end of the armhole stay and the lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.	301	SSaa-1	10-14	A	A
33.	Bind lower fronts.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw back edge of the lower fronts with 3/4-inch-wide bias binding, turning under the outside raw edge of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the waist seam to the bottom edge of fronts.	301	BSb-1	10-14	A	A
34.	Assemble fronts.					
	Finished appearance. All chest and waist darts shall be properly tapered and shall finish without gathers, puckers, or pleats. The upper and lower fronts and side body panels shall be joined without gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
34.	Assemble fronts. (cont'd)					
	a. The fronts shall consist of an upper front, a side body front, and a lower front (skirt).					
	b. Fold the upper fronts, matching the cut edges of the chest and waist darts, respectively. Stitch the entire length of the chest and waist darts, 3/8 inch from the cut edges at the upper end of the chest darts and tapering to zero at the lower end, and 3/8 inch from the cut edge at the lower end of the waist darts, tapering to zero at the upper end.	301	SSa-1	10-14	A	A
	c. Position the upper fronts and side body fronts, with the edges even, and join with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	d. Spread open the waist dart and the underarm seam and press flat with a heated pressing iron. Press the chest dart flat, turning the cut edges toward the armhole edge of the fronts.					
	e. Position the upper and the lower fronts with edges even and join together at the waist with a 3/8-inch seam and with the 1/4-inch-wide stay tape positioned on the upper front 1/4 inch from the lower edge and caught in the stitching.	301	SSa-1	12-16	A	A
	f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the center of the side body front to not more than 3 inches from the front edge of the fronts.	301	SSa-1	12-16	A	A
	g. Spread open the waist seam and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
34.	Assemble fronts. (cont'd) h. Press and shape the fronts from the waist to the top edge on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortions to the front or armhole of the coat.					
35.	Set pockets and pocket flaps. Finished appearance. The pockets and pocket flaps shall be set without twists, gathers, puckers, pleats or raw edges. The stitching for the raised edge of the flaps shall conform to stitching for setting the pockets. The side edges of the pockets shall not be exposed beyond the sides of the flaps. The pockets and pocket flaps on the left and right side, respectively, shall be in horizontal alignment with each other. The front edges of the pockets, pocket flaps, and pleats on the upper pocket shall be in parallel alignment with front edge of coat when buttoned. The point of the upper pocket flap shall be at the center of the pleat on the upper pockets. The center of the pleat on the upper pockets shall be aligned as accurately as possible with the waist darts in the fronts. On the finished coat, the top edge of pocket flap shall be in line with the second buttonhole. The top edge of the bottom pocket flap shall be parallel with the waist seam line, and the front edge of the flap shall be in line with the front edge of the upper pocket. The lower front corners of the bottom pocket shall be 3/8 inch further back towards side seam. Pockets and					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
35.	Set pockets and pocket flaps. (cont'd)					
	pocket flaps shall conform to the measurements in Table III.					
	a. Mark the fronts in accordance with the marks on the pattern for position of upper and lower pockets and pocket flaps.					
	b. Position the pocket flaps on the outside of the fronts in accordance with the marks for the upper and lower pocket flaps, respectively. Position the silesia or polyester/cotton stay piece for the flaps and top corners of the pockets on the underside of the fronts.					
	c. Seam the pocket flaps to the fronts through the silesia or polyester/ cotton stay uniformly 1/8 inch from the serged edge of the flap.	301	LSq-2(a)	12-16	A (silk)	A
	d. Turn down the flaps and topstitch the flaps 1/8 inch down from the raised edge.	301	LSq-2(B)	12-16	A (silk)	A
	e. Position the upper pockets in accordance with the marks and seam to the fronts uniformly 1/8 inch from the side and bottom edges. The top corners of the pockets shall be securely tacked through the silesia or polyester/cotton stay pieces.	301	LSd-1	12-16	A (silk)	A
	f. Position the lower pockets in accordance with the marks on the pattern, lower edge to be 1-1/4 inches above bottom edge of finished coat. Seam bellows of pockets from the inside to fronts 3/8 inch from side and bottom serged edges. Securely tack	301	SSa-1 (each edge)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
35.	Set pockets and pocket flaps. (cont'd)					
	upper corners of pockets from the outside through silesia or polyester/ cotton stay pieces.					
36.	Make buttonhole tab.					
	Finished appearance. The sword slit buttonhole tab shall finish smooth and flat without distortion. The stitching shall be uniform and the buttonhole shall be properly positioned. The tab shall finish 2-3/8 ± 1/8 inches long and 2 ± 1/8 inches wide.					
	a. The buttonhole tab for the sword slit shall be made of one ply of basic material and one ply of rayon lining material.					
	b. Seam together the lining piece and basic material at side and bottom edges of tab 3/16 inch. Turn and topstitch 1/8-inch from seamed edge.	301	SSe-2 (shows finished seam)	12-16	A (silk)	A
	c. Close the top raw edge of tab with 1/8-inch seam.	301	SSa-1	12-16	A (silk)	A
	d. Make a vertical eyelet-end, taper-bar type buttonhole, cut 5/8 inch long, in center of tab with the inside edge of the buttonhole eyelet placed 1/2 to 5/8 inch above bottom edge of tab. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the lining side of the tab.	Buttonhole		60 per buttonhole (including tack)	B (silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
37.	Make sword slit and attach buttonhole tab (see Figure 10).					
	Finished appearance. The sword slit shall finish without bulges or excessive bulkiness. All parts shall be securely fastened and properly positioned. The flap shall be securely attached and properly positioned to cover slit properly.					
	a. Mark left front for 2-inch-long sword slit in waist seam. The back end of the sword slit shall be 1/2 to 5/8 inch in front of underarm seam.					
	b. Topstitch the left front, 1/16 inch below waist seam, through the seam allowance, for a distance of 2 inches, starting 1/2 to 5/8 inch in front of the underarm seam. The stitching shall be through the allowance of the waist seam but not through the pocket stay. The lower pocket stay material shall be trimmed away from the sword slit opening.	301	OSf-1	12-16	A (silk)	A
	c. Tack across waist seam at each end of the topstitching to prevent seam from opening when sword slit is cut. The tacks shall be 1/8 inch long, 1/16 inch on each side of seam.	301	SSa-1	12-16	A (silk)	A
	d. Mark tab 1-3/4 inches from bottom edge. Cut waist seam open for sword slit and position tab on outside of front with top end inserted through slit. Align mark on tab with upper folded edge of slit. Topstitch front for a distance of 2 inches along the waist seam 1/16 inch above opening, stitching through seam allowance and	301	LSd-1	12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
37.	Make sword slit and attach buttonhole tab (see Figure 10). (cont'd) tab, and securely tacking each side of the tab to the front at the opening. The basic fabric side of the tab shall be towards the outside of the coat.					
38.	Set belt loops. Finished appearance. The belt loops shall finish vertically straight and shall be positioned with the top front edge of the loops, for size 36 to 40 inclusive, 1/4 inch to the back of the underarm seam, and for sizes 42 to 46 inclusive, with the top back edge of loop placed 1/4 inch to the front of the underarm seam. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to bottom folded edges. The underloop for the belt fastener shall have an opening of not less than 1-1/2 inches. All bartacks shall be made across the entire width of the loops. a. Position the 5-1/2-inch-long belt loop on the left front with one end approximately 1 inch above the waist seam and bartack the loop to the front 1/8 to 3/16 inch from the end of the loop. Bartack the loop to the front at the top edge of the lower pocket flap to form the underloop for the belt fastener. Turn loop up and, with the top end turned under, bartack the loop to the front 1/8 to 3/16 inch from the folded edge, catching the turned under portion of the loop in the stitching. (See Figure 11).	Bartack		28 per bartack (minimum)	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
38.	Set belt loops. (cont'd)					
	b. Position one end of the 3-1/2-inch-long belt loop on the right front and bartack the loop to the front at the top edge of the lower pocket flap. Turn under the top end of the loop and bartack the loop to the front 1/8 to 3/16 inch from the folded edge, catching the turned under portion of the loop in the stitching.	Bar-tack		28 per bartack (minimum)	A (silk)	A
39.	Interline fronts.					
	a. Properly position the left and right fronts on the respective coat front interlinings and baste along the top edge of the upper pocket flap on the outside.	301	Hopper			
	b. Tack the top edge of upper pocket stay and the front end of the upper and lower pocket stay to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible.	301	Hopper			
	c. Baste the interlining and fronts together starting approximately 1-1/2 inches above the top edge of upper pocket flap and baste along the center of the upper pocket flap and pocket, along the waist dart to the top edge of the lower pocket flap, and then diagonally across front corner of the lower pocket flap to the front edge of the lower pocket and from that point continue to baste along the front edge of the pocket to the bottom of the coat.	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
39.	Interline fronts. (cont'd)					
	d. Baste horizontally towards the front of the coat, starting from the top of the center basting stitch. Continue to baste along the front edge to the bottom of coat.	301	Hopper			
	e. Baste across the shoulder allowing room for setting the shoulder pad and working the fullness towards the armhole. Baste along front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the interlining.	301	Hopper			
40.	Sew snap fastener to upper pockets.					
	Finished appearance. The pocket flaps shall lie smooth and flat without distortion when closed.					
	a. Securely sew one socket snap fastener part to each side edge of the upper pockets to properly engage stud part on flaps. When socket part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or 301 or Hand		21 per fastener (minimum) 16 per fastener (minimum) 3-4 (double thread) (not including tack)	A A C (silk)	A
41.	Join back and fronts at sides.					
	Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
41.	Join back and fronts at sides. (cont'd)					
	a. Position the back and front, with edges even, and join together at the sides with a 3/4-inch seam.	301	SSa-1	12-16	A	A
	b. Spread open the side seams and press flat with a heated pressing iron.					
42.	Tape armhole.					
	a. Seam the 3/4-inch-wide silesia or polyester/cotton stay to the lower edge of the armhole, centered on the top end of the underarm seam.	301 or 401	SSaa-1	10-14	A	A
	b. Sew one piece of the 1/4-inch-wide stay tape to the lower front and to the back edge, respectively, of the armholes. The tape on the lower front edge of the armhole shall be stitched with slight tension and shall extend from approximately 1-1/2 inches above the notch in the fronts to approximately 1/8 inch on top of front end of the silesia or polyester/cotton stay. The tape on the back edge of the armholes shall be held taut while stitching and shall extend from approximately 1/8 inch on top of back end of the silesia or polyester/cotton stay to approximately 1 inch from shoulder edge. The tape on the lower front edge shall be stitched to the front and silesia or polyester/cotton stay only.	301 or 401	SSaa-1	10-14	A	A
43.	Press armholes and shoulder blades.					
	a. Press the armhole tapes, the shoulder blades and the front smooth and flat with a heated pressing iron or suitable type pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
44.	Shape fronts. a. Mark and shape the front edges of the coat. Dress the left front on a line running from the top notch to the waist seam 1 inch from the front edge. Continue on a straight line from the waist seam to the notch at bottom as indicated on the pattern. b. Mark the fronts 1-1/4 inches below the bottom edge of the lower pockets for the bottom turnup. c. Trim coat front interlining 1/4 to 5/16 inch back from top, front and bottom edges of coat. Trim the bottom edge of coat, matching the length of right and left backs at the vent. -or- d. Marking and shaping the front edges and trimming the bottom edge of the coat may be accomplished with a clicker machine using dies conforming to patterns furnished. e. In the finished coat, the left front shall overlap the right front 3 to 3-1/2 inches at the bottom edge.					
45.	Bind bottom turnup. Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats and the basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
45.	Bind bottom turnup. (cont'd)					
	a. Bind the raw edge of the bottom turnup with 3/4-inch-wide bias binding, turning under the outside raw edge of binding only, and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the back edge of the front cutout to the edge of the vent at the center back.	301	BSb-1	10-14	A	A
46.	Baste facing-lining assemblies to fronts.					
	a. Position the right and left facing lining assemblies on the outside of the respective fronts and baste along the front and bottom edge, distributing the fullness in the breast area. The facing shall be held slightly taut across the bottom edge of the front while basting.	Hand or 301	Hopper			
47.	Join facings and fronts with tape.					
	a. Join the facings to fronts 3/16 inch from top, front and bottom edges of coat, with the 3/8-inch-wide stay tape positioned on the interlining side of fronts and caught in the stitching.	301	SSa-1	12-16	A	A
	b. The tape shall be sewn with slight tension and shall extend from the collar notch to 1-1/2 to 2 inches from side seams at the bottom of the coat.					
	c. Fell inside edge of 3/8-inch-wide stay tape to the coat front interlining from top end of tape to the bottom edge of interlining.	103	SSm-1	4-6	A	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
47.	Join facings and fronts with tape. (cont'd)					
	d. Press the front edges smooth and flat with a heated pressing iron or pressing machine, removing the fullness.					
	e. Remove all basting stitches. Trim lower and upper front corner of the facings and extend the cut for collar notch to the seam for proper turning.					
	f. Spread open the front-facing seam from the collar notch to the bottom edge of the coat and press smooth and flat with a heated pressing iron.					
48.	Baste front and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working out the corners completely. Turn up the bottom of the coat, lapping the facing on the bottom turnup, and working out the front corner completely.					
	b. Baste along the top and front edges and finished bottom edges of the coat, working the seams to the edge of the coat.	101		4-6		
	c. In the finished coat, the bottom turnup shall be uniformly 1 to 1-1/8 inches.					
49.	Fell bottom turnup.					
	a. Fell the bound edge of the bottom turnup to the fronts and backs with blindstitching.	301	EFc-1(b)	6-8	0 (silk)	0

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
50.	Baste facings second time.					
	a. Baste the facings to the fronts approximately 1-1/4 inches from the edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward toward the back edge of the facing while basting.	301 or Hand	Hopper			
	b. Baste as close to the facing lining seam as possible, placing the fullness over the chest, and continue basting along the bound edge of the facing to the bottom turnup of the coat.	301 or Hand	Hopper			
51.	Fell facings to fronts and tack to interlining.					
	a. Fell the bound edge of the left and right front facings to fronts with blindstitching from the bound edge of the bottom turnup to not less than 2 inches above the bottom finished edge of front lining.	301	EFc-1(b)	6-8	0 (silk)	0
	b. Tack the back edge of the left and right facing lining along the seam allowance to the interlining only, not more than 3 inches below the shoulder edge, with the inside breast pocket lying flat against the interlining.	103	SSm-1	4-6	A	-
	c. Tack the breast pocket to the interlining along the seam allowance.	Hand			C (silk)	
52.	Baste yoke lining to back.					
	a. Position and baste the one piece rayon yoke lining to the inside of the back, along the center pleat and along the armholes, shoulder and bottom edges of the yoke.	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
53.	Baste and fell front linings.					
	a. When necessary, trim the back end of lower pocket stays away from the side seam.					
	b. Fold the front lining, in accordance with the notches, forming the chest pleat and baste lengthwise along the entire center of pleat. Baste lining to coat along lower edge of armhole approximately 1-1/2 inches from edge, starting at lower end of chest pleat and continuing to approximately 2 inches from side seam of coat and across the bottom finished edge of lining. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	c. Turn under the back edge of the front lining matching the lower folded edge with the side seam and lapping the upper folded edge on the yoke. Baste the lining to coat from armhole to bottom finished edge not less than 3/4 inch from folded edge.	Hand or 101		4-6		
	d. Fell the turned under portion of the front lining to side seam allowance of the fronts and to the yoke lining with blindstitching 1/4 to 3/8 inch from folded edge. Stitching shall extend from bottom finished edge of front lining to the lower edge of armholes.	301	SSm-1	6-8	0 (silk)	0
54.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole and front gorge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
54.	Trim lining and interlining. (cont'd)					
	b. Trim the yoke lining even with the back at the neck.					
55.	Baste shoulder pad.					
	a. Insert shoulder pad between interlining and chest padding of coat fronts in line with the armhole edge and securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
56.	Seam shoulders.					
	Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulders may be properly shaped. The shoulder seam shall finish without a distorted appearance.					
	a. Join the fronts and back together at the shoulders with a 3/8-inch seam, working in the proper fullness on the backs, in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
57.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the coat without twists, puckers, pleats or					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
57.	Set shoulder straps. (cont'd)					
	other distortion. On the finished coat, the straps shall be 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at eyelet end of the buttonhole.					
	a. Position shoulder straps with the rounded end of the strap 3/4 to 7/8 inch from the edge of the neck and with the back edge of the strap 1/4 to 3/8 inch to the back of the shoulder seam at the armhole edge. On the finished coat, the rounded end of the strap shall finish 1/4 to 3/8 inch from the bottom edge of collar.					
	b. Seam the shoulder straps to the coat 1/8 to 1/4 inch from the armhole edge, trimming the shoulder strap even with the armhole where necessary.	301	SSa-1	10-14	A	A
58.	Baste shoulder.					
	a. Position shoulder interlining and lining in place. Baste upper part of each shoulder on the outside and turn the coat on the inside.	Hand or 301	Hopper			
	b. Turn under the raw edge of yoke lining at the shoulders, baste the upper part of each shoulder over the front lining and continue to baste across neck at the back.	Hand or 301	Hopper			
59.	Seam neckline with size label and hanger.					
	Finished appearance. The neckline shall finish smooth and flat without twists, pleats, or puckers. The size label shall be positioned between the ends of the coat hanger. Ends of					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
59.	Seam neckline with size label and hanger. (cont'd) coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and the yoke lining to the coat at the neckline from collar notch to collar notch with a 1/4-inch seam. The upper edge of the size label and the ends of the coat hanger shall be properly positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A
60.	Set collar. Finished appearance. The collar shall be carefully joined to the coat without twists, puckers, pleats, raw edges or distortion. a. Mark neckline on the outside 1/2 inch from top edge for proper positioning of collar. b. Position the collar with the lower edge lapped on the outside top edge of coat at the mark.					
	c. Seam the collar to the coat from end to end 1/16 to 1/8 inch from lower edge of collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (silk)	A
61.	Edgestitch coat. Finished appearance. The coat shall be uniformly edgestitched with the same gage as used on flaps and pockets and without distortion.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
61.	Edgestitch coat. (cont'd)					
	a. Topstitch the top and front edges of the coat and continue the stitching along the bottom edge of the coat the width of the facings.	301	SSe-2 front and bottom edges of coat (shows finished seam)	12-16	A (silk)	A
	b. The stitching shall be uniformly 1/8 inch from the edge.					
62.	Set sleeves.					
	Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole-sleeve seam shall finish smooth and flat without twists, puckers or pleats. The armhole shall not be stretched or distorted due to pressing.					
	a. Position sleeves on outside of coat at the armholes, with back arm seam of sleeve matching the side back seam and with notch in top sleeve and front matching.					
	b. Join the sleeves to the coat with a 3/8-inch seam, distributing fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching.	301	SSa-1	12-16	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness. Spread open the upper part of the armhole-sleeve seam from backarm sleeve seam to approximately midway between shoulder					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
62.	Set sleeves. (cont'd)					
	seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron. Care shall be exercised in pressing armhole seam in order not to stretch the armhole.					
63.	Baste armhole lining.					
	a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place, and distributing fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeve to the notch in the front.	Hand or 301	Hopper			
64.	Tack armhole and stitch sleeve head pads.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam, and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end through the armhole sleeve seam allowance 1/8 inch from the folded edge of the pad, catching the armhole end of the stay	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
64.	Tack armhole and stitch sleeve head pads. (cont'd) for the upper pockets, the front and yoke linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.					
65.	Fell linings.					
	a. Position the sleeve lining at the armhole with back and forearm seams of sleeves and linings matched. Turn under the armhole edge of the sleeve lining and lap the linings on the outside of the yoke and front linings at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness in accordance with good commercial practice, and backstitching the lower armhole edge from approximately 1-1/2 inches to the front of forearm sleeve lining seam to the side of body lining.	Hand		8-10	C (silk)	
	b. Fell the lower corners of the front lining to the facings and the front seam allowance, respectively.	Hand		8-10	C (silk)	
	c. Fell the upper back edge of the front lining to the yoke lining, placing the stitching over the folded edge of front lining. Fell the lower finished edge of front lining. Fell the lower finished edge of the yoke lining to the side seam outlet.	Hand		8-10	C (silk)	
	d. Fell the yoke lining and facing lining assembly together at the shoulder, placing the stitching over	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
65.	Fell linings. (cont'd)					
	the folded edge of the yoke lining and securing the top end of the chest pleat in the felling.					
66.	Tack facing and bottom turnup.					
	a. Fell the ends of the bottom turnup to the body of the coat at the vent.	Hand		8-10	C (silk)	
	b. Fell the back edge of the facings to the coat from the bottom to the top edges of the bottom turnup.	Hand		8-10	C (silk)	
67.	Finish sword slit.					
	Finished appearance. The sword slit shall finish flat and smooth and shall be firmly stitched and properly positioned with no puckers, bulges, or raw edges.					
	a. Properly position left front lining and baste to front to hold in position for cutting of opening for sword slit tab.	Hand				
	b. Cut opening for sword slit tab in lining to correspond with opening in front.					
	c. Turn under raw edges of lining at cut opening and fell folded edge to front.	Hand		6-8	C (silk)	
	d. Cut 2-inch-long opening in sword slit patch, 3/4 to 1 inch from top edge. The opening shall be 1 inch on each side of center of patch.					
	e. Position patch on top of lining with opening in patch aligned with opening in lining. Fell patch to lining	Hand		6-8	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
67.	Finish sword slit. (cont'd)					
	on all edges, and fell raw edges of patch at opening to front.					
	f. Pull tab through opening to inside of coat.					
68.	Press left front.					
	a. Press left front smooth and flat removing any fullness in order that front buttonholes may be made with less difficulty.					
69.	Make buttonholes.					
	Finished appearance. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 40-line insignia button and the 34-line sewing hole button. The stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front and the purling of the buttonholes shall be on the outside. The waist seam shall not be open beyond the end of the waist buttonhole. The buttonholes shall be the cut-first type.					
	a. Mark the left front in accordance with the marks on the pattern for the location of 5 buttonholes. The mark for the bottom buttonhole shall be on the waist seam, the mark for the top buttonhole shall be 7/8 to 1 inch below the top edge of the front and the marks for the remaining three buttons shal be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
69.	Make buttonholes. (cont'd)					
	b. Make one horizontal eyelet-end, square bar type buttonhole, cut 1-1/8 inches long, at each of the marks, with the purling of the buttonhole to finish on the outside of the front. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coats. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.	Button		50 per buttonhole (minimum) (not including bartack)	B (silk)	F
	c. Care shall be exercised when making the buttonhole in the waistseam so that the seam does not come open beyond the ends of the buttonhole.					
	d. Securely bartack the end of each buttonhole and trim the ends of the gimp.	Bartack		21 per bartack	A (silk)	A
70.	Make eyelets in pockets.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of the pocket and shall finish with a 1/8-inch-diameter opening. All stitches shall be securely caught in the fabric.					
	a. Make one eyelet in each pocket for removable insignia button to correspond with eyelet end of buttonhole in flaps so that when buttoned on the finished coat, flaps shall be smooth and flat without twists or bulges.	Eyelet		21 per eyelet	A (silk)	A
71.	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
71.	Sew hook and eye to collar. (cont'd)					
	closure at the front of collar without misalignment or gap.					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar.	Hand		10 per hook and eye (minimum)	C (silk) (double thread)	
72.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling. The collar lining may be basted before felling it to coat.	Hand		8-10	C (silk)	
	d. Position the collar tab on the inside of collar at the left end, with the collar tab extending approximately 3/4 inch beyond the front end of collar. Fell the top, back and bottom raw edges of tab to collar lining.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
73.	Clean coat. a. Pull all basting thread, trim and remove all loose ends of thread, and remove all spots, stains and tickets, except one ticket for matching belt to coat, without injury to the material. b. Examine buttonholes at front closure for exposure of coat front interlining cloth. The exposed interlining shall be blackened with indelible ink.					
74.	Press coat. Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. b. Press the entire collar smooth and flat. c. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. d. Press the lower fronts and pockets smooth and flat. e. Press the sides, working the fullness towards the back.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
74.	Press coat. (cont'd) f. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent. g. Press the sleeves smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the bottom edge of the breast pockets. The backarm crease shall be in line with the forearm crease. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. Press the shoulder straps flat. i. Press the armholes solid from the inside, creasing the armholes at the front and armpit. The armpit and the back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking in the top sleeves. k. Press lower edge of coat smooth, flat and even. l. Remove all wrinkles and impressions from under pocket flaps. Remove all impressions of the side and center back seam allowances from the coat. Press linings throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat. Remove all gloss marks.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
75.	Mark for buttons. a. Mark the right front for the location of four 40-line insignia buttons and one 34-line sewing hole button to properly engage with the buttonholes in the left front. b. Mark each shoulder for the location of one 27-line insignia button to properly engage with the buttonhole in the shoulder straps in order that the straps shall lie smooth and flat without twisting or bulging on the finished coat. c. Mark the sword slit patch for the location of one 22-line sewing hole button to properly engage with buttonhole in tab. d. Mark the collar lining for the location of five 16-line sewing hole buttons to properly engage with buttonholes in white collar worn with coat.					
76.	Attach and sew on buttons. Finished appearance. The buttons shall be securely attached and sewn to the coat and shall properly engage buttonholes in left front, shoulder straps, sword slit buttonhole tab and upper and lower pocket flaps. The insignia buttons on the front shall finish with the head of the eagle in an upright position. The shoulder buttons shall finish with the head of eagle towards the collar. When the coat is buttoned, the center of those buttons between the upper pockets shall be midway between the front edge of the pockets.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
76.	Attach and sew on buttons. (cont'd)					
	a. Attach one 27-line insignia button to each pocket with shank of button inserted through eyelets and secured by ring toggles.					
	b. Sew one 40-line insignia button at each of the marks on the right front, except at the waist. The button shall be sewn through all plies of material with the head of the eagle in an upright position.	101 or		21 per button	24/4	
		301 or		21 per button	24/4	24/4
		Hand		6-8 per button (double thread)	24/4	
	c. Sew one 34-line sewing hole button at the waist mark on the right front through all plies, necking the button for shank wrapping.	101 or		21 per button	24/4	
		301 or		21 per button	24/4	24/4
		Hand		6-8 per button (double thread)	24/4	
	d. Shank wrap the 34-line sewing hole button.	Hand or		4 wraps (double thread)	24/4	
		Machine		16 stitches per shank	24/4	24/4
	e. Sew a 27-line insignia button at the mark on each shoulder. The button shall be sewn through all plies of material. The head of the eagle shall be towards the edge of the collar.	101 or		21 per button	24/4	
		301 or		21 per button	24/4	24/4
		Hand		6-8 per button (double thread)	24/4	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
76.	Attach and sew on buttons. (cont'd)					
	f. Sew one 22-line sewing hole button at mark on sword slit patch and wrap not less than four times. Stitching shall catch the pocket stay material.	Hand		8 per button (double thread)	24/4	
	g. Securely sew one 16-line sewing hole button at each of the marks on the collar lining. The button stitching shall not show on the outside of the collar.	Hand		8 per button (double thread)	24/4	
77.	Attach belt to coat.					
	a. Place the belt in the belt loops with the belt fastener through the underloop and buttoned.					

3.7 Finished measurements. The finished coat shall conform to measurements shown in Table II and III.

Table II. Coat measurements 1/

Size	Breast 2/ (inches)	Back Length 3/ (inches)	Sleeve Length 4/ (inches)	Collar Length 5/ (inches)	Belt Length 6/ (inches)
			Short		
36	37	28-3/4	17	15-1/2	38-3/4
38	39	29	17	16	40-3/4
40	41	29-1/4	17	16-1/2	42-3/4
42	43	29-1/2	17	17	44-3/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Size	Breast 2/ (inches)	Back Length 3/ (inches)	Sleeve Length 4/ (inches)	Collar Length 5/ (inches)	Belt Length 6/ (inches)
			Regular		
36	37	29-3/4	18	15-1/2	38-3/4
38	39	30	18	16	40-3/4
40	41	30-1/4	18	16-1/2	42-3/4
42	43	30-1/2	18	17	44-3/4
44	45	30-3/4	18	17-1/2	46-3/4
46	47	31	18	18	48-3/4
			Long		
36	37	30-3/4	19	15-1/2	38-3/4
38	39	31	19	16	40-3/4
40	41	31-1/4	19	16-1/2	42-3/4
42	43	31-1/2	19	17	44-3/4
44	45	31-3/4	19	17-1/2	46-3/4
46	47	32	19	18	48-3/4
			Extra Long		
36	37	32-1/4	20	15-1/2	38-3/4
38	39	32-1/2	20	16	40-3/4
40	41	32-3/4	20	16-1/2	42-3/4
42	43	33-1/8	20	17	44-3/4
44	45	33-3/8	20	17-1/2	46-3/4

1/ Tolerance on all measurements except belt and collar: ± 3/8 inch
Tolerance is on 1/2 breast measurements
Tolerance for collar length measurement: ± 1/4 inch.
Tolerance for belt length measurement: ± 1/2 inch.

2/ Breast measurement shall be taken from folded edge to folded edge in line with pit of armhole with the coat buttoned. Multiply by 2.

3/ Back length measurement shall be taken along center back seam from lower edge of collar to bottom edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of sleeve.

5/ Collar sizes represent length of collar in inches measured from end to end along the center.

6/ Belt length measurement shall be taken along the center from end to end.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Table III. Pocket and Flap Measurements 1/

Upper Pockets and Flaps			
Size (Short, Regular, Long, X-Long)	36 - 38 inches	40 - 42 inches	44 - 46 inches
Length of flap at center point	2-7/8	2-7/8	2-7/8
Length of flap at sides	2-1/8	2-1/8	2-1/8
Width of flap at top edge	4-3/4	5-1/4	5-3/4
Width of Pocket at top edge, side to side	4-1/2	5	5-1/2
Width of pocket at bottom edge, side to side	4-7/8	5-3/8	5-7/8
Length of pocket, top edge to bottom edge	6	6-1/4	6-1/4

Lower Pockets and Flaps			
Size (Short, Regular, Long, X-Long)	36 - 38 inches	40 - 42 inches	44 - 46 inches
Length of flap at center point	3-3/4	3-3/4	3-3/4
Length of flap at sides	2-1/4	2-1/4	2-1/4
Width of flap at top edge	7-3/4	8-1/4	8-3/4
Width of pocket at top edge, side edge to side edge	7-1/2	8	8-1/2
Width of pocket at bottom edge, side edge to side edge	10	10-1/2	11
Length of pocket top to bottom edge:			
Short	10-1/2	10-1/2	10-1/2
Regular	10-3/4	10-3/4	10-3/4
Long	11	11	11
X-Long	11-3/4	11-3/4	11-3/4

1/ Tolerance on all measurements: ± 1/8 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

*4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-1490 and MIL-I-45208.

4.4 First article inspection. When first article is required, inspection of the first article shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table IV for characteristics noted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Table IV. Test Methods

Components	Characteristics	Reqmt. para.	Test method	No. Determination per sample unit	Results reported as:
Cloth, Cotton, Buckram (collar interlining)	Material identification	3.3.7.1	1200	1	Pass or fail
	Weave (single ply)	3.3.7.2	Visual	1	Pass or fail
	Texture-threads per inch (single ply)	3.3.7.3	5050		
	- warp			3	Avg. of the 3 det in each direction to the nearest whole number.
	- filling			3	
	Resistance to:				
	- Wet (dry) cleaning (laminated cloth)	3.3.7.4	5622	1	Satisfactory or unsatisfactory to standard. If no standard: good, fair or poor.
	- Accelerated aging (laminated cloth)	3.3.7.4	5622	1	Pass or fail
	- Perspiration	3.3.7.4	5682	1	Satisfactory or unsatisfactory to standard. If no standard: good fair or poor.
	Stiffness- in. lb.				
	- original 1/	3.3.7.4.1	5202	10	Nearest 0.001 lb.
	- after wet (dry) cleaning 2/	3.3.7.4.1	5622	10	
	- after accelerated aging 3/	3.3.7.4.1	5850	10	
	- after perspiration 4/	3.3.7.4.1	5680	10	
	Weight oz. per sq.yd.	3.3.7.4.2	5041	5	Avg. of the 5 det to nearest -.1 oz.
	Breaking strengths lbs. (laminated cloth)	3.3.7.4.3	5100	5	Avg. of the 5 det to each direction to the nearest 1.0 lb.
	- warp direction			5	
	- filling direction			5	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

Table IV. Test methods (cont'd)

Components	Characteristics	Reqmt. para.	Test method	No. Determination per sample unit	Results reported as:
Fastener, snap	Material identification 1/	3.3.16	Std. comml		
	Finish	3.3.16	Std. comml	1	Pass or fail
	Size and type	3.3.16	Std. comml	1	Pass or fail
Hook and eye	Material identification 5/	3.3.17	Std. comml	1	Pass or fail
	Design	Fig. 1	Visual	1	Pass or fail
	Measurements	Fig. 1	Std. comml	1	Pass or fail
	Finish	3.3.17.1	Std. comml	1	Pass or fail
	Finish (tackiness) 6/	3.3.17.1		1	Pass or fail

1/ Method 5202, using a moment-weight of 1 pound.
2/ Method 5622, except the material shall be subjected to three 20-minute test cycles.
3/ Method 5850, except the aging process shall be limited to 5 hours at a temperature of 100°C.
4/ Method 5680, except the material shall be immersed in the specified solution for 20 minutes and then air-dired.
5/ Accept a certificate of compliance for this requirement.
6/ Test for tackiness. At room temperature (60° to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1490. If one or more sample units fail to meet any test requirements listed below, the lot represented shall not be acceptable.

Components	Lot size expressed as	Sample unit for testing
Fasteners, snap	1000 sets	15 complete sets
Threads (all sizes)	Bobbins (when used) 1/	Sufficient number of bobbins to total a minimum of 360 yards.
Cloth, Cotton Buckram (for collar)	Yards	2 yds. full width
Buttons, (each type and size)	Gross	20 each
Ring toggle	Gross	5 complete sets
Hook and eye	100 each	2 ea, hook and eye

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an asterisk (*) and listed as selected defects in MIL-STD-1490. Any coat containing a selected defect shall not be included in the end item lot.

4.5.4 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1490 and Tables II and III of this specification.

4.5.5 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1490. The occurence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1490.

1/ When threads are purchased in the form of cones or spools and on bobbins, thread from each shall be tested.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

5. PACKAGING

*5.1 Preservation and packaging. Preservation and packaging shall be level A, B, or commercial as specified (see 6.2).

5.1.1 Level A.

5.1.1.1 Method 1. Each coat, with belt attached, shall be neatly folded in accordance with good commercial practice. Fifteen (15) coats, of one size only, shall be packed with the collar of every other coat in a reverse position, in a fiberboard shipping container conforming to class weather resistant, grade V2s, size 3A of MIL-B-17757. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container (see 5.2.1).

5.1.1.2 Method 2. When specified (see 6.2), three level B shipping containers (45 coats of one size only) shall be overpacked in a fiberboard shipping container conforming to class weather resistant, size 4, of MIL-B-17757, reinforced as specified in the appendix to the box specification. Towards the end of the contract or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container (see 5.2.1).

*5.1.2 Level B. Each coat, with belt attached, shall be neatly folded in accordance with good commercial practice. Fifteen (15) coats, of one size only, shall be packed with collar of every other coat in a reversed position, in a fiberboard shipping container conforming to class domestic, size 3A of MIL-B-17757. The fiberboard used in fabricating the box shall be grade 275 and for lining grade 200. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60 pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled and closed as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container (see 5.2.1).

5.1.3 Commerical. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight and National Motor Freight Classification rules and U. S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

5.2 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

5.2.1 Mixed sizes. Each shipping container that is packed with mixed sizes shall have, securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 inches by 4 inches. The words "Mixed Sizes" shall be plainly stamped or printed on the label. The quality and sizes of the coats contained in the shipping container shall be legible stamped or printed under the words "mixed sizes" on the label.

6. NOTES

6.1 Intended use. The coat covered by this specification is intended to be worn by male officers of the U. S. Marine Corps.

6.2 Ordering data. Procurement documents should specify the following:

*6.2.1 Procurement requirements.

(a) Title, number, and date of this specification
(b) Size required (see 1.2)
(c) When first article is not required (see 3.2)
(d) Selection of applicable levels of preservation and packaging and packing (see 5.1)
(e) When level A, method 2, preservation and packaging is required (see 5.1.1.2).

6.2.2 Contract data requirements. Data conforming to Data Item Description DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on DD Form 1423 included in the contract.

6.3 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 Approved material. For information regarding types of approved basic material other than specified herein, address inquiry to the Commandant of the Marine Corps, Headquarters, U. S. Marine Corps (Code LMP), Washington, D. C. 20380.

*6.5 First article. Examination, tests and approval shall be as specified by the contracting officer (see 3.2).


Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

*6.6 Figures. Figures 1 through 11 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.7. Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship of the last previous issue.

Preparing activity:
Navy - MC
Project No. 8405-N772

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

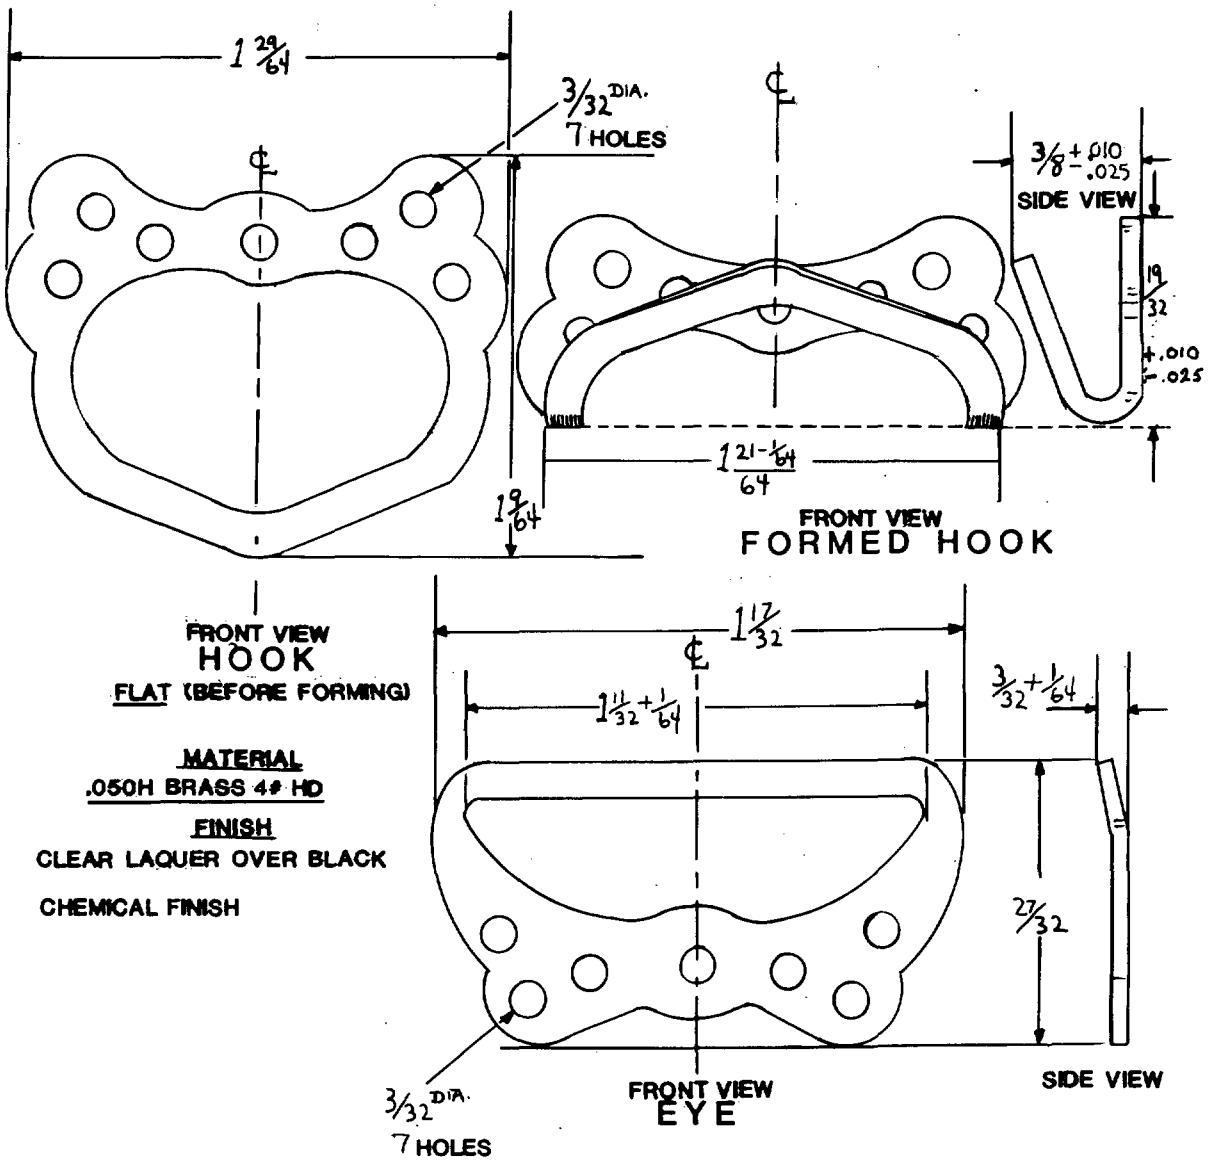

TOLERANCES: UNLESS OTHERWISE SHOWN

DECIMAL..... ± —

FRACTIONS..... ± .010


ANGLE..... ± —

ALL MEASUREMENTS ARE IN INCHES

HOOK AND EYE

FIGURE 1. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

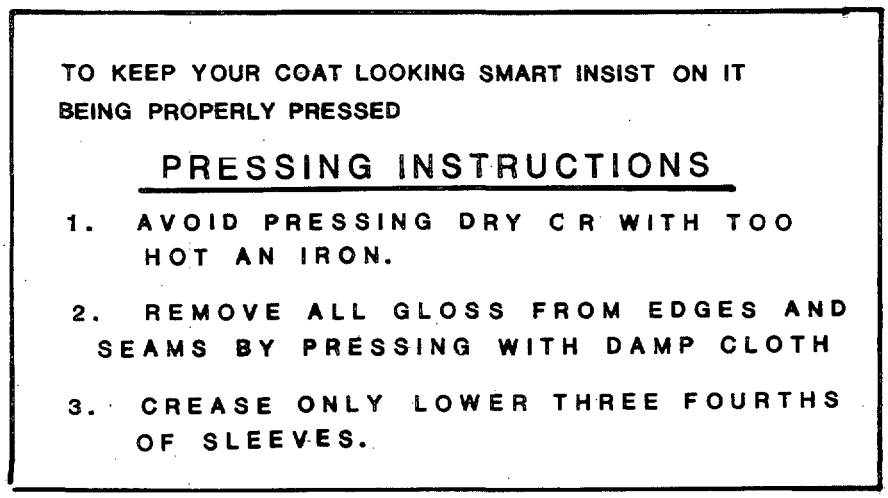

WOVEN
INSTRUCTION LABEL

FIG. 2 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

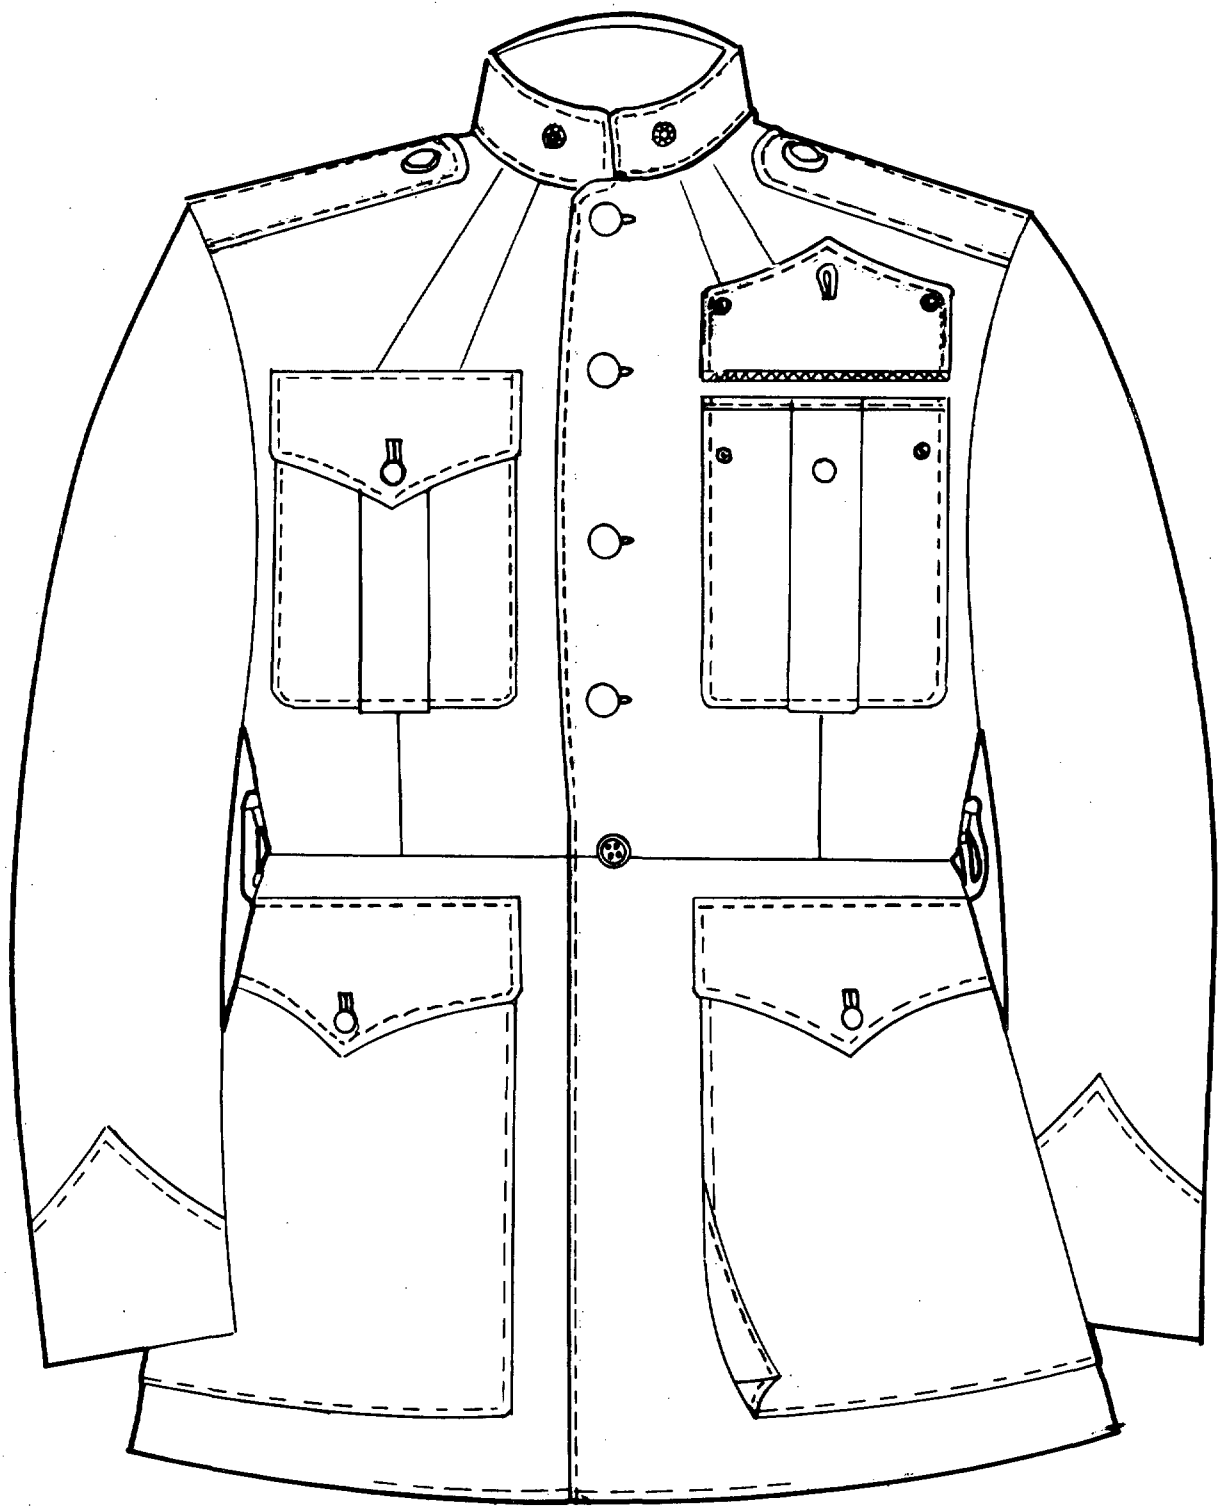


FIG. 3 COAT, MAN'S: DRESS, BLUE, OFFICERS

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.


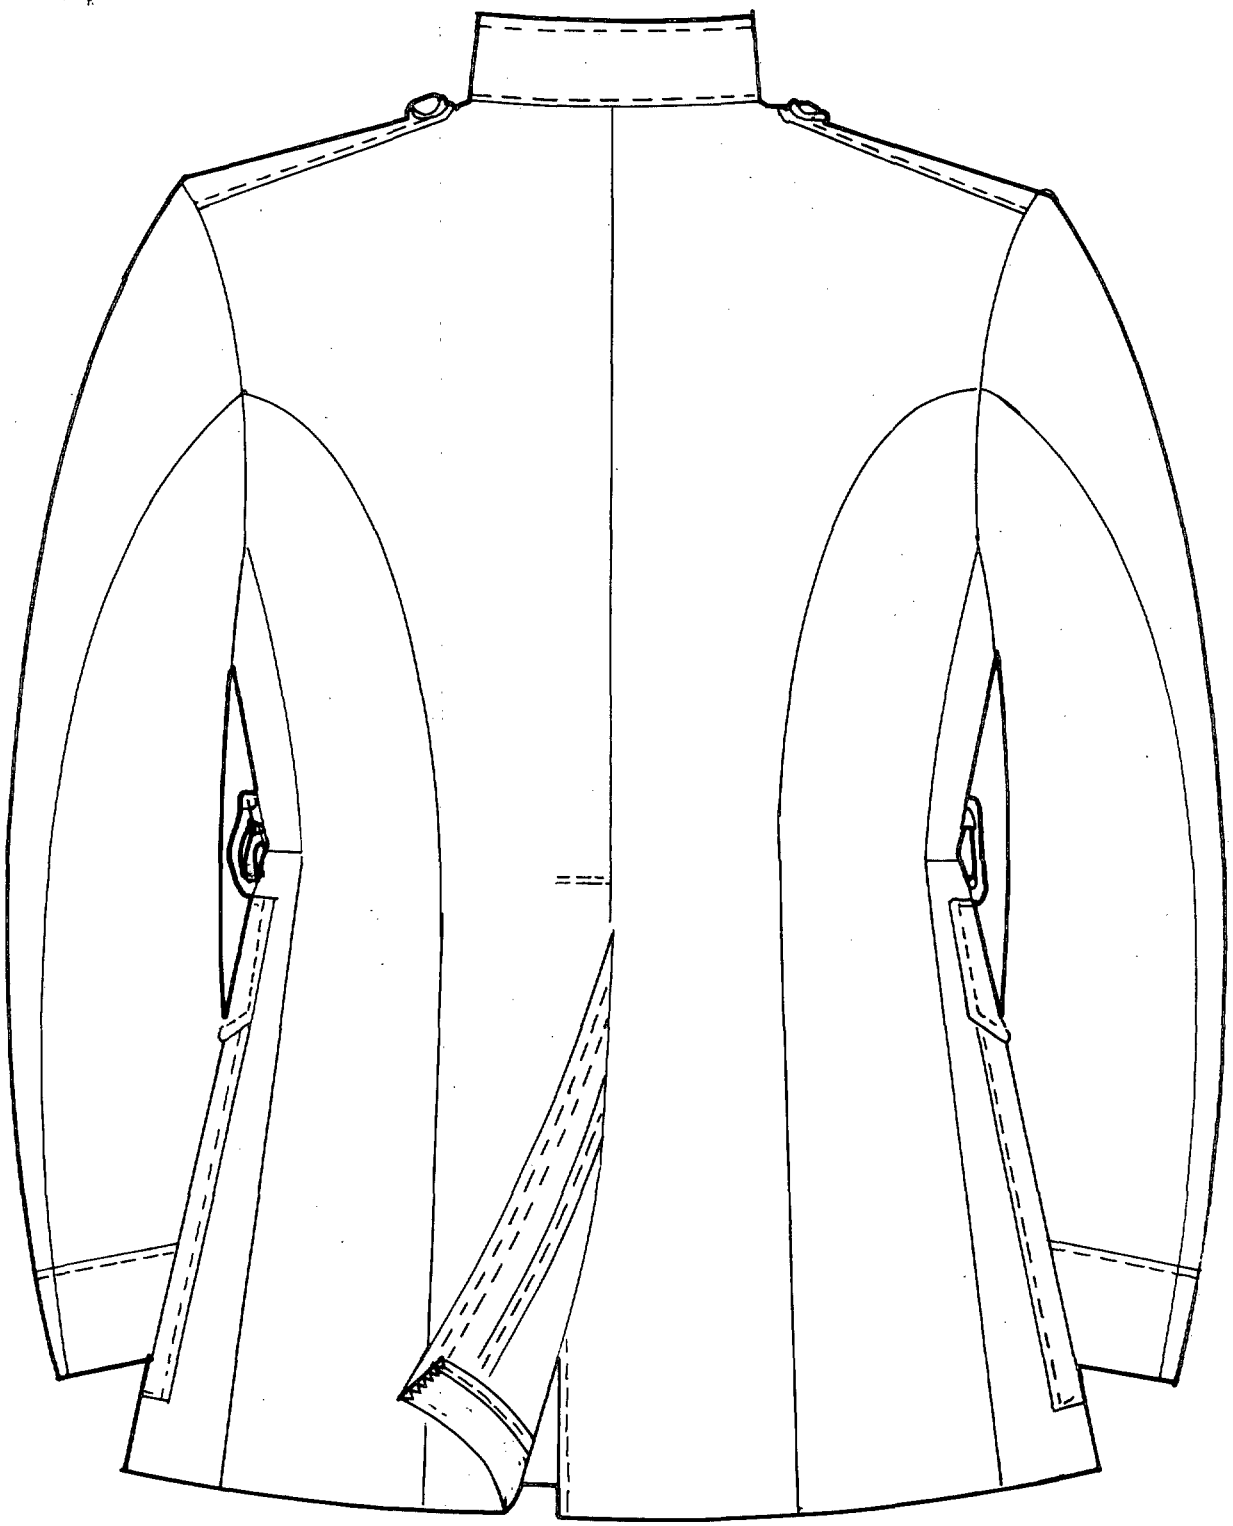


FIG. 4 COAT, MAN'S: DRESS, BLUE, OFFICER'S


Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

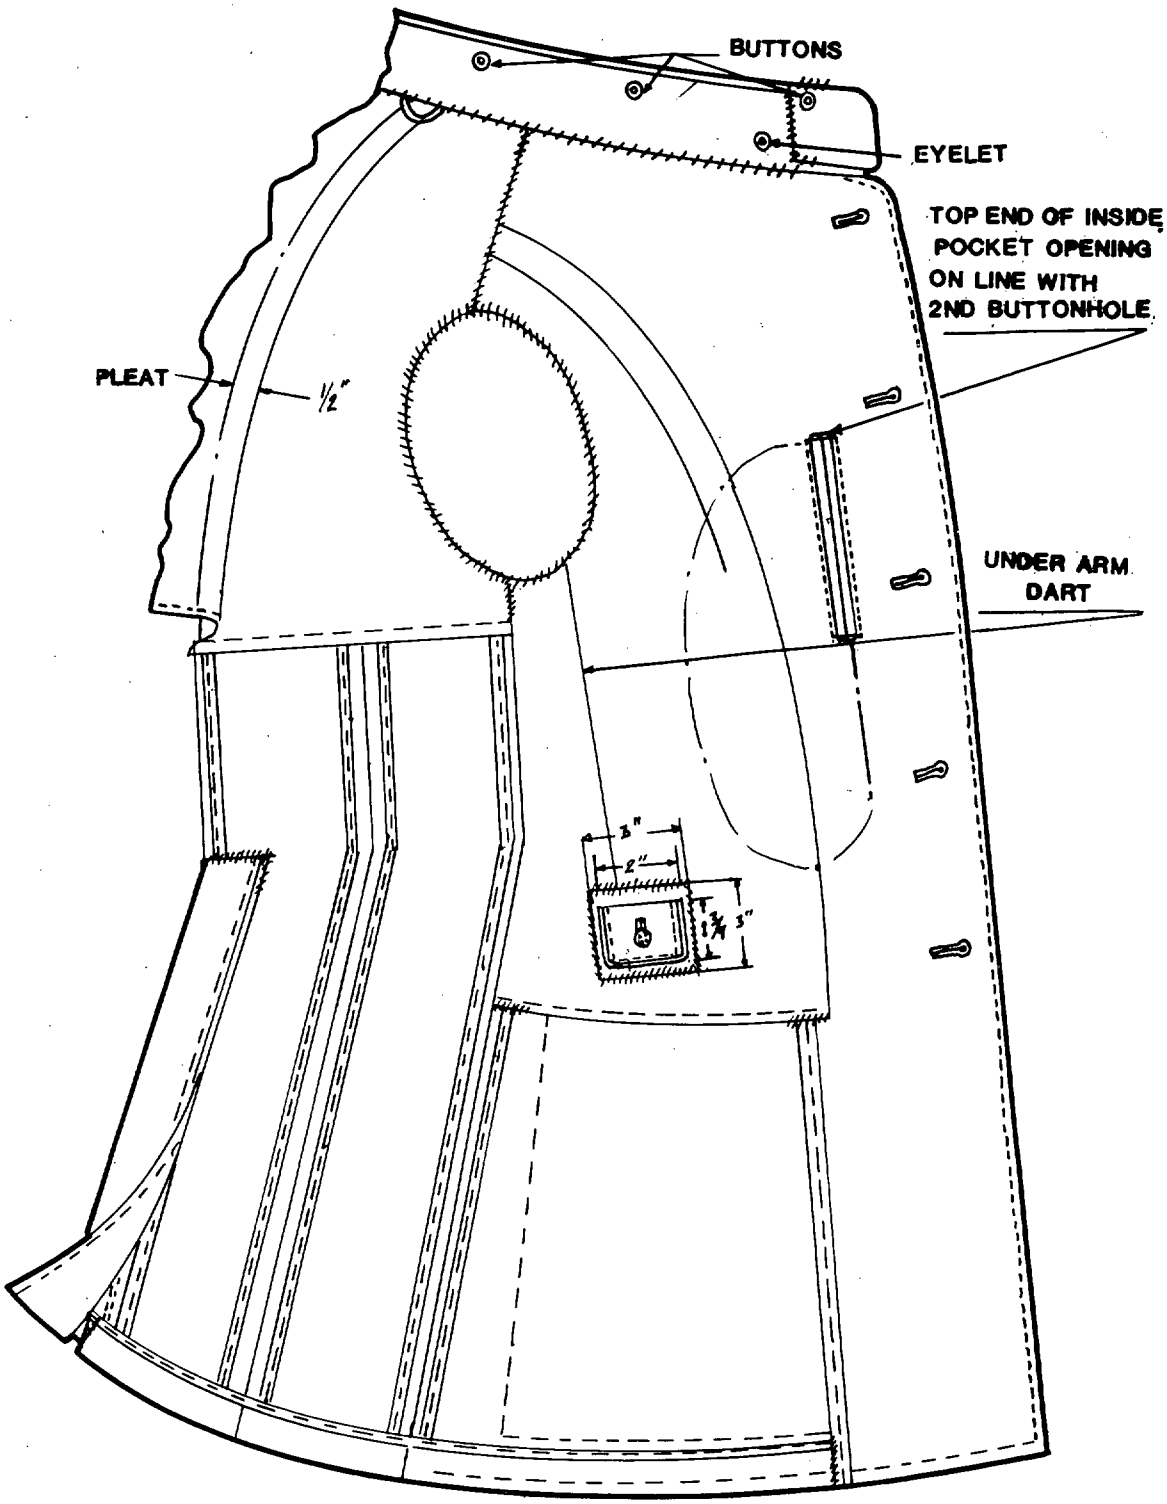

SIDE VIEW LEFT INSIDE

FIG 5. COAT, MAN'S: DRESS, BLUE, OFFICERS

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

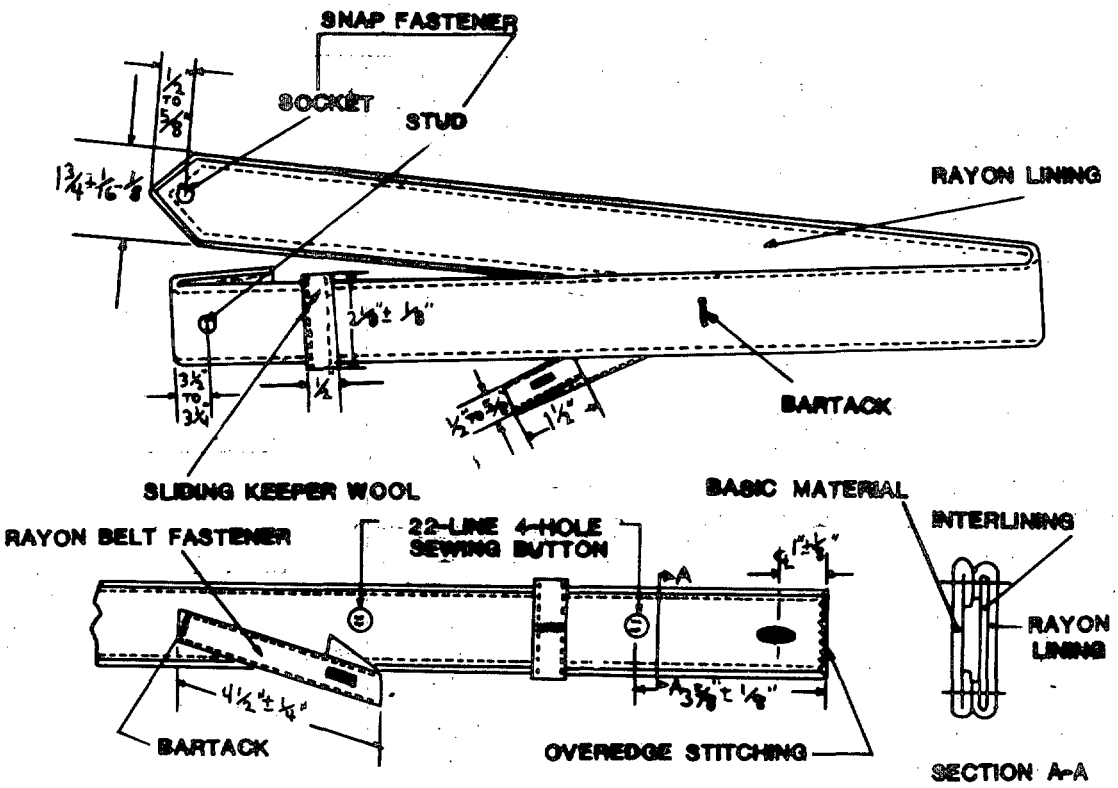

BELT DETAIL (STANDARD)

FIGURE 6. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

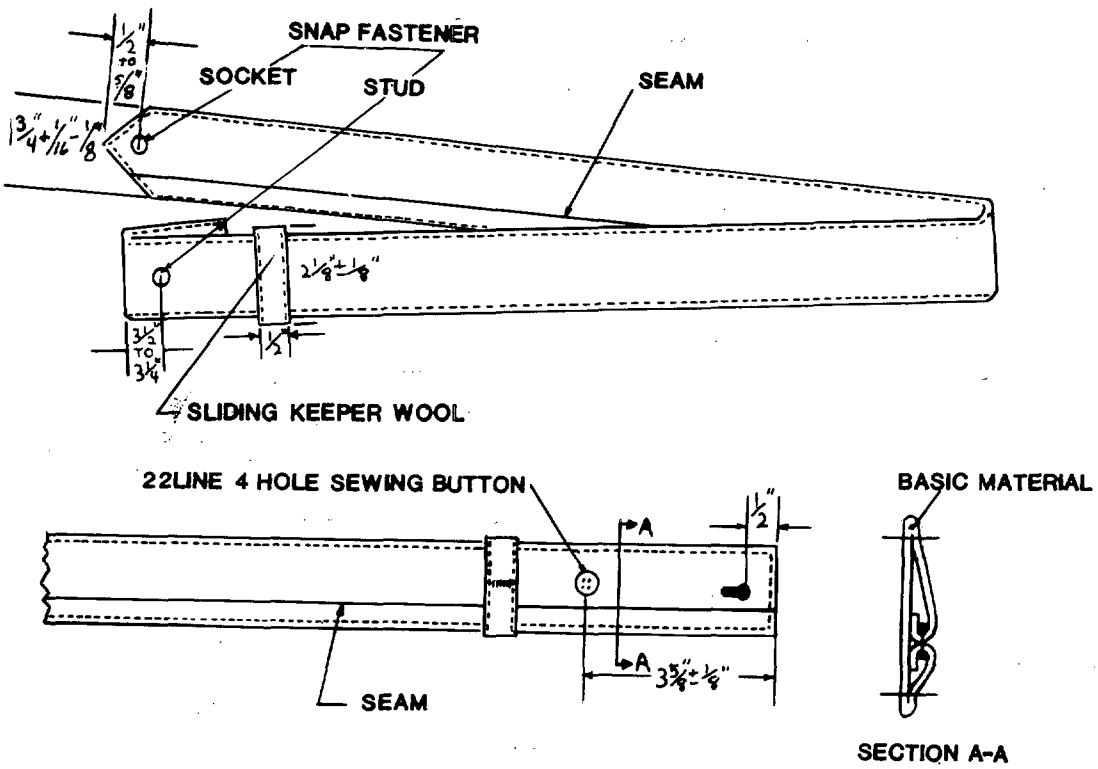


FIGURE 7. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

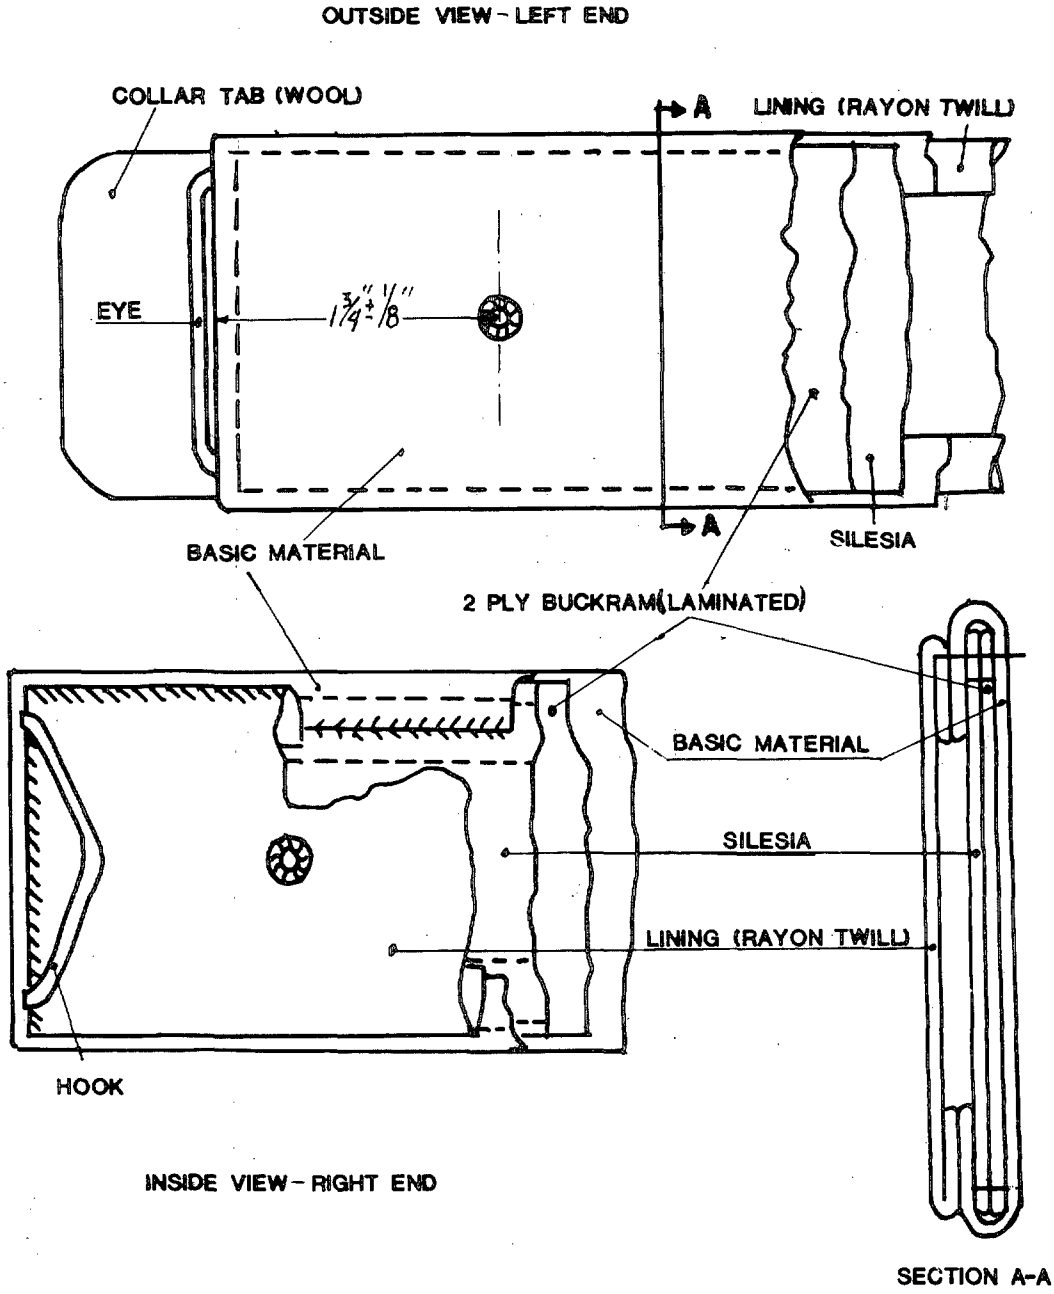


FIG 8 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

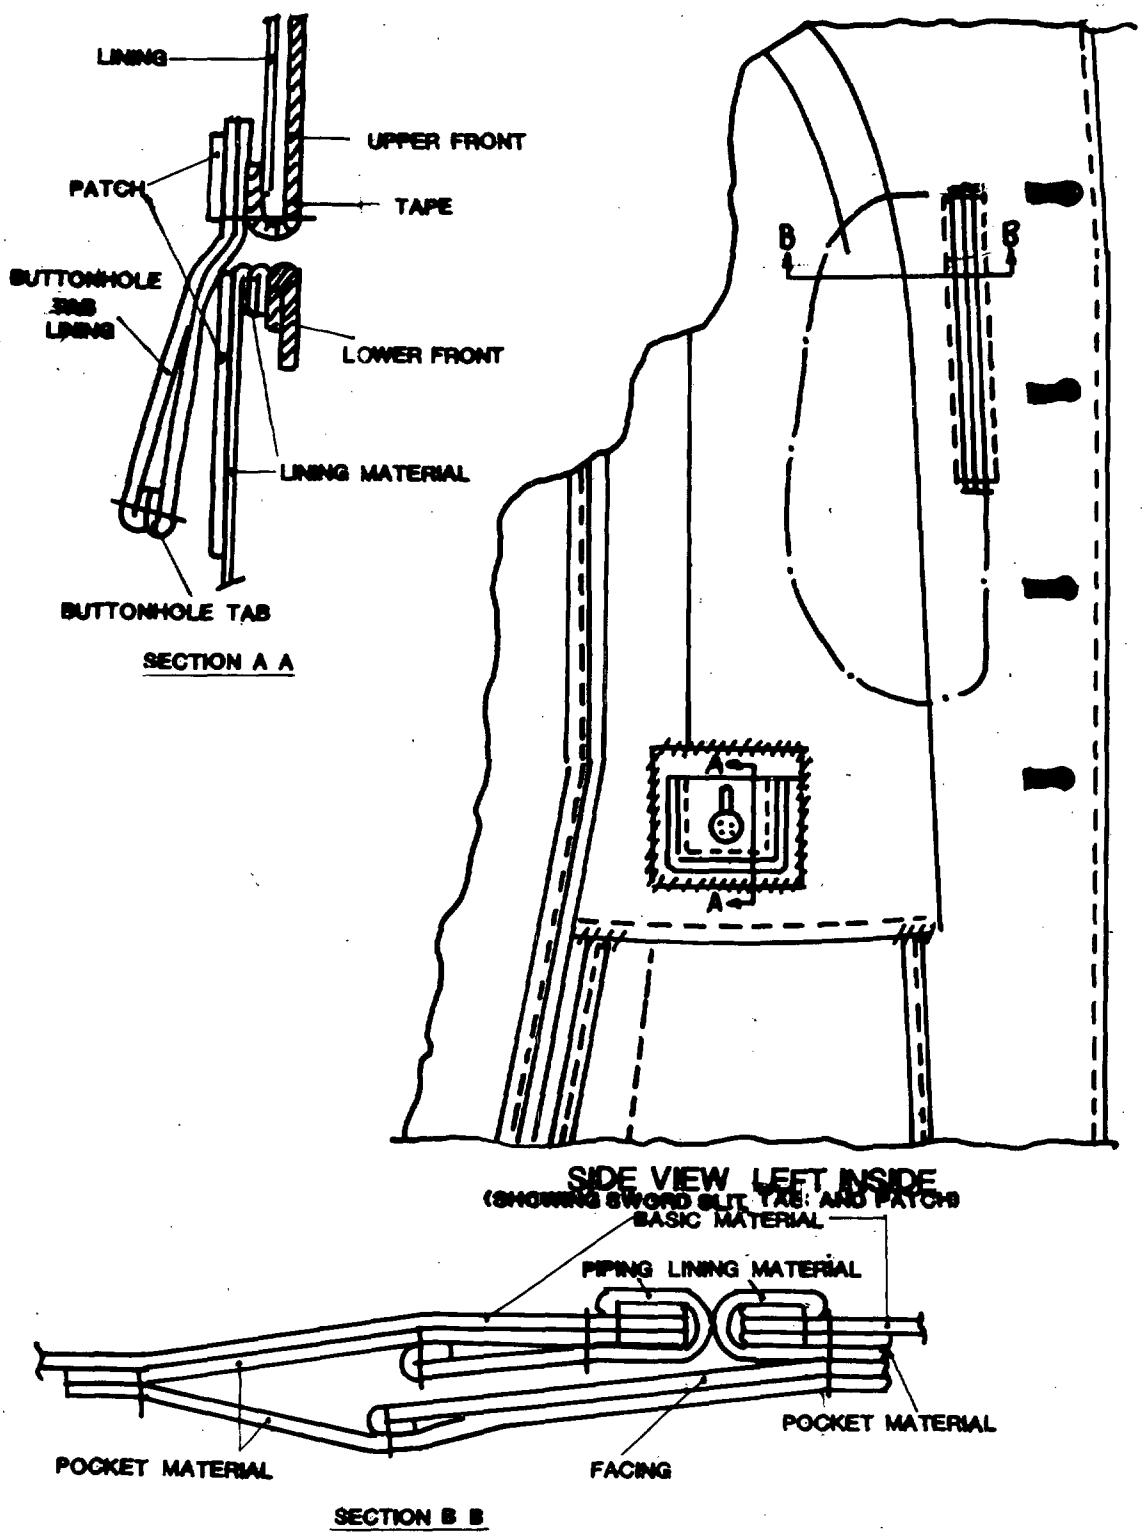


FIG 9 COAT, MAN'S: DRESS, BLUE, OFFICERS

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.


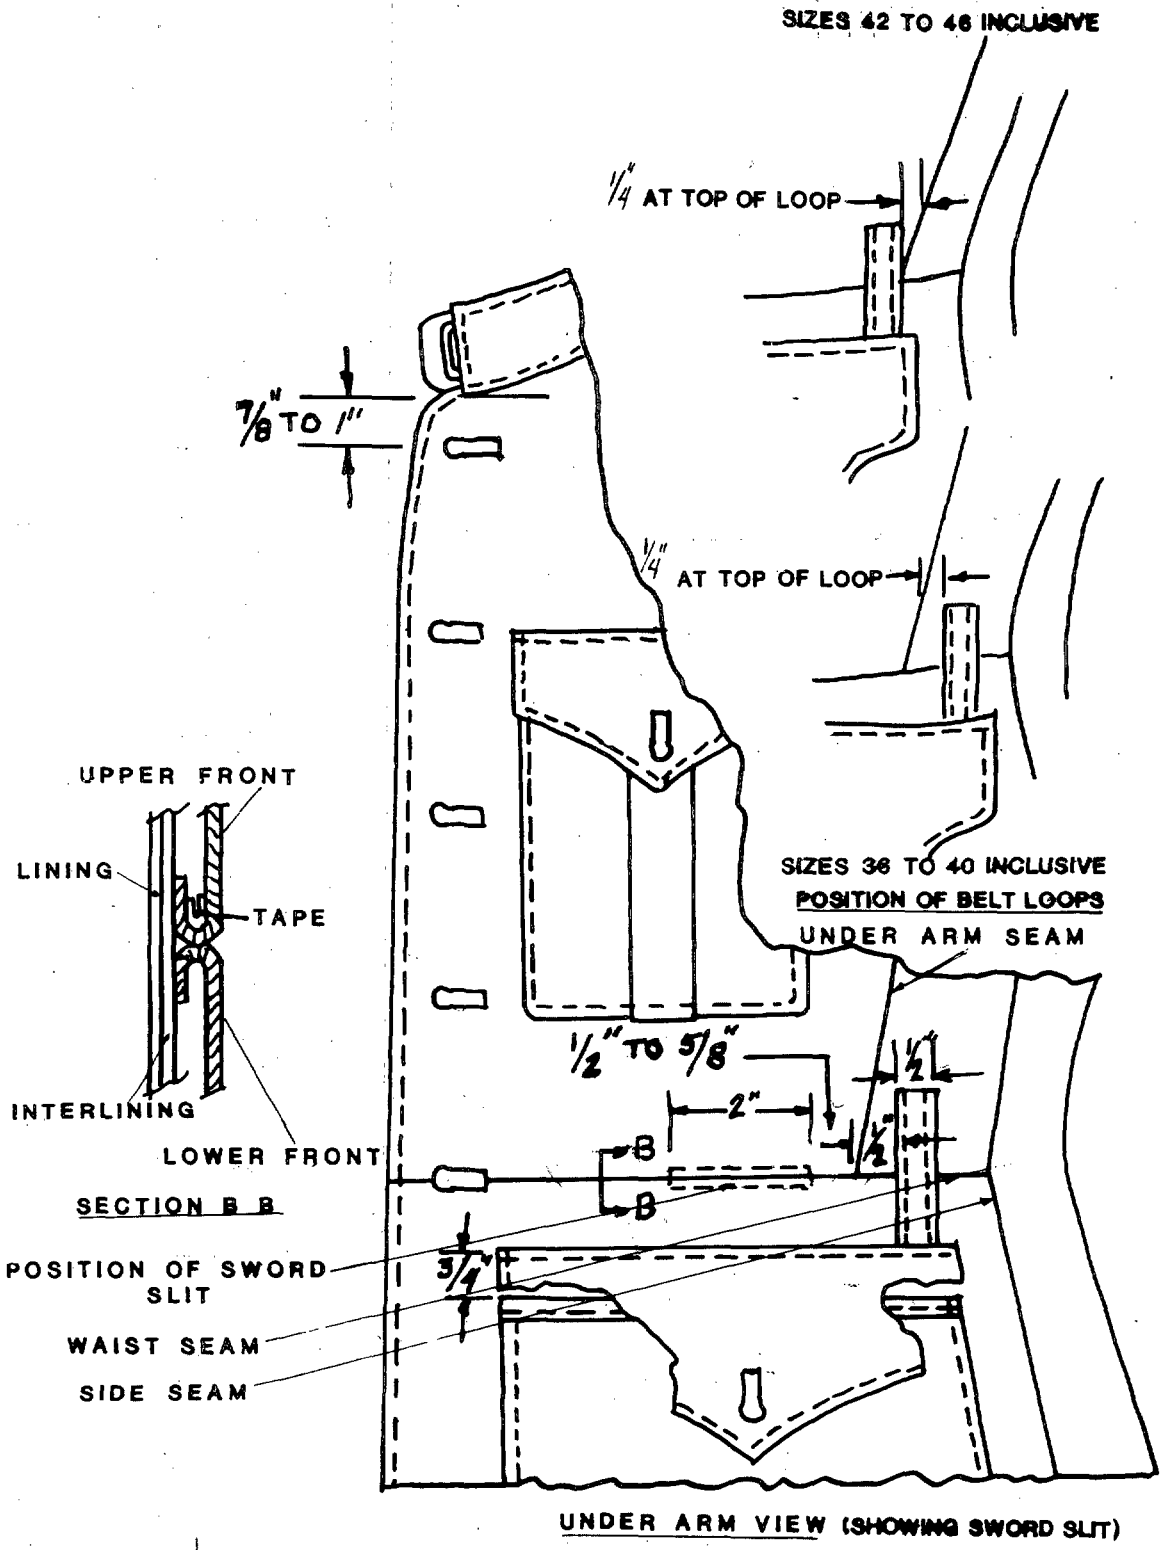


FIG 10 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

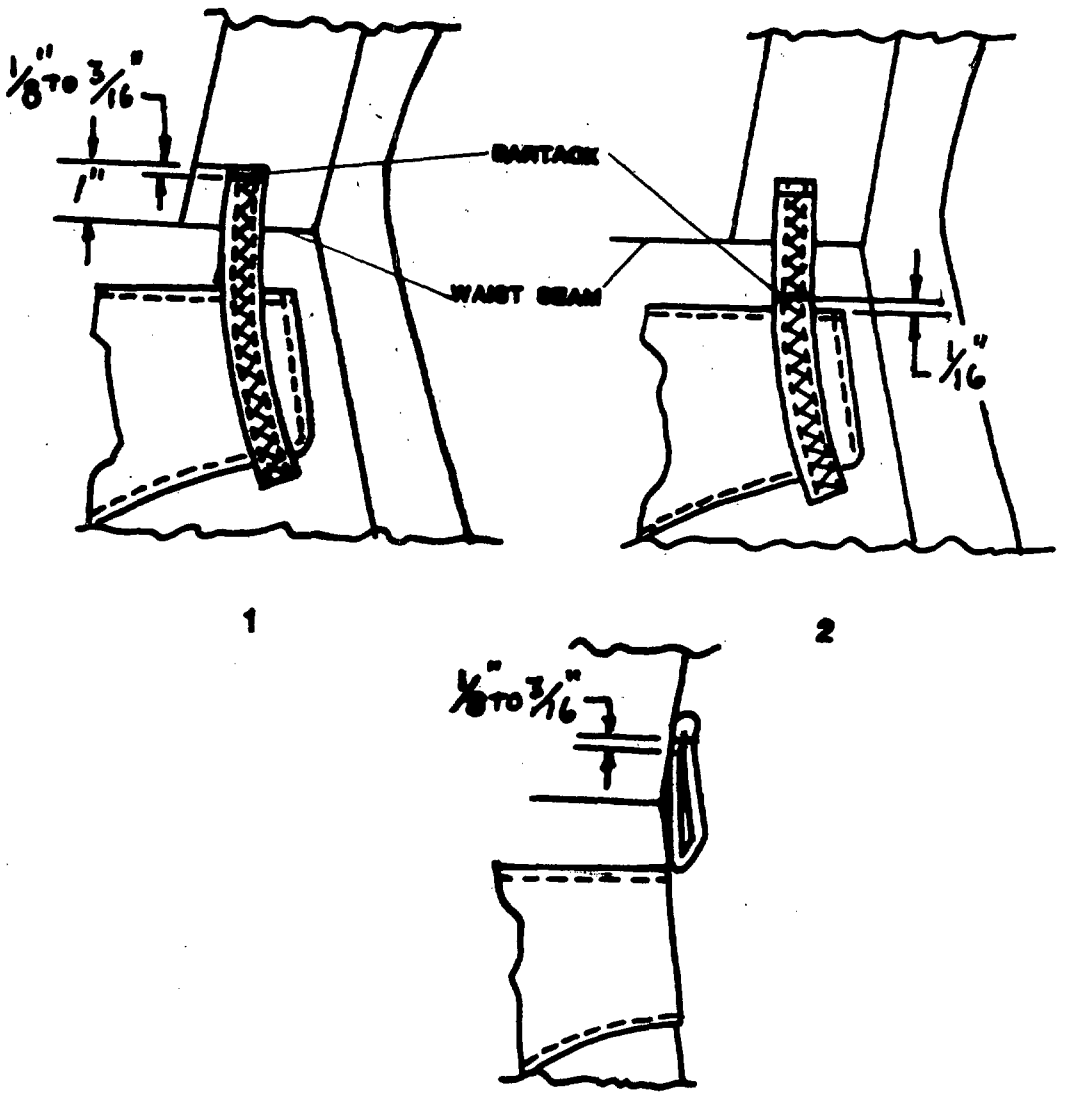

BELT LOOP PLACEMENT

FIG. 11. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1426 1 OCT 76

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID

U.S.MAIL

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commandant of the Marine Corps
Headquarters, U. S. Marine Corps
Code LMO-1
Washington, D.C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:06Z
Check the source to verify that this is the current version before use.