INCH-POUND

MIL-C-28950B(MC)

26 July 1994

SUPERSEDING
MIL-C-28950A(MC)
6 April 1978

MILITARY SPECIFICATION

COAT, MAN'S: DRESS; BLUE (OFFICER'S)

This specification is approved for use U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for a blue dress coat, with belt.

1.2 Classification. The coats shall be of one type in the following sizes as specified (see 6.2).

Schedule of Sizes

Short	Regular	Long	Extra Long
36	36	36	36
38	38	38	38
40	40	40	40
42	42	42	42
	44	44	44
	46	46	

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except the detailed requirements of Section 3, Table I may be modified to the extent necessary for good custom tailoring practices.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-50067	- Cloth, Flannel, Wool, Undercollar Cloth
A-A-50186	- Cloth, Buckram, Woven and Nonwoven
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton, Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton, or Polyester Covered
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill, Polyester, or Polyester Blend
V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic)
DDD-L-20	- Label, For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile; Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-F-495	- Finish Chemical, Black, For Copper Alloys
MIL-B-3461	- Buttons, Insignia, Metal, Uniforms and Cap
MIL-C-3738	- Cloth, Elastique, Wool
MIL-C-10176	- Cloth, Gabardine, Wool, Polyester/Wool
MIL-L-15040	- Labels, Garment (Woven, Rayon)
MIL-P-15064	- Pads, Shoulder and Sleeve-Head
MIL-F-15065	- Coat Fronts
MIL-C-44192	- Container, Shipping and Storage Coat (Hanger Pack)
MIL-I-45208	- Inspection Systems Requirements

STANDARDS

FEDERAL

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitch, Seam, and Stitching

MILITARY

MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-1490 - Provisions for Evaluating Quality of Coats, Men's Dress

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094.)

2.2 Non-Government publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of documents which are DoD adopted shall be those listed in the issue of the DoDISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issues of the documents cited in the solicitation (see 6.2).

Department of Defense (DoD) Standard Shades for Buttons, 1966

Department of Defense (DoD) Standard Color Card of Official Standardized Shades for Sewing Threads, 1968

(Copies may be obtained from the Color Association of the United States, Inc., 200 Lexington Avenue, New York, NY 10016.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM-D 3951 - Standard Practice for Commercial Packaging

(Applications for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103-1187.)

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document shall take precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currentversion before use.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample coats for first article inspection and approval.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, polyester/wool gabardine, conforming to type II, class 12 of MIL-C-10176, 10.6 oz., blue shade 2312. An optional fabric is cloth, wool, elastique, conforming to type II of MIL-C-3738, 16 oz., blue shade 2309.

3.3.2 Lining. The material for lining the coat, standard belt, pocket flaps, buttonhole tab for sword slit, collar and vent; for making the belt fastener; and for the facing of the inside pocket shall be cloth, rayon, twill, 3.7 ounce, conforming to class 1 of MIL-C-368. The color of the cloth shall be black shade 2604 (see 6.3).

3.3.3 Undercollar cloth. The sword slit patch and collar tab shall be made of wool flannel, undercollar cloth, conforming to A-A-50067. The color of the cloth shall be of an approved shade to closely match the basic material of the coat (see 6.3).

3.3.4 Bias binding. The binding for the upper edge of the front pockets, the back edge of the facings, the raw edge of the button turnup, and the raw edge of seam allowances shall be bias-cut out of the lining material specified in 3.3.2. The bias binding for the seams, facings and bottom turnup shall be 3/4 inch wide, and for the top edge of pockets shall be 1-1/8 inches wide. The binding shall have sized edges.

3.3.5 Polyester twill. The material for making the inside breast pocket, stay pieces for the front pockets, stays for the armhole and shoulder seams and the lower edge of armhole, inside pocket support, collar interlining, and the reinforcement pieces for the upper front pocket snap fasteners shall be cloth, polyester twill, conforming to class 1 of A-A-52106. The polyester twill shall be black. The requirements for non-fibrous material and seam efficiency shall not apply.

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

3.3.6 Belt interlining. The material for interlining the standard belt shall be cloth, cotton, buckram, natural color, conforming to type I, A-A-50186.

3.3.7 Collar, interlining. The material for interlining the color shall be cloth, cotton, buckram, double texture, a laminated, starch finish, natural color, conforming to type IV of A-A-50186. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard.

3.3.8 Coat fronts. The coat fronts shall conform to type XI of MIL-C-15065, except that the cotton warp, hairwool filling cloth and the polyester twill cloth for the stays shall be dyed black. The dyed polyester twill shall show fastness to wet (dry) cleaning only. The dyeing of the cotton warp, hair filling cloth shall be accomplished with a selected direct dye and the dyed cloth shall be after treated, preferably with copper sulfate to meet the requirements as specified herein. The dyed cotton warp, hairwool filling cloth shall show fastness to wet (dry) cleaning.

3.3.8.1 Fusible for coat fronts and back vent (alternate). The coat front and vent may be fused using a woven twill cloth conforming to type II, Style B, class 1 of MIL-C-44296 in black or charcoal gray shade. Kufer Style G34, National Style 200FL or Crown Style 241 fusibles meet the requirements (see Figure 12).

3.3.8.1.1 Chest pieces. Construction and application of chest piece and required components shall be the same as required in MIL-C-15065. Components requiring haircloth are the chest pieces, top front reinforcement pieces and wedge pieces. The flannel felt shall be the same as stated in MIL-C-15065, paragraphs 3.3.4.1 and 3.3.4.2. The polyester twill cloth required for stays and coverings shall be the same as stated in MIL-C-15065, paragraph 3.3.3. As an alternate, needle punch fabric in lieu of flannel is permitted.

3.3.9 Shoulder pads. The shoulder pads shall conform to type I, class 2, of MIL-P-15064.

3.3.10 Sleeve-head pads. The sleeve-head pads shall conform to type IV of MIL-P-15064.

3.3.11 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

3.3.12 Tape, cotton. The cotton tape shall conform to type III of DDD-T-86; 1/4 inch wide for armholes, back vent and waistseam and 3/8 inch wide for front edges of coat.

3.3.13 Thread.

3.3.13.1 Silk thread. The silk thread shall conform to A-A-50196. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and size F for buttonhole, needle and looper threads, respectively; and size O for machine felling. The thread for hand sewing shall be type III, size C, 2-ply of A-A-50196.

3.3.13.2 Cotton thread. The cotton thread shall conform to A-A-52094, type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, overedge stitching, and for belt and belt fastener buttonholes; type II, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for basting shall be a good commercial grade. As an alternate to the cotton thread, a polyester, cotton-covered thread conforming to A-A-50199 ticket No. 50, 2 or 3 ply may be used for seaming and ticket No. 70, 2 ply may be used for overedging.

3.3.13.3 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.4 Color and colorfastness. All thread shall be black AA, Cable No. 66043, (see DoD Standard Color Card of Official Standardized Shades for Sewing Threads, 1968) except cotton thread for basting and for machine tacking armholes may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to light.

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or type II of A-A-50198. The color of the gimp shall be black AA, Cable No. 66043 showing good fastness to wet (dry) cleaning.

3.3.15 Buttons.

3.3.15.1 Insignia buttons. The insignia buttons shall be metal, gold plated, officer design, 27-line and 40-line, regular shank conforming to type I, Style 4, class A, subclass 1 of MIL-B-3461. Ring toggles for securing buttons to pockets shall conform to MIL-B-3461.

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

3.3.15.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish, conforming to type II, class D, Style 4, 22-line, Style 20, 34-line, and Style 25, 16-line of V-B-871. The color shall be white for the collar, and black shade BT Cable No. 62001 for the rest of the coat (see DoD Standard Shades for Buttons 1966).

3.3.16 Fasteners, snap. The snap fasteners for the upper pockets and flaps shall be brass, black japanned finish or black chemical finish in accordance with MIL-F-495, followed by clear lacquer coating, round or square style, rolled edge, size 1/0, sew-on type (see Section 4, Table IV for required tests).

3.3.17 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, followed by clear lacquer coating and shall conform to the requirements shown in Figure 1 and the following.

3.3.17.1 Closure finish. All surfaces and edges of the hook and eye shall be clean, smooth, and free from burrs, tool marks, sharp edges and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in Section 4, Table IV. All apertures of the finished lacquered hook and eye shall be completely open and free of any lacquer film or black chemical finish.

3.3.18 Labels. Each coat shall have an identification label and a size label conforming to DDD-L-20 and a woven instruction label conforming to MIL-L-15040 and the following. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.18.1 Identification label. The identification label shall be type I, class 1 of DDD-L-20 and shall measure not less than 2-1/2 by 1-1/2 inches. The content and format shall be as follows:

Nomenclature (item description)
Contract Number
Name of contractor
Wool Products Act Information

Note: Size of character for "Name of Contractor" shall be minimum 8 point (approximately 3/32 inch).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

3.3.18.2 Size label. The size label shall be type I, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long, and Extra Long, as shown by the following example:

40R

3.3.18.3 Woven instruction label. The woven instruction label shall conform to size C of MIL-L-15040. The content and format shall be as shown in Figure 2. The letters for the caption shall be not less than 5/32 inch in height and all other letters and figures shall not be less than 1/8 inch in height.

3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 3, 4 and 5, a five-button, single breasted, quarter or fully lined coat with separate belt, having a skirt-type front with side body pieces, waist seam and waist darts, upper patch pockets and lower bellows pockets with worked eyelets for detachable insignia buttons and with flaps to button, a four-piece back with lined vent, ornamental sleeve cuffs, one inside breast pocket with vertical piped opening, shoulder straps to button, and a stand-up collar with single hook and eye for front closure. Coats shall have a sword slit in waist seam at left side with a lined tab on inside to button.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns provide 3/16 inch allowance for seams at the top and front edges of coat, and for pocket flap and shoulder strap seams; 3/4 inch allowance for side seams; 5/8 inch allowance for center back seam and 3/8 inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 Pattern parts. Coats shall be cut form the materials specified herein in accordance with the number of pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

Item	Pattern Nomenclature	No. of cut parts
	Material: Basic	
1.	Front, upper	2
2.	Front, lower	2
3.	Facing, right	1
4.	Side body (front)	2
5.	Facing, left	1
6.	Center back	2
7.	Side back	2
8.	Topsleeve	2
9.	Undersleeve	2
10.	Sleeve cuff	2
11.	Collar (outer ply)	1
12.	Shoulder strap, top ply	2
13.	Shoulder strap, under ply	2
14.	Pocket, upper	2
15.	Pocket, lower	2
16.	Pocket flap, upper	2
17.	Pocket flap, lower	2
18.	Belt (standard)	1
19.	Belt (optional)	1
20.	Sword slit tab	1
	Material: Cloth, rayon lining	
21.	Front	2
22.	Yoke	1
23.	Topsleeve	2
24.	Undersleeve	2
25.	Pocket flap, upper	2
26.	Pocket flap, lower	2
27.	Vent lining	1
28.	Sword slit tab lining	1
29.	Inside breast pocket facing	2
30.	Collar lining	1
31.	Belt lining (standard belt)	1
	Material: Polyester twill	
32.	Inside breast pocket	2
33.	Stay, snap fastener	4
34.	Stay, upper pocket	2
35.	Stay, lower pocket	2
36.	Collar interlining	1
	Material: Cloth, buckram, cotton (double textured; double ply)	
37.	Collar interlining	1

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currentversion before use.

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, cotton buckram (single ply)	
38.	Belt interlining (standard belt)	1
	Material: Cloth, flannel, wool	
39.	Sword slit patch	1
40.	Collar tab	1
	Shapers	
41.	Finished pocket shaper, upper	
42.	Finished pocket shaper, lower	
43.	Finished pocket flap shaper, upper	
44.	Finished pocket flap shaper, lower	
45.	Left vent shaper	
	Marker	
46.	Sleeve cuff marker	

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitching. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raw edge without cutting the material.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitchings shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic material, and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with patterns furnished. b. Cut all materials in the direction indicated by the directional lines on the patterns. The straight of the cloth indicates the warp direction. c. Cut all wool parts of the coat, including belts, from one piece of basic material, except the following parts may be cut from ends, but when so cut, the parts shall harmonize with the shade of the coat: underply of shoulder straps, sword slit buttonhole tab, belt loops and belt keeper may be banded 1 inch wide. d. Cut fronts, yoke, collar and vent lining parts of the coat and facing for inside pocket from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. The belt lining shall be cut 2-1/4 inches wide, and the belt fastener shall be cut 1-5/8 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) d. (cont'd) Bias binding shall be cut 3/4 inch wide for edge of bottom turnup, back edge of facings, and for edges of seam allowances and 1-1/8 inches wide for top edge of pockets. e. Cut polyester twill stays for armhole and shoulder seams and lower edge of armholes on the bias. Cut stays for armhole and shoulder seams and lower edge of armholes, 3/4 inch wide and 4-1/2 ± 1/4 inches long for the shoulder and armhole seams and 1-1/4 to 1-1/2 inches long for the lower edge of the armhole. f. Cut belt interlining on the straight 1-5/8 inches wide. g. Cut collar interlining in accordance with the pattern furnished. h. Dress the left vent in accordance with the shaper furnished. i. The use of drill holes is prohibited.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. a. Replace at time of cutting any parts containing damages such as holes or seriously weakening defects such as smashes, multiple floats, and slubs likely to develop into holes. b. Replace any part damaged during the manufacturing process by needle chews which may be expected to develop into a hole, scissor or knife cuts, tears, holes, mends, and burns.					
3	Shade marking. a. Mark all component parts cut from one piece of basic and lining materials, and the pairs of sleeve linings when cut from ends, to insure uniform shade and size throughout the coat. b. The use of tickets with metal fastening devices or sewn-on tickets is prohibited on the rayon lining (see 3.6.2).					

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make belt loops and keeper. Finished appearance. The belt loops and keeper shall finish 1/2 inch wide and shall finish smooth and flat without pleats, gathers, puckers, or other distortions. The stitching shall be uniformly 1/8 inch from the finished edges. a. The belt loops and keeper shall be made from a 1 inch wide strip of basic material. b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges, and join the edges together with a covering stitch. c. Cut the loop for the left and right sides of the coat 5-1/2 inches and 3-1/2 inches long, respectively. d. Cut the keeper 4-1/2 inches long, fold in half, end to end, and join the ends with a bartack across the width of the keeper. The finished keeper shall measure 2-1/8 ± 1/8 inches from bartack to folded end.	406 Bartack	EFh-1	12-16 28 per bartack	A (Silk) A	A A

Source: https://assist.dla.mil -- Downloaded: 20260410-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make belt fastener (standard belt only) (see Figure 6).					
	Finished appearance. The belt fastener shall finish 1/2 to 5/8 inch wide and shall finish smooth and flat without pleats, gathers, puckers or other distortions. The buttonhole shall be clean cut and well made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the fastener.					
	a. The belt fastener shall be made from a 1-5/8 inch wide strip of rayon lining material.					
	b. Fold the strip in half lengthwise, turn in the raw edges, and stitch 1/8 inch from each side, catching the turned edges in the stitching to form a 1/2 to 5/8 inch wide band. Cut the fastener 6-1/2 inches long.	301	EFp-2	10-14	A	A
	c. Turn under one end of the fastener 1-1/2 inches and make a horizontal straight type buttonhole cut 5/8 inch long through the center of the turned under portion. The ends of the buttonhole shall be securely tacked.	Buttonhole		50 per buttonhole (including tack)	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make standard belt (see Figure 6). Finished appearance. The belt shall be uniformly stitched and shall finish smooth and flat without twists, pleats, puckers or raw edges. The pointed end of the belt shall be well formed with the turned in edges securely caught in the stitching. The buttonhole shall be clean cut and well made. a. The standard belt shall be made of one piece of basic material, lined with rayon lining and interlined with buckram. b. Place the interlining material between the basic and lining materials and seam together uniformly 1/8 inch from upper and lower edges, with the raw edges of lining and basic materials turned in and caught in the stitching. The stitching shall extend from one end of belt to approximately 1-1/4 inches from the opposite end. The lining shall be 1/16 inch back from the finished edge of belt.	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make standard belt (see Figure 6). (cont'd)					
	c. Turn lining and basic materials back at the top and bottom unseamed edges of the belt and trim the interlining approximately 1-1/4 inch back from the end.					
	d. Fold the end of the basic material in half lengthwise to the outside, and stitch across the width of the basic material 1/8 inch from the end.	301	SSa-1	12-16	A (Silk) -or- A	A A
	e. Turn the end of the belt, working out the point. Turn under the upper and lower edges of the lining, and seam the lining to the belt 1/8 inch from the folded edges of the belt closing the end and forming a point at the center of the finished end.	301	SSc-1	12-16	A (Silk)	A
	f. Close the opposite end of the belt with serge stitching.	502 or 503	EFd-1 EFd-1	10-14 10-14	A A	A A
	g. The finished width of the belt shall be 1-3/4 (+1/16, -1/8) inches. The finished length of the belt for each size coat shall be as shown in Table II.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make standard belt (see Figure 6). (cont'd)					
	h. Make a horizontal, straight type buttonhole, cut 5/8 inch long, midway between upper and lower finish edges of the belt to fit a 22-line sewing button, with the center of the buttonhole 1 ± 1/8 inch from the buckle end, and with both ends of buttonhole securely tacked. The purling of the buttonhole shall be on the outside of the belt.	Buttonhole		50 per buttonhole (including tack)	A	A
	i. Mark location for sewing two 22-line sewing hole buttons to lining side of belt. The center of the button for the buckle end shall be 3-5/8 ± 1/8 inches from the overedge stitched end of belt. The button for the belt fastener shall be positioned in accordance with mark on pattern for each size belt. The buttons shall be securely sewn to the belt with the end of the stitching securely tacked.					
	j. Securely sew one button at each mark. The button for the buckle end shall properly engage buttonhole in buckle end and shall be sewn through all plies of material.	101		21 per button	24/4	

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make standard belt (see Figure 6). (cont'd) j. (cont'd) The button for the belt fastener shall be sewn through the lining and interlining only. k. Mark location for sewing belt fastener to lining side of belt, in accordance with mark on pattern for each size belt. l. Turn under the raw end of the fastener 1/2 inch and bartack the fastener to the belt through all plies 1/8 to 3/16 inch from the folded edge. The bartack shall be across the entire width of the fastener and shall be finely stitched in order to not have an objectionable appearance on the outside of the belt. The fastener, when buttoned, shall be smooth and flat without twisting or bulging. m. Clean and press belt as specified in operation 7.k and 7.l.	Bartack		28 per bartack	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make optional one piece belt (see Figure 7).					
	Finished appearance. The belt shall finish smooth and flat without twists, pleats, puckers or raw edges. The pointed end of the belt shall be well formed. The buttonhole shall be clean cut and well made. The ends of the buttonhole shall be securely tacked.					
	a. The optional belt shall be made of one piece of basic material.					
	b. Fold the piece in half lengthwise forming two plies. Join the two plies together with a 3/8 inch seam.	301	SSa-1	12-16	A	A
	c. Spread open the seam and press the belt smooth and flat with a heated pressing iron.					
	d. Close the pointed end of the belt with a 1/4 inch seam along the slanted edges.	301	SSe-2 (a)	12-16	A	A
	e. Evenly trim the pointed end of the belt for proper turning. Turn the belt through the open end, completely working out the point.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make optional one-piece belt (see Figure 7). (cont'd)					
	f. Topstitch the belt uniformly 1/8 inch from top and bottom folded edges and seamed end, turning in the square end of the belt 1/4 inch and catching the turned-in portion in the stitching. The seam of the belt shall finish off center.	301	OSf-1 (top and bottom edges) SSe-2 (b) (pointed end) SSc-1 (square end)	12-16	A (Silk) -or- A (Silk)	A A
	g. The finished width of the belt shall be 1-3/4 (+1/16, -1/8) inches. The finished length of the belt for each size coat shall be as shown in Table II.					
	h. Make a horizontal eyelet-end taperbar type buttonhole, cut 5/8 inch long, in the center of the belt. The inside edge of the eyelet-end of the buttonhole shall be 1/2 to 5/8 inch from the buckle end of the belt. The buttonhole shall be well worked over the gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the belt.	Buttonhole		60 per buttonhole (including tack)	B (Silk)	F
	i. Mark the location for sewing one 22-line sewing hole button to the underside of the belt.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make optional one-piece belt (see Figure 7). (cont'd) i. (cont'd) The button shall be sewn to the belt with the end of the stitching securely tacked. j. Securely sew the button at the mark on the belt to properly engage buttonhole in buckle end. On the finished belt, the button shall be 3-5/8 ± 1/8 inches from square end of belt. k. Trim the ends of the stitching and remove all loose ends of thread from the belt. Remove all spots and stains from the belt without injury to the material. l. Place the belt keeper on the belt at the square end and secure by buttoning the end. Press the belt smooth and flat with a heated pressing iron or pressing machine. Ends of the keeper shall be spread open and pressed flat on the underside at the center of the belt.	Hand		6 per button (double thread)	24/4	

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Attach snap fasteners.					
	Finished appearance. The snap fasteners shall be securely attached to the belt. On the finished coat, the belt ends shall be fastened without misalignment or gap. On the standard belt, the fasteners shall be stitched through the interlining only. On the optional belt, the stitching shall not show on the opposite side of the belt.					
	a. Sew the socket part of the snap fastener to the inside point of the belt 1/2 to 5/8 inch from the point.	101		21 per fastener (minimum)	A	
		or 301		21 per fastener (minimum)	A	A
		or Hand		3-4 (double thread)	A	
	b. Sew the stud part of the snap fastener 3-1/2 to 3-3/4 inches from the folded end of the belt on the outside. When stud part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101		21 per fastener (minimum)	A	
		or 301		21 per fastener (minimum)	A	A
		or				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Attach snap fasteners. (cont'd)					
	b. (cont'd)	Hand		3-4 (double thread) (not including tack)	C (Silk)	
9	Make upper and lower pocket flaps. Finished appearance. The pocket flaps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The seamed edges, the corners and point of the flaps shall be well worked out and the lining shall not be visible on the outside of the flaps. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The ends of the gimp shall be pulled through to the underside of the buttonholes and the purling of the buttonholes shall be on the outside of the flaps. The buttonholes shall be the cut-first type.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Make upper and lower pocket flaps. (cont'd)					
	a. The pocket flaps shall be made of one ply of basic material, lined with rayon lining.					
	b. Securely sew the stud part of the snap fastener to the lower corners of the lining of the upper pocket flaps, through a small triangular shaped twill stay piece. On the finished flap, the fastener shall be midway between the side and bottom finished edges 3/8 to 1/2 inch back from the corners. When stud part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or 301 or Hand		21 per fastener (minimum) 16 per fastener (minimum) 3-4 (double thread) (not including tack)	A A	 A
	c. Seam the lining to the basic material 3/16 inch from the side and bottom edges, evenly trimming the edges for proper turning.	301	SSe-2 (a)	10-14	A -or- A (Silk)	A A
	d. Turn the flaps, working the edges, corners and point out completely. Topstitch the flaps uniformly 1/8 inch from seamed edges, working the lining back from the finished edge of the flaps.	301	SSe-2 (b)	12-16	A (Silk) -or- A (Silk)	A A

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Make upper and lower pocket flaps. (cont'd)					
	e. Press the flaps smooth and flat with a heated pressing iron or pressing machine.					
	f. Mark and trim top edge of flaps so that in the finished coat the length of the flaps at center point and sides shall conform to measurements shown in Table III.					
	g. Join the raw edges of the lining and flap together with overedge stitching.	504 or 505	EFd-1 EFd-1	8-10 8-10	A A	A A
	h. Make a vertical eyelet -end square-bar type buttonhole, cut 3/4 inch long, through the center of each pocket flap, with the inside edge of the eyelet 5/8 ± 1/8 inch above the center point.	Buttonhole		38 per buttonhole (minimum) (not including bartack)	B (Silk)	F
	i. Securely bartack the end of buttonholes, and trim the ends of the gimp.	Bartack		21 per bartack (minimum)	A (Silk)	A
10	Make upper pockets.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats; the basic material and both edges of binding shall be securely caught					

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Make upper pockets. (cont'd) in the stitching. The pleats shall be vertically centered and the folded side edges of the pleats shall be parallel. The pockets shall be uniform in shape and size in accordance with the pattern. a. Form a vertical box pleat on the outside center of upper pockets with a heated creasing machine. The pleat shall be 1-1/2 inches wide.					
	b. Secure the pleat with a row of stitches 1/16 inch from top and bottom edges, respectively. Trim the lower corners of the pockets.	301	SSe-1	10-14	A	A
	c. Tack the abutted edges of the pleat together on the inside of the pocket with blindstitching.	103	SSm-1	6-8	A	-
	d. Bind the upper edge of the pockets with 1-1/8 inch wide bias binding, with the pleat closed and both edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	a	A
	e. Turn under and crease the side and bottom edges of the pockets in a heated					

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Make upper pockets. (cont'd)					
	e. (cont'd)					
	edge creasing machine.					
	-or-					
	f. Fold the pocket in half lengthwise and stitch 1-1/2 inches from folded edge.	301	OSf-1	10-14	A	A
	g. Form the pleat and seam across the top and bottom edges, respectively, 1/16 to 1/8 inch from edge.	301	SSa-1	10-14	A	A
	h. Baste the center of pleat by machine.	301	Hopper			
	i. Press pleat flat and smooth with a heated pressing iron or pressing machine.					
	j. Bind the upper edge of pockets with 1-1/8 inch wide binding, with the pleat closed and both edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	k. Mark the patch pocket in accordance with the pocket shaper and trim the lower corners of the pocket for better turning.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Make upper pocket. (cont'd)					
	1. Turn under side and bottom edges of pocket at the marks and baste along the edges.	101 or Hand				
11	Make lower pockets.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats. The basic material and both edges of binding shall be securely caught in the stitching. The pockets shall be uniform in shape and size in accordance with finished pocket shaper.					
	a. Overedge stitch the raw edges of sides, bottom corners and bottom of pockets.	503 or 504	SSa-1	6-10	A	A
	b. Bind the upper edge of the pockets with 1 to 1-1/8 inch wide bias binding, with both edges of binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	c. Seam lower corners of pockets 3/8 inch from the serged edges.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11	Make lower pockets. (cont'd) d. Spread open the corner seams of pockets and press smooth and flat with a heated pressing iron.					
	e. Trim the corners and turn pockets, working out the corners completely. Turn under side and bottom edges of pockets to form bellows, and topstitch uniformly 1/8 inch from folded edges.	301	OSf-1	12-16	A (Silk)	A
	f. Press entire pocket smooth and flat with a heated pressing iron or pressing machine, evenly creasing the edges.					
	g. The pockets shall be uniform in shape and size in accordance with the finished pocket shaper.					
12	Make shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and caught in the basic material.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Make shoulder straps. (cont'd) The gimp shall be pulled through to the underside of the buttonhole, and the purling of the buttonholes shall be on the outside of the shoulder straps. a. The shoulder straps shall be made of two pieces of basic material.					
	b. Seam the two pieces together 3/16 inch from the edges at the front, back and collar end, evenly trimming all edges of the strap for proper turning.	301	SSe-2 (a)	10-14	A	A
	c. Turn the straps, working the seams out to the edges. Topstitch the strap uniformly 1/8 inch from the seamed edges.	301	SSe-2 (b)	12-16	A (Silk)	A
	d. Make a horizontal eyelet-end, squarebar type buttonhole, cut 3/4 inch long, in each strap midway between the back and front edges and with the inside edge of the eyelet placed so that in the finished coat, the end of the shoulder strap will be 1/4 to 3/8 inch from the edge of the collar and with the purling to finish on the outside of the strap.	Buttonhole		38 per buttonhole (minimum) (not including bartack)	B (Silk)	F

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Make shoulder straps. (cont'd) e. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside of the buttonhole. f. Securely bartack the end of the buttonholes and trim the ends of the gimp. g. Press the straps smooth and flat with a heated pressing iron or pressing machine. The strap shall be uniform in shape and size in accordance with the pattern. The seams shall finish at the edges of the straps. h. On the finished coat, the straps shall measure 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the eyelet end of the buttonhole.	Bartack		21 per bartack (minimum)	A (Silk)	A
13	Make collar (see Figure 8). Finished appearance. The completed collar shall finish smooth and flat without distortion. Edges shall be uniformly even. The edgestitching shall be uniform.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Make collar (see Figure 8). (cont'd)					
	a. The collar shall be made of one ply each of basic material, or polyester twill, cotton buckram and lining.					
	b. Seam polyester twill and cotton buckram together 1/8 to 1/4 inch from all edges and trim polyester twill even with edges of buckram.	301	SSa-1	10-14	A	A
	c. Lap the upper edge of polyester twill side of interlining approximately 1/2 inch on the inside of the upper edge of the collar outer ply and seam together 1/4 inch from the raw edge of interlining. The outer ply shall extend not less than 1 inch at each end of collar interlining.	301	LSa-1	10-14	A	A
	d. Smooth fold the outer ply over the upper and lower edges of the interlining. Tack the portion of outer ply folded to inside at the lower edge to polyester twill interlining. Stitching shall not be through outer ply of collar.	Hand		2-3	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Make collar (see Figure 8). (cont'd)					
	e. Fold ends of outer ply to inside ends of interlining and tack to polyester twill with overcast stitching, turning under the upper and lower edges sufficiently so as not to be visible in the finished collar.	Hand		2-3	C (Silk)	
	f. Lap approximately 1/2 inch of the top inside edge of the collar on the raw top edge of the collar lining with the lining face up. Stitch collar uniformly 1/8 inch on both front and top edges, catching the collar lining in the stitching at the upper edge. The lining shall extend a minimum of 1 inch beyond each end of the collar.	301	LSa-1 (top edge) OSf-1 (ends)	12-16	A (Silk)	A
	g. Turn collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.					
	h. Make one eyelet through all plies at each end of the collar midway between top and bottom edges and 1-3/4 ± 1/8 inches from finished ends.	Eyelet		20 per eyelet (minimum)	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Make collar (see Figure 8). (cont'd)					
	h. (cont'd)					
	The eyelet shall be well worked with the purling on the outside of the collar and shall finish with a 1/8 inch diameter opening.					
14	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top and under sleeves with notches matching and join at the forearm with a 3/8 inch seam.	301	SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
15	Join cuffs to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs shall be uniformly stitched to sleeves.					
	a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Join cuffs to sleeve. (cont'd)					
	a. (cont'd)					
	Turn cuff completely, working out the point.					
	b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the upper edge of cuff, or the cuff may be basted instead of pressed.	101		4-6		
	c. Mark the sleeve in accordance with the pattern for positioning the cuffs, with notch matching the forearm seam line and with the lower raw edge of the sleeve and marker even.					
	d. Position the cuffs at the mark on the sleeve and seam uniformly 1/8 inch from the upper edge of cuff.	301	LSd-1	12-16	A (Silk)	A
16	Seam sleeve at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Seam sleeve at backarm. (cont'd)					
	a. Join the topsleeve to the undersleeve at the backarm with a 3/8 inch seam, catching the ends of the cuffs in the seam.	301	SSa-1	12-16	A	A
	b. Spread open the sleeve and cuff seams and press flat with a heated pressing iron. Trim ends of cuff if necessary.					
17	Tack cuff to sleeve.					
	a. Turn the cuff outlet to the inside, in accordance with notches, against the bottom end of sleeves, and baste along the turned edge of cuff.	Hand or 101		4-6		
	b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching.	103	SSm-1	4-6	A	
	c. On the finished coat, the length of the cuff shall be 3-1/4 ± 1/4 inches at the front and back creased edges and 6 ± 1/4 inches at the point.					
18	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Seam sleeve linings. (cont'd) gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position the top and undersleeve lining pieces in accordance with notches on pattern and join at the forearm and backarm, respectively, with a 3/8 inch seam.	301	SSa-1	10-14	A	A
19	Assemble sleeve and sleeve lining. Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers or pleats.					
	a. Properly position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.					
	b. Seam sleeve lining to topsleeve, backarm and forearm seam allowance respectively, commencing approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches below armhole edge at the backarm and approximately 4-1/2 inches below armhole edge at the forearm.	301	SSa-1	6-8	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Fell turnup of sleeve lining; press sleeves. Finished appearance. The sleeve linings shall not be short, tight or twisted at bottom of sleeves.					
	a. Pull sleeves through lining and turn under the bottom edge of sleeve lining to finish approximately 1-1/4 inches above the finished end of the sleeve, and baste to turnup of cuff.	Hand or 101		4-6		
	b. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching. The bottom of sleeve lining may be felled without basting.	301 or Hand	EFc-1 (b)	6-8 8-10	O (Silk) C (Silk)	O
	c. Turn sleeves and assemble in pairs. The lower half of sleeve may be pressed smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam.					
21	Hem yoke and front linings. Finished appearance. The hem shall be uniformly stitched, uniform in width, and shall finish smooth and flat without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Hem yoke and front linings. (cont'd) The hem shall be 3/8 ± 1/8 inch wide.					
	a. Hem the bottom edge of the yoke and front linings, respectively, with the raw edge turned under and caught in stitching 1/16 inch from the folded upper edge of the hem.	301	EFb-1	10-14	A	A
22	Make center pleat in yoke lining. Finished appearance. The pleat shall be uniform in width and shall finish smooth and flat without puckers or pleats.					
	a. Fold the yoke lining in accordance with the notches on the pattern to form a 1/2 inch wide pleat at the center back. Tack lengthwise along the pleat in line with the notches for a distance of 1 to 1-1/2 inches at the top end. -or-	301	OSf-1	10-14	A	A
	b. Form the pleat by stitching across top pleat at neckline. Press the pleat smooth and flat from the top to the bottom edges of the yoke lining with a heated pressing iron.	301	OSf-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Make center pleat in yoke lining. (cont'd) b. (cont'd) The folded edge of the pleat on the outside of the yoke shall be towards the left side.					
23	Stitch dart in front lining. Finished appearance. The dart shall be tapered to a point at the lower end and shall finish without gathers, puckers or pleats.					
	a. Fold the front lining, matching the cut edge of the underarm dart. Stitch lengthwise along the dart tapering from 1/4 inch at the armhole to a point at the lower end as indicated by the mark on the pattern.	301	SSa-1	10-14	A	A
24	Seam wool facing to front lining. Finished appearance. The lining shall be carefully and properly aligned and seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Seam wool facing to front lining. (cont'd)					
	a. Position the lining on the wool facing with the top edges even and bottom finished edge of the lining matched with the notch in the back edge of the facing to insure proper seaming.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge.	301	SSa-1	10-14	A	A
	c. Press the facing-lining seam, the underarm dart, and the bottom edge of the lining smooth and flat with a heated pressing iron with the raw edges of the underarm dart and facing-lining seam toward the side.					
25	Assemble inside pocket on left facing (see Figure 9).					
	a. The inside pocket shall be made of two pieces of polyester twill with a facing of rayon lining at the vertical piped pocket opening.					
	b. Position the rayon facing on the two pieces of pocket material with the top and front edges even. Turn under the inside and bottom edges,	301	LSd-1 (each edge)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Assemble inside pocket on left facing (see Figure 9). (cont'd)					
	b. (cont'd)					
	respectively, of the facing and seam to the pocket 1/16 to 1/8 inch from the folded edges, catching the lower edge of the identification label in the stitching at the inside edge of facing.					
	c. Seam the remaining three edges of label to pocket material 1/16 inch from each edge.	301	SSa-1	10-14	A	A
	d. Mark the left wool facing for the position of the pocket opening as indicated by the marks on the patterns.					
	e. Position the two front edges of pocket in line with the mark for the pocket opening, with the pocket facing next to the front facing.					
	f. Seam the pocket to the wool facing through all plies, with one row of stitches 3/16 to 1/4 inch on each side of the mark for the pocket opening.	301	SSv-2	10-14	A	A
	g. Cut the wool facing only for the pocket opening midway between the two rows of stitches.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Assemble inside pocket on left facing (see Figure 9). (cont'd) g. (cont'd) Tongue notch each end of the opening.					
	h. Turn the pocket through the opening to the inside. Form the piping at the front and back edge of the opening. Topstitch the front and back edges of the pocket opening adjacent to the seamed outer edges of the piping.	301	BSp-2	10-14	A	A
	i. Tack the ends of the piping at the underside, catching the tongue notches at each end of the pocket opening in the tacking.	301	SSA-1	10-14	A	A
	j. Turn back the front part of the pocket and seam to the back part along the side and bottom raw edges, catching the tongue notch at each end of pocket opening. Continue to stitch along the folded edge of the front pocket as close as possible to the piping seam to complete the pocket. -or-	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Assemble inside pocket on left facing (see Figure 9). (cont'd) k. The pocket opening may be cut and piped with the use of an approved automatic type sewing machine specifically designed to position the component parts, cut the opening, stitch and form the piped edges in one operation. l. In the finished coat, the width of the pocket opening shall be 5-3/4 ± 1/4 inches.					
26	Bind facings. Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw back edge of the facing with 3/4 to 7/8 inch wide bias binding, turning under the outside raw edge of binding only, and catching the turned under portion in the stitching 1/16 inch	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Bind facings. (cont'd) a. (cont'd) from the inner folded edge. The binding shall extend from the bottom edge of facing to not less than 1 inch above bottom finished edge of lining.					
27	Bind center and side back. Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats; the basic material and edges of binding shall be caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw edge of the center back with 3/4 to 7/8 inch wide bias binding from the top edge of backs to the top end of vent. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. When binding the left center back, continue to bind the raw edge of the vent for the left back from the top to the bottom end.	301	BSb-1	10-14	A	a

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Bind center and side back. (cont'd) a. (cont'd) The binding is not required along the top edge of the vent.					
	b. Bind the raw side edges of the left and right side-backs, respectively, from the top to the bottom edge of the coat with 3/4 to 7/8 inch wide bias binding. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge.	301	BSb-1	10-14	A	A
28	Seam lining to right vent. Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Fold vent lining piece in half lengthwise and stitch across the top of the vent with 1/4 inch seam. b. Turn vent lining inside out, forcing the corner out.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Seam lining to right vent. (cont'd)					
	c. Position the raw edges of lining on the outside of right vent, and seam together 3/8 inch from the back edge. The lining shall extend from the bottom turnup to approximately 1 inch beyond the top end of the vent.	301	SSe-2 (a)	10-14	A (Silk)	A
	d. Turn the lining to the inside of the vent and topstitch uniformly 1/8 inch from the folded edge, with the lining 1/16 inch back from the folded edge.	301	SSe-2 (b)	10-14	A (Silk)	A
29	Join back.					
	Finished appearance. The backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in line with the center back seam. In the finished coat, the left back shall overlap the right back 3 to 3-1/4 inches measured at the bottom edge of the coat, and the left vent shall be 1-3/8 to 1-1/2 inches wide, measured at the bottom bound edge. The backstitching across the top end of vent shall not be through vent lining.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Join back. (cont'd)					
	a. Stitch the 1/4 inch wide stay tape to the left back along the vent with the edge of the tape positioned approximately 1/8 inch in back of the fold notch to the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join at the center with a 5/8 inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch across the vent to the bound edges of the vents.	301	SSa-1	12-16	A	A
	c. Turn the left vent to the inside of the left center back in accordance with the notches and topstitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam.	301	OSf-1	12-16	A (Silk)	A
	d. Stitch and back stitch across the top end of the vent on the outside through all plies for a distance of 1-1/2 ± 1/8 inches from the center back seam. The stitching shall not be through the vent lining.	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Join back. (cont'd)					
	e. Join the left and right side backs to the respective center backs with 3/8 inch seam.	301	SSa-1	10-14	A	A
30	Press side and center back seams and vent lining.					
	a. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right center back to lower end of the stitching for the center back seam.					
	b. Spread the side and center back seam open, respectively, and press flat with a heated pressing iron.					
31	Fell vent lining.					
	Finished appearance. The folded edge of the lining shall be accurately aligned with the center seam allowance of the right back part. The felling shall not be visible on the outside of the coat.					
	a. Baste top edge of vent lining to coat.	Hand or 101 or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Fell vent lining. (cont'd)					
	b. Fell vent lining to coat across the top edge and on both side for a distance of not less than 1 inch form the top end.	Hand			C (Silk)	
31	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester twill reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers or pleats.					
	a. Seam the 3/4 inch wide polyester twill stays to the underside of the fronts along the shoulder edge and upper front edge of armhole, respectively, 1/8 inch from the outer edges. The top end of the armhole stay and the lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.	301	SSaa-1	10-14	A	A
33	Bind lower fronts.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
33	Bind lower fronts. (cont'd)					
	caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw back edge of the lower fronts with 3/4 inch wide bias binding, turning under the outside raw edge of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the waist seam to the bottom edge of fronts.	301	BSb-1	10-14	A	A
34	Assemble fronts.					
	Finished appearance. All chest and waist darts shall be properly tapered and shall finish without gathers, puckers, or pleats. The upper and lower fronts and side body panels shall be joined without gathers, puckers, or pleats.					
	a. The fronts shall consist of an upper front, a side body front, and a lower front (skirt).					
	b. Fold the upper fronts, matching the cut edges of the chest and waist darts,	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Assemble fronts. (cont'd) b. (cont'd) respectively. Stitch the entire length of the chest and waist darts, 3/8 inch from the cut edges at the upper end of the chest darts and tapering to zero at the lower end of the waist darts, tapering to zero at the upper end.					
	c. Position the upper fronts and side body fronts, with the edges even, and join with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	d. Spread open the waist dart and the underarm seam and press flat with a heated pressing iron. Press the chest dart flat, turning the cut edges toward the armhole edge of the fronts.					
	e. Position the upper and the lower fronts with edges even and join together at the waist with a 3/8 inch seam and with the 1/4 inch wide stay tape positioned on the upper front 1/4 inch from the lower edge and caught in the stitching.	301	SSa-1	12-16	A	A
	f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the center of	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Assemble fronts. (cont'd) f. (cont'd) the side body front to not more than 3 inches from the edge of the fronts. g. Spread open the waist seam and press flat with a heated pressing iron. h. Press and shape the fronts from the waist to the top edge on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortions to the front or armhole of the coat.					
35	Set pockets and pocket flaps. Finished appearance. The pockets and pocket flaps shall be set without twists, gathers, puckers, pleats, or raw edges. The stitching for the raised edge of the flaps shall conform to stitching for setting the pockets. The side edges of the pockets shall not be exposed beyond the sides of the flaps. The pockets and pocket flaps on the left and right side, respectively, shall be in horizontal alignment with each other. The front edges of the pockets,					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Set pockets and pocket flaps. (cont'd) pocket flaps, and pleats on the upper pockets shall be in parallel alignment with front edge of coat when buttoned. The point of the upper pocket shall be at the center of the pleat on the upper pockets. The center of the pleat on the upper pockets shall be aligned as accurately as possible with the waist darts in the fronts. On the finished coat, the top edge of the bottom pocket flap shall be parallel with the waist seam line, and the front edge of the flap shall be in line with the front edge of the upper pocket. The lower front corners of the bottom pocket shall be 3/8 inch further back towards side seam. Pockets and pocket flaps shall conform to the measurements in Table III. a. Mark the fronts in accordance with the marks on the pattern for position of upper and lower pockets and pocket flaps. b. Position the pocket flaps on the outside of the fronts in accordance with the marks for the					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Set pockets and pocket flaps. (cont'd)					
	b. (cont'd)					
	upper and lower pocket flaps, respectively. Position the polyester twill stay piece for the flaps and top corners of the pockets on the underside of the fronts.					
	c. Seam the pocket flaps to the fronts through the polyester twill stay uniformly 1/8 inch from the serged edge of the flap.	301	LSq-2 (a)	12-16	A (Silk)	A
	d. Turn down the flaps and topstitch the flaps 1/8 inch down from the raised edge.	301	LSq-2 (b)	12-16	A (Silk)	A
	e. Position the upper pockets in accordance with the marks and seam to the fronts uniformly 1/8 inch from the side and bottom edges. The top corners of the pockets shall be securely tacked through the polyester twill stay pieces.	301	LSd-1	12-16	A (Silk)	A
	f. Position the lower pockets in accordance with the marks on the pattern, lower edge to be 1-1/4 inches above the bottom edge of finished coat. Seam bellows of pockets from the inside to fronts	301	SSa-1 (each edge)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Set pockets and pocket flaps. (cont'd)					
	f. (cont'd)					
	3/8 inch from side and bottom serged edges. Securely tack upper corners of pockets from the outside through polyester twill stay pieces.					
36	Make buttonhole tab.					
	Finished appearance. The sword slit buttonhole tab shall finish smooth and flat without distortion. The stitching shall be uniform and the buttonhole shall be properly positioned. The tab shall finish 2-3/8 ± 1/8 inches long and 2 ± 1/8 inches wide.					
	a. The buttonhole tab for the sword slit shall be made of one ply of basic material and one ply of rayon lining material.					
	b. Seam together the lining piece and basic material at side and bottom edges of tab 3/16 inch. Turn and topstitch 1/8 inch from seamed edge.	301	SSe-2 (shows finished seam)	12-16	A (Silk)	A
	c. Close the top raw edge of tab with 1/8 inch seam.	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Make buttonhole tab. (cont'd)					
	d. Make a vertical eyelet -end, taper-bar type buttonhole, cut 5/8 inch long, in center of tab with the inside edge of the buttonhole eyelet placed 1/2 to 5/8 inch above bottom edge of tab. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the lining side of the tab.	Buttonhole		60 per buttonhole (including tack)	B (Silk)	F
37	Make sword slit and attach buttonhole tab (see Figure 10).					
	Finished appearance. The sword slit shall finish without bulges or excessive bulkiness. All parts shall be securely fastened and properly positioned. The flap shall be securely attached and properly positioned to cover slit properly.					
	a. Mark left front for 2 inch long sword slit in waist seam. The back end of the sword slit shall be 1/2 to 5/8 inch in front of underarm seam.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37	Make sword slit and attach buttonhole tab (see Figure 10). (cont'd)					
	b. Topstitch the left front, 1/16 inch below waist seam, through the seam allowance, for a distance of 2 inches, starting 1/2 to 5/8 inch in front of the underarm seam. The stitching shall be through the allowance of the waist seam but not through the pocket stay. The lower pocket stay material shall be trimmed away form the sword slit opening.	301	OSf-1	12-16	A (Silk)	A
	c. Tack across waist seam at each end of the topstitching to prevent seam from opening when sword slit is cut. The tacks shall be 1/8 inch long, 1/16 inch on each side of seam.	301	SSa-1	12-16	A (Silk)	A
	d. Mark tab 1-3/4 inches from bottom edge. Cut waist seam open for sword slit and position tab on outside of front with top end inserted through slit. Align mark on tab with upper folded edge of slit. Topstitch front for a distance of 2 inches along the waist seam 1/16 inch above opening, stitching through seam allowance and tab, and securely tacking each side of the tab to	301	LSd-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37	Make sword slit and attach buttonhole tab (see Figure 10). (cont'd) d. (cont'd) the front at the opening. The basic fabric side of the tab shall be towards the outside of the coat.					
38	Set belt loops (see Figures 10 and 11). Finished appearance. The belt loops shall finish vertically straight and shall be positioned with the top front edge of the loops, for size 36 to 40 inclusive, 1/4 inch to the back of the underarm seam, and for sizes 42 to 46 inclusive, with the top back edge of loop placed 1/4 inch to the front of the underarm seam. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to bottom folded edges. The underloop for the belt fastener shall have an opening of not less than 1-1/2 inches. All bartacks shall be made across the entire width of the loops. a. Position the 5-1/2 inch long belt loop on the left front with one end approximately 1 inch above the waist seam and bartack the loop to the	Bartack		28 per bartack (minimum)	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
38	Set belt loops (see Figures 10 and 11). (cont'd)					
	a. (cont'd)					
	front 1/8 to 3/16 inch from the end of the loop. Bartack the loop to the front at the top edge of the lower pocket flap to form the underloop for the belt fastener. Turn loop up and, with the top end turned under, bartack the loop to the front 1/8 to 3/16 inch from the folded edge, catching the turned under portion of the loop in the stitching. (See Figure 11).					
	b. Position one end of the 3-1/2 inch long belt loop on the right front and bartack the loop to the front at the top edge of the lower pocket flap. Turn under the top end of the loop and bartack the loop to the front 1/8 to 3/16 inch from the folded edge, catching the turned under portion of the loop in the stitching.	Bartack		28 per bartack (minimum)	A (Silk)	A
39	Interline fronts.					
	a. Properly position the left and right fronts on the respective coat front interlinings and baste along the top edge of the upper pocket flap on the outside.	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Interline fronts. (cont'd)					
	b. Tack the top edge of upper pocket stay and the front end of the upper and lower pocket stay to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible.	301	Hopper			
	c. Baste the interlining and fronts together starting approximately 1-1/2 inches above the top edge of upper pocket flap and baste along the center of the upper pocket flap and pocket, along the waist dart to the top edge of the lower pocket flap, and then diagonally across front corner of the lower pocket flap to the front edge of the lower pocket and from that point continue to baste along the front edge of the pocket to the bottom of the coat.	301	Hopper			
	d. Baste horizontally towards the front of the coat, starting from the top of the center basting stitch. Continue to baste along the front edge to the bottom of coat.	301	Hopper			
	e. Baste across the shoulder allowing room for setting the shoulder pad	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Interline fronts. (cont'd) e. (cont'd) and working the fullness towards the armhole. Baste along front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the interlining.					
40	Sew snap fastener to upper pockets. Finished appearance. The pocket flaps shall lie smooth and flat without distortion when closed.					
	a. Securely sew one socket snap fastener part to each side edge of the upper pockets to properly engage stud part on flaps. When socket part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or 301 or Hand		21 per fastener (minimum) 16 per fastener (minimum) 3-4 (double thread) (not including tack)	A A C (Silk)	A
41	Join back and fronts at sides. Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers, or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Join back and fronts at sides. (cont'd)					
	a. Position the back and front, with edges even, and join together at the sides with a 3/4 inch seam.	301	SSa-1	12-16	A	A
	b. Spread open the side seams and press flat with a heated pressing iron.					
42	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester twill reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4 inch wide stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges.	301	SSa-1	10-14	A	A
43	Tape armholes.					
	a. Sew 1/4 inch wide stay tape around the armhole from a point 1 to 1-1/2 inches above notch on the fronts to 3/4 to 1 inch	301 or 401	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43	Tape armholes. (cont'd)					
	a. (cont'd)					
	from shoulder edge on the back.					
	b. From the front notch to approximately 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness.	301 or 401	SSaa-1	10-14	A	A
44	Press armholes and shoulder blades.					
	a. Press the armhole tapes, the shoulder blades and the front smooth and flat with a heated pressing iron or suitable type pressing machine.					
45	Shape fronts.					
	a. Mark and shape the front edges of the coat. Dress the left front on a line running from the top notch to the waist seam 1 inch from the front edge. Continue on a straight line from the waist seam to the notch at bottom as indicated on the pattern.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45	Shape fronts. b. Mark the fronts 1-1/4 inches below the bottom edge of the lower pockets for the bottom turnup. c. Trim coat front interlining 1/4 to 5/16 inch back from top, front and bottom edges of coat. Trim the bottom edge of coat, matching the length of right and left backs at the vent. -or- d. Marking and shaping the front edges and trimming the bottom edge of the coat may be accomplished with a clicker machine using dies conforming to patterns furnished. e. In the finished coat, the left front shall overlap the right front 3 to 3-1/2 inches at the bottom edge.					
46	Bind bottom turnup. Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers, or pleats and the basic material and edges of binding shall be securely caught in the stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Bind bottom turnup. (cont'd) The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw edge of the bottom turnup with 3/4 inch wide bias binding, turning under the outside raw edge of binding only, and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the back edge of the front cutout to the edge of the vent at the center back.	301	BSb-1	10-14	A	A
47	Baste facing-lining assemblies to fronts.					
	a. Position the right and left facing-lining assemblies on the outside of the respective fronts and baste along the front and bottom edge, distributing the fullness in the breast area. The facing shall be held slightly taut across the bottom edge of the front while basting.	Hand or 301	Hopper			
48	Join facings and fronts with tape.					
	a. Join the facings to fronts 3/16 inch from top, front and bottom edges of	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48	Join facings and fronts with tape. (cont'd) a. (cont'd) coat, with the 3/8 inch wide stay tape positioned on the interlining side of fronts and caught in the stitching. b. The tape shall be sewn with slight tension and shall extend from the collar notch to 1-1/2 to 2 inches from side seams at the bottom of the coat. c. Fell inside edge of 3/8 inch wide stay tape to the coat front interlining from top end of tape to the bottom edge of interlining. d. Press the front edges smooth and flat with a heated pressing iron or pressing machine, removing the fullness. e. Remove all basting stitches. Trim lower and upper front corner of the facings and extend the cut for collar notch to the seam for proper turning. f. Spread open the front-facing seam from the collar notch to the bottom edge of the coat and press smooth and flat with a heated pressing iron.	103	SSm-1	4-6	A	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49	Baste front and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working out the corners completely. Turn up the bottom of the coat, lapping the facing on the bottom turnup, and working out the front corner completely.					
	b. Baste along the top and front edges and finished bottom edges of the coat, working the seams to the edge of the coat.	101		4-6		
	c. In the finished coat, the bottom turnup shall be uniformly 1 to 1-1/8 inches.					
50	Fell bottom turnup.					
	a. Fell the bound edge of the bottom turnup to the fronts and backs with blindstitching.	301	EFc-1 (b)	6-8	O (Silk)	O
51	Baste facings a second time.					
	a. Baste the facings to the fronts approximately 1-1/4 inches from the edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward toward the back	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
51	Baste facings a second time. (cont'd)					
	a. (cont'd)					
	edge of the facing while basting.					
	b. Baste as close to the facing-lining seam as possible, placing the fullness over the chest, and continue basting along the bound edge of the facing to the bottom turnup of the coat.	301 or Hand	Hopper			
52	Fell facings to fronts and tack to interlining.					
	a. Fell the bound edge of the left and right front facings to fronts with blindstitching from the bound edge of the bottom turnup to not less than 2 inches above the bottom finished edge of front lining.	301	EFc-1 (b)	6-8	O (Silk)	O
	b. Tack the back edge of the left and right facing-lining along the seam allowance to the interlining only, not more than 3 inches below the shoulder edge, with the inside breast pocket lying flat against the interlining.	103	SSm-1	4-6	A	-
	c. Tack the breast pocket to the interlining along the seam allowance.	Hand			C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 20261-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Baste yoke lining to back.					
	a. Position and baste the one piece rayon yoke lining to the inside of the back, along the center pleat and along the armholes, shoulder and bottom edges of the yoke.	301	Hopper			
54	Baste and fell front linings.					
	a. When necessary, trim the back end of lower pocket stays away from the side seam.					
	b. Fold the front lining, in accordance with the notches, forming the chest pleat and baste lengthwise along the entire center of pleat. Baste lining to coat along lower edge of armhole approximately 1-1/2 inches from edge, starting at lower end of chest pleat and continuing to approximately 2 inches from side seam of coat and across the bottom finished edge of lining. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	c. Turn under the back edge of the front lining matching the lower folded edge with the side seam and lapping the upper folded edge on the yoke.	Hand or 101		4-6		

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
54	Baste and fell front linings. (cont'd)					
	c. (cont'd)					
	Baste the lining to coat from armhole to bottom finished edge not less than 3/4 inch from folded edge.					
	d. Fell the turned under portion of the front lining to side seam allowance of the fronts and to the yoke lining with blindstitching 1/4 to 3/8 inch from folded edge. Stitching shall extend from bottom finished edge of front lining to the lower edge of armholes.	301	SSm-1	6-8	O (Silk)	O
55	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole and front gorge.					
	b. Trim the yoke lining even with the back at the neck.					
56	Baste shoulder pad.					
	a. Insert shoulder pad between interlining and chest padding of coat fronts in line with the armhole edge and securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
57	Seam shoulders. Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulders may be properly shaped. The shoulder seam shall finish without a distorted appearance.					
	a. Join the fronts and back together at the shoulders with a 3/8 inch seam, working in the proper fullness on the backs, in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
58	Set shoulder straps. Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the coat without twists, puckers, pleats, or other distortion. On the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
58	Set shoulder straps. finished coat, the straps shall be 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at eyelet end of the buttonhole. a. Position shoulder straps with the rounded end of the strap 3/4 to 7/8 inch from the edge of the neck and finished edge of the strap 1/2 inch behind and in line with the shoulder seam. The raw edge of the shoulder strap shall be positioned in line with the armhole edge and may be trimmed if necessary. On the finished coat, the rounded end of the strap shall finish 1/4 to 3/8 inch from the bottom edge of collar.					
	b. Seam the shoulder straps to the coat 1/8 to 1/4 inch from the armhole edge, trimming the shoulder strap even with the armhole where necessary.	301	SSa-1	10-14	A	A
59	Baste shoulder. a. Position shoulder interlining and lining in place. Baste upper part of each shoulder on the outside and turn the coat on the inside.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Baste shoulder. (cont'd)					
	b. Turn under the raw edge of yoke lining at the shoulders, baste the upper part of each shoulder over the front lining and continue to baste across neck at the back.	Hand or 301	Hopper			
60	Seam neckline with size label and hanger.					
	Finished appearance. The neckline shall finish smooth and flat without twists, pleats, or puckers. The size label shall be positioned between the ends of the coat hanger. Ends of coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and the yoke lining to the coat at the neckline from collar notch to collar notch with a 1/4 inch seam. The upper edge of the size label and the ends of the coat hanger shall be properly positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61	Set collar. Finished appearance. The collar shall be carefully joined to the coat without twists, puckers, pleats, raw edges, or distortion. a. Mark neckline on the outside 1/2 inch from top edge for proper positioning of collar. b. Position the collar with the lower edge lapped on the outside top edge of coat at the mark. c. Seam the collar to the coat from end to end 1/16 to 1/8 inch from lower edge of collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (Silk)	A
62	Edgestitch coat. Finished appearance. The coat shall be uniformly edgestitched with the same gage as used on flaps and pockets and without distortion. a. Topstitch the top and front edges of the coat and continue the stitching along the bottom edge of the coat the width of the facings. Topstitch left edge of vent. b. The stitching shall be uniformly 1/8 inch from the edge.	301	SSe-2 front and bottom edge of coat (shows finished seam)	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Set sleeves. Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole sleeve shall finish smooth and flat without twists, puckers, or pleats. The armhole shall not be stretched or distorted due to pressing. a. Position sleeves on outside of coat at the armholes, with back arm seam of sleeve matching the side back seam and with notch in top sleeve and front matching. b. Join the sleeves to the coat with a 3/8 inch seam, distributing fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching. c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness. Spread open the upper part of the armhole sleeve seam from backarm sleeve seam to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Set sleeves. (cont'd) c. (cont'd) pressing iron. Care shall be exercised in pressing armhole seam in order not to stretch the armhole.					
64	Baste armhole lining. a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place, and distributing fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeve to the notch in the front.	Hand or 301	Hopper			
65	Tack armhole and stitch sleeve head pads. Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole. a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam, and with the front end of					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65	Tack armhole and stitch sleeve head pads. (cont'd)					
	a. (cont'd)					
	the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end through the armhole sleeve seam allowance 1/8 inch from the folded edge of the pad, catching the armhole end of the stay for the upper pockets, the front and yoke linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
66	Fell linings.					
	a. Position the sleeve lining at the armhole with back and forearm seams of sleeves and linings matched. Turn under the armhole edge of the sleeve lining and lap the linings on the outside of the yoke and front linings at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness in accordance with good commercial practice, and	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66	Fell linings. (cont'd)					
	a. (cont'd)					
	backstitching the lower armhole edge from approximately 1-1/2 inches to the front of forearm sleeve lining seam to the side body lining.					
	b. Fell the lower corners of the front lining to the facings and the front seam allowance, respectively.	Hand		8-10	C (Silk)	
	c. Fell the upper back edge of the front lining to the yoke lining, placing the stitching over the folded edge of front lining. Fell the lower finished edge of front lining. Fell the lower finished edge of the yoke lining to the side seam outlet.	Hand		8-10	C (Silk)	
	d. Fell the yoke lining and facing-lining assembly together at the shoulder, placing the stitching over the folded edge of the yoke lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (Silk)	
67	Tack facing and bottom turnup.					
	a. Fell the ends of the bottom turnup to the body of the coat at the vent.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67	Tack facing and bottom turnup. (cont'd)					
	b. Fell the back edge of the facings to the coat from the bottom to the top edges of the bottom turnup.	Hand		8-10	C (Silk)	
68	Finish sword slit.					
	Finished appearance. The sword slit shall finish flat and smooth and shall be firmly stitched and properly positioned with no puckers, bulges, or raw edges.					
	a. Properly position left front lining and baste to front to hold in position for cutting of opening for sword slit tab.	Hand				
	b. Cut opening for sword slit tab in lining to correspond with opening in front.					
	c. Turn under raw edges of lining at cut opening and fell folded edge to front.	Hand		6-8	C (Silk)	
	d. Cut 2 inch long opening in sword slit patch, 3/4 to 1 inch from top edge. The opening shall be 1 inch on each side of center of patch.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68	Finish sword slit. (cont'd)					
	e. Position patch on top of lining with opening in patch aligned with opening in lining. Fell patch to lining on all edges, and fell raw edges of patch at opening to front.	Hand		6-8	C (Silk)	
69	Press left front.					
	a. Press left front smooth and flat removing any fullness in order that front buttonholes may be made with less difficulty.					
70	Make buttonholes.					
	Finished appearance. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 40-line insignia button and the 34-line sewing hole button. The stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front and the purling of the buttonholes shall be on the outside. The waist seam shall not be open beyond the end of the waist buttonhole. The buttonholes shall be the cut-first type.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70	Make buttonholes. (cont'd) a. Mark the left front in accordance with the marks on the pattern for the location of 5 buttonholes. The mark for the bottom buttonhole shall be on the waist seam, the mark for the top buttonhole shall be 7/8 to 1 inch below the top edge of the front and the marks for the remaining three buttons shall be evenly spaced. b. Make one horizontal eyelet-end, square bar type buttonhole, cut 1-1/4 inches long, at each of the marks, with the purling of the buttonhole to finish on the outside of the front. The inside edge of the eyelet-end of the buttonhole shall be 5/8 inch from the front edge of the coats. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside. c. Care shall be exercised when making the buttonhole in the waistseam so that the seam does not come open beyond the ends of the buttonhole.	Buttonhole		50 per buttonhole (minimum) (not including tack)	B (Silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70	Make buttonholes. (cont'd)					
	d. Securely bartack the end of each buttonhole and trim the ends of the gimp.	Bartack		21 per bartack	A (Silk)	A
71	Make eyelets in pockets.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of the pocket and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric.					
	a. Make one eyelet in each pocket for removable insignia button to correspond with eyelet end of buttonhole in flaps so that when buttoned on the finished coat, flaps shall be smooth and flat without twists or bulges.	Eyelet		21 per eyelet	A (Silk)	A
72	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of collar without misalignment or gap.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
72	Sew hook and eye to collar. (cont'd)					
	a. Position and securely sew the hook to the right end and the eye to the the left end of the collar.	Hand		10 per hook and eye (minimum)	C (Silk) (double thread)	
73	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (Silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar.	Hand		8-10	C (Silk)	
	c. Fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling. The collar lining may be basted before felling it to coat.	Hand		8-10	C (Silk)	
	d. Position the collar tab on the inside of collar at the left end, with the collar tab	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73	Finish collar. (cont'd) d. (cont'd) extending approximately 3/4 inch beyond the front end of collar. Fell the top, back and bottom raw edges of tab to collar lining.					
74	Clean coat. a. Pull all basting thread, trim and remove all loose ends of thread, and remove all spots, stains and tickets, except one ticket for matching belt to coat, without injury to the material. b. Examine buttonholes at front closure for exposure of coat front interlining cloth. The exposed interlining shall be blackened with indelible ink.					
75	Press coat. Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. b. Press the entire collar smooth and flat. c. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. d. Press the lower fronts and pockets smooth and flat. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent. g. Press the sleeves smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the					

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) g. (cont'd) bottom edge of the breast pockets. The backarm crease shall be in line with the forearm crease. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. Press the shoulder straps flat. i. Press the armholes solid from the inside, creasing the armholes at the front and armpit. The armpit and the back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking in the top sleeves. k. Press lower edge of coat smooth, flat and even. l. Remove all wrinkles and impressions from under pocket flaps. Remove all impressions of the side and center back seam allowances from the coat. Press linings throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat. Remove all gloss marks.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
76	Mark for buttons. a. Mark the right front for the location of four 40-line insignia buttons and one 34-line sewing hole button to properly engage with the buttonholes in the left front. b. Mark each shoulder for the location of one 27-line insignia button to properly engage with the buttonhole in the shoulder straps in order that the straps shall lie smooth and flat without twisting or bulging on the finished coat. c. Mark the sword slit patch for the location of one 22-line sewing hole button to properly engage with buttonhole in tab. d. Mark the collar lining for the location of five 16-line sewing hole buttons to properly engage with buttonholes in white collar worn with coat.					
77	Attach and sew on buttons. Finished appearance. The buttons shall be securely attached and sewn to the coat and shall properly engage buttonholes in left front, shoulder straps, sword slit buttonhole tab					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Attach and sew on buttons. (cont'd)					
	and upper and lower pocket flaps. The insignia buttons on the front shall finish with the head of the eagle in an upright position. The shoulder buttons shall finish with the head of the eagle towards the collar. When coat is buttoned, the center of those buttons between the upper pockets shall be midway between the front edge of the pockets.					
	a. Attach one 27-line insignia button to each pocket with shank of button inserted through eyelets and secured by ring toggles.					
	b. Sew one 40-line insignia button at each of the marks on the right front, except at the waist. The button shall be sewn through all plies of material with the head of the eagle in an upright position.	101 or 301 or Hand		21 per button 21 per button 6-8 per button (double	24/4 24/4 24/4 thread)	 24/4
	c. Sew one 34-line sewing hole button at the waist mark on the right front through all plies, necking the button for shank wrapping.	101 or 301 or Hand		21 per button 21 per button 6-8 per button (double	24/4 24/4 24/4 thread)	 24/4

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Attach and sew on buttons. (cont'd)					
	d. Shank wrap the 34-line sewing hole button.	Hand		4 wraps (double thread)	24/4	
		or Machine		16 stitches per shank	24/4	24/4
	e. Sew a 27-line insignia button at the mark on each shoulder. The button shall be sewn through all plies of material. The head of the eagle shall be towards the edge of the collar.	101 or		21 per button	24/4	
		301 or		21 per button	24/4	24/4
		Hand		6-8 per button (double thread)	24/4	
	f. Sew one 22-line sewing hole button at mark on sword slit patch and wrap not less than four times. Stitching shall catch the pocket stay material.	Hand		8 per button (double thread)	24/4	
	g. Securely sew one 16-line sewing hole button at each of the marks on the collar lining. The button stitching shall not show on the outside of the collar.	Hand		8 per button (double thread)	24/4	
78	Attach belt to coat.					
	a. Place the belt in the belt loops with the belt fastener through the underloop and buttoned.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II and Table III.

Table II. Coat Measurements 1/

Size	Breast 2/ (inches)	Back Length 3/ (inches)	Sleeve Length 4/ (inches	Collar Length 5/ (inches)	Belt Length 6/ (inches)
			Short		
36	37	28-3/4	17	15-1/2	38-3/4
38	39	29	17	16	40-3/4
40	41	29-1/4	17	16-1/2	42-3/4
42	43	29-1/2	17	17	44-3/4
			Regular		
36	37	29-3/4	18	15-1/2	38-3/4
38	39	30	18	16	40-3/4
40	41	30-1/4	18	16-1/2	42-3/4
42	43	30-1/2	18	17	44-3/4
44	45	30-3/4	18	17-1/2	46-3/4
46	47	31	18	18	48-3/4
			Long		
36	37	30-3/4	19	15-1/2	38-3/4
38	39	31	19	16	40-3/4
40	41	31-1/4	19	16-1/2	42-3/4
42	43	31-1/2	19	17	44-3/4
44	45	31-3/4	19	17-1/2	46-3/4
46	47	32	19	18	48-3/4
			Extra Long		
36	37	32-1/4	20	15-1/2	38-3/4
38	39	32-1/2	20	16	40-3/4
40	41	32-3/4	20	16-1/2	42-3/4
42	43	33-1/8	20	17	44-3/4
44	45	33-3/8	20	17-1/2	46-3/4

1/ Tolerance on all measurements except belt and collar: ± 3/8 inch.
Tolerance is on 1/2 breast measurements.
Tolerance for collar length measurement: ± 1/4 inch.
Tolerance for belt length measurement: ± 1/2 inch.

2/ Breast measurement shall be taken from folded edge to folded edge in line with pit of armhole with the coat buttoned. Multiply by 2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

3/ Back length measurement shall be taken along center back seam from lower edge of collar to bottom edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of sleeve.

5/ Collar sizes represent length of collar in inches measured from end to end along the center.

6/ Belt length measurement shall be taken along the center from end to end.

Table III. Pocket and Flap Measurements 1/

Upper Pockets and Flaps			
Size (Short, Regular, Long, X-Long)	36 - 38 inches	40 - 42 inches	44 - 46 inches
Length of flap at center point	2-7/8	2-7/8	2-7/8
Length of flap at sides	2-1/8	2-1/8	2-1/8
Width of flap at top edge	4-3/4	5-1/4	5-3/4
Width of pocket at top edge, side to side	4-1/2	5	5-1/2
Width of pocket at bottom edge, side to side	4-7/8	5-3/8	5-7/8
Length of pocket, top edge to bottom edge	6	6-1/4	6-1/4

Lower Pockets and Flaps			
Size (Short, Regular, Long, X-Long	36 - 38 inches	40 - 42 inches	44 - 46 inches
Length of flap at center point	3-3/4	3-3/4	3-3/4
Length of flap at sides	2-1/4	2-1/4	2-1/4
Width of flap at top edge	7-3/4	8-1/4	8-3/4
Width of pocket at top edge, side edge to side edge	7-1/2	8	8-1/2
Width of pocket at bottom edge, side edge to side edge	10	10-1/2	11
Length of pocket top to bottom edge:			
Short	10-1/2	10-1/2	10-1/2
Regular	10-3/4	10-3/4	10-3/4
Long	11	11	11
X-Long	11-3/4	11-3/4	11-3/4

1/ Tolerance on all measurements: ± 1/8 inch.

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-1490 and MIL-I-45208.

4.4 First article inspection. When first article is required, inspection of the first article shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The methods of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table IV for characteristics noted.

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:05Z
Check the source to verify that this is the current version before use.

Table IV. Test Methods

Components	Characteristics	Reqmt. para.	Test method	No. Determination per sample unit	Results reported as:
Fastener, Snap	Material identification	3.3.16	Standard Commercial		
	Finish	3.3.16	Standard Commercial	1	Pass or Fail
	Size and type	3.3.16	Standard Commercial	1	Pass or Fail
Hook and Eye	Material identification 1/	3.3.17	Standard	1	Pass or Fail
	Design	Fig. 1	Visual	1	Pass or Fail
	Measurements	Fig. 1	Standard Commercial	1	Pass or Fail
	Finish	3.3.17.1	Standard Commercial	1	Pass or Fail
	Finish (tackiness) 2/	3.3.17.1		1	Pass or Fail

1/ Accept a certificate of compliance for this requirement.

2/ Test for tackiness. At room temperature (60° to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1490. If one or more sample units fail to meet test requirements listed below, the lot represented shall not be acceptable.

Components	Lot size expressed as	Sample unit for testing
Fasteners, snap	1000 sets	15 complete sets
Threads (all sizes)	Bobbins (when used) 1/	Sufficient number of bobbins to total a minimum of 360 yards.
Buttons, (each type and size)	Gross	20 each
Ring toggle	Gross	5 complete sets
Hook and Eye	100 each	2 each, hook and eye

1/ When threads are purchased in the form of cones or spools and on bobbins, thread from each shall be tested.

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an asterisk (*) and listed as selected defects in MIL-STD-1490. Any coat containing a selected defect shall not be included in the end item lot.

4.5.4 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1490 and Table II and Table III of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

4.5.5 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1490. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1490.

5. PACKAGING

5.1 Preservation. Coats shall be preserved in accordance with MIL-C-44192 (Hanger Pack).

5.1.1 Hanger packs. Coats shall be hung with fronts lapped and unbuttoned on a 17 inch hanger and preserved as specified in the appendix to MIL-C-44192.

5.2 Packing. Coats preserved in accordance with 5.1 shall be packed 12 coats of one size in a type I container (hanger pack) using style A or b hanger bar conforming to MIL-C-44192.

5.3 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES.

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat covered by this specification is intended to be worn by male officers of the U. S. Marine Corps.

6.2 Ordering data. Procurement documents should specify the following:

6.2.1 Procurement requirements.

(a) Title, number, and date of this specification.
(b) Size required (see 1.2).
(c) When first article is not required (see 3.2).

6.3 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 First article. Examination, tests and approval shall be as specified by the contracting officer (see 3.2).


Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:05Z
Check the source to verify that this is the current version before use.

6.5 Figures. Figures 1 through 12 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Subject term (key word) listing.
Blue
Coat
Man's
Officer's


Preparing Activity:
Navy - MC
Project No. 8405-N235

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

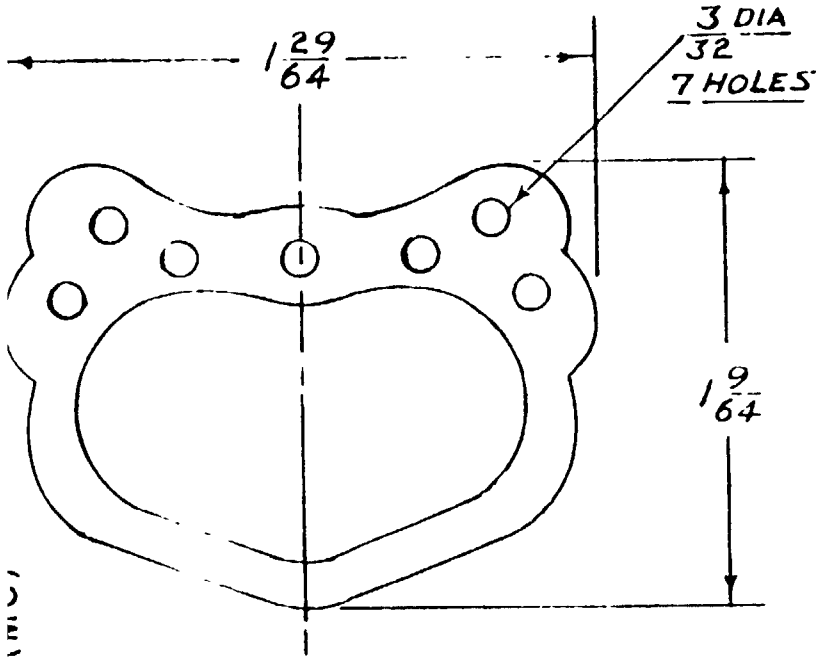

HOOK

FLAT (BEFORE FORMING)

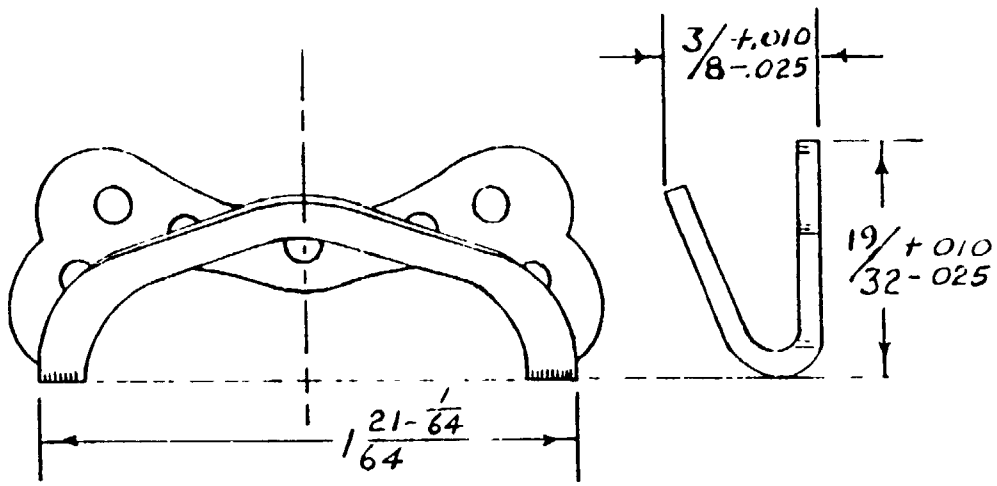


FORMED HOOK

MAT'L—.050 H BRASS 4 HD

FINISH—BLACK JAPANNED

TOLERANCES, UNLESS OTHERWISE SHOWN
DECIMAL . . . . . ± —
FRACTIONS . . . . ± 010
ANGLE . . . . . ± —

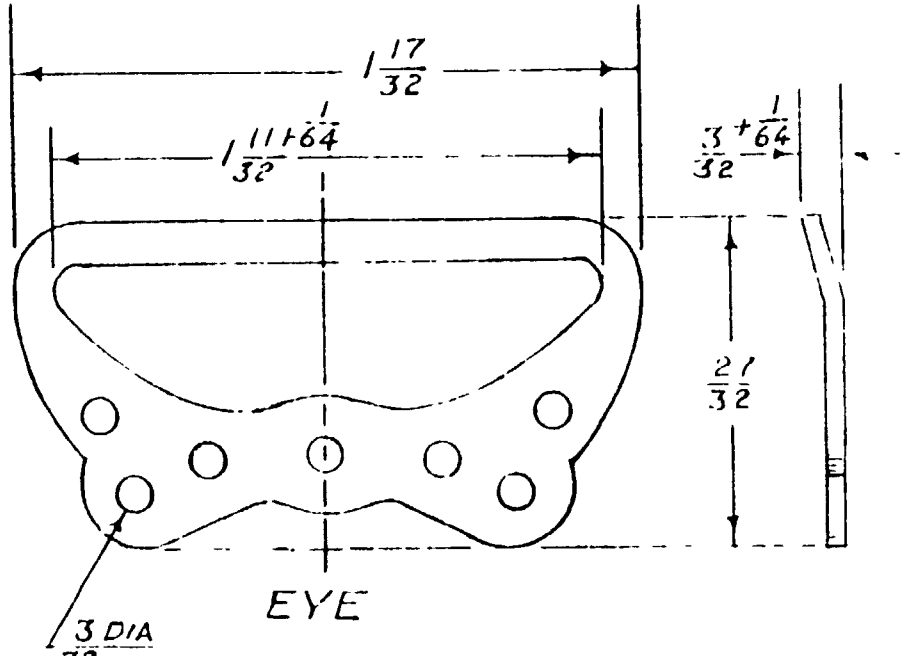

EYE

HOOK AND EYE

FIGURE 1. COAT, MAN'S; DRESS, BLUE, OFFICER'S

MIL-C-44099A(AR)

Source: https://assist.dla.mil -- Downloaded: 2026/10-20T21:05Z
Check the source to verify that this is the current version before use.

TO KEEP YOUR COAT LOOKING SMART INSIST ON IT BEING PROPERLY PRESSED.

PRESSING INSTRUCTIONS

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.

2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH DAMP CLOTH.

3. CREASE ONLY LOWER THREE-FOURTHS OF SLEEVES.

WOVEN INSTRUCTION LABEL

FIGURE 2. COAT, MAN'S DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

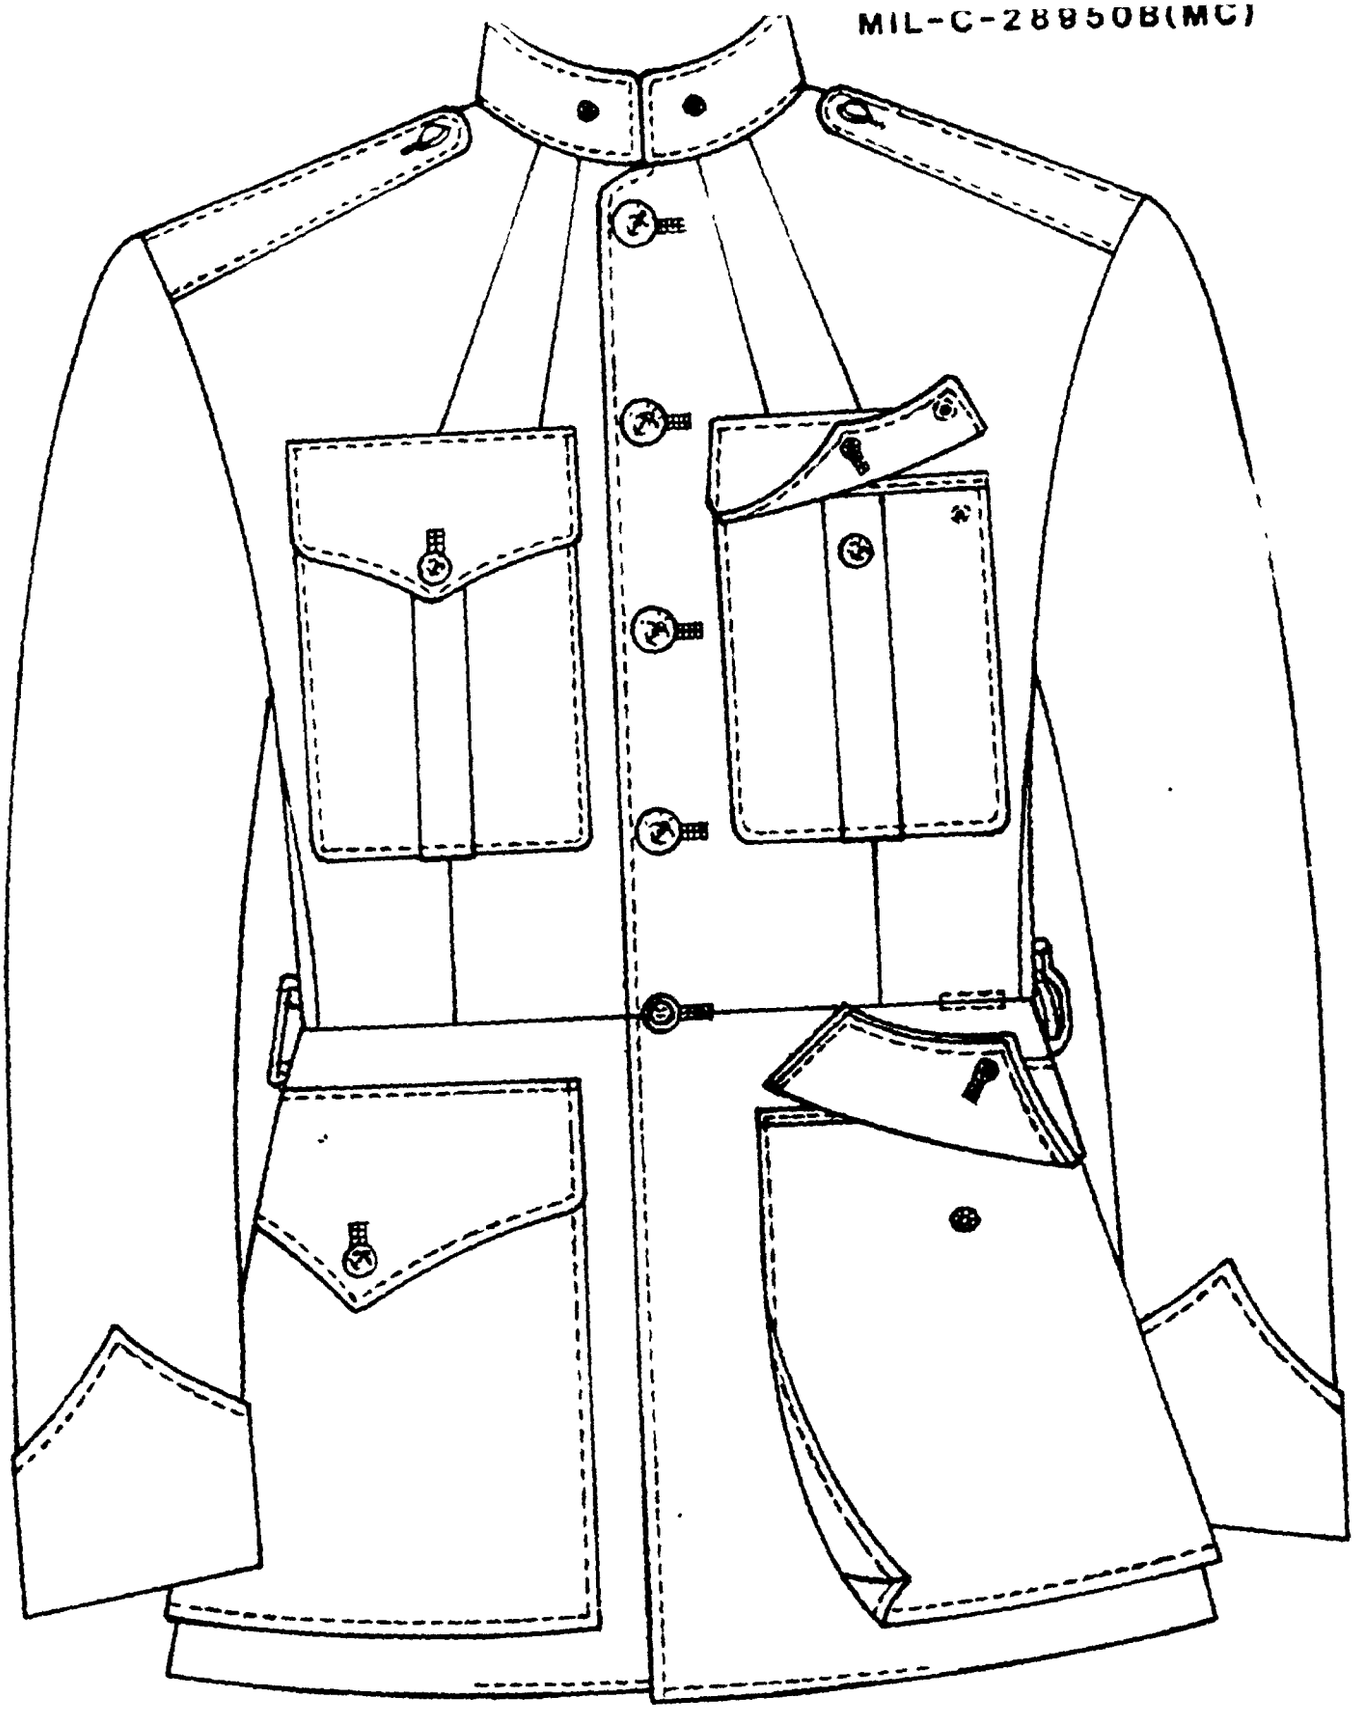


FIGURE 3. COAT, MAN'S; DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 20260410-20T21:05Z
Check the source to verify that this is the current version before use.


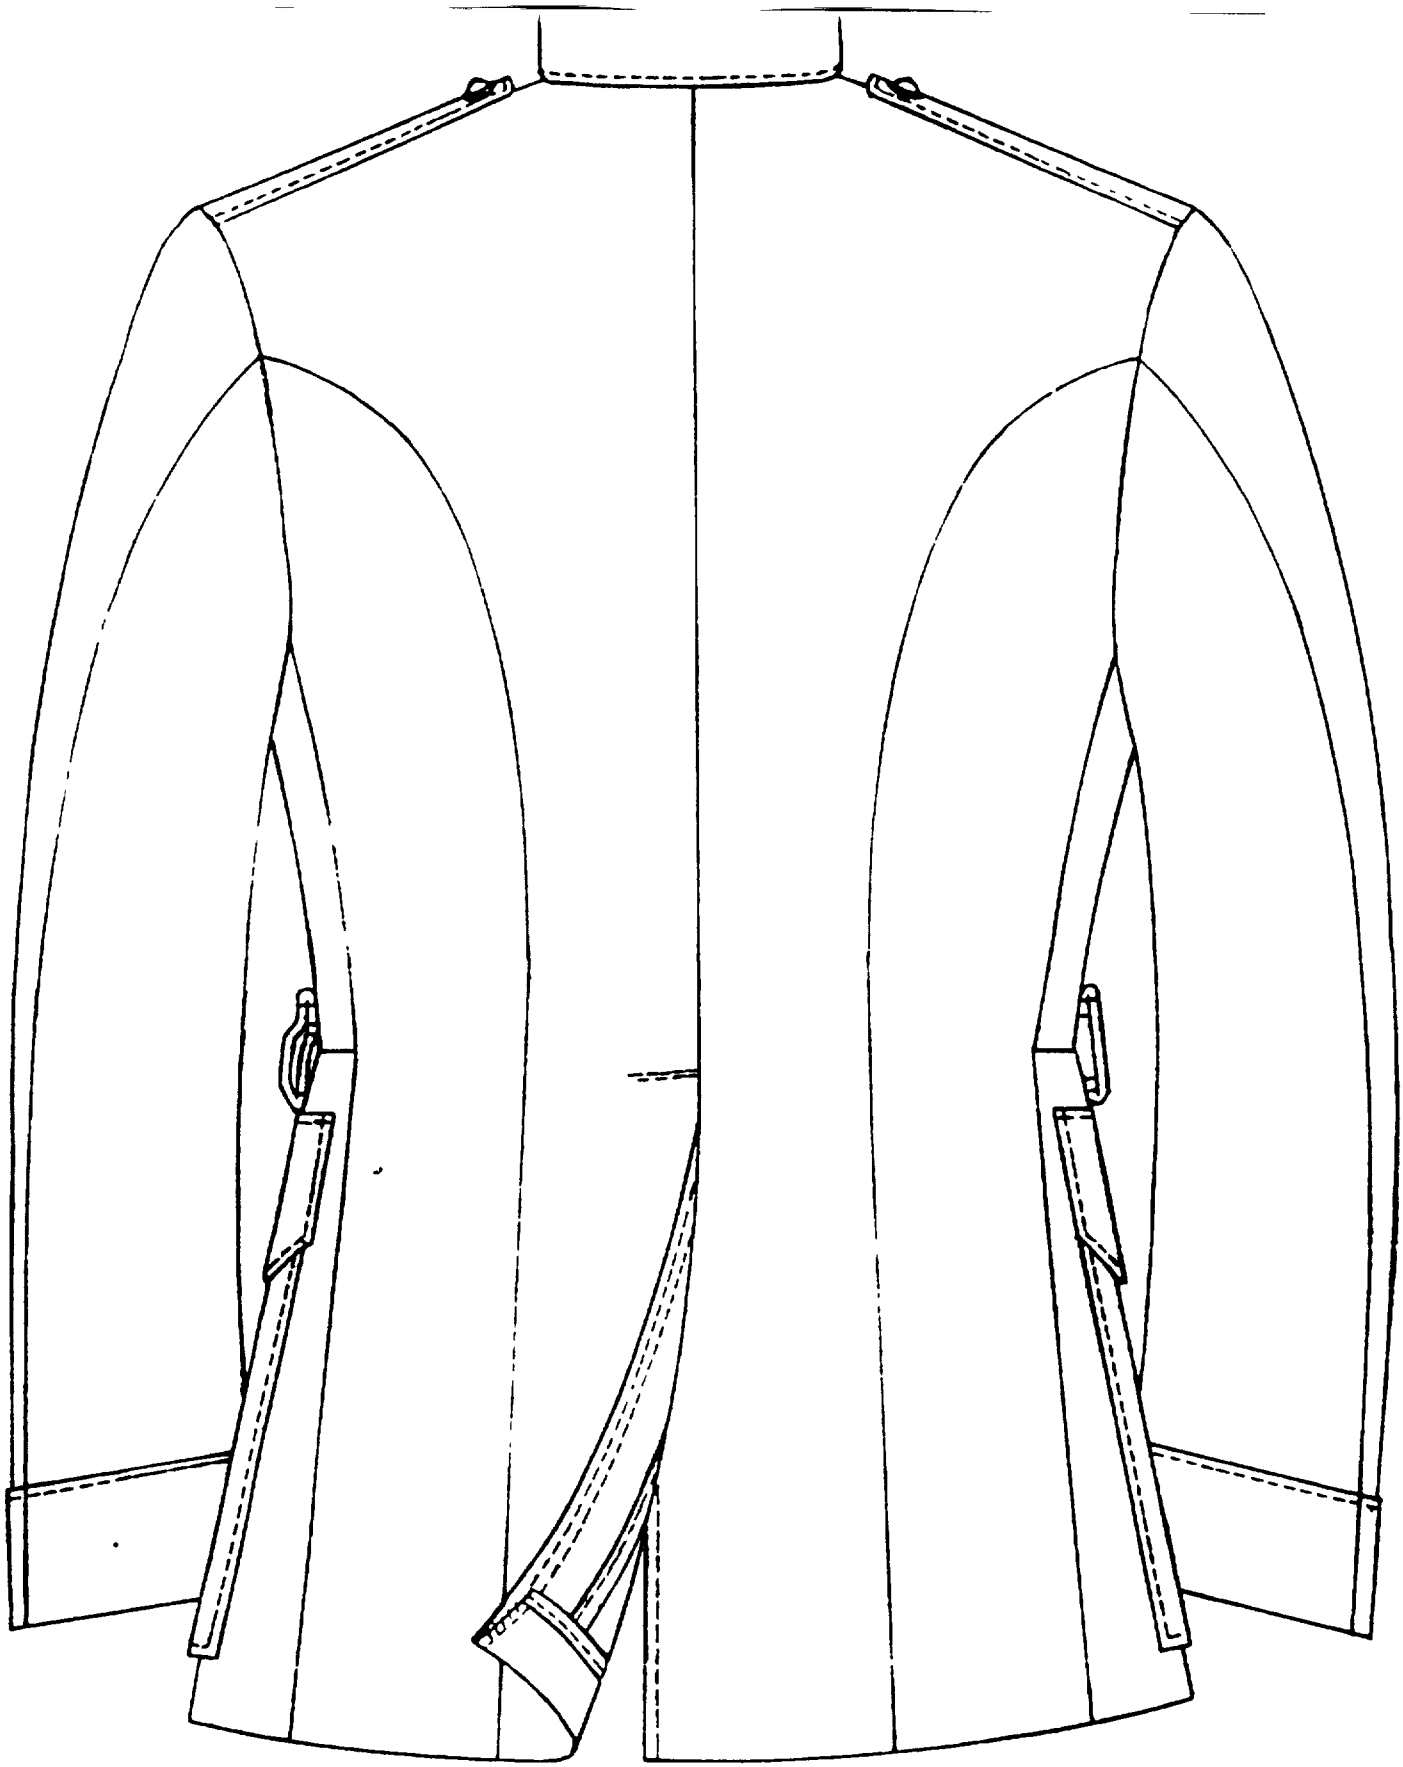


FIGURE 4. COAT, MAN'S: DRESS, BLUE, OFFICER'S


Source: https://assist.dla.mil Downloaded: 20261O-20T21:05Z
Check the source to verify that this is the current version before use.

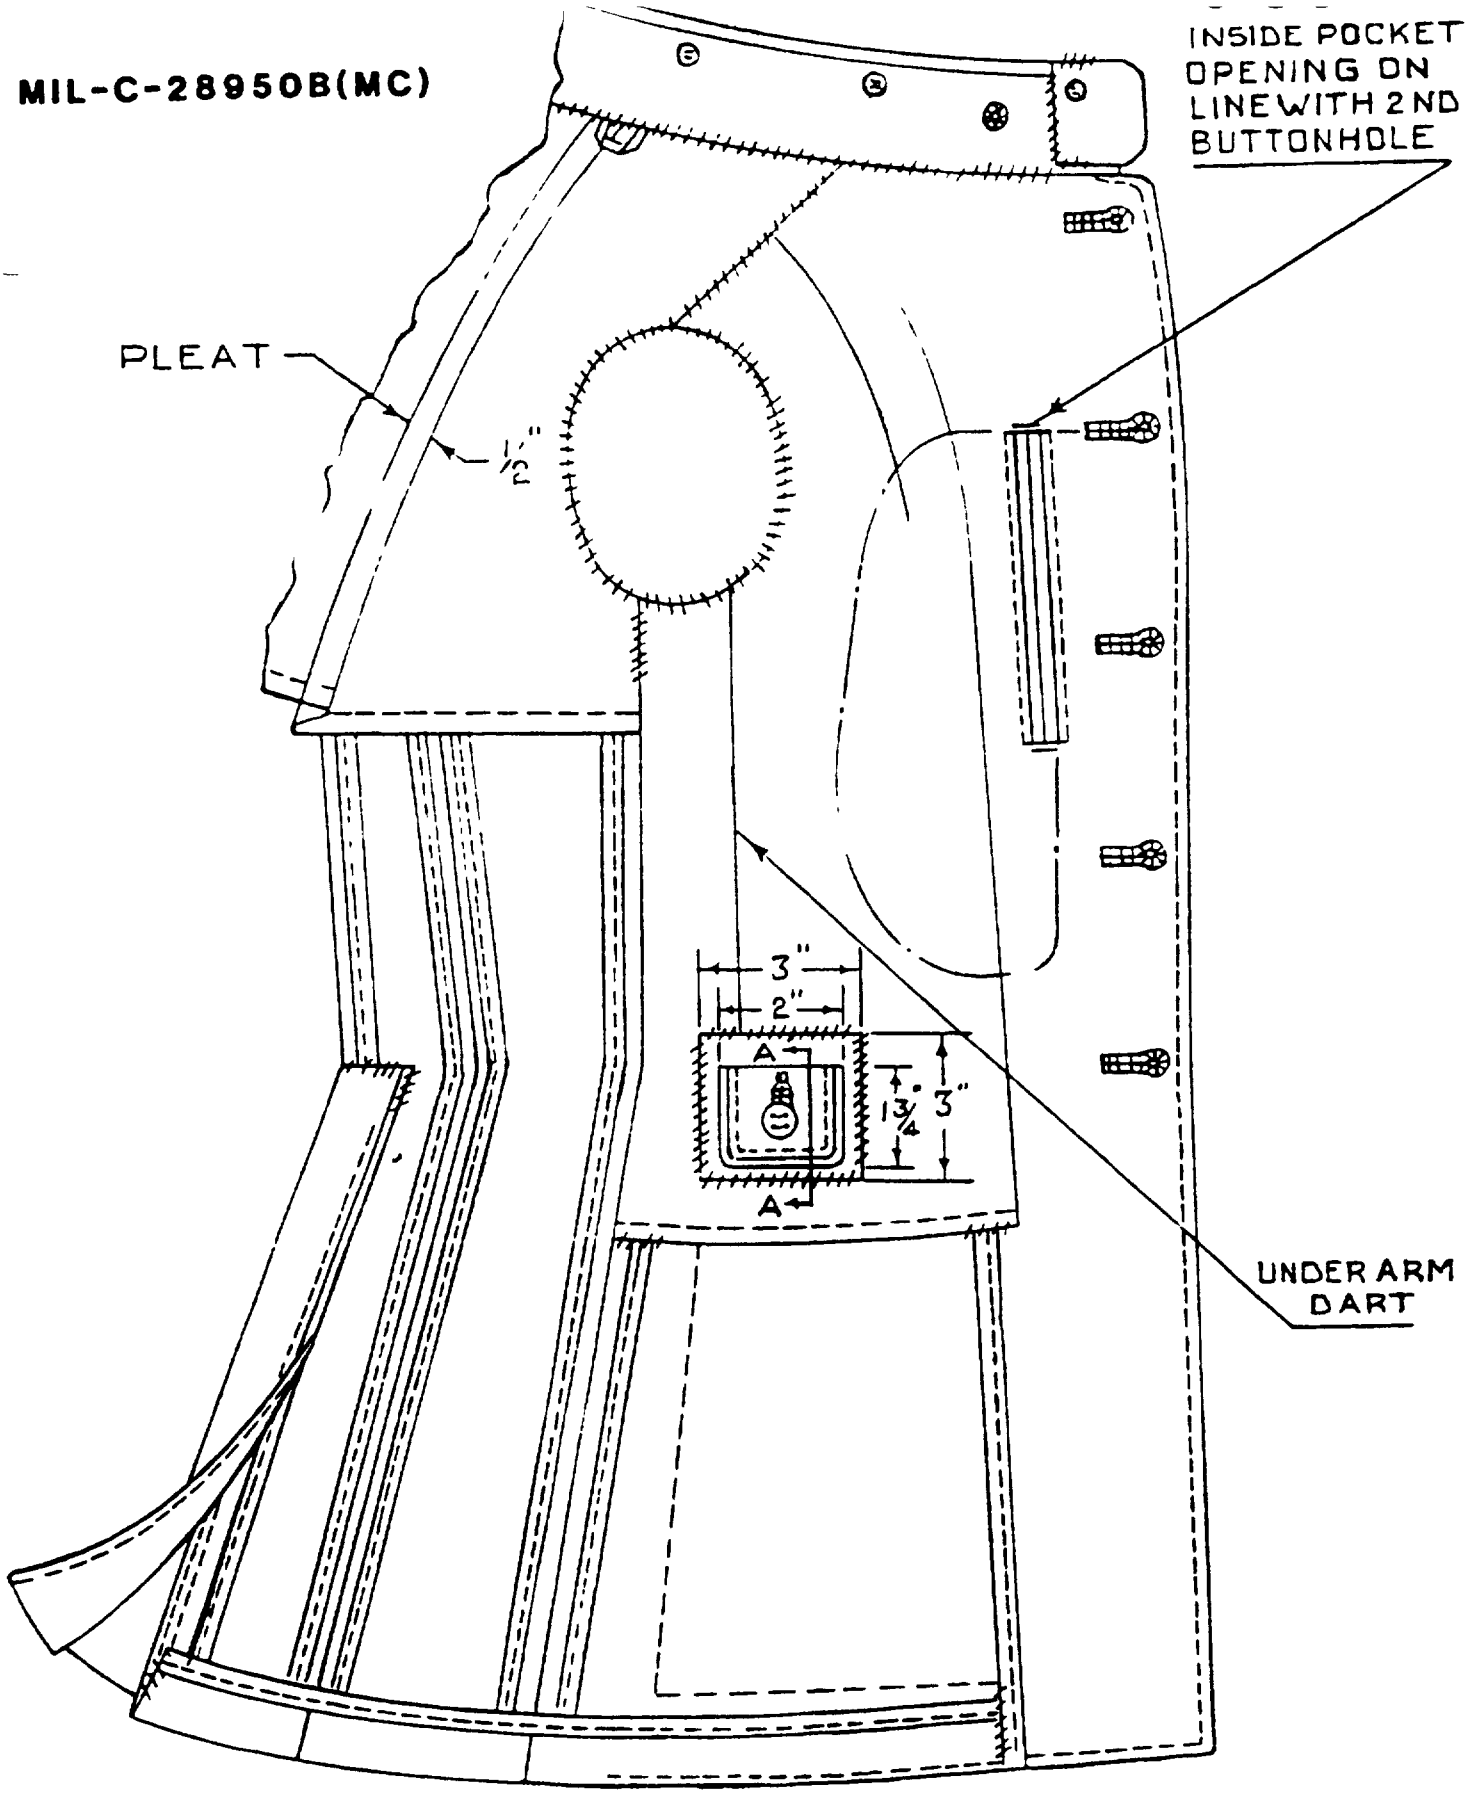

SIDE VIEW — LEFT INSIDE

FIGURE 5. COAT, MAN'S: DRESS, BLUE, OFFICER'S


Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

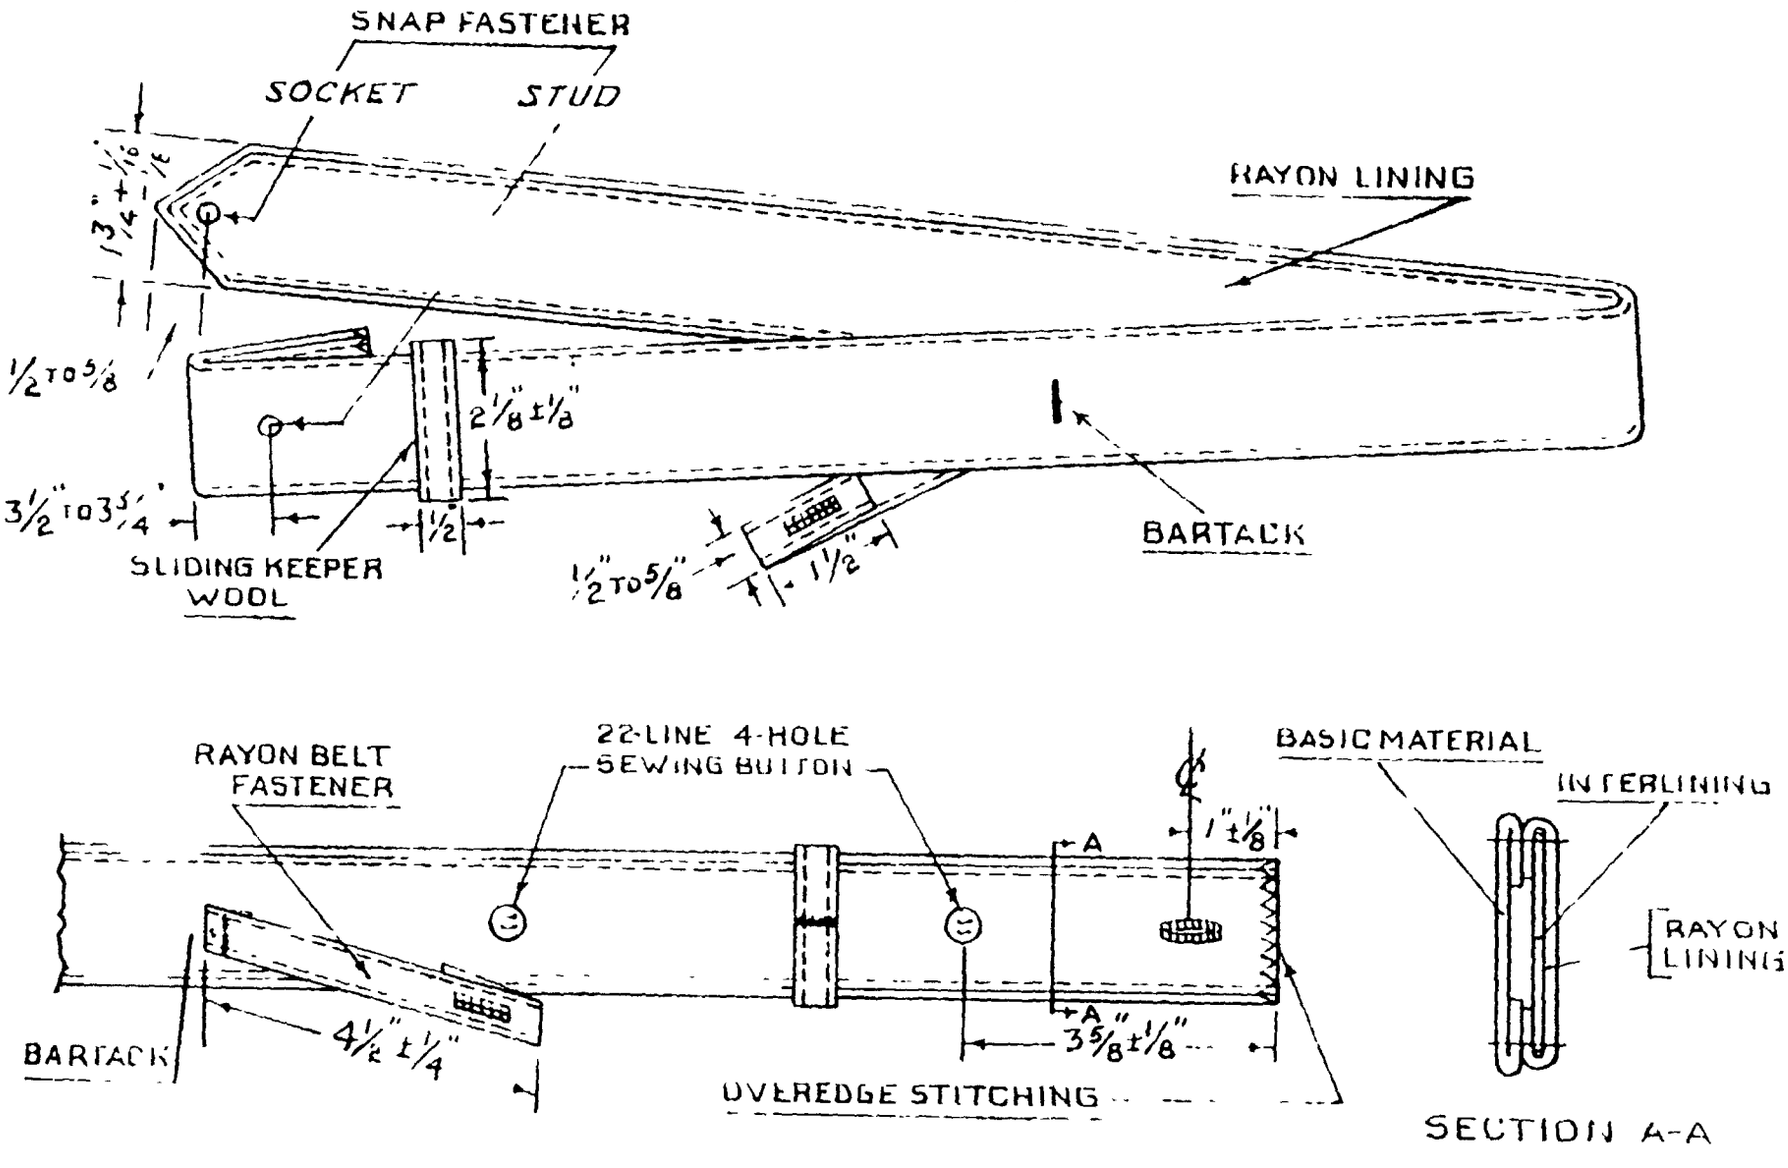



BELT DETAIL (STANDARD)

FIGURE 6 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026/10-20T21:05Z
Check the source to verify that this is the current version before use.

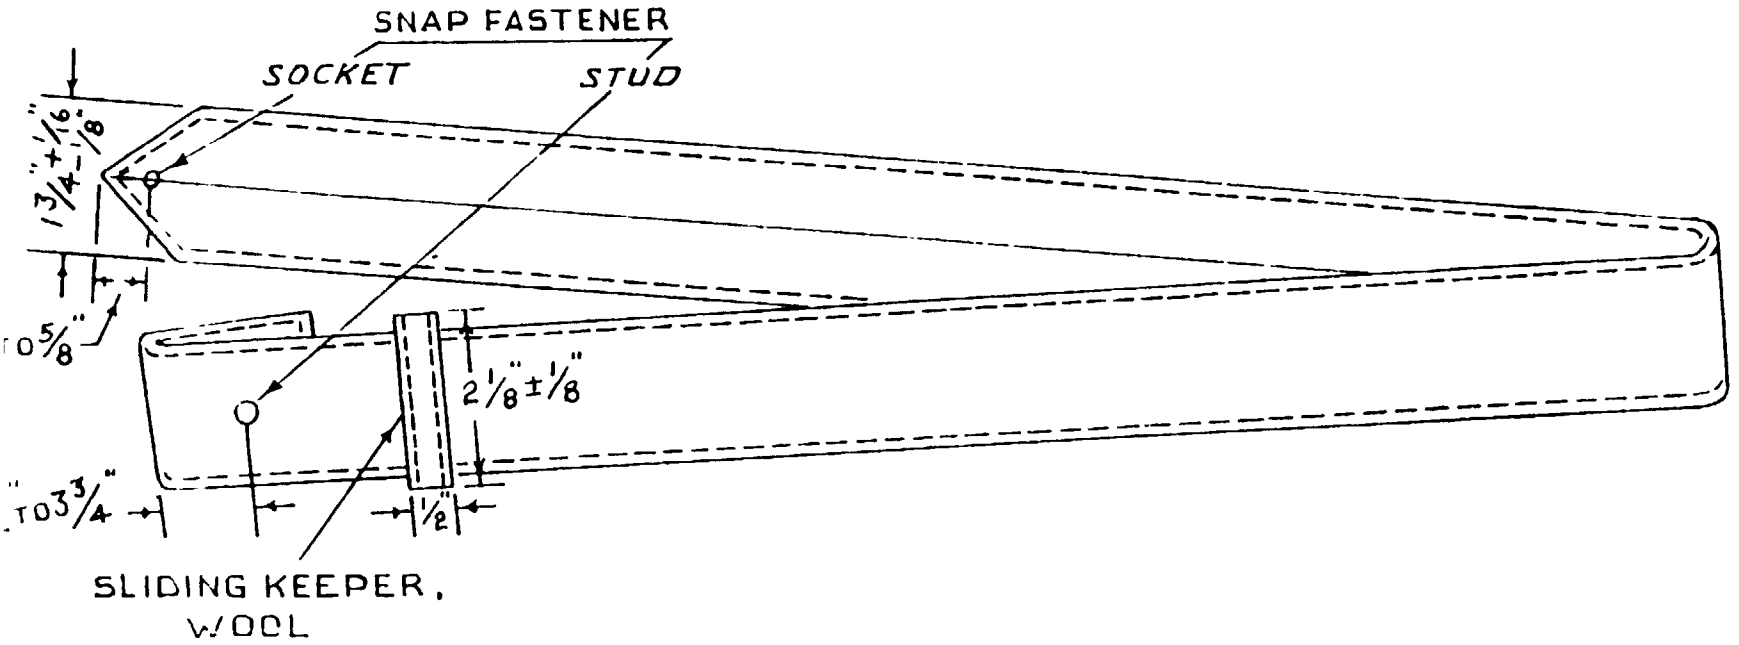

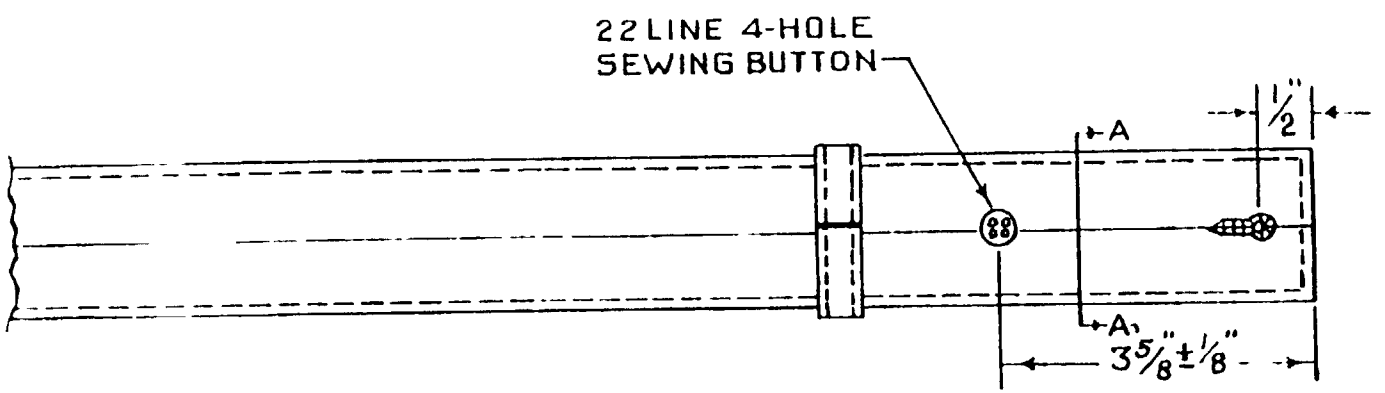

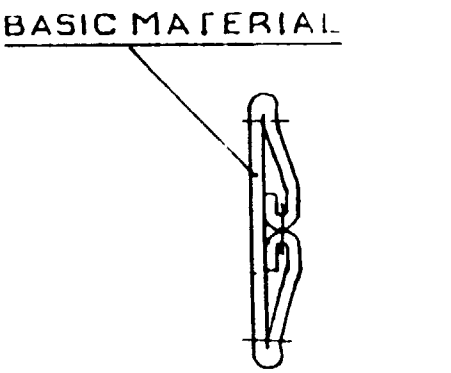

SECTION A-A

BELT DETAIL (OPTIONAL)

FIGURE 7. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 20240-20T21:05Z
Check the source to verify that this is the current version before use.


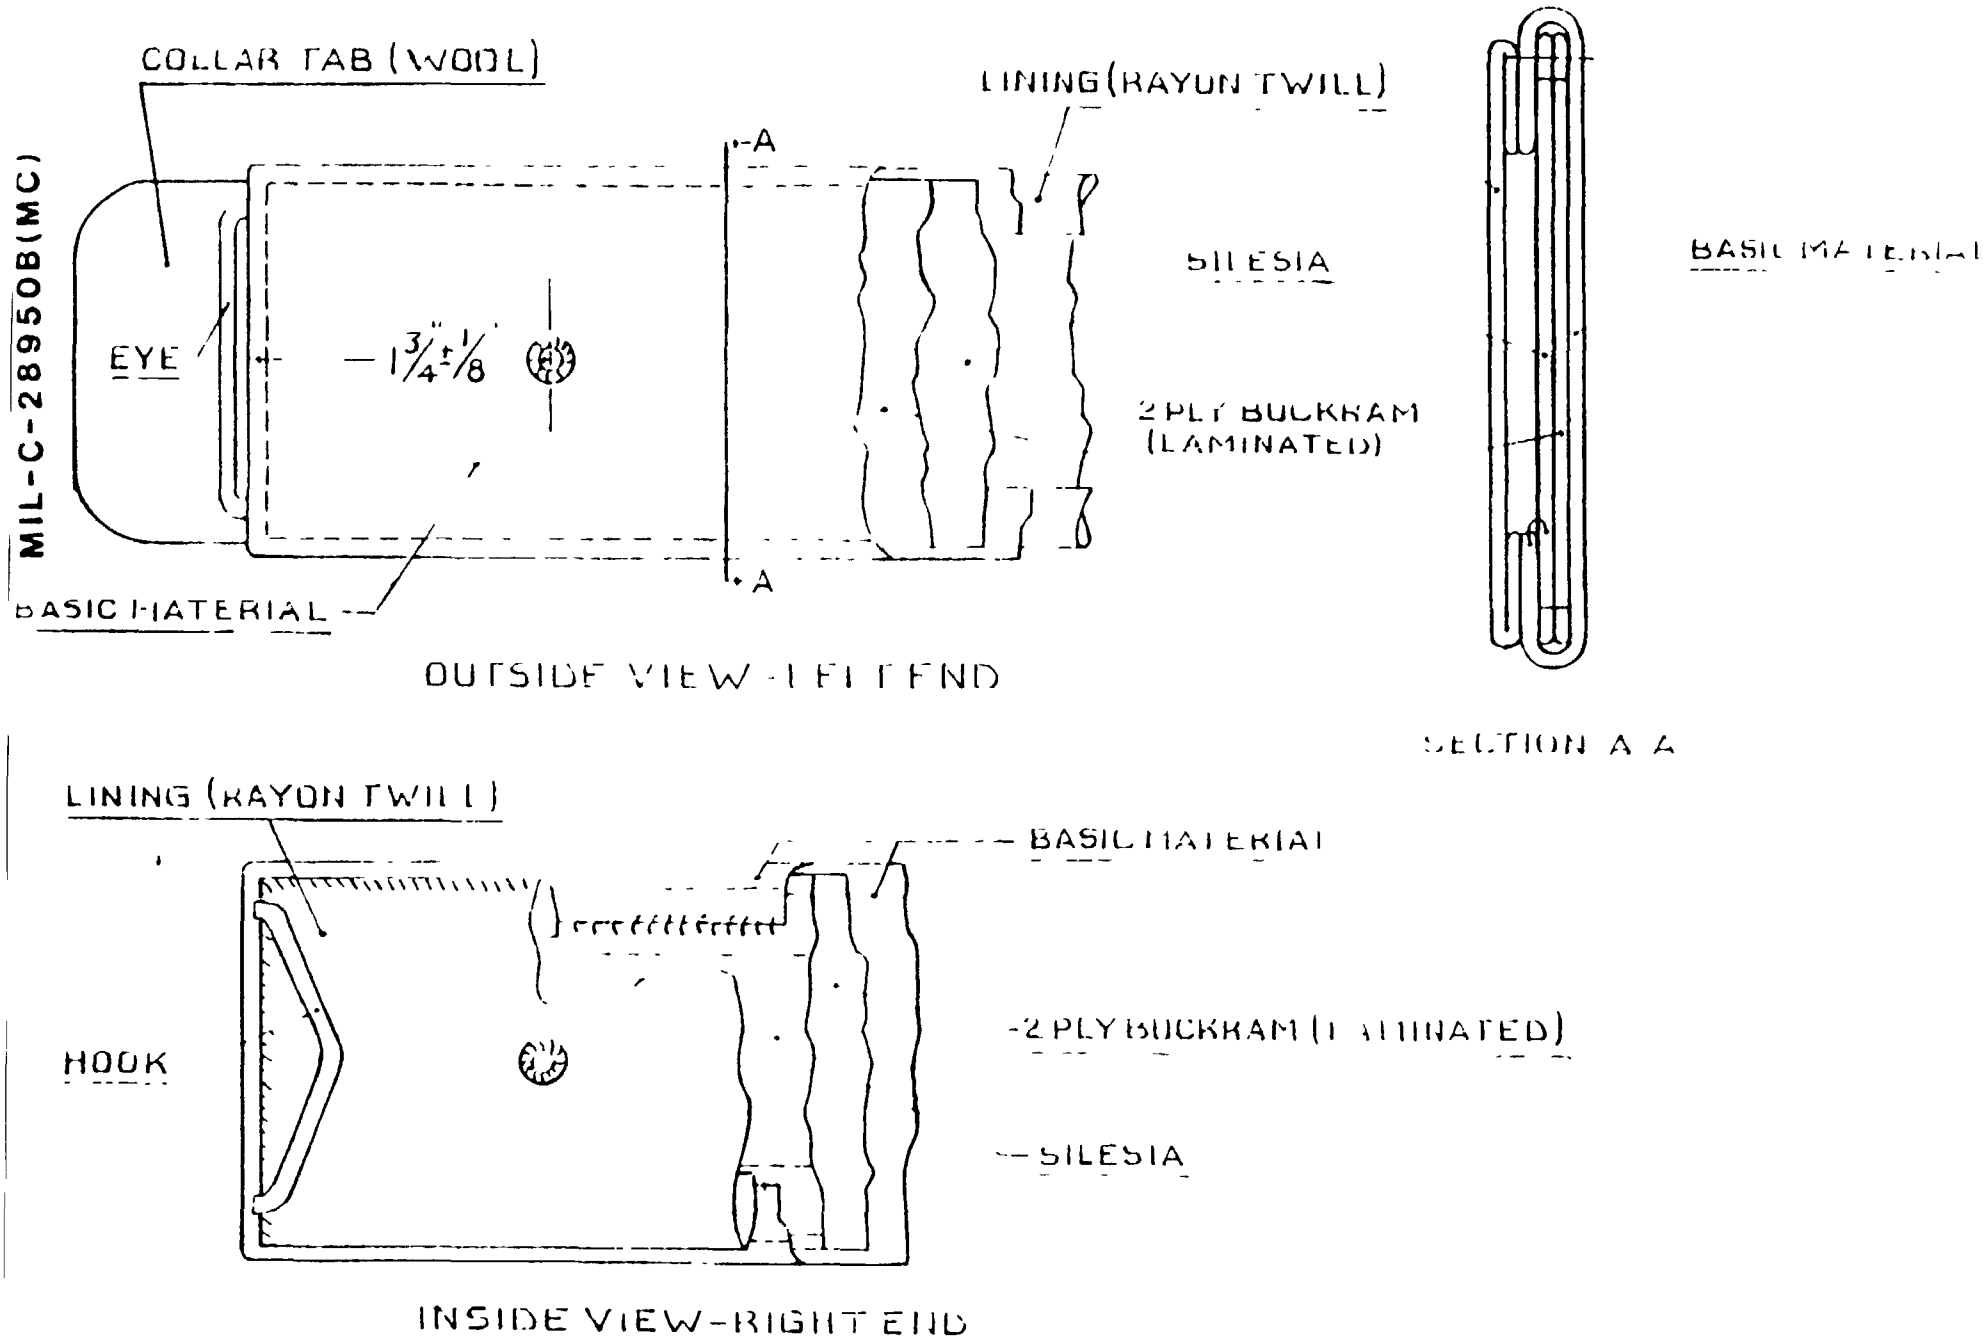



FIGURE 8 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 20260410-20T21:05Z
Check the source to verify that this is the current version before use.

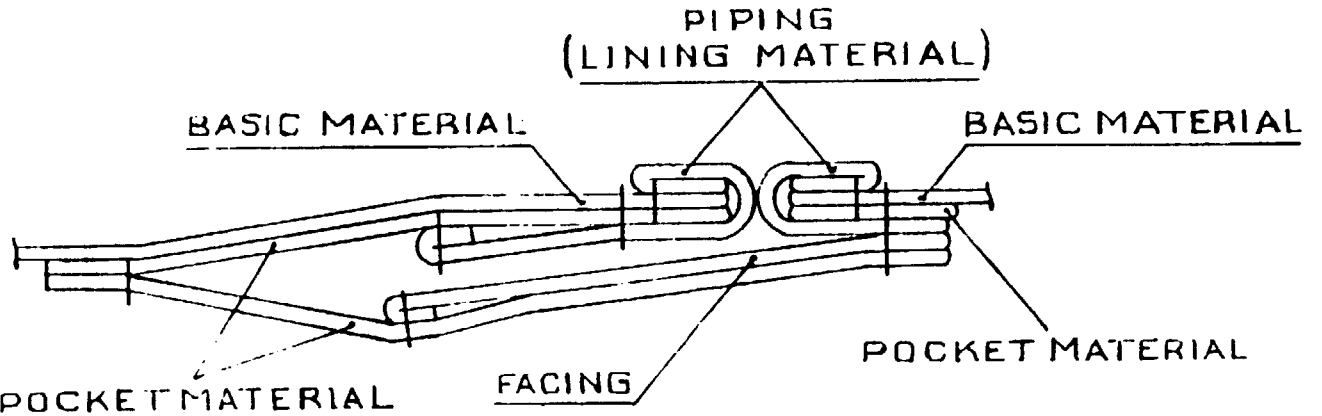


SECTION B-B

INSIDE POCKET—CUT THROUGH VIEW

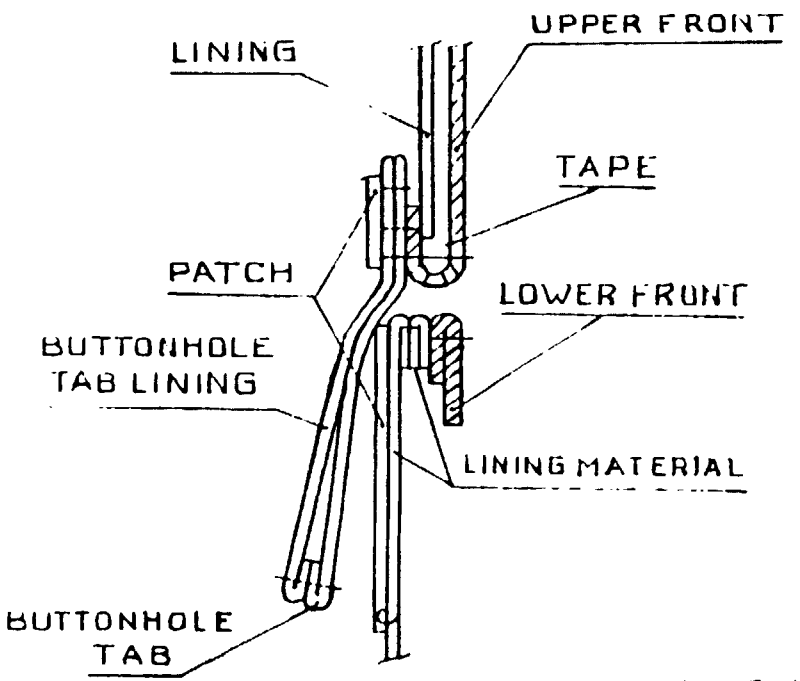

SECTION A-A

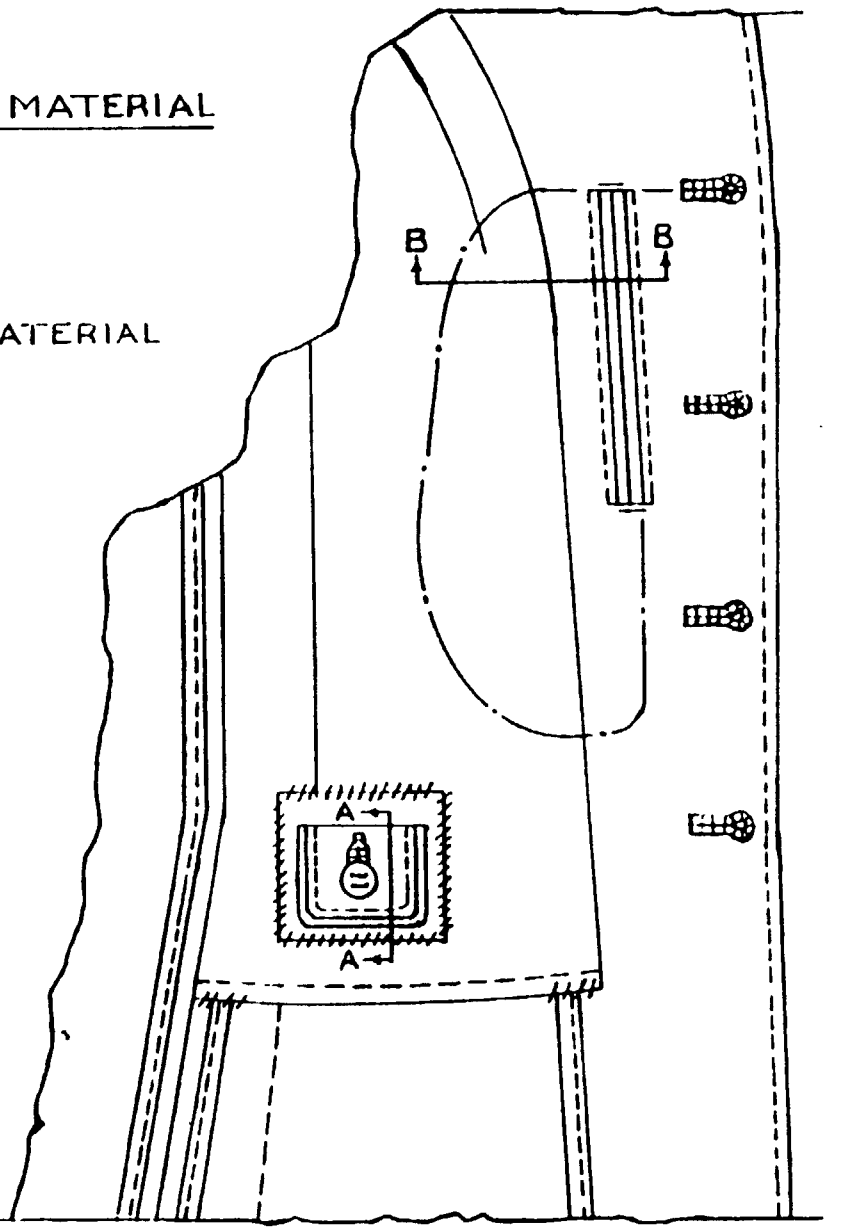

SIDE VIEW, LEFT—INSIDE
SHOWING SWORD SLIT, TAB AND PATCH

FIGURE 9. COAT, MAN'S: DRE , BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 20260-20T21:05Z
Check the source to verify that this is the current version before use.

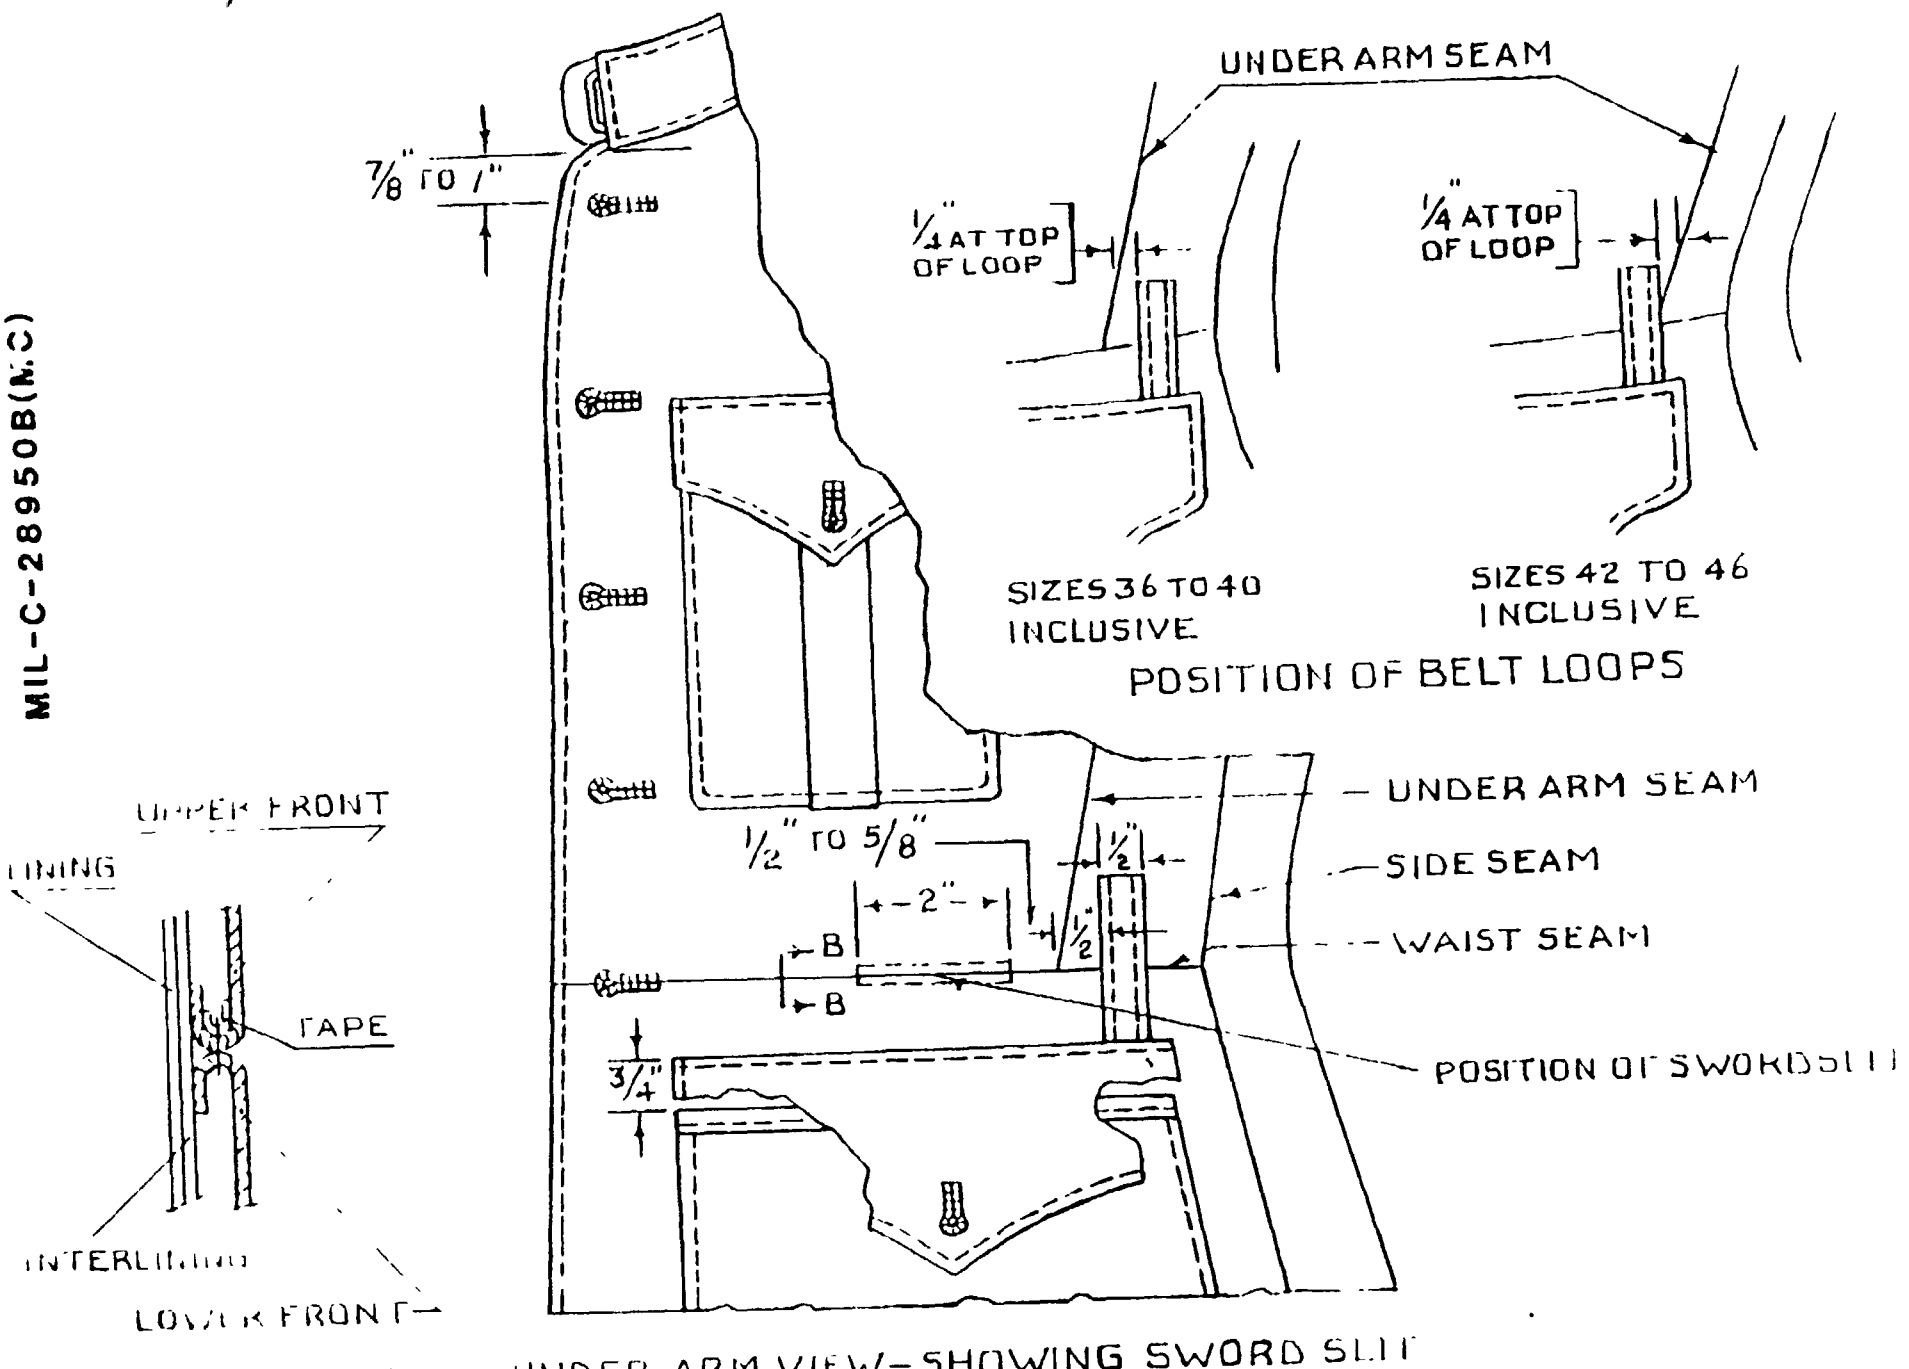


FIGURE 10 COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.


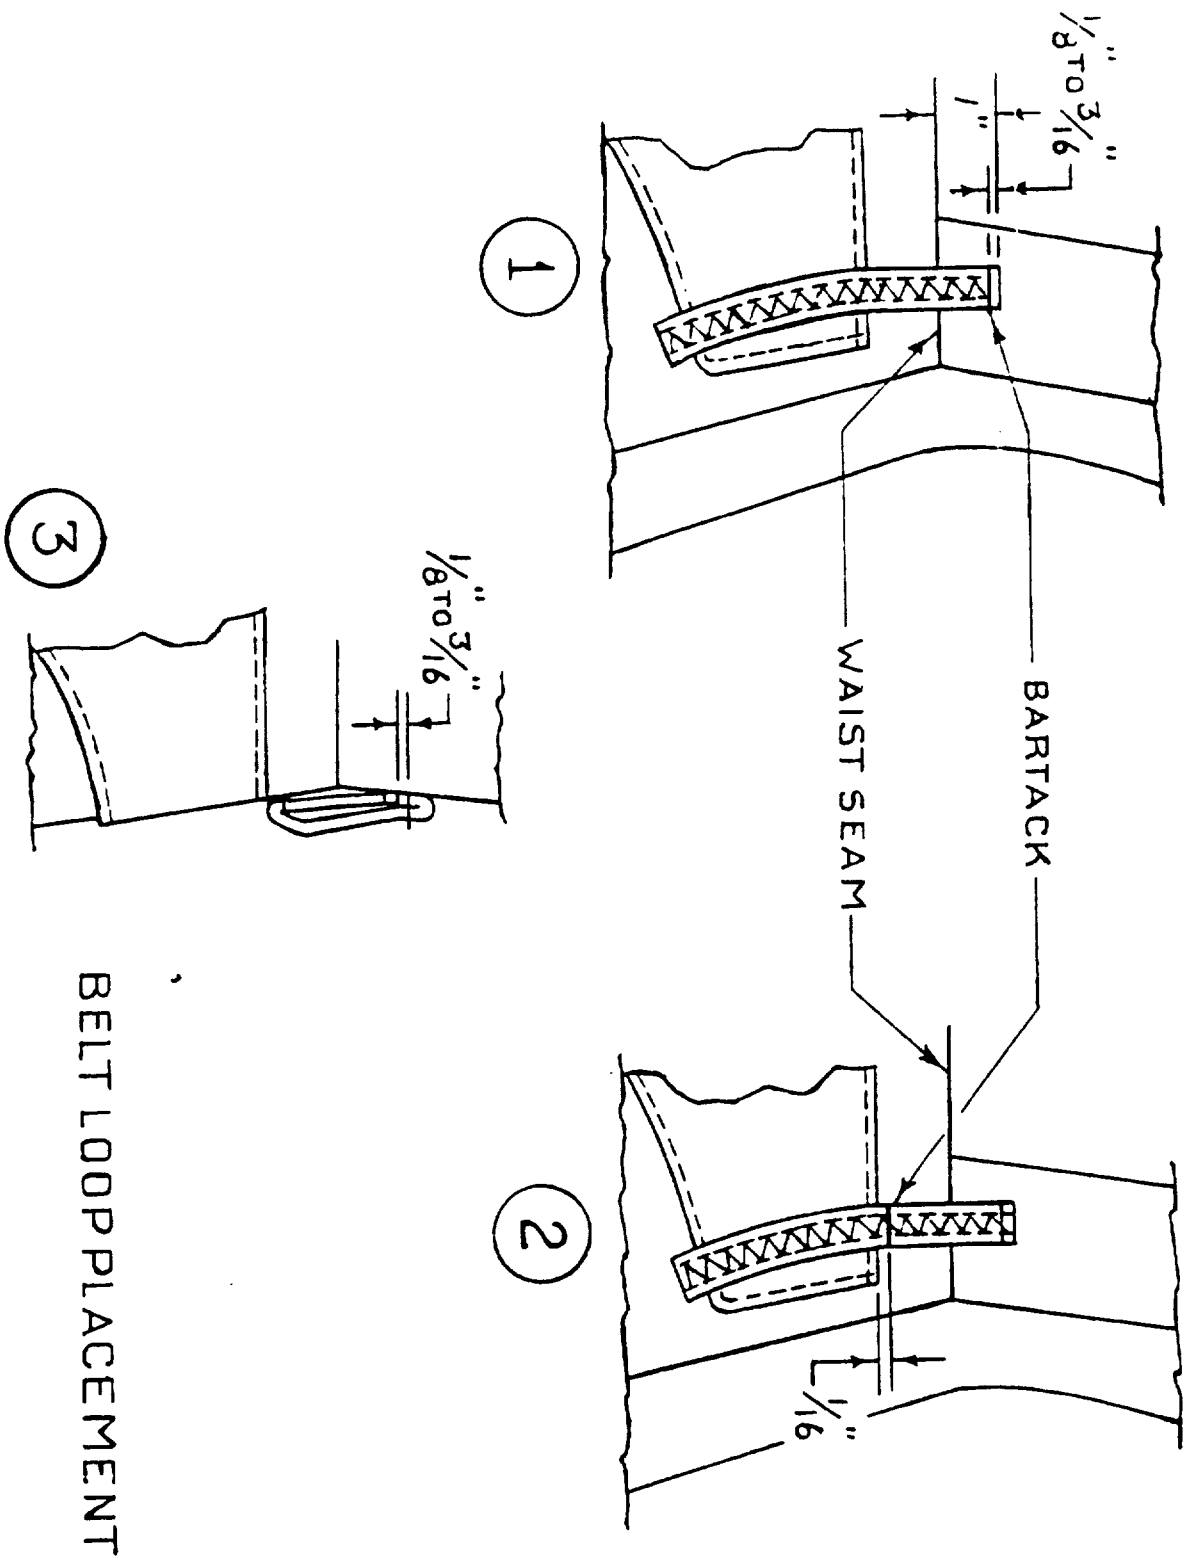


FIGURE 11. COAT, MAN'S: DRESS, BLUE, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.

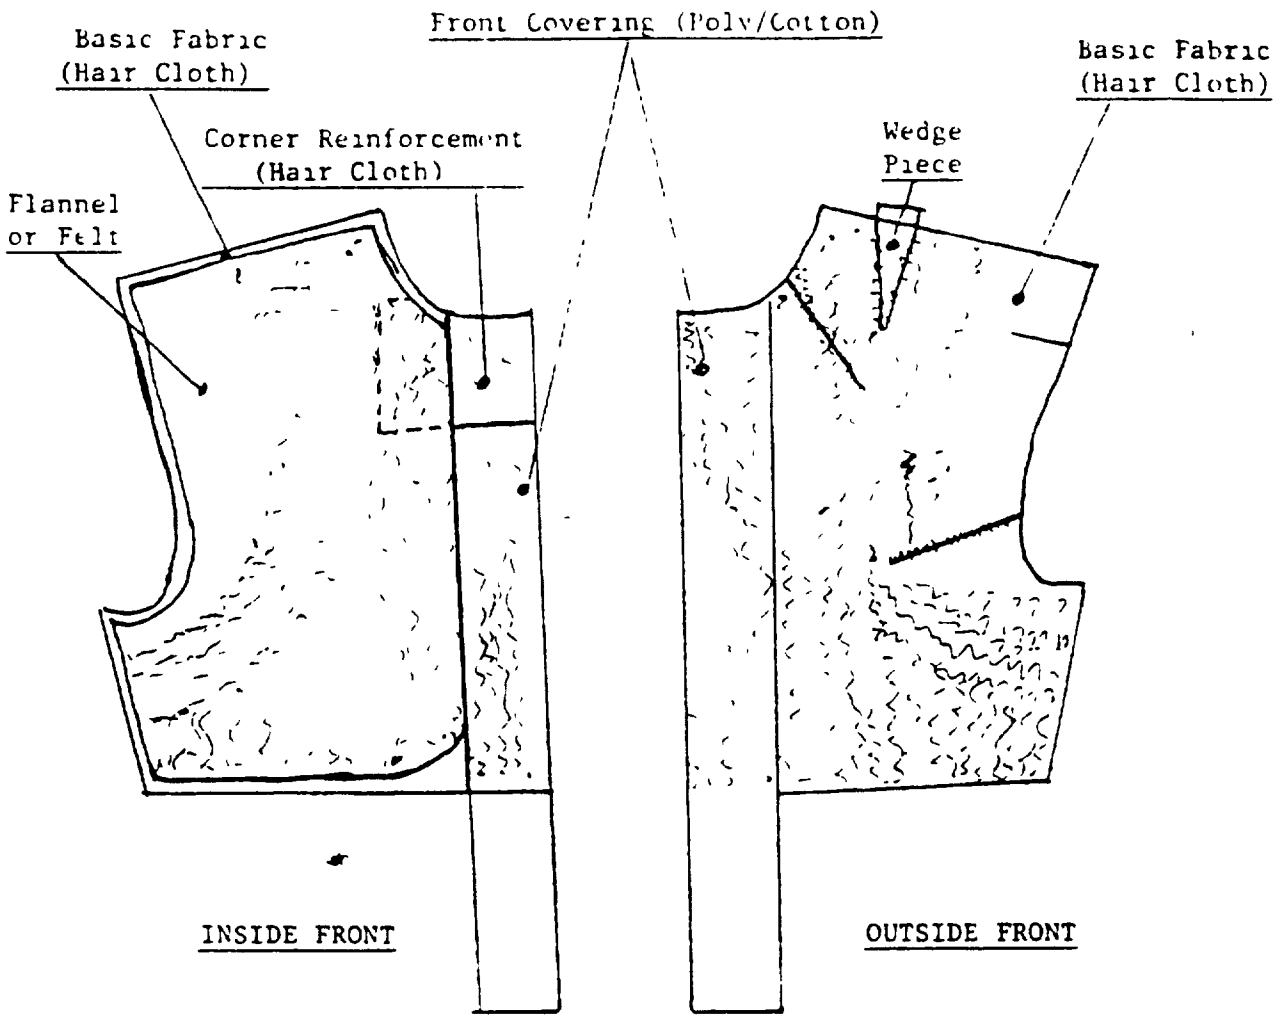

ALTERNATE FLOATING CHEST PIECE FOR FUSED FRONT COAT,

DRESS BLUE, MAN'S, MARINE CORPS

Figure 12. Coat, Man's, Dress Blue Officer's

Source: https://assist.dla.mil -- Downloaded: 202640-20T21:05Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1 The preparing activity must complete blocks 1, 2 3, and 8 In block 1, both the document number and revision letter should be given

2 The submitter of this form must complete blocks 4, 5, 6, and 7

3 The preparing activity must provide a reply within 30 days from receipt of the form

NOTE This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER	2 DOCUMENT DATE (YYMMDD)
	MIL-C-28950B(MC)	26 July 1994

3. DOCUMENT TITLE

COAT, MAN'S: DRESS; BLUE (OFFICER'S)

4 NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed)*

5 REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8 PREPARING ACTIVITY

a NAME	b TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER	(703) 640-4584	278-4584
c ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE (PSE-C/S) MARCORSYSCOM, 2033 BARNETT AVE, SUITE 315, QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil Downloaded: 2026-10-20T21:05Z
Check the source to verify that this is the current version before use.