INCH-POUND

MIL-J-28978B(MC)

September 20, 1994

SUPERSEDING
MIL-J-28978A(MC)
2 June 1989

MILITARY SPECIFICATION

JACKET, MAN'S: EVENING DRESS (STAFF NONCOMMISSIONED OFFICER'S)

This specification is approved for use within the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for a blue polyester/wool gabardine evening dress jacket.

1.2 Classification. The jacket shall be of one type in the following sizes as specified (see 6.2):

Schedule of Sizes

Short	Regular	Long	Extra Long
36	36	36	36
38	38	38	38
40	40	40	40
42	42	42	42
44	44	44	44
	46	46	

1.3 Individual order. When the jacket is custom tailored to an individual order, this specification shall govern, except the detailed requirements of Section 3, Table I may be modified to the extent necessary for good custom tailoring practices.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. The following specifications and standards form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation (See 6.2).

SPECIFICATIONS

FEDERAL

A-A-50067	- Cloth, Flannel, Wool, Undercollar Cloth
A-A-50186	- Cloth, Buckram, Woven and Nonwoven
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Cotton Gimp, Buttonhole
A-A-52094	- Thread, Cotton
A-A-52105	- Cloth, Interlining, Cotton or Synthetic Warp, and Spun Hair-Wool or Rayon Filling
A-A-52106	- Cloth Twill, Polyester, or Polyester Blend
DDD-L-20	- Label, for Clothing, Equipage and Tentage (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-3461	- Buttons; Insignia, Metal, Uniform and Cap
MIL-C-10176	- Cloth, Gabardine, Wool, Polyester and Wool
MIL-C-15064	- Pad, Shoulder and Sleeve-Head
MIL-C-29405	- Cloth Broadcloth: Wool and Wool/Nylon

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams and Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094.)

2.2 Non-Government publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of documents which are DOD adopted shall be those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS shall be the issues of the documents cited in the solicitation (see 6.2).

AMERICAN SOCIETY OF TESTING MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document shall take precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption had been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from this specification may appear in the guide sample in which case the specification shall govern.

3.2 First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection and approval (see 4.4 and 6.3).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, gabardine, polyester/wool, dark blue shade 2312, 10.6 ounce, conforming to type II, class 12 of MIL-C-10176.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3.3.2 Lining. The material for lining the jacket, shall be cloth, rayon twill, black shade 3602 (see 6.3), 3.7-ounce, conforming to class 1 of MIL-C-368.

3.3.3 Polyester twill. The stays for shoulder and armhole seams shall be cloth, polyester twill, black, conforming to class I of A-A-52106, except that the non-fibrous material content and colorfastness requirements for perspiration and crocking shall not apply.

3.3.4 Undercollar cloth. The undercollar and shoulder eyelet cover cloth shall be wool flannel conforming to A-A-50067. The color of the cloth shall be black of an approved shade to closely match the basic material. The acidity (pH) requirement and colorfastness to perspiration and crocking requirements shall not apply.

3.3.5 Collar interlining. The material for interlining the collar shall be cloth, buckram, cotton, natural color, conforming to type IV of A-A-50186, except that the test for shrinkage shall be in accordance with method 5580 of FED-STD-191.

3.3.6 Shoulder pads. The shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.7 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.8 Coat front interlining. The material for the front interlining shall be cotton warp and hair-wool filling interlining cloth conforming to type II, of A-A-52105.

3.3.9 Hanger braid. The braid for the jacket hanger shall be cotton or rayon tubular flat braid, 1/8- to 3/16-inch-wide, minimum breaking strength of not less than 50 pounds. The color of the braid shall be black.

3.3.10 Tape, cotton. The cotton tape shall be 1/4-inch and 3/8-inch widths and shall conform to type III, class 1, preshrunk of DDD-T-86, except that the non-fibrous material content shall not apply.

3.3.11 Piping. The material for piping the shoulder straps shall be cloth, broadcloth, wool scarlet shade 2501, 14-ounce, conforming to type I or II of MIL-C-29405.

3.3.12 Thread.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3.3.12.1 Silk thread. The silk thread shall conform to A-A-50196. The thread for machine sewing shall conform to type I, ticket No. A, 3-ply for bartacks, and all outside seaming and stitching; ticket No. F, 3-ply and ticket No. B, 3-ply for buttonholes, bobbin or looper, and needle threads, respectively, and ticket No. 0, 3-ply for machine felling. The threads for hand sewing shall be type III, class 3, ticket No. C, 2-ply.

3.3.12.2 Cotton thread. The cotton thread shall conform to A-A-52094, type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching and type II, glazed finish, ticket No. 24, 4-ply for machine tacking armholes. The thread for basting shall be good commercial grade cotton.

3.3.12.3 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after dry cleaning process shall be brushed off or removed.

3.3.12.4 Color and colorfastness. The thread shall be dyed shade black AA, cable No. 66043, except cotton thread for basting and for machine tacking armholes may be white. The dyed thread shall show fastness to light and wet (dry) cleaning equal to or better than the standard sample. When no standard sample is available, the dyed thread shall show good fastness to light and wet (dry) cleaning. The thread for seaming lining and all inside stitching need show fastness to wet (dry) cleaning only.

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be black AA, cable No. 66043. The dyed gimp shall show fastness to wet (dry) cleaning equal to or better than the standard sample. When no standard sample is available, the dyed gimp shall show good fastness to wet (dry) cleaning.

3.3.14 Buttons. When specified (see 6.2), buttons shall be furnished with the jacket. The insignia buttons shall be metal, gold plated, 27-line, conforming to type I, style 3, class A, subclass 1 of MIL-B- 3461.

3.3.14.1 Ring toggles. When buttons are furnished, ring toggles for securing buttons to the fronts and shoulders shall conform to MIL-B-3461.

3.3.14.2 Linked buttons. When buttons are furnished, a pair of insignia buttons for the front closure shall be linked together with a multiple link chain conforming to MIL-B-3461.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3.3.15 Labels. Each jacket shall have an identification label and a size label as follows. The jacket is intended to be dry cleaned and the label shall show fastness to dry cleaning.

3.3.15.1 Identification label. The identification label shall conform to type I, class 1 of DDD-L-20. The content and format shall be as follows:

Nomenclature (item description)
Contract number
Name of contractor
Wool Products Act information

3.3.15.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long, and Extra Long as shown by the following example:

40R

3.4 Design. The jacket shall be the semiformfitting Marine Corps design shown in Figures 1 through 3. The fully lined jacket shall have a four-piece plain back, waist darts, and ornamental sleeve cuffs; peaked lapels and shoulder straps to button. Edges of the shoulder straps shall be piped with scarlet broadcloth. Jacket shall have three worked eyelets on each front for detachable buttons and one eyelet in each end of collar for attaching branch of service insignia and one buttonhole on each front for the linked buttons. The jacket is designed to be held together at the front by the linked buttons.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working pattern shall be identical to the standard patterns. The standard patterns shall provide 1/4-inch seam allowance for shoulder strap seams, and for seam at the edges of the lapels and front edges of jacket; 5/8-inch seam allowance for center back seam; 3/8-inch seam allowance, except as otherwise specified in Table I for all other seams. These patterns show size, are marked for placement and cutting and are notched or marked for proper assembly of component parts.

3.5.1 List of pattern parts. Jackets shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Pattern Nomenclature

Item	Material: Cloth, gabardine, polyester/wool	No of cut parts
1.	Front	2
2.	Side front	2
3.	Side back	2
4.	Back	2
5.	Top sleeve	2
6.	Undersleeve	2
7.	Top collar	1
8.	Front facing	2
9.	Shoulder straps	4
10.	Sleeve cuff	2
	Material: Cloth, rayon lining	
11.	Front	2
12.	Side back	2
13.	Back	2
14.	Top sleeve	2
15.	Undersleeve	2
	Material: Cloth, cotton interlining	
16.	Collar interlining	1
	Material: Cloth, cotton, warp, hair-wool filling	
17.	Front interlining	2
	Material: Cloth, wool flannel undercollar	
18.	Undercollar	2
19.	Shoulder eyelet-cover	2
	Shapers	
20.	Working lapel shaper	
21.	Undercollar shaper	
22.	Finished collar and lapel shaper	
	Markers	
23.	Undercollar stand marker	
24.	Sleeve cuffs marker	
25.	Front eyelet marker	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3.6 Manufacturing requirements. Jacket shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I but all operations specified shall be used to manufacture the jackets.

3.6.1 Stitches, seams, and stitching. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. Ends of seams and stitching (stitch type 301), when not caught in other seams or stitchings, shall be backtacked not less than 1/4-inch; thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2-inch.

3.6.2 Shade marking. The component parts of the jacket cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, and the two parts of the undercollar cloth shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade, marking may be used except:

(a) Corrosive metal fastening devices.
(b) Adhesive type tickets which show discoloration or leave traces of paper or adhesive mass to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut jackets in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction indicated by the directional lines on the pattern. The straight of the material shall indicate the warp direction. c. Cut all wool parts of the jacket from one piece of basic material, except the underply of shoulder straps may be cut from ends. Parts cut from ends shall harmonize with the shade of the jacket. d. Cut the body lining of jacket from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. e. The scarlet wool broad cloth for piping the edges of the shoulder straps shall be cut in the warp direction, 5/8-inch wide. f. The two parts of the undercollar cut from undercollar material shall match each other.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) g. Cut the shoulder eyelet covers from undercollar material. h. Cut the cotton interlining cloth for collar on the bias in accordance with the pattern furnished. i. Cut the jacket front interlining in accordance with the pattern furnished. j. Cut polyester twill stays for armhole and shoulder seams on the bias, 3/4-inch-wide, 4-1/4 inches long, for front shoulder and armhole edge.					
2	Replacement of damaged parts. a. Replace at time of cutting any parts of the jacket containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, etc., expected to develop into holes, shade bars, and dye streaks or unsightly slubs, etc..					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. (cont'd) b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends, or burns in the material.					
3	Shade marking. a. Mark or ticket all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the jacket. All lining parts shall be marked, bundled or ticketed to insure uniform shade and size throughout the garment. b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4	Hem scarlet piping. a. Turn under one edge of 5/8-inch-wide scarlet piping 1/4-inch and seam the turned under portion to the body of the piping not less than 1/8-inch from the folded edge. The piping shall finish 3/8-inch-wide.	301	EFa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Assemble top ply of shoulder strap. (cont'd) Finished appearance. The piping shall be uniformly stitched to the shoulder straps without twists, gathers, puckers, or pleats. The scarlet piping shall extend uniformly and evenly 1/8-inch beyond the front and back edges and collar end of strap. a. The top ply of the shoulder straps shall be piped with 5/8-inch-wide scarlet wool broadcloth hemmed as specified in operation 4.a. b. Position the top ply of the shoulder strap on the outside of hemmed scarlet piping with the raw turned under edge of the piping even with the top ply of the shoulder strap at the back and front edges, and around the collar end, and seam 1/8-inch from the back and front edges and collar end of the shoulder straps. The raw edges of the piping shall be notched to prevent pulling and to eliminate gathers and bulges around the collar end.	301	LSb-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Finish shoulder straps. Finished appearance. On the finished jacket, the straps, including the piping, shall measure 2-3/8 ±1/8 inches wide at the armhole seam and shall taper to 1-7/8 ±1/8 inches wide at the collar end.					
	a. Position the top ply assembly on the outside of the under ply, with back edges even, and seam together 1/8-inch from the front and back raw edges and around the collar end of top ply, trimming the excess material of the under ply.	301	SSa-1	12-16	A	A
	b. Turn the straps, working the piping out to the edges and topstitch the strap uniformly 3/16 to 1/4-inch from piped edges. On the finished straps, the piping shall extend uniformly and evenly 1/8-inch beyond the front and back edges and around the collar end.	301	SSa-1	12-16	A (Silk)	A
	c. Press the shoulder straps smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make buttonhole in shoulder straps. Finished appearance. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole, and the purling of the buttonholes shall be on the outside of the shoulder straps.					
	a. Make a horizontal eyelet-end, square-bar type cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges and with the inside edge of the eyelet placed so that in the finished jacket the edge of the shoulder strap button will be 1/4 to 1/2-inch from the edge of the collar and with the purling to finish on the outside of the strap.	Buttonhole		38 per button-hole (minimum) not including bartack	B (Silk)	F
	b. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside of the buttonhole.					
	c. Securely bartack the ends of the buttonholes and trim the ends of the thread and gimp.	Bartack		21 per bartack (minimum)	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Make undercollar.					
	a. The undercollar shall consist of two pieces of undercollar cloth and one piece interlining material.					
	b. Join the two halves of undercollar with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	c. Spread the seam open and press flat with a heated pressing iron.					
	d. Mark the breakline of undercollar with the undercollar stand marker.					
	e. Position the undercollar to the interlining and seam the undercollar through the interlining at the mark for the collar stand. Stand shall be 1-1/4 ±1/8-inches at center.	301	SSa-1	10-14	A	A
	f. Quilt the interlining to undercollar with 4 to 5 rows of blindstitching.	301	SSm-1	4-6	A	A
	g. Press undercollar smooth and flat with a heated pressing iron or pressing machine.					
	h. Mark and cut the undercollar in accordance with undercollar shaper or undercollar may be die cut to conform to pattern shaper. Trim undercollar interlining 1/8 to 3/16					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Make undercollar. (cont'd)					
	inch away from lower edge of undercollar.					
	i. Seam undercollar to interlining 1/2 ±1/8-inch from top and side edges.	301	SSa-1	10-14	A	A
9	Assemble topcollar and undercollar.					
	Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists gathers, puckers, pleats, or raw edges (top and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The eyelets shall be well worked with the purling on the outside of the collar and shall finish with a 1/8-inch diameter opening.					
	a. Position topcollar between undercollar and interlining with the upper edge abutting the undercollar interlining seam. Join topcollar to interlining, properly distributing the fullness between the notches with 3/16 to 1/4-inch lap seam.	301	LSa-1	6-8	A	A
	b. Fell topcollar to undercollar at top edge with zig-zag stitching to	301	LSa-1	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Assemble topcollar and undercollar. (cont'd) extend to approximately 3/4-inch from each side edge of the collar. c. Turn the topcollar to the outside over the upper edge of the interlining and baste along the upper edge and along the breakline with the fullness placed between the two rows of basting stitches. The basting shall extend to approximately 1 1/2-inches from the side edges. d. Trim and turn the side edges of the topcollar 3/8 -inch over the interlining between the undercollar and the interlining and baste the edges, forming the points at the upper corners of the collar. e. Fell the points at the upper corners of the collar and continue to fell topcollar to the undercollar along each side. f. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat, and uniformly even.	101 or Hand Hand or Machine Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Assemble topcollar and undercollar. (cont'd)					
	g. Trim the lower edge of the topcollar to provide for proper seaming to the jacket, and cut a guide notch in the lower edge of the topcollar at the center.					
	h. Make one eyelet at each end of the collar 1 inch from the side and upper edge, respectively. The eyelets shall be well worked with the purling on the outside of the collar, and shall finish with an 1/8-inch diameter opening.	Eyelet		22 per eyelet (minimum)	A (Silk)	A
10	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of undersleeve and with the notches in the lower forearm edge of top and undersleeves matching. Seam top and undersleeve together 3/8-inch from forearm edge of top sleeve, forming a tapered outlet on the undersleeve.	301	SSbd-1 and SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Seam sleeves at forearm. (cont'd)					
	b. Spread open the seam and press flat, holding seam short, with a heated pressing iron.					
11	Join cuffs to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs uniformly stitched to sleeves. The point of the cuff shall be centered between the lower front creased edge and the creased backarm seam of sleeve.					
	a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8-inch from the raw edges. Turn cuff completely, working out the point.	301	SSa-1	12-16	A	A
	b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern, and press smooth and flat with a heated pressing iron or pressing machine, creasing the edge.					
	c. In lieu of pressing, the turn under at the upper edge of cuffs, they may be basted.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11	Join cuffs to sleeve. (cont'd)					
	d. Mark the sleeve in accordance with the sleeve cuff marker for positioning the cuffs, with notch matching the forearm seam line and with the lower raw edge of the sleeve and marker even.					
	e. Position the cuffs at the mark on the sleeve and seam uniformly 1/8-inch from the upper folded edge of cuff.	301	LSd-1	12-16	A (Silk)	A
12	Seam sleeve at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top sleeve to the undersleeve at the backarm with a 3/8-inch seam, catching the ends of the cuff in the seam.	301	SSa-1	12-16	A	A
	b. Spread open the sleeve and cuff seams and press flat with a heated pressing iron.					
13	Tack cuff to sleeve.					
	a. Turn the cuff outlet to the inside in accordance with notches, against the bottom end of the sleeve, and baste	Hand or 101				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Tack cuff to sleeve. (cont'd) along the turned edge of cuff.					
	b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching.	103	SSm-1	4-6	A	
	c. On the finished jacket, the length of the cuff shall be 3-1/4 ±1/4 inches at the front and back creased edges and 6 ± 1/4 inches at the point.					
14	Seam sleeve linings. Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position top sleeve lining with upper forearm edge in line with the notch in the armhole edge of upper sleeve lining and with the lining at lower forearm edge of top and undersleeve linings even. Seam the top and undersleeves linings together 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the undersleeve lining.	301	SSbd-1 and SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Assemble sleeve and sleeve lining. Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers, or pleats. a. Position the sleeve lining on the sleeve with the upper edge of lining extending 3/4 to 1 inch beyond the armhole edge of sleeve. b. Seam or tack lining to sleeve backarm and forearm seam allowance, respectively commencing approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches below armhole edge at the backarm and approximately 4-1/2 inches below armhole edge at the forearm.	301	SSa-1	6-8 1 to 1-1/2 inches in length	A	A
16	Fell turnup of sleeve lining; press sleeves. Finished appearance. The sleeve linings shall not be short, tight, or twisted at bottom of sleeves, and shall extend to within 1 to 1-1/4 inches from finished end of sleeve. The sleeves shall be properly pressed.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Fell turnup of sleeve lining; press sleeves. (cont'd)					
	a. Pull sleeves through lining and turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished end of the sleeve, and baste to turnup of cuff. The sleeve lining may be felled to bottom of sleeve without basting.	Hand or 101				
	b. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching.	301 or Hand	EFc-1 (b)	6-8 8-10	O (Silk) C (Silk)	O
	c. Turn sleeves and assemble in pairs. The sleeves may be pressed prior to setting. The backarm crease shall be on the backarm seam.					
17	Stitch waist darts and make pleat in front lining.					
	Finished appearance. The waist dart shall be tapered to a point at upper end and shall finish without gathers, puckers, or pleats.					
	a. Fold the front lining with the cut edge of the waist dart even and stitch the entire length of dart 3/8 inch from the cut edges at lower end and	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Stitch waist darts and make pleat in front lining. (cont'd)					
	tapering to a point at the upper end of dart, securely backtacking the pointed end.					
	b. Fold the front lining in accordance with the notches on the pattern to form a 3/4 inch wide pleat at the side. Seam across the top and bottom edges respectively, 1/8 to 1/4 inch from each end.	301	SSa-1	10-14	A	A
	c. Press the pleat smooth and flat from the top to the bottom edges of the front lining with a heated pressing iron. The folded edge of the pleat on the outside of the lining shall be towards the back.					
18	Seam wool facing to front lining; sew on label.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished jacket, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Seam wool facing to front lining; sew on label. (cont'd)					
	a. Position the lining on the wool facing with notches matching and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top edge of facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	10-14	A	A
	b. Sew the identification label to the right front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned with one end even with the facing-lining seam and the lower edge approximately 9 inches above the finished bottom edge of the jacket.	201	SSa-1	10-14 (each edge)	A	A
19	Assemble body lining.					
	Finished appearance. Front, side back, and back lining shall be uniformly stitched and the lining shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edge. Seams shall start and finish evenly at the line of stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
19	Assemble body lining. (cont'd)					
	a. Position the back lining with back edges even and upper notches matching. Seam together from the upper notches for a distance of approximately 2 inches, and from that point seam horizontally to 3/8 inch from the back edge and continue seaming to the bottom end of lining.	301	SSa-1	10-14	A	A
	b. Respectively position and join the left and right side backs to the back parts with a 3/8 inch seam and with notches matching.	301	SSa-1	10-14 (each seam)	A	A
	c. Position the side back and front linings and join together at the sides with a 3/8 inch seam.	301	SSa-1	10-14	A	A
20	Press lining seams, darts, and center back pleat.					
	a. Press the dart, and lining side seam smooth and flat toward the back.					
	b. Press the left and right side back seams smooth and flat toward the back.					
	c. Press the back pleat smooth and flat from top to bottom edge. The folded edge of pleat on					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Press lining seams, darts, and center back pleat. (cont'd) the outside of lining shall be toward the left side as worn.					
21	Hem bottom lining (for removable buttons).					
	a. Hem the bottom edge of the front lining with the raw edge turned under and caught in the stitching 1/16 inch from the folded upper edge of the hem. Continue the stitching at each side end of the hem. The hem shall start from the seam line of the facing and lining and shall extend 4-1/2 to 4-3/4 inches long. The hem shall be 3/4 ± 1/4 inches wide.	301	EFb-1 and SSa-1 (each end)	10-14	A	A
22	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester twill reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats.					
	a. Seam the 3/4 inch wide stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Seam reinforcement stay to armhole and shoulder. (cont'd) top end of the armhole stay and the lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
23	Assemble fronts. Finished appearance. Front and side front shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or raw edges. Seams shall start and finish evenly at the line of stitching. The waist darts in the fronts shall be tapered to a point at upper end.					
	a. Fold the front, matching the cut edges of the waist dart and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point at the upper end, securely backtacking the pointed end.	301	SSa-1	10-14	A	A
	b. Position the front and side fronts with edges even and join together with a 3/4 inch seam.	301	SSa-1	10-14	A	A
	c. Press open the dart seam and side front joining seams smooth and					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23	Assemble fronts. (cont'd)					
	flat with a heated pressing iron or pressing machine.					
24	Interline fronts.					
	a. Position the left and right fronts in the respective jacket front interlining and baste along the center front, distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.	Hopper or Hand				
	b. Baste the fronts horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness towards the armhole. Baste along the front of armhole approximately 1-1/2 inches from the edge, and continue the basting down the back edge of interlining to approximately 1-1/2 inches from bottom edge of fronts.	Hopper or Hand				
	c. Baste along the breakline of lapel, starting from the top edge of gorge, down to the lower end of lapel. From this point, continue to baste along the front edge	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Interline fronts. (cont'd)					
	of jacket to approximately 1-1/2 inches from the bottom edge.					
	d. Baste from the top and front edge of lapel down to the lower end of lapel.	Hopper or Hand				
25	Baste bridle tape to lapel.					
	a. Position the 3/8 inch bridle tape adjacent to and behind the breakline from gorge to 3-1/2 to 4 inches from lower end of lapel.					
	b. Baste the tape evenly and smoothly for a distance of 1-1/2 to 2 inches down from the gorge; continue basting for a distance of 4 to 5 inches, holding the tape taut and working in 3/8 to 1/2 inch breast fullness. Baste the remainder of the tape evenly, smoothly, and without tension or fullness. Tape and interlining shall be stamp marked to assure proper fullness.	301			Commercial	
26	Pad lapels.					
	a. Pad each lapel from approximately 1 inch from the front edge to the breakline with six rows of blindstitching, properly	103 or 306	SSm-6	4-8	A A	A A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Pad lapels. (cont'd)					
	distributing the fullness in the interlining between the rows of stitches to roll the lapels.					
	b. Blindstitch both edges of bridle tape to interlining.	103 or 306	SSm-2	4-8	A A	A A
27	Shape fronts.					
	a. Mark and shape the front edges of the fronts; mark and shape the lapels in accordance with the shaper furnished.					
	b. Trim the jacket front interlining 1/4 to 3/8 inch back from the front edge of the fronts and top and front edge of the lapel; trim the bottom edge of the interlining.					
28	Make eyelets in fronts.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of fronts, and shall finish with a 1/8 inch diameter opening.					
	a. Mark location of eyelets, on right and left fronts, for removable insignia buttons in accordance with the front eyelet marker.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Make eyelets in front. (cont'd)					
	b. Make one eyelet at each mark through front and interlining.	Eyelet		22 per eyelet (minimum)	A (Silk)	A
29	Join backparts.					
	Finished appearance. The back and side backs shall be carefully joined without twists, gathers, puckers, or pleats. Seams shall start and finish evenly.					
	a. Position the backs with edges even and notches matching and join at the center with 5/8 inch seam.	301	SSa-1	10-14	A	A
	b. Position the back on the respective side backs with edges even and notches matching and join together with a 3/8 inch seam.	301	SSa-1	10-14	A	A
30	Join fronts and back at sides.					
	Finished appearance. The fronts and back shall be completely joined at the sides, and the seam shall finish smooth and flat without twists, puckers, pleats, or other distortions. The seam shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Join fronts and back at sides. (cont'd)					
	a. Position the side back and side fronts even and join together at the side with a 3/8 inch seam.	301	SSa-1	10-14	A	A
31	Press seams.					
	Finished appearance. Seams shall be pressed smooth and flat with a heated pressing iron or pressing machine of a type suitable to obtain the desired appearance.					
	a. Spread open side and back seams and press flat with a heated pressing iron.					
	b. Mark the jacket for bottom turnup 1-1/4 inches from the bottom raw edge. The shape of the finished bottom shall be in accordance with the shape of the pattern.					
32	Stitch center back point.					
	Finished appearance. Center back point shall be stitched to allow a uniform point to be located at the end of the center back.					
	a. Fold the center back face-to-face at the center seam and stitch together on a 45 degree angle from the bottom raw edge up to	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Stitch center back point. (cont'd) the finished bottom turnup. Turn to the inside, working out the point.					
33	Tape armholes.					
	a. Sew 1/4 inch wide tape around the armhole from a point 1 to 1-1/2 inches above notch on the fronts to 3/4 to 1 inch from shoulder edge on the back.	301 or 401	SSaa-1	10-14	A	A
	b. From the front notch to approximately 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness.	301 or 401	SSaa-1	10-14	A	A
34	Press armholes, shoulder blades and lapels. a. Press the armhole tapes, the shoulder blades and the lapels smooth and flat with a heated pressing iron or suitable type pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Baste facing lining assemblies to fronts.					
	a. Position facing lining assembly on outside of jacket and baste along the breakline, distributing the fullness in the breast area, and continue the basting along the front and bottom edge. Baste from the top and front edge of lapel down to the lower end of lapel, working the fullness toward the center of the lapel.	Hopper or Hand				
36	Join facings and fronts with tape.					
	a. Join the facing and fronts together 3/16 inch from the top and front edges of lapel and front and bottom edge of jacket, with the 3/8 inch wide stay tape positioned on the interlining side of fronts 1/8 inch from the edges and caught in the stitching.	301	SSab-1	10-14	A	A
	b. The tape shall extend from 1/2 inch back of the lapel notch to the bottom edge of the jacket and along the bottom edge, the width of the facings. The tape shall be sewn with normal tension along the top and front edges of lapel, and with slight tension along the front and bottom edge of jacket.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Join facings and fronts with tape. (cont'd)					
	c. Fell the back edge of the 3/8 inch wide stay tape to jacket front interlining, from the lapel notch to the end of the tape at the bottom edge.	103	SSm-1	4-6	A	
	d. Remove all basting stitches and trim lower front corner and bottom edge of facings and corner of lapels; notch the lapels for proper turning.					
	e. Spread open the front facing seam from lapel notch to the bottom edge of jacket and press front and bottom edges of jacket smooth and flat with a heated pressing iron or pressing machine.					
37	Baste fronts and bottom edge of jacket.					
	a. Turn the facing lining assemblies to the inside of the fronts and work out completely the corners of lapel. Turn up the bottom of jacket at the mark lapping the facing on the turnup and working out the front corners completely.					
	b. Baste along the top and front edge of lapels and the front and the bottom turnup of the jacket, forming the bottom	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37	Baste fronts and bottom edge of jacket. (cont'd)					
	curve and center back point in accordance with the mark on the pattern.					
38	Fell bottom turnup.					
	a. Fell the raw edge of the bottom turnup to the fronts and back with blindstitching.	Hand or Machine				
39	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from top and front edge of lapel and front and bottom edge of facing, holding the lower corner of the jacket in such a manner as to cause the lower front edge to roll inward.	Hopper or Hand				
	b. Baste along breakline of lapel, placing the proper fullness at the center of the lapel.	Hopper or Hand				
	c. Baste lapel diagonally from the corner to the breakline, properly placing the fullness to allow the lapel to roll.	Hopper or Hand				
	d. Baste the facings to the fronts as close as possible to the facing-lining seam, placing the proper fullness over the chest. The basting shall	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Baste facing (second time). (cont'd)					
	extend from approximately 1-1/2 inches from the bottom edge of the jacket to approximately 3 inches from the shoulder edge of facings.					
40	Tack facings to interlining.					
	a. Raise the lining and tack the back edge of the facings to the jacket front interlining, starting approximately 2 inches from the bottom edge of jacket and tacking to approximately 2-1/2 inches from the shoulder edge of interlining. Tacking shall be through seam allowance of facing and lining.	301 or 103 or Hand	SSm-1 SSm-1 	4-6 4-6 4-6	A A C (Silk)	A
41	Baste body lining to jacket.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat and baste along the entire length of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hopper or Hand				
	b. Baste the front lining to the jacket, starting at the lower end of chest pleat and basting along the lower edge of armhole,	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Baste body lining to jacket. (cont'd)					
	approximately 2 inches from the edge to the side seam. Match all seams of jacket and lining and continue basting, as close as possible to the side seam, to approximately 4 inches from bottom finished edge of jacket, and from that point, baste horizontally to approximately the center of the front lining.					
	c. Fold the back lining at the center seam forming a 3/4 inch wide pleat and baste lining to back part from top end of pleat to approximately 4 inches from bottom finished edge of jacket. The folded edge of the pleat on the outside of the lining shall be towards the left side when worn.	Hopper or Hand				
	d. Baste lining to back parts, starting at side seam and baste along armhole and shoulder edges to approximately 2 inches from top end of center back pleat, allowing room at the shoulder for setting of shoulder pads.	Hopper or Hand				
	e. Turn under bottom edge of lining forming the bottom curve and center back point, and baste lining to jacket, catching	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Baste body lining to jacket. (cont'd) the turned under portion in the basting and with the folded edge of the lining approximately 3/8 to 1/2 inch above bottom finished edge of jacket. f. The fullness shall be distributed throughout the lining.					
42	Fell lining to bottom turnup. a. Fell the turned under portion of the lining to the bottom turnup of the jacket with blindstitching 1/4 to 3/8 inch from bottom folded edge of lining. Only the under-ply of the folded bottom edge of lining shall be caught in the blindstitching. The hemmed bottom edge of the lining shall be left open.	301	EFc-1 (b)	6-8	O (Silk)	O
43	Baste shoulder pad to jacket. a. Insert shoulder pad between lining and front interlining in line with armhole edge and tack the pad through the interlining along the curved and straight edge of pad.	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Seam shoulders. Finished appearance. The shoulder seam shall be evenly gaged when stitched; the fullness on the backs shall be eased in so that the seam line in the finished jacket curves slightly toward the front at the armhole end and the front shoulder is not stretched.					
	a. Join the fronts and back together at shoulders with a 3/8 inch seam, matching the front and back seam line.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
45	Set shoulder straps. Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the jacket without twists, puckers, pleats, or other distortion.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45	Set shoulder straps. (cont'd)					
	a. Position each shoulder strap with the rounded end of the strap even with the edge of the neck, and with the back edge of the strap 1/4 to 3/8 inch back of the shoulder seam at the armhole edge.					
	b. Seam each shoulder strap to the jacket 1/8 to 1/4 inch from the armhole edge. Trim the shoulder strap even with the armhole where necessary.	301	SSa-1	10-14	A	A
46	Baste shoulders and insert eyelet cover.					
	a. Position shoulder interlining and lining in place, and baste the upper part of each shoulder on the outside, then turn the jacket on the inside.	Hopper or Hand				
	b. Insert eyelet cover between front and back lining at the shoulder, with one raw edge aligned with the facing-lining seam line. Turn under the raw back edge of lining at the shoulders, baste the upper part of each shoulder over the front lining catching the eyelet cover in the basting and continue to baste across the neck at back.	Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
47	Stitch hanger and label to jacket.					
	a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of the jacket at the neck.	301	SSa-1	10-14	A	A
	b. The hanger opening in the finished jacket shall be 2-1/8 inches when measured along the lower edge of the collar.					
48	Set collar.					
	Finished appearance. The collar shall finish centered on the back seam with the fullness distributed over the shoulders to conform to and hug the neck.					
	a. Mark the jacket around the neck from shoulder seam to shoulder seam 5/8 inch from top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
	b. Join the top collar to the facing at the gorge from the lapel notch to a point not less than 1 inch in back of the lapel breakline.	301	SSa-1	12-16	A	A
	c. Notch the facing at the end of joining seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49	Tack top collar to fronts at gorge.					
	a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge from the lapel notch to the end of the seam, catching the top end of the bridle tape in the tacking.	Hand or 301	SSa-1	2-4 12-16	C (Silk) A	A
50	Baste undercollar to jacket.					
	Finished appearance. The center seam of the undercollar shall be in line with center back seam of jacket. Fullness in the collar shall be properly placed over the shoulders to permit the collar to lie flat.					
	a. Turn the collar to the outside with the lower neck of the undercollar lapped on the outside of the jacket at the mark.					
	b. Securely tack the corners of the collar across the juncture point of the collar and the lapel.	Hand		8-10	C (Silk)	
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand or Machine				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50	Baste undercollar to jacket. (cont'd)					
	d. In the finished jacket, the ends of lapel and collar shall be 2-3/8 and 1-5/8 inches respectively when measured from the tacked corner to the finished edges of the lapel and the collar.					
51	Tack collar interlining to jacket.					
	a. Raise the lower edge of the top collar and tack the collar interlining to upper edge of the jacket lining with overcast stitching, from shoulder seam to shoulder seam.	Hand or 103		2-3	C (Silk)	
		or	SSm-1	3-4	A	
		301	SSm-1	3-4	A	A
52	Baste top collar to jacket.					
	a. Turn under the lower edge of the top collar and baste across neck.	Hand or 301				
53	Edgestitch jacket and collar.					
	Finished appearance. The jacket shall be uniformly edgestitched.					
	a. Stitch the side and top edges of collar, top and front edge of the lapels, front edges of the jacket, and continue the stitching along the bottom edge of the jacket the width of facings.	301	SSb-1 (collar) SSe-2 (lapels)	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Edgestitch jacket and collar. (cont'd) b. The stitching shall be uniformly 1/8-inch from the edge.					
54	Set sleeves. Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole sleeve seam shall finish smooth and flat without twists, puckers, or pleats. The armhole shall not be stretched or distorted due to pressing. a. Position sleeves on outside of jacket at the armholes, with backarm seam of sleeve matching the side back seam and with notch in top sleeve and fronts matching.					
	b. Join the sleeves to the jacket with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching.	301	SSa-1	12-16	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness. Spread open the upper part of the armhole					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
54	Set sleeves. (cont'd)					
	sleeve seam from backarm sleeve seam to approximately midway between shoulder seam and notch at front edge of armhole; press smooth and flat with heated pressing iron. Care shall be exercised in pressing armhole seam in order not to stretch the armhole. Shoulder strap shall remain smooth and flat.					
55	Baste armhole.					
	a. Baste around inside armhole, positioning linings, shoulder pad, and front lining in place and distributing the fullness evenly. Turn the jacket on the outside.	301 or Hand				
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeves to the front notch of the jacket.	301 or Hand				
56	Tack armhole and stitch sleeve head pads.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
56	Tack armhole and stitch sleeve head pads. (cont'd) a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw armhole seam, and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad from end-to-end to the sleeve through the armhole sleeve seam allowance 1/8 inch from the folded edge of the pad, catching the front and back part linings and shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
57	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, and correctly positioned. The stitching shall be securely caught in the basic material. The buttonholes shall be well worked over gimp to fit a 27-line insignia button. The ends of the gimp shall be pulled through to the underside of buttonholes and the ends of all					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
57	Make buttonholes. (cont'd)					
	buttonholes securely bartacked. The purling of the buttonhole shall be on the outside of fronts.					
	a. Mark the left and right fronts for the location of one buttonhole on each front.					
	b. Make a horizontal, eyelet-end, square-bar type buttonhole, cut 3/4 inch long, at each of the marks with the inside edge of the eyelet 5/8 inch from the front edge of the jacket.	Buttonhole		38 per button-hole (minimum)	B (Silk)	B
	c. Securely bartack the end of each buttonhole, and trim the ends of the gimp.	Bartack		21 per bartack (minimum)	A (Silk)	A
58	Fell collar to jacket.					
	a. Fell the lower edge of the entire length of undercollar to the fronts and back.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of the topcollar to the jacket from gorge seam to gorge seam, catching the top edge of the size label and the ends of the jacket hanger in the stitching.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Fell linings.					
	a. Position the sleeve linings at the armhole with back and forearm seams of sleeves and linings matched. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back part linings at the armhole. Fell the sleeve lining to the jacket around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness in accordance with good commercial practice and backstitching the lower armhole edge from approximately 1-1/2 inches to the front of forearm sleeve lining seam to the side seam of body lining.	Hand		8-10	C	
	b. Tack the lower front corner of the front lining to the facing and bottom turnup of the jacket for a distance of approximately 1/2 inch along the front bottom edges, respectively, of the lining.	Hand		8-10	C (Silk)	
	c. Fell the back lining and facing lining assembly together at the shoulder, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Fell linings. (cont'd) and eyelet cover in the felling					
60	Make eyelet in shoulder. Finished appearance. The eyelets shall be worked with the purlings on the outside of the shoulder, and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark location of eyelet in shoulder for removable button to correspond with eyelet of buttonhole in shoulder straps, so that on the finished jacket, the straps shall lie smooth and flat without twisting and bulging.					
	b. Make one eyelet at the mark on each shoulder. The eyelet shall be through all plies.	Eyelet		22 per eyelet (minimum)	A (Silk)	A
61	Fell shoulder eyelet covers (see Figure 3). a. Fell the eyelet cover along the facing-lining seamline from the bottom edge up to the shoulder line.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
62	Clean jacket. a. Pull and remove all basting threads. Trim all ends of stitching and remove all loose ends of threads from the jacket. Remove all spots, stains, and shade tickets and markings without injury to the material.					
63	Press jacket. Finished appearance. The jacket shall be well pressed throughout with heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing procedures. a. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat. b. Press armhole solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of armhole shall be held short while pressing. c. Block armholes on pressing buck, shrinking in the top sleeves.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Press jacket. (cont'd) d. Press the sleeves smooth and flat, creasing at backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 3 to 3-1/2 inches below the armhole. e. Press the lapels smooth and flat from the breakline to the front edge, straightening the edges and working the fullness towards the center of the lapel; remove the fullness by shrinking. f. Press the collar at the center back, creasing on the breakline the length of the collar and continuing to approximately 2 inches below the top edge of the lapels. g. Press the fronts smooth and flat on a body machine, straightening the front edges of the jacket. Care shall be exercised in pressing the fronts so that the bottom edges are even. h. Press bottom edge of jacket smooth and flat. i. Press the sides, working the fullness					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Press jacket. (cont'd) towards the back. j. Press the back smooth and flat, removing all fullness. k. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps. l. Press pleat in upper front lining and center back lining smooth and flat. m. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.					
64	Attach buttons (when required). a. When insignia buttons are required for the shoulders and fronts of the jackets, they shall be attached by inserting the shank of the button through the eyelet on the shoulders and fronts and securing on the inside with metal ring toggles. b. When insignia buttons are required for front closure, they shall be attached to the jacket with the multiple link chain on the inside of jacket and button through each buttonhole to the outside.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished jacket shall conform to the measurements shown in Table II.

Table II. Jacket Measurements 1/

Size	Breast 2/	Back Length 3/	Sleeve Length 4/
		Short	
36	20-1/2	20	17
38	21-1/2	20-1/4	17
40	22-1/2	20-1/2	17
42	23-1/2	20-3/4	17
44	24-1/2	21	17
		Regular	
36	20-1/2	21	18
38	21-1/2	21-1/4	18
40	22-1/2	21-1/2	18
42	23-1/2	21-3/4	18
44	24-1/2	22	18
46	25-1/2	22-1/4	18
		Long	
36	20-1/2	22	19
38	21-1/2	22-1/4	19
40	22-1/2	22-1/2	19
42	23-1/2	22-3/4	19
44	24-1/2	23	19
46	25-1/2	23-1/4	19
		Extra Long	
36	20-1/2	23-1/2	20
38	21-1/2	23-3/4	20
40	22-1/2	24	20
42	23-1/2	24-1/4	20
44	24-1/2	24-1/2	20

1/ Tolerance on all measurements: ± 1/2 inch.

2/ Breast measurement shall be taken from the front edge to the center back seam in line with armpit and with the jacket lying open and flat.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

3/ Back length measurement shall be taken along center back seam from lower edge of undercollar to bottom edge of jacket.

4/ Sleeve length measurement shall be taken along underarm seam from pit of armhole to bottom edge of cuff.

3.8 Workmanship. The finished jackets shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in this specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4)
b. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

4.4 First article inspection. When a first article is required (see 3.1 and 6.2), it shall be examined for the defects specified in 4.5.3.1, 4.5.3.2, 4.5.3.3 and 4.5.3.4. The presence of any defect may be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer.

4.5 Quality conformance inspection.

4.5.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected and tested in accordance with all the requirements of referenced specifications, drawings, and standards, unless otherwise excluded, amended, modified, or qualified in this specification or applicable purchase documents. The method of testing shall be as specified in FED-STD-191, wherever applicable. All test reports shall contain the individual values used in expressing the final result. The lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size and sample size shall be in accordance with the following:

Lot Size (lot unit)	Sample Size (sample unit)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

4.5.2 In-process inspection. Inspection shall be made at any point or during any phase of the manufacturing process to determine whether operations or assemblies are accomplished as specified herein. The Government reserves the right to exclude from consideration for acceptance any material for which in-process inspection has indicated nonconformance.

4.5.3 Examination of the end item. The defects found during examination shall be classified in accordance with the list shown in 4.5.3.1 through 4.5.3.4. The sample unit for these examinations shall be one completely fabricated jacket.

4.5.3.1 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes and eyelets (construction)	a. One or more omitted or added.	101		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes and eyelets (construction) (cont'd)	b. Wrong type buttonhole or eyelet.	102		
	c. Buttonhole or eyelet not securely caught on fabric causing stitching to pull away from fabric.	103		
	d. Not corresponding to size of button (front and shoulder straps) - too small, not permitting button to enter buttonhole.	104		
	- too large, 3/16-inch or more longer than the diameter of button (measured at inside edge of purling).		201	
	e. Bartack omitted or loose on one or more buttonholes: - front buttonholes.	105		
	- shoulder straps.	106		
	f. Bartack misplaced: - on 1 buttonhole.			301
	- 2 or more buttonholes.		202	
	g. One or more broken stitches in: - 1 buttonhole.		203	
	- 2 or more buttonholes.	107		
	- 1 eyelet.		204	
	- 2 or more eyelets.	108		
	h. More than 2 skipped stitches in one or more buttonholes or eyelets: - front buttonholes.		205	
	- shoulder strap buttonholes.			302
	- one eyelet.			303
	- two or more eyelets.		206	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes and eyelets (construction) (cont'd)	i. Gimp omitted in one or more buttonholes.			304
	j. Ragged edges, affecting appearance.			305
	k. Poorly made, affecting appearance (unless otherwise classified).		207	
	l. Ends of gimp not pulled through on the underside on one or more buttonholes.			306
	m. Stitches per buttonhole, on front and shoulder straps excluding bartack, less than minimum specified:			
	- one or two stitches.			307
	- three stitches.		208	
	- four or more stitches.	109		
	n. Any uncut buttonhole.		209	
	o. Constructed with purling on reverse side.		210	
Button or ring toggles (when required)	a. Missing, loose or defective:			
	- 1 button or ring toggle.			308
	- 2 or more buttons or ring toggles.		211	
	b. Not specified type or size.			309

NOTE: Buttons shall be considered defective if they have sharp, rough or cracked edges: scratches, blemishes or embeded foreign matter on face side of button, loose shanks; or badly shaded.

Cleanness	a. One or more removable spots or stains clearly noticeable.		212	
	b. One or more spots or stains of an obvious permanent nature.	110		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Cleanness (cont'd)	c. Thread ends not trimmed, loose thread ends, 2 or more shade markings, or bastings not removed throughout garment (to be scored when the condition exists on major portion of jacket).			310
Components and assembly	a. Any defective component or defect of assembly (not herein classified).	111		
	b. Any component part or required operation omitted (not herein classified).	112		
Cutting	a. Any component part of basic material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	113		
Material defects and damages	a. Any weakening defect such as smash, multiple float, loose slub, etc., that may develop into a hole.	114		
	b. Any hole.	115		
	c. Shade bars, unsightly slubs, etc.	116		
	d. Needle chews which may develop into a hole.	117		
	e. Scissors or knife cut, tear, mend, or burn.	118		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or non-weakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Material defect Workmanship damages	- No defect - Minor B defect			
Pressing	a. Burned or scorched.	119		
	b. Pressing omitted, (entire garment).	120		
	c. Poorly pressed (unless otherwise classified).		213	
	d. Basting or pressing impressions not removed on major portion of jacket.			311
	e. Armholes not blocked or blocked poorly.		214	
	f. Inside of armholes not pressed solid.		215	
	g. Edges bulky, i.e., not pressed solid, affecting appearance.			312
	h. Sleeves not creased as required on forearm and backarm seams.		216	
Seams and stitching	a. Accuracy of seaming.			
	(1) Seams twisted, puckered, or pleated, affecting appearance (unless otherwise classified).		217	
	(2) Part of garment caught in any related operation or stitching.		218	
	(3) Unsightly blindstitching exposed and visible on outside of jacket, affecting appearance.		219	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	(4) Thread breaks or ends of all stitching (when not caught in other seams or stitching) not securely backstitched.		220	
	(5) Wrong shade or 2 shades of thread used on out side of same jacket.		221	
	b. Gage of stitching (edge or top stitching).			
	(1) Irregular, i.e., unevenly gaged or various stitching not uniform, affecting appearance.		222	
	(2) Beyond range of width specified or varies more than 1/16-inch when no range is specified.			313
	c. Open seams.			
	(1) On outside: - up to 1/4-inch inclusive.			314
	- more than 1/4-inch but not more than 1/2-inch.		223	
	- more than 1/2-inch.	121		
	(2) On inside: - up to 1-inch machine felling.			315
	- more than 1-inch machine felling.		224	
	(3) Edge or raise stitching sewn too close to edge, resulting in damage to cloth.	122		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	d. Raw edge:			
	(1) On outside:			
	- up to 1/8-inch inclusive.		225	
	- more than 1/8-inch but not more than 1/4-inch.			316
	- more than 1/4-inch.	123		
	(2) On inside:			
	- more than 1/4-inch but not more than 1/2-inch.			317
	- more than 1/2-inch.		226	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under, or over, and stitched.

	e. Run-offs (see classification of open seams).			
	f. Seam and stitch type:			
	(1) Wrong seam type.			318
	(2) Wrong stitch type.			319
	g. Stitch tension.			
	(1) Loose tension, resulting in loose seam.	124		
	(2) Loose tension on edge or raised stitching, resulting in loosely exposed bobbin thread or top thread.		227	
	(3) Tight tension (stitches break when normal strain is applied to seam or stitching).	125		

NOTE: Puckering is evidence of tight tension. When puckering is evident the inspector shall test seam by exerting normal pull in the lengthwise direction of seam or stitching.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	h. Stitches per inch (including labels) less than minimum specified: - 1 or two stitches. - 3 stitches. - 4 or more stitches.	 126	 228	 320
	NOTE: To be scored only when condition exist on major portion of seam.			
	i. Stitches skipped or broken (on edge or top stitching when seam is seamed, turned, and stitched). (1) More than 1/4-inch but not more than 3/4-inch. (2) More than 3/4-inch.	 	 229	 321
Shaded parts	a. Any outside part shaded, affecting appearance.	127		

4.5.3.3 Detailed defects (inside of jacket). Detailed defects applicable to inside of jacket shall be classified as follows:

Alignment and position of buttonholes and eyelets	a. Buttonhole on left front not in same horizontal position as buttonhole on right front by more than 1/4-inch.	128		
	b. Any eyelet on left front not in same position as corresponding eyelet on right front by more than 1/4-inch.	129		
	c. Position of front buttonhole from front edge 5/8-inches ± 1/8 inch.	130		
Link buttons (when required)	Omitted.	131		
Length of front	Unbuttoned fronts unequal in length by more than 3/16-inch.	132		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	a. Short, i.e., causing puckers on back or fronts or pulling lapel breakline, causing fronts to roll out.		230	
	b. Long, i.e., setting away from neck or lapel, not rolling to within 2-inches of top front button or buttonhole.		231	
	c. Collar not properly set, causing decided curve or bulge on crease line at joining to gorge seam.		232	
	d. Tight at joining to gorge seam or across back, causing fullness on lapels or fullness or pleats across out side back.	133		
	e. Eyelets positioned from the outer edge or lower end of collar will be no more or no less than ± 3/16 inch.	134		
	f. Gorge seam.			
	(1) Not straight, affecting appearance.		233	
	(2) Gorge seam not spread open.		234	
	(3) Tacking on gorge seam omitted.		235	
	(4) Tacking on gorge seam insecure.			322
	(5) Tacking on corners of undercollar to lapel omitted or insecure.		236	
	g. Top collar.			
	(1) Crooked, affecting appearance.	135		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification: Major	Minor: A	Minor: B
Collar (construction and setting)	(2) Undercollar exposed along collar edge for distance of 3/8-inch or more, affecting appearance.		237	
	h. Top collar.			
	(1) Tight, i.e., causing edges to curl or bulging on undercollar.	136		
	(2) Twisted, i.e., having a diagonal twist.	137		
	(3) Full, i.e., having excessive puckers or fullness.	138		
	i. Undercollar.			
	(1) Interlining pleated or twisted, affecting smoothness of topcollar.	139		
	(2) Interlining tight or twisted, causing puckers on undercollar.			323
	(3) Tight at joining to fronts or back, causing puckers or pleats at neck of jacket.		238	
	(4) Undercollar stand less than 1-1/8-inches or more than 1-3/8-inches wide at center.		239	
Lapels	a. Lapel facings.			
	(1) Twisted, short, or tight, causing crooked edges, affecting appearance.	140		
	(2) Fullness or puckers, affecting appearance.		240	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Lapels (cont'd)	b. Lapel edges.			
	(1) Bulky, irregular, or not properly forced out, causing crooked edges, affecting appearance.		241	
	(2) Front part exposed on lapel edge, affecting appearance.		242	
	c. Bridle tape.			
	(1) Misplaced, not serving intended purpose.	141		
	(2) Tape partly on creased edge or on lapel side.	142		
	d. Collar and lapel.			
	(1) Ends of lapel less than 2-3/8-inches or more than 2-1/2-inches.		243	
	(2) Ends of collar less than 1-5/8-inches or more than 1-3/4-inches.		244	
	(3) Pointed ends poorly shaped or not of uniform shape, affecting appearance.		245	

NOTE: Measure from the tacked corners to the finished edge of lapel and collar.

Shoulder (construction)	Improperly joined or set, causing shoulders or back to twist.	143		
Shoulder pads	a. Not completely caught in armhole joining seam.		246	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.	144		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder straps	a. Misplaced so that it will not lie flat when buttoned, causing bulge or twist on strap, affecting appearance.	145		
	b. Eyelet on shoulder not aligned with buttonhole, causing bulge or twist on strap when buttoned or puckers on shoulder, affecting appearance.	146		
	c. Short, i.e., rounded area of strap not completely covered by collar.			324
	d. Long, i.e., rounded end extending beyond undercollar seam.		247	
	e. Misplaced so that shoulder seam is exposed (excepting rounded end).	147		
	f. Misplaced, i.e., one strap further forward or back from position of other strap, affecting appearance.	148		
	g. Upper side of strap full or twisted, affecting appearance.		248	
	h. Less than 2-1/4-inches or more than 2-1/2-inches wide at armhole, including piping.			325
	i. Less than 1-3/4-inches or more than 2-inches wide across center of buttonhole, including piping.			326
	j. Buttonhole 3/16-inch or more off center.		249	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder straps (cont'd)	k. Buttonhole finished with purling on the underside.	149		
	l. Rounded end of shoulder strap less than 1/4-inch or more than 3/8-inch from undercollar.			327
	m. Back edge of shoulder strap less than 3/8-inch or more than 5/8-inch from shoulder seam at armhole seam.		250	
	n. Buttons not uniformly set by more than 3/16-inch.		251	
Scarlet piping	a. Omitted.	150		
	b. Gathers, puckers, or pleats.	151		
	c. Irregular in width, affecting appearance.		252	
	d. Less than 1/8-inch or more than 3/16-inch wide.			328
Armholes (construction)	a. Badly stretched, affecting appearance.	152		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	153		
	c. Crooked seam, affecting appearance.	154		
	d. Tape stitching exposed and visible on outside surface.	155		
	e. Sleeve head pads not completely tacked to armholes or misplaced, not serving intended purpose.	156		
	f. One or both sleeve head pads omitted.	157		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Armholes (construction) (cont'd)	g. Armhole not tacked completely.		253	
Sleeves	a. Setting and hang of sleeves.			
	(1) Sleeve fullness misplaced, affecting appearance.	158		
	(2) Backarm seam of sleeve not matching side back seam by: - more than 3/16-inch.	159		
	(3) Hang of sleeves in opposite direction by more than 1-1/2-inches.	160		
	(4) Sleeve tight in armhole, affecting appearance.	161		
	b. Sleeve lining.			
	(1) Twisted, tight or short, causing bulge on outside of sleeve.	162		
	(2) Sleeve lining seams out of alignment more than 3/8-inch with sleeve seams.		254	
	(3) Tacking on one or both sleeve lining seams omitted or insecure.		255	
	c. Sleeve cuffs.			
	(1) Top edge on sleeve poorly shaped, affecting appearance.		256	
	(2) Height of pointed end on both sleeves varying in length by more than 1/4-inch.		257	
	(3) Sleeve puckered at joining of cuff, affecting appearance.	163		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	(4) Cuff puckered or twisted at joining to sleeve, affecting appearance.	164		
	(5) Ends of cuff staggered at backarm seam by:			
	- 1/8-inch or more but not more than 3/16 inch.		258	
	- more than 1/4 inch.	165		
	(6) Height of cuff at point on top sleeve:			
	- less than 5-3/4-inches or more than 6-1/4 inches.		259	
	- less than 5-1/2-inches or more than 6-1/2 inches.	166		
	(7) Height of cuff at back arm or front creased edges:			
	- less than 3-inches but not more than 2-3/4-inches or more than 3-1/2-inches but nor more than 3-3/4-inches.			329
	- less than 2-3/4-inches or more than 3-3/4-inches.		260	
	(8) Point of cuff not centered between the lower forearm creased edge and the creased backarm seam by more than 1/4-inch.		261	
Body	a. Fitting of body linings, tight, short or twisted, causing fullness or twist on outside of jacket, affecting appearance.	167		
	b. Fitting of front interlining:			
	(1) Tight, short, or twisted, causing fullness or twist on outside of jacket,			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body (cont'd)	affecting appearance.	168		
	(2) Too full, causing jacket front to have a wavy appearance.	169		
	c. Waist dart.			
	(1) One or both darts not properly tapered at top end, causing puckers, or pleats, affecting appearance.	170		
	(2) Upper end of dart not backtacked.		262	
	(3) Not pressed smooth and flat.		263	
Front edges	a. Front edges stretched, affecting appearance.	171		
	b. Bottom edge stretched, puckered or uneven, affecting appearance.	172		
	c. Fronts rolling outward below button.	173		
	d. Front edge irregular or not properly forced out, causing crooked or curved edges, affecting appearance.	174		
	e. Facing exposed on front edges affecting appearance (score only when clearly noticeable and the condition exists along major portion of seam).	175		
	f. Bottom corner of one or both fronts poorly shaped, affecting appearance.	176		
	g. Fronts uneven in length by more than 1/4-inch.	177		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Back side panels	a. Curved panel seam on back of jacket, stretched or distorted, affecting appearance.		264	
	b. Center point of bottom back poorly shaped, affecting appearance.	178		
Front facings	a. Short, tight or twisted, causing excessive fullness or twists on fronts.	179		
	b. Facing long, causing bottom corner to curl up.	180		

4.5.3.2 Detailed defects (outside of jacket). Detailed defects applicable to outside of jacket shall be classified as follows:

Size label	a. Missing, incorrect, illegible or not securely caught in stitching.		265	
Hanger	a. Omitted or 1 or both ends not securely stitched.		266	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of topcollar.			330
Identification label	a. Omitted.	181		
	b. Incorrect or illegible.		267	
	c. Not stitched on four sides.			331
	d. Bottom edge of label positioned less than 8-inches from finished bottom of jacket.			332
Body lining	a. Excessive puckering or pleating.			333

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body lining (cont'd)	b. Twisted, not affecting smoothness of outside surface.			334
	c. Pleat omitted at center back.		268	
	d. Shoulder pleat omitted.			335
	e. Lining exposed beyond bottom edge.	182		
	f. Felling on bottom corner of front lining to facing and bottom turning omitted.	183		
Lining side of armhole	a. Backstitching at armpit of armhole from 1-1/2-inches to front of forearm sleeve lining seam to side seam of body lining omitted.			336
Bottom hem and turnup	a. Hem twisted or irregular in width.			337
	b. Tacking on turnup to front omitted or insecure.		269	

4.5.3.4. Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.4. Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing, and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

Examine	Defects
Marking (exterior interior)	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.
Materials	Any component missing. Any component damaged, or affecting serviceability.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling. Bulging or distortion of containers.
Content	Number of jackets per shipping containers is more or less than required. Improper number of intermediate packages per container. For this defect, one intermediate package from each container in the sample be examined.

5. PACKAGING

5.1 Preservation. Preservation shall be in accordance with ASTM D 3951.

5.2 Packing. Jackets preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.3 Marking. Each container shall have, at a minimum, a paper label or stamped label on the exterior depicting the items contained therein, size and name of contractor.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The jackets described herein are intended for wear by staff noncommissioned officers of the U.S. Marine Corps.

6.2 Procurement requirements. Procurement documents should specify the following:

(a) Title, number, and date of this specification.
(b) Type, class, and sizes required (see 1.2).
(c) When first article is required and the number of units for the first article (see 3.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

6.3 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209 and the requirements of this specification. The sample(s) presented for inspection may be first articles, pre-production samples, first production or sample(s) taken from the first lot depending on the contractors history and will be as directed by the Contracting Officer. The Contracting Officer should include specific instructions in all acquisition instruments regarding arrangements for selection, inspection, and approval of the first article.

6.4 Standard samples and shade samples. For information regarding availability of standard samples and standard shades specified, address inquiry to the acquiring activity issuing the invitation for bids.

6.5 Subject term (keyword) listing.

Dress
Evening
Jacket
Man's
Noncommissioned
Officers
Staff

6.6 Figures. Figures are furnished for information purposes only. To the extent of any inconsistencies between the written specification and the figures, the written specification shall govern.

Preparing Activity
Navy - MC
Project No. 8405-N251

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

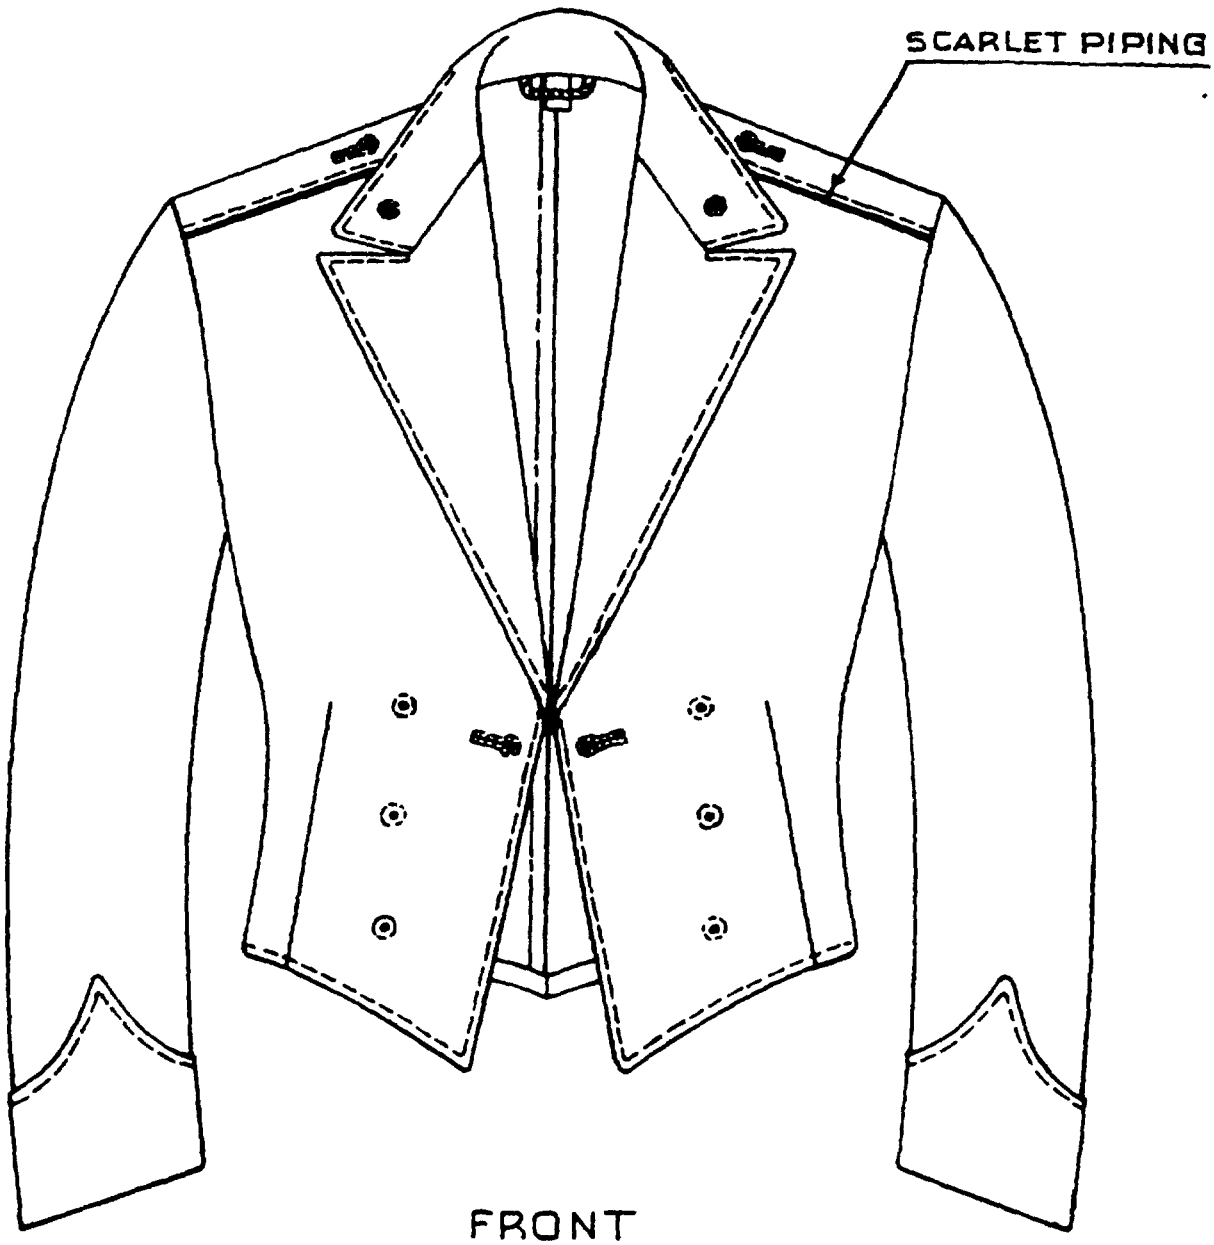


FIGURE 1. JACKET, MAN'S: EVENING DRESS; (STAFF, NON COMMISSIONED OFFICER'S)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.


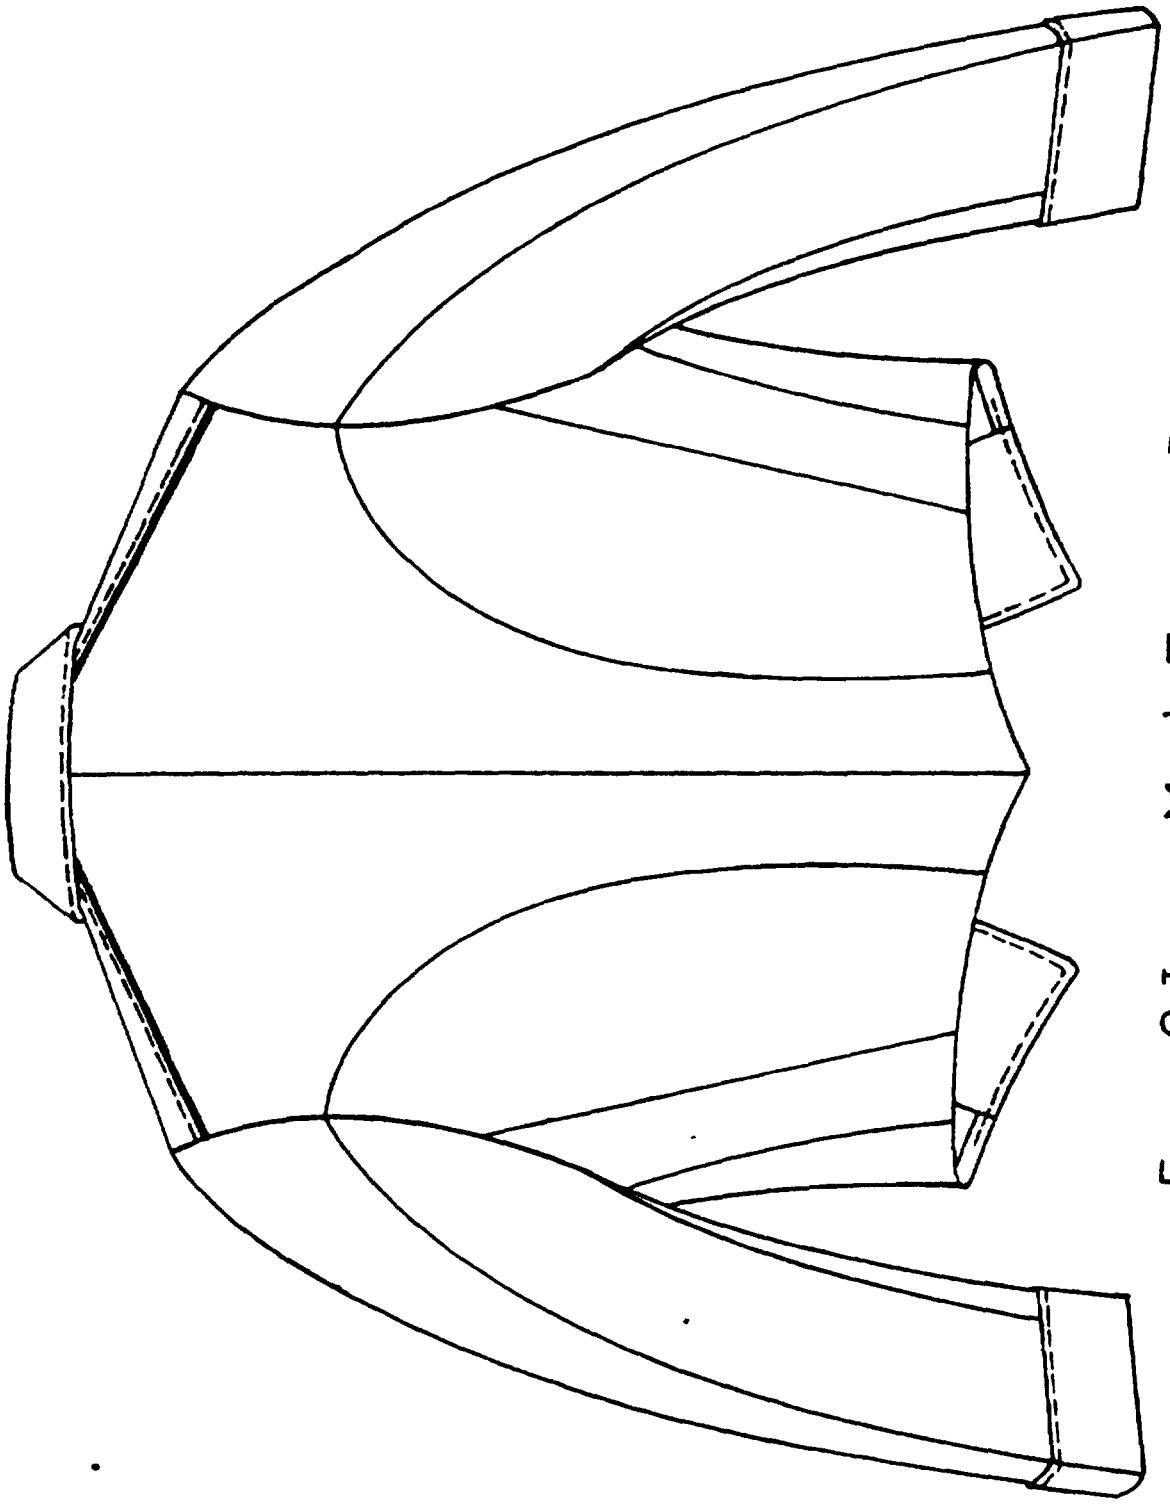


FIGURE 2. JACKET, MAN'S: EVENING DRESS; (STAFF, NON COMMISSIONED OFFICER'S)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

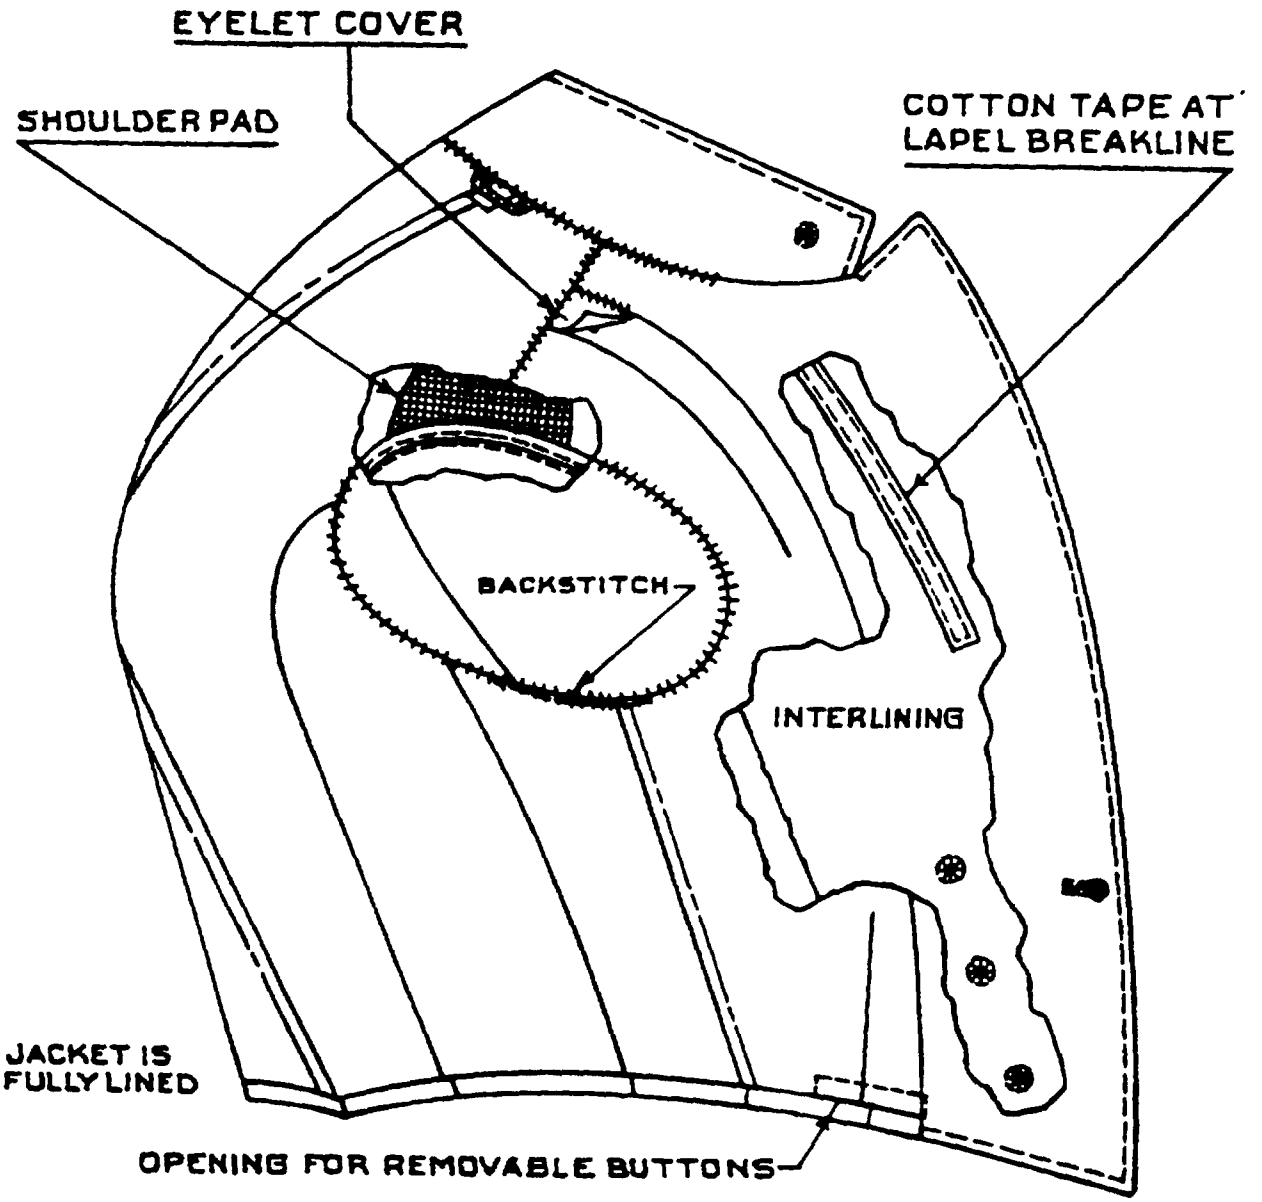

DETAIL: INSIDE LEFT FRONT

FIGURE 3. JACKET, MAN'S: EVENING DRESS; (STAFF, NON COMMISSIONED OFFICER'S)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:12Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1 The preparing activity must complete blocks 1, 2, 3, and 8 In block 1, both the document number and revision letter should be given

2 The submitter of this form must complete blocks 4, 5, 6, and 7

3 The preparing activity must provide a reply within 30 days from receipt of the form

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER	2 DOCUMENT DATE (YYMMDD)
	MIL-J-28978B(MC)	20 September 1994

3. DOCUMENT TITLE

JACKET, MAN'S: EVENING DRESS (STAFF NONCOMMISSIONED OFFICER'S)

4 NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed)*

5 REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a NAME	b TELEPHONE (Include Area Code)	
COMMANDER	(1) Commercial 703-640-4584	(2) AUTOVON 278-4584
c ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE, (PSE-C/S) MARCORSYSCOM, 2033 BARNETT AVE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil/online/converted/2010-20T21:12Z
Check the source to verify that this is the current version before use.