MIL-O-28969A(MC)
17 July 1978
SUPERSEDING
MIL-O-28969(MC)
21 May 1971

MILITARY SPECIFICATION

OVERCOATS, MAN'S: WOOL, GABARDINE, BLUE

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for blue gabardine overcoats.

1.2 Classification. The overcoats shall be of the following types and sizes as specified (see 6.2):

Type I - With piped shoulder straps and sleeve cuffs

Type II - Without piped shoulder straps and sleeve cuffs

Schedule of sizes

| Regular | Long | Extra Long |
|---|---|---|
| 34 | 34 | |
| 36 | 36 | 36 |
| 38 | 38 | 38 |
| 40 | 40 | 40 |
| 42 | 42 | 42 |
| 44 | 44 | 44 |
| 46 | 46 | |

2. APPLICABLE DOCUMENTS

*2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMA-1), Headquarters, U. S. Marine Corps, Washington, D.C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8405

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

| | |
|---|---|
| R-N-91 | - Napthalene, Technical. |
| V-B-871 | - Button, Sewing Hole, and Button, Staple, (Plastic) |
| V-T-276 | - Thread, Cotton |
| V-T-280 | - Thread, Gimp, Cotton, Buttonhole |
| V-T-295 | - Thread, Nylon |
| V-T-301 | - Thread, Silk |
| UU-P-268 | - Paper, Kraft, Wrapping |
| CCC-C-438 | - Cloth, Buckram, Cotton |
| DDD-L-20 | - Label; For Clothing, Equipage and Tentage, (General Use) |
| DDD-T-86 | - Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed) |

MILITARY

| | |
|---|---|
| MIL-C-326 | - Cloth, Silesia, Cotton |
| MIL-C-368 | - Cloth, Satin, Rayon and Cloth, Twill, Rayon |
| MIL-B-371 | - Braid, Textile, Tubular |
| MIL-B-3461 | - Buttons, Insignia, Metal, Uniform and Cap |
| MIL-C-10176 | - Cloth, Gabardine, Wool, Polyester and Wool |
| MIL-C-11065 | - Cloth, Flannel, Wool and Nylon, 16 oz., Shrink Resistant |
| MIL-C-15062 | - Cloth, Flannel, Wool, Undercollar Cloth |
| MIL-P-15064 | - Pad, Shoulder and Sleeve-head |
| MIL-C-15065 | - Coat, Front |
| MIL-B-17757 | - Box, Shipping, Fiberboard (Modular Sizes) |
| MIL-C-43718 | - Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon |
| MIL-C-82252 | - Cloth, Broadcloth, Wool, and Wool Synthetic (Moth-Proofed) |

STANDARDS

FEDERAL

| | |
|---|---|
| FED-STD-191 | - Textile Test Methods |
| FED-STD-751 | - Stitch, Seam and Stitching |

MILITARY

| | |
|---|---|
| MIL-STD-129 | - Marking for Shipment and Storage |
| MIL-STD-1391 | - Provisions for Evaluating Quality of Overcoat's, Man's |

(Copies of specifications and standards required by contractor in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the currentversion before use.

*2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the Manual may be obtained from the Superintendent of Documents, U. S. Government Printing Office, Washington D. C. 20402.)

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D. C. 20026.)

Department of Defense (DOD) Standard Shades for Buttons, 1966

Department of Defense (DOD) Standard Color Card of Official Standardized Shades for Sewing Threads, 1968

(Copies may be obtained from the Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. Unless otherwise specified (see 6.2), before production is commenced, the first article, consisting of the number of finished overcoats specified by the procuring activity (see 6.2), shall be submitted, or made available, to the contracting officer or his authorized representative for inspection. The approval of the first article authorizes the commencement of production but does not relieve



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

the contractor of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the contractor at the same facilities to be used for the manufacture of the production items.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, gabardine, dark blue shade 2316, (see 6.3), 14.5 ounce, conforming to type I, class 5 of MIL-C-10176.

*3.3.2 Lining. The material for lining the overcoat, the bias binding, the back part of the hanging pockets, and the right vent shall be cloth, rayon, twill, black shade 2604 (see 6.3), 3.7 ounce, conforming to class 1, of MIL-C-368.

3.3.3 Undercollar. The material for the undercollar shall be cloth, wool, flannel conforming to MIL-C-15062. The color of the cloth shall be black of an approved shade to closely match shade black 3204. The acidity (pH) requirement and colorfastness to perspiration and crocking requirements shall not apply.

*3.3.4 Bias binding. The binding for the back edge of facings, raw edge of bottom turnup, raw edge of seam allowances, underarm darts, raw inside edge of pocket openings, raw top, back and bottom edges of hanging pockets, raw edge of left vent, and for making button loop for left vent shall be bias cut out of the lining material specified in 3.3.2.

3.3.5 Piping. The material for piping the shoulder straps and the edges of sleeve cuffs of type I overcoat shall be cloth, wool, broadcloth, scarlet shade 2501 (see 6.3), 16.5 ounce per linear yard of 54 inch width, conforming to type I, class 4 of MIL-C-82252, except the color shall be produced by stock dyeing and the finished cloth shall show fair fastness to crocking, perspiration, wet (dry) cleaning, and light.

3.3.6 Tape. The 1/4-, 3/8-, and 5/8-inch-wide tape shall be cotton, preshrunk, conforming to the following types and classes of DDD-T-86, except the requirements for nonfibrous material shall not apply.

| Width, inch | Type | Class |
|---|---|---|
| 1/4 and 3/8 | III | 1, 2 or 3 |
| 5/8 or 1/2 | I | 1 |

The 1/4-inch-wide and 3/8-inch-wide tape shall be unbleached or dyed. The colored tape shall show good fastness to wet (dry) cleaning. The 5/8-inch-wide tape shall be unbleached.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

3.3.7 Collar interlining. The material for interlining the collar shall be natural or dyed, conforming to type I, class 2 of CCC-C-438.

*3.3.8 Pocket material. The material for the pocketing shall be cloth flannel, wool/nylon, 16 ounce, shrink resistant conforming to MIL-C-11065. The flannel cloth shall be dyed a black shade to closely match black shade 2604. The dyed cloth shall show good fastness to wet (dry) cleaning and laundering when tested as specified in MIL-C-11065.

*3.3.9 Silesia or polyester and cotton. The material for making the stays for the top end of the vent, armhole, lapel interlining and shoulder seams and lower edge of armholes shall be cloth, cotton, silesia, conforming to type I of MIL-C-326 or polyester and cotton conforming to type I of MIL-C-43718. The silesia or polyester and cotton shall be black, except the requirements for nonfibrous material and seam efficiency shall not apply.

3.3.10 Thread.

3.3.10.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A, 3 ply for all outside seaming and stitching; size B, 3 ply and size F, 3 ply, top and lower thread, respectively, for buttonholes; and size 0, 3 ply for machine felling. The thread for hand sewing shall conform to type III, class 3, size C, 2 ply. The requirements for extractable material shall not apply.

*3.3.10.2 Nylon thread. As an alternate to the silk thread in all machine operations, nylon, tailoring, soft finish thread conforming to V-T-295 may be used as specified below:

| Size | Ply (min) | Length per pound (yards/min) | Breaking Strength (pounds/min) | Elongation (percent-max) |
|---|---|---|---|---|
| 0 | 2 | 16,000 | 3.0 | 35 |
| B | 2 | 11,000 | 4.3 | 35 |
| F | 3 | 3,800 | 12.0 | 35 |

Size "0" nylon shall be used in all machine operations where even size "0, OO or A" silk is currently specified and size "B" nylon in lieu of size "B" silk. The nylon thread for the buttonholes shall be either size "B" for both needle and looper or size "B" for the needle and size "F" for the looper. For all hand sewing operations, type IV and type V of V-T-295 shall be substituted as an alternate to the hand sewing silk on an equal size basis.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

*3.3.10.3 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3 ply for all inside seaming and stitching, type IB3, glazed finish, ticket No. 24, 4 ply for sewing on buttons and type IA1 or IA2, ticket No. 30, 3 ply for machine tacking armholes. The thread for basting shall be a good commercial grade.

*3.3.10.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

*3.3.10.5 Color and colorfastness. The cotton and silk thread, except basting thread which may be white, shall be dyed black shade AA, cable No. 66043. The dyed threads shall show good fastness to light and wet (dry) cleaning, when tested as specified in the applicable thread specification. (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968).

3.3.11 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to type I or type II of V-T-280, showing good colorfastness to wet (dry) cleaning. The color shall approximate black shade AA, cable No. 66043.

*3.3.12 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

3.3.13 Buttons.

3.3.13.1 Insignia buttons. The insignia buttons shall be metal, gold plated, 40 line, conforming to type I, style 3, class A of MIL-B-3461, subclass 1 for type II overcoats and subclass 2 for type I overcoats. Regular shank buttons shall be used on the right front and belt; short shank buttons shall be used on left front.

*3.3.13.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish, style 4, 22 line for right vent, lapel buttonhole tab, and sword slit patch and style 20, 30 line for shoulder straps (type II overcoats) conforming to type II, class D of V-B-871. The color of the buttons shall match the approved standard black BT, Cable No. 62001. (See DOD Standard Shades for Buttons 1966).

3.3.14 Coat fronts. The coat fronts shall conform to type XII of MIL-C-15065. The color shall be black.

*3.3.15 Shoulder pads. The shoulder pads shall conform to type I, class 3 of MIL-P-15064.



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

3.3.16 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.17 Sword slit patch. The sword slit patch for type II overcoat shall be made of the material specified in 3.3.3.

3.3.18 Labels. Each overcoat shall have an identification and size label as follows. The overcoat is intended to be dry cleaned and the labelsshall show fastness to dry cleaning.

3.3.18.1 Identification label. The identification label shall be type I, class 1 of DDD-L-20 and shall measure not less than 2-3/4 by 1-1/2 inches, with a 3/16-inch margin for sewing maintained on all four sides. The content and format shall be as follows:

Nomenclature (Item description)
Contract number
Name of contractor
Wool Products Act information

3.3.18.2 Size label. The size label shall be type I, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numberical size designation specified in 1.2, followed by the letters R, L, or XL for Regular, Long and Extra Long, and the stock number as shown by the following example:

40R
Stock Number

The stock number may be incorporated on the identification label.

*3.4 Design. The overcoat shall be the U. S. Marine Corps design shown on Figures 1 through 7 - a semiformfitting, double breasted, quarter-lined overcoat with three insignia buttons on each front; having two lower slash pockets with outside welt and cut through pocket opening; ornamental sleeve cuffs; a semiulster type collar; lapel buttonhole tab and button; shoulder straps; and a two-piece half-belt to button. Type I overcoats only shall have ornamental sleeve cuffs, shoulder straps piped with scarlet broadcloth and slit at side seams to insert belt halves. Type II overcoats only shall have a sword slit on the left front above the slash pocket, with a tab on inside to button.

*3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard patterns shall provide 5/8-inch seam allowance for the side and center back seams, 1/4-inch allowance for neck darts and 3/8-inch allowance for underarm darts and sleeve seams, 1/8 to



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

3/16-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size, are marked and notched for proper cutting, placement and assembly of component parts.

*3.5.1 Pattern parts. Overcoats shall be cut from the material specified herein in accordance with the pattern parts indicated below:

| Item | Pattern Nomenclature | No. of cut parts |
|---|---|---|
| | Material: Cloth, Wool, Gabardine | |
| 1. | Fronts | 2 |
| 2. | Back | 2 |
| 3. | Front facings | 2 |
| 4. | Top sleeves | 2 |
| 5. | Under sleeves | 2 |
| 6. | Topcollar | 1 |
| 7. | Topcollar stand | 1 |
| 8. | Sleeve cuffs | 2 |
| 9. | Pocket welts | 2 |
| 10. | Half-belt | 2 |
| 11. | Shoulder straps (Type I) | 2 |
| 12. | Shoulder straps (Type II) | 2 |
| 13. | Shoulder straps underply (Type II) | 2 |
| 14. | Lapel buttonhole tab | 2 |
| 15. | Sword slit buttonhole tab | 2 |
| 16. | Welt piece | 1 |
| | Material: Cloth, Wool, Flannel Undercollar | |
| 17. | Undercollar | 4 |
| 18. | Sword slit patch | 1 |
| | Material: Cloth, Rayon, Lining | |
| 19. | Fronts | 2 |
| 20. | Yoke | 1 |
| 21. | Top sleeves | 2 |
| 22. | Under sleeves | 2 |
| 23. | Hanging pocket lining | 2 |
| 24. | Right vent lining | 1 |
| | Material: Cloth, Flannel | |
| | Hanging pockets: | |
| 25. | Top ply | 2 |
| 26. | Under ply | 2 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

| Item | Pattern Nomenclature | No. of cut parts |
|---|---|---|
| | Material: Cloth, Silesia or Polyester and Cotton | |
| 27. | Lapel interlining | 2 |
| | Material: Cloth, Cotton, Interlining | |
| 28. | Collar interlining | 4 |
| | Shapers | |
| 29. | Left vent shaper | |
| 30. | Working lapel shaper | |
| 31. | Finished lapel shaper | |
| 32. | Topcollar shaper | |
| 33. | Undercollar shaper | |
| 34. | Finished lapel shaper with collar | |
| | Markers | |
| 35. | Belt marker for buttonholes | |
| 36. | Undercollar stand marker | |
| 37. | Cuff marker (sleeve) | |

*3.6 Construction. The overcoats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of operations as listed in Table I but all operations specified shall be used to manufacture the overcoats.

*3.6.1 Stitches, seams and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

*3.6.1.1 Ends of seams and stitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch; thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

*3.6.2 Shade marking. The component parts of the overcoat, except the lapel buttonhole tab, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.
(c) Sew on shade tickets on lining.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD | |
|---|---|---|---|---|---|---|
| | | | | | NDL | BOB/ LPR |
| 1. | Cutting.<br><br>a. Cut the overcoats in strict accordance with patterns furnished by the Government.<br><br>b. Cut all materials in the direction indicated by the directional lines on the patterns.<br><br>c. Cut all wool gabardine parts from one piece of material except the lapel buttonhole tab, which may be cut from ends. All wool gabardine parts cut from ends shall harmonize with overcoat. The four parts of the undercollar cut from undercollar cloth shall match each other. The welts shall be cut in such a manner that in the finished overcoat, the twill lines on the top ply of the welts and fronts shall be in the same direction.<br><br>d. Cut the lining for the front, yoke, hanging pocket and right vent from one piece of rayon lining material. Pairs of sleeve linings and bias bindings may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

**TABLE 1 MANUFACTURING REQUIREMENTS**

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 1. | Cutting. (cont'd)<br><br>lining parts shall match. The bias bindings shall be cut 7/8 inch wide for the raw back edge of the facings, raw edge of bottom turnup, raw edges of side and center back seam allowances, and raw edge of left vent; and shall be cut 1-1/8 inches wide for the raw edges of underarm darts, the raw inside edge of pocket opening, the top, back and bottom edges of hanging pockets, and vent button loop.<br><br>e. Cut the flannel cloth for the hanging pockets in the warp direction in accordance with the pattern.<br><br>f. Cut the cotton interlining cloth for the collar in accordance with the patterns. The collar interlining shall be cut on the bias.<br><br>g. Cut the material (see 3.3.5) for piping the edges of shoulder straps and sleeve cuffs for type I overcoats on the straight. The piping shall be cut 5/8 inch wide for shoulder straps and cuffs.<br><br>h. Dress the left vent in accordance with pattern furnished.<br><br>i. Cut the lapel interlining in accordance with pattern furnished.<br><br>j. Cut the silesia or polyester and cotton stay for the top end of the vent on the straight (wrap of filling) 2-1/4 inches long and 1-1/2 inches wide. Cut the silesia or polyester and cotton stay for the shoulder and armhole | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 1. | Cutting. (cont'd)<br><br>seams and lower edge of armholes on the bias, 3/4 inch wide and 4-1/2 ± 1/4 inches long. | | | | | |
| 2. | Replacement of damaged parts.<br><br>a. Replace at time of cutting any part of the overcoat containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance.<br><br>b. Replace any part damaged during manufacturing process by needle chews which may develop into holes, scissors or knife cut, tears, holes, mends and burns in the material affecting appearance. | | | | | |
| 3. | Shade marking.<br><br>a. Mark or ticket all wool gabardine component parts, except lapel buttonhole tab, and the undercollar parts to insure a uniform shade and size throughout the garment. All lining parts shall be marked, bundled, or ticketed to insure a uniform shade and size throughout the garment.<br><br>b. The use of tickets with metal fastening devices or sew-on tickets is prohibited on the rayon lining. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 4. | Make lapel buttonhole tab. | | | | | |
| | Finished appearance. The lapel buttonhole tab shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers and pleats. The seamed edges shall be neatly and completely worked out. The buttonholes shall be cut-first type. The purling of the buttonhole shall be on the outside when the lapel tab is buttoned to the overcoat. | | | | | |
| | a. The tab shall be made of two plies of the basic material. | | | | | |
| | b. Seam the two plies of the tab together 3/16 inch from the sides and rounded edges. | 301 | SSe-2(a) | 12-16 | A | A |
| | c. Turn tab completely, working out the seamed edges. Topstitch the tab uniformly 1/8 inch from seamed edges. | 301 | SSe-2(b) | 12-16 | A (silk) | A |
| | d. Join the raw edge of the tab together with overedge stitching. | 504 or 505 | EFd-1 | 8-10 | A | A |
| | | | EFd-1 | 8-10 | A | A |
| | e. Make one horizontal eyelet-end square bar type buttonhole, cut 3/4 inch long, midway between side edges of tab with the inside edge of the eyelet end of the buttonhole 1/2 ± 1/8 inch from rounded end. | But-ton-hole | | 38 per button-hole | B | F |
| | f. Securely bartack the end of buttonhole, catching the gimp in the stitching, and trim ends of gimp. | Bar-tack | | 21 per bartack | A | A |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 5. | Make shoulder straps (type I). | | | | | |
| | Finished appearance. The piping shall be uniformly stitched to the shoulder straps without twists, gathers, puckers or pleats, shall be evenly and uniformly worked out to the edges and shall extend uniformly 1/8 inch beyond the seamed edges of the shoulder strap. The straps shall finish smooth and flat and shall be uniform in appearance. | | | | | |
| | a. The shoulder straps shall be made of one ply of basic material, piped with scarlet wool broadcloth. | | | | | |
| | b. Place a 5/8-inch-wide strip of scarlet wool broadcloth piping to the shoulder straps along front and back edges and around collar end. Stitch 1/8 inch from the edges. | 301 | SSe-2(a) | 10-14 | A (silk) | A |
| | c. Turn back the straps and scarlet piping uniformly, working the folded edge of the piping 1/8 inch beyond the edge of the straps. Topstitch the straps uniformly 3/16 inch from the folded edges of piping. | 301 | SSe-2(b) | 10-14 | A (silk) | A |
| | d. Press the straps smooth and flat with a heated pressing iron or pressing machine. The straps shall be uniform in shape and size in accordance with the patterns. | | | | | |
| 6. | Make shoulder straps (type II). | | | | | |
| | Finished appearance. The shoulder straps shall finish smooth and flat, without twists, pleats, puckers, or raw edges and be uniform in appearance. The edges shall be neatly and completely worked out. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 6. | Make shoulder straps (type II). (cont'd) | | | | | |
| | a. The shoulder straps shall be made of two plies of basic material. | | | | | |
| | b. Position the two plies with edges even and uniformly seam together 3/16 inch from the edges at the front, back and collar end. | 301 | SSe-2(a) | 10-14 | A | A |
| | c. Turn the straps completely, working the seams out to the edges. | | | | | |
| | d. Topstitch the straps uniformly 3/8 inch from the seamed edges. | 301 | SSe-2(b) | 12-16 | A (silk) | A |
| | e. Press the straps smooth and flat with a heated pressing iron or pressing machine. The straps shall be uniform in shape and size in accordance with the patterns. The seam shall finish at the edges. | | | | | |
| 7. | Make buttonhole in shoulder straps (type II). | | | | | |
| | Finished appearance. The buttonholes shall be clean cut, well made and correctly positioned. The buttonholes shall be well worked over gimp to fit a 30-line sewing hole button. The ends of the gimp shall be pulled through to the underside of the straps and the ends of the buttonholes shall be securely bartacked. The purling of the buttonholes shall be on the outside of the shoulder straps. The buttonholes shall be cut-first type. | | | | | |
| | a. Make a horizontal, eyelet-end square bar type buttonhole, cut 3/4 inch long, in each strap midway between the back and front edges. The inside | Buttonhole | | 38 per buttonhole | B (silk) | F |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 7. | Make buttonhole in shoulder straps (type II). (cont'd) | | | | | |
| | edge of the eyelet end of the buttonhole shall be 1 inch from the collar end of the strap. The buttonholes shall be worked over gimp and the ends of the gimp shall be pulled through to the underside of the strap. | | | | | |
| | b. Securely bartack the end of each buttonhole, catching the gimp in the stitching, and trim ends of gimp. | Bar-tack | | 21 per bartack | A (silk) | A |
| 8. | Make sleeve cuffs (type I). | | | | | |
| | Finished appearance. The piping shall be uniformly stitched to the upper curved edge of sleeve cuffs without twists, gathers, puckers or pleats and shall extend uniformly 1/8 inch beyond the seamed edges of the cuff. The cuffs shall finish smooth and flat and shall be uniform in appearance. | | | | | |
| | a. The sleeve cuffs shall be one ply of basic material, piped with scarlet wool broadcloth. | | | | | |
| | b. Place a 5/8-inch-wide strip of scarlet wool broadcloth piping to the sleeve cuffs and stitch 1/8 inch from the upper curved edge. | 301 | SSe-2(a) | 10-14 | A | A |
| | c. Turn back the cuffs and scarlet piping uniformly, working the folded edge of the piping 1/8 inch beyond edge of the cuffs. Topstitch the cuffs uniformly 3/16 inch from folded edges of piping. | 301 | SSe-2(a) | 10-14 | A (silk) | A |
| | d. Press smooth and flat with a heated pressing iron or pressing machine. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 9. | Make sleeve cuffs (type II). | | | | | |
| | Finished appearance. The upper curved edge shall be properly formed and creased. | | | | | |
| | a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges. Turn the cuff, completely working out the point. | 301 | SSa-1 | 10-14 | A | A |
| | b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern, and press smooth and flat with a heated pressing iron or pressing machine, creasing the edge. The upper edge of the cuff may be turned under and basted by machine. | | | | | |
| 10. | Make pocket welt. | | | | | |
| | a. The welt shall be made of a single ply of basic material folded in half lengthwise and reinforced at the inside folded edge with 5/8-inch-wide cotton tape. | | | | | |
| | b. Position the tape lengthwise on the welt piece at the center and seam 1/16 inch from each edge. | 301 | SSaa-1 (each edge) | 10-14 | A | A |
| | c. Fold the welt lengthwise in half to the outside and close the ends of the welt with a 1/4-inch seam. Trim the corners of the welt for proper turning. | 301 | SSe-2(a) | 10-14 | A | A |
| | d. Turn the welt to the right side, completely working out the seamed edges and corners. Topstitch the welt uniformly 3/8 inch from the | 301 | SSe-2(b) (seamed edges) OSF-1 (folded edge) | 12-16 | A (silk) | A |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 10. | Make pocket welt. (cont'd)<br><br>seamed and folded edges. The welt shall finish with the cotton reinforcement tape stitched to the back part of the welt.<br><br>e. Press the welt smooth and flat with a heated pressing iron.<br><br>f. On the finished overcoat, the welt for all sizes shall be 7-3/4 ± 1/4 inches long, except for size 34, the welt shall be 7-1/4 ± 1/4 inches long. The width of the welt for all sizes shall be 1-3/4 ± 3/16 inches. | | | | | |
| 11. | Make half belt.<br><br>Finished appearance. The belt shall finish smooth and flat without twists, pleats, puckers or raw edges. On the finished overcoat, the half belt shall be 2-1/4 ± 1/8 inches wide.<br><br>a. The left and right half belt shall be made of a single ply of basic material. | | | | | |
| | b. Fold the left and right belt pieces in half lengthwise forming two plies and seam the two plies together along the length 3/8 inch from the raw edges. | 301 | SSa-1 | 10-14 | A | A |
| | c. Spread the seam open and press smooth and flat with a heated pressing iron. | | | | | |
| | d. Close the pointed ends of the belt along the slanted edges with a 3/16-inch seam. | 301 | SSe-2(a) | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 11. | Make half belt. (cont'd) | | | | | |
| | e. Trim the corners of the point and turn the belt through the open end, completely working out the point. | | | | | |
| | f. Topstitch the belt uniformly 3/8 inch from the pointed and folded edges. The seam of the belt shall finish off center. | 301 | SSe-2(b) (seamed edges) OSf-1 (folded edges) | 12-16 | A | A |
| | g. Press the left and right half-belt smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| 12. | Make buttonholes in belt. | | | | | |
| | Finished appearance. The buttonholes shall be clean cut, well made and correctly positioned. The buttonholes shall be well worked over gimp to fit 40-line insignia buttons. The ends of the gimp shall be pulled through to the underside of the belt and the ends of the buttonholes shall be securely bartacked. The purling of the buttonholes shall be on the upperside of the half belt. The buttonholes shall be cut-first type. | | | | | |
| | a. Mark the location for two buttonholes on the left half-belt in accordance with the belt marker. | | | | | |
| | b. Make two horizontal eyelet end, square bar type buttonholes, cut 1-1/8 inches long, at the mark on the left half belt. The inside edge of the eyelet end of one buttonhole shall be 1 inch from the pointed end of the belt, and the inside edge of the remaining buttonhole shall be 6 inches from the pointed end. | But-ton-hole | | 54 per Button-hole | B (silk) | F |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 12. | Make buttonholes in belt. (cont'd) | | | | | |
| | c. Securely bartack the end of each buttonhole, catching the gimp in the stitching. Trim the ends of the gimp and thread. | Bar-tack | | 21 per bartack | A (silk) | A |
| 13. | Seam sleeves at forearm. | | | | | |
| | Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. | | | | | |
| | a. Position the top and underarm sleeves with notches matching and join together at forearm with a 3/8-inch seam. | 301 or 401 | SSa-1 | 12-16 | A | A |
| | b. Spread open the seam and press flat with a heated pressing iron. | | | | | |
| 14. | Join cuff to sleeves (type I). | | | | | |
| | Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers, pleats or raw edges. On the finished coat, the length of the cuff shall measure 3-1/4 ± 1/4 inches at the front and back creased edges, and 6 ± 1/4 inches at the point. In the finished coat (after pressing) the point of the cuff shall be centered between the lower forearm creased edge and the creased backarm of sleeve. | | | | | |
| | a. Mark the sleeve in accordance with sleeve cuff marker for positioning the cuffs, with notch on the cuff marker matching the forearm seam line and the bottom edge of marker in line with the bottom raw edge of sleeve. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 14. | Join cuff to sleeves (type I). (cont'd) | | | | | |
| | b. Position the upper edge of cuff on the sleeves at the mark. | | | | | |
| | c. Seam the sleeve cuff to the sleeve and stitch as close as possible to, but not on top of, the topstitching at the upper edge. | 301 | | 10-14 | A (silk) | A |
| 15. | Join cuff to sleeves (type II). | | | | | |
| | Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs shall be uniformly stitched to sleeves. In the finished overcoat (after pressing) the point of the cuff shall be centered between the lower forearm creased edge and the creased backarm seam of sleeve. | | | | | |
| | a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges. Turn the cuff, completely working out the point. | 301 | SSa-1 | 10-14 | A | A |
| | b. Mark the sleeve in accordance with sleeve cuff marker for positioning the cuffs. | | | | | |
| | c. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern, and press smooth and flat with a heated pressing iron or pressing machine, creasing the edge. The upper edge of the cuff may be turned under and basted by machine. | | | | | |
| | d. Position the cuffs on the mark on the sleeve, and seam uniformly 1/8 inch from upper finished edge of cuffs. | 301 | LSd-1 | 12-16 | A (silk) | A |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the currenversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 16. | Seam sleeve at backarm. | | | | | |
| | Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly. | | | | | |
| | a. Join the top and undersleeves together at the backarm with a 3/8-inch seam, catching the ends of the cuff in the seam. The upper edges of the cuff shall be aligned at the backarm seam line. Any excess sleeve cuff material extending beyond backarm seams may be trimmed off simultaneously during the seaming of the backarm seam of sleeve. | 301 or 401 | SSa-1 | 12-16 | A | A |
| | | | SSa-1 | 12-16 | A | A |
| | b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron. | | | | | |
| 17. | Tack cuff to sleeve. | | | | | |
| | a. Turn the bottom of the cuff to the inside in accordance with notches against the bottom end of sleeves, and baste along the turned edge of cuff. | 101 or Hand | | | | |
| | b. Tack the raw edge of the cuff to the body of sleeves with blindstitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff. | 103 | SSm-1 | 4-6 | A | |
| 18. | Seam sleeve lining. | | | | | |
| | Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The seam shall start and finish evenly. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 18. | Seam sleeve lining. (cont'd) | | | | | |
| | a. Position the top and undersleeve lining pieces in accordance with notches on pattern and join at the forearm and backarm, respectively, with a 3/8-inch seam. | 301 or 401 | SSa-1 | 10-14 | A | A |
| | | | SSa-1 | 10-14 | A | A |
| 19. | Assemble sleeve and sleeve lining. | | | | | |
| | Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers or pleats. | | | | | |
| | a. Properly position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve. | | | | | |
| | b. Seam or tack forearm seam and backarm seam of sleeve lining to forearm seam and backarm seam of wool sleeves, properly distributing lining fullness along the seam. The tacking shall extend not more than 6 inches below top of armhole and not more than 5 inches above the bottom finished end of sleeves. When tacking is done by hand, both ends of stitching shall be securely backstitched with not less than three stitches. | 301 or Hand | SSa-1 1 to 1-1/2 inches in length | 6-8 | A | A Commercial |
| 20. | Fell turnup of sleeve lining; press sleeves. | | | | | |
| | Finished appearance. The sleeve linings shall not be short, tight or twisted at bottom of sleeves, and shall extend to within 1 to 1-1/4 inches from finished end of sleeve. The sleeves may be creased prior to hanging to facilitate check on balance of sleeves. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 20. | Fell turnup of sleeve lining; press sleeves. (cont'd) | | | | | |
| | a. Pull sleeves through lining, turn under the bottom edge of sleeve lining, and baste to turnup of the cuff. | Machine or Hand | | | Commercial | |
| | -or- | | | | | |
| | b. The sleeve lining may be felled to bottom of sleeve without basting. | | | | | |
| | c. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching. | 301 or Hand | EFc-1 | 6-8<br>8-10 | 0 (silk)<br>C (silk) | 0 |
| | d. Turn sleeves and assemble in pairs. The sleeves may be pressed at lower half by creasing on backarm seam and front edge of sleeve. | | | | | |
| 21. | Make undercollar. | | | | | |
| | a. The undercollar assembly consists of one ply (4 pieces) of undercollar cloth and one ply (4 pieces) of permanent finish interlining material. | | | | | |
| | b. Properly position and join together the center and side undercollar pieces, respectively, with a 3/8-inch seam. | 301 | SSa-1 (each seam) | 12-16 | A | A |
| | c. Spread open the seams and press flat with a heated pressing iron. | | | | | |
| | d. Properly position and join together the center and side interlining pieces, respectively, of each ply with a 1/4 inch lap seam. | 301 | LSa-1 (each seam) | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 21. | Make undercollar. (cont'd) | | | | | |
| | e. Mark the breakline of the undercollar with the undercollar stand marker. Position the undercollar on the interlining with the lower edges even and with the seams of undercollar and interlining staggered. Join the undercollar to interlining at the breakline. | 301 | SSv-1 | 10-14 | A | A |
| | f. Quilt the interlining to the undercollar with a minimum of seven rows of blindstitching. | 103 | SSm-1 (each row) | 4-6 | A | |
| | g. Fold undercollar assembly on breakline to the outside and press smooth and flat with a heated pressing iron, creasing on the breakline. | | | | | |
| | h. Position the undercollar shaper on the outside of undercollar with the lower edge of shaper in line with the breakline and the back edge of shaper even with the center seam. Mark the upper, side and lower front edge and location for two notches at the upper edge. Trim excess material at the mark. | | | | | |
| | i. Seam undercollar and interlining together 1/2 ± 1/8 inch from top and side edges. | 301 | SSa-1 | 10-14 | A | A |
| 22. | Assemble top collar. | | | | | |
| | a. The top collar-collar stand assembly consists of a single piece of basic material each for top collar and collar stand. | | | | | |
| | b. Position the top collar and collar stand with notches matching and join together at the lower edge with a 1/4 inch seam. | 301 | SSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBB/ LPR |
|---|---|---|---|---|---|---|
| 22. | Assemble top collar. (cont'd) | | | | | |
| | c. Spread open the seam and press smooth and flat with a heated pressing iron. | | | | | |
| | d. Position the collar shaper on the outside of topcollar with the lower edge of shaper in line with the seam joining topcollar to collar stand, and with the back edge of shaper aligned with the upper center notch of top collar. Mark the upper and side edges and the location for two notches at the upper edge. Trim excess material at the mark. | | | | | |
| 23. | Assemble topcollar and undercollar. | | | | | |
| | Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers or raw edges (top and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The edges and corners of the collar shall be smooth, flat and uniformly even. | | | | | |
| | a. Position topcollar between undercollar and interlining with upper edge abutting undercollar interlining seam and notches aligned. Baste topcollar to undercollar 1/4 inch from top edge. | 101 | | | | |
| | b. Join topcollar, undercollar and interlining together at the top edge with zig-zag stitching. The zig-zag stitching design shall be on the interlining side of the collar. In the finished collar, the stitching shall extend to within 1 inch of the upper corners. | 304 | LSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 23. | Assemble topcollar and undercollar. (cont'd) | | | | | |
| | c. Turn the topcollar smoothly to the outside over the upper edge of interlining and baste with two rows of stitches. The outer and inner row of stitches shall be approximately 1/2 and 1-1/2 inches, respectively, from the upper edge of the collar. Baste the collar approximately 3/8 inch above breakline. The proper fullness shall be placed between the rows of basting stitches. The stitching shall extend to within 1-1/2 inches of the side edges. | 101 | | | | |
| | d. Trim and turn the side edges of the topcollar smoothly over the interlining between the undercollar and interlining and baste the edges forming the rounded upper corners of the collar. | Hand | | | | |
| | e. Fell the topcollar to undercollar starting at the end of the stitching at the top edge and continuing around the corners and along each side. | Hand | | 8-10 | C (silk) | |
| | -or- | | | | | |
| | f. Insert 1/2-or 3/4-inch bias binding (see 3.3.2) between the undercollar and interlining and stitch the three plies with a zig-zag or E stitch machine. Bias binding will extend approximately 1/4 inch from outer edge of collar. | 304 or 306 | | 12-14 | A | A |
| | g. Stitch undercollar to topcollar using a 3/16-inch knife attachment, matching notches and distributing fullness. The interlining edge shall be used as a guide for the finished stitch line and the shape of collar. | 301 | SSa-1 | 12-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 23. | Assemble topcollar and undercollar. (cont'd) | | | | | |
| | h. Turn collar. Force out edges and baste collar edge with at least 2 rows of stitching, distributing the collar fullness evenly and rolling the joining seam to underside. The first row shall be 1/4 inch from edge. Place an additional row of basting along the outside edge of collar. | Hand or Mach-ine | | | Commercial | |
| | Note: The rayon ribbon will not be exposed at the edge of collar. | | | | | |
| | i. Press the collar smooth and flat with a heated pressing machine, removing the fullness by shrinking. | | | | | |
| | j. Trim the lower edge of topcollar even with the bottom edge of undercollar at gorge line, and continue to trim excess material at the center, leaving seam allowance for turning under (see 63.a). | | | | | |
| 24. | Make hanging pocket. | | | | | |
| | a. The hanging pocket shall consist of two pieces of the pocketing material specified in 3.3.8 lined with rayon lining. | | | | | |
| | b. Seam the three plies together 1/8 to 3/16 inch along the raw edges, except the cutout of the pocket, with the rayon lining on the outside of the under ply of hanging pocket. The napped side of the pocket shall be on the inside of finished pocket. | 301 | SSa-1 (each edge) | 12-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 24. | Make hanging pocket. (cont'd) | | | | | |
| | c. Bind the hanging pocket at the top, back, and bottom edges with 1-1/8-inch-wide bias binding, with the raw edges of the binding turned under and caught in the stitching 1/16 inch from inner folded edges. The binding shall be evenly stitched and the materials shall be securely caught in the stitching. | 301 | BSc-1 | 10-14 | A | A |
| 25. | Make sword slit buttonhole tab. | | | | | |
| | a. The sword slit buttonhole tab shall be made of two plies of basic material. | | | | | |
| | b. Seam the two plies together at the side and bottom edges. | 301 | SSe-2(a) | 12-16 | A | A |
| | c. Turn and edgestitch 1/8 inch from the seamed edges. | 301 | SSe-2(b) | 12-16 | A (silk) | A |
| | d. Seam the plies together 1/8 inch from raw edges at top end of tab. | 301 | SSa-1 | 12-16 | A (silk) | A |
| | e. Make a vertical eyelet-end taper-bar type buttonhole, cut 5/8 inch long, in center of tab with the inside edge of buttonhole eyelet placed 5/8 inch above bottom edge of tab. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button, and the end of the buttonhole shall be securely tacked. The purling of the buttonhole shall be on the underside of the tab. | But-ton-hole | | 60 per button-hole | A (cotton) | A |
| 26. | Stitch lapel interlining to coat front interlining. | | | | | |
| | a. Position the lapel interlining on the outside of coat front interlining with the lapel interlining | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 26. | Stitch lapel interlining to coat front interlining. (cont'd) | | | | | |
| | approximately 1/2 inch back from the top and front edges of the coat front interlining. | | | | | |
| | b. Stitch the lapel and coat front interlinings together approximately 1/2 inch to the back of the lapel breakline; | 301 | SSv-1 | 10-14 | A | A |
| | -or- | | | | | |
| | c. The lapel piece may be stitched to coat front interlining during the construction of coat fronts using stitch type 304 and same thread used in stitching of the coat fronts. | | | | | |
| 27. | Make vent button loop. | | | | | |
| | a. Fold the 1-1/8-inch-wide strip of bias binding for the button loop in half lengthwise, turning the edges to the inside, and seam 1/16 inch from the turned edges to finish 1/4 to 5/16 inch wide. | 301 | EFp-1 | 10-14 | A | A |
| 28. | Join and hem front and yoke linings. | | | | | |
| | Finished appearance. The hem shall be uniformly stitched, uniform in width, and shall finish smooth and flat without twists, gathers, puckers or pleats. | | | | | |
| | a. Join front and yoke linings at the side seam with a 5/8-inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | b. Hem the bottom edge of the yoke and front linings with the raw edge turned under and caught in stitching 1/16 inch from the folded upper edge of the hem. | 301 | EFb-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 28. | Join and hem front and yoke linings. (cont'd)<br><br>c. In the finished overcoat, linings shall extend to the lower edge of the belt and the hem shall be 3/8 ± 1/8 inch wide. | | | | | |
| 29. | Make center pleat in yoke lining; sew on label.<br><br>Finished appearance. The pleat shall be uniform in width and shall finish smooth and flat without puckers or pleats.<br><br>a. Fold the yoke lining in accordance with notches on the pattern to form a 3/4-inch-wide pleat at center back.<br><br>b. Press the pleat smooth and flat from top to bottom edge of yoke lining with a heated pressing iron. The folded edge of the pleat on the outside of the lining shall be towards the left side as worn.<br><br>c. Position the identification label on the outside of yoke lining so that in the finished overcoat, the label shall be midway between the center back pleat and the right side seam and the lower edge of label approximately 1-1/2 inches above the bottom finished edge of the lining. Seam the label to the lining 1/8 inch from each edge. | 301 | | 10-14 | A | A |
| 30. | Bind backparts.<br><br>Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats. The basic material | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD | |
|---|---|---|---|---|---|---|
| | | | | | NDL | BOBB/ LPR |
| 30. | Bind backparts. (cont'd) | | | | | |
| | and edges of binding shall be caught in the stitching. Only the outside raw edge of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. | | | | | |
| | a. Mark the left backpart in accordance with vent marker for positioning the 3/8-inch-wide stay tape. | | | | | |
| | b. Bind the raw center back edge of the left and right backparts, respectively, with 3/4-to 7/8-inch-wide bias binding from top edge of backparts to top end of vent. When binding the left backpart, continue to bind the raw edge of the vent for the left backpart from top to bottom end, with the vent loop positioned on the outside in accordance with the notch on pattern and with the ends of the loop caught in the binding. The loop opening shall be not more than 5/8 inch long to fit a 22-line button. The binding is not required along the top end of the vent. | 301 | BSb-1 | 10-14 | A | A |
| | c. Bind the raw side edge of left and right backparts, respectively, with 3/4-to 7/8-inch wide bias binding from armhole edge to bottom edge of backpart. | 301 | BSb-1 | 10-14 | A | A |
| | d. Only the outside raw edge of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. The binding shall be evenly stitched and the basic material shall be securely caught in the stitching. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 31. | Seam lining to right vent.<br><br>Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. | | | | | |
| | a. Position the vent lining on the outside of the right vent with the edge of the vent and one edge of the lining even, and with the bottom end of the lining approximately 3/8 inch above the bottom edge. Seam the lining to the vent 3/8 inch from the back edge. | 301 | SSe-2(a) | 10-14 | A | A |
| | b. Turn the lining to the inside of the right vent and topstitch uniformly 1/8 inch from the folded edge, with the lining 1/16 inch back from the folded edge of the vent. | 301 | SSe-2(b) | 12-16 | A | A |
| 32. | Join backparts.<br><br>Finished appearance. The backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in line with the center back seam. In the finished overcoat, the left backpart shall overlap the right backpart 2-1/2 ± 1/4 inches when measured at the bottom edge of the overcoat. The left vent shall be 2 ± 1/8 inches when measured at the bound edge of bottom turnup. | | | | | |
| | a. Position the 3/8-inch-wide stay tape with one edge of the tape approximately 1/8 inch back of the mark on the left backpart. Stitch the tape to the left backpart along the vent. | 301 | SSaa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 32. | Join backparts. (cont'd) | | | | | |
| | b. Properly position the backparts with edges even and join together at the center back with a 5/8-inch seam from the top edge of the backparts to approximately 3/4 inch below the top end of the vent. Continue the stitching across the top of the left and right vents. The silesia or polyester and cotton stay piece at top end of vent shall be positioned on the right backpart and caught in the stitching at the center back and top end of the vent. | 301 or 401 | SSa-1 SSa-1 | 12-16 12-16 | A A | A A |
| | c. Notch the top end of the right vent diagonally from the juncture point of the vent and center seam allowance of the right backpart to the lower end of the stitching for the center back seam. | | | | | |
| | d. Spread open back center seam and press flat with a heated pressing iron. | | | | | |
| | e. Turn the left vent to the inside in accordance with the bottom notch and the joining center back seam. Baste the entire length of the vent along the folded edge. On the finished vent, the tape stitching shall not show on the outside. | 101 or Hand | | | | |
| | f. Edgestitch the left vent uniformly 3/8 inch from the folded edge. The folded edge of the vent shall be in line with the center back seam. | 301 | OSf-1 | 12-16 | A (silk) | A |
| | g. Stitch and backstitch diagonally across the top end of the vent opening on the outside through all plies for a distance of 2 ± 1/8 inches from the center back seam. The stitching shall not be through the vent lining. | 301 | SSa-1 | 12-16 | A (silk) | A |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the currenversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 32. | Join backparts. (cont'd) | | | | | |
| | h. Fell the bound edge of left vent to left backpart from top to bottom end of vent. | 301 | EFc-1 | 6-8 | 0 (silk) | 0 |
| 33. | Baste and fell vent lining. | | | | | |
| | Finished appearance. The folded edge of the lining shall be accurately aligned with the center seam allowance on the right backpart. The felling shall not be visible on the outside of the overcoat. | | | | | |
| | a. Turn under the front raw edge of the vent lining, folding the top end over and under the center seam allowance of the right backpart. Baste the lining to the backpart along the top and front edges, catching the turned under portion in the basting. | 301 | Hopper | | | |
| | b. Fell the turned under portion at the front edge of the vent lining to the right backpart with blindstitching from the bottom end to 3/4 to 1 inch from the top end. | 301 | EFc-1(b) | 6-8 | 0 (silk) | 0 |
| 34. | Seam wool facing to front lining. | | | | | |
| | Finished appearance. The lining shall be carefully and properly aligned, and seamed to the facing so that in the finished overcoat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion. | | | | | |
| | a. Position the lining on the wool facing with top edges even and the bottom finished edge of lining matched with the notch in the back edge of the facing in order to insure proper seaming. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 34. | Seam wool facing to front lining. (cont'd) | | | | | |
| | b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. | 301 | SSa-1 | 10-14 | A | A |
| | c. Press the facing seam and bottom edge of the lining smooth and flat with a heated pressing iron. | | | | | |
| 35. | Bind facings. | | | | | |
| | Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely caught in the stitching. Only the outside raw edge of the binding shall be turned under and caught in the stitching 1/16 inch from outside folded edge. | | | | | |
| | a. Bind the raw back edge of the facings with 3/4-to 7/8-inch-wide bias binding from the bottom edge of the overcoat to not less than 1 inch above the bottom finished edge of the lining. | 301 | BSb-1 | 10-14 | A | A |
| 36. | Seam reinforcement stay to armhole and shoulder. | | | | | |
| | Finished appearance. The silesia or polyester and cotton reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers or pleats. | | | | | |
| | a. Seam the 3/4-inch-wide silesia or polyester and cotton stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 | 301 | SSaa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 36. | Seam reinforcement stay to armhole and shoulder. (cont'd) | | | | | |
| | inch from the edges. The top end of the armhole stay and lower edge of shoulder stay shall form a right angle at the armhole without the stays overlapping each other. | | | | | |
| 37. | Join half belt to fronts. | | | | | |
| | Finished appearance. The belt shall be set without twists, gathers, puckers or pleats. | | | | | |
| | a. Position left and right half belt on the outside of the respective fronts with top and bottom edges of belt and notches in back edge of fronts matching and with the raw end of belt and back edge of front even. | | | | | |
| | b. Join the left and right half belt to the respective front 1/8 inch from the raw edges. | 301 | SSa-1 | 10-14 | A | A |
| 38. | Bind fronts and underarm darts. | | | | | |
| | Finished appearance. The binding shall be evenly stitched with no raw edges showing and the fabric caught in the stitching. The binding shall not be tight nor full causing puckers, gathers or pleats. | | | | | |
| | a. Bind the raw back edge of fronts with 3/4-to 7/8-inch wide bias binding from armhole edge to bottom edge of front, catching the end of the left and right half belt in the binding. Only the outside raw edge of the binding shall be turned under and caught in the stitching 1/16 inch from the outside folded edge. | 301 | BSb-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD | |
|---|---|---|---|---|---|---|
| | | | | | NDL | BOBV LPR |
| 38. | Bind fronts and underarm darts. (cont'd) | | | | | |
| | b. Bind the raw edges of the underarm darts with 3/4-inch-wide bias binding with the edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges. | 301 | BSc-1 | 10-14 | A | A |
| 39. | Stitch darts in fronts; press fronts. | | | | | |
| | Finished appearance. The darts shall be properly tapered and shall finish without gathers, puckers or pleats. | | | | | |
| | a. Fold fronts, matching the bound edges of the underarm dart. Stitch the entire length of the dart 3/8 inch from the bound edges at the upper end and taper to zero at the lower end. | 301 | SSa-1 | 10-14 | A | A |
| | b. Fold fronts, matching the cut edges of the neck dart and stitch the entire length of the dart 3/8 inch from the cut edges at the upper end of the dart and taper to zero at the lower end. | 301 | SSa-1 | 10-14 | A | A |
| | c. Spread open the dart seams and press smooth and flat with a heated pressing iron. | | | | | |
| | d. Press and shape the fronts on a suitable type heated pressing machine from the waist to the top edge, shrinking the fronts to eliminate the excess fullness in the chest. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 40. | Assemble hanging pocket and welt on fronts. | | | | | |
| | Finished appearance. The welt shall be uniform in appearance and placement, and shall lie flat and smooth without twists, puckers, pleats or raw edges. All stitching shall be uniform in width. | | | | | |
| | a. Mark fronts in accordance with pattern for position of pocket welt. | | | | | |
| | b. Position the welt on the outside of fronts with the raw edge in line with the mark, and with the folded edge of the welt towards the front of the fronts. Seam the welt to the fronts 3/16 inch from the raw edge. | 301 | SSa-1 | 10-14 | A | A |
| | c. Position hanging pocket on the outside of the fronts with top ply of pocket next to welt and with raw edge of cutout even with raw edge of welt. Notch top and bottom corners of the hanging pocket at the cutout to match the length of the welt. | | | | | |
| | d. Join the top ply of the pocket through the welt and the fronts with a 3/16-inch seam, securely tacking the ends for a distance of approximately 3/8 inch on the line of stitching. | 301 | SSa-1 | 10-14 | A | A |
| | e. Cut the opening in the fronts on a line even with the raw edge of welt and hanging pocket and tongue notch the fronts at the top and bottom ends of the pocket opening; | | | | | |
| | -or- | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 40. | Assemble hanging pocket and welt on fronts. (cont'd) | | | | | |
| | f. The straight part of the opening only may be cut with a Dale Machine in the cutting room. When this method is used, the finished length of the opening shall be accomplished with hand sheers for cutting diagonally to ends of welt stitching line. The cut ends of opening, either the straight cut or the diagonal (tongue notch) cut, shall not be exposed at either end of the finished welt pocket. | | | | | |
| | g. Bind the raw back edge of front at the pocket opening with 1-1/8-inch-wide bias binding with edges of binding turned under and caught in the stitching 1/16 inch from outer folded edges. | 301 | BSc-1 | 10-14 | A | A |
| | h. Turn the hanging pocket and raw edge of welt through opening to the inside. Turn back the bound edge of pocket at the opening and stitch the fronts 1/16 inch from the raised edge. | 301 | SSq-2 (shows finished seam) | 12-16 | A (silk) | A |
| | i. Stitch the top and bottom ends of the welt to the fronts through the hanging pocket from the stitching for the raised seam at front edge of welt to the back edge of the welt. Stitch diagonally to the outer corners of the topstitching for the welt and continue on the line of topstitching at each end of the welt to the stitching for the raised seam. Stitch on the line of stitching for the raised seam back to the row of stitches at the top and bottom ends of the welt. The stitching at the top and bottom ends of the welt shall be uniformly 1/16 inch from the ends. Care shall be taken when stitching ends of welt to preclude exposed notch at end of welt. | 301 | LSa-2 | 12-16 | A (silk) | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 41. | Make sword slit and attach sword slit buttonhole tab (type II). | | | | | |
| | a. Mark left front 1 inch above front top corner of pocket for a 2-inch-long horizontal sword slit (see Figure 6). | | | | | |
| | b. Mark sword slit buttonhole tab 1/2 inch from raw edge for seaming to overcoat. | | | | | |
| | c. Position sword slit buttonhole tab on outside of front with marks on tab and front matching, with raw edge of sword slit buttonhole tab toward bottom edge of overcoat and with the purling of the buttonhole facing up. Turn back the inside hanging pocket and seam the tab through the front at mark. | 301 | SSa-1 | 12-16 | A (silk) | A |
| | d. Position welt piece for lower edge of sword slit opening on outside of front, with one of the longer edges placed under sword slit buttonhole tab and abutting tab seam. | | | | | |
| | e. Seam welt piece 3/16 inch from raw edge, through the front. | 301 | SSa-1 | 12-16 | A (silk) | A |
| | f. Cut opening for sword slit midway between seams joining tab and welt piece to the front, tongue notching each end of the opening. The notches shall be cut to a sufficient depth for proper pulling of tab and welt piece through the opening, but shall not show on outside of finished overcoat. | | | | | |
| | g. Pull welt piece through opening to inside of overcoat, forming a 3/16-inch-wide welt at lower edge of opening. Topstitch lower edge of opening through welt 1/16 inch below seam joining welt to the front. | 301 | SSe-2 (shows finished seam) | 12-16 | A (silk) | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 41. | Make sword slit and attach sword slit buttonhole tab (type II). (cont'd) | | | | | |
| | h. Pull sword slit buttonhole tab through opening to inside of overcoat and topstitch through tab 1/16 inch from seam. | 301 | SSe-2 (shows finished seam) | 12-16 | A (silk) | A |
| | i. Cut an opening in back edge of hanging pocket to coincide with sword slit opening in front (see Figure 7). The opening shall be 3/8 to 1/2 inch in height and the length shall correspond with length of sword slit. | | | | | |
| | j. Fell upper raw edge of hanging pocket opening to seam allowance of sword slit tab (see Figure 7). | Hand | | 6-8 | C (silk) | |
| | k. Fell welt piece to hanging pocket on all edges (see Figure 7). | Hand | | 6-8 | C (silk) | |
| 42. | Interline fronts. | | | | | |
| | a. Position left and right fronts on the respective coat front interlining. Baste along the vertical center of the fronts from approximately 3 inches below shoulder edge to approximately 1-1/2 inches above bottom edge of front, with the hanging pocket turned back in order not to be caught in the binding. | 301 | Hopper | | | |
| | b. Baste the fronts and interlining together starting at the breakline of lapel approximately 3 inches down from the shoulder edge of fronts and continuing to approximately 1-1/2 inches from armhole, working the fullness towards the armhole. Baste along the front of armhole and continue basting down the back edge of interlining. | 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 42. | Interline fronts. (cont'd) | | | | | |
| | c. Baste along breakline of the lapel, starting approximately 3 inches down from top edge and baste approximately 1 inch from front edge and continue basting to bottom edge of front. | 301 | Hopper | | | |
| 43. | Baste bridle tape to lapel. | | | | | |
| | a. Position the 5/8 inch wide bridle tape on the interlining side of the fronts with the front edge of the tape 1/8 inch beyond the breakline. | | | | | |
| | b. Baste the tape to the lapel evenly and smoothly along the vertical center with normal tension, for a distance of approximately 4 inches, properly distributing the fullness in the breast. Baste the remainder of the tape evenly and smoothly with normal tension. | 101 or 301 | Hopper | | | |
| | c. The tape shall extend from top edge of gorge to 3 inches above the lower end of breakline of lapel. | | | | | |
| 44. | Pad lapels. | | | | | |
| | a. Pad the lapel with not less than 10 rows of blindstitching, placing one row over each edge of the bridle tape. The rows of blindstitching shall extend from approximately 1 inch from front edge of lapel to the breakline, with the fullness properly distributed between the rows in order to roll the lapels. | 103 | SSm-1 (each row) | 4-6 | A | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 45. | Join back and fronts at sides. | | | | | |
| | Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats. For type I overcoats only, where the belt is attached to fronts, an opening shall be left the width of belt for tucking in belt halves. | | | | | |
| | a. Position the back and fronts with edges even and join together at the sides with a 5/8-inch seam, except where belt is attached to fronts for type I overcoats, spread open seam allowance, raise stitch 1/16 inch on the front part catching belt, position belt on opposite side, and stitch backpart 1/16 inch from folded edge forming an open slit. Tack or bartack above and below seam where belt halves are attached to fronts. | 301 | SSa-1 | 12-16 | A | A |
| | | or 401 | SSa-1 | 12-16 | A | A |
| | b. Spread open the side seams and press smooth and flat with a heated pressing iron. | | | | | |
| 46. | Tape armholes. | | | | | |
| | a. Sew one piece of 1/4-inch-wide stay tape to the armhole. The tape shall extend from approximately 1-1/2 inches above the notch on the front to approximately 1 inch from the shoulder. The tape shall be stitched with normal tension and shall be sewn to the wool fronts only, not to the interlining. The tape shall be held taut with stitching drawing up the material 3/8 to 1/2 inch evenly distributed. | 301 | SSaa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 47. | Press fronts, lapels and armholes.<br><br>a. Press the fronts individually on a chest pressing machine. Press the armhole tape and lapels smooth and flat with a heated pressing iron or machine. | | | | | |
| 48. | Shape fronts.<br><br>a. Mark and shape the front edge of fronts. Mark and shape the lapels in accordance with the shaper furnished.<br><br>b. Mark the overcoat 1-1/4 inches above the bottom edge for the bottom turnup. In lieu of marking, the width of the bottom turnup may be gaged when tape is sewn along bottom edge of the overcoat. The right front shall not extend below the bottom edge of left front.<br><br>c. Trim the corners of the lapel interlining, the bottom edge of the interlining, and the bottom edge of overcoat, matching the length of the right and left back parts at the vent. Trim bottom corners of side seam allowances and lower inside corner of left vent.<br><br>d. Trim coat front interlining 1/4 to 3/8 inch back from top and front edges of lapel and front edge of fronts.<br><br>e. In the finished overcoat, the lapels shall be in accordance with the finished lapel shaper. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD | |
|---|---|---|---|---|---|---|
| | | | | | NDL | BOB/ LPR |
| 49. | Bind bottom turnup. | | | | | |
| | Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats. The basic material and edges of binding shall be securely caught in the stitching. Only the outside raw edge of the binding shall be turned under and caught in the stitching. | | | | | |
| | a. Bind the raw edge of the bottom turnup with 3/4-to 7/8-inch wide bias binding, from the back edge of the front cutout to the edge of vent. Only the outside raw edge of the binding shall be turned under and caught in the stitching 1/16 inch from the outside folded edge. | 301 | BSb-1 | 10-14 | A | A |
| 50. | Baste facing-lining assembly to front. | | | | | |
| | a. Properly position the right and left facing-lining assembly to the outside of the respective fronts and baste along the lapel breakline, distributing the fullness in the breast area. Continue to baste along the front and bottom edges. Baste from the top and front edges of lapel down to the lower end of lapel working the fullness towards the center of lapel. | 301 or Hand | Hopper | | | |
| 51. | Join facings and fronts with tape. | | | | | |
| | a. Join the facings and fronts together 3/16 inch from top and front edges of lapel, and front and bottom edges of overcoat, with the 3/8-inch-wide stay tape positioned on the interlining side of fronts 1/8 inch from the edges and caught in the stitching. | 301 | SSa-1 | 12-16 | A | A |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 51. | Join facings and fronts with tape. (cont'd)<br><br>b. The tape shall extend from approximately 1/2 inch to the back of lapel notch to the mark for the bottom turn-up and continue along the bottom edge to the side seam. The tape shall be sewn with normal tension along the top and front edges of the lapel and with slight tension along the front edge of the overcoat.<br><br>c. Trim the fronts even at the top and front edges of the lapel and front edges of overcoat. The edges shall be trimmed with a knife attachment on the sewing machine or may be trimmed by hand.<br><br>d. Fell inside edge of 3/8-inch-wide stay tape to coat front interlining from top end of tape to the bottom edge of interlining.<br><br>e. Press the front edges smooth and flat with a heated pressing iron or pressing machine, removing the fullness.<br><br>f. Remove all basting stitches, trim lower front corner of facings and corner of lapels and notch lapels for proper turning.<br><br>g. Spread open the front facing seam from lapel notch to the bottom edge of overcoat and press smooth and flat with a heated pressing iron. | 103 | SSm-1 | 4-6 | A | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 52. | Baste front and bottom edge of overcoat. | | | | | |
| | a. Turn the facing-lining assembly to the inside of the fronts, working out the corner of the lapel completely. Turn up the bottom of the overcoat, lapping the facing on the bottom turnup and working out the front corner completely. | | | | | |
| | b. Baste along the top and front edges of lapels and the front and bottom edges of overcoat, working the seams to the edge of overcoat. | 101 | | | | |
| | -or- | | | | | |
| | c. Place a second row of basting along the bottom turnup 1/4 inch from the bound edge. | | | | | |
| | d. Baste approximately 1-1/4 inches from top and front edges of lapels and front and bottom edges of overcoat, holding the lower front corner in such a manner as to cause the lower front edge to roll inward. | 301 or Hand | Hopper | | | |
| | e. Baste the lapels diagonally from the corner to the breakline, properly placing the fullness to allow the lapel to roll. | 301 or Hand | Hopper | | | |
| | f. Baste along the breakline of the lapel, properly placing the fullness in the facing to allow lapel to roll. | 301 or Hand | Hopper | | | |
| 53. | Tack hanging pocket to interlining. | | | | | |
| | a. Turn back the facing-lining assembly, properly positioning the hanging pockets, and baste pockets to interlining and fronts. | 301 or Hand | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 53. | Tack hanging pocket to interlining. (cont'd) | | | | | |
| | b. Securely tack front edge of the hanging pockets to the coat front interlining only with overcast stitching. | Hand | | 1-2 | A | |
| | -or- | | | | | |
| | c. The front edges of pocket may be tacked to interlining with blind-stitching. | 103 | SSm-1 | 4-6 | A | |
| 54. | Baste facing to fronts; tack facing to interlining. | | | | | |
| | a. Turn facing-lining assemblies flat against fronts. Baste as close as possible to the facing-lining seam, placing the fullness over the chest. Continue basting along the bound edges of the facing to the bottom turnup. | 301 or Hand | Hopper | | | |
| | b. Turn back the lining and tack seam allowance of facing-lining assemblies to interlining only with overcast stitching from approximately 1 inch above bottom finished edge of lining to approximately 3 inches below shoulder edge of facing. | Hand | | 1-2 | | |
| | -or- | | | | | |
| | c. The seam allowance of facing-lining assemblies may be tacked to the interlining only with blindstitching. | 103 or 301 | SSm-1 SSm-1 | 4-6 4-6 | A A | A |
| 55. | Baste yoke lining to back. | | | | | |
| | a. Properly position and baste rayon yoke lining to the inside of the back along the center pleat, armholes, shoulder (allowing room for shoulder pad) and bottom edges of the yoke. | 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 56. | Baste front lining. | | | | | |
| | a. Fold the front lining at the shoulder in accordance with the notches, forming the chest pleat, and baste along the vertical center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole. | Hand or 301 | Hopper | | | |
| | b. Baste the lining to the overcoat, starting at the lower end of the chest pleat and continuing along the lower edge of the armhole, approximately 1-1/2 inches from the edge, to the side seam. Continue basting along the side seam and across the bottom edge of lining. | Hand or 301 | Hopper | | | |
| 57. | Trim lining and interlining. | | | | | |
| | a. Trim the excess coat front interlining and front and back lining at the armhole. | | | | | |
| | b. Trim yoke lining even with the back at the neck. | | | | | |
| 58. | Fell facings and bottom turnup. | | | | | |
| | a. Fell the bound edge of the facings to the front from bottom edge of hanging pockets to bound edge of bottom turnup. Continue to fell bound edge of bottom turnup to fronts and backparts with blindstitching. | 301 | EFc-1 | 6-8 | 0 (silk) | 0 |
| | b. Fell facings to the outer ply of hanging pocket only from bottom edge of pocket to not less than 1 inch above the bottom finished edge of the front lining. | Hand or 301 | EFc-1 | 8-10<br>6-8 | C (silk)<br>0 (silk) | 0 |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the currentversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 59. | Baste shoulder pad. | | | | | |
| | a. Insert shoulder pad between interlining and chest padding of coat front interlining in line with armhole edge and securely tack the pad to the interlining and chest padding only. | 301 or Hand | | | | |
| 60. | Seam shoulders. | | | | | |
| | Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulders may be properly shaped. | | | | | |
| | a. Join the back and fronts together at the shoulders with a 3/8-inch seam, working in the proper fullness on the backs in accordance with good manufacturing practice. | 301 | SSa-1 | 12-16 | A | A |
| | | or 401 | SSa-1 | 12-16 | A | A |
| | b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short. Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished overcoat. | | | | | |
| 61. | Set shoulder straps (type I). | | | | | |
| | Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the overcoat without twists, puckers, pleats, or other distortion. On the finished overcoat, the straps, including the piping, shall measure 2-3/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches wide at the rounded neck end. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 61. | Set shoulder straps (type I). (cont'd) | | | | | |
| | a. Position narrow end of shoulder strap 7/8 to 1 inch from raw edge of the gorge (neck edge). Line the shoulder strap with back edge of strap 3/8 to 1/2 inch to back of shoulder seam at the armhole. | | | | | |
| | b. Seam the shoulder straps to the overcoat at the front and back edges and around the collar end, as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder strap even with the armhole, where necessary. | 301 | SSa-1 | 10-14 | A | A |
| 62. | Set shoulder straps (type II). | | | | | |
| | Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the overcoat without twists, puckers, pleats or other distortion. On the finished overcoat, the straps shall measure 2-3/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches wide at the eyelet end of the buttonhole. | | | | | |
| | a. Position the shoulder straps with the collar end at the edge of the gorge, the back edge at the collar end in line with, or not more than 1/8 inch to the back of, shoulder seam, and the back edge at the armhole end 3/8 inch to the back of shoulder seam. | | | | | |
| | b. Stitch the shoulder straps to the overcoat 3/8 inch from the armhole edge, trimming the strap even at the armhole. | 301 | SSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 63. | Baste shoulders. | | | | | |
| | a. Position shoulder interlining and lining in place. Baste the upper part of each shoulder horizontally on the outside, then turn the coat on the inside. | 301 or Hand | | | | |
| | b. Turn under raw edge of yoke lining at the shoulders. Baste the folded edge over the front lining and continue to baste across neck at back. | 301 or Hand | | | | |
| | c. In lieu of basting the lining as indicated in 63.b. and hand felling as required in 76.e.,trim the shoulder edge of the front lining, coat front interlining, and yoke lining to approximately 3/8 inch from shoulder at the armhole edge and tapering to 1/8 inch at the neck, and join the yoke lining to the facing lining assembly at the shoulder with 3/8-inch seam, securing the top end of chest pleat in the seam. In the finished coat, the yoke lining shall be lapped on the facing lining assembly. | 301 | SSa-1 | 10-14 | A | A |
| 64. | Stitch hanger and size label. | | | | | |
| | Finished appearance. The size label and the ends of the overcoat hanger shall be properly positioned to the inside center back of the overcoat at the neck. | | | | | |
| | a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of the overcoat at the neck. | 301 | SSa-1 | 12-16 | A | A |
| | b. The hanger opening in the finished overcoat shall be 1-1/2 inches long when measured along the lower edge of the topcollar. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN LPR |
|---|---|---|---|---|---|---|
| 65. | Join topcollar-collarstand assembly to facing at gorge. | | | | | |
| | Finished appearance. The seam joining topcollar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats or other distortions. | | | | | |
| | a. Properly position the collar on the inside of the overcoat with the lower edge of topcollar and collarstand even with top edge of facing and with the lapel notch and lower corners of topcollar matching. | | | | | |
| | b. Join the topcollar-collarstand assembly to the facings at the gorge from lapel notch to not less than 1 inch behind the lapel breakline. | 301 | SSa-1 | 12-16 | A | A |
| | c. Notch the gorge of the facings at the end of joining seam. | | | | | |
| 66. | Tack topcollar-collarstand assembly to fronts at gorge. | | | | | |
| | a. Spread open the seam joining the topcollar-collarstand assembly to the facings and tack seam allowance of the topcollar to the fronts at the gorge from lapel notch to end of the seam. The seam allowance may be pressed open with a heated pressing iron before tacking the gorge seam. | 301 or Hand | | 12-16<br>2-4 | A<br>C (silk) | A |
| 67. | Baste undercollar to overcoat. | | | | | |
| | Finished appearance. The center seam of the undercollar shall be in line with center back seam of overcoat. Fullness in the collar shall be properly placed over the shoulders to permit the collar to lie flat. | | | | | |
| | a. Mark the overcoat 5/8 inch along neck edge from lapel notch to lapel notch. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 67. | Baste undercollar to overcoat. (cont'd) | | | | | |
| | b. Position lower edge of undercollar at the mark and securely tack the corners of the collar across the juncture point of the collar and the lapel. | Hand | | | C (silk) | |
| | c. Baste the undercollar to the fronts and backparts, placing proper fulness over the shoulders, and aligning the center seam of undercollar with center seam of backparts. | Hand or Machine | | | | |
| | d. In the finished overcoat, the ends of the collar and top edge of lapels, when measured from the tacked corners to finished edges of collar and lapel, shall be 3-1/4 ± 1/8 inches for size 34 and 3-3/4 ± 1/8 inches for sizes 36 to 46, inclusive. | | | | | |
| 68. | Tack neck outlet. | | | | | |
| | a. Tack neck outlet of basic material and lining to collar interlining from gorge notch to gorge notch with overcast stitching. | Hand or Machine | | 2-3<br>6-8 | C (silk)<br>A | <br>A |
| 69. | Baste topcollar to overcoat. | | | | | |
| | a. Turn under the lower edge of the topcollar from gorge notch to gorge notch, lapping the folded edge on the facing and lining at the shoulders and on the yoke lining at the back. Baste topcollar to undercollar and back at the neck. | Hand or Machine | | | | |
| | b. In lieu of operation 68.a, 69.a and 75.b, stitch lower edge of topcollar across neck from gorge seam to gorge seam. | 301 | SSa-1 | 12-16 | A | A |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 70. | Edgestitch overcoat. | | | | | |
| | Finished appearance. The overcoat shall be uniformly edgestitched without twists, puckers or pleats. | | | | | |
| | a. Edgestitch the bottom and front edges of the overcoat and the front and top edges of the lapels. Continue the stitching across collar seam and edgestitch the edges of the collar. | 301 | SSe-2 (edges of overcoat) (shows finished seam) OSa-1 (collar) | 12-16 | A (silk) | A |
| | b. The stitching shall be uniformly 3/8 inch from all edges. The stitching along the bottom edge of overcoat shall extend the width of the facings. | | | | | |
| 71. | Make buttonholes. | | | | | |
| | Finished appearance. The buttonholes shall be clean-cut, well made, properly positioned, well worked over gimp to fit a 40-line insignia button and the stitching shall be securely caught in the basic material. The gimp and thread shall be pulled through to the underside of the buttonholes. The purling of the buttonholes shall be on the outside of the fronts. The buttonholes shall be cut-first type. | | | | | |
| | a. Mark the location for three buttonholes on the left front in accordance with marks on pattern. In the finished overcoats, the buttonholes shall be evenly spaced and the distance between the center of the top and bottom buttonholes shall be as follows: | | | | | |

| Sizes | Distance between top and bottom buttonholes (inches) 1/ |
|---|---|
| Regular | 12-1/2 |
| Long | 13-1/4 |
| Extra Long | 14 |

1/ Tolerance: ± 1/2 inch



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 71. | Make buttonholes. (cont'd) | | | | | |
| | b. Make a horizontal eyelet-end square bar type buttonhole, cut 1-1/8 inches long, at each of the marks. The inside edge of the eyelet end of the buttonhole shall be 3/4 inch from the front edge of overcoat. | But-ton-hole | | 54 per button (not including bartack) | B (silk) | F |
| | c. Securely bartack the end of each buttonhole, catching the gimp in the stitching, and trim the ends of the gimp and thread. | Bar-tack | | 21 per bartack | A (silk) | A |
| 72. | Set sleeves. | | | | | |
| | Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole sleeve seam shall finish smooth and flat without twists, puckers or pleats. The armhole shall not be stretched or distorted due to pressing. | | | | | |
| | a. Position the outside sleeves on outside of overcoat at the armholes, with back notch of sleeve matching notch in the back and with notch in top sleeve and fronts matching. | | | | | |
| | b. Join the sleeves to the overcoat with a 3/8-inch seam, evenly distributing the fullness in accordance with good manufacturing practice, and catching the ends of the shoulder straps in seams. | 301 | SSa-1 | 12-16 | A | A |
| | c. Notch armhole seam allowance on back and front and adjacent to each side of shoulder strap. | | | | | |
| | d. Press the entire armhole smooth and flat with heated pressing iron to remove the fullness. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 72. | Set sleeves. (cont'd) | | | | | |
| | e. Spread open the upper part of the armhole sleeve seam, (except at the shoulder strap area) from the backarm sleeve seam to approximately midway between shoulder seam and front notch. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole. The ends of the shoulder straps at the armhole shall not be pressed back. | | | | | |
| 73. | Baste armholes. | | | | | |
| | a. Baste around inside armholes, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the overcoat on the outside. | 301 or Hand | | | | |
| | b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of the overcoat. | 301 or Hand | | | | |
| 74. | Stitch sleeve head pads and linings at armhole. | | | | | |
| | Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and lining at the armhole. | | | | | |
| | a. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts. | | | | | |
| | b. Stitch the sleeve head pad to the sleeve from end to end through the armhole sleeve seam allowance 1/8 inch from the folded edge of the pad. | 301 | SSa-1 | 4-6 | 30/3 | 30/3 |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 74. | Stitch sleeve head pads and linings at armhole. (cont'd) | | | | | |
| | The front and yoke linings and the shoulder pad shall be caught in the stitching. Continue stitching the lining around the remainder of the armhole, trimming away the excess lining and interlining. | | | | | |
| 75. | Fell collar to overcoat. | | | | | |
| | a. Fell the lower edge of the under-collar to the fronts and the back parts from end to end. The under-collar may be machine felled to over-coat. | Hand or Mach-ine | LSa-1 | 8-10<br>8-12 | C (silk)<br>C (silk) | |
| | b. Fell the folded edge of the top-collar to the overcoat from gorge seam to gorge seam. The top edge of size label and the ends of the overcoat hanger shall be caught in the felling. | Hand or 306 | LSa-1 | 8-10<br>8-12 | C (silk)<br>0 (silk) | 0 |
| 76. | Fell lining. | | | | | |
| | a. Position the sleeve lining at the armhole with back and forearm seams of sleeves and linings matched. Turn under the armhole edge of the sleeve lining and lap the linings on the out-side of the front and yoke linings at the armhole. Fell the sleeve lining to the overcoat around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness in accord-ance with good commercial practice, and backstitching the lower armhole edge from approximately 1-1/2 inches to the front of forearm sleeve lining seam to the side seam of body lining. | Hand | | 8-10 | C (silk) | |
| | -or- | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD | |
|---|---|---|---|---|---|---|
| | | | | | NDL | BOBV LPR |
| 76. | Fell lining. (cont'd) | | | | | |
| | b. The sleeve lining may be stitched by machine to the armhole on the inside from forearm seam of sleeve to backarm seam across the undersleeve. Top portion may be felled by machine (simulated hand felling stitch). | 301 | SSa-1 | 12-16 | A | A |
| | c. Fell the top edge of the right vent lining to the overcoat and continue the felling along the front and back edges of the lining for a distance of 3/4 to 1 inch down from top edge. | Hand | | 8-10 | C (silk) | |
| | d. Tack the lower front corner of front lining to the bound back edge of the facings. Tack the bottom finished edge of front and yoke linings to the side seam outlet. | Hand | | 8-10 | C (silk) | |
| | e. Fell the back lining and facing-lining assembly together at the shoulder, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling. | Hand | | 8-10 | C (silk) | |
| 77. | Tack facing and bottom turnup. | | | | | |
| | a. Fell the bound back edge of the facings to the overcoat from the bottom to the bound top edge of the bottom turnup. | Hand | | 8-10 | C (silk) | |
| | b. Fell the ends of the bottom turnup to the body of the overcoat at the vent. The felling on the left end of the bottom shall be continued along the bound top edge of the turnup, the width of the left vent. | Hand | | 8-10 | C (silk) | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 78. | Set lapel buttonhole tab.<br><br>Finished appearance. The lapel tab shall be properly positioned and shall not be exposed to the outside front edge of overcoat. The purling of the buttonhole shall be face up when buttoned.<br><br>a. Position the tab on the underside of the left lapel side as shown in Figures 1 and 3.<br><br>b. Fell tab to the lapel along the serged edge, catching the front interlining in the felling. | Hand | | 8-10 | C (silk) | |
| 79. | Finish sword slit.<br><br>a. Properly position left front lining. Baste lining to front in order to hold lining in position for cutting of opening for sword slit tab. The basting stitches shall be around the entire buttonhole tab and shall be as close as possible to the edges of the tab.<br><br>b. Cut opening for sword slit in lining to correspond with openings in front and hanging pocket.<br><br>c. Fell upper cut edge of lining to sword slit buttonhole tab. Fell lower cut edge of lining to lower folded edge of front at sword slit opening.<br><br>d. Cut 2-inch-long opening in the 3 by 3-inch sword slit patch, 1/2 inch from one edge. The opening shall extend 1 inch on each side of vertical center of patch. Pull sword slit buttonhole tab through the opening. | Hand | | 6-8 | C (silk) | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 79. | Finish sword slit. (cont'd) | | | | | |
| | e. Position patch on the lining and sword slit buttonhole tab with opening in patch towards the top of lining. Insert free end of tab through opening in patch and pull through to topside of lining. Fell patch to lining on all edges. Fell upper and lower cut edges of patch at the opening to sword slit buttonhole tab and lower folded edge of front at sword slit opening, respectively. | Hand | | 6-8 | C (silk) | |
| 80. | Clean overcoat. | | | | | |
| | a. Pull and remove all basting threads. Trim all ends of stitching and remove all loose ends of thread from the overcoat. Remove all spots, stains, shade tickets and marking without injury to the material. | | | | | |
| 81. | Press overcoat. | | | | | |
| | Finished appearance. The overcoat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. | | | | | |
| | a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. | | | | | |
| | b. Press the entire collar smooth and flat, stretching where necessary to obtain the proper shape and straighten the edges. During the pressing operation, all fullness shall be worked towards the center of the collar and removed by shrinking. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the currentversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 81. | Press overcoat. (cont'd)<br><br>c. Press the upper half of the fronts on a body machine, shrinking in and properly shaping the chest.<br><br>d. Press the lower half of the fronts and pocket welt smooth and flat.<br><br>e. Press the sides, working the fullness towards the back.<br><br>f. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent.<br><br>g. Press the sleeves smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 3 to 3-1/2 inches below the armhole. The backarm crease shall be in line with the forearm crease.<br><br>h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. During the pressing operation, the shoulder straps shall be properly positioned over the shoulder seam and pressed flat.<br><br>i. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and back of armhole shall be held short while pressing.<br><br>j. Block the armholes on a pressing buck, shrinking in the top sleeves. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 81. | Press overcoat. (cont'd)<br><br>k. Press the lapels smooth and flat, straightening the edges. During the pressing operation, the fullness shall be worked towards the center of the lapel and removed by shrinking. The lapels shall remain rolled pressed.<br><br>l. Press the collar on a collar machine, creasing on the breakline and shaping in order to obtain the proper contour while pressing. Creasing of the collar shall extend from shoulder seam to shoulder seam.<br><br>m. Remove all wrinkles and impressions from under lapels, collar and shoulder straps. Press the lining throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat. Remove all gloss marks. | | | | | |
| 82. | Mark for buttons.<br><br>a. Mark the location for sewing three 40-line insignia buttons to each front of the overcoat in accordance with marks on patterns. On the finished overcoats, the center of the buttons from the front edge of the overcoat shall be as follows:<br><br>Size — Distance from front edge<br>34 — 6 ± 1/4 inches<br>36 to 46 — 7 ± 1/4 inches<br><br>The buttons on the right front shall be in horizontal alignment with the buttons on the left front. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBN/ LPR |
|---|---|---|---|---|---|---|
| 82. | Mark for buttons. (cont'd)<br><br>b. Mark the location for sewing two 40-line insignia buttons to the right half belt in accordance with the pattern marker. On the finished overcoat, the buttons shall properly engage buttonholes in the left half belt.<br><br>c. Mark the location for sewing one 22-line sewing hole button to the outside of the right vent to properly engage button-loop on the left vent.<br><br>d. Mark the location for sewing one 22-line sewing hole button to the undercollar to properly engage lapel buttonhole tab on the left lapel.<br><br>e. Mark the location for sewing one 30-line sewing hole button to each shoulder of the type II overcoat to properly engage the buttonhole in the shoulder straps. On the finished type II overcoat, the straps when buttoned shall lie smooth and flat without twisting or bulging.<br><br>f. Mark sword slit patch for the location of one 22-line sewing hole button to properly engage with buttonhole in sword slit tab (type II overcoat). | | | | | |
| 83. | Sew on buttons.<br><br>Finished appearance. The buttons shall be securely sewn to the overcoat and shall properly engage buttonholes in the left front, half belt and lapel tab. The buttons on the right front and on the half belt shall finish with the eagle upright. The buttons shall be securely sewn to the overcoat with | | | | | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOBV LPR |
|---|---|---|---|---|---|---|
| 83. | Sew on buttons. (cont'd) | | | | | |
| | the end of the stitching securely tacked. The regular shank buttons shall be sewn to the right front and belt. The short shank button shall be sewn to the left front. | | | | | |
| | a. Sew one 40-line insignia button at each of the marks on the right and left front. The top button on each front shall be sewn through the front, interlining and facing. The remaining two buttons on each front shall be sewn through the front, interlining and front part of the hanging pocket. | 101 or 301 | | 21 per button<br>21 per button | 24/4<br>24/4 | <br>24/4 |
| | b. Sew one 40-line insignia button at each of the marks on the right half belt through all plies. | 101 or 301 | | 21 per button<br>21 per button | 24/4<br>24/4 | <br>24/4 |
| | c. Sew one 22-line sewing hole button at the mark on the right vent through the vent lining. | 101 or 301 | | 20-22 per button<br>14-16 per button | 24/4<br>24/4 | <br>24/4 |
| | d. The 40-line insignia buttons on the fronts and on the half belt shall be sewn with the eagle upright. | | | | | |
| | e. Sew one 22-line sewing hole button at the mark on the undercollar, catching the undercollar interlining in the stitching. Thread shall be wrapped three times to form a shank, with the ends of thread tacked off. The stitches shall not show on the outside of collar, | Hand | | 8 per button double not including wrapping | 24/4 | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | THREAD NDL | THREAD BOB/ LPR |
|---|---|---|---|---|---|---|
| 83. | Sew on buttons. (cont'd) | | | | | |
| | f. For type II overcoats, sew one 22-line sewing hole button at the mark on sword slit patch and wrap not less than four times. Stitching shall catch the pocket stay material. | Hand | | 8 per button (double thread) | 24/4 | |
| | g. For type II overcoats, sew one 30-line sewing hole button at the mark on each shoulder. The buttons shall be sewn through the facing. | 101 or 301 | | 21 per button<br>21 per button | 24/4<br>24/4 | <br>24/4 |

3.7 Finished measurements. The finished overcoat shall conform to the measurements shown in Table II.

Table II. - Overcoat measurements

| Size | 1/2 Breast inches 1/ | Back length inches 2/ | Sleeve length inches 3/ |
|---|---|---|---|
| | Regular | | |
| 34 | 19-1/2 | 45-1/4 | 18 |
| 36 | 20-1/2 | 45-1/2 | 18 |
| 38 | 21-1/2 | 45-3/4 | 18 |
| 40 | 22-1/2 | 46 | 18 |
| 42 | 23-1/2 | 46-1/4 | 18 |
| 44 | 24-1/2 | 46-1/2 | 18 |
| 46 | 25-1/2 | 46-3/4 | 18 |
| | Long | | |
| 34 | 19-1/2 | 47-3/4 | 19 |
| 36 | 20-1/2 | 48 | 19 |
| 38 | 21-1/2 | 48-1/4 | 19 |
| 40 | 22-1/2 | 48-1/2 | 19 |
| 42 | 23-1/2 | 48-3/4 | 19 |
| 44 | 24-1/2 | 49 | 19 |
| 46 | 25-1/2 | 49-1/4 | 19 |



Source: https://assist.dla.mil -- Downloaded: 202640-20T21:09Z
Check the source to verify that this is the current version before use.

Table II. - Overcoat measurements
(cont'd)

| Size | 1/2 Breast inches 1/ | Back length inches 2/ | Sleeve length inches 3/ |
|---|---|---|---|
| | | Extra Long | |
| 36 | 20-1/2 | 50-1/2 | 20-1/2 |
| 38 | 21-1/2 | 50-3/4 | 20-1/2 |
| 40 | 22-1/2 | 51 | 20-1/2 |
| 42 | 23-1/2 | 51-1/4 | 20-1/2 |
| 44 | 24-1/2 | 51-1/2 | 20-1/2 |
| Tolerance | ± 3/4 | ± 3/4 | + 1/2<br>- 3/8 |

1/ Tolerance is on 1/2 breast. Breast measurement taken with overcoat buttoned, lying flat and without streatching, from folded edge to folded edge (in line with pit of armholes).

2/ Back measurement taken along back seam from lower edge of undercollar to bottom edge of overcoat.

3/ Sleeve length measurement taken along underarm seam from pit of armhole to bottom edge of cuff.

3.8 Workmanship. The finished overcoats shall conform to the quality and grade of product established by this specification. The occurence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

*4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

*4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.



Source: https://assist.dla.mil -- Downloaded: 20260-20T21:09Z
Check the source to verify that this is the current version before use.

*4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

*4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-1391.

*4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated overcoat for all provisions of this specification.

*4.5 Quality conformance inspection.

*4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing specified in FED-STD-191, wherever applicable, shall be followed.

*4.5.1.1 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

*4.5.2 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each overcoat shall be buttoned on a model form and examined for those defects identified by an asterisk (*) and listed as selected defects in MIL-STD-1391. Any coat containing a selected defect shall not be included in the end item lot.

*4.5.2.1 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1391 and Table II of this specification.

*4.5.3 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1391. The occurence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1391.

*5. PACKAGING

*5.1 Preservation and packaging. Preservation and packaging shall be level A or commercial as specified (see 6.2).



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

5.1.1 Level A. Fold the overcoats in half lengthwise inside out with the front edges and lapels aligned, the collar turned up and sleeves lying full length between the fold. The overcoats shall be folded in half again in the length and then folded in half in the width.

*5.1.2 Commercial. Overcoats shall be packaged to afford adequate protection against physical damage during shipment from the supplier to the first receiving activity. The package and the quantity per package shall be the same as that normally used by the contractor for retail distribution.

* 5.2 Packing. Packing shall be level A, B or commercial (see 6.2).

5.2.1 Level A.

*5.2.1.1 Method 1. Ten overcoats of one size only, folded as specified in 5.1.1 shall be packed in a fiberboard shipping container with liner conforming to weather-resistant class, grade V25 size 3A of MIL-B-17757. Every other overcoat shall be placed in the shipping container with the collar at opposite ends and armholes at opposite sides. Not less than 8 ounces of napthalene flakes, conforming to class B of R-N-91 (see 6.4) shall be uniformly distributed throughout the contents of each container. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed and reinforced as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.1.2 Method 2. When specified (see 6.2), three level B shipping containers (30 overcoats of one size only) shall be overpacked in a fiberboard shipping container conforming to weather-resistant class, size 4 of MIL-B-17757 reinforced as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

*5.2.2 Level B. Ten overcoats of one size only, folded as specified in 5.1.1, shall be packed in a fiberboard shipping container with liner conforming to domestic class, size 3A of MIL-B-17757. The fiberboard used for fabricating the container and the liner shall be grade 275 and 200 respectively. Every other overcoat shall be placed in the shipping container with the collar at opposite ends and the armholes at opposite sides. Not less than 8 ounces of napthalene flakes conforming to class B of R-N-91 (see 6.4) shall be uniformly distributed throughout the contents of each container. In addition, each container shall have the contents completely covered on top and bottom with a sheet of



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

60-pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled and closed as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

*5.2.3 Commercial. Overcoats, packaged as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rates for such supplies. The quantity per shipping container shall be the same as that normally used by the contractor for retail distribution. Containers shall comply with the U. S. Postal Service Manual, Uniform Freight Classification Rule or National Motor Freight Classification Rule, as applicable.

*5.3 Marking. In addition to any special marking required by the contract or order, interior packages and shipping containers shall be marked in accordance with MIL-STD-129.

*5.3.1 Mixed sizes. Each shipping container, packed with mixed sizes only, shall have a 5 X 4 inch white paper label securely attached to the end and side directly under the printing or stenciling. The words "MIXED SIZES" shall be plainly stamped or printed thereon and under these words shall be legibly stamped or printed the correct quantity and sizes contained therein.

6. NOTES

6.1 Intended use. The type I overcoat described herein is intended to be worn by male enlisted personnel and the type II overcoat by male officers of the U. S. Marine Corps ceremonial troops.

*6.2 Ordering data. Procurement documents should specify the following:

*6.2.1 Procurement requirements.

(a) Title, number and date of this specification.
(b) Type and size required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Number of overcoats in first article (see 3.2).
(e) Selection of applicable levels of packaging and packing (see 5.1 and 5.2).
(f) When level A, method 2, packing is required (see 5.2.1.2).

6.2.2 Contract data requirements. Data conforming to Data Item Descriptions DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a Form DD-1423 included in the contract.



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

*6.3 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 Moth repellent. The moth repellent requirement (see 5.2.1.1 and 5.2.2) is not applicable when overcoats are made of moth repellent treated cloth.

6.5 First article. Examinations, test and approval shall be as specified by the contracting officer (see 3.2).


*6.6 Figures. Figures 1 through 7 show general design of the overcoat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

*6.7 Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modification, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship of the last previous issue.

Preparing activity:
Navy - MC
Project No. 8405-N793



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

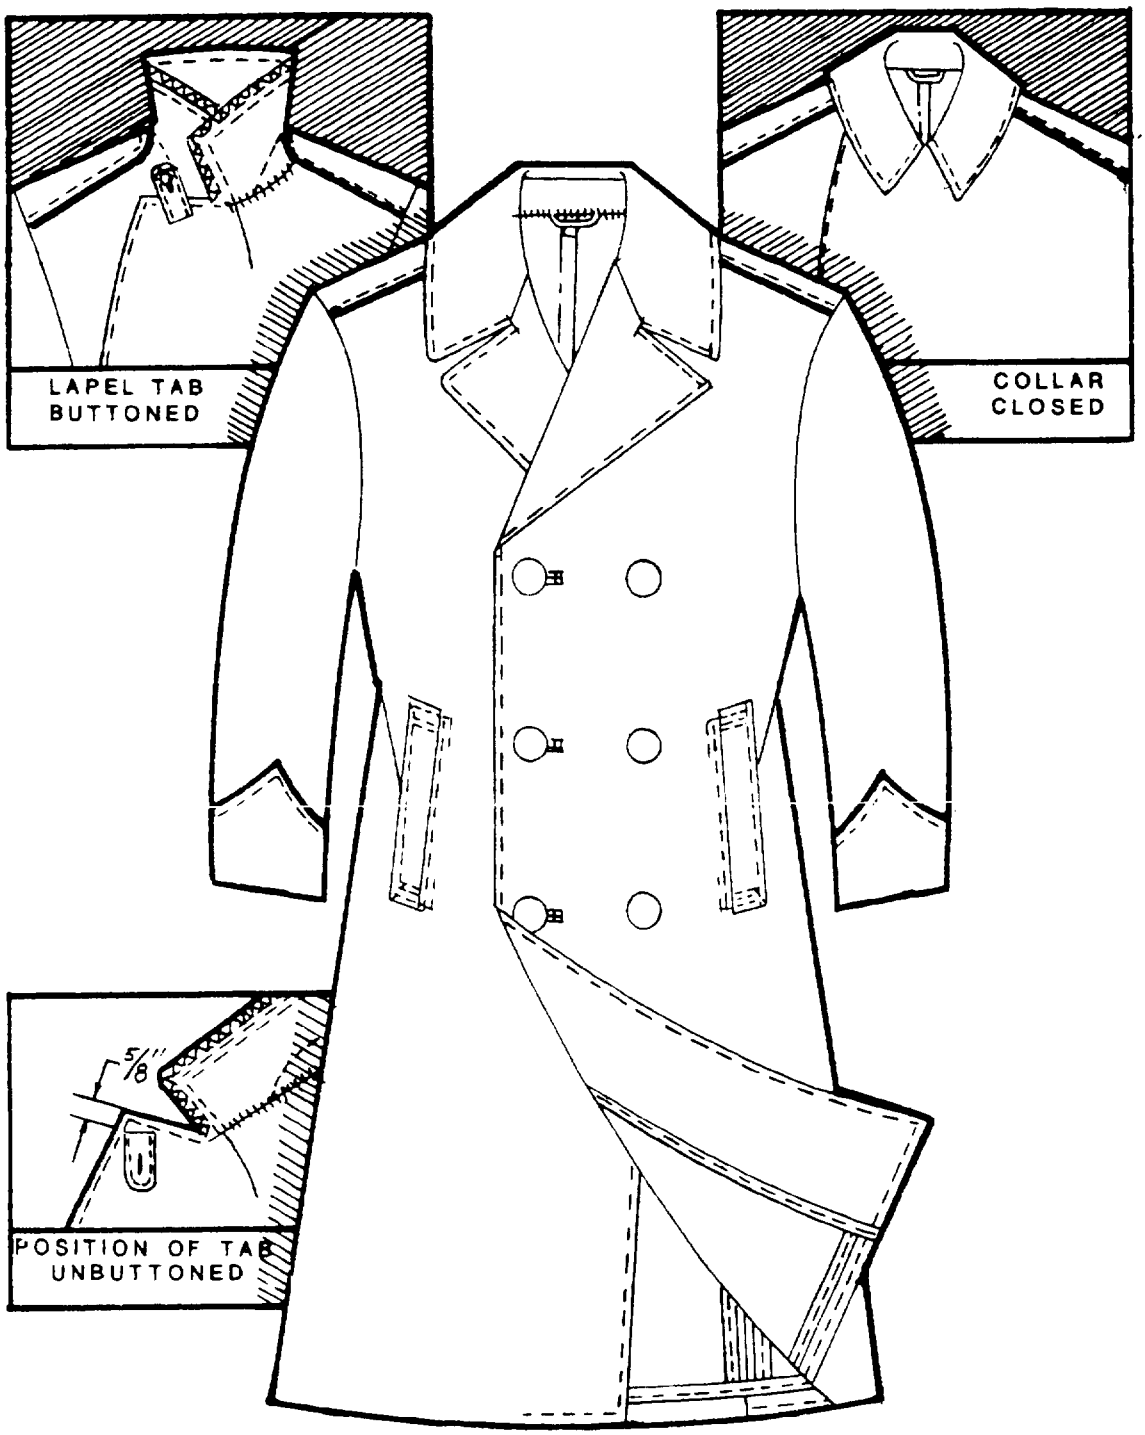



(TYPE I)

FIG. 1 OVERCOAT, MAN'S, WOOL GABARDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

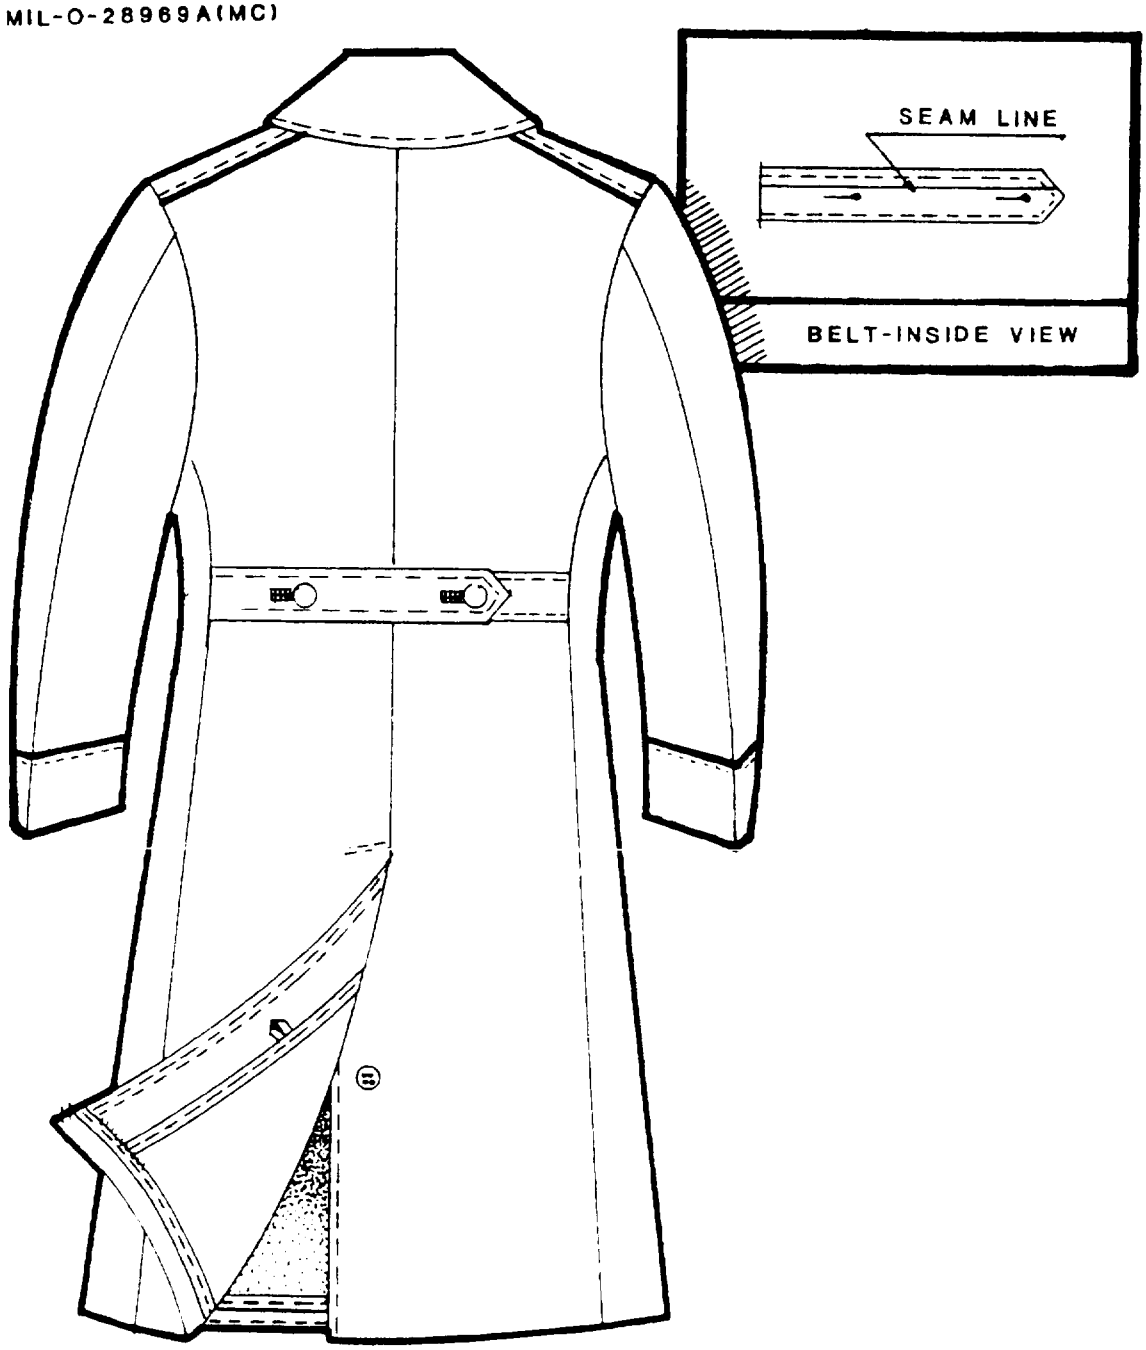



(TYPE I)

FIG. 2. OVERCOAT, MAN'S: WOOL GABARDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.

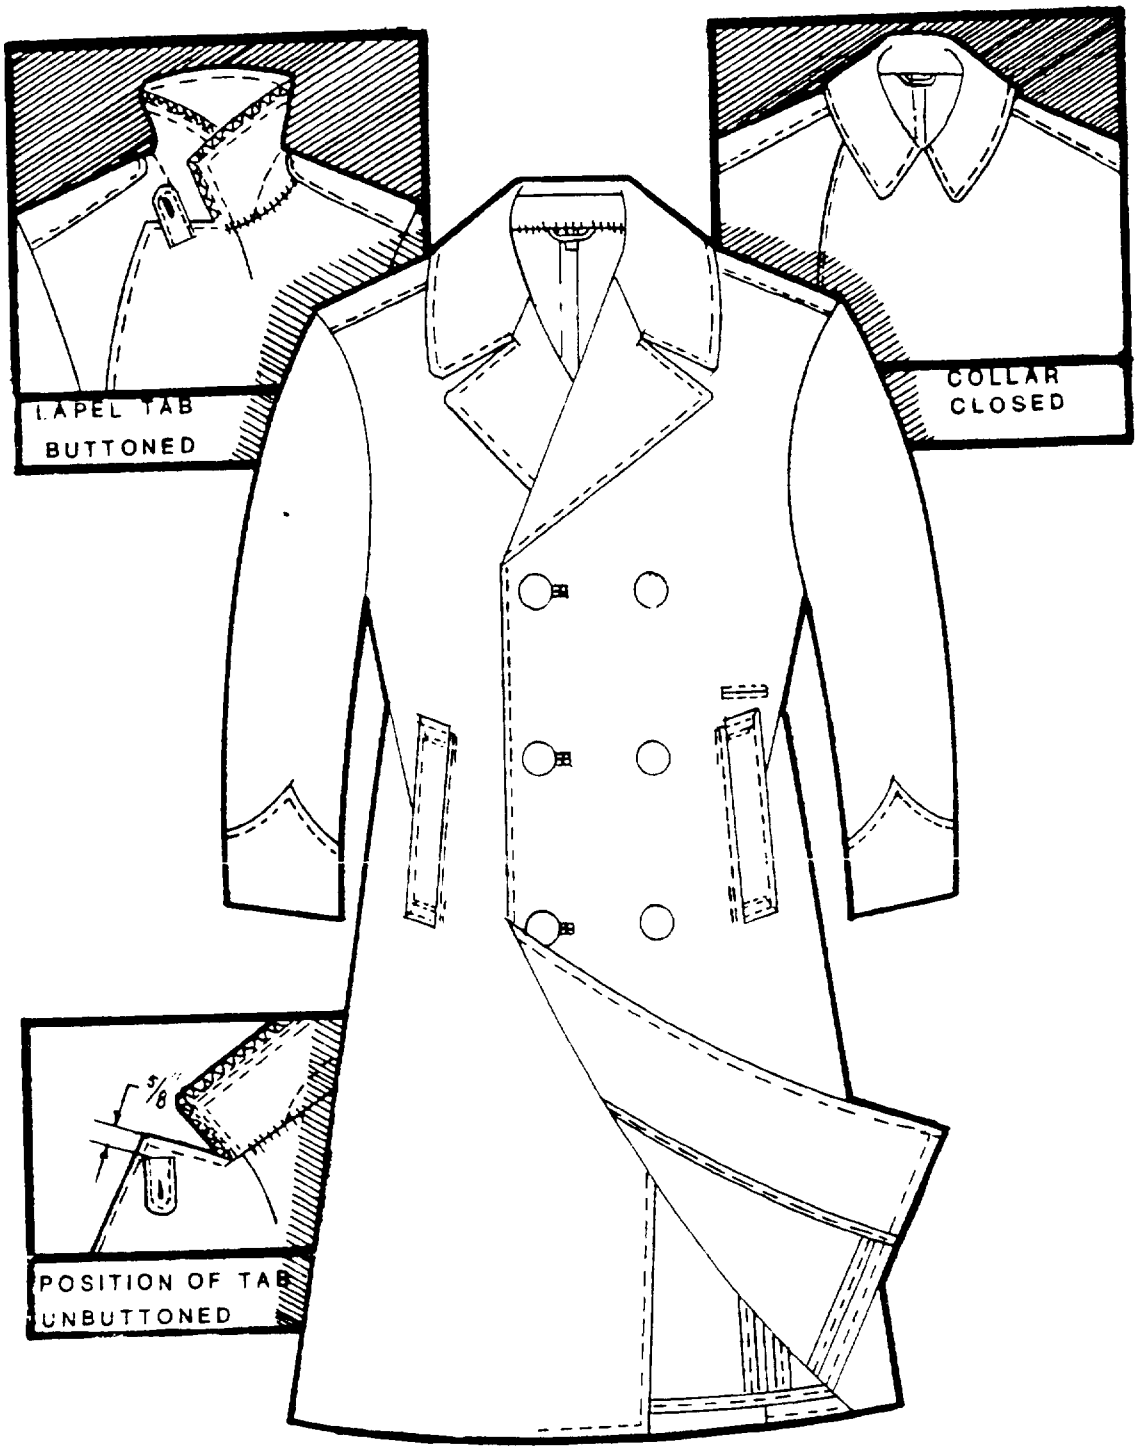



(TYPE II)

FIG. 3. OVERCOAT, MAN'S: WOOL GABARDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

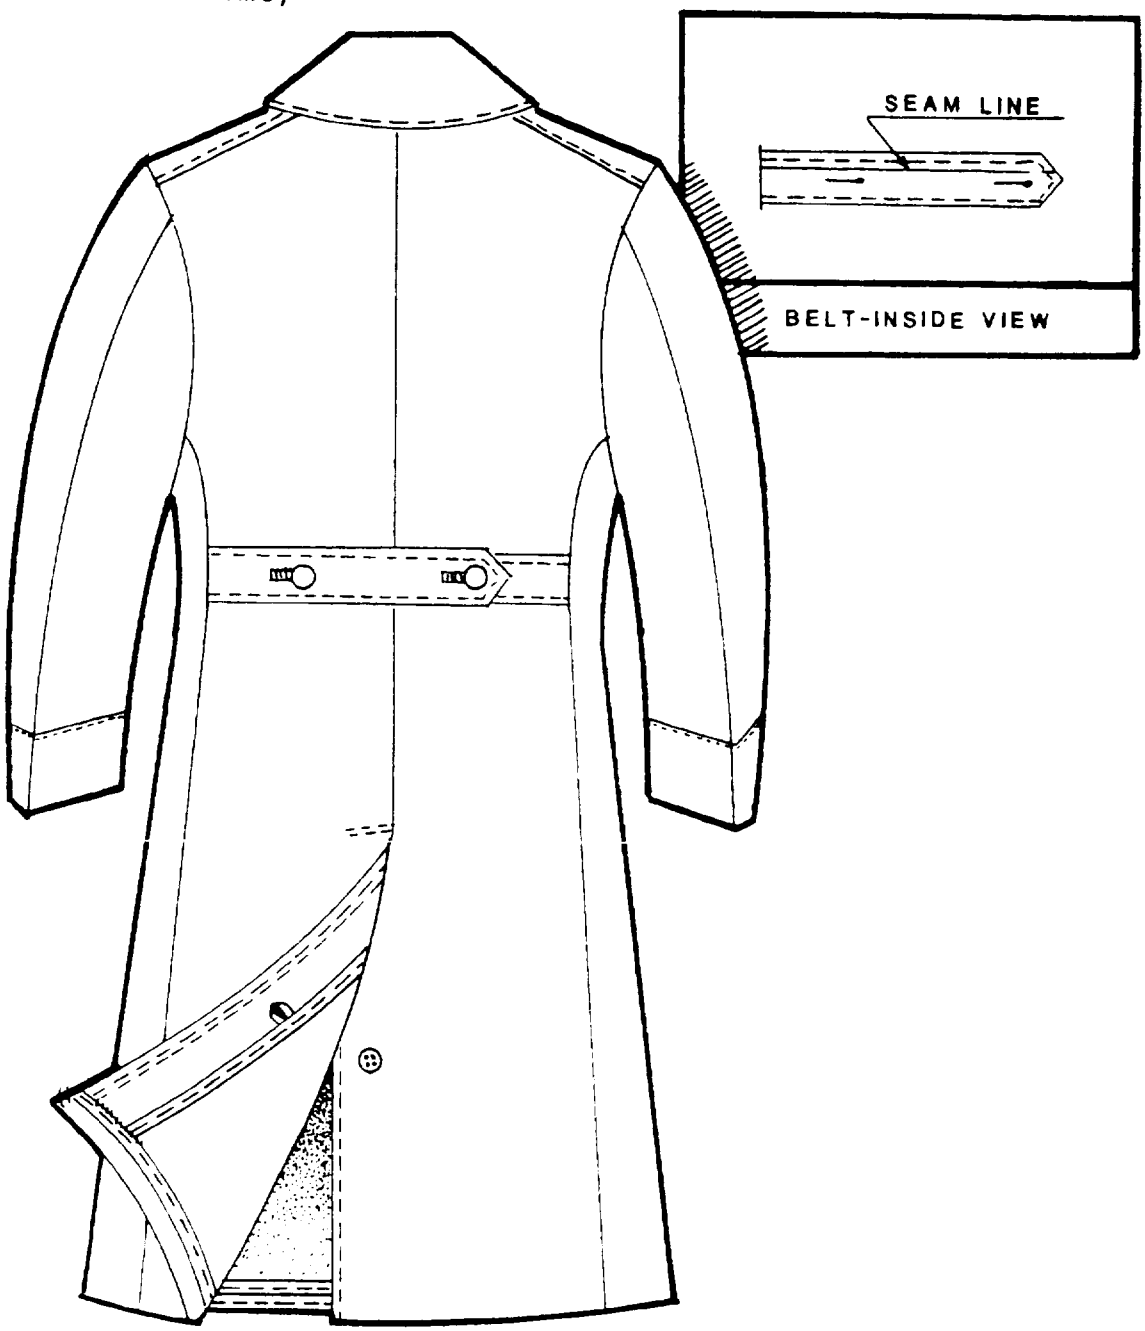


(TYPE II)

FIG. 4. OVERCOAT, MAN'S: WOOL GABARDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 20261O-20T21:09Z
Check the source to verify that this is the current version before use.


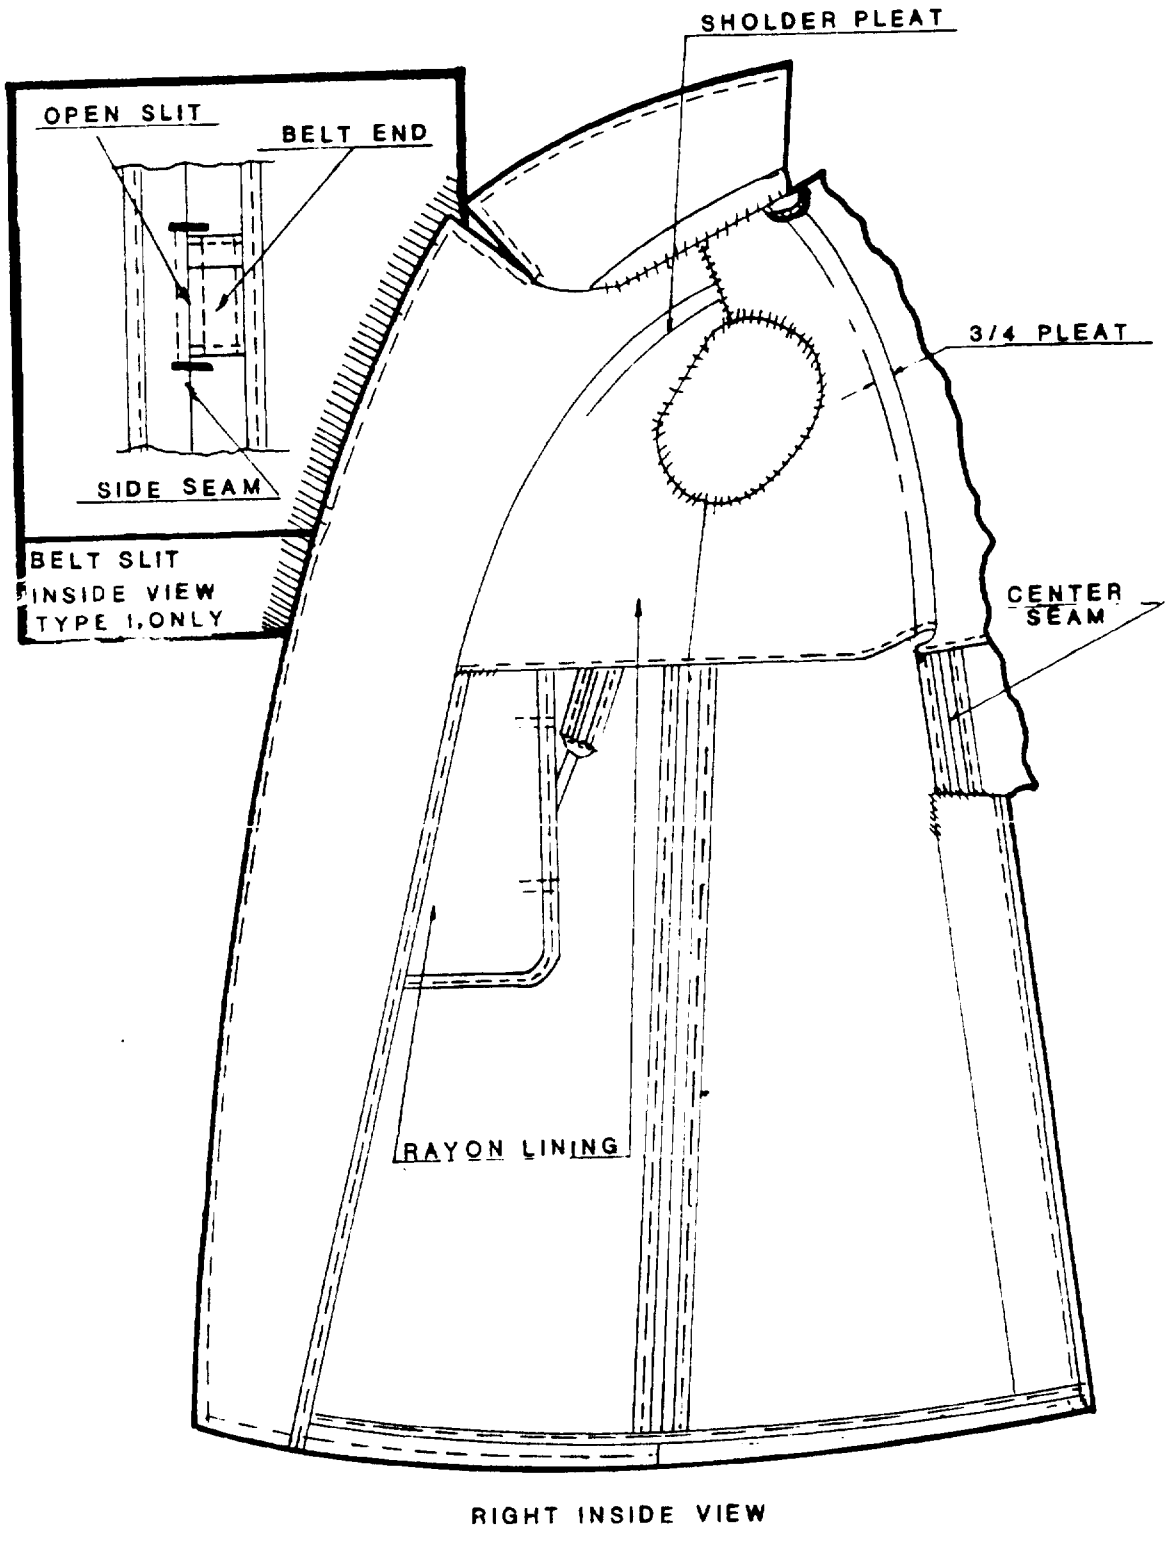



FIG. 5. OVERCOAT, MAN'S: WOOL GABARDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

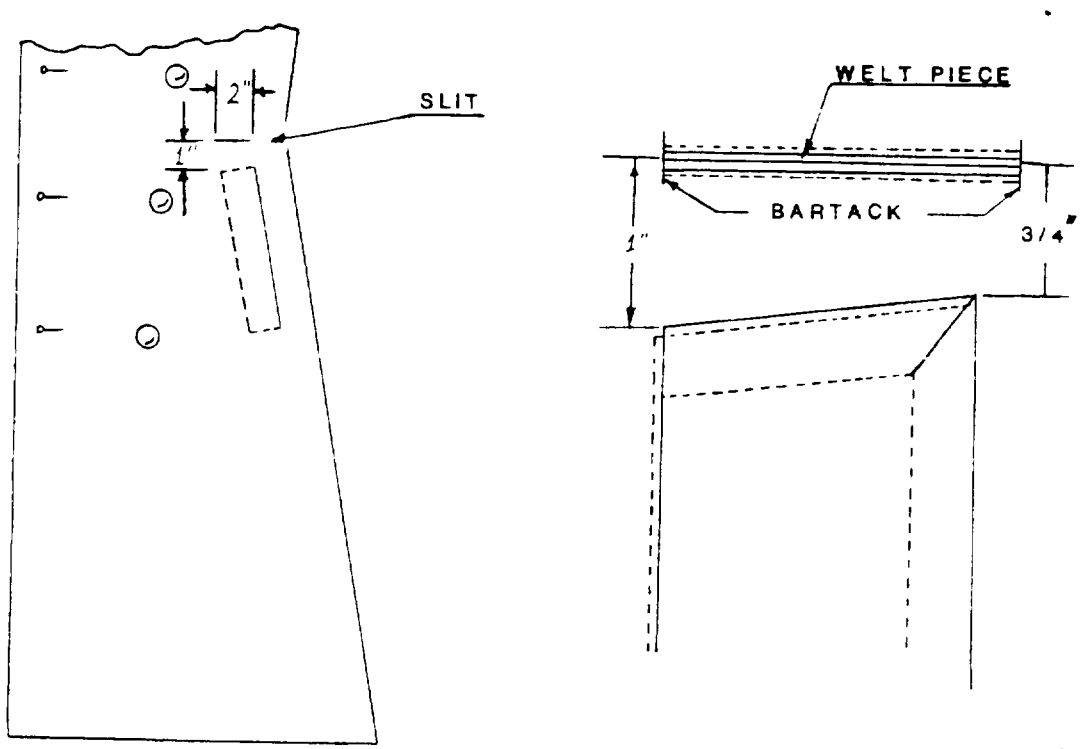


FRONT VIEW

OUTSIDE VIEW- LOCATION OF SWORD SLIT (LEFT HAND SIDE)

(TYPE II)

FIG. 6. OVERCOAT, MAN'S: WOOL GABERDINE, BLUE



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

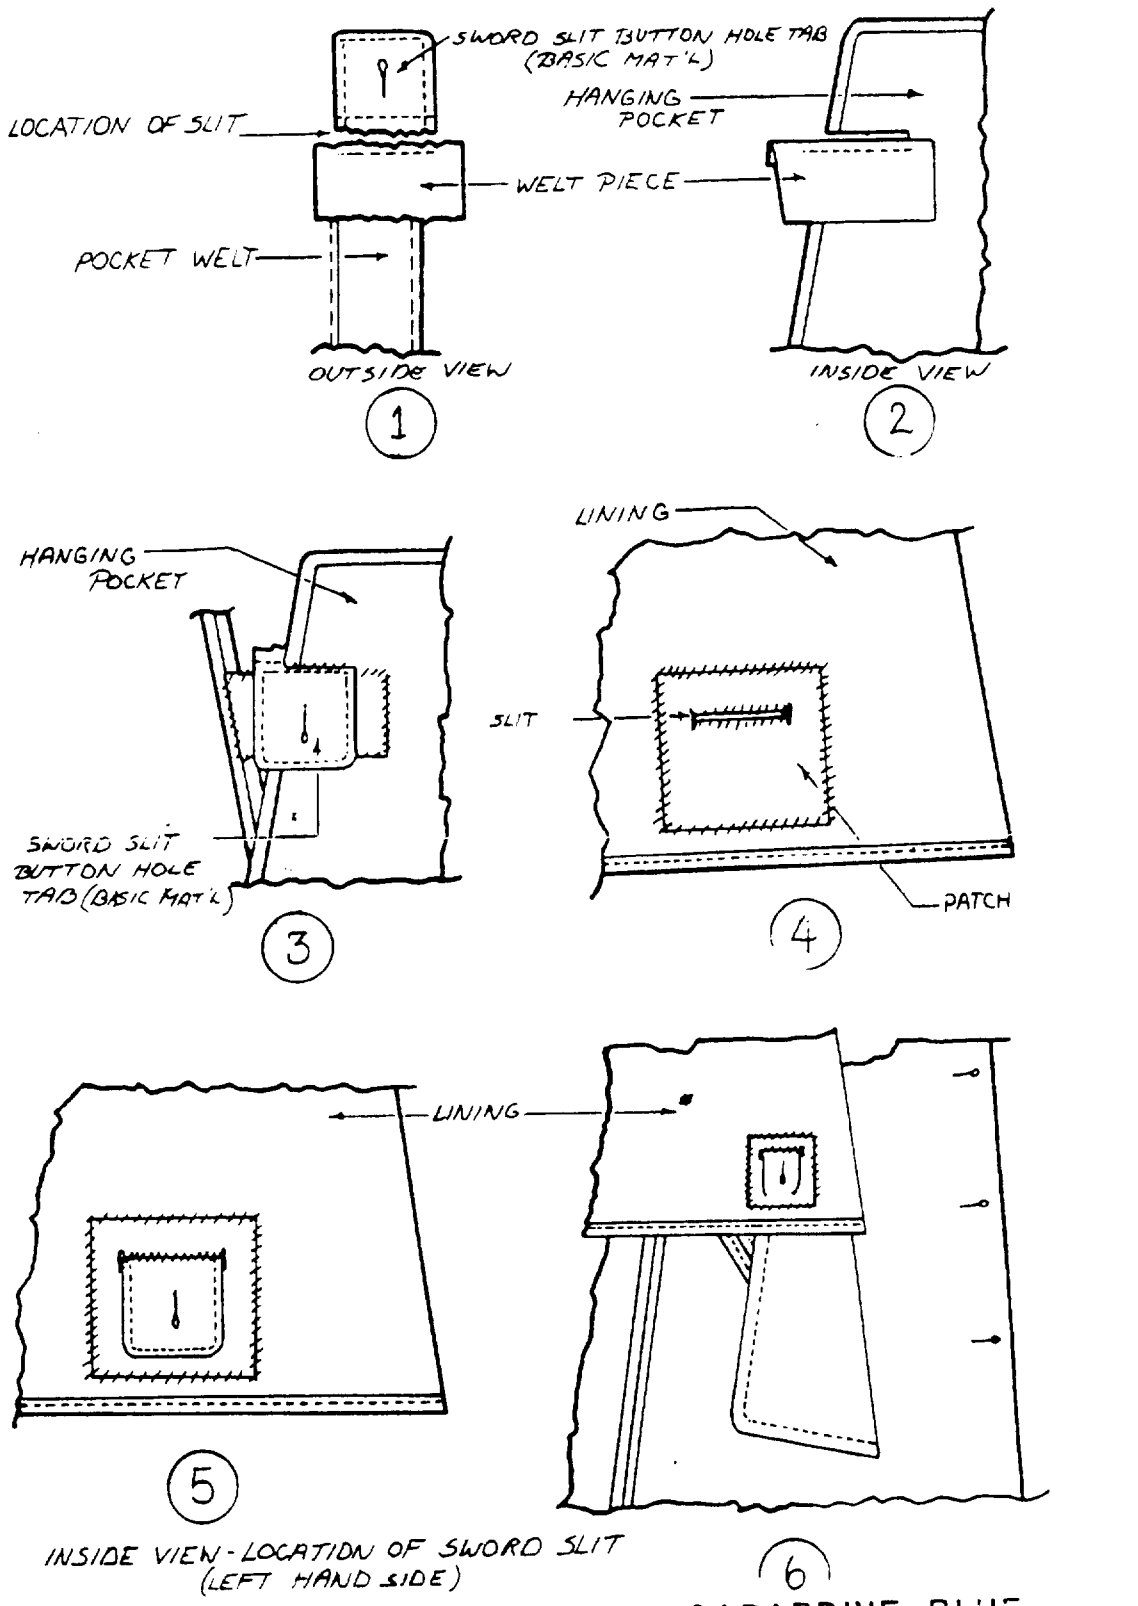



FIG. 7. OVERCOAT, MAN'S: WOOL GABARDINE, BLUE (TYPE II)



Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID




OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commandant of the Marine Corps
Headquarters U. S. Marine Corps
Code LMA-1
Washington, D. C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T21:09Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. *Fold on lines on reverse side, staple in corner,* and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

**DD FORM 1 JAN 72 1426** REPLACES EDITION OF 1 JAN 68 WHICH MAY BE USED S/N 0102-LF-014-1802

Source: https://assist.dla.mil -- Downloaded: 202610-20T21:09Z
Check the source to verify that this is the current version before use.