INCH-POUND

MIL-DTL-20553E
31 May 2023
SUPERSEDING
MIL-W-20553D (AR)
17 November 1976

DETAIL SPECIFICATION

WAX, DESENSITIZING

Reinstated after 31 May 2023 and may be used for new and existing designs and acquisitions.

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements, examinations, and tests on desensitizing waxes for use in cast and pressed explosives compositions (see 6.1).

1.2 Classification. Desensitizing wax is of the following types.

TABLE I. Classification

Type	Custodian	End usage	Melting Point °C
I	Army	Comp A-3 Comp A-4 Comp D-2	79.4 (175 °F) to 93.3 (200 °F)
II	Army	Comp B	77.2 (171 °F) to 93.3 (200 °F)
III	Navy	Comp A-4 Comp D-2 Comp B	79.4 (175 °F) to 93.3 (200 °F)

Comments, suggestions, or questions on this document should be addressed to: U.S. Army CCDC-AC, ATTN: FCDD-ACE-QSA, Picatinny Arsenal, New Jersey 07806-5000 or e-mailed to usarmy.pica.devcom-ac.list.ardec-stdzn-branch@army.mil. Since contact information can change, you may want to verify the currency of this information using ASSIST Online database at https://assist.dla.mil.

AMSC N/A FSC 9160

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements of documents cited in sections 3 and 4 of this specification, whether or not they are listed.

2.2 Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

INTERNATIONAL STANDARDIZATION AGREEMENTS

AOP-7	-	Manual of Data Requirements and Tests for the Qualification of Explosive Materials for Military Use
STANAG 4170	-	Principles and Methodology for the Qualification of Explosive Materials for Military Use
STANAG 4556	-	Explosives: Vacuum Stability Test

DEPARTMENT OF DEFENSE STANDARDS

MIL-STD-650	-	Explosives: Sampling, Inspection and Testing
MIL-STD-1916	-	DOD Preferred Methods for Acceptance of Product

(Copies of these documents are available online at https://quicksearch.dla.mil/).

2.3 Non-government standards and publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents are those cited in the solicitation or contract.

ASTM INTERNATIONAL

ASTM D92	-	Standard Test Method for Flash and Fire Points by Cleveland Open Cup Tester
ASTM D127	-	Standard Test Method for Drop Melting Point of Petroleum Wax, Including Petrolatum
ASTM E300	-	Standard Practice for Sampling Industrial Chemicals
ASTM D445	-	Standard Test Method for Kinematic Viscosity of Transparent and Opaque Liquids (and Calculation

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

		Of Dynamic Viscosity)
ASTM D721	-	Standard Test Method for Oil Content of Petroleum Waxes
ASTM D938	-	Standard Test Method for Congealing Point of Petroleum Waxes, Including Petrolatum
ASTM D1321	-	Standard Test for Needle Penetration of Petroleum Waxes

(Copies of these documents are available from https://www.astm.org/.)

AMERICAN OIL CHEMIST SOCIETY (A.O.C.S)

Cc 3 - 25	-	Slip Melting Point, AOCS Standard Open Tube Melting Point

(Copies of these documents are available from https://www.aocs.org/.)

2.4 Order of precedence. Unless otherwise noted herein or in the contract, in the event of a conflict between the text of this document and the references cited, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Required inspections.

3.1.1 First article. When specified (see paragraph 6.2 and 6.5), a sample shall be subjected to first article inspection in accordance with 4.2.

3.1.2 Conformance. A sample shall be subject to conformance inspection in accordance with 4.3.

3.2 Physical and chemical properties. The desensitizing wax shall conform to the physical and chemical requirements specified in Table II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

TABLE II. Chemical and physical requirements for wax desensitizing.

Properties	Requirements
Melting point °C	
Type I, minimum (min)	79.4 (175 °F)
maximum (max)	93.3 (200 °F)
Type II, min	77.2 (171 °F)
max	93.3 (200 °F)
Type III, min	79.4 (175 °F)
max	93.3 (200 °F)
Viscosity at 98 °C (210 °F) in centistokes (cST)	
min	9
max	21
Penetration in millimeters (mm)	
At 25 °C (77 °F) min	0.6
At 43.3 °C (110 °F) max	3.5
Flash point °C, min	204 (400 °F)
Organic insoluble matter weight percent (%) max	0.03
Alkalinity, in 30 seconds (s)	None
Acidity, as Acetic acid, (%) max	0.01
Oil content, weight (%), max	2.5
Exudation at 71 °C (160 °F) (%) max	3.0
Fingerprint 1/.	
Differential scanning calorimeter (DSC) curve	Shall contain one major peak
Congealing and softening points	Temperature shift shall not be greater than 2.5°C (5.0°F) from original values
Reactivity at 100 °C in milliliter (mL)	
max	1.0

Note:
1/. See 6.3.2 for definition of major change.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

3.3 Workmanship. The desensitizing wax shall be uniform in quality, free from visible impurities and foreign material such as dirt, wooden particles or any other foreign matter.

3.4 Energetic material. The desensitizing wax is an ingredient in energetic materials. When required, the energetic material shall meet the requirements of AOP-7 and STANAG 4170 (see 6.3.2, 6.4, and 6.5).

4. VERIFICATION

TABLE III. Requirements/verification cross reference matrix.

Method of verification 1 – Analysis 2 – Demonstration 3 – Examination 4 – Test						Classes of verification A – First article B – Conformance		
Section 3 Requirement	Description	Verification Methods				Verification Class		Section 4 Verification
		1	2	3	4	A	B	
3.1.1	First article	X		X	X	X		4.2
3.1.2	Conformance	X		X	X		X	4.3
3.2	Melting point	X		X	X	X	X	4.4.1
3.2	Viscosity	X		X	X	X	X	4.4.2
3.2	Penetration	X		X	X	X	X	4.4.3
3.2	Flash point	X		X	X	X	X	4.4.4
3.2	Organic insoluble matter	X		X	X	X	X	4.4.5
3.2	Alkalinity	X		X	X	X	X	4.4.6
3.2	Acidity	X		X	X	X	X	4.4.7
3.2	Oil content	X		X	X	X	X	4.4.8
3.2	Exudation	X		X	X	X	X	4.4.9
3.2	Fingerprint	X		X	X	X	X	4.4.10
3.2	Reactivity	X		X	X	X	X	4.4.11
3.3	Workmanship			X	X	X	X	4.4.12
3.4	Energetic material qualification	X		X	X	X		4.4.13

4.1 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see paragraph 4.2).
b. Conformance inspection (see paragraph 4.3).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

4.2 First article inspection. When specified (see paragraph 6.2 and 6.4), a sample shall be subjected to first article verification in accordance with Table IV. Samples of not less than 5 lbs. of desensitizing wax collected in accordance with 4.3.2 shall be submitted for examination. Samples shall be produced by the contractor using the same process procedures, material supply sources, production equipment, and production line as will be used in regular production.

TABLE IV. First article acceptance tests.

Category	Examination or test	Requirement paragraph	Inspection method reference
Critical	None defined		
Major			
101	Melting Point	3.2	4.4.1
102	Viscosity	3.2	4.4.2
103	Penetration	3.2	4.4.3
104	Flash Point	3.2	4.4.4
105	Organic Insoluble Matter	3.2	4.4.5
106	Alkalinity	3.2	4.4.6
107	Acidity	3.2	4.4.7
108	Oil Content	3.2	4.4.8
109	Exudation	3.2	4.4.9
110	Fingerprint	3.2	4.4.10
111	Reactivity	3.2	4.4.11
112	Energetic material qualification	3.4	4.4.13
Minor			
201	Workmanship	3.3	4.4.12

4.2.1 Rejection. If any sample fails to comply with any of the applicable requirements, the first article batch shall be rejected.

4.3 Conformance inspection.

4.3.1 Inspection lot formation. Inspection lots and batches shall comply with the MIL-STD-1916, paragraph “Formation and identification of lots or batches.” Each batch shall consist of a quantity of wax desensitizing that has been subjected to the same chemical and physical mixing process intended to make the final product homogeneous. A lot shall consist of one acceptable batch of desensitizing wax produced by one manufacturer in accordance with one specification and revision under one continuous set of operating conditions.

4.3.2. Desensitizing wax sampling.

4.3.2.1 Sampling at the manufacturer. Samples shall be collected from the beginning, middle, and end of every batch in every lot in accordance with ASTM E300. A composite

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

sample of not less 2.3 kg (5 lbs.) shall be formed which is assumed to be representative from a single batch. All composite samples shall be verified in accordance with 4.4. If any sample fails to comply with any applicable requirements the lot shall be rejected.

4.3.2.2 Sampling at the received facility. Desensitizing wax batches shipped in containers (e.g., drums, totes, boxes, etc.) shall be sampled and accepted using Verification Level I of MIL-STD-1916, where one unit is defined as one container. Each container shall be sampled in three (3) locations of the shipping containers in accordance with ASTM E300. This material shall be placed in a secondary container and mixed to form a composite sample consisting of a minimum of 2.3 kg (5 lbs.) for each desensitizing wax lot received. There shall be no reduced sampling. Every lot received shall be tested and verified in accordance with 4.4. If any sample fails to comply with any applicable requirements the lot shall be rejected.

4.3.3 Classification of characteristics. Desensitizing wax shall be subjected to the inspections according to 4.3.3.1.

4.3.3.1 Desensitizing wax.

Category	Examination or Test	Verification Level	Requirement Paragraph	Inspection Method
Critical	None defined			
Major				
101	Melting point	4.3.2	3.2	4.4.1
102	Viscosity	4.3.2	3.2	4.4.2
103	Penetration	4.3.2	3.2	4.4.3
104	Flash Point	4.3.2	3.2	4.4.4
105	Organic insoluble matter	4.3.2	3.2	4.4.5
106	Alkalinity	4.3.2	3.2	4.4.6
107	Acidity	4.3.2	3.2	4.4.7
108	Oil content	4.3.2	3.2	4.4.8
109	Exudation	4.3.2	3.2	4.4.9
110	Fingerprint	4.3.2	3.2	4.4.10
111	Reactivity	4.3.2	3.2	4.4.11
Minor				
201	Workmanship	4.3.2	3.3	4.4.12

4.4 Test methods and procedures.

4.4.1 Melting point. The melting point shall be determined in accordance with ASTM D127.

4.4.2 Viscosity. The viscosity shall be determined in accordance with ASTM D445 using the Ubbelohde viscometer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

4.4.3 Penetration. The penetration shall be determined in accordance with ASTM D1321.

4.4.4 Flash point. The flash point shall be determined in accordance with ASTM D92.

4.4.5 Organic insoluble matter. The solvent for this determination shall consist of either toluene or aliphatic naphtha (see 6.7.1). Use clean medium porosity glass filtering crucibles which will allow 20 mL of hot solvent to flow through them, under suction, within 15 seconds or less. Condition the crucibles prior to use as follows: wash three (3) 20 mL portions of hot solvent through the crucible with the aid of suction, wash one (1) 20 mL portion of acetone through the crucible, back wash the crucible with one (1) 20 mL portion of acetone, dry the crucible in an oven at 100 ± 5 °C, cool the crucible in a desiccator, weigh the crucible-and record weight, return crucible to oven and maintain at 100 ± 5 °C until used.

Weigh approximately 5 grams (g) of the sample to the nearest 0.l milligram (mg) and transfer to a 400 mL beaker. Add approximately 250 mL or solvent to the beaker. Dissolve the wax in the solvent by placing the beaker and contents on a steam bath and heat at a temperature of 65 °C minimum. Continue heating until the wax dissolves (stirring may be used). Filter the hot solution through the previously conditioned and tared hot crucible with the aid of suction. Maintain the crucible and contents at above 60 °C to prevent the wax from coming out of the solution. Use a heat gun or other commercially available equipment to maintain the temperature of' the solution. Wash the crucible with hot solvent until the residue and crucible are free from wax, or until approximately 5 mL of the washings, when evaporated to dryness, leaves no residue.

Retain the filtrate for the determination of' alkalinity as specified in 4.4.6. During filtration air must not be sucked through the crucible. This is to prevent the air from cooling the filtering surface which could cause the wax to come out of solution and clog the crucible. Dry crucible and contents in an oven for 30 minute at l00 °C to 105 °C, cool in a desiccator and weigh. The percentage of insoluble matter is calculated as follows:

$$\text{Percent insoluble matter} = \frac{100*A}{W}$$

Where:

A = increase in weight of filtering crucible, in g.
W = weight of sample, in g.

4.4.6 Alkalinity. The filtrate from the determination of insoluble matter (4.4.5) shall be transferred to a 500 mL separatory funnel, and the flask shall be rinsed with two (2), 10 mL portions of toluene. 25 mL of distilled water shall be added to the funnel. The funnel shall be shaken, the phases allowed to separate, and the aqueous layer withdrawn. The procedure of adding distilled water, shaking, and separating shall be repeated two more times. The aqueous extracts shall be combined. The extract shall be tested with red litmus paper of such sensitivity that its color is completely changed in one minute by 0.004 Normal (N) sodium hydroxide solution. The water extract shall be considered to be alkaline if upon application red litmus paper changes color within 30 seconds. The water extract shall be reserved for determination of acidity (see 4.4.7).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

4.4.7 Acidity. Three drops of phenolphthalein indicator shall be added to the water extract, obtained as specified in 4.4.6, and the solution shall be titrated with approximately 0.1 N sodium hydroxide solution. A blank determination shall be made on the same quantities of toluene and water as were used in dissolving and extracting the sample. Any acidity shall be calculated to percentage of acetic acid in the sample as follows:

$$\text{Percent acetic acid} = \frac{6.0\ (A-B)*N}{W}$$

Where:

A = mL of sodium hydroxide solution used in determination
B = mL of sodium hydroxide solution used in blank
N = normality of sodium hydroxide solution
W = weight of sample, in g

4.4.8 Oil content. The oil content shall be determined in accordance with ASTM Method D721.

4.4.9 Exudation. The sample shall be melted at approximately 104.4 °C (220 °F). When completely molten, the wax shall be cooled with stirring, to about 5.8 °C (10 °F) above its drop melting point and cast into a glass mold, 25.4 millimeter (1 inch) inside diameter and 12.7 millimeter (0.5 inch) high. The glass mold shall rest on a smooth 12.7 millimeter (0.5 inch) thick aluminum plate and at the time of casting, both plate and mold shall be at 21.1 °C ± 5.6 °C (70 °F ± 10 °F). Under these conditions the sample will freeze in 3 to 5 minutes. The sample shall be removed from the mold and placed on 20 layers of filter paper, cut in 38.1 millimeter (0.5 inch) diameter circles. An 80 g brass weight, 25.4 millimeter (1 inch) in diameter, shall be placed on top of the wax casting. This assembled sample shall then be placed on a wire screen and stored in an oven for 24 hours at 71.1°C ± 0.3 °C (160 °F ± 0.5°F). Before assembly, the brass weight shall be weighed and then reweighed with the wax casting. After hot storage, wax and brass weight shall be removed from the filter paper while still warm, no attempt being made to separate brass weight and wax, and allowed to cool upside down (the wax resting on the brass weight). When cool, the wax and brass weight shall be weighed together. The difference in weights shall be calculated as percent lost during storage. The test shall be run in triplicate and the average of the three values shall be reported as the percent exudation.

$$\text{Percent exudation} = \frac{A-C}{A-B}*100$$

Where:

A = weight of wax plus brass weight before exudation test, in g.
B = weight of brass, in g.
C = weight of wax plus brass weight after exudation test, in g.

4.4.10 Fingerprint. A fingerprint characterizing the wax shall be obtained by collecting Differential Scanning Calorimeter (DSC) curve (see Fig.1), congealing point, and softening point in accordance with the following procedures.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

4.4.10.1 DSC apparatus. A DSC curve shall be obtained by Differential Scanning Calorimeter which utilizes an inert gas flow of 10 to 20 mL of gas/minute to purge the sample chamber and the following procedure.

a. Transfer a sample size of 5 to 8 mg of compacted or resolidified wax into an aluminum pan.
b. Heat at a rate of 5 to 10 °C/min in a temperature range within 25 to 100 °C.
c. Sample conditioning. Heat sample to 5 °C above its onset endotherm point and allow it to cool to 25 °C without changing its position in the DSC heating chamber.
d. Record the DSC curve.

4.4.10.2 Determination of congealing point. A congealing point will be obtained for each qualified wax in accordance with the procedure specified in ASTM D938.

4.4.10.3 Determination of softening point. A softening point will be obtained for each qualified wax in accordance with the procedure specified in A.O.C.S. Method Cc 3-25.

4.4.11 Determination of reactivity. The reactivity shall be determined in accordance with STANAG 4556 Procedure 1 using a capillary tube with a horizontal dimension 15 or 26 centimeters or Procedure 2 with the following exceptions:

The specimens shall consist of 7.50 g of wax, 5.00 g of RDX and 5.00 g of TNT. These specimens are reduced to a practicable and standardized fineness for intimacy of conduct and reproducibility of results, approximately 12 mesh.

Two and one half grams (2.5) of wax shall be placed in each of three (3) heating tubes. Two and one half grams (2.5) of RDX shall be placed in one (1) of the tubes containing wax and two and one half grams (2.5) of TNT shall be placed in another tube containing wax. Two and one half grams (2.5) of RDX and two and one half grams (2.5) of TNT shall be placed in two (2) additional tubes.

The sum of the volume of gases evolved by the wax and explosive individually subtracted from the volume of gas produced by the wax-explosive mixture shall be the reactivity values to be reported.

4.4.12 Workmanship. Place approximately 50 g into a 150 mL glass beaker over a clean, well-lighted white surface. The sample shall be examined by personnel with normal vision or normal corrected vision. The sample shall be uniform in quality and free from visible impurities, and foreign material such as dirt, wooden particles or any other foreign matter. Failure to meet the workmanship requirement during inspection or while executing production processes shall result in batch or FAT rejection.

4.4.13 Energetic material. Verify by visual examination of objective evidence that the desensitizing wax and all constituent energetic materials meet the requirements of AOP-7 and STANAG 4170 (see 6.4 and 6.5).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Packaging. For acquisition purposes, the packaging requirements shall be as specified in the contract or order (see paragraph 6.2). When packaging of the materiel is to be performed by DOD or in-house contractor personnel, these personnel need to contact the responsible packaging activity to ascertain packaging requirements. Packaging data retrieval is available from the managing Military Department's or Defense Agency's automated packaging files, CD-ROM products, or by contacting the responsible packaging activity.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The desensitizing wax types covered by this specification are intended for used as desensitizers in high explosives. It is likely that a wax may qualify in from one to all explosives compositions. Pressed explosives include Comp A-4. The desensitizing wax furnished under this specification should be approved for its intended military use by the Army Qualification Authority and the Navy Qualification Authority or as specified in the contract (see 6.4.2.1, 6.4.2.2, and 6.5)

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification
b. Provisions for submission/resubmission of first article samples
c. Quantity required and delivery schedules
d. Levels of preservation and packing (see 5.1)
e. Type of material
g. Certificate(s) of Analysis reporting the test results for the batch(es) or container(s) Tested

6.3 Definitions.

6.3.1 Batch. A discrete quantity of material that has been manufactured through various unit operations to produce a substantially uniform final product.

6.3.2 Definition of major change. A major change in the product requires reapproval (see 6.4). The determination of a major change in a manufacturer's product will be based upon evaluation of the DSC curve for the following:

a. Changes in characteristics from the original curve (see Fig. 1) and subsequent curves for the same product in regard to shifts of the melting point or changes in the composition of the wax (single cut vs blend) or melting point characteristics as demonstrated by the appearance of new peaks or disappearance of peaks in the DSC curve.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

b. The determination of a major change in a manufacturer's product for congealing and softening points will be based on a shift of greater than 2.5°C (5.0°F) from original values.

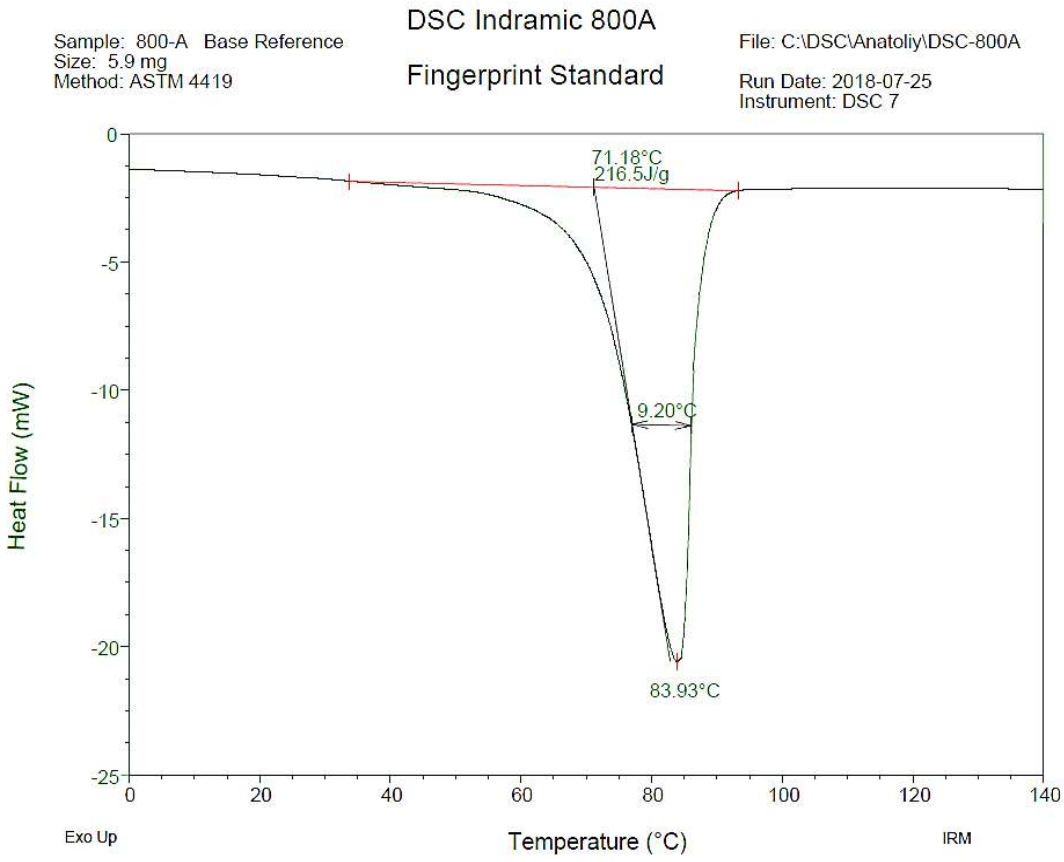


FIGURE 1. Illustrated DSC scan.

6.4 Major change inspection.

6.4.1 Qualification testing for a major change of the wax desensitizing ingredient. The wax desensitizing should be requalified in the applicable explosive formulation (see 6.5) when the wax desensitizing undergoes a major change (see 6.3.2). The testing should include but not be limited to the following (see 6.4.2.1 and 6.4.2.2).

a. Pressibility
b. Incorporatibility
c. Sensitivity
d. Compatibility
e. Flow properties of formulated explosives
f. Cast shrinkage

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

6.4.2 Qualification test samples. Qualification samples should be identified by tags marked with the following information:

a. Wax, Desensitizing, Specification MIL-DTL-20553
b. Sample for Qualification Test
c. Manufacturers Formula Number or Brand Name
d. Date of shipment
e. Name and address of manufacturer

6.4.2.1 Sample for Navy qualification testing. Unless otherwise specified, the sample size should consist of sufficient material of desensitizing wax. Contact SEA 05S, 1333 Isaac Hull Avenue, SE, Stop 5160, Washington Navy Yard, DC 20376-5160 or emailed to CommandStandards@navy.mil and Commander, Naval Surface Warfare Center, Indian Head Division (NSWC IHD), Indian Head, MD20640-5035, Attn: Code M41 or email to nswc_iheodtd_exp.fct@navy.mil for necessary amount. Samples should be produced by the contractor using the same process procedures, material supply sources, production equipment, and production line as will be used in regular production. Samples should be sent to the following location: Commander, Naval Surface Warfare Center, Indian Head Division(NSWC IHD), Indian Head, MD 20640-5035, Attn: Code M41.

6.4.2.2 Sample for Army qualification testing. Unless otherwise specified, the sample size should consist of sufficient material of desensitizing wax. Contact the Energetic Material Qualification Board (see 6.5) for sample size and shipping information. Samples should be produced by the contractor using the same process procedures, material supply sources, production equipment, and production line as will be used in regular production.

6.5 Energetic material approval. When a contract is awarded to a manufacturer who has not previously produced wax desensitizing for the Government, approval of energetic materials by the relevant Service Qualification Authority should require demonstration that the energetic material meets the requirements of AOP-7 and STANAG 4170. Point of contact for the relevant Service Qualification Authority can be obtained from the Technical Agency. All correspondence should be submitted through the contracting officer to Technical Agency (see 6.6).

6.6 Technical agency. US Army Combat Capability Development Command Armament Center (DEVCOM AC) is the technical agency that is responsible for the preparation and revision of the specification. All correspondence to the Technical Agency should be submitted through the contracting officer to: DEVCOM AC, ATTN: FCDD-ACE-QEE, Picatinny Arsenal, NJ 07806-5000.

6.7 Approval of equivalent test methods and/or instruments. Prior approval by the Contracting Officer should be required for use of equivalent test methods and/or instruments. A description of the proposed method and/or instrumentation should be submitted through the Contracting Officer to the Technical Agency (see 6.6). This description should include but not be limited to the procedures used, the accuracy and precision of the method, test data to demonstrate the accuracy and precision, and drawings of any special equipment required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.

6.7.1 Aliphatic naphtha. Aliphatic naphtha used in testing should have a boiling point no less than 131°F and no greater than 300 °F.

6.8 Submission of alternative conformance inspection provisions. Unless otherwise specified in the contract, proposed alternative conformance inspection provisions should be submitted by the contractor for evaluation by the Technical Agency (See 6.6) responsible for preparation of this specification.

6.9 Incorporated changes. ECP Y22Q2004 provides documentation for noted changes.

6.10 Subject term (key word) listing.

Energetic material
Desensitizer
Ingredient
Press Explosives

6.11 Changes from previous issue. The margins of this specification are marked with vertical lines to indicate where changes from previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the previous issue.

Custodians:
Army – AR
Navy - OS

Preparing activity
Army - AR
(Project 9160-2023-002)

Review Activities:
Army - AS

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil .

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:00Z
Check the source to verify that this is the current version before use.