INCH-POUND

MIL-C-44379(GL)
27 October 1989

MILITARY SPECIFICATION

COAT, WOMAN'S, CLASSIC DESIGN, POLYESTER/WOOL, AG-344, FUSIBLE

This specification is approved for use by the Natick Research, Development, and Engineering Center, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers a woman's polyester/wool serge coat.

1.2 Classification. The coat shall be of one type in the following classes and sizes (see 6.2).

Class 1 - General Officers
Class 2 - Officers
Class 3 - Enlisted Personnel

Schedule of sizes for women

Short	Short-plus	Regular	Regular-plus	Long	Long-plus	X-Long
		4 R	4 R+	4 L		
6 S	6 S+	6 R	6 R+	6 L		
8 S	8 S+	8 R	8 R+	8 L	8 L+	8 XL
10 S	10 S+	10 R	10 R+	10 L	10 L+	10 XL
12 S	12 S+	12 R	12 R+	12 L	12 L+	12 XL
14 S	14 S+	14 R	14 R+	14 L	14 L+	14 XL
16 S	16 S+	16 R	16 R+	16 L	16 L+	
18 S	18 S+	18 R	18 R+	18 L	18 L+	
20 S	20 S+	20 R		20 L		

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: U.S. Army Natick Research, Development, and Engineering Center, Natick, MA 01760-5014 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A

FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 202640-22T01:51Z
Check the source to verify that this is the current version before use.

Schedule of sizes for juniors

X-Short	X-Short plus	Short	Short plus	Regular	Regular plus	Long	Long plus
		3 S		3 R	3 R+	3 L	
		5 S	5 S+	5 R	5 R+	5 L	
		7 S	7 S+	7 R	7 R+	7 L	7 L+
9 XS	9 XS+	9 S	9 S+	9 R	9 R+	9 L	9 L+
11 XS	11 XS+	11 S	11 S+	11 R	11 R+	11 L	11 L+
13 XS	13 XS+	13 S	13 S+	13 R	13 R+	13 L	13 L+
15 XS	15 XS+	15 S	15 S+	15 R	15 R+		
17 XS	17 XS+	17 S	17 S+	17 R			
19 XS	19 XS+	19 S	19 S+				

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

V-T-280 - Thread, Gimp, Cotton, Buttonhole
V-T-295 - Thread, Nylon
V-T-301 - Thread, Silk
CCC-C-438 - Cloth, Buckram, Woven and Nonwoven
DDD-L-20 - Label: For Clothing, Equipage, and Tentage, (General Use)
DDD-T-86 - Tape, Textile; Cotton, General Purpose (Unbleached, Bleached, or Dyed)
PPP-B-636 - Boxes, Shipping, Fiberboard

MILITARY

MIL-C-368 - Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371 - Braid, Textile, Tubular
MIL-B-593 - Braid, Textile (Flat)
MIL-C-823 - Cloth, Serge; Wool, Wool and Nylon, Polyester and Wool

Source: https://assist.dla.mil -- Downloaded: 202640-22T01:51Z
Check the source to verify that this is the current version before use.

MIL-B-3461 - Button, Insignia, Metal, Uniform and Cap
MIL-C-15062 - Cloth, Flannel, Wool, Undercollar Cloth
MIL-P-15064 - Pads, Shoulder and Sleeve-Head
MIL-C-15065 - Coat Fronts
MIL-L-35078 - Loads, Unit; Preparation of Semiperishable Subsistence Items, Clothing, Personal Equipment and Equipage, General Specification For
MIL-T-43548 - Thread, Polyester Core: Cotton-, Rayon-, or Polyester-Covered
MIL-C-43718 - Cloth, Polyester; Polyester and Cotton; Polyester and Rayon, For Pockets
MIL-C-44121 - Cloth, Twill, Polyester
MIL-C-44192 - Container, Shipping and Storage, Coat (Hanger Pack)
MIL-C-44296 - Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-147 - Palletized Unit Loads
MIL-STD-731 - Quality of Wood Members for Containers and Pallets
MIL-STD-1608 - Provisions for Evaluating Quality of Coats, Women's, Dress

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Naval Publications and Forms Center, (ATTN: NPODS), 5801 Tabor Avenue, Philadelphia, PA 19120-5099.)

2.2 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the currentversion before use.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103-1187.)

THE COLOR ASSOCIATION OF THE UNITED STATES

Standard Color Card of America

Department of Defense Standard Color Card for Sewing Threads

(Application for color cards should be addressed to the Color Association of the United States, 343 Lexington Avenue, New York, NY 10016-0927. If color cards are not available from the Color Association, individual color samples may be obtained from the contracting activity or as directed by the contracting activity.)

(Non-Government standards and other publications are normally available from organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 First article. When specified (see 6.2), a sample shall be subjected to first article inspection (see 6.3) in accordance with 4.3.

3.2 Guide sample. Guide samples, when furnished, are solely for guidance and information to the contractor (see 6.4). Variation from this specification may appear in the sample, in which case this specification shall govern.

3.3 Material. It is encouraged that recycled material be used when practical as long as it meets the requirements of this specification.

3.3.1 Basic material. The basic material shall be 11.3 ounce polyester and wool serge, Army Green 344, conforming to type III, class 3 of MIL-C-823.

3.3.2 Lining. The material for the lining shall be rayon twill, Army Green 45, conforming to class 1 of MIL-C-368. As an alternate, the lining material may be polyester twill, Army Green 461 conforming to MIL-C-44121.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

3.3.3 Binding. The binding for the coat shall be cut on the bias and shall be made of the same material as the coat lining (see 3.3.2). The width of the bias binding shall be 5/8 to 7/8 inch. The binding may be placed on rolls.

3.3.4 Collar interlining. The material for the collar interlining shall be cotton buckram cloth, natural or bleached conforming to type I, class 2 of CCC-C-438.

3.3.5 Fusible interlinings.

3.3.5.1 Small parts fusible interlining. The lapels, front facing, pocket flaps, top sleeve, under sleeve, top collar, lapel notch reinforcement, bound buttonhole piping (non-automatic construction), and shoulder loops, known as "small parts" shall use a black or charcoal, nonwoven fusible interlining. It shall conform to either type V or VI, class 1, style A or B or type VIII, class 1, style A of MIL-C-44296. The material shall have a uniformly distributed powder dot, paste dot, spunfused, or sintered nylon polyamide fusible adhesive evenly applied to one side in accordance with good commercial practice. Any given coat shall incorporate the same small parts fusible material. As an alternate, a black or charcoal, woven, lightweight fusible interlining for small parts, conforming to type I, class 1, style A of MIL-C-44296 may be used.

3.3.5.2 Fronts fusible interlining. The fusible interlining for the coat and side body fronts shall be a black or charcoal napped woven twill material conforming to type II, class 1, style B of MIL-C-44296. The material shall have a uniformly distributed dot type nylon polyamide fusible adhesive evenly applied to one side in accordance with good commercial practice. Any given coat shall incorporate the same fronts fusible material.

3.3.5.3 Fused state bonding strength. The small parts and fronts fusible material for preproduction and in-process testing shall meet an initial minimum bonding strength requirement in the warp (machine) direction of 32 ounces per inch or splits prior to drycleaning when tested as specified in 4.4.2, and minimum 24 ounces per inch or splits in the warp (machine) direction after three drycleanings and pressings when tested as specified in 4.4.3.1. Additionally the small parts fusible interlining will be accepted if it either begins to debond from the outer shell material equivalent to the minimum bond strength or higher and then splits from itself or if the small parts fusible interlining readily splits from itself at a minimum tear strength of 6.0 ounces (170 grams) per inch. As an option, the bonding strength test may be conducted up to two hours after the initial fusing takes place.

3.3.5.4 Colorfastness. All dyed finished fusible interlining materials shall show fastness to drycleaning as specified in MIL-C-44296, except when no standard sample is available, the finished fusible materials shall show "fair" fastness to drycleaning.

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the currentversion before use.

3.3.5.5 Shrinkage. The interlining, after fusing to the basic cloth as specified in 3.3.5.6, shall not exceed 1.5 percent differential shrinkage when tested as specified in 4.4.3.1 and shall not exceed 2.0 percent shrinkage after drycleaning when tested as required in 4.4.3.1. All drycleaned materials shall not exhibit any sign of bubbling, puckering or delamination.

3.3.5.6 Fusing press operating procedure and conditions. A single layer of fusible interlining shall be fused to a single layer of basic material on a dry electrically heated conveyor type fusing press which has the capacity of controlling and retaining pressure, dwell time, and temperature for a minimum of 8 hours. Pair or sandwich fusing which can create differential shrinkage, stitching, and uneven bonding shall not be permitted. A steam sourced fusing press shall not be allowed for any initial fusing operations. For optimum results, the fusible material manufacturers recommendations for fusing dwell time, pressure, and temperature, based upon the fusing equipment used and basic material being fused, shall be utilized. Common fusing press settings shall be established in order to fuse both the small parts and fronts fusibles together. Basic preproduction and production maintenance procedures, including a fusing press information chart, shall be required to assure proper fusing press performance relative to temperature control, evenness in pressure head or roller contact, dwell time and cleanliness. Results of the production maintenance procedures shall be recorded on figure 4.

3.3.6 Twill cloth. The material for the lower hanging pockets, inside chest pocket, bridle stays, back neck stay, armhole stays, chest pocket stays, and front edge stays shall be polyester and cotton or polyester and rayon cloth matching the shade of the basic material or black conforming to class 1 of MIL-C-43718, except that the nonfibrous material content and colorfastness requirements for perspiration and crocking shall not apply.

3.3.7 Undercollar material. The material for the undercollar shall be wool flannel, Army Green 48 conforming to MIL-C-15062, except that the colorfastness requirements for perspiration and crocking shall not apply.

3.3.8 Chest piece. The chest piece for the coat shall conform to type XXV of MIL-C-15065.

3.3.9 Braid.

3.3.9.1 Hanger loop. The braid for the hanger loop shall conform to type IX, class 1 of MIL-B-371. The color shall match the basic material and shall show "good" fastness to crocking and wet drycleaning.

3.3.9.2 Ornamentation (sleeve braid) for class 1 and 2 coats. The ornamentation for the sleeves of the class 1 coat shall be 1-1/2 inches and for class 2 coat shall be 1/2 inch wide, mohair braid, Black 194 conforming to type I, class 3 of MIL-B-593, except that colorfastness to perspiration shall not apply.

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the currentversion before use.

3.3.10 Labels. Each coat shall have a class 2 size label and a class 15 combination identification and instruction label conforming to type VI of DDD-L-20. The labels shall show fastness to drycleaning. The combination identification and instruction label shall include the following information:

COAT, WOMAN'S, CLASSIC DESIGN, POLYESTER/WOOL, AG-344, FUSIBLE

1. DRY CLEAN ONLY.
2. Use a damp cloth for all outside pressing.
3. Roll press (without creasing) sleeves and lapels.
4. Remove gloss marks at edges and seams with iron and damp cloth.
5. DO NOT REMOVE THIS LABEL.

3.3.11 Shoulder pads. The shoulder pads shall conform to type III, class 1 of MIL-P-15064.

3.3.12 Sleeve-heads. The sleeve-heads shall conform to type IV of MIL-P-15064, except that the length shall be 12 to 12-1/2 inches.

3.3.13 Stay tape. The material for the stay tape shall be cotton, preshrunk conforming to type I, classes 1, 2 or 3 (dyed black) of DDD-T-86, except that the requirement for non-fibrous material shall not apply. When black tape is used, it shall show colorfastness to wet drycleaning, perspiration, and crocking. The stays shall be 1/4 inch for armholes and back shoulder. As an alternate, a fusible edge tape, as specified in 3.3.13.1, may be used.

3.3.13.1 Fusible edge tape. The fusible edge tape shall be type I, style B, class 1, dyed black or charcoal conforming to MIL-C-44296, except that it shall be cut in the filling (cross cut) direction at a width of 1/4 +1/8, -0 inch. The edges shall be sewn together using a LSa-1 seam with a 304 stitch at 12-16 stitches per inch with 70/2 thread conforming to MIL-T-43548. All sewn edges shall be within the fusible dot area such that the adhesive will not exhibit any breaks or blank areas on either side of the joining seam.

3.3.14 Thread.

3.3.14.1 Thread, polyester core: cotton-, rayon-, or polyester-covered. The cotton-, rayon-, or polyester-covered polyester core thread shall conform to MIL-T-43548 in the colors, sizes and manufacturing uses as follows:

Use	Ticket	Color	Ply
Seaming and stitching of coat	30, 50, 70	Green E, C.A. 66034	2 or 3
Blindstitching, overedging and machine felling	70	Green E, C.A. 66034	2
Button sewing, hand	30	Green E, C.A. 66034	2 or 3

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

Use	Ticket	Color	Ply
(cont'd)			
Button sewing, machine (except automatic sew and shank type, see 3.3.14.6)	30	Green E, C.A. 66034	2 or 3
Braid stitching (class 1 and 2 coats only)	50	Black	2 or 3
Tacking armhole and attaching sleeve-heads and pads	30	White	2 or 3

3.3.14.2 Thread, silk. The silk thread shall conform to V-T-301 in the types, sizes and manufacturing uses as follows:

Use	Thread type	Size	Ply
Machine tacking	I	0	3
Hand felling or machine type felling	III	A or C	2
Machine made buttonholes	I	B or C	3
Handmade buttonholes	I	10	3

3.3.14.3 Thread, nylon. The nylon thread may be used as an alternate to the silk thread as indicated in 3.3.14.2. The nylon thread may also be used for padding lapels and collar. The nylon thread shall conform to the following type and sizes of V-T-295:

Thread type	Size
IV	A and C
VI	B, F and O
III	000 (for padding)
I	10 (for handmade buttonhole)

3.3.14.4 Thread, basting. The thread for basting shall be a good commercial grade, bleached or unbleached cotton thread. As an alternate, the cotton-covered polyester core thread used for seaming and stitching or the nylon thread used in hand or machine type felling may be used for basting or a soluble monofilament synthetic basting thread may be used for those operations where the thread is required to be removed, providing the coat is subsequently given a treatment by a drycleaning agent in which the synthetic thread is soluble. When the soluble thread is used, any residue remaining in the coat after the drycleaning process shall be brushed off or removed (see 6.10).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

3.3.14.5 Color. The color of the silk or nylon threads shall be Army Green E, C.A. 66034, except that the thread for stitching the sleeve braid shall be Black AA, C.A. 66043, and the thread for tacking the armholes and attaching the sleeve-heads and pads shall be white.

3.3.14.5.1 Colorfastness. All dyed thread shall show fastness to light, perspiration, and wet drycleaning, equal to or better than the standard sample. When no standard sample is available, the dyed thread shall show "good" fastness to light, perspiration, and wet drycleaning.

3.3.14.5.2 Color, thread, topstitching. All thread used for outside trim (topstitching) either silk or nylon, as indicated in 3.6.5 and table I shall be separately evaluated for Army Green E, C.A. 66034 shade matching.

3.3.14.6 Automatic button sewing. If an automatic machine which sews and shanks (wraps) the buttons in one operation simulating hand sewing is utilized, the thread shall be nylon waxed monocord, special No. 5, having a minimum breaking strength of 15 pounds and a minimum length per unit weight of 3600 yards per pound when tested for these requirements and for colorfastness (see 3.3.14.5.1) in accordance with test methods specified in V-T-295.

3.3.15 Gimp. The gimp for reinforcing the buttonholes shall be cotton, type I or II, size 8, green E, C.A. 66034 conforming to V-T-280. The dyed gimp shall show colorfastness to wet drycleaning, equal to or better than the standard sample. When no standard sample is available, the dyed gimp shall show "good" fastness to wet drycleaning.

3.3.16 Buttons. The buttons shall be metal, uniform, 25-line hopper back with split pin toggles for the shoulder loops and 30-line hopper back for the front, conforming to type I, style 2, class A of MIL-B-3461, except that hopper back buttons may be used with toggles.

3.3.17 Snap fasteners. The snap fasteners for the shoulder loops shall be round or square sew-on type, size 00, brass with black japan finish.

3.4 Design. The design is a fitted, single breasted, four button coat with side body construction, front bust seam from shoulder to top of pockets, slanted flap pockets, open notch collar and two piece sleeves with shoulder loops. The back has a vent in the bottom of the center back seam and the inside of the coat is 3/8 lined, with a yoke back, fully lined sleeve and one inside chest pocket.

3.5 Patterns. Standard patterns to be used for cutting the contractor's working patterns will be furnished by the Government. The standard patterns shall not be altered in any way and are to be used as a guide for cutting the contractor's working patterns. The working patterns shall be identical to the standard patterns. The patterns provide for the following seam allowances:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

1/4 inch

Shoulder loop seams
Pocket flap setting seam (alternate construction).
Outer arc of shield
Pocket flap construction
Front facing to fronts

1/2 inch

Collar setting seam

3/8 inch

Pocket flap setting seam
Under sleeve to top sleeve
Sleeve setting seam
Shoulder seam
Front bust seam
Side body to front
All other seams, unless otherwise specified

5/8 inch

Center back seam
Side body to side back seam

3.5.1 List of pattern parts. The components of the coat shall be cut from material as specified in accordance with the pattern parts indicated below:

List of pattern parts

Material	Nomenclature	Cut parts
Basic material	Side front	2
	Front	2
	Side body	2
	Back	2
	Under sleeve	2
	Top sleeve	2
	Top collar	1
	Shoulder loop	2
	Front facing	2
	Pocket flap	4
	Lower pocket facing	2
	Lower pocket double welt	2
	Bound buttonhole piping	4
Rayon or polyester lining cloth	Front lining	2
	Back yoke	1
	Top sleeve lining (alternate construction)	2
	Under sleeve lining (alternate construction)	2
	Armhole shield	4
	Inside chest pocket piping lining	2
	Vent	1
Twill cloth	Lower back hanging pocket	2 1/
	Inside chest pocket	1
	Lower front hanging pocket	2 1/

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

List of pattern parts (cont'd)

Material	Nomenclature	Cut parts	
Cloth, cotton, buckram	Undercollar interlining	1	2/
Cloth, flannel, wool	Undercollar	1	
Cloth, cotton, hair-wool	Chest piece interlining	2	
	Shoulder piece interlining	2	
	Shoulder wedge	2	
Press wool felt	Shoulder piece felt	2	
Fusible interlining cloth, fronts	Front fusible interlining	2	
	Side front fusible interlining	2	
Fusible interlining cloth, small parts	Front facing fusible interlining	2	
	Shoulder loop fusible interlining	2	
	Pocket flaps fusible interlining	2	
	Top sleeve fusible interlining	2	
	Under sleeve fusible interlining	2	
	Top collar fusible interlining	1	
	Bound buttonhole piping fusible interlining	2	2/
	Lapel notch reinforcement fusible interlining	2	
	Shapers		
	Undercollar stand		
	Undercollar		
	Finished lapel		
	Working lapel		
	Pocket flap		
	Front		

1/ Lower pocket lining may be cut in one piece.

2/ Basic pattern part may be used for this part.

3.6 Construction.

3.6.1 Stitches, seams and stitching. All stitches, seams, stitching types and stitches per inch specified in table I shall conform to FED-STD-751. When two or more methods of seams or stitch types are given for the same operation, any one of them may be used. Seam allowances shall be maintained with seams sewn so that no raw edges, run-offs, twists, pleats, puckers or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that tight or loose tension will not result. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall be considered a defect.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

3.6.1.1 Stitches per inch. The minimum and maximum number of stitches per inch shall be as specified in table I.

3.6.1.2 Repairs of type 301 and 306 stitching. Repairs of type 301 and 306 stitching shall be as follows:

a. When thread breaks or bobbin run-outs occur during stitching, the stitching shall be repaired by restarting the stitching a minimum of 1/2 inch back of the end of the stitching. 1/

b. Thread breaks or two or more consecutive skipped or run-off stitches noted during end item inspection shall be repaired by overstitching. The stitching shall start a minimum of 1/2 inch in back of the defective area and continue a minimum of 1/2 inch beyond the defective area onto the existing stitching. Loose or excessively tight stitching shall be repaired by removing the defective stitching, without damaging the materials, and restitching in the required manner. 1/

1/ When making the above repairs, the ends of the stitching are not required to be backstitched. The loose ends shall be trimmed by scissors. Caution: Pulling or breaking the loose ends is not allowed.

3.6.1.3 Repairs of type 101 and 103 stitching. Repairs shall be accomplished by superimposing new tack or blindstitching in same location after removing threads of first broken tack or blindstitching. When repairing blindstitching, superimpose stitching 1/2 inch over loose ends of broken stitching.

3.6.1.4 Repairs of type 401, 502, 503 and 504 stitching. All repairs shall be in accordance with 3.6.1.2.a and 3.6.1.2.b, except substitute 3/4 inch for 1/2 inch wherever 1/2 inch appears. Repairs to stitch type 401 may be accomplished by the use of stitch type 301.

3.6.1.5 Thread breaks and ends of seams. Ends of all seams and stitchings (except darts), when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch except on labels where the overlap shall be not less than three stitches. The ends of hand felling shall be tacked with not less than three stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. The thread ends of darts shall not be trimmed closer than 1/2 inch.

3.6.2 Buttonholes and eyelets. The buttonholes shall be eyelet-end, square bar, cut-first type worked over gimp with the ends of the gimp pulled through to the underside. The ends of the buttonhole stitching shall be bartacked by hand or machine, the width of the bar section, catching the ends of the buttonhole stitching, and the gimp. The finished cut length of the buttonhole for the front closures shall be 1 + 1/8, -0 inch. The shoulder loop shall have an eyelet measuring 3/16 to 5/16 inch in diameter at inside cut edge. The purl of

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

the buttonhole shall be on the outside of the coat. Tack the ends of the buttonhole with a 1/4 inch bartack containing 21 stitches, if done by machine, or 6 to 8 stitches if done by hand. All loose thread ends shall be trimmed or fused to within 1/8 inch of the bartack. Additive treatments or materials used to secure the ends of the stitching or to stiffen the fabric, prior to stitching the buttonholes, is prohibited. As an option, the front buttonholes may be a bound type buttonhole (piped with the basic material) (see 6.8).

3.6.3 Fusible interlinings pressed on a fusing press. A single layer of fusible interlining shall be fused to a single layer of basic material on a dry electrically heated conveyor type fusing press which has the capacity of controlling and retaining pressure, dwell time and temperature for a minimum of eight hours. Pair or sandwich fusing which can create differential shrinkage, stitching, and uneven bonding shall not be permitted. A steam sourced fusing press shall not be allowed for any initial fusing operations. For optimum results, the fusible material manufacturers recommendations for fusing dwell time, pressure and temperature, based upon the fusing equipment used and basic material being fused, shall be utilized. Basic preproduction and production maintenance procedures, including a fusing press information chart, shall be required to assure proper fusing press performance relative to temperature control, eveness in pressure head or roller contact, dwell time and cleanliness. Results of the production maintenance procedures shall be recorded on the chart as shown on figure 4.

3.6.4 Bartacks. Bartacks shall measure 1/4 to 3/8 inch long, and be free from thread breaks and loose stitching.

3.6.5 Outside trim top stitching. All outside trim topstitching shall be done with either silk or nylon thread as specified in table I, however, only one type of thread shall be used in the outside trim topstitching of any one coat.

3.7 Manufacturing operations requirements. The coats shall be made by and with the use of all operations listed in table I. The contractor is not required to follow the exact sequence of operations listed. Any additional basting or holding stitches used to facilitate manufacture is permissible provided the thread is removed or does not show on the finished coat.

3.7.1 Pressing. Pressing specified in table I shall be performed by use of a heated pressing iron or machine as commercially used. Any additional underpressing to facilitate manufacture is permissible.

3.7.2 Use of automated apparel equipment. Automated apparel equipment may be used to perform any of the operations specified in table I, providing that the seam and stitch type are as specified and the finished component conforms to the required configuration. When a government finished shaper pattern is furnished, the component shall conform to that pattern.

3.8 Figures. Figures are furnished solely for guidance and information. Should variation from the written specification appear in the figures, the written specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
1.	Cutting. a. Spread the material without tension. The cloth lay shall be no greater than 60 plies. The cut parts from the top and bottom plies shall match and correspond to the pattern. b. Lay the material in uniform widths and lengths. The plies shall not be stretched, pulled nor full, and one side of the lay shall be even. Mark each component part in the top of the main lay with the size of the coat. c. Cut the coat in strict accordance with the patterns furnished, which show directional lines, size and notches for proper assembly of parts. Directional lines shall be placed in the warp direction of the material. Waist notches shall be shallow to permit alterations. d. Cut all basic material parts of each coat out of the same piece of material except the under pocket flaps and pocket facing, which may be cut from ends. Parts cut from ends shall approximate the shade of the basic material. e. Cut all rayon lining parts of each coat out of the same piece of material, except sleeve linings and shields which may be cut from ends. Parts cut from ends shall approximate the shade of the lining. The two sleeve linings shall match in shade and the two finished shields shall match in shade. Cut binding for bottom hem and side seam finish on the bias, 5/8 to 7/8 inch wide, to desired finished length.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
1.	Cutting. (cont'd) f. Cut lining pieces for inside chest pocket facing 4-3/4 inches wide by 6-5/8 inches long in the warp direction. g. Cut the twill cloth for stays of sufficient length to meet operation requirements and in the direction and width as follows (the cloth may be placed on rolls): Location — Cut direction — Width (inches) Bridle and chest pocket — Warp — 1/2 Front edge — Filling — 1/4 Back neck — Filling — 3/4 Armhole — Bias — 1/4 and 3/4 h. Cut the fusible interlinings in the same direction as the parts to be fused. i. Cut the hanger loop of sufficient length to comply with the finished length (see operation 26.i). j. Cut the interlining cloth for undercollar in accordance with patterns furnished. k. Cut the wool flannel cloth for the undercollar in accordance with patterns furnished. l. Chest pieces: (1) Cut the cloth for the chest piece interlining, shoulder piece interlining, and shoulder wedge in accordance with patterns furnished.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
1.	Cutting. (cont'd) (2) Cut the felt for the shoulder piece in accordance with patterns furnished.						
2.	Replacement of damaged parts. Care shall be exercised during the spreading, cutting, and manufacturing operations to assure that material defects and damages, as classified in MIL-STD-1608, are excluded and replaced with nondefective and properly matched material.						
3.	Marking. The component parts of the coat shall be marked or bundled to assure a uniform shade or size throughout the garment. Bundling is permitted for lining cut parts only. Any method of marking may be used except: a. Corrosive metal fastening devices. No metal device shall be used on rayon lining. b. Sew-on type tickets (on rayon only). c. Adhesive type tickets which leave an impression or traces of paper or adhesive on the material after removal of tickets.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
3.	Marking. (cont'd) NOTE: The use of an ink pad numbering machine, rubber stamp or pencil is allowed, provided the numbering does not show on the outside of the coat, and wherever possible, is covered by the seam allowance. d. Identify the test swatches (basic material and fusible interlining) that represent every 1000 coat units of production.						
4.	Fusing. a. Fuse the following fronts parts with a woven fusible interlining (type II of MIL-C-44296): (1) Fronts: Position in the center with all edges set back 1/8 inch. Superimpose the lapel notch reinforcement on the top of the lapel with edges set back 1/8 inch from front, top and gorge edges. (2) Side fronts: Position in the center, with all edges set back 1/8 inch. b. Fuse the following small parts with a nonwoven fusible interlining (type V or VI of MIL-C-44296): (1) Top collar: Match notches. All remaining edges shall be set back 1/8 inch from collar edges. (2) Pocket flaps: Match notches. All remaining edges shall be set back 1/8 inch from flap edges.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
4.	Fusing. (cont'd) (3) Top and under sleeves: Line up notches with side edges set back 1/8 inch from sleeve side edges. (4) Shoulder loops: Place interlining even with center point, edges set back 1/8 inch from top point and bottom edge. (5) Fuse woven and nonwoven test swatches. (6) Front facing: Line up with shoulder. All remaining edges shall be set back 1/8 inch from facing edges. (7) Bound buttonhole piping. Position in the center with all edges even (non-automated method). NOTE: Fused lots and test swatches shall be allowed to cool to the touch prior to bundle tying or testing.						
5.	Make shoulder loops. Finished appearance. The shoulder loops shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges, and shall be uniform in shape and size. The eyelets shall be clean cut, well made, properly positioned, and the stitching shall be securely caught in the basic material.						
	a. Fold loop in half lengthwise and seam raw side edges.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
5.	Make shoulder loops. (cont'd)						
	b. Shift the seam to off center position of loop and with the seam spread open, stitch around the pointed end.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	c. Press seam open. Trim point, turn loop to right side and work out point.						
	d. Baste edges. Press flat.	101 or hand			Commercial		
6.	Make pocket flaps.						
	Finished appearance. The flaps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats, or raw edges and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The seamed edges, the corners and the points of the flaps shall be well worked out.						
	a. Position the fused outer flap to the under flap. Sew ends and bottom of flap and trim point. Turn flap to right side and work out edges.	301 or 401	SSe-2(a)	10-14 10-14	50 50	50 70	
	b. Baste edges. Press flaps flat. The lining must not show on the outside of flap.	101 or hand			Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
7.	Make collar.						
	Finished appearance. The collar shall be uniform in appearance and the edges shall be smooth and flat without twists, gathers, puckers, or raw edges (top and sides). The interlining shall not show after the collar is set.						
	a. Place interlining to undercollar felt and quilt with five to six rows of equally spaced blind-stitching. Press undercollar flat.	103 or 306 or 313 or 314	SSm-5 or 6 SSm-5 or 6 SSm-5 or 6 SSm-5 or 6	4-8 4-8 4-8 4-8	70 70 70 70	 70 70 70	
	b. Trim undercollar to conform to undercollar shaper. The undercollar may be die cut to conform to the undercollar shaper.						
	c. Trim undercollar interlining 1/8 to 3/16 inch away from lower edge of undercollar.						
	d. Stitch undercollar to interlining 1/2 ± 1/16 inch from edge.	301	SSa-1	10-14	50	50	
	e. Mark the breakline of undercollar with the undercollar stand shaper.						
	f. Stitch the undercollar to interlining at breakline. The collar stand shall be 1-1/4 ± 1/16 inches at center back.	301	SSa-1	10-14	50	50	
	g. Position outer edge of fused top collar between outer edges of undercollar. Seam the top collar to interlining easing in between notches.	301	LSa-1	4-6	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
7.	Make collar. (cont'd)						
	When operation 7.k. (top edge) is performed by machine, the top collar need not be sewn to interlining.						
	h. Baste the ends together, outer edge of collar and at crease line.	101 or hand	SSa-1		Commercial		
	i. In lieu of operations 7.g. and 7.h., baste the top collar to the undercollar along crease line and outer edge matching notches.	101 or hand	SSa-1		Commercial		
	j. Trim and turn edges of top collar over interlining between undercollar and interlining and baste edges.	101 or hand	SSa-1		Commercial		
	k. Fell top and side edges of top collar to undercollar by hand, or top edge may be machine felled with simulated hand stitching. The corners and sides shall be felled by hand. When simulated hand stitching is used, the operation shall precede collar basting.	Machine (simulated hand felling) or hand		6-10 8-10	A silk or B nylon C silk or C nylon		
	or						
	l. The side edges may be stitched 1/16 inch from finished shaped edge through the collar interlining. Trim top collar material only, 1/4 to 3/8 inch from finished seam line.	301		10-14	50	50	
	m. Trim bottom edge of top collar to allow for seaming.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
7.	Make collar. (cont'd)						
	n. Press and crease stand of undercollar holding crease line short and stretch outer edge of collar across the shoulders. Center area of crease line shall be straight for a distance of 3 to 4 inches.						
8.	Make coat sleeves and sleeve linings.						
	Finished appearance. The sleeves shall be uniform in width. The seams shall be pressed smooth and flat and shall be without gathers, puckers, pleats, or raw edges. The blindstitching for tacking turn up of sleeves shall not show through the outer side. The lining shall not be short or tight at bottom of sleeves.						
	a. Stitch forearm seams of sleeves, distributing fullness between notches.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	b. Shape press seam open without stretching.						
	c. Turn up bottom of sleeves, as indicated by marks on pattern, and baste along folded edge.	101 or hand	SSa-1		Commercial		
	d. Press bottom of sleeve. Remove all basting.						
	e. In class 1 and 2 coats stitch braid to sleeve with the bottom edge of braid 3 ± 1/8 inches from the bottom edge of the finished sleeve. The stitching shall be 1/16 to 3/32 inch from each edge of braid.	301	SSau-2	10-14	50 (black)	50 (black)	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

MIL-C-44379(GL)

Source: https://assist.dla.mil - 22 Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
8.	Make coat sleeves and sleeve linings. (cont'd)						
	f. Stitch backarm seam, matching notches. In class 1 and class 2 coats, the top and bottom edges of braid shall be aligned and the ends of the braid shall be caught in the seaming. Press seam open and flat.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	g. Tack forearm and backarm seam allowance of hem to sleeve seam allowance.	103 or hand		4 6 4-6	70 70		
	h. Stitch lining forearm and backarm seams.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	i. The sleeve linings shall extend not less than 9/16 inch above the top of sleeve. Tack forearm seam and backarm seam of sleeve lining to forearm seam and backarm seam of sleeves respectively, distributing lining fullness evenly. The tacking shall extend from not more than 5 inches below top of sleeve to not more than 5 inches above creased bottom edge of sleeve.	103 or hand		4-6 4-6	70 70		
	or						
	j. As an alternate, when using a sleeve lining felling machine (see 6.11), join backarm seam and forearm seam of sleeve lining. The distance between the notches on the forearm seam shall be left open.	301 or 401	SSa-1 SSa-1	10-14 10-14	30 30	30 50	
	k. Position the sleeve lining top notches to the top of forearm sleeve seam and top of the backarm sleeve hem. Tack forearm seam and backarm seam of	Hand or 301		2-3 4-8	50	50 50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
8.	Make coat sleeves and sleeve linings. (cont'd)						
	the sleeve lining to the forearm seam and the backarm seam, respectively. The backarm seam tacking shall extend from approximatley the midpoint of the backarm seam to not more than 6 inches above creased bottom edge. The forearm seam tacking shall be for a distance of 1-1/2 to 2 inches below the bottom left open forearm seam notch.						
	1. Pull sleeve through lining. Baste turn up of sleeve, if sleeve lining is to be felled by hand. Sleeve lining shall finish not less than 1 inch above bottom edge of sleeve. The sleeve lining may be felled without basting, if simulated machine stitch is to be used (see operation 33.j.).	101 or hand	SSa-1		Commercial		
	NOTE: Operations 8.d. and 8.e. may be performed after stitching backarm seam (see operation 8.g.).						
9.	Make shields and yoke.						
	a. Superimpose two shield pieces, face to face, and stitch around outer arc. Turn shield to right side, work out seams and raise stitch seam on underside.	301	SSa-1	10-14	50	50	
		301	LSq-2	10-14	50	50	
	or						
	b. Superimpose two shield pieces, back to back, and join together with a 7/8 inch wide bias binding using a folder. The bias binding shall be cut from the same material used for the lining.	301	BSc-1	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil - Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
9.	Make shields and yoke. (cont'd)						
	The finished side shall show on the top and the color of the thread shall match the lining fabric.						
	c. When alternate operation 9.b is used, the binding must be cut on the bias, 7/8 ± 1/16 inch wide. The binding may be put on rolls.						
	d. Seam a 1/2 ± 1/8 inch hem on bottom of one piece of yoke lining with the stitching 1/8 ± 1/16 inch from turned edge.	301	EFb-1	10-14	50	50	
	e. Press a 3/4 to 1 inch pleat at center and press across the bottom edge of the yoke. Fold shall be to the left side, as worn.						
10.	Make lining fronts and attach combination identification-instruction label.						
	a. Fold the uncut waist darts, as indicated by marks on pattern, and stitch. The darts shall be tapered to nothing, 1 ± 1/16 inch beyond drill holes.	301 or 401	OSf-1 OSf-1	10-14 10-14	50 50	50 70	
	b. Position the label on the right front (as worn) with the right side of label 2 to 2-1/2 inches from, and parallel with, the front raw edge of lining. The top of label shall be 2 ± 1/8 inches below the waist darts. Stitch the label on all four sides. The stitching shall not be through the printing.	301	LSbj-1	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
11.	Make inside chest pocket.						
	a. Join left front lining to left front facing. Press seams and darts towards side body.	301	SSa-1	10-14	50	50	
	b. Mark position for a 1/8 to 3/16 inch double-piped pocket on the left front lining, as indicated on pattern.						
	c. The top and bottom raw edges of the facing shall be turned in and seamed to the twill cloth pocket. When either edge is selvaged, the edge need not be turned in.	301	SSa-1	10 14	50	50	
	d. Seam twill cloth, positioned at marks on coat facing and lining with twill cloth stay extending to the armhole on the underside, with two rows of stitching, no less than 1/4 or more than 3/8 inch apart.	301	SSv-2	10-14	50	50	
	e. Cut opening of the pocket and tongue notch the ends of the opening. The finished length of the pocket opening shall be not less than 4-3/4 inches for woman's sizes 12 through 20 and junior sizes 11 through 19 and not less than 4-3/8 inches for woman's sizes 4 through 10 and junior sizes 3 through 9. It shall not extend into the facing more than 3/4 inch nor extend into the side body.						
	f. Turn pocket through cut opening, make and stitch top and bottom piping, and tack corners through tongue notch.	301		10 14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)
MANUFACTURING OPERATIONS REQUIREMENTS

NO.		STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
11.	Make inside chest pocket. (cont'd)						
	or						
	g. Pocket opening may be accomplished with a double-piped pocket machine which stitches, cuts, and turns piped edges in one operation. When a machine is used, the piping may be trimmed to permit insertion into the machine. The joining seam of the top and bottom piped edges shall be raise stitched through lining and coat facing prior to pocket closing, and top edge stitched through all plies. Tack ends of pocket opening.	301		10-14	50 or A silk or O nylon 50 or A silk or O nylon	50 50 or A silk or O nylon	
	NOTE: When this machine is used, the contractor may utilize the machine manufacturer's recommended piping reinforcement material in addition to the twill cloth.						
	h. Turn pocket into position and stitch sides and bottom edge of the pocket. The finished pocket shall measure not less than 5 inches in depth for all sizes. The back part of the pocket twill cloth shall be held taut to prevent gapping at the pocket opening.	301	SSa-1	10-14	50	50	
	i. Stitch twill cloth stay from back end of pocket to armhole. Notch top of pocket at front edge of the full width of seam allowance and blindstitch inner ply of pocket to facing (see operation 33.h for alternate operation).	301 103 or 306	SSv-1 and SSm-1 SSm-1	10-14 2-4 2-4	50 70 70	50 70	
	j. Press pocket smooth and flat.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
12.	Join front to side front.						
	Finished appearance. All seams, pockets, and flaps shall be correctly positioned, finished without pleats or gathers, and uniformly sewn. The width of pocket cords or pipings, pocket openings, and depth of pockets shall be as specified. The back edge of the pocket flap shall be aligned with front side body seam and in no instance finish more than 3/16 inch in front or back of this seam.						
	a. Join front to side front from pocket flap setting to shoulder. Press seam open.	301	SSa-1	10-14	50	50	
	b. Clip in corner on front bust seam. Position flap to lower flap setting seam and stitch flap and seam together. Size of flap shall be checked against pocket flap shaper.	301	SSa-1	10-14	50	50	
	c. Press pocket flap setting seam open. The seam allowances of the pocket flap will be pressed up.						
	or						
	d. For this method, trim 1/8 inch off of flap setting seam. Flap may be stitched to front, after front dart seam has been completely closed and front has been stitched to side body (operation 15.a.). Prior to setting flaps, front waist darts must be pressed open and size of flaps shall be checked against finished pocket flap shaper.						
	e. Overedge top raw edge of flap.	502 or 503	EFd-1 EFd-1	6-8 6-8	70 70	70 70	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)
MANUFACTURING OPERATIONS REQUIREMENTS

NO.		STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
12.	Join front to side front. (cont'd)						
	f. Position right side of flap to front with bottom edge up. Stitch line will be 1/8 inch above overedge seam and front of flap will finish in line with front waist dart. Stitch flap to front, backtacking each end of seam.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	g. Turn flap down and press flat. Trim away seam allowance at front corner. Tack top corners to coat front vertically 3/8 ± 1/16 inch along edge of flap. Backtack through all plies. An automatic straight tack may be used. Do not use a bartack.	301		12-16	0 silk or 0 nylon	0 silk or 0 nylon	
13.	Baste chest piece to fronts.						
	a. Position the prepared chest piece on the inside of the front with chest piece interlining next to front, aligned with gorge line and armhole curve.						
	b. Stitch along the edge of arc at armhole with a 1/4 inch seam, catching the chest piece and across shoulder interlining only, allowing room for the shoulder pad. Tack chest piece seam allowance at front bust seam.	103 or 306 or 313 or 314	SSm-6 to 8 SSm-6 to 8 SSm-6 to 8 SSm-6 to 8	4-8 4-8 4-8 4-8	70 70 70 70	 70 70 70	
	c. Position bridle tape 1/8 to 1/4 inch behind lapel breakline step at the gorge. Baste bridle tape (in a straight line) so that the center of bridle tape is placed on the edge of chest piece and will finish 1/4 to 3/8 inch behind the breakline at a point 1 to 1-1/8 inches from bottom	101 or hand	SSa-1		Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
13.	Baste chest piece to fronts. (cont'd)						
	of lapel. Top of bridle tape shall be caught in the top collar gorge stitching. Baste tape even and smooth for a distance of 1-1/2 to 2 inches from gorge, then hold tape taut for a distance of 4 to 5 inches to work in not less than 3/8 inch but not more than 1/2 inch breast fullness. Baste the balance of the tape without tautness or fullness. Tape and interlining shall be stamp marked to assure amount of fullnes.						
14.	Make two lower pockets.						
	a. Seam bottom edge of double welt to top edge of front ply pocket twill cloth, and turn seam down. Position welt on front of coat according to marks on pattern. Seam through coat 1/8 inch above and below mark for pocket opening. Cut on mark and tongue notch ends.	301	SSa-1	10-14	50	50	
	b. Turn welt and twill cloth pocket piece through opening. Fold the narrow side of welt piece up forming an upper piping 1/8 to 3/16 inch wide. Turn the wide side of the welt piece down forming the lower piping 1/8 to 3/16 inch wide. Stitch between the folds of both pipings, through the seam. The stitching shall be imbedded in the seam.	301	SSaf-2(b)	10 14	50	50	
	c. Stitch back pocket twill cloth to cloth facing. Turn seam down. On underside of front, position top edge of facing to top edge of upper piping seam allowance and seam together from the underside.	301	SSa-1	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
14.	Make two lower pockets. (cont'd)						
	Adjust pipings, tongues, and close ends of pocket opening. Continue stitching around twill cloth pocket.						
	d. These pockets may be made with a doublepiped pocket machine which stitches, cuts, and turns piped edges in one operation. When this machine is used, the welt piece may be trimmed to permit insertion into the machine. A twill cloth stay or the machine manufacturers recommended pocket stay material may be used. The joining seam of the bottom piping piece shall be raise stitched through front and piping piece, and the joining seam of the top piping pieces shall be raise stitched through all plies in the closing of the top of pocket. Ends of pocket shall be securely tacked. The finished length of the pocket openings shall be 4-1/2 ± 1/8 inches.	101 and 301		10-14 10-14	50 or A-3 or 0 nylon 50 A-3 or 0 nylon	50 A-3 or 0 nylon	
15.	Join side body to front of coat.						
	a. Join front to side body matching notches, working in bust fullness between notches. Press seam open and flat. Avoid stretching waist.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	b. Stitch 1/4 inch tape around each armhole beginning at side body, holding tape taut to prevent material at the front armhole notch and finishing at back edge from stretching. A 3/4 inch size bias tape shall be sewn to front armhole from notch to raw edge of shoulder seam. This operation may be performed	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
15.	Join side body to front of coat. (cont'd)						
	after the back and side body joining operation (see operation 20.b), using a one piece, 1/4 inch twill tape.						
16.	Shape lapels.						
	a. The left and right fronts of coat shall be pressed individually, on woman's left and right coat front pressing machine respectively, to conform to the shape of the body. The front edge shall be straight and in accordance with front shaper.						
	b. Mark and trim lapels as indicated by shaper.						
17.	Join facings to fronts.						
	a. Match, fit, and baste facings to coat putting in proper lapel and bust fullness. The facings shall be held slightly taut at bottom edges of foreparts.	101 or hand	SSa-1		Commercial		
	b. Position 1/4 inch tape 1/8 ± 1/16 inch from the edge of coat across top of lapel to front of interlining and facing, down front, and across bottom to back edge of facing and stitch.	301	SSa-1	10-14	50	50	
	c. Fusible edge tape construction (when used).						
	(1) Position tape 1/8 to 3/16 inch from the edge of the coat and stitch 1/16 to 1/8 inch from edge of tape, across top of lapel, down front, and across bottom to back edge of facing.	101 or hand			Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
17.	Join facings to fronts. (cont'd)						
	(2) Press edges, fusing edge tape to the front. Press edge seam flat toward front. Pull basting thread.						
	d. Blindstitch edge of bridle tape (that is not attached to the chest piece) to interlining.	103	SSm-1	3-4	50 or 70		
	e. Press edges flat and smooth, and pull basting threads. Edge seam may be pressed open (see operation 16.a.).						
18.	Baste coat edges and tack facings to interlining.						
	Finished appearance. Edges, lapel points, and corners shall be uniformly worked out. Fullness shall be uniformly placed at lapel break to point, when basting along breakline and back edge of facing so that lapel will roll. The lower front edges shall close flat and smooth, without rolling outward.						
	a. Notch corner of lapel and trim around lapel points and bottom corners of front edges. Turn facing, work out lapels and bottom corners of fronts.						
	b. Edge baste across top of lapel, down front, and across bottom of facing, rolling the joining seam toward the underside of lapel along lapel edge. Roll the lower part of joining seam toward the inside of the coat along the front and bottom edge of coat.	101 or hand	SSa-1		Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)
MANUFACTURING OPERATIONS REQUIREMENTS

NO.		STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
18.	Baste coat edges and tack facings to interlining. (cont'd)						
	c. Baste facings along lapel front (second basting) 1 ± 1/2 inch from edge, along fronts to a point in line with turn of lapel, holding lower corner of coat rolled in such a manner as to cause lower front edge of forepart to roll inward.	101 or hand	SSa-1		Commercial		
	d. Place a row of basting diagonally from lapel break to the point of lapel to allow lapel to roll.	101 or hand	SSa-1		Commercial		
	e. Baste along breakline of lapel, allowing fullness in facing, to permit lapel to roll.	101 or hand	SSa-1		Commercial		
	f. Baste back edge of facing, putting fullness over bust.	101 or hand	SSa-1		Commercial		
	g. Tack the back edge of left facing and lining to the interlining with one row of blindstitching from not more than 2-1/2 inches from shoulder seam to not more than 2 inches above inside pocket opening and continue the tacking along outer ply of inside pocket seam allowance of facing to within 2 inches of bottom of coat (see operation 33.h.).	301 or 103 or hand	SSm-1 SSm-1	2-4 2-4	50 50 or 70	50 50	
	h. Tack the back edge of right facing and lining to interlining with one row of blindstitching from not more than 2-1/2 inches from shoulder seam to within 2 inches of bottom of coat.	301 or 103 or hand	SSm-1 SSm-1	2-4 2-4	50 50 or 70	50 50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026/0-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
19.	Make backs. Finished appearance. The backs shall be joined without gathers, puckers, or pleats. The right vent lining and left vent shall finish smooth and flat without puckers, gathers or pleats. The vent shall finish right over left (as worn).						
	a. Tape back armholes with 1/4 inch twill tape starting at side back raw edge, drawing tape approximately 1/4 inch over shoulder blade area. (This operation may be performed after the back and side body joining operation, see operation 20.a.).	301	SSa-1	8-10	50	50	
	b. Stitch 1/4 inch twill tape to back shoulder seam between notches, easing in 3/16 inch of fullness. Tape shall be positioned 1/16 inch from sewing line and shall not be caught in the shoulder seam. Press before joining shoulder seams.	301	SSaa-1	8-10	50	50	
	c. Position a 3/4 inch size strip of straight cut twill cloth flush with raw edge of neck and stitch 1/8 inch below top edge from shoulder seam to shoulder seam.	301	SSa-1	8-10	50	50	
	d. Turn under edges of center back and side seam allowances of back parts 1/4 ± 1/16 inch and blind-stitch. The blindstitching of center back shall terminate at top of vent opening.	103 301 or 401	SSa-3(a) SSba-3 (b&c) SSba-3 (b&c)	3-6 10-14 10-14	70 30 30	 30 50	

Source: https://assist.dla.mil -- Downloaded: 2026l0-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
19.	Make backs. (cont'd)						
	e. Join center back with a 5/8 inch stitching seam terminating at vent notch. Slash left (as worn) seam allowance at top of vent and press back seam open.						
	f. Fold back raw edges of right (as worn) vent, in line with center back turned edge and bottom notch and stitch from top to bottom of vent 3/16 ± 1/16 inch from the raw edge.	301 or 401	SSa-1	10-14 10-14	50 50	50 70	
	g. Fold back right (as worn) vent in line with center back seam and bottom notch, and press.						
	h. Position vent lining to left vent, face to face, with side raw edges even and stitch lining to right vent, 1/16 to 1/8 inch from edge. Turn vent to inside even with folded back seam allowance, fold lining to inside and stitch from top to bottom of vent 1/32 to 1/16 inch from folded edge. No raw edges shall show at top of vent lining.	301	SSa-1	10-14	50	50	
	i. Stitch top of vent lining to the left (as worn) back seam allowance with the stitching continuing vertically down seam for a distance of 3/8 ± 1/8 inch.	301	SSbe-2	10-14	50	50	
	j. Stitch top of vent lining to the left seam allowance with the stitching continuing vertically down seam for a distance of 5/8 ± 1/8 inch.	301	SSbe-2	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
19.	Make backs. (cont'd)						
	k. Tack diagonally across top of vent through all plies, the width of the right vent allowance.	301		10-14	0 silk or 0 nylon	0 silk or 0 nylon	
	l. Baste yoke to inside of back in center, maintaining the center pleat in the lining, across shoulder area and armhole.	101 or hand	SSa-1		Commercial		
20.	Join back to side body.						
	a. Turn under edge of side seam allowance of front parts, 1/4 ± 1/16 inch and blindstitch.	103	SSba-3(a)	3-6	70		
	b. Stitch back to side body matching notches, working in fullness between back notches. Press seams open and flat. Avoid stretching waist.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 70	
	or						
	c. Place 1/4 inch twill tape on armhole and stitch as required in operation 20.a. across pressed open seam (see operation 20.b.) in one piece. Care must be taken not to stitch the front interlining to the tape.	301 or 401	SSaa-1 SSaa-1	10-14 10-14	50 50	50 70	
21.	Bind bottom edge of coat.						
	Finished appearance. The binding shall be evenly stitched with no raw edges showing and the fabric caught in the stitching. The binding shall not be tight or full, causing puckers, gathers or pleats.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
21.	Bind bottom edge of coat. (cont'd)						
	a. Bind the bottom edge of the coat with the top raw edge turned in and caught within the binding. Binding shall extend from the vent to 2 to 3 inches beyond side seam. The inside of the binding shall be raw.	301	BSb-1	10-14	50	50	
	NOTE: Before binding the bottom edge, remove the 1/4 inch allowed for booking the bottom turn-up from the bottom of the back and bottom of the front side press.						
	or						
	b. In lieu of binding the portion of bottom edge, turn in raw edge 1/4 ± 1/16 inch and blindstitch.	103	EF1-1	3-6	70		
22.	Hem bottom of coat.						
	Finished appearance. On the finished coat, the hem shall be turned up evenly all around. Right and left vent hems shall not be turned up excessively causing the coat to appear short at the center back. The blindstitching of the turn up at bottom shall not show through the outer side.						
	a. Turn up bottom of coat, as indicated on pattern, matching length of vent opening, and baste.	101 or hand	SSa-1		Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
22.	Hem bottom of coat. (cont'd)						
	b. Blindstitch complete bottom turn up of coat.	103 or		6-8	0 silk or 0 nylon		
		306 or		6-8	0 silk or 0 nylon		
		hand		6-8	A silk or A nylon		
23.	Baste lining to coat.						
	a. Baste pleat in shoulder fronts, and baste around armhole, down side seam, and across bottom.	101 or hand	SSa-1		Commercial		
	b. Turn in the bottom and back edge of lining and baste to body of coat; basting to allow room for felling. The raw edge of lining at bottom hem shall be covered.	101 or hand	SSa-1		Commercial		
	c. Trim gorge and the lining of armholes and shoulders with lining extending 1/4 inch from shoulder point at neck and 1/2 inch at shoulder point at armhole; trim even at the lapel notch to a point extending 1/8 inch from gorge at stop for lapel crease line to allow for gorge to settle even when lapel is turned and creased. The lining at armhole shall extend no less than 1/2 inch to allow for insertion of sleeve head and shoulder pads.						
	d. Baste shield to base of armhole with center notches matching.	101 or hand	SSa-1		Commercial		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
24.	Fell lining.						
	Blindstitch the bottom and sides of front body lining to body of coat. The felling stitches shall not be visible on the outside of coat.	Hand or 301		6-8 6-8	A silk 0 silk	0 nylon 0 nylon	
25.	Join shoulder seams.						
	Finished appearance. The shoulder seam shall finish flat and smooth without distortion.						
	a. Join shoulder seams matching front and back notches.	301 or 401	SSa-1	10-14	50 50	50 70	
	b. Press shoulder seams open and flat without stretching the seam.						
26.	Set collar.						
	Finished appearance. The collar shall finish centered on the back seam with the fullness distributed over the shoulder to conform to and hug the neck.						
	a. Mark neck outlet on the back and front gorge 1/2 inch at the back of the shoulder seam tapering to 3/8 inch at the lapel breakline and step notch on the lapel.						
	b. Trim gorge seam of facing to correspond with neck edge of coat.						
	c. Seam topcollar to front facing at gorge to a point not less than 3/4 inch back of lapel breakline.	301	SSa-1	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
26.	Set collar. (cont'd)						
	d. Slash the seam allowance of the facing at the end of the stitching. A 1/4 to 3/4 inch strip of straight cut twill cloth may be stitched to front and facing gorge seams (bias portion) prior to setting the collar.						
	e. Tack gorge seam open, catching bridle tape in the tacking.	Hand or 301			50 50	50	
	f. Baste undercollar to coat, putting in fullness over the shoulder.	101 or hand	SSa-1		50 50	50	
	g. Fell shoulder seam lining over front facing a distance of 1 to 1-1/4 inches from neck. Tack lining and coat to interlining of undercollar.	Hand or machine 204	LSb-1	6-8	A or C (nylon or silk)		
	or						
	h. Shoulder lining may be closed in one operation prior to collar setting, from neckline to armhole.	301 or 306			A or C (nylon or silk)		
	i. Place hanger loop and size label at center back of lining and coat above tacking stitch, and stitch 3 inches across, securely catching the ends of hanger loop. The size label shall be positioned so that the printing on the label will not be covered by the collar. The hanger loop shall measure 2 $\pm$ 1/2 inches from outside edge to outside edge in the finished coat.	Hand or machine					

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
26.	Set collar. (cont'd)						
	j. Fell the lower edge of undercollar to coat by hand or machine. The raw edge of the undercollar shall be inclosed within the felling.	Hand or	LSa-1	8-12	C silk or C nylon		
		machine (simulated hand felling)	LSa-1	6-10	A silk or B nylon		
		or 306	LSa-1	8-12	0 silk or 0 nylon	0 silk or 0 nylon	
	k. Blind tack corners of collar and lapels. The tacking shall not show on the outside of coat.	Hand		6 8	C silk or C nylon		
	l. Fell the lower edge of top collar from gorge seam to gorge seam by hand.	Hand		8-10	C silk or C nylon		
	or						
	m. Stitch lower edge of top collar from gorge seam to gorge seam by machine.	301	LSa-1	10 14	50	50	
27.	Edge baste front edges and collar.						
	Edge baste edges of lapels, fronts and collar basting to extend across bottom the width of the facings. The facing shall not hang below the outside of the front at the bottom. Press edges flat.	301	SSe-2	10 14	0 silk or 0 nylon 50	0 silk or 0 nylon 50	
		shows finished seam					

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
28.	Set shoulder loops and eyelets.						
	Finished appearance. The shoulder loops shall be of a uniform length and setting and shall lay flat and smooth. The collar must cover all points of shoulder loop.						
	a. Baste or stitch loop to shoulder at armhole. Trim even with armhole. Point of loop shall extend 1/8 ± 1/16 inch beyond raw edge of the gorge outlet and 1/4 to 3/8 inch in front of shoulder seam. The back edge of loop shall finish 3/4 ± 1/16 inch back of the shoulder seam at armhole.	101 or hand	SSa 1	10-14	50 50	50 50	
	b. Mark the location for the eyelet so that when the button is attached, the rim of the button shall be 1/8 +0, -1/8 inch away from the edge of collar.						
	c. Make an eyelet at marking. The cut of the finished eyelet shall measure no less than 3/16 inch or more than 5/16 inch (in diameter).	Machine	Eyelet				
29.	Set in sleeves.						
	Finished appearance. The sleeves shall set uniformly with fullness at armhole distributed without pleats or puckers. The sleeves shall hang alike with the front of each in the same relative position to the back of the pocket flaps. Front and back shall have a rolled effect. Sleeves may be pressed and rolled prior to hanging to facilitate check on the hang of sleeve.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)
MANUFACTURING OPERATIONS REQUIREMENTS

NO.		STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
29.	Set in sleeves. (cont'd)						
	Set sleeves matching front sleeve notch with front armhole seam distributing the sleeve head fullness between notches and catching the end of shoulder loops in the seam.	301 or 401	SSa-1 SSa-1	12-16 12-16	50 50	50 70	
30.	Press armhole seam.						
	Finished appearance. The armhole seam pressing shall not stretch or distort the armhole.						
	Press fullness of sleeve flat all around the armhole. The portion of the shoulder loop seam shall not be pressed back. Shoulder loop shall remain smooth and flat. Press seams open across top from 1 $\pm$ 1/4 inches above backarm seam to not less than 3 or more than 4 inches forward of shoulder seam, or the seam across top may be pressed toward sleeve in the same direction as loop.						
31.	Set shoulder pads.						
	a. Center pads between shoulder piece felt and chest piece interlining on each shoulder with edge of pad even with edge of armhole and tack center of pad to seam allowance.	204 or hand		4-6 4-6	Commercial Commercial		
	b. Tack neck end of pads to the shoulder in front and back of seam allowance.	Hand		2-4			

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026/10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
32.	Baste and tack armholes.						
	a. Baste balance of shoulder lining back over front. Baste around outside armholes, positioning lining, shoulder pad, and back of shoulder in place. Baste fullness of back lining in place; or back part of armholes may be basted from the lining side.	101 or hand	SSa-1		Commercial		
	b. Tack all around armhole by hand or machine, catching the shields at base of armhole.	301 or hand		4-6 4-6	30 30	30	
	NOTE: When armhole is tacked by machine, a loosely formed and elastic stitch shall be used, and operation 32.c. may be omitted.						
	NOTE: When tacking is done by hand, the tacking shall be backstitched every other stitch from front notch, around top of armhoie to back notch.						
	c. Tack across base of armhole from sleeve notch on front to side back seam.	301	SSa-1	4-6	30	30	
	d. Trim away excess lining and interlining.						
	e. Tack sleeve head wadding to armhole 7 inches in front and 5 inches in back of shoulder seam. The sleeve head wadding shall be positioned with folded edge adjacent to edge of armhole backing cloth side against sleeve and in such a manner as to cause it to fold on itself. The tacking shall be adjacent to armhole seam. When armhole is tacked by machine, the sleeve head wadding shall be attached in the armhole tacking operation.	Hand or 301		4-6 4-6	30 white 30 white	30 white	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
33.	Complete hand felling.						
	a. Fell lining all around armholes and backstitch pit of armhole from forearm seam of sleeve to back side body seam. The sleeve lining seams shall be turned toward the undersleeve.	Machine (simulated hand felling)		6-10	A silk or O nylon		
		or 306	SSa-1	10-14	50	50	
		or hand		6-10	C silk or C nylon		
	or						
	b. The sleeve lining may be stitched to the armhole on the inside from forearm seam of sleeve to the backarm seam across undersleeve.	301 and machine (simulated hand felling)	SSa-1	10-14	50	50	
				6-10	A silk or O nylon		
		or 306	SSa-1	10-14	50	50	
		or hand		6-10	C silk or C nylon		
	or						
	c. As an alternate, the armhole lining may be felled utilizing a sleeve lining felling machine that consists of a one needle, two thread, feed off the arm machine equipped with a lower and upper feed (see operations 8.j. and 8.k.).						
	d. Stitch sleeve lining to armhole on inside from front sleeve notch to backarm seam across undersleeve.	301	SSa-1	10-14	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
33.	Complete hand felling. (cont'd)						
	e. Stitch the top sleeve lining to armhole on inside from the front armhole notch to top backarm lining seam across the crown of the top sleeve lining.	306	SSa-1	10-14	50 or nylon A	50 or nylon A	
	f. Close the previous left opened forearm seam 1/16 to 3/32 inch from edge.	301	SSc-1	10-14	50	50	
	g. Sew lining at shoulder.	301 or 306		10-14 6-10	50 A silk or 0 nylon	50	
	h. Fell corners of lining and facing, at bottom of coat.	Hand		6-10	A or C silk A or C nylon		
	i. Fell bottom of lining to coat hem.	103 or 306		6-10	A silk or 0 nylon		
	j. Fell the sleeve lining turn-up to the sleeve 1 inch from the bottom edge.	Hand or 103 or 306		6-8 6-8	A or C silk A or C nylon 0 silk or 0 nylon	0 silk or 0 nylon	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
33.	Complete hand felling. (cont'd)						
	k. Tack bottom edge of armhole shields on the underside to lining.	Hand		6-8	A or C silk or A or C nylon		
	l. In lieu of operations 11.h. and 18.g., front edge of inside chest pocket may be tacked by hand. Tack through facing pocket seam allowance and interlining, from corner of pocket opening and down for a distance not less than 5 inches.	Hand		2-4	A or C silk or A or C nylon		
34.	Clean coat.						
	a. Remove all basting threads.						
	b. Ends of all stitching shall be trimmed and loose threads removed from the coats.						
	c. All spots, stains, and shade or size markings shall be removed without damage to the material.						
35.	Mark and make buttonholes.						
	a. Press right front prior to the buttonhole operation.						
	b. Mark right front for four buttonholes as indicated by marks on pattern for top and bottom buttonholes. The remaining two buttonholes shall be evenly spaced between top and bottom buttonholes.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)
MANUFACTURING OPERATIONS REQUIREMENTS

NO.		STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
35.	Mark and make buttonholes. (cont'd)						
	NOTE: Caution should be exercised that marking be in strict adherence with top and bottom buttonhole as marked on pattern. On the finished coat the top button and buttonhole must not be lower than top buttonhole on pattern (0 tolerance) nor higher than mark on pattern by 1/8 inch.						
	c. Make four buttonholes in right front as marked with the inside edge of the eyeiet 5/8 +0, -1/8 inch from the finished edge of the coat. The cut of the finished buttonhole after tacking shall measure 1 +1/8, -0 inch (see 3.6.2).	Machine or		63-70 per 1 inch buttonhole	C or B nylon	B or B nylon	
	1 +1/8, -0 inch (see 3.6.2).	hand		56-63 per 7/8 inch buttonhole	B nylon		
	d. Bartack ends of buttonholes with a vertical bartack, with the bartack centered on both legs of the buttonhole.	Bartack or		21 per bartack	B silk or B nylon	B silk or B nylon	
		hand		6-8 per bartack	10 silk or 10 nylon		
	e. Optional bound buttonhole construction (when used) (see 6.8).						
	Finished appearance. The buttonhole shall be 1 ± 1/8 inch long, positioned on the right front as indicated by marks on pattern and as indicated in paragraph 3.6.2.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
35.	Mark and make buttonholes. (cont'd)						
	(1) Mark the position and the length of the buttonholes on front.						
	(2) Cut strip in two pieces for each buttonhole, sufficiently long to extend beyond the ends of the buttonhole.						
	(3) Fold strip of basic material in half lengthwise and stitch 1/8 inch from folded edge.	301	OSf-1	12-16	50	50	
	(4) Place pieces of stripping on each buttonhole mark with the raw edges abutted. Stitch to front through interlining, with the stitching superimposing the 1/8 inch stitching on the buttonhole strip, and securely tack ends. The two parallel lines of stitching shall be not more than 1/4 inch apart.	301		12-16	50	50	
	NOTE: The 1/8 inch line of stitching from the folded edge (see operation 35.d.) may be omitted.						
	(5) Cut between the two parallel rows of stitching through front fusible interlining, tongue notching ends.						
	(6) Turn piping, joining seam to inside. Turn in the tongue notched ends and stitch on inside across ends of buttonhole through tongue and piping only.	301		12-16	50	50	

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
35.	Mark and make buttonholes. (cont'd)						
	(7) Baste buttonhole closed.	Hand or machine	-	-	-	-	
	(8) Trim excess material at each end of buttonhole to not less than 3/8 inch from the stitching across the ends.						
	NOTE: The buttonholes may be made in one operation using a special machine with a suitable material for reinforcement. When using the special machine, the notch of the piping piece shall be placed towards the top of the front.	101 or 301	-	12-16	50	50	
	f. Finish front bound buttonhole.						
	Slit facing the length of buttonhole in line with opening. Turn in raw edge and fell to piping, securely tacking ends. Indentations along front edge of coat, in line with buttonholes, shall be avoided.	Hand	-	8 10	A or C silk		
36.	Press coat.						
	Finished appearance. The coat shall be pressed smooth and flat, without any gloss or pressing impressions. The top of sleeves shall be blocked and pressed having a rolled effect at front and back. The left front edge below the lower button shall hang in a straight vertical line when buttoned on a form.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
36.	Press coat. (cont'd) a. Place coat on hanger after first pressing operation until completion of pressing. b. Press edges (edge pressing machine) of lapels, fronts, collars, and bottom of coat. c. Press right and left fronts on women's right and left front machine respectively. d. Press balance of fronts, side seams, and back on body machine. e. Press collar on collar machine stretching outer edge of collar over shoulder area when required. The pressed crease at breakline of lapel shall extend 2 to 2-1/2 inches below the gorge seam. The remainder of the lapel shall be roll pressed. f. Care shall be exercised that collar and lapels are pressed in accordance with the width prescribed on the finished collar lapel shaper. g. Press armhole and shoulders on armhole machine. Shoulders may be pressed on a shoulder machine. h. Press armhole solid from the inside, creasing armhole from not less than 1/2 inch above backarm seam to not less than 4 inches below shoulder seam. The armpit and back of armhole shall be held short and pressed flat. i. Roll press sleeves, do not crease.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE I. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
37.	Finish pressing. a. Press coat lining and shields smooth. b. Remove gloss, wrinkles, creases, and all pressing impressions. c. Block armhole and shrink top sleeve. d. Brush coat and examine. e. Press any wrinkles missed or caused by previous pressing operations.						
38.	Mark coat for buttons and attach button to shoulder loop. a. Mark the location of the four buttons on the left front of coat, as indicated on patterns, to correspond with buttonholes on right front. Buttons shall be sewn 3/4 to 7/8 inches from edge. Buttons shall be in vertical alignment. b. Fasten a button through each shoulder loop eyelet with a toggle. The button shall be attached with the eagle in upright position, with the spread wings of the eagle in line with shoulder seam, the head in direction of the back edge of the loop. The button shall be positioned as specified in operation 28.b.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
39.	Sew on buttons. Finished appearance. The buttons shall be attached with the eagle in the upright position and when sewn by hand, the sewing shall be backstitched with not less than two stitches and with the ends of thread hidden.						
	Sew on buttons for fronts. Sew a 30-line button on left front at each mark through front, interlining, and facing.	301 or		14 16 per button	30	30	
		101		14 16 per button	30		
		or hand		4 6 per button double thread	30		
		or 801 (see Fig. 3 and 6.11.b)		7 (min) per button (1 deep set)	4 nylon		
40.	Sew snap fastener to shoulder loop.						
	Sew a male part of the snap to underside of shoulder loop in line with center of loop 1-1/4 ± 1/8 inches from end of point. Sew a female part of the snap to front of coat to correspond with male snap. When the snap fasteners are engaged the shoulder loops shall lie flat and smooth without twists, pleats or bulges.	301 or		11 per fastener	50	50	
		101 or		20 22 per fastener	50		
		hand		14-16 per fastener	50		

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

NO.	TABLE I. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
41.	Tack pocket flap. Spot tack the lower back corner of each pocket flap 1/16 to 1/8 inch from back and bottom edges to the coat. The tack shall not show through on the outside of the flap. After tacking, the flap and front of the coat shall be smooth and flat without twists, pleats or bulges. Tacking shall be according to good commercial practice.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

Measurements. The finished measurements of the coat shall conform to the measurements shown in tables II and III.

TABLE II. Measurements for women (inches)

	Size									
	4	6	8	10	12	14	16	18	20	Tol.
1/2 bust	17-3/4	18-1/4	18-3/4	19-1/4	20	20-3/4	21-1/2	22-1/2	23-1/2	± 3/8
Cross back	13-5/8	13-7/8	14-1/8	14-3/8	14-3/4	15-1/8	15-1/2	16	16-1/2	± 3/8
1/2 waist	13-1/4	13-3/4	14-1/4	14-3/4	15-1/2	16-1/4	17	18	19	± 3/8
1/2 waist plus sizes	13-3/4	14-1/4	14-3/4	15-1/4	16	16-3/4	17-1/2	18-1/2	19-1/2	± 3/8
1/2 sweep	19-3/4	20-1/4	20-3/4	21-1/4	22	22-3/4	23-1/2	24-1/2	25-1/2	± 1/2
1/2 sweep plus sizes	20-1/4	20-3/4	21-1/4	22-1/4	23	23-3/4	24-1/2	25-1/2	26-1/2	± 1/2
Sleeve Length:										
Short		21-3/4	22	22-1/4	22-1/2	22-3/4	23	23-1/4	23-1/2	± 1/4
Regular	22-3/4	23	23-1/4	23-1/2	23-3/4	24	24-1/4	24-1/2	24-3/4	± 1/4
Long	24-1/4	24-1/2	24-3/4	25	25-1/4	25-1/2	25-3/4	26	26-1/4	± 1/4
X-Long			26-1/4	26-1/2	26-3/4	27				± 1/4
Back Length:										
Short		25-3/4	26	26-1/4	26-1/2	26-3/4	27	27-1/4	27-1/2	± 3/8
Regular	26-3/4	27	27-1/4	27-1/2	27-3/4	28	28-1/4	28-1/2	28-3/4	± 3/8
Long	28	28-1/4	28-1/2	28-3/4	29	29-1/4	29-1/2	29-3/4	30	± 3/8
X-Long			29-3/4	30	30-1/4	30-1/2				± 3/8

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE III. Measurements for juniors (inches)

	Size									
	3	5	7	9	11	13	15	17	19	Tol.
1/2 bust	17-3/8	17-7/8	18-3/8	18-7/8	19-5/8	20-3/8	21-1/8	21-7/8	22-5/8	± 3/8
Cross back	13-3/8	13-5/8	13-7/8	14-1/8	14-1/2	14-7/8	15-1/4	15-5/8	22-5/8	± 3/8
1/2 waist	12-7/8	13-3/8	13-7/8	14-3/8	15-1/8	15-7/8	16-5/8	17-3/8	18-1/8	± 3/8
1/2 waist plus sizes	13-3/8	13-7/8	14-3/8	14-7/8	15-5/8	16-3/8	17-1/8	17-7/8	18-5/8	± 3/8
1/2 sweep	19-3/8	19-7/8	20-3/8	20-7/8	21-5/8	22-3/8	23-1/8	23-7/8	24-5/8	± 1/2
1/2 sweep plus sizes	19-7/8	20-3/8	20-7/8	21-7/8	22-5/8	23-3/8	24-1/8	24-7/8	25-5/8	± 1/2
Sleeve Length:										
X-Short				22-3/8	22-5/8	22-7/8	23-1/8	23-3/8	23-5/8	± 1/4
Short	22	22-1/4	22-1/2	22-3/4	23	23-1/4	23-1/2	23-3/4	24	± 1/4
Regular	22-5/8	22-7/8	23-1/8	23-3/8	23-5/8	23-7/8	24-1/8	24-3/8		± 1/4
Long	24-1/8	24-3/8	24-5/8	24-7/8	25-1/8	25-3/8				± 1/4
Back Length:										
X-Short				24-3/8	24-5/8	24-7/8	25-1/8	25-3/8	25-5/8	± 3/8
Short	24-5/8	24-7/8	25-1/8	25-3/8	25-5/8	25-7/8	26-1/8	26-3/8	26-5/8	± 3/8
Regular	25-7/8	26-1/8	26-3/8	26-5/8	26-7/8	27-1/8	27-3/8	27-5/8		± 3/8
Long	27-1/8	27-3/8	27-5/8	27-7/8	28-1/8	28-3/8				± 3/8

Source: https://assist.dla.mil -- Downloaded: 2026-02-22T01:51Z
Check the source to verify that this is the current version before use.

3.9.1 Methods of measuring. The coat shall be buttoned, placed flat upon a table and measured from folded edge to folded edge, unless otherwise indicated.

1/2 bust	- Across front at underarm seam.
Cross back	- 4-1/2 inches below neck edge of undercollar (may be measured on form) from sleeve setting seam to sleeve setting seam.
1/2 waist	- 1-1/4 inches above lowest button.
1/2 sweep	- Along bottom hemmed edge making certain that the back vent and overlap are laying flat and closed.
Back length	- Along center back seam from neck edge of undercollar to bottom of coat.
Sleeve length	- Down center of sleeve from sleeve setting seam at shoulder to bottom of sleeve.

3.10 End item. The end item fusible shall have "no strike through" of the adhesive after fusing. The production end item testing shall be as specified in 4.4.5. Results of the end item drycleaning test shall be recorded on figure 5. Copies of figures 4 and 5 shall be attached to and become part of the contractor's end item examination record.

3.11 Workmanship. The end item shall conform to the quality of product established by this document and the occurrence of defects shall not exceed the applicable acceptable quality level.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements (examinations and tests) as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in this specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements, however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

4.1.2 Responsibility for dimensional requirements. Unless otherwise specified in the contract or purchase order, the contractor is responsible for ensuring that all specified dimensions have been met. When dimensions cannot be examined on the end item, inspection shall be made at any point, or at all points in the manufacturing process necessary to ensure compliance with all dimensional requirements.

4.1.3 Certificates of compliance. When certificates of compliance are submitted, the Government reserves the right to inspect such items to determine the validity of the certification.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Quality conformance inspection (see 4.4).

4.3 First article inspection. When a first article is required (see 3.1 and 6.2), it shall be examined for the visual and dimensional defects specified in MIL-STD-1608, as modified by 4.4.4 and tested as specified in 4.4.5.

4.4 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be performed in accordance with MIL-STD-105.

4.4.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all the requirements of referenced documents unless otherwise excluded, amended, modified, or qualified in this specification or applicable purchase document. In addition, testing shall be performed on components listed in table IV for the characteristics noted including small parts and fronts fused to the outershell fabric as prepared by the contractor during the pre-production testing period. The methods of testing specified in FED-STD-191, wherever applicable, and as listed in table IV shall be followed. All requirements are applicable to the sample unit. Unless otherwise specified, lot average will apply when more than one determination is made per sample unit. All test reports including figures 4 and 5 shall contain the individual values used in expressing the final result. The component lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size shall be expressed in linear yards and the sample unit shall be 18 linear inches full width. The sample size shall be in accordance with the following:

Lot size	Sample size (sample unit)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

TABLE IV. Component tests - fusible material

Components	Characteristics	Requirement	Test Method
Cloth, fusible, all parts	Color	3.3.5.1 thru 3.3.5.2	Visual 1/
	Adhesive type	3.3.5.1 thru 3.3.5.2	1/
	Evenness of adhesive	3.3.5.1 thru 3.3.5.2	1/ 2/
	Colorfastness to drycleaning	3.3.5.4	5621

1/ A certificate of compliance will be accepted for this requirement.

2/ A 12 inch head end per 100 yards of fusible material shall be viewed under a black light for unevenness of adhesive, missing dot coating or extreme heavy coating. Any of these conditions observed shall cause rejection of the 100 yard sample.

4.4.2 Daily preproduction testing. The tests listed in table V shall be performed each day prior to the start of production. The lot size, sample unit, sample size and acceptance/rejection criteria shall be as stated in the applicable test method.

TABLE V. Daily preproduction testing

Characteristic	Requirement	Test Method
Bonding strength:		
Small parts	3.3.5.3	4.4.2.3
Fronts	3.3.5.3	4.4.2.3
Fusing press settings	3.3.5.6	4.4.2.1
Actual fusing temperature	3.3.5.6	4.4.2.2

4.4.2.1 Fusing press settings. Before production begins each day, visually check all fusing machine settings for temperature, pressure and conveyor speed dwell time for conformance with the manufacturer's recommendations. Nonconforming settings shall be adjusted accordingly. Actual settings will be recorded in the first column of figure 4.

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

4.4.2.2 Actual fusing temperature. Two swatches of outershell material, 11 inches in the filling direction and 12 inches in the warp direction, shall be cut from outershell material to be used in the first two hours of the day's production. At the same time, one swatch each of the small parts fusible and the fronts fusible material, 11 inches in the filling direction and 12 inches in the warp direction shall be cut from material to be used in the first 2 hours of the day's production. All test swatches shall be cut into three equal parts of approximately 3.6 inches by 12 inches. The fusible test swatches may be cut slightly smaller in size to avoid conveyor belt contamination. Sandwich a temperature strip face down between one specimen of outershell material placed face down and a specimen of the fronts fusible material placed on top with the adhesive side down. The temperature strip shall be placed slightly within the fusible starter strip. All small parts and fronts fusing tests shall have an approximate 1 inch by full width starter strip or non-fused area incorporated into the top portion of any given bond strength samples. This can be accomplished by placing a thin non-adhesive material between the fusible interlining and outershell before fusing, or by folding the fusible onto itself. This sample shall be placed in the center of the fusing press conveyor with the outershell material down. Prepare two additional samples as described above using the fronts fusible material and place them on the left and right sides of the conveyor belt with the outershell material face down. Repeat the process for the small parts fusible material but without using the temperature strips. Lanes may be designated on the samples if necessary. After the fusing press is fully warmed up run all samples through the press. When all the samples are cool to the touch after running through the press, take the temperature strip specimens, determine the average of the three readings, and record the results in column 2 of figure 4. Retain each individual temperature reading in an organized self-developed worksheet form. If the average falls outside of the fusible manufacturers recommended range, or if there is a variance in excess of $10^{o}F$ or $6^{o}C$ between lanes, determine the cause, correct the problem and repeat the testing process. Actual temperature will be recorded on figure 4. (See 6.5 for suggested temperature indicator sources.)

4.4.2.3 Bonding strength. To determine bonding strength, trim all small parts and fronts fusible swatches from the actual fusing temperature test to 1 inch by 12 inch strips. Pinking shears shall not be used to cut strips. The outershell fabric of each shall be clamped at the top and the fusible material pulled from the starter strips downwards in a vertical direction in a steady continuous motion. A constant-rate-extension (CRE), or a constant-rate-traverse (CRT), or calibrated spring scale type tester may be used. If a spring scale type tester is used, it shall be calibrated once weekly. Any calibration procedure used shall assure an accuracy of 1/4 ounce or better,

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

and the date of calibration shall be entered on figure 4. Average the three bonding strength readings for each fusible type. Retain each individual bonding strength reading in an organized self-developed worksheet format and record the averages on figure 4. If the minimum bonding strength requirements specified in 3.3.5.3 are not met, cause must be determined, corrections made and the material retested until the problem is resolved before commencing production. In case of bonding strength dispute, see 6.7.

4.4.3 In-process inspection. Inspection of sub-assemblies shall be made to ascertain that construction details which cannnot be examined in the finished product are in accordance with specified requirements. The Government reserves the right to exclude from consideration for acceptance, any material or service for which in-process inspection has indicated nonconformance. Examination shall be made of the following operation to establish conformance to specified requirements. Whenever nonconformance is noted, correction shall be made to the areas affected, the lot in progress, and to the operation. Parts which cannot be corrected shall be removed from production.

a. Visual and dimensional examination of the working patterns to determine that they conform to the Government patterns in all respects (see 3.5).

b. Visual and dimensional examination of the cut parts to determine that they are properly cut with respect to size and material directional requirements (warp and filling), that location marks and notches on the parts are located correctly, and that parts containing material defects and damages have been removed (see table I, operation 2).

c. Visual examination of side front, side back, and side body seams to insure that the correct seam allowance is being taken and that the seam allowances are consistent in width through the waist and entire length of seam. 1/

d. Visual examination of cut parts during assembly of the coat to determine proper shade matching (see table I, operation 3).

e. Visual examination of pressed fronts to determine that pressing is performed correctly and proper pressing machine is used (see table I, operation 17.d).

f. Visual examination of collar gorge seam to determine seam is tacked open and the bridle is caught in the tacking (see table I, operation 26.e.). 1/

g. Visual examination of sleeves (prior to basting lining to armhole, side seams, and bottom of coat) to determine that sleeves are set uniformly with fullness at armhole distributed without pleats or puckers (see table I, operation 29).

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

h. Visual examination of the fused cut parts to assure conformance to the specified positioning requirements of table I, operation 4 and that there is no bubbling, strike back, or strike through. Additionally, all cut parts shall be examined for any resin transference.

1/ For this examination the contractor shall establish an inspection station. Periodic examination shall be made during each work shift to determine that the requirements are being met.

4.4.3.1 In-process fusing press maintenance and representative production testing. In-process tests listed in table VI shall be performed. Actual fusing temperature and bonding strength testing shall be performed after every 2 hours of fusing production time, and prior to restarting fusing production after any stopping of fusing for 29 minutes or more. Pressure evenness and dwell time maintenenace testing shall be performed once weekly. All representative production testing shall be performed on the outershell, and both the small parts and fronts fusible materials, sampled from component lots to be consumed in the next 1000 units of coat production. Sample size, and acceptance/rejection criteria shall be as specified in the applicable test procedure.

TABLE VI. In-process fusing press maintenance and representative production testing

Characteristic	Requirement	Test Method
Drycleaned bonding strength:		
Small parts	3.3.5.3	4.4.3.4
Fronts	3.3.5.3	4.4.3.4
Bonding strength:		
Small parts	3.3.5.3	4.4.2.3
Fronts	3.3.5.3	4.4.2.3
Representative production:		
Differential shrinkage	3.3.5.5	4.4.3.3
Appearance (before and after drycleaning)	3.3.5.5	4.4.3.4
Drycleaned shrinkage	3.3.5.5	4.4.3.4
Fusing press maintenance:		
Actual fusing temperature	3.3.5.6	4.4.2.2
Pressure evenness	3.3.5.6	4.4.3.2
Dwell time	3.3.5.6	4.4.3.2

4.4.3.2 Pressure evenness and dwell time. Cut five 1 inch in the filling direction by 12 inches in the warp direction strips of both the outershell material and the fronts fusible material being used in current production. Place each of the fusible strips with the adhesive side down on the top of the outershell material with the face side down and with a fusible starter strip

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

(see 4.4.2.2). Arrange the five specimens on the fusing press conveyor belt alongside each other in five different lanes consisting of extreme left, middle left, center, middle right, and extreme right. Lanes may be marked on each strip if necessary. Run the specimens through the fusing press and using a stop watch, wrist watch or any mechanism that assures proper timing, mark the time elapsed between the time the leading edge of one of the specimens comes under pressure contact or begins to disappear into the fusing machine and the time it is first visible from either pressure contact or from the fusing machine. As an alternate procedure, the dwell time test may be conducted with the outershell differential swatch required in 4.4.3.3. Enter the dwell time on figure 4. Remove the strips from the fusing machine when adequately cooled, and perform the bonding test in 4.4.2.3 on all five specimens, recording the results for each specimen on figure 4. The dwell time should be consistent with the machine speed ratings, and the fusible manufacturers recommended range and all five specimens should meet the minimum initial requirement for bond strength specified in 3.3.5.3. Any variations shall be investigated for cause, corrections made, and the testing process repeated.

4.4.3.3 Differential shrinkage. From the outershell material cut three 11 inches in the filling direction by 12 inches in the warp direction swatches and cut the same size pieces from the small parts fusible and the fronts fusible materials. Mark all the swatches with 10 inch gage marks using drycleaning resistant ink. Run one swatch of outershell material through the fusing press by itself, and record the dimensional change in both directions to the nearest one half percent. As an alternate, the dwell time test (see 4.4.3.2) may be conducted using this swatch. Prepare the two composite samples with the remaining two outershell swatches placed face down, then place the small parts and fronts fusible material swatches, matching the outershell warp direction, on top with the adhesive side down and with the fusible starter strips (see 4.4.2.2). After running through the fusing press, record the dimensional changes in both directions of the samples to the nearest one half percent. Differential shrinkage shall be calculated as the difference, if any, between the dimensional percent changes in the outershell material and each of the fusible materials. This information shall be recorded on figure 5, chart A. If the differential shrinkage exceeds the requirements specified in 3.3.5.5, investigate to determine cause, correct the problem, and repeat testing.

4.4.3.4 Drycleaning appearance, shrinkage and bonding strength. For all tests use the two small parts and fronts premarked by 12 inch by 11 inch fused swatches fabricated in 4.4.3.3. Prior to drycleaning, the two swatches shall be pressed twice each on a top and bottom steam press with closed head for 20 seconds and vacuum for 10 seconds. Both swatches shall be drycleaned three times using a commercial drycleaning procedure and perchlorethylene solvent. Each swatch shall be steam pressed with 20 second bottom steaming in the non-locked position and vacuum after each of the three drycleanings. After cleaning and pressing, examine the swatches for bubbling, delamination, or strike through and record the observations on figure 5, chart A. Measure the bench marks on the outershell material in both directions for each swatch,

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

determine shrinkage to one half percent, and record on figure 5, chart A. Trim each swatch into three 1 inch by 12 inch strips and perform bonding strength tests using the bonding strength procedure in the preproduction testing in 4.4.2.3. Retain each individual bonding strength reading in an organized self-developed worksheet format and record the averages on figure 5, chart A. Any evidence of bubbling, delamination, or strike through or either shrinkage or bonding strength not meeting the requirements of 3.3.5.3 shall be investigated for cause, corrections made and retesting performed before continuing production of the 1000 coats represented by the sample.

4.4.3.5 Examination of coat fronts and facings. The right and left coat fronts, after stitching side fronts, coat front fusible interlinings, and facing, shall be examined for the defects listed below. The lot shall be all pairs (matched right and left) of coat fronts submitted for inspection at one time. The sample unit shall be one pair of coat fronts (right and left). The inspection level shall be II (see 6.9).

Examine	Defects
Front seam and side body fronts	One or more omitted One or more not as specified One or more not pressed as specified
Fronts fusible interlinings and facing fusible interlinings	Not attached or positioned as specified Not fused Omitted
Front chest piece	Not attached or positioned as specified Omitted

4.4.4 Point count inspection. Sampling and inspection provisions for end item examination, dimensional examination, and packaging inspection shall be performed in accordance with MIL-STD-1608, except that for end item examination, the following defects and point values listed in table VII shall be added to or substituted for, as applicable, the defects and point values listed in MIL-STD-1608.

TABLE VII. End item defects

Examine	Defects	Point Value
Cleanness	Spot or stain on outside:	
	a. Up to 1/4 inch inclusive in longest direction	2
	b. More than 1/4 inch in longest direction	3
	Spot or stain on inside	1

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the currentversion before use.

TABLE VII. End item defects (cont'd)

Examine	Defects	Point Value
Shoulder loop	Point of loop extending beyond edge of gorge outlet by more than 3/16 or less than 1/16 inch	1
	Back edge of loop more than 13/16 inch from shoulder seam at armhole; point of loop back of seam or point of loop more than 3/8 inch forward of shoulder seam	1
	Other than one piece construction	1
	Position of shoulder loop button from collar edge not as specified:	
	a. Partially covered by collar edge (half of button or less)	1
	b. Button more than half covered by collar edge	2
	c. Rim of button more than 1/8 inch away from collar edge	1
	Male part of snap 1/4 inch or more off center, or less than 1-1/8 or more than 1-3/8 inches from end of point	1
	Female snap not aligned with male snap	1
	Any point of loop not covered by the collar	1
	Position of eyelet not as specified	1
Inside chest pocket	Opening not extending into facing, or extending into side body	1
	Tacking along front edge of twill cloth pocket through facing and interlining (hand) extending for a distance of less than specified	1
	Stay piece not extending to armhole seam or stay piece not stitched to lining	1
Vent	Bottom turn up exposed or visible on right vent edge	1

Source: https://assist.dla.mil -- Downloaded: 2026l0-22T01:51Z
Check the source to verify that this is the currentversion before use.

TABLE VII. End item defects (cont'd)

Examine	Defects	Point Value
Armhole or shoulder	Tape not stitched as specified to armhole	2
	Excess fabric resulting in fullness or puckering in any of the following locations:	
	a. Over shoulder in back area	3
	b. In collar or shoulder area	3
	c. Between lapel and sleeve seam	3
	Puckering on front or back of coat around armhole from back seam to forearm seam	3
	Stretched affecting appearance	3
	Crooked seam	2
	Tape around armhole stretched while stay tape is being sewn causing extra length and distortion along armhole circumference	3
Collar	Back edge of gorge seam stitched less than 3/4 inch back of lapel breakline	1
Bridle tape	Bridle tape not held taut causing breakline not to finish flat	3
	Bridle tape not within 1 to 1-1/8 inches from bottom of lapel	2
Sleeve	Sleeve lining extending less than 9/16 inch above top of sleeve	1
Pocket flaps	Finished width or length varying more than 1/8 inch from finished pocket flap shaper	3
	The back edge of pocket flap finishing more than 3/16 inch in front or back of front side body seam	3
Buttons	Top or bottom varies from marks on pattern more than 1/8 inch	3

4.4.5 End item testing. One coat shall be randomly selected for end item testing for each 3000 coats or any portion of 3000 coats in the end item lot. Each coat selected shall be initially examined visually for any defects in the fusible category of MIL-STD-1608. After initial examination each sample unit

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

shall be drycleaned and pressed three times as described in 4.4.3.4. Each sample coat shall then again be visually examined for fusible defects after three drycleanings and pressings, then retesting shall be performed by randomly selecting one coat for each 1,000 coats or portion of 1,000 coats in the end item lot and repeating the testing procedure. If any sample coat contains any fusing defects after three drycleanings and three pressings upon retesting, the end item lot shall be rejected. An end item testing chart shall be maintained in accordance with figure 5.

4.4.6 Palletization examination. The fully packaged and palletized end items shall be examined for the defects listed below. The lot size shall be expressed in units of palletized unit loads. The sample unit shall be one palletized unit load, fully packaged. The inspection level shall be S-1 (see 6.9).

Examine	Defect
Finished dimensions	Length, width, or height exceeds specified maximum requirement
Palletization	Pallet pattern not as specified Interlocking of loads not as specified Load not bonded as specified
Weight	Exceeds maximum load limits
Marking	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application

5. PACKAGING

5.1 Preservation. Preservation shall be level A or Commercial, as specified (see 6.2).

5.1.1 Level A preservation.

5.1.1.1 Folding. Each coat shall be laid back down and a paperboard insert conforming to figure 2 placed in the coat so as to fit snugly into the collar and shoulder area. The buttonhole front shall overlap the button front. The width of the insert may be reduced to accommodate the smaller size coats. Fold in the sleeves so that the ends rest over the pockets. The bottom shall be folded up over the front so that the folded coat measures not more than 19 by 16-1/2 inches.

5.1.1.2 Intermediate packing. Five folded coats of one class and size only, stacked one on another and alternated collar to bottom, shall be placed in an intermediate fiberboard box conforming to style FTC, type CF, variety SW, class domestic, grade 175 of PPP-B-636. Inside dimensions of the box shall be 19 inches in length, 16-1/2 inches in width, and 3-3/4 inches in depth. Each box shall be closed in accordance with the appendix of PPP-B-636.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

5.1.2 Commercial preservation. Coats shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Packing shall be level A, B, or Commercial, as specified (see 6.2).

5.2.1 Level A packing. Twenty coats of one class and size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC, grade V2s of PPP-B-636. Level A intermediate packs shall be packed flat, four in depth within a shipping container. Inside dimensions of each shipping container shall approximate 21 inches in length, 18-1/2 inches in width, and 17 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method III, waterproofed in accordance with method V, and reinforced as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.4. Shipping containers shall be arranged in unit loads in accordance with MIL-L-35078 for the type and class of load specified (see 6.2). Strapping shall be limited to nonmetallic strapping, except for type II, class F loads.

5.2.2 Level B packing. Twenty coats of one class and size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC, type CF (variety SW) or SF, class domestic, grade 275 of PPP-B-636. Level A intermediate packs shall be packed flat four in depth within a shipping container. Inside dimensions of each shipping container shall approximate 21 inches in length, 18-1/2 inches in width, and 17 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method II as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.4.

5.2.2.1 Weather-resistant fiberboard shipping containers. When specified (see 6.2), shipping containers shall be a grade V3c, V3s, or V4s fiberboard box fabricated in accordance with PPP-B-636 and closed in accordance with method III as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.4.

5.2.2.2 Hanger packs. When specified (see 6.2), 12 coats of one class and size shall each be placed on a 14 inch hanger for sizes up to and including size 11 and a 16 inch hanger for size 12 and larger and packed in a type I container (hanger pack) in accordance with MIL-C-44192. The loaded containers shall be palletized and marked in accordance with MIL-C-44192.

5.2.3 Commercial packing. Coats, preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.3 Palletization. When specified (see 6.2), coats, packed as specified in 5.2.2 and 5.2.3 shall be palletized on a 4-way entry pallet in accordance with load type Ia of MIL-STD-147. Pallet type shall be type I (4-way entry),

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

type IV, or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III, or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C and D or film bonding means F or G. Pallet pattern shall be number 90 in accordance with the appendix of MIL-STD-147.

5.4 Marking. In addition to any special marking required by the contract or purchase order, intermediate packs, shipping containers and palletized unit loads shall be marked in accordance with MIL-STD-129 or ASTM D 3951, as applicable.

6. NOTES

(This section contains information of a general explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coats are intended for wear by female personnel of the Department of the Army as part of the service uniforms and for wear by Junior ROTC.

6.2 Acquisition requirements. Acquisition documents must specify the following:

a. Title, number, and date of this specification.
b. Class and size required (see 1.2).
c. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1.1 and 2.2).
d. When a first article is required (see 3.1, 4.3, and 6.3).
e. Levels of preservation and packing (see 5.1 and 5.2).
f. Type and class of unit load required (see 5.2.1).
g. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1).
h. When hanger pack is required (see 5.2.2.2).
i. When palletization is required (see 5.3).
j. Acceptance criteria required (see 6.9).

6.3 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should also include specific instructions in acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.4 Sample. For access to samples, address the contracting activity issuing the invitation for bids or request for proposal.

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.

6.5 Temperature indicators. Suggested sources for temperature indicators are as follows:

Paper Thermometer Co., Telephone No. (603) 547-2034
MRC Inc., Reatec Div., Telephone No. (215) 687-4300

6.6 Release agent. A suggested source for release agent is as follows:

Apparel Machine and Supple Co., (EZ OFF Agent), Telephone No. (215) 634-2626

6.7 Bonding strength dispute procedure. In case of dispute, the average of the first 3 inches of the five highest bonding strength peaks from a chart recording on a CRE Tensile Tester, running at 12 inches per minute shall determine the bonding strength. If splitting is observed, then just the highest peak shall be regarded as the bonding strength.

6.8 Implementation of optional bound buttonhole. The optional bound buttonhole shall be implemented at the discretion of the contracting activity issuing the invitation for bids or request for proposal.

6.9 Acceptance criteria. The acceptance criteria below are recommended for use. The acceptance criteria as specified in the contract or purchase order shall be binding. Unless otherwise specified, the following acceptance criteria are in accordance with MIL-STD-105.

6.9.1 For examination of coat fronts and facings. An acceptable quality level (AQL), expressed in terms of defects per hundred units, of 2.5 is recommended.

6.9.2 For palletization examination. An AQL, expressed in terms of defects per hundred units, of 6.5 is recommended.

6.10 Basting recommendations. In order to assure good basting without quilling effect (protrusion of extraneous fibers through basting needle holes) the following practices are recommended:

a. Utilize either 70/2 smooth finish cotton/polyester wrap or size A nylon thread. Avoid using threads with coarse, hairy exterior structure.

b. Utilize finest size sewing needle possible (sizes 12 or 14) with ballpoint. Larger sized needles will provide larger holes and better chance for fibrous material to enter.

c. Increase quality control checks on needle changes during production. Dull or burred needle tips will push fibrous material to outershell exterior.

d. Reduce basting sewing tensions and amount of pull on the material being sewn wherever possible.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

6.11 Alternate construction for felling armhole lining.

a. When the alternate construction to fell the armhole lining by machine is used, it consists of leaving an opening between the notches of the forearm sleeve lining seam. Stitching the lining to the armhole on the inside from front sleeve notch of sleeve to backarm seam across undersleeve (301 stitch). Utilizing the forearm sleeve opening stitch the top sleeve lining to the armhole on inside by felling machine from front sleeve notch to backarm seam across the crown of top sleeve lining. Close the previous left opened forearm seam.

b. Use of AMF Automatic 84-4 EBS Button Machine, using fully wrapped shank with show (tack) stitch is permissible.

6.12 Subject term (key word) listing.

Dress uniform
Junior ROTC uniform
Service uniform

Custodian:
Army - GL

Review activities:
Army - MD
DLA - CT

Preparing activity:
Army - GL

(Project 8410-A699)

Source: https://assist.dla.mil -- Downloaded: 202610-22T01:51Z
Check the source to verify that this is the current version before use.


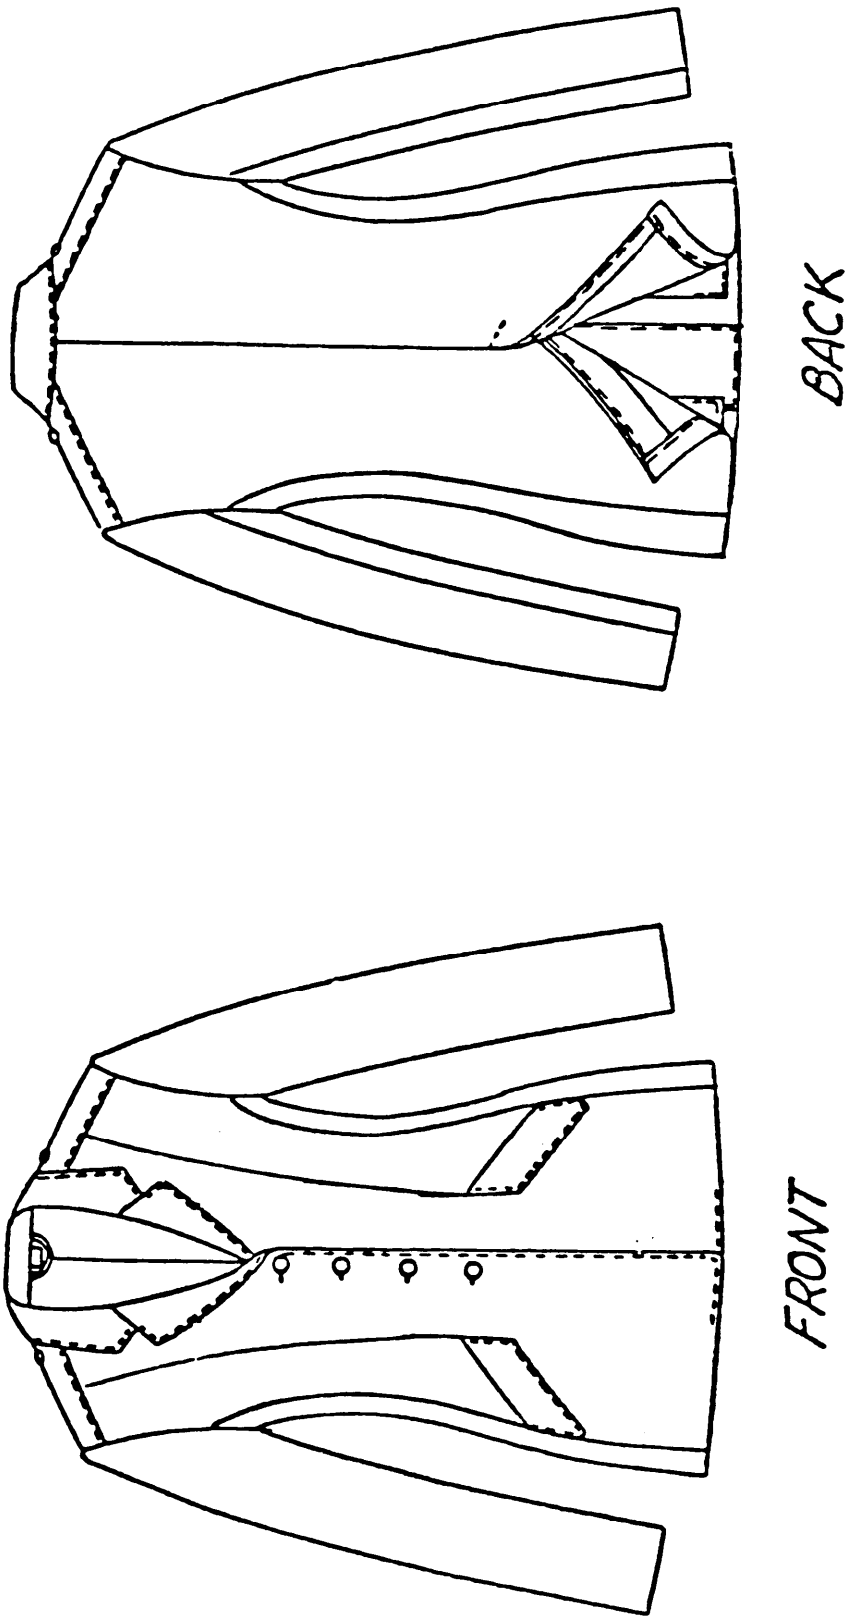


FIGURE 1 - COAT, WOMAN'S: CLASSIC DESIGN, POLYESTER/WOOL

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

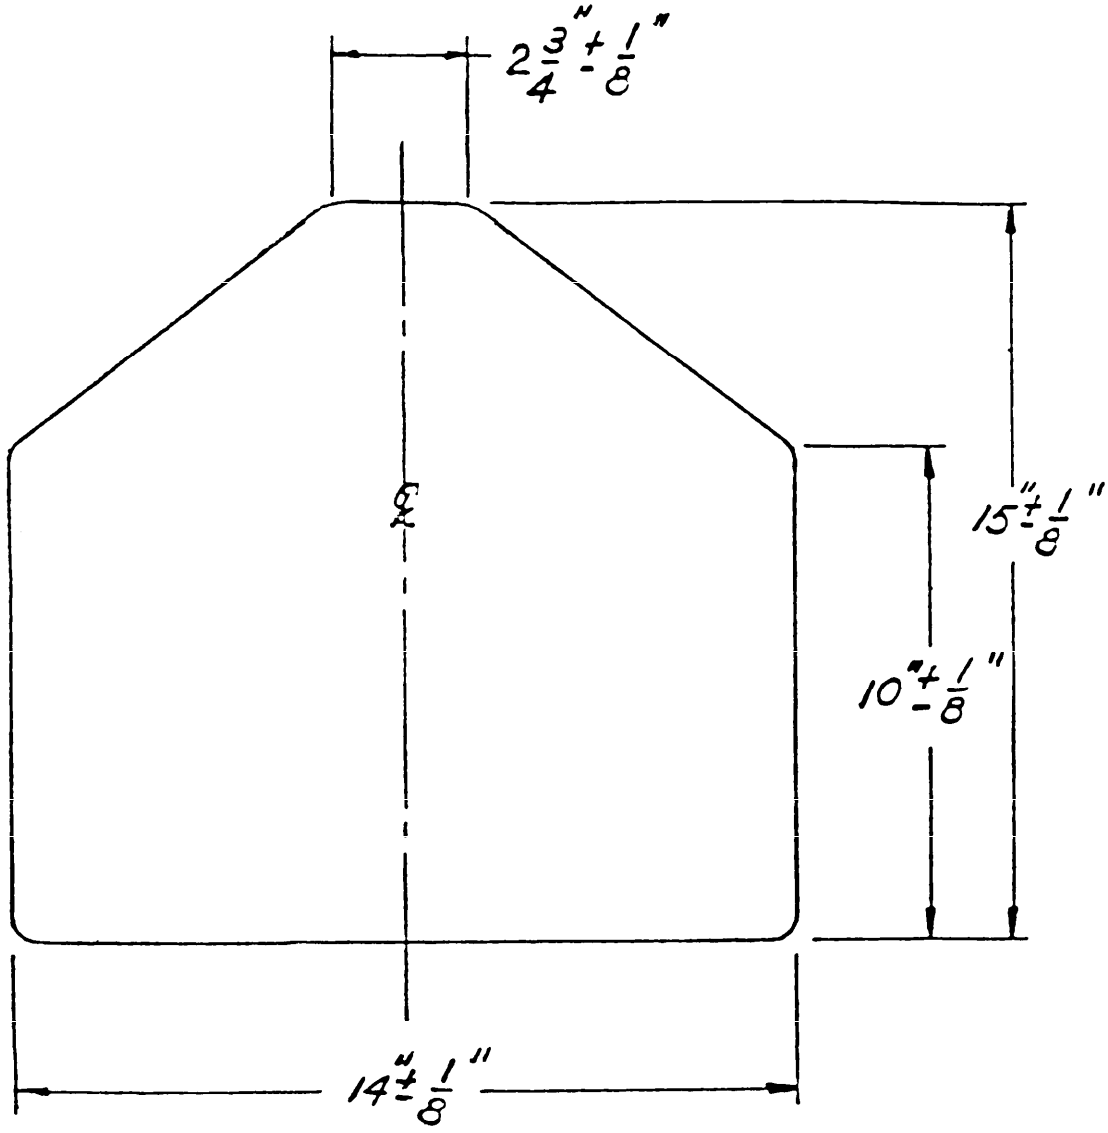


PAPERBOARD .032" THICK

FIGURE 2 - INSERT, PAPERBOARD

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

Stitch Class 800. This class of stitch shall be formed with one or more needle threads and has for a general characteristic that the thread does not interloop with itself or any other thread or threads. The thread is passed completely through the material by means of a double pointed center eye needle and returned by another path. This class of stitch simulates hand stitching.

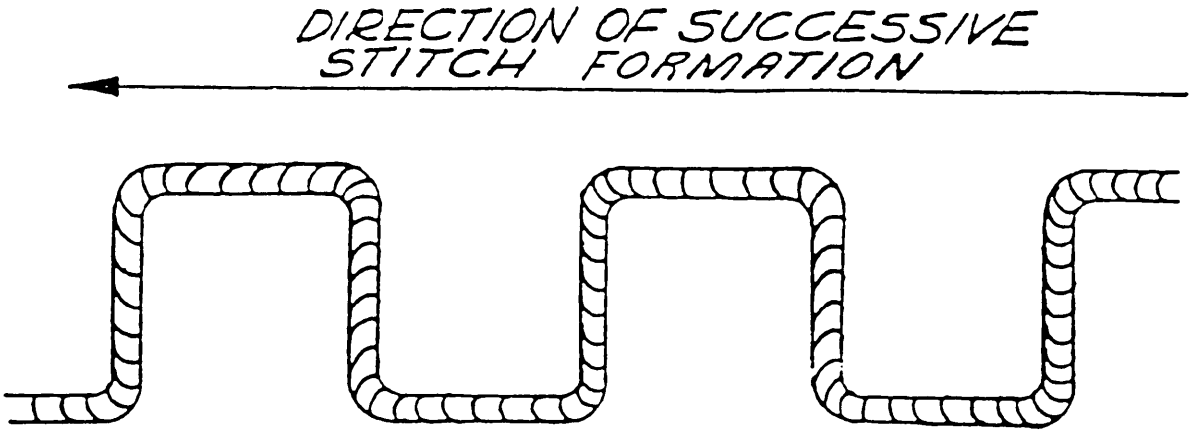

This type of stitch shall be formed with one needle thread which is passed completely through the material and returned by another path after the material has been moved forward one stitch length.

FIGURE 3 - STITCH TYPE 801

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

FUSING PRESS MAINTENANCE/BONDING STRENGTH CHECK CHART
ONE WEEK PRE-PRODUCTION & PRODUCTION

Contract # _____

Contractor _____

QAR Name _____

TIME

TEMPERATURE	BONDING STRENGTH

Record (See: 4.4.2.2 & 4.4.2.3)

Fusing Press Setings Recomended by Fusible Mfg.:

Temperature,F(C) _____

Pressure,Bar _____

Dwell Time,Sec. _____

Initial Daily Test (after machine warm up) and test every TWO hours after and subsequent to any 20 minute (min) production stoppage.

FUSING PRESS CLEANLINESS once daily (See: 3.3.5.7)

Date: DD/MM/YY

MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									
MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									
MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									
MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									
MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									
MT - P - DT	TE	BS * I	BS * II						AI
___/___/___									

* Min. req.: 2 lbs. (32 oz.) (907 gms.) / inch or split for Small Parts

PRESSURE EVENNESS, BONDING STRENGTH (See: 4.4.3.2)
TEST ONCE WEEKLY

Date:		AI
___/___/___	___ ___ ___ ___ ___	-------

DWELL TIME, SEC. (See: 4.4.3.2)
TEST ONCE WEEKLY

Date:	MACHINE SETTING	STOP WATCH READING	AI
___/___/___			-------

SPRING SCALE CALIBRATION (See: 4.4.3.3)
TEST ONCE WEEKLY

Date:	AI
___/___/___	-------

KEY:

AI	Authorized initials to verify contractor tests.
BS	Bonding Strength / In., Ave.
DT	Dwell time
MS	Machine setting
MT	Machine temperature
P	Pressure
T	Time
TE	Temperature- strip reading, Ave
I	Small Parts, fusible
II	Fronts fusible

Fig. 4

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

Representative Production Bond Strength Check Chart. Chart A (See: 4.4.3.4 & 4.4.3.3)

Contract # _____ Small Parts, Fusible * Fronts, Woven Fusible *

Contractor _____ *(All samples shall be pressed twice in accordance with 4.4.3.4 before being dry cleaned.)

QAR Name _____

Representative Production Units / 1,000	Date: DD/MM/YY	Prod. lot #	Shrink,% Diff. DC.	B.S. After 3 DC.	Appear. After 3 DC.	Shrink,% Diff. DC.	B.S. After 3 DC.	Appear. After 3 DC.	AI
1 - 1,000	__/__/__								
1,001 - 2,000	__/__/__								
2,001 - 3,000	__/__/__								
3,001 - 4,000	__/__/__								
4,001 - 5,000	__/__/__								
5,001 - 6,000	__/__/__								
6,001 - 7,000	__/__/__								
7,001 - 8,000	__/__/__								
8,001 - 9,000	__/__/__								
9,001 - 10,000	__/__/__								
10,001 - 11,000	__/__/__								
11,001 - 12,000	__/__/__								
Requirement:			1.5%(max) / 2%(max)	** or split	Good	1.5%(max) / 2%(max)	**	Good	

End Item Testing Check Chart Chart B (See: 4.4.5)

Coats Production Units / 3,000	Date: DD/MM/YY	Coat Prod. lot #	Appearance Initial Good	Appearance Initial Poor	Appearance After 3 DC. * Good	Appearance After 3 DC. * Poor	Coat Lot Accept	Coat Lot Reject	AI
1 - 3,000	__/__/__								
Retest:		1000 -	-	-	-	-	—	—	
		2000 -	-	-	-	-	—	—	
		3000 -	-	-	-	-	—	—	
3,001 - 6,000	__/__/__								---
Retest:		1000 -	-	-	-	-	—	—	
		2000 -	-	-	-	-	—	—	
		3000 -	-	-	-	-	—	—	
6,001 - 9,000	__/__/__								---
Retest:		1000 -	-	-	-	-	—	—	
		2000 -	-	-	-	-	—	—	
		3000 -	-	-	-	-	—	—	
9,001 - 12,000	__/__/__								---
Retest:		1000 -	-	-	-	-	—	—	
		2000 -	-	-	-	-	—	—	
		3000 -	-	-	-	-	—	—	
Requirement:			Good		Good				---

KEY:

Shrink. Diff. — Shrinkage Differential (W x F)
DC. — Drycleans (W x F)
(W x F) — Warp x Filling
Appear. — Appearance
B.S. — Bonding Strength /In. Ave.
AI — Authorizied Initials
** — 1.5 lbs. (24 oz.) (680 gms.)

Fig. 5

*U.S. GOVERNMENT PRINTING OFFICE: 1990--704-034/30010

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

U.S. ARMY NATICK RESEARCH, DEVELOPMENT
and ENGINEERING CENTER
ATTN: STRNC-ES
Natick, MA 01760-5014

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
U.S. Army Natick Research, Development
and Engineering Center
ATTN: STRNC-ES
Natick, MA 01760-5014

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-44379(GL)	Coat, Woman's, Classic Design, Polyester/Wool, AG-344, Fusible

3a. NAME OF SUBMITTING ORGANIZATION

b. ADDRESS (Street, City, State, ZIP Code)

4. TYPE OF ORGANIZATION *(Mark one)*

- ☐ VENDOR
- ☐ USER
- ☐ MANUFACTURER
- ☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T01:51Z
Check the source to verify that this is the current version before use.