INCH-POUND

MIL-V-70579B (AR)
AMENDMENT 2
9 September 1992
SUPERSEDING
AMENDMENT 1
9 September 1991

MILITARY SPECIFICATION

VOLTAGE, CONVERTER: 9360839

This amendment forms a part of MIL-V-70579B (AR), dated 27 August 1990, is approved for use by the U.S. Army Armament, Munitions, and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 2

* 2.1.1: Delete the following military standard:

"MIL-STD-2000 - Standard Requirements for Soldering Electrical and Electronic Assemblies"

PAGE 3

* 2.1.2: Add the following drawing:

"12950877 - Requirements for Soldering Electrical and Electronic Assemblies"

PAGE 4

* 3.3.1: Delete in its entirety and substitute the following:

"3.3.1 Vibration. The voltage converter shall not suffer damage and shall meet the requirements of 3.4 and 3.5 after exposure to the equivalent of 6000 miles of track-laying vehicle operational vibration as defined by MIL-STD-810 narrowband random-on-random data for equipment installed on the deck of the M113 armored personnel carrier."

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:43Z
Check the source to verify that this is the current version before use.

* 3.3.3: Delete in its entirety and substitute the following:

"3.3.3 Altitude operating. The voltage converter shall meet the requirements of 3.4 and 3.5 during and after exposure to barometric pressure encountered at 10,000 feet above sea level (20.6 inches of Hg)."

PAGE 8

* 3.9: Delete in its entirety and substitute the following:

"3.9 Soldering. All soldering shall be in accordance with the requirements of Note 2 of Drawing 12950877."

PAGE 15

* 4.7.1.1: Delete first sentence and substitute:

"4.7.1.1 Vibration. This test shall be performed as specified in Method 514, Category 8, Procedure I of MIL-STD-810 and paragraph 3.3.1 herein."

* 4.7.1.3: Delete in its entirety and substitute the following:

"4.7.1.3 Altitude operating. This test shall be performed as specified in Procedure II, Method 500 of MIL-STD-810. The operational checkout shall be as specified in 4.7.2 and 4.7.3 for compliance with 3.3.3."

PAGE 17

* 4.8: Delete in its entirety and substitute the following:

"4.8 Soldering. Soldering processes shall be inspected by certified inspectors to the requirements and acceptance criteria of Note 2 of Drawing 12950877 as specified in paragraph 3.9."

Source: https://assist.dla.mil -- Downloaded: 20260-23T03:43Z
Check the source to verify that this is the current version before use.

* Figure 1: Delete in its entirety and substitute the following:

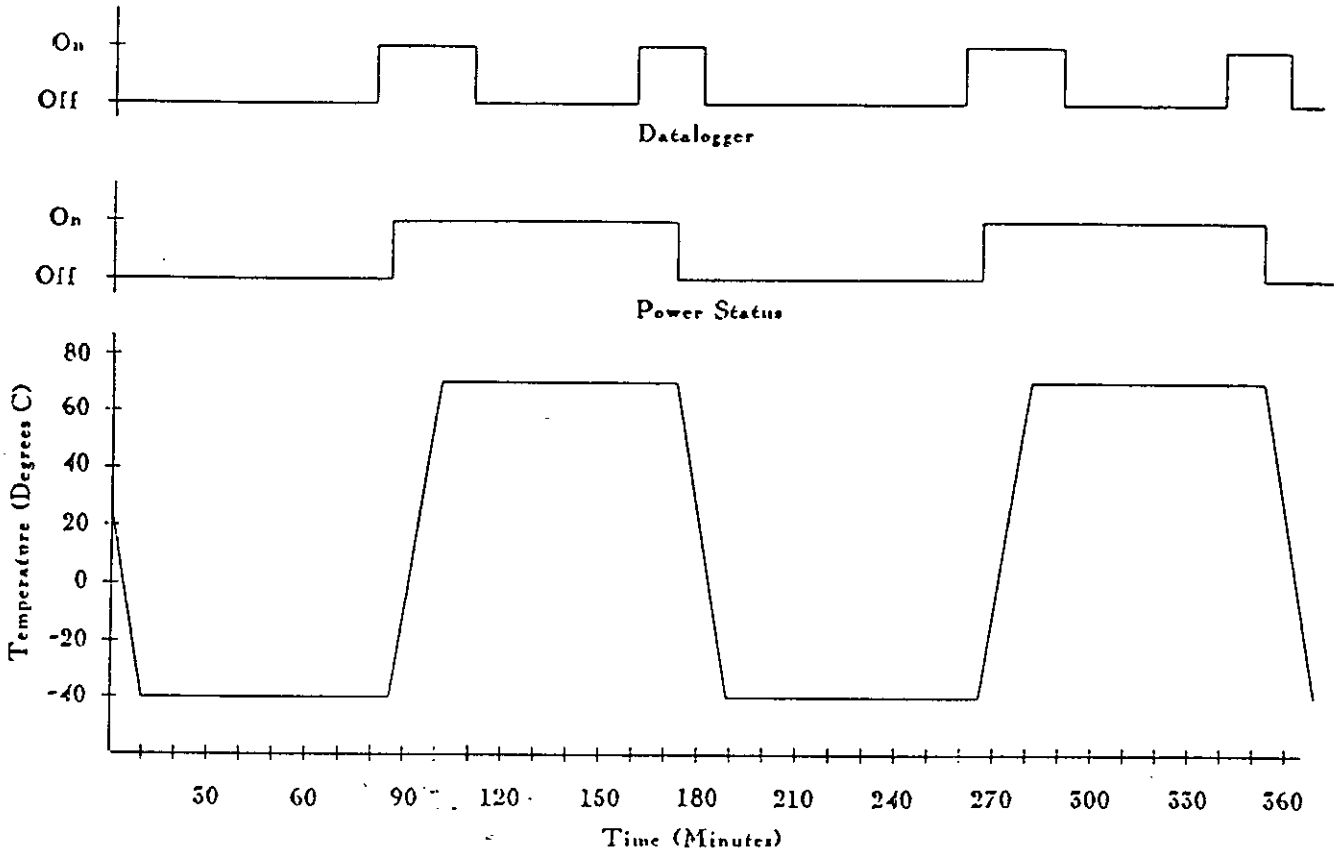


Figure 1. Burn-in Temperature Versus Time Diagram

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:43Z
Check the source to verify that this is the current version before use.

* Figure 2: Delete in its entirety and substitute the following:

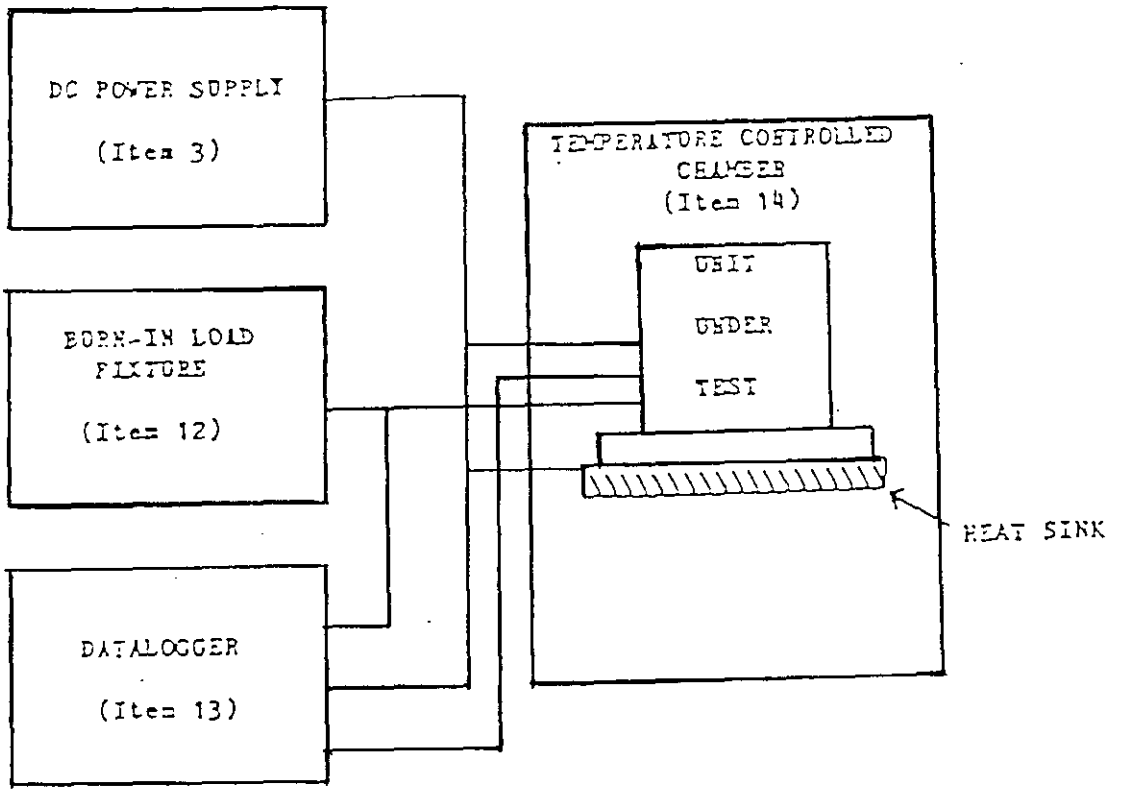


Figure 2. Burn-in Test Set-up.

The margins of this amendment are marked with an asterisk or vertical lines to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1285-A839)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:43Z
Check the source to verify that this is the current version before use.