MILITARY SPECIFICATION

COMPUTER SET, GUN DIRECTION: 10525735

This amendment forms a part of Military Specification MIL-C-60184(MU), dated 18 March 1965.

Paragraph 3.5.3.1b: Delete and substitute:

"b. The temperature warning indicator lamp shall energize at an ambient temperature greater than 117°F or an internal temperature lower than -18°F."

Paragraph 3.5.3.1c: Delete and substitute:

"c. The computer shall de-energize at an ambient temperature greater than 125°F or an internal temperature lower than -40°F."

Add the following new subparagraph to 3.5.3.1:

"d. The computer may de-energize after sustained operation (sustained operation is defined as, operation of at least 1 hour) at an ambient temperature of +125°F. This is not to be considered a failure. In order to achieve sustained operation after this occurrence the chamber temperature will be reduced, in increments of 2°F, to the point where operation may be sustained, but not less than +121°F."

Add the following subparagraph to requirement 3.7.1:

"e. The power ready indicator which illuminates when the computer is energized shall blink continuously when the blower cut-off switch is actuated manually and the marginal test switch is in the "OFF" position. This condition shall also exist when the rear cover is installed as the cover automatically actuates the blower cut-off switch."

Paragraph 3.8: Change references to "70 hour run-in" to "50 hour run-in"; delete "and 3.8.1" in 2nd sentence and delete 3rd sentence.

Paragraph 4.3.1: Delete and substitute:

"4.3.1 General.- One unit shall be selected at random by a Government representative as a standard sample from each 50 produced. The sample shall meet the requirements and tests in Table B and paragraph 4.2.1.1(A) through 4.2.1.1(L)."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:15Z
Check the source to verify that this is the current version before use.

Paragraph 4.5.1.8, 1st sentence: Delete "with all covers in place,". 2nd sentence: Delete "of the front cover". 4th sentence: Delete "covers shall be removed".

Paragraph 4.5.3.1: Add new subparagraph: "(c) Energize computer and observe that when the power ready light comes on it shall not blink. Manually actuate the blower cut-off switch to cause the power ready light to blink continuously."

Paragraph 4.5.4: Add the following:

"A maximum of 20 readings checked during the following tests of this paragraph may fall outside the specified limits within the limitations listed below:

a. 4.5.4.3(f) 65±10%
b. 4.5.4.4(e) 8.6 volts
c. 4.5.4.5(d) .55 volts
e. 4.5.4.6(d) .55 volts"

Paragraph 4.5.4.3(f), last sentence: Delete "75" and substitute "65".

Paragraph 4.5.4.3(h): Delete "1%" and substitute "5%".

Paragraph 4.5.9.5(b): Delete "Y and J17" and substitute "CC on J10 with DD jumped to h".

Paragraph 4.5.10(a): Add "Rev A" after "8213315-17".

Paragraph 4.5.10(b): Change "9 00000 00000 05055" to "9 00000 00001 05055."

Paragraph 4.5.12: Delete entire paragraph except 4.5.12.5 and 4.5.12.6 and substitute:

"4.5.12 Run-in.- As specified in 3.8 and after each computer has successfully passed all the performance tests, each computer shall be run for a total of 50 hours excluding down-time. The tests shall be run for at least 4 hours--22°F, 4 hours at +125°F and at least 30 hours after the--22°F, +125°F tests are completed.

Table I, line 14: Delete and substitute: "-27U -25 ±1.5 6000 105E-1".

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:15Z
Check the source to verify that this is the current version before use.

Table XXXIII: Delete and substitute:

TABLE XXXIII

PROBLEM SOLUTIONS
MET. STANDARD

Bat.	Target	Deflection Low	Deflection High	Fuse Time Low	Fuse Time High	Quad. Elev. Low	Quad. Elev. High	
A	1	1500	1718	4.4	38.9	170	1412	NSL
A	6	94	116	20.0	29.6	610	958	
B	2	2986	3138	7.1	46.0	158	1447	NSL
B	7			...0 (Indicates Out of Range)				
C	3	2094	2194	11.9	36.8	220	1270	
C	8			... (Indicates Out of Range)				
D	4	1882	1982	8.0	38.0	204	1380	NSL
D	9			...0 (Indicates Out of Range)				
E	5	587	756	8.6	42.4	136	1373	NSL
E	10	67	103	19.8	34.9	490	1047	

Table XXXIV: Delete and substitute:

TABLE XXXIV

PROBLEM SOLUTIONS
MET "H" TAPE

Bat.	Target	Deflection Low	Deflection High	Fuse Time Low	Fuse Time High	Quad. Elev. Low	Quad. Elev. High	
A	1	1499	1706	4.4	38.9	170	1408	NSL
A	6	99	121	20.4	29.5	623	954	
B	2	2985	3121	7.1	46.0	158	1448	NSL
B	7			...0 (Indicates Out of Range)				

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:15Z
Check the source to verify that this is the current version before use.

TABLE XXXIV (CON'T)

Bat.	Target	Deflection Low	Deflection High	Fuse Time Low	Fuse Time High	Qual. Elev. Low	Qual. Elev. High	
C	3	2093	2181	11.8	36.9	217	1272	NSL
C	8	1753	1759	25.1	28.9	694	819	
D	4	1881	1968	8.0	38.0	205	1378	NSL
D	9			...0 (Indicates Out of Range)				
E	5	587	767	8.6	42.4	137	1371	NSL
E	10	71	110	20.1	34.9	498	1048	

Paragraph 30.3.1: Delete 2nd sentence and substitute:

"Information is loaded in octal Teletype or Fieldata code".

Paragraph 30.3.1(c): Insert the following sentence between the 1st and 2nd sentence:

"In initial program fill the last character entered is normally a HALT code". Change last sentence to read: "then the COMPUTE code will start computation at the address specified in L when the computer leaves the manual HALT mode.

Paragraph 30.3.2.1(c)(6): Delete "Manual" and substitute "Program".

Paragraph 30.3.2.3(a): Add "by character".

Paragraph 30.3.2.3(b): Add "by word".

Paragraph 30.3.2.3(c): Add "by character".

Paragraph 30.3.2.3(d): Add "by word".


Paragraph 30.4.1: Delete "ENTER" and substitute "INITIATE".

Paragraph 30.4.2.3(a): Delete "8-bit Character" and substitute "Alphanumeric".


4. Custodian;
Army - MU

Preparing activity:
Army - MU
Project No. 1220-A300Y


Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:15Z
Check the source to verify that this is the current version before use.

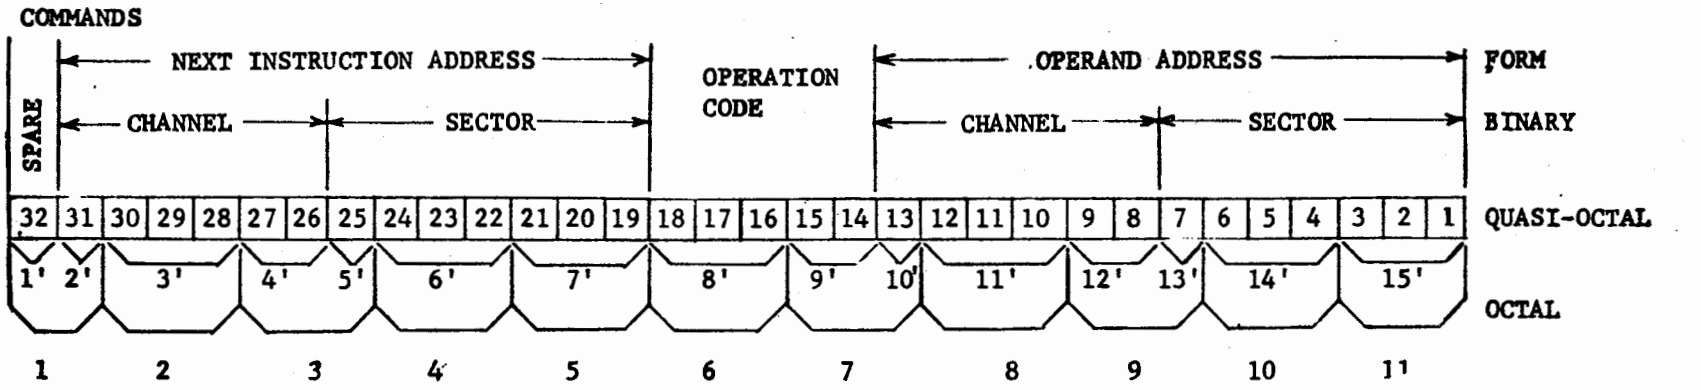

(a)

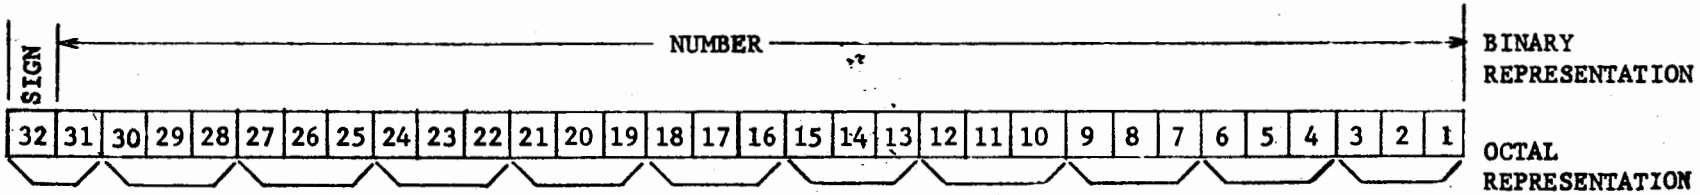

(b)

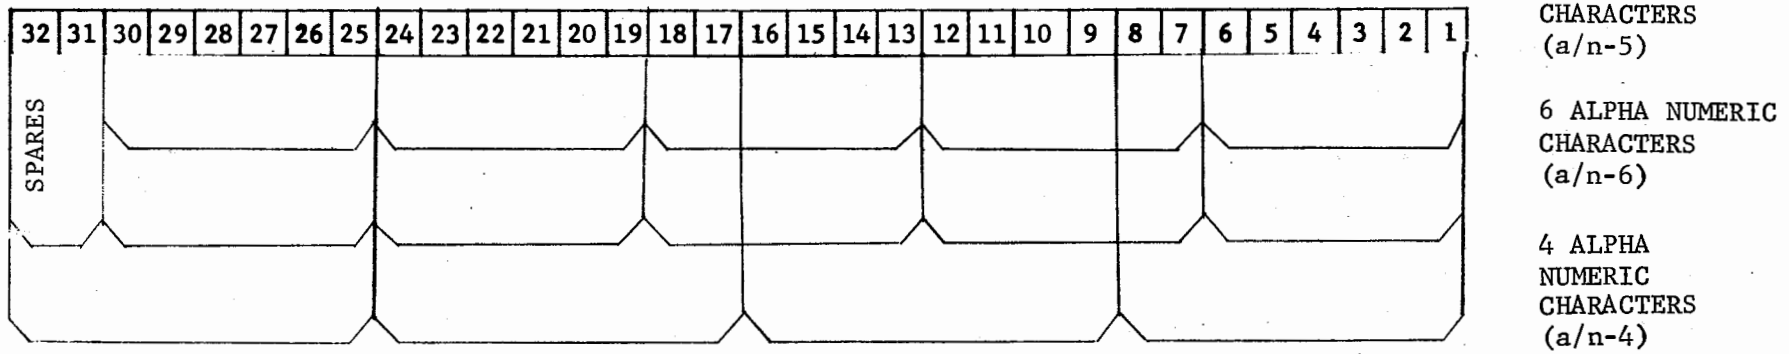

(c) FIGURE 10

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:15Z
Check the source to verify that this is the current version before use.