METRIC

DOD-C-63980(AR)
AMENDMENT 7
26 August 1992
SUPERSEDING
AMENDMENT 6
24 April 1991

MILITARY SPECIFICATION

CARTRIDGE, 30MM TARGET PRACTICE, M788

This amendment forms a part of Military Specification DoD-C-63980(AR), dated 14 May 1982, and is approved for use by the U.S. Army Armament, Munitions and Chemical Command and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 2

2.1.2 (Drawings): Delete “11825969 - Test Barrel, 30MM and substitute “9390627 - Barrel, Test, 30W (ADEN Barrel)

2.1.2 (Product and Packaging Drawings): Add “12902718 - Packing and Marking of Ammunition Container, 30mm, M592 for 30mm Cartridges” and 12902719 - Strip, Ammunition, Metallic”.

PAGE 3

3.7 Delete in its entirety and substitute the following:

"3.7 Muzzle velocity. The projectile shall have a mean muzzle velocity of 795-815 meters per second (m/s) at 21 degrees C ± 5 degrees C. The standard deviation shall not exceed 15 m/s at temperatures of 21 degrees C ± 5 degrees C and 71 degrees C ± 5 degrees C. The standard deviation shall not exceed 20 m/s at a temperature of 54 degrees C ± 5 degrees C. Following the exposure to the environmental conditions of paragraph 3.9, the mean velocity at 21 degrees C ± 5 degrees C shall not increase or decrease from the mean muzzie velocity before exposure at 21 degrees C ± 5 degrees C by more than 30 m/s.”

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026l0-23T03:07Z
Check the source to verify that this is the current version before use.

PAGE 4

* 3.8 Delete in its entirety and substitute the following:

"3.8 Case mouth Pressure. The mean peak pressure shall not exceed 295 MPa at 21°C ± 5°C. The mean peak pressure shall not exceed 415 MPa at temperatures of -54°C and 71°C respectively. Following environmental exposure, the mean peak pressure shall not increase or decrease form the mean peak pressure at 21°C ± 5°C by more than 60 MPa."

3.9 Delete the title "Environmental Conditions." and substitute "Environmental exposure."

3.10 Delete "Drawing 11825969" and substitute "Drawing 9390627".

PAGE 13

4.4.2.4 Minor 201, under Paragraph Reference/Inspection method column add "6.8".

PAGE 15

Add: Quality Conformance Inspection Sheets:

4.4.2.6	Packing and marking of ammunition Container, M592 for 30mm Cartridges	Drawing No. 12902718		
CRITICAL				
1.	Strip improper (anyone of the forty four (44) tabs of strip not in groove strip inverted; strip damaged; strip distorted	100%	3.1.1	Visual
MAJOR				
101.	Cartridge properly mounted	.40%	3.1.1	Visual
102.	Correct number of cartridges	.40%	3.1.1	Visual
103.	Fillers, liners, Strip, strap and channels missing	.40%	3.1.1	Visual
104.	Edge guard channel not properly mounted	.40%	3.1.1	Visual
105.	Contents loose	.40%	3.1.1	Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

MINOR

201.	Container in proper condition	.65%	3.1.1	Visual
202.	Metallic seal missing	.65%	3.1.1	Visual
302.	Marking improper or illegible	.65%	3.1.1	Visual

Page 15 should read 15A

PAGE 19

Delete the paragraph "7/ Primer Leaks." in its entirely and substitute the following:

"7/ Primer Leaks. Primer Leaks shall be defined as follows:

a. Suspect. A suspect primer leak is defined as the definite evidence of smudging or discoloration around any part of the periphery of the primer cup, button, insulator, or primer pocket." The fired primer must be removed by sectioning the cartridge case and must be disassembled to determine whether actual gas leakage has occurred.

b. Internal minor leak. A suspect primer, which upon disassembly,shows definite evidence of a leakage path between primer components or through a crack or split in any primer component.

c. External minor primer leak. A suspect primer, which upon disassembly, shows definite evidence of a leakage path between the primer cup and primer pocket without evidence of erosion of the pocket.

d. Major leak. A primer leak which shows erosion of any primer component.

e. Critical leak. A primer leak which shows evidence of erosion of the primer pocket or melting of any primer component.

f. A dislodged primer button is not cause for rejection.

PAGE 23

4.5.6 Delete "Drawing 11825969" and substitute "Drawing 9290627."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

Para 4.5.9.1

Delete "Method 504",
Substitute "Method 514.4"

Para 4.5.9.3

Delete second sentence. The test will be conducted with an AAH magazine. “ , and replace with .The test will be conducted with an M592 ammo can.”

Change third sentence from “The vibration. . figure 2."
To read “The vibration. . . as shown in figures 1 and 2. "

PAGE 24

Add figure 1,Vibration test curves for equipment installed in helicopters , equipment category C. (Included)

PAGE 25

Add figure 2, Logarithmic sweep. (Included

PAGE 26

Add Paragraph 5.1.1.3 as follows:

5.1.1.3 Bulk (metallic strip) packing.The Bulk (Metallic strip) packing. Strip) Pack shall consist of ten (10) 30mm Metallic ammunition strips (see drawing 12902719) containing 11 cartridges packed in the M592 shipping and storage container.

Add Paragraph 5.1.2.3 as follows:

‘5.1.2.3 Bulk (metallic strip) packing The interior packing shall be in accordance with drawing number 12902718. The 30mm rounds shall be placed in the Metallic Strips In accordance with the drawing 12910289.”

Delete Paragraph 5.2 in its entirely and substitute the following:

“5.2 Marking. Marking for shipment shall be in accordance with the instructions of the contract and shall comply with drawing number 11825893 (for Bulk "Metallic Strip" Packing marking shall comply with drawing number 12902718).

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

addition, exterior containers shall show the caution marking required by Title 49, Code of Federal Regulations, indicating the appropriate classification of ammunition."

PAGE 28

6.9: Add "d" as follows:

"d. Missing paint on the rotating band is not a defect."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

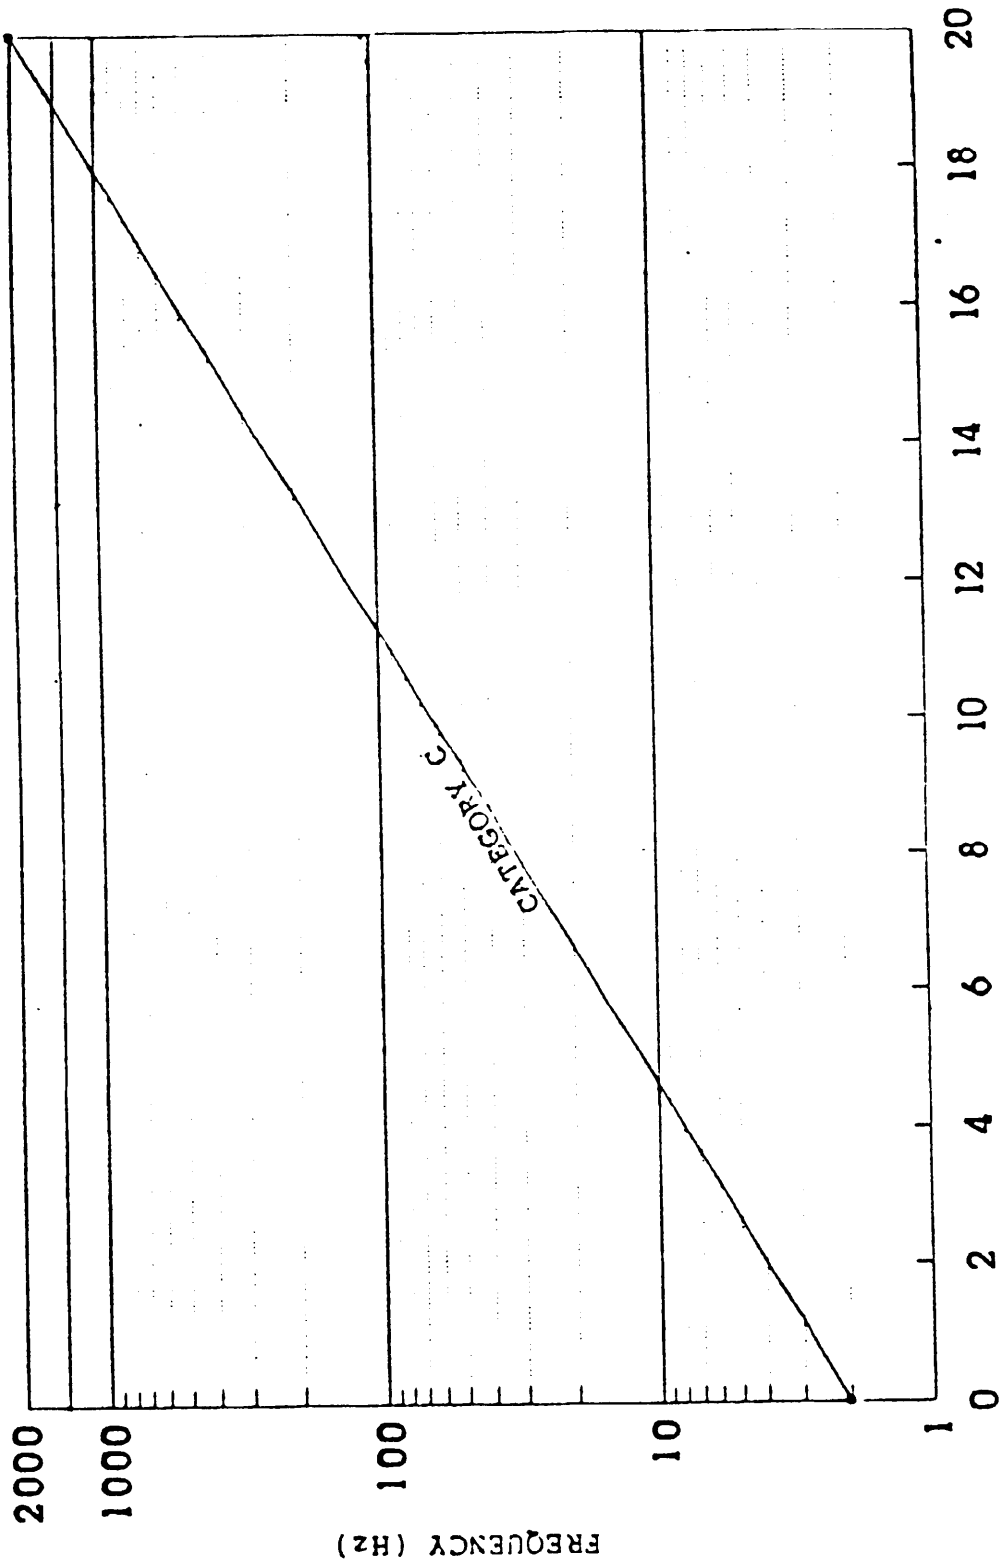


FIGURE 2. Logarithmic Sweep. (Ref. Figure 514.2-10 of MIL-STD-810C)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

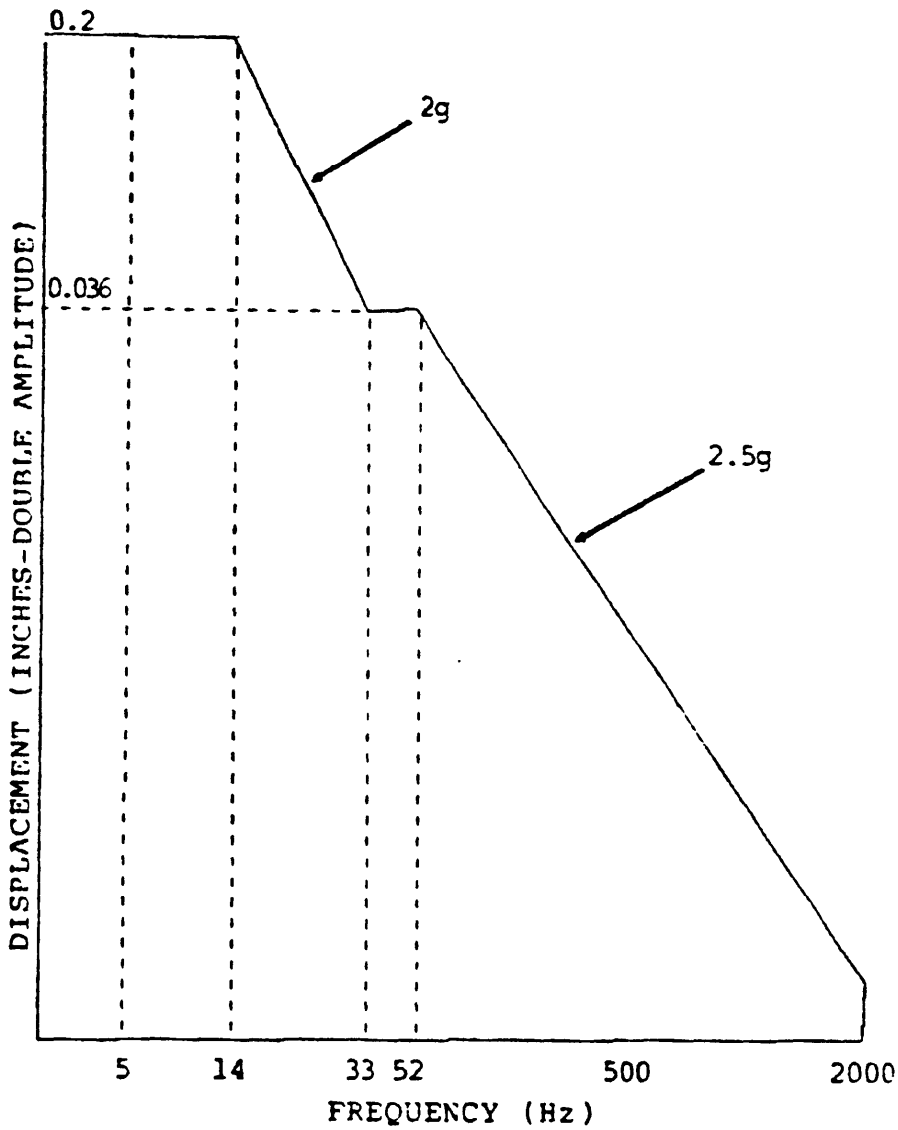


FIGURE 1. Vibration Test Curves for Equipment Installed in Helicopters. Equipment

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

PAGE 29

6.14 Should read:

"Contamination of explosive components. Particular care should be exercised to avoid contamination of primers and propellant by oil or grease. Such contamination may adversely affect performance. Particular care should also be exercised to avoid contamination of primers and propellant by dust and other foreign matter. If contamination by foreign matter or dust is evident, the quantity shall not exceed the requirements set forth in Drawing 11825946."

6.16 Should read:

"6.16 Retest procedures. Failure of the material sample to comply with the velocity, pressure or action time requirements shall result in a retest. Sample size shall be as indicated in the applicable table."

PAGE 30

6.18 Delete in its entirety.

The margins of this amendment are marked with an asterisk or vertical line to indicate where changes (additions, modification, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1305-AE19)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.