MILITARY SPECIFICATION

FUZE, M539, POWER SUPPLY FOR
PARTS FOR, ASSEMBLING AND PACKING

This specification is approved for use by Picatinny Arsenal, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This Military Specification covers parts for assembling and packing of Fuze, M539, Power Supply.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-116	- Preservation - Packaging, Methods Of
MIL-B-117	- Bag, Sleeve and Tubing - Interior Packaging
MIL-B-3106	- Board, Composition, Water-resistant, Solid (For Filler or Cushioning Pads)
MIL-A-48078	- Ammunition, Standard Quality Assurance Provisions, General Specification for
MIL-I-45607	- Inspection Equipment, Supply and Maintenance of
MIL-F-50449	- Filler, Sheet Form (For Use In - Ammunition Containers)
MIL-P-60312	- Parts, Molded, Plastic Foam, Polystyrene (For Use With Ammunition)

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

FEDERAL

L-P-378	- Plastic Sheet and Strip, Thin Gauge, Polyolefin
PPP-B-601	- Box, Wood, Cleated Plywood
PPP-B-636	- Box, Shipping, Fiberboard
PPP-T-76	- Tape, Pressure - sensitive Adhesive Paper, Water Resistant, (For Carton Sealing)

STANDARDS

MILITARY

MIL-STD-1169 - Packaging, Packing And Marking for Shipment of Inert Ammunition Components

DRAWINGS

PICATINNY ARSENAL

PRODUCT AND PACKAGE DRAWINGS

9276238	- Power Supply, Fuze, M539
9293288	- Projectile, 152MM, HEAT-T-MP, M409A2, Loading Assembly
9294989	- Cartridge, 152MM, HEAT-T-MP, M409A2

3. REQUIREMENTS

3.1 General. -Materials and parts shall be in accordance with applicable drawings and specifications.

3.2 Power Supply.-The power supply shall comply with all requirements specified on Drawing (dwg.) 9276238 and with all requirements specified in applicable specifications.

3.3 Workmanship.-All parts and assemblies shall be free of chips, dirt, grease, rust, burrs, cracks and other foreign material. The cleaning methods used shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agents.

3.4 Piezoid.

3.4.1 The piezoid shall be capable of passing all required electrical tests after temperature cycling, as well as at ambient temperatures.

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:25Z
Check the source to verify that this is the current version before use.

3.4.2 The piezoid shall not exhibit any cracking when subjected to a minimum (min.) compressive load of 50,000 psi.

3.5 Proving Ground.-The applicable loaded projectile shall comply with the following requirements when assembled with a power supply and tested as specified in 4.5.5.

3.5.1 Graze Functioning.-The projectile shall detonate "high-order" on initial impact with a gravel pad located 1000 ± 200 meters from the gun muzzle.

3.5.2 Safety.-There shall be no premature bursts, in flight, prior to impact.

3.6 First Article Inspection.-This specification contains technical provisions for first article inspection. Requirements for the submission of first article asamples by the contractor shall be as specified in the contract.

3.7 Resistor.-The resistor shall not exhibit any cracking when subjected to a min. compressive load of 10,000 psi.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions.-Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of Inspections.-The following types of inspection shall be conducted on this item:

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First Article Inspection

4.3.1 Submission.-The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

Part Description	Drawings	Quantity
Power Supply, Fuze, M539	9276238	10
Piezoid	9276194	25
Forward Terminal Assembly	9276097	5
Aft Terminal Assembly	9276111	5

In addition, the submission shall include 10 each of every component and every subassembly not listed above. (Where a multiple cavity mold is used in the manufacturing process, a minimum of 5 samples shall be submitted from each mold cavity. Each part shall be identified with its mold cavity).

4.3.2 Inspections to be Performed.-The First Article parts submitted in accordance with paragraph 4.3.1 will be subjected by the Government to all examinations and tests specified in 4.4.2 of this specification and to any or all requirements of the applicable drawings. After inspection, each power supply shall be cut open; and the piezoid shall be subjected to all applicable electrical tests specified in 4.4.2 of this specification.

4.3.3 Rejection.-See MIL-A-48078 (PA).

4.4 Quality Conformance Inspection

4.4.1 Inspection Lot Formation.-Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of power supplies shall contain piezoid lots produced from no more than a single batch of composition mix (See 6.6).

4.4.2 Examination.-See MIL-A-48078

a. Sampling Plans.-Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.1	Insulator, Base				9298763
					NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined.				
Major A	None defined.				
Major B					
131	Inside diameter, max.		0.40%	3.2	Gage
132	Outside diameter, min.		0.40%	3.2	Gage
Minor					
201	Thickness		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9298764
4.4.2.2	Spring, Contact				NEXT HIGHER ASSEMBLY 9276111
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Width of segments, min.		0.40%	3.2	Gage
132	Thickness		0.40%	3.2	Gage
Minor					
201	Height, min.		0.65%	3.2	Gage
202	Any operation or feature missing		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.3	Forward Terminal Assembly				9276097
					NEXT HIGHER ASSEMBLY
					9276230
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Leak test of glass seal		4.4.3.1	3.2	Test
102	Pull test of pin		4.4.3.2	3.2	Test
103	True position of holder outside diameter		0.40%	3.2	Gage
104	Perpendicularity		0.40%	3.2	Gage
Major B					
131	Protrusion length of pin		0.40%	3.2	Gage
Minor					
201	Evidence of glass on threads		0.65%	3.2	Visual
202	Protective finish missing or incomplete		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276099
4.4.2.4	Pin, Forward Terminal				NEXT HIGHER ASSEMBLY 9276097
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Length of effective threads, min.		0.40%	3.2	Gage
132	Overall length		0.40%	3.2	Gage
133	Diameter of contact clip attachment hub, min.		0.40%	3.2	Gage
134	Height of contact clip attachment hub, min.		0.40%	3.2	Gage
Minor					
201	Any operation or feature missing		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.4	Visual
203	Thread pitch diameter, min.		0.65%	3.2	Gage
204	Thread major diameter, min.		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276103
4.4.2.5	Ramp, Ball				NEXT HIGHER ASSEMBLY 9276230
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of locating holes		100%	3.2	Gage
102	Dimension to bottom of ramp, max. (four places)		0.40%	3.2	Gage
103	Angle of ramp, max (four places)		0.40%	3.2	Gage
Major B					
131	Outside diameter, min.		0.40%	3.2	Gage
132	Diameter of locating holes, max.		0.40%	3.2	Gage
133	Major diameter of center hole, max.		0.40%	3.2	Gage
134	Thickness		0.40%	3.2	Gage
135	Depth of major center hole diameter		0.40%	3.2	Gage
Minor					
201	Surface finishes incorrect		0.65%	3.2	Visual/Comparison Blocks
202	Protective finish missing or incomplete		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.6	Switch, Graze	1 OF 1	9276104
			NEXT HIGHER ASSEMBLY 9276230

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of locating holes		100%	3.2	Gage
102	Length of tangs, min.		0.40%	3.2	Gage
103	Thickness, max.		0.40%	3.2	Gage
104	Width of tangs, min.		0.40%	3.2	Gage
105	Gold plating defective		4.4.3.3	3.2	Test
106	Hardness		0.40%	3.2	Test
Major B					
131	Diameter of locating holes, max.		0.40%	3.2	Gage
132	Presence of burrs on tangs		0.40%	3.2	Visual
Minor					
201	True position of center hole		0.65%	3.2	Gage
202	Outside diameter, min.		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

10

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.7	Spacer	1 OF 1	9276105
			NEXT HIGHER ASSEMBLY 9276230

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Flatness		0.40%	3.2	Gage
Major B					
131	Major diameter of boss, min.		0.40%	3.2	Gage
132	Outside diameter, min.		0.40%	3.2	Gage
133	Thickness to boss		0.40%	3.2	Gage
134	Thickness through boss, max.		0.40%	3.2	Gage
135	Height of boss minor diameter		0.40%	3.2	Gage
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.4	Visual
203	Thread pitch diameter, max.		0.65%	3.2	Gage
204	Thread minor diameter, max.		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.8	Sleeve, Insulator				9276106
					NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Inside diameter, max.		0.40%	3.2	Gage
132	Thickness, min.		0.40%	3.2	Gage
Minor					
201	Height		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276107
4.4.2.9	Bar, Shorting				NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of tang		0.40%	3.2	Gage
102	Flatness		0.40%	3.2	Gage
103	Deflection of tang under load		0.40%	3.2	Test
Major B					
131	Outside diameter, min.		0.40%	3.2	Gage
132	Width of locating tab,		0.40%	3.2	Gage
133	Offset of locating tab		0.40%	3.2	Gage
134	Dimension from outside diameter to end of tang		0.40%	3.2	Gage
135	Dimension from root of tang to outside diameter		0.40%	3.2	Gage
136	Hardness		0.40%	3.2	Gage
Minor					
201	Any operation missing		0.65%	3.2	Visual
202	Protective finish missing or incomplete		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET	DRAWING NUMBER
4.4.2.10	Insulator, Piezoid		1 OF 1	9276109
				NEXT HIGHER ASSEMBLY 9276238

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
Major A					
101	True position of lip inside diameter		0.40%	3.2	Gage
Major B					
131	Thickness, min.		0.40%	3.2	Gage
132	Height, max.		0.40%	3.2	Gage
133	Thickness of lip, max.		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

14

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.11	Aft Terminal Assembly		9276111
			NEXT HIGHER ASSEMBLY 9276234

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Leak test of glass seal		4.4.3.1	3.2	Test
102	Pull test of pin		4.4.3.2	3.2	Test
103	Pull test of contact spring		4.4.3.4	3.2	Test
104	True position of holder outside diameter		0.40%	3.2	Gage
105	Perpendicularity		0.40%	3.2	Gage
Major B					
131	Protrusion length of pin		0.40%	3.2	Gage
132	Dimension at bend in contact spring (2 places), min.		0.40%	3.2	Gage
Minor					
201	Evidence of glass on threads		0.65%	3.2	Visual
202	Protective finish missing or incomplete		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.4	Visual
204	Ring gage fails to fit end of contact spring		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.12	Holder, Terminal		9276112
			NEXT HIGHER ASSEMBLY
			9276097 - 9276111

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined.				
Major A	None defined.				
Major B					
131	Any feature or operation missing		0.40%	3.2	Visual
132	Thickness		0.40%	3.2	Gage
133	Thickness of crimp lip		0.40%	3.2	Gage
134	Outside diameter, min.		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276115
4.4.2.13	Plate, Fulcrum				NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of minor outside diameter		0.40%	3.2	Gage
102	True position of tang ramp		0.40%	3.2	Gage
Major B					
131	Width of locating tab slot		0.40%	3.2	Gage
132	Width of tang ramp		0.40%	3.2	Gage
133	Thickness		0.40%	3.2	Gage
134	Thickness of lip		0.40%	3.2	Gage
135	Depth of tang ramp at basic dimension, max.		0.40%	3.2	Gage
136	Minor outside diameter, min.		0.40%	3.2	Gage
137	Depth of locating tab slot		0.40%	3.2	Gage
138	Major outside diameter, min.		0.40%	3.2	Gage
Minor					
201	Protective finish incomplete or missing		0.65%	3.2	Visual
202	Surface finishes incorrect		0.65%	3.2	Visual/Comparison Blocks

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.14	Envelope	1 OF 1	9276119
			NEXT HIGHER ASSEMBLY 9276238

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of inside crimp diameters (both ends)		0.40%	3.2	Gage
Major B					
131	Wall thickness, min.		0.40%	3.2	Gage
132	Inside crimp diameters, max (both ends)		0.40%	3.2	Gage
133	Depth to crimp diameter shoulder, max.		0.40%	3.2	Gage
134	Dimension between inside crimp diameter shoulders		0.40%	3.2	Gage
135	Height		0.40%	3.2	Gage
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.4	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276128
4.4.2.15	Pin, Aft Terminal				NEXT HIGHER ASSEMBLY 9276111
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Length of perfect threads, min.		0.40%	3.2	Gage
132	Overall length		0.40%	3.2	Gage
Minor					
201	Minor outside diameter		0.65%	3.2	Gage
202	Height of peen boss, min.		0.65%	3.2	Gage
203	Diameter of peen boss, min.		0.65%	3.2	Gage
204	Thread pitch diameter, min.		0.65%	3.2	Gage
205	Thread major diameter, min.		0.65%	3.2	Gage
206	Any operation missing		0.65%	3.2	Visual
207	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.16	Cushion				9276184
					NEXT HIGHER ASSEMBLY 9276738
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Thickness		0.65%	3.2	Gage
202	Outside diameter, min.		0.65%	3.2	Gage
203	Diameter of center hole, max.		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276185
4.4.2.17	Clip, Contact				NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Thickness		0.40%	3.2	Gage
132	Diameter of center hole, max.		0.40%	3.2	Gage
133	Any feature or operation missing		0.40%	3.2	Visual
134	Width of offset, min.		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.18	Pieziod	1 OF 1	9276194
			NEXT HIGHER ASSEMBLY: 9276238

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Parallelism of faces		0.40%	3.2	Gage
102	Electrical resistance of silvered surface (both sides)		0.40%	3.2	Test
103	Open circuit voltage after release of compression load, min.		100%	3.2	Test
104	Capacitance, min.		100%	3.2	Test
105	Electrode to electrode electrical resistance, min.		100%	3.2	Test
106	Minimum electrical characteristics after temperature cycle		4.4.3.5	3.5.1	4.5.2
107	Minimum compressive strength		4.4.3.6	3.5.2	4.5.3
Major B					
131	Outside diameter, min.		0.40%	3.2	Gage
132	Thickness		0.40%	3.2	Gage
133	Absence of void in paint marking positive face		0.40%	3.2	Visual
134	Surface finish incorrect		0.40%	3.2	Visual/Comparison Blocks
Minor					
201	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.19	Resistor				9276229
					NEXT HIGHER ASSEMBLY
					9276234
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Thickness, max		0.40%	3.2	Gage
102	Physical and electrical properties at +125°F		4.4.3.8	3.2, 3.7	4.5.6
103	Physical and electrical properties at -35 °F		4.4.3.8	3.2, 3.7	4.5.6
Major B	None defined				
Minor					
201	Thickness, min		0.65%	3.2	Gage
202	Outside diameter		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276230
4.4.2.20	Graze Switch Terminal Assembly				NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A	None defined				
Major B					
131	Any part missing or improperly assembled		100%	3.2	Visual
132	Visible gaps present between component parts		0.40%	3.2	Visual
133	Assembly loose		0.40%	3.2	Manual
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.21	Washer, Felt				9276231
					NEXT HIGHER ASSEMBLY
					9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Thickness		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.22	Anvil Terminal Assembly				9276234
					NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Resistor missing		100%	3.2	Visual
Major A	None defined				
Major B					
131	Assembly loose		0.40%	3.2	Manual
132	Visible gaps present between component parts		0.40%	3.2	Visual
133	Thread above flush with anvil surface		0.40%	3.2	Straight-edge
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.23	Anvil				9276235
					NEXT HIGHER ASSEMBLY 9276234
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Parallelism		0.40%	3.2	Gage
102	True position of c'bore diameter		0.40%	3.2	Gage
103	True position of c'bore boss		0.40%	3.2	Gage
104	Height of c'bore boss		0.40%	3.2	Gage
Major B					
131	Outside diameter, min.		0.40%	3.2	Gage
132	C'bore diameter, max.		0.40%	3.2	Gage
133	C'bore boss diameter, min.		0.40%	3.2	Gage
134	Thickness through c'bore boss		0.40%	3.2	Gage
135	Depth to c'bore boss		0.40%	3.2	Gage
Minor					
201	Thread pitch diameter, max.		0.65%	3.2	Gage
202	Thread minor diameter, max.		0.65%	3.2	Gage
203	Surface finishes incorrect		0.65%	3.2	Visual/Comparison Blocks
204	Protective finish missing or incomplete		0.65%	3.2	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.24	Insulator, Graze Switch	1 OF 1	9276236
			NEXT HIGHER ASSEMBLY 9276230

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	True position of locating bosses		0.40%	3.2	Gage
102	Dimension between bottoms of slots (two places)		0.40%	3.2	Gage
103	Height of bosses		0.40%	3.2	Gage
Major B					
131	Diameter of bosses, min.		0.40%	3.2	Gage
132	Diameter of center hole, max.		0.40%	3.2	Gage
133	Thickness		0.40%	3.2	Gage
Minor					
201	Outside diameter, min.		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.4	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026[illegible]
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.25	Power Supply, Fuze, M539				9272638
					NEXT HIGHER ASSEMBLY
					9293288/9294989
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Safety*		4.4.3.7.2	3.5.2	Visual
Major A					
101	Acceleration necessary to close Graze Switch		100%	3.2	Test (Note 1)
102	Air leakage exceeds max. allowable rate		100%	3.2	Test (Note 1)
103	Electrical resistance, terminal-to-terminal, under min. allowable		100%	3.2	Test
104	Electrical resistance, forward terminal-to-Envelope, under min. allowable		100%	3.2	Test
105	Electrical resistance, aft terminal-to-Envelope, under min. allowable		100%	3.2	Test
106	Capacitance, terminal-to-terminal, under min. allowable		100%	3.2	Test
107	Shorting bar missing or improperly assembled		100%	3.2	Visual
108	Graze Functioning*		4.4.3.7.1	3.5.1	4.5.5.1
Major B					
131	Piezoid Insulator missing		100%	3.2	Visual
132	One or more Balls missing		100%	3.2	Visual
133	Solder flux on either terminal assembly, discoloration of solder or of plating in the immediate area of the solder joints		0.40%	3.2	Visual
134	Length, max		0.40%	3.2	Gage
135	Presence of foreign material on insulators, prior to assembly		100%	3.2	Visual

NOTES: Note 1 - These tests shall be performed prior to all electrical tests.
*Proving Ground

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.25	CONTINUATION SHEET				9276238
					NEXT HIGHER ASSEMBLY
					9293288/9294989
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Any component part missing or insecure		0.65%	3.2	Manual/Visual
202	Evidence of poor workmanship		0.65%	3.4	Visual
203	Marking incorrect or unidentifiable		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.26	Sleeve, Grounding				9276239
					NEXT HIGHER ASSEMBLY
					9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major A			0.40%	3.2	
101	Electrical Resistance, max.		0.40%	3.2	Test
Major B					
131	Major outside diameter, min.		0.40%	3.2	Gage
132	Any operation missing		0.40%	3.2	Visual
Minor					
201	Material thickness, min.		0.65%	3.2	gage
202	Major outside diameter, max.		0.65%	3.2	Gage
203	Height		0.65%	3.2	Gage
204	Protective finish missing or incomplete		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.27	Insulator, External				9276240
					NEXT HIGHER ASSEMBLY 9276238
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major A	None defined				
Major B 131	Thickness, min.		0.40%	3.2	Gage
Minor 201 202	Major inside diameter, max. Minor inside diameter		0.65% 0.65%	3.2 3.2	Gage Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER: 9276241
4.4.2.28	Disc, Insulator				NEXT HIGHER ASSEMBLY 9276242
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Thickness, min.		0.65%	3.2	Gage
202	Inside diameter, max.		0.65%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9276242 / NEXT HIGHER ASSEMBLY 9276238
4.4.2.29	"O" - Ring Assembly				
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor 201	"O" - Ring insecurly assembled or missing		0.65%	3.2	Manual/Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20261026T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER N/A
4.4.2.30	Packing (See 5.1)				NEXT HIGHER ASSEMBLY N/A
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	One or more power supplies missing from any bottom support, prior to assembly of top support		0.65%	3.1	Visual
202	Packing loose, within fiber box		0.65%	3.1	Visual/Manual
203	Fiber box damaged, improperly sealed or marked		0.65%	3.1	Visual
204	Bag damaged, improperly sealed or marked, or missing (Level B)		0.65%	3.1	Visual
205	Packing loose, within wood box (Level B)		0.65%	3.1	Visual/Manual
206	Wood box damaged, improperly sealed or marked (Level B)		0.65%	3.1	Visual
207	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63067 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.31	Insulator, Washer	1 OF 1	9298771
			NEXT HIGHER ASSEMBLY 9272638

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Thickness		0.40%	3.2	Gage
Minor					
201	Inside diameter		0.65%	3.2	Gage
202	Outside diameter, min		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.4	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Leak Test of Glass Seal.-Thirty samples shall be selected from each lot for this test. If any sample fails to comply with the applicable requirement, the lot shall be rejected.

4.4.3.2 Pull Test of Pin.-Thirty samples shall be selected from each lot for this test. If any sample fails to comply with the applicable requirement, the lot shall be rejected.

4.4.3.3 Testing of Graze Switch Gold Plate.-Testing of the gold plate on the graze switch shall be for thickness (microscope technique) and adhesion. Sampling for this test shall be as follows:

a. Batch Type Process.-For plating batches of 1000 parts or less, 2 samples shall be randomly selected. For batches in excess of 1000 parts, one additional part shall be randomly selected from each 500 parts or fraction thereof. If any sample fails to comply with the applicable reqirements, the batch represented by that sample shall be rejected.

b. Continuous Type Process.-Two parts shall be randomly selected from each 1000 parts or fraction thereof plated in a continuous process. If any sample fails to comply with the applicable requirements, all parts, plated prior to that sample, and subsequent to the last acceptable sample shall be rejected.

4.4.3.4 Pull Test of Contact Spring.-Thirty samples shall be selected from each lot for this test. If any sample fails to comply with the applicable requirement, the lot shall be rejected. Samples subjected to pull test shall not be returned to the lot.

4.4.3.5 Minimum Electrical Characteristics After Temperature Cycle.-Thirty piezoids shall be selected from each lot for this test. If any sample fails to comply with the applicable requirement, the lot shall be rejected.

4.4.3.6 Minimum Compressive Strength.-Ten piezoids shall be selected from each lot for this test. If any sample fails to comply with the applicable requirement, the lot shall be rejected. Samples subjected to min. compressive strength test shall not be returned to the lot.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

4.4.3.7 Proving Ground

4.4.3.7.1 Graze Functioning.-A sample of twenty (20) power supplies shall be randomly selected from each lot for this test. Each sample power supply shall be assembled onto a cartridge comprised of components (projectile, fuze, shaped-charge liner, etc.) previously tested and accepted in accordance with applicable specifications. If six (6) or more cartridges fail to comply with the applicable requirement, the power supply lot shall be rejected. If one (1) or more projectiles fail to initially impact the gravel pad, the power supply lot shall be referred and results of such impacts shall be reported.

4.4.3.7.2 Safety.-All cartridges fired in proving ground testing shall be observed for premature bursts, in flight, prior to impact. If any power supply fails to comply with the applicable requirement, the lot shall be rejected.

4.4.3.8 Physical and Electrical Properties of Resistor at Temperature Extremes.-A sample of ten (10) resistors shall be randomly selected from each lot for each of these tests. If any resistor fails to comply with the applicable requirement, the lot shall be rejected. Sample resistors subjected to these tests shall not be returned to the lot.

4.5 Test Method and Procedures

4.5.1 Materials, Components and Processes.-Compliance with all requirements of Section 3 of this specification shall be ascertained by current and continuing examination of inspection and test data to determine that all components (parts, subassemblies, and materials) have been inspected and tested and found to comply with their respective drawing and specification requirements, and that all specified manufacturing processes have been followed.

4.5.1.1 Visual and Mechanical Inspection.-The visual, manual and mechanical inspections and tests shall verify compliance with the requirements of Sections 3 and 5 of this specification in accordance with 4.4.2 herein

4.5.2 Minimum Electrical Characteristics After Temperature Cycle.-Sample piezoids shall be temperature conditioned at +145°F + 5°F (piezoid temperature) for one hour (min.) then conditioned at -65°F ± 5°F (piezoid temperature) for one hour (min.). The entire cycle shall be accomplished within a eight hour period. After temperature cycling,

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:25Z
Check the source to verify that this is the current version before use.

the piezoids will be conditioned at 70°F ± 5°F for 48 hours and subjected to each of the following tests:

a. Open circuit voltage after release of compressive load, min.

b. Capacitance, min.

c. Electrode to electrode electrical resistance, min.

Failure is defined as the inability of any sample piezoid to comply with the applicable requirement for any or all three tests.

4.5.3 Minimum Compressive Strength.-The compressive strength of the piezoid shall be tested with the sample piezoid between steel platens of Rockwell Hardness C54 minimum.

The following testing parameters are advisory:

a. Platen thickness one inch minimum

b. Length to diameter ratio 1:2

c. Platens to be flat to .0005 inches

d. Platens to have 8RMS finish

e. All testing surfaces to be parallel within .001 inches.

f. Platens and piezoid sample to be concentric to center of load and free of all foreign material

g. Constant loading rate of 10,000 pounds per minute

h. Compression loading of the piezoid to be continuous

4.5.4 Dimensional Control of Cast, Stamped, or Molded Parts.-In place of the normal sampling associated with the classification of Defects, and subject to approval of the Government procuring agency, the optional sampling plans in paragraphs 4.5.4.1, 4.5.4.2, and 4.5.4.3 may be used for dimensional control of cast, stamped, or molded parts. Use of these optional plans is limited to those dimensions and features controlled by the tool, die, or mold cavity. For all specified tests, visual examinations, and examinations

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.

of dimensions or features not developed exclusively by the tool, die, or mold cavity, these optional plans are not applicable. In the event of in-process reject(s) during optional sampling, corrective action applicable to parts produced prior to the rejected, and subsequent to the last acceptable sample, shall require approval of the Government procuring agency.

4.5.4.1 Cast Parts.-A sample of at least five (5) parts (as cast) from each cavity shall be dimensionally inspected to qualify a new or reworked cavity for use in production or as a control of the cavity during production. Inspection for control of each cavity during production shall be performed on the above quantities from each cavity after production of 5000 parts. Individual cavity identification must be provided. If any defective parts are found during qualification of the cavity, the cavity producing the defective part shall not be used in production. If any defective parts are found when inspection is performed for control of the cavity, the cavity producing the defective part shall be remomed from production. Further, that portion of production since the last control check shall be returned for corrective action. All cavities formerly removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test specified above.

4.5.4.2 Stamped Parts.-A sample of at least ten (10) parts shall be dimensionally inspected to qualify the tool used in the stamping process for use in production. In addition, a random sample of five (5) parts shall be selected from the last portion of each hour's production for dimensional inspection as a control of the tool during production. If any defective parts are found during qualification of the tool, the tool producing the defective part shall not be used in production. If any defective parts are found when inspection is performed for control of the tool, the tool producing the defective part shall be removed from production. Further, that portion of production since the last tool control check shall be returned for corrective action. All tools removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test above.

4.5.4.3 Molded Parts.-A sample of five (5) parts (as molded) from each cavity shall be fully inspected dimensionally to qualify a new or reworked cavity for use in production. The molded parts shall carry the individual cavity identification. As a control of each cavity during production, the above quantity of parts from each cavity shall be dimensionally

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

inspected after continuous production of each 5,000 parts or at the end of each week, whichever occurs first. If any defective parts are found during qualification of the cavity, the cavity producing the defective part will not be used in production. If any defective parts are found when inspection is performed for the control of the cavity, the cavity producing the defective part shall be removed from production. Further, that portion of production since the last control check shall be returned for corrective action. All cavities removed from production because of some fault, may, after reworking, be returned to production, providing they pass the qualification test above.

4.5.5 Ballistic Test.-These tests shall be conducted at a Government proving ground in accordance with the applicable Acceptance Test Procedure. The sample cartridges shall be fired in a gun for which the cartridge is standard and observation shall be made for proper functioning and for premature bursts, in flight, prior to impact.

4.5.5.1 Graze Functioning.-The ammunition for this test shall be conditioned at a temperature of 70 Degrees Fahrenheit (°F) ±5 °F for 16 hours min. prior to firing. Test cartridges shall be fired for graze functioning at a gravel impact field, at a range of 1000 meters.

4.5.6 Physical and Electrical Properties of Resistor at Temperture Extremes.-The sample resistors shall be conditioned at the required temperature ± 5°F (10 at +125°F, 10 at -35°F) for 8 continuous hours min. The resistors shall be removed from conditioning, and subjected to the following tests within 20 minutes max. after removal from conditioning:

a. Resistance
b. Power dissipation
c. Compressive loading.

5.1 Preservation & Packing

5.1.1 Level C.-Pack 36 power supplies, aft terminal end down, into the 36 cavities of the bottom support. Bottom support to be manufactured in accordance with Figure 1. Position top support (Ref Figure 2) over bottom support. Tape two halves together with 2 strips of 2. inch wide Spec PPP-T-76 tape. The two strips of tape to cross each other in center. Pack 5 layers (180 power supplies) in a Type CF, Domestic Class, variety DW, 275 grade, RSC style fiber box Spec PPP-B-636. The inside dimensions of fiber box to

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

be 10 1/4 x 10 1/4 x 11 5/8 high. Add commercial chipboard fillers 1/16 thick on sides, ends and on top as required to insure tight packing. Tape fiber box in accordance with Spec PPP-B-636 as applicable for fiber boxes overpacked or shipped as exterior containers.

5.1.2 Level B.-In addition to fiber box specified in Level C, overpack fiber box in a class E, Spec MIL-B-117 bag after blunting corners of box. Exhaust all excess air within bag and seal bag in accordance with Spec MIL-P-116. Size of bag to be 21 3/4 min. open face x 25 1/2 min. deep. Pack 18 bagged fiber boxes (3 x 3 x 2 high) in an overseas type wood cleated - plywood box in accordance with Spec PPP-B-601. Box to be provided with skids in accordance with Para. 3.3.3 of Spec. Requirements for box to be for 760 pound weight of contents (Ref Table III). Inside dimensions of box to be 32 1/2 x 32 1/2 x 25 1/2 high. Add filler material 32 x 32 x 1/16 thick or 32 x 24 x 1/16 thick as applicable on sides, ends and top as required for tight packing. Filler material to comply with Spec MIL-B-3106 or MIL-F-50449.

5.2 Marking

5.2.1 Level C.-Marking of fiber box to be in accordance with MIL-STD- 1169.

5.2.2 Level B.-Marking of fiber box, bag, and box to be in accordance with Level A, MIL-STD-1169.

6. NOTES

6.1 Intended Use.-The part covered by this specification is intended for use as part of the M539, PIBD, Fuzing System.

6.2 Ordering Data.-See MIL-A-48078 (PA).

6.3 Submission of Designs for Approval.-See 6.2.3 of MIL-A-48078 (PA). Submit equipment designs, as required, to:

Commander
Picatinny Arsenal
ATTN: SARPA-QA-T-T
Dover, New Jersey 07801

6.4 Inspection Lot Size.-It is noted that the size of inspection lots of components, assemblies or items of delivery may differ from the actual quantities contractually scheduled for delivery. However, in order to facilitate scheduling of test or deliveries, inspection lots of items of delivery may be equivalent to such contract quantities provided all of the

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

lot formation criteria and sampling provisions of this specification are maintained.

6.5 Visual Examination.-When compliance with the applicable requirements is in doubt as a result of visual examination, the characteristic may be measured or gaged to determine acceptability.

6.6 Batch.-A batch is defined as a quantity of piezoid ingredients blended in a single container at one time.

6.7 Proving Ground Test Summary.-


Test	Sample Size	Requirement	Test Procedures Paragraph
Graze Functioning	20 rds	3.5.1	4.5.5.1
Safety		3.5.2	

Custodian:
ARMY-PA

Preparing Activity:
ARMY-PA

Project Number: FSC: 1390-A118

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

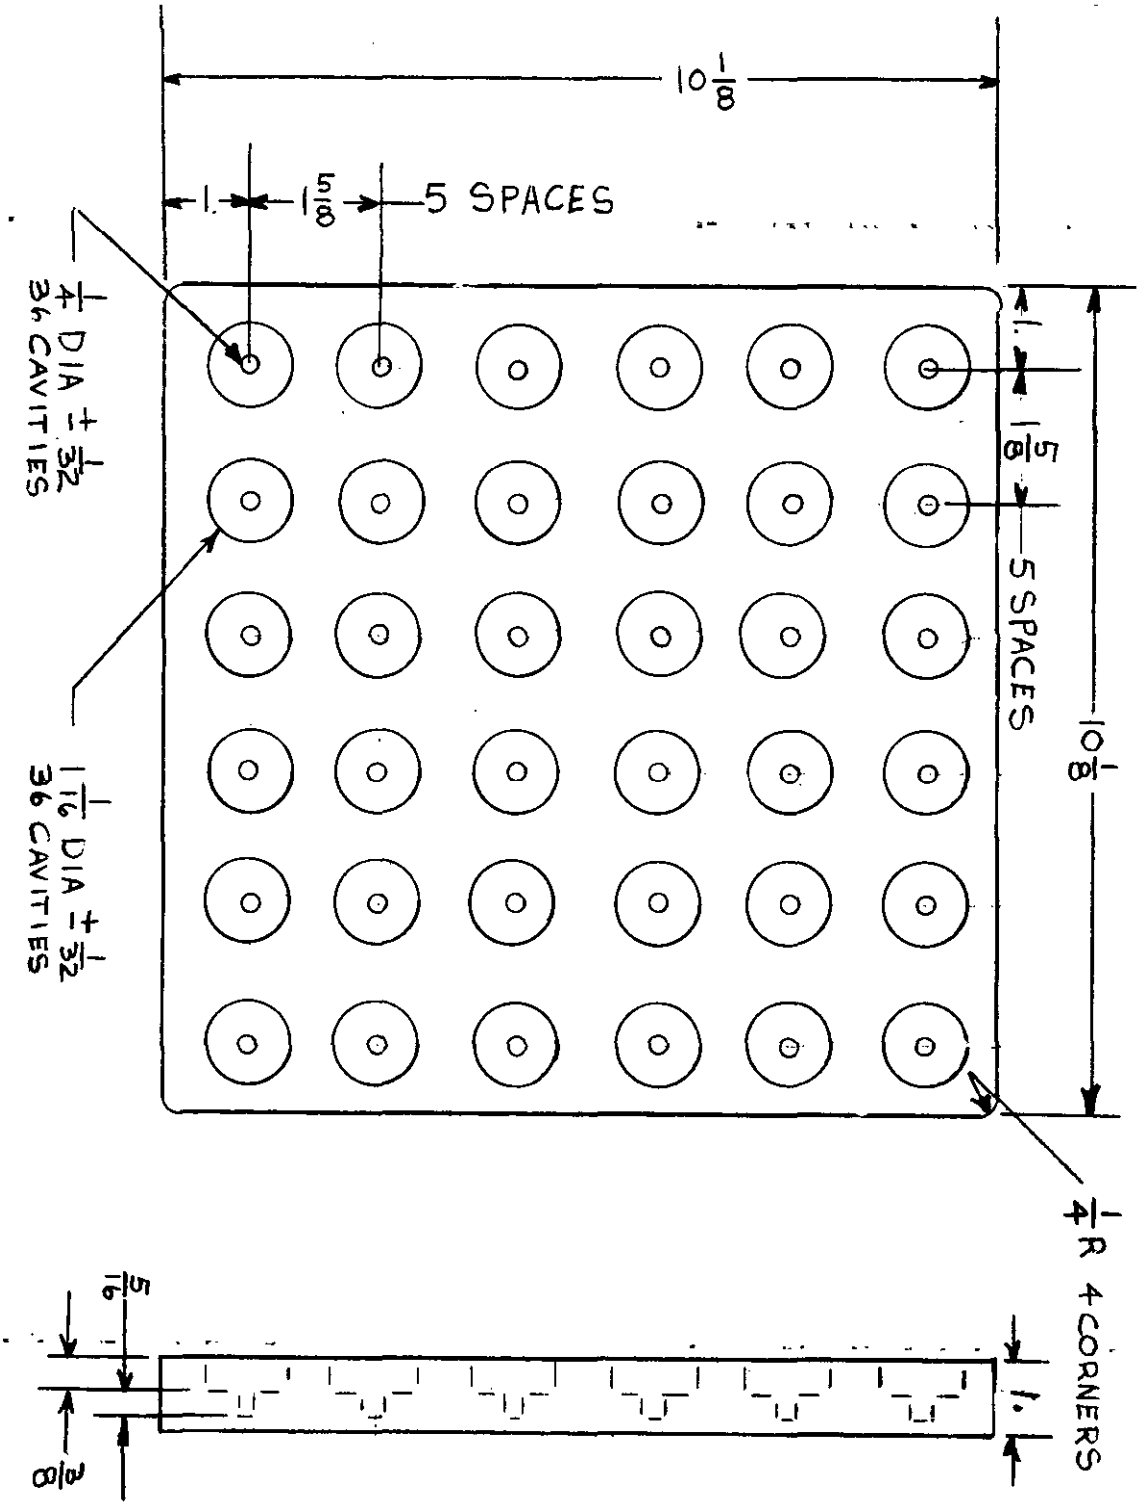


MATERIAL - POLYSTYRENE FOAM
SPEC MIL P 6031 2 TYPE II CLASS 2
DENSITY 2 LB/CU. FT

(UNTOL DIM ± 1/16)

SUPPORT BOTTOM

FIGURE 1.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

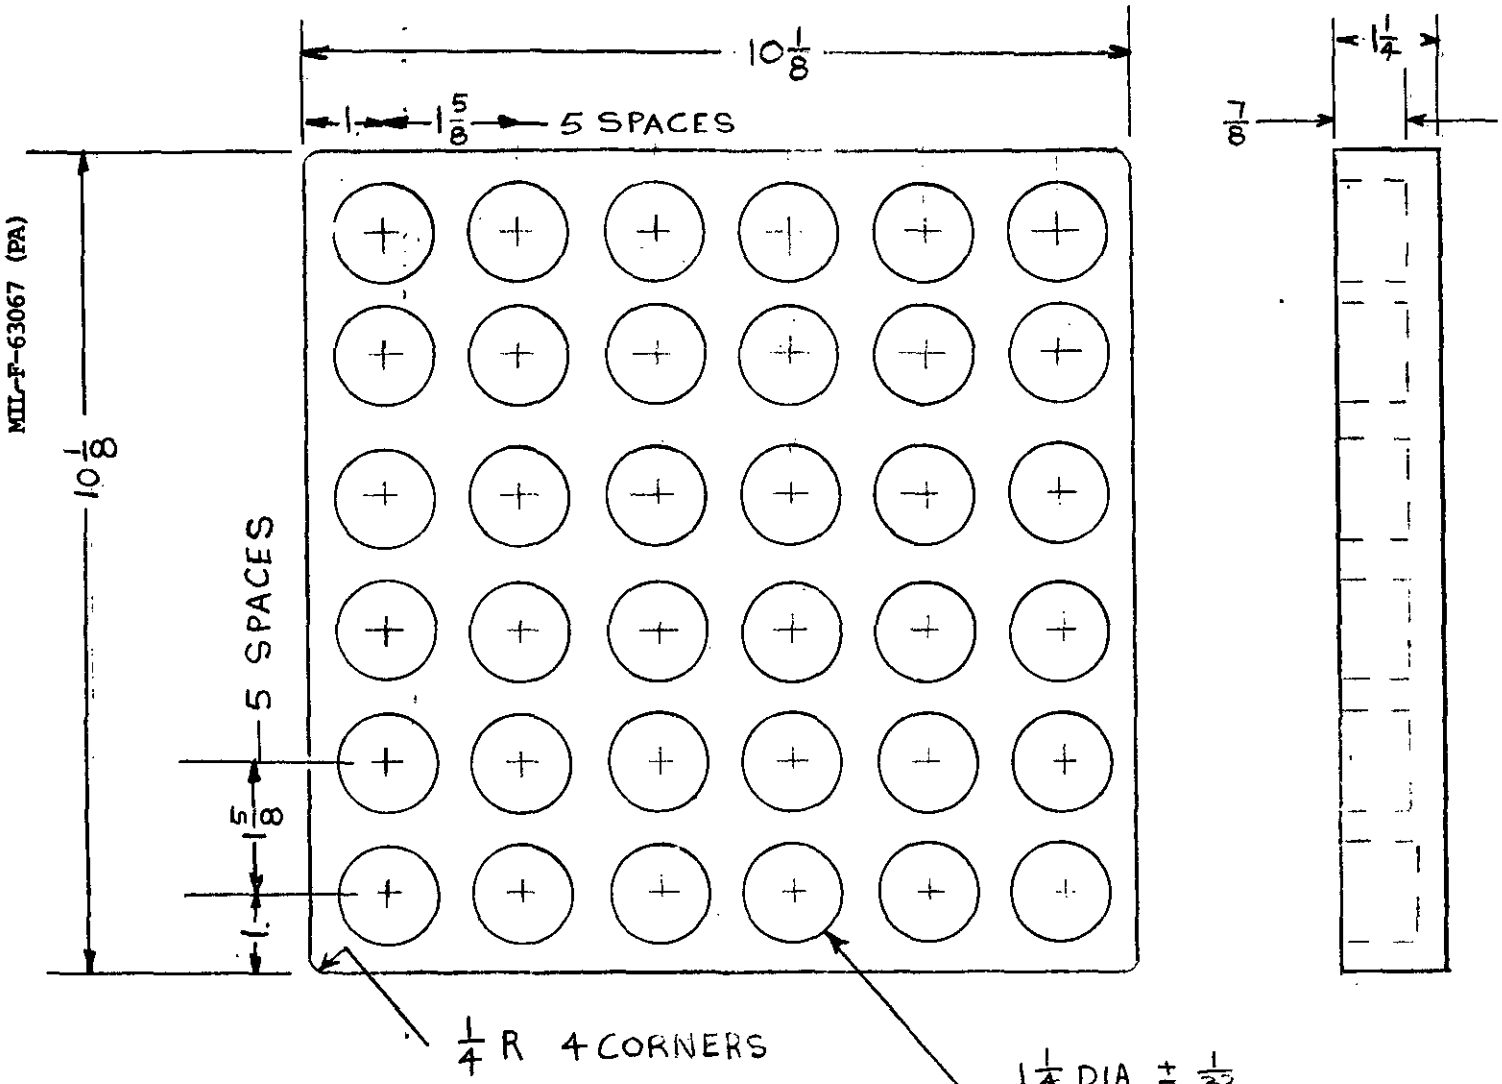

MATERIAL - POLYSTYRENE FOAM
TYPE II CLASS 2
SPEC MIL P 60312
DENSITY - 2 LB / CU. FT.

(UNTOL DIM ± 1/16)

SUPPORT TOP

FIGURE 2.

Source: https://assist.dla.mil -- Downloaded: 2026/10-26T04:25Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products *at reasonable cost and minimum* delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. *Attach any pertinent data which* may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:25Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDER
Picatinny Arsenal
ATTN: SARPA-QA-A
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:25Z
Check the source to verify that this is the current version before use.