INCH-POUND

MIL-DTL-24558/26B
3 October 2011
SUPERSEDING
MIL-DTL-24558/26A
28 December 2004

DETAIL SPECIFICATION SHEET

TERMINAL BOX, CONNECTION, SUBMERSIBLE (15-FOOT), 500 VOLTS, THREE-PHASE, SYMBOL NO. 572.1, SIX BRANCH LUGS FOR TWO 3-CONDUCTOR 40 MCM CABLES, SIX BUS LUGS FOR TWO 3-CONDUCTOR 75 MCM CABLES

This specification is approved for use by all Departments and Agencies of the Department of Defense.

The requirements for acquiring the product described herein shall consist of this specification sheet and MIL-DTL-24558, "Terminal Boxes, Connection, for Electrical and Electronic Systems, General Specification for".

REQUIREMENTS: The terminal box shall be as specified herein and in accordance with table I and figures 1 through 12.

1. Electrical rating. The terminal box shall have an electrical rating of 500 volts root mean square, and 500 volts direct current. Bus terminals are designed for 75 thousand circular mils (MCM) cables. Branch terminals are designed for 40 MCM cables.

2. Dimensions and configuration. For dimensions and configuration see figures 1 through 12. All dimensions in figures 1 through 12 are expressed in decimal inches. Overall terminal box dimensions are approximate. Exact dimensions are shown in MIL-E-24142/6, "Enclosure, Submersible (15-Foot), Sizes 8 by 10 Through 14 by 26".

3. Tolerance. All tolerances not specified herein shall be in accordance with MIL-DTL-24558.

4. Standard parts. The standard parts shown in table I shall be used in the construction of the connection box specified herein. The numbers in circles shown on figures 1, 2, 4, 5, 6, 7, 8, 9, 10, 11, and 12 are the same as those shown in the "Item" column of table I.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

5. Enclosure. The enclosure shall be a 15-foot submersible type.

6. Finish. The interior of the enclosure may be painted or left unpainted at the contractor's option.


7. Weight. The weight of the connection box shall not exceed 29.9 pounds.

QUALITY ASSURANCE: First article inspection and quality conformance inspection shall be as specified in MIL-DTL-24558.

NOTES:

1. Drawing. The terminal box specified by this specification sheet was formerly covered on NAVSHIPS drawing no. 9000-S6202-74175.

2. Part or identifying number (PIN). The PIN to be used for terminal boxes acquired to this specification is created as follows:

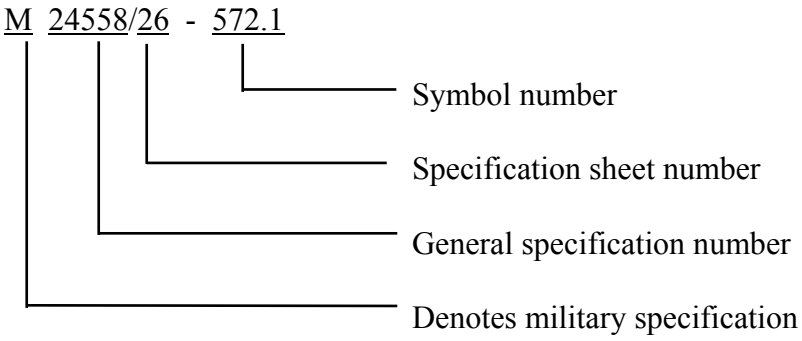

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

TABLE I. Parts list.

Item	Description	Qty	Part number or specification	Remarks
1	Enclosure assembly, brass with type A cover	1	MIL-E-24142/6	M24142/6-004
2	Identification plate	1	MIL-DTL-24558	Figure 6
3	Information plate	1	MIL-DTL-24558	Figure 6
4	Terminal board base	1	Figure 4	MIL-I-24768/1 type GME
5	Mounting bracket	2	MIL-DTL-24558	Figure 2
6	Terminal bus cover	1	Figure 5	MIL-I-24768/1 type GME
7	Terminal bus assembly - phase "A" and "C"	2	Figure 6	Brass
8	Terminal bus assembly - phase "B"	1	Figure 7	Brass
9	Terminal bus body	6	9000-S6202-73055, pc 2	Brass
10	Terminal bus pressure screw assembly	6	9000-S6202-73055, pc 22	Brass
11	Branch terminal body	6	9000-S6202-73246, pc 3	Brass
12	Branch terminal pressure screw assembly	6	9000-S6202-73246, pc 23	Brass
13	Terminal board spacer	2	Figure 8	MIL-I-24768/1 type GME
14	Barrier, 1-hole	4	Figure 9	MIL-I-24768/1 type GME
15	Insert	4	Figure 10	Steel
16	Barrier, 2-hole	2	Figure 11	MIL-I-24768/1 type GME
17	Spacer	6	Figure 12	Brass
18	RDH machine screw .138-32 X 0.188	4	Commercial	Brass
19	FLH machine screw .138-32 X 0.500	8	Commercial	Steel
20	RDH machine screw .190-24 X 0.562	9	Commercial	Brass
21	Washer, #10 internal tooth	9	Commercial	Steel
22	FLH machine screw .190-24 X 1.250	4	Commercial	Steel
23	RDH machine screw1/4-20 X 0.750	4	Commercial	Steel
24	Washer, 1/4 internal tooth	4	Commercial	Steel

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

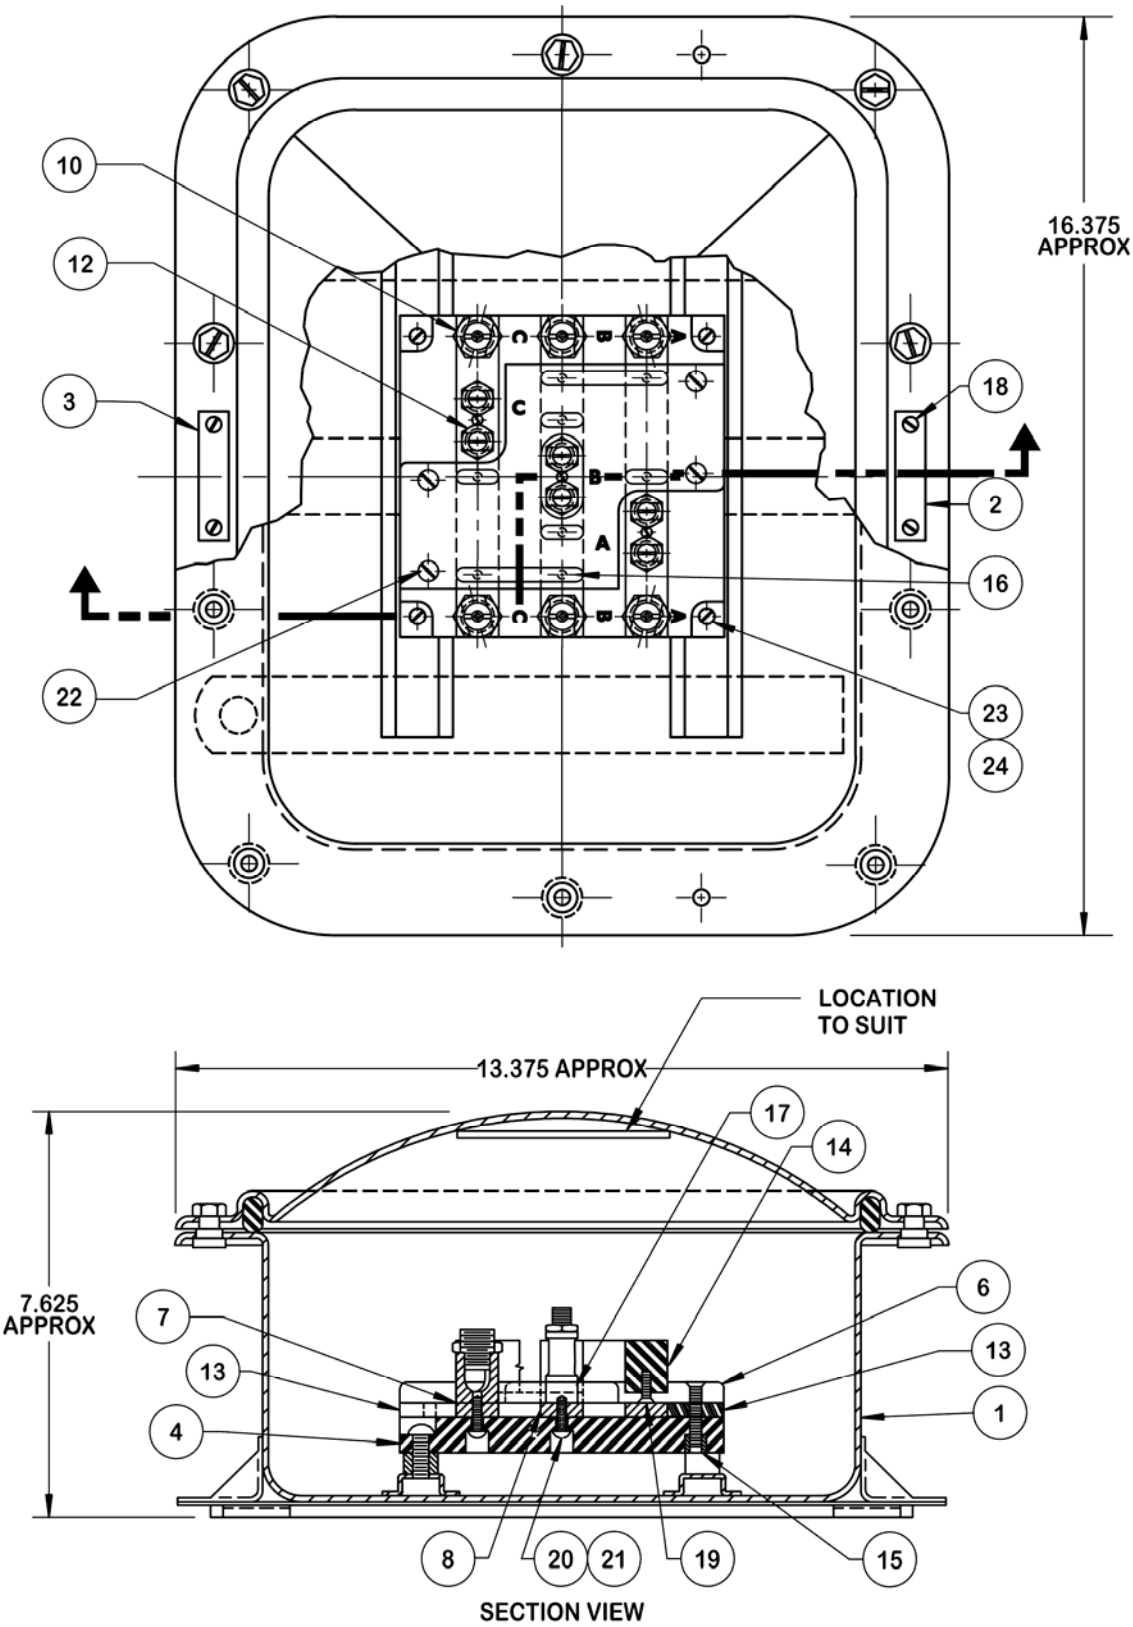


FIGURE 1. Connection box assembly.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

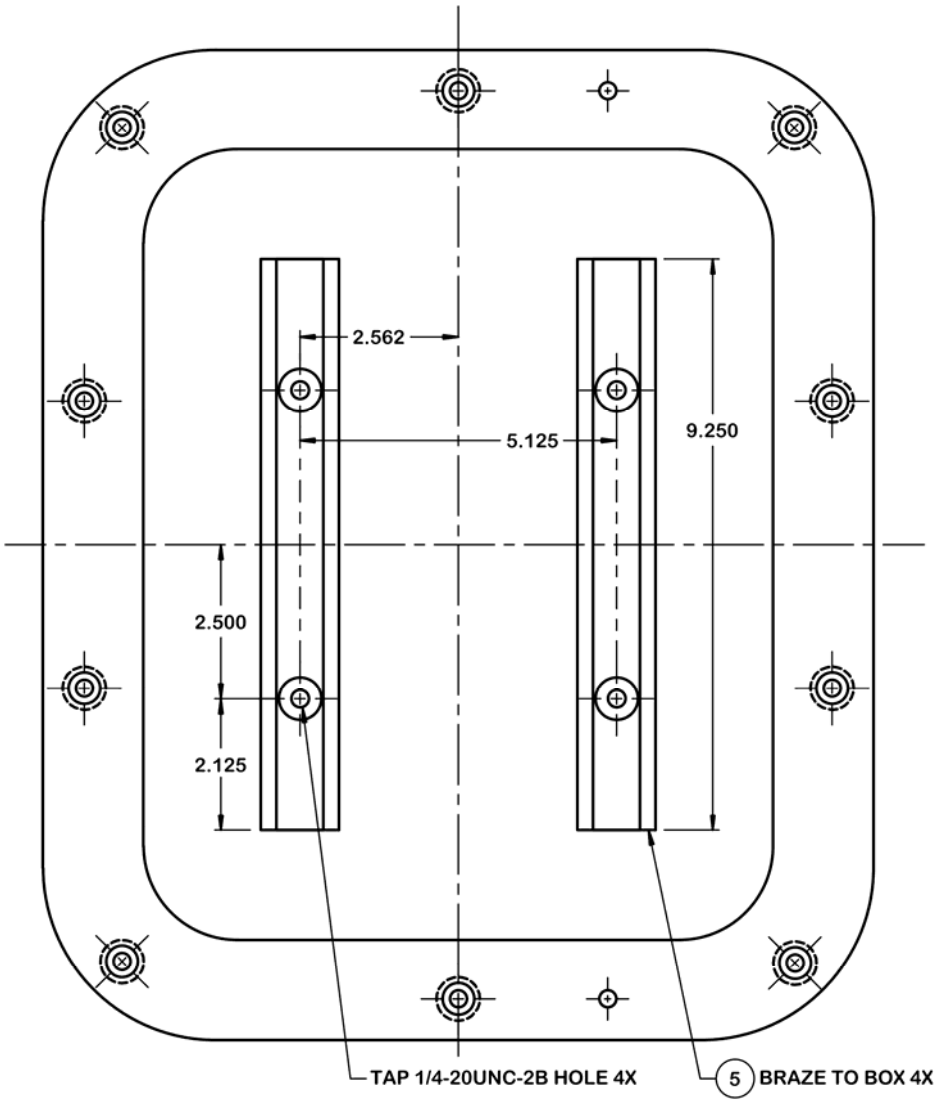


FIGURE 2. Location of terminal board mounting brackets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

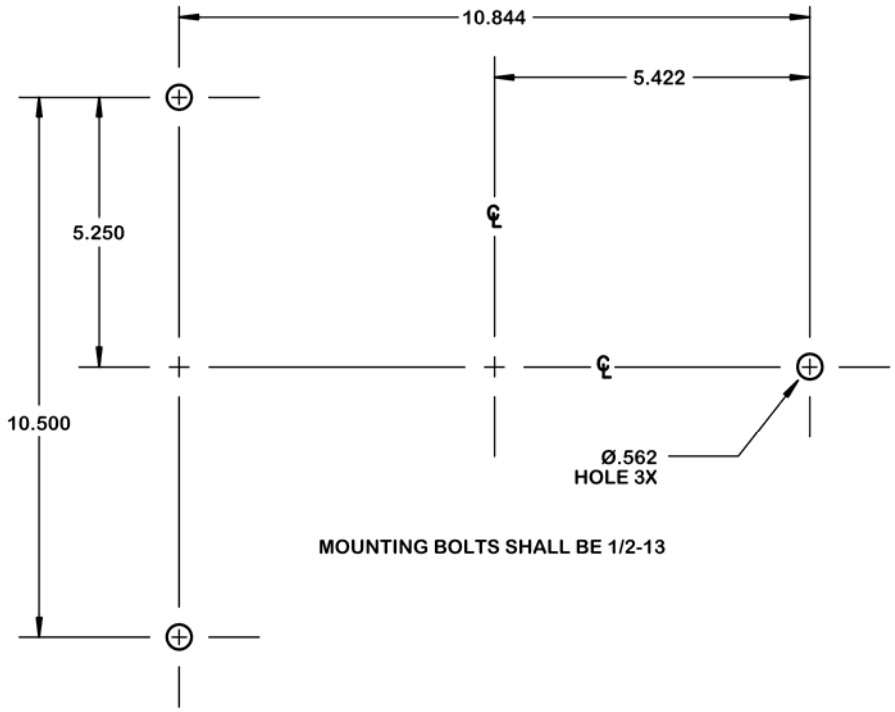


FIGURE 3. Mounting dimensions.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

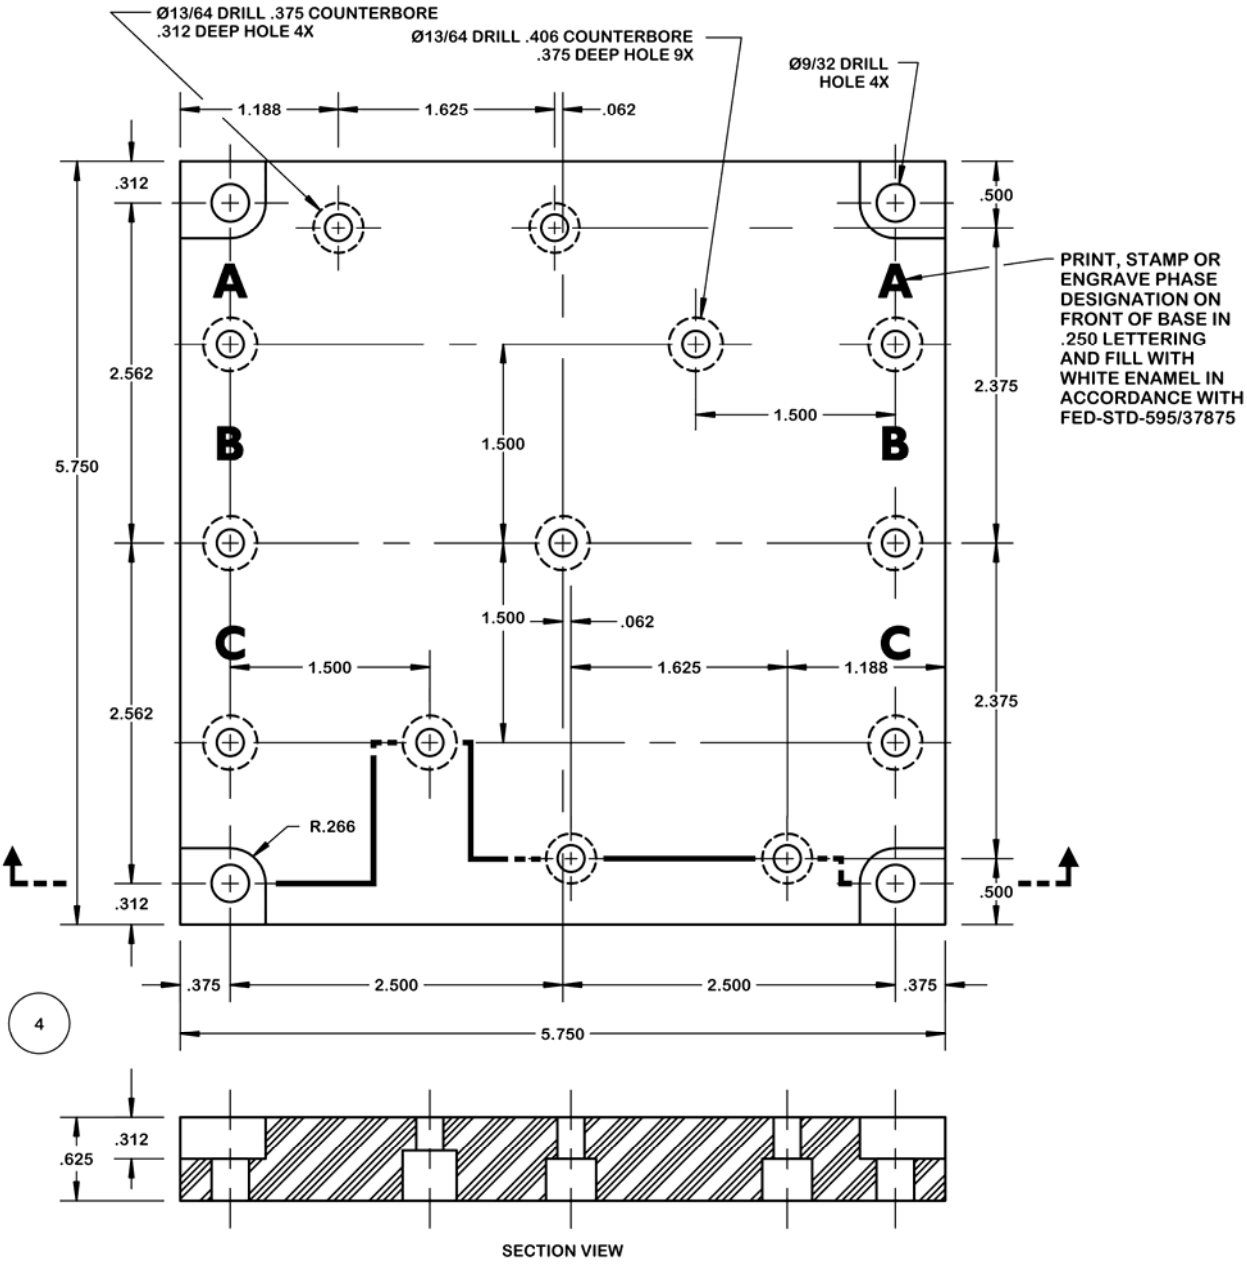


FIGURE 4. Terminal board base.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

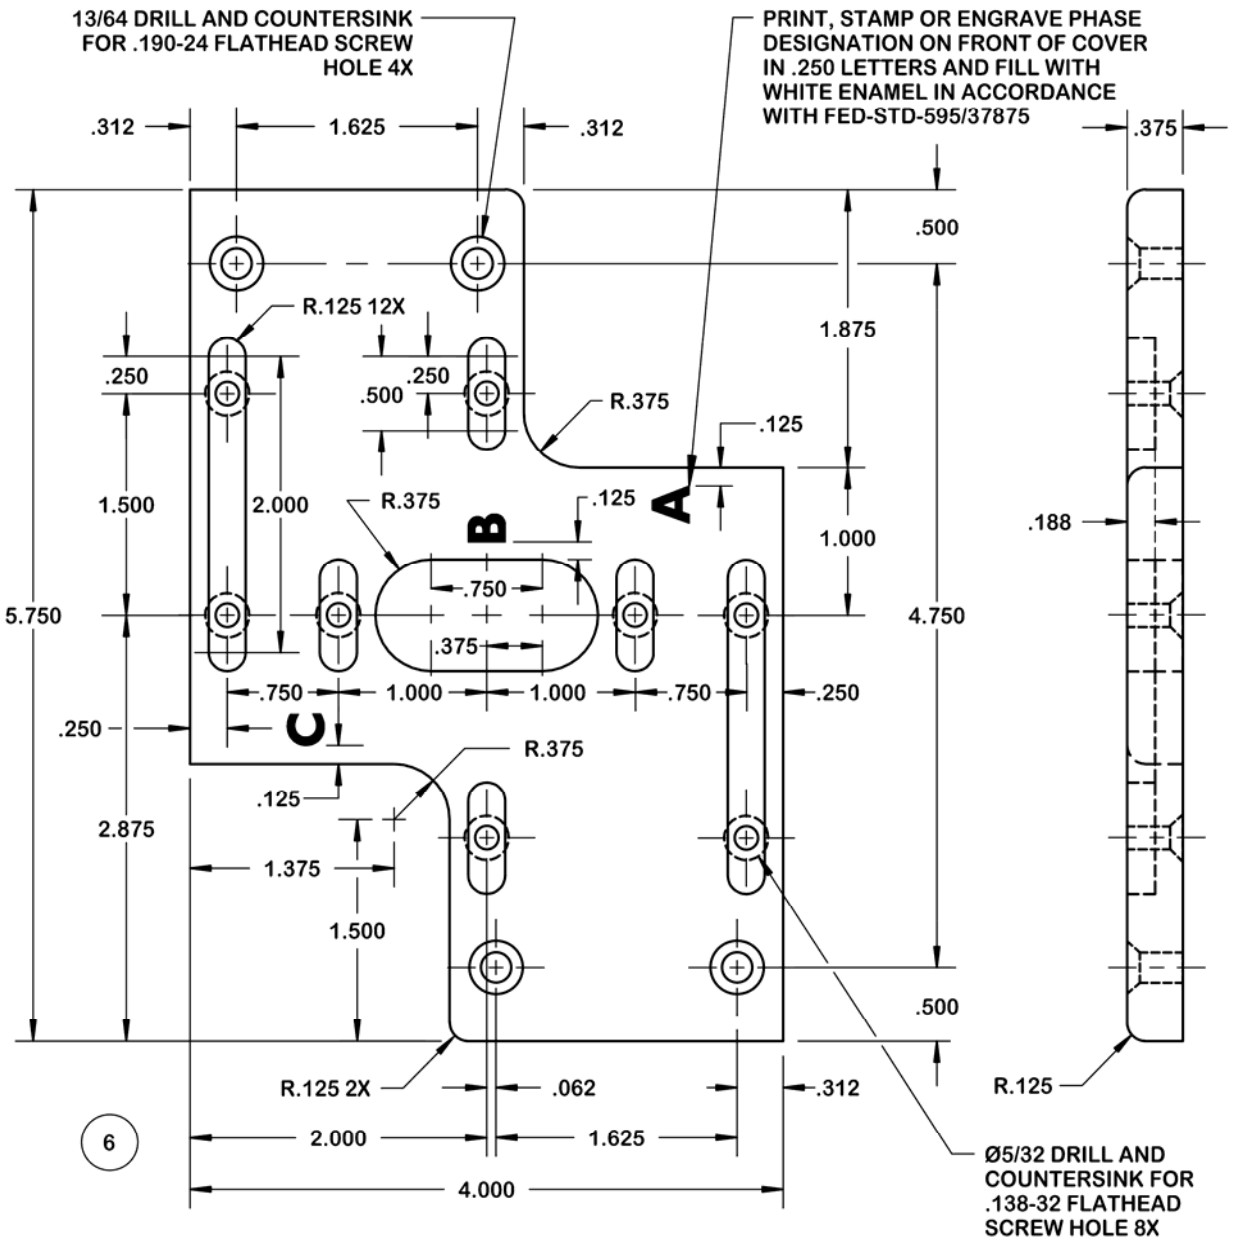


FIGURE 5. Terminal bus cover.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

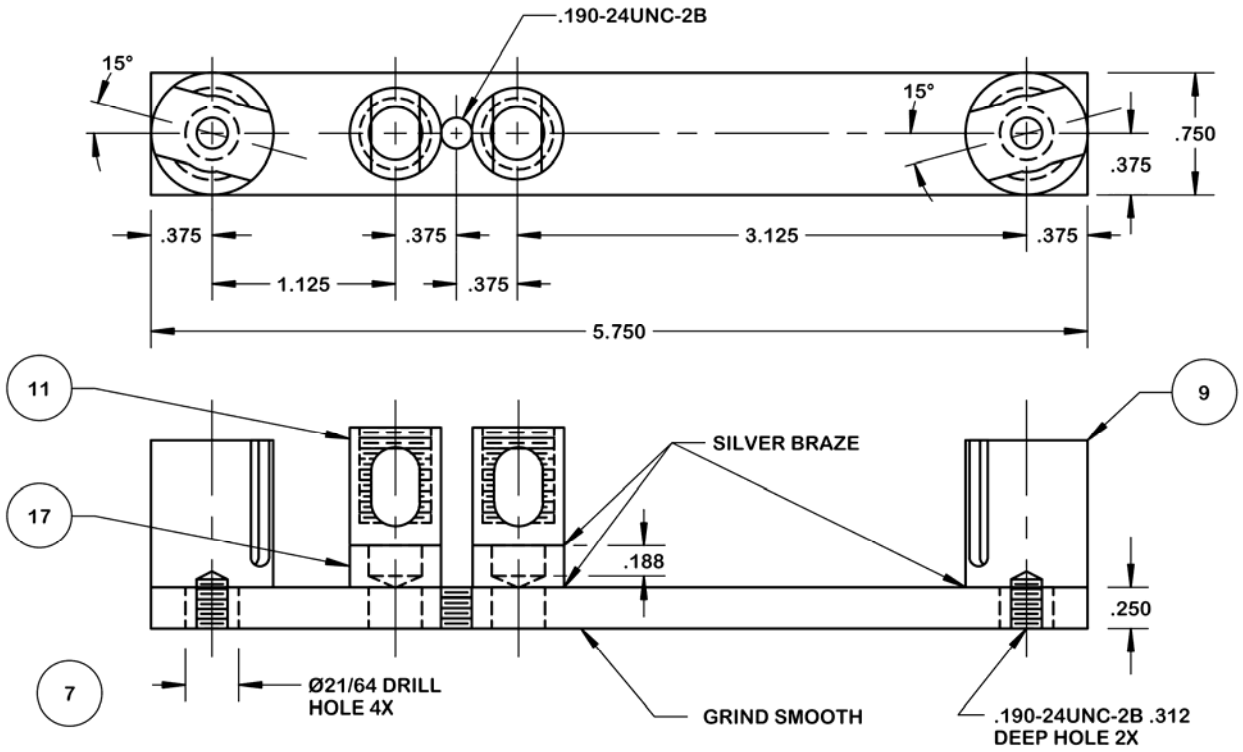


FIGURE 6. Terminal bus assembly - phase "A" and "C".

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

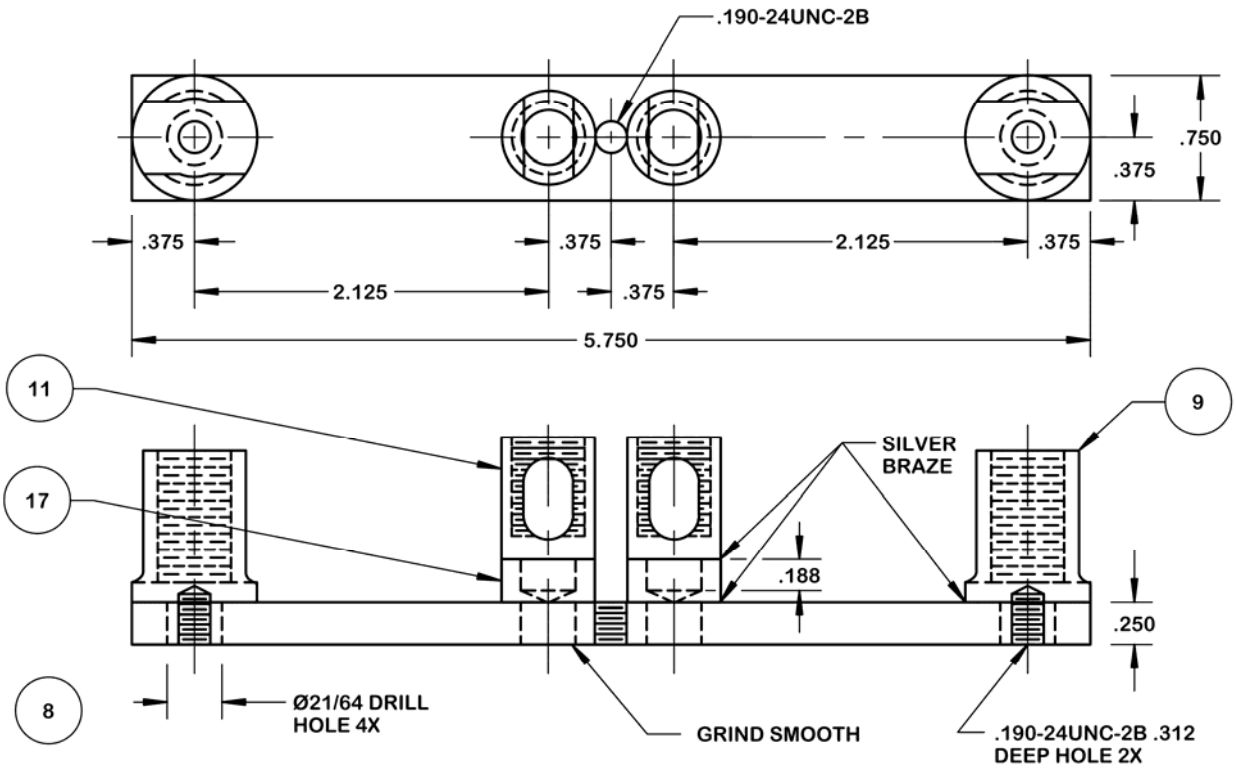


FIGURE 7. Terminal bus assembly - phase "B".

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

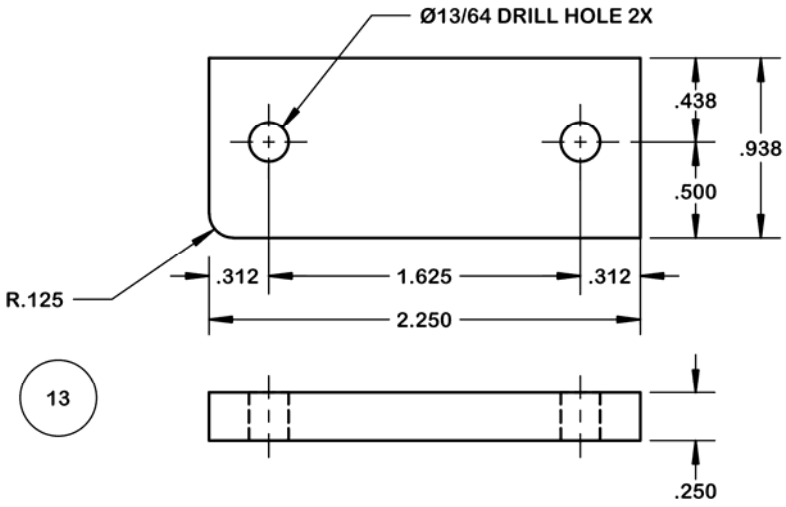


FIGURE 8. Terminal board spacer.

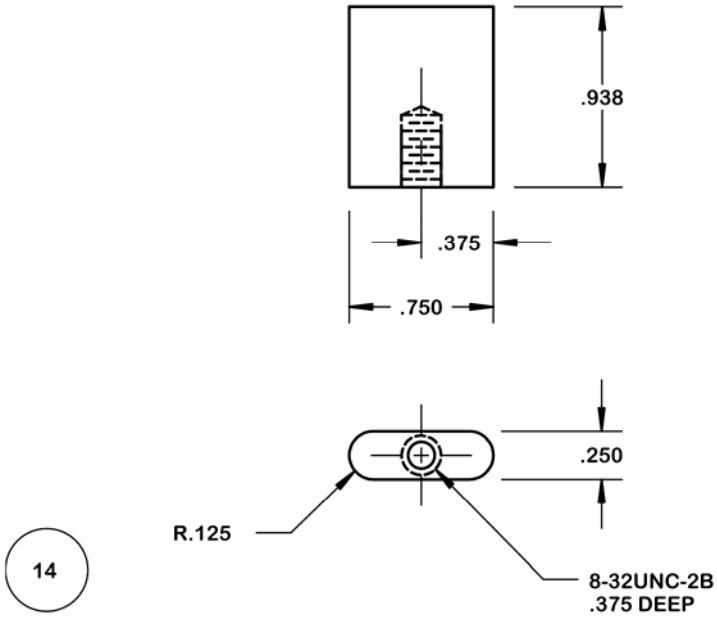


FIGURE 9. Barrier, 1-hole.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

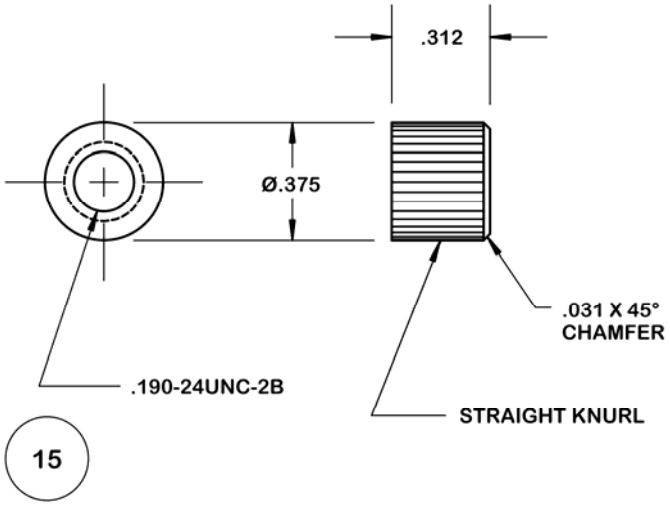


FIGURE 10. Insert.

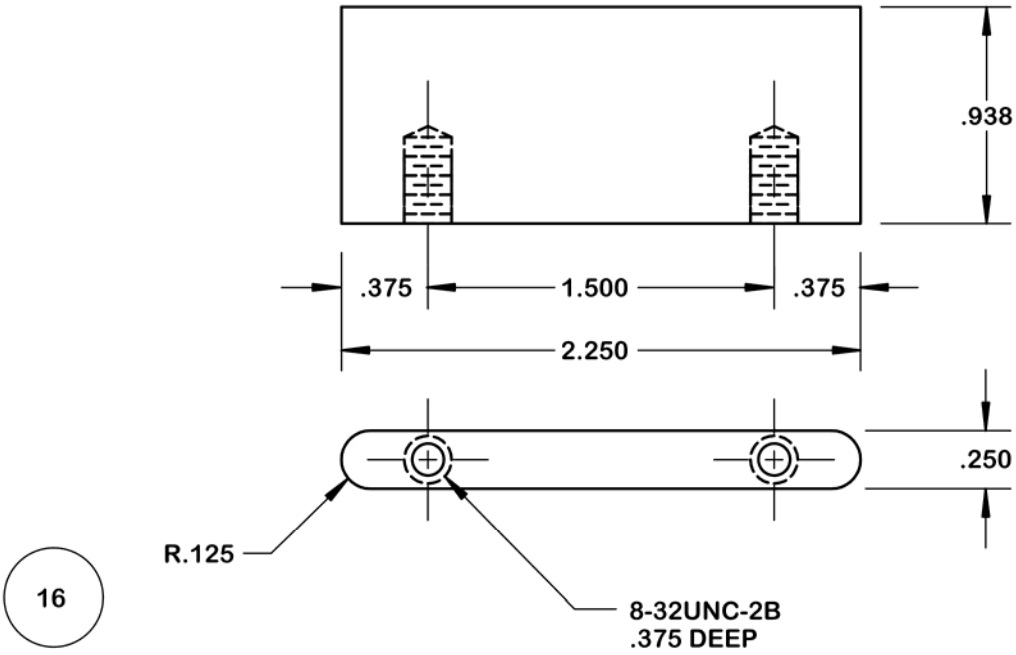


FIGURE 11. Barrier, 2-hole.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

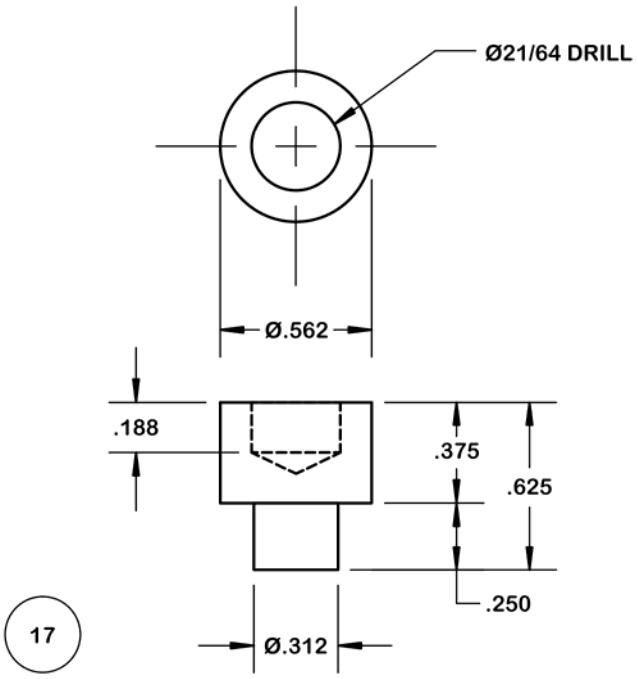


FIGURE 12. Spacer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.

CHANGES FROM PREVIOUS ISSUE. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extent of the changes.

Custodians:
Navy - SH
DLA - GS

Preparing Activity:
DLA - GS4

(Project 5940-2011-053)

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST database at https://assist.daps.dla.mil/.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T22:49Z
Check the source to verify that this is the current version before use.