INCH-POUND

MIL-C-29628(NU)
2 July 1991

MILITARY SPECIFICATION

COAT, WOMAN'S, BLUE, DRESS

This specification is approved for use by the Navy Clothing and Textile Research Facility, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for a woman's blue, single breasted, fused dress coat with body types and lengths.

1.2 Classification. The coat shall be of one type only in the following sizes (body types and lengths)(see 6.2).

1.2.1 Sizes.

Body type	Length
Juniors - J	Petite (Short) - P
Misses - No designation	Regular - R
Womens - W	Tall (Long) - T

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Officer in Charge, Navy Clothing and Textile Research Facility, Post Office Box 59, Natick, MA 01760-0001 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release, distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

Schedule of sizes

MISSES

Petite (P)	Regular (R)	Tall (T)
4	4	4
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20

WOMENS

Petite (P)	Regular (R)	Tall (T)
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18

JUNIORS

Petite (P)	Regular (R)	Tall (T)
10	10	10
12	12	12
14	14	14
16	16	16

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

C-F-206	- Felt Sheet, Cloth, Felt, Wool, Pressed
V-T-276	- Thread, Cotton
V-T-280	- Thread, Cotton, Gimp, Buttonhole
V-T-295	- Thread, Nylon
V-T-301	- Thread, Silk
NN-P-71	- Pallet, Material Handling, Wood, Stringer Construction, 2-Way and 4-Way (Partial)
DDD-L-20	- Label, For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-B-3461	- Button, Insignia, Metal, Uniform and Cap
MIL-P-15011	- Pallet, Material Handling, Wood, Post Construction, 4-Way Entry
MIL-P-15064	- Pads, Shoulder and Sleeve-head
MIL-B-17757	- Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-T-43548	- Thread, Polyester Core: Cotton-, Rayon-, or Polyester-Covered
MIL-C-43718	- Cloth, Polyester; Polyester and Cotton; Polyester and Rayon, For Pockets
MIL-C-44121	- Cloth, Twill, Polyester
MIL-C-44192	- Container, Shipping and Storage, Coat (Hanger Pack)
MIL-C-44296	- Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage
MIL-STD-147	- Palletized Unit Loads
MIL-STD-1608	- Provisions for Evaluating Quality of Coats, Women's, Dress
MIL-STD-2073-1	- DOD Materials Procedures for Development and Application of Packaging Requirements
MIL-STD-2073-2	- Packaging Requirement Codes

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094.)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this document to the extent specified herein. Unless otherwise specified, the issues are those cited in the solicitation.

U.S. POSTAL MANUAL

(Application for copies should be addressed to the Superintendent of Documents, U.S. Government Printing Office, Washington, DC 20402-0001).

CODE OF FEDERAL REGULATIONS

Title 9 - Animal and Animal Products

Part 95 - Sanitary Control of Animal By-Products

(Copies of the Code of Federal Regulations (CFR) and the Federal Register (FR) are for sale on a subscription basis by the Superintendent of Documents, U.S. Government Printing Office, Washington, DC 20402-0001).

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DOD adopted shall be those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association, ATTN: Traffic Department, 1616 P Street, N.W., Washington, DC 20036-1404).

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606-5808).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades for Sewing Threads

(Applications for copies should be addressed to The Color Association of the United States, 343 Lexington Avenue, New York, NY 10016-0927).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide sample. Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample in which case this specification shall govern.

3.2 First article. When specified, the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.2).

3.3 Material.

3.3.1 Basic material. The basic material for the coat shall be a 10 ounce polyester/wool blend tropical in shade Blue 3346, conforming to type III, class 3 of MIL-C-21115. The piece number for the standard sample is 4001369.

3.3.2 Lining. The material for lining the body and sleeves shall be a rayon twill, 3.7 ounce, shade Black 3202, conforming to class 1 of MIL-C-368. The piece number for the standard sample is 79221. As an alternate, the lining may be polyester twill cloth, Black 3202, conforming to MIL-C-44121. The piece number for the standard sample is 87034.

3.3.3 Interlining, fusible.

3.3.3.1 Fronts. The material for interlining the coat fronts shall be a fusible conforming to type II, class 1, style B of MIL-C-44296, except the minimum dots per inch shall be 200 or type VIII, class 1 of MIL-C-44296, except the weight shall be 2.1 oz/yd^2 ($\pm$ 0.5 oz) and the minimum dots per inch shall be 200. The color shall be Black.

3.3.3.2 Small parts. The material for interlining the lapel facing, topcollar, undercollar, top sleeves and undersleeves shall be a fusible conforming to type V, class 1, style A or B of MIL-C-44296. The color shall be Black.

3.3.3.3 Fused state bonding strength. The small parts and fronts fusible material for preproduction and in-process testing shall meet an initial minimum bonding strength requirement in the warp (machine) direction of 32 ounces per inch or splits prior to drycleaning when tested as specified in Table V, and minimum 24 ounces per inch or splits in the warp (machine) direction after three drycleanings and pressings when tested as specified in 4.4.3.1. Additionally the small parts fusible interlining will be accepted if it either begins to debond from the outer shell material, equivalent to the minimum bond strength or higher, and then splits from itself or if the small parts fusible readily splits from itself at a minimum tear strength of 6.0 ounces per inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.3.3.4 Colorfastness. All dyed finished fusible interlining materials shall show a fastness to drycleaning as specified in MIL-C-44296. As a limit of acceptability or when no standard sample is available, the finished fusible materials shall show "fair" colorfastness to drycleaning.

3.3.3.5 Shrinkage. The interlining, after fusing to the basic cloth as specified in 3.3.3.6, shall not exceed 1.5 percent differential shrinkage when tested as specified in 4.4.3.1. Additionally, the interlining after fusing to the basic cloth as specified in 3.3.3.6 shall not exceed 2.0 percent shrinkage after drycleaning when tested as required in 4.4.3.1. All drycleaned materials shall not exhibit any sign of bubbling, puckering or delamination.

3.3.3.6 Fusing press operating procedure and conditions. A single layer of fusible interlining shall be fused to a single layer of basic material on a dry electrically heated conveyor type fusing press which has the capacity of controlling and retaining pressure, dwell time, and temperature for a minimum of 8 hours. Pair or sandwich fusing which can create differential shrinkage, stitching and uneven bonding shall not be permitted. For optimum results, the fusible material manufacturers recommendations for fusing dwell time, pressure, and temperature, based upon the fusing equipment used and basic material being fused, shall be utilized. Basic preproduction and production maintenance procedures, including a fusing press information chart, shall be required to assure proper fusing press performance relative to temperature control, evenness in pressure head or roller contact, dwell time and cleanliness. Results of the production maintenance procedures shall be recorded on Figure 2.

3.3.4 Floating chest piece assembly.

3.3.4.1 Haircloth, synthetic. The synthetic haircloth for the chest piece shall have warp yarns made from 100 percent cotton, 100 percent polyester, any combination of polyester and cotton, or from 45 to 100 percent polyester with the remaining percentage rayon. The filling yarns shall be made from 100 percent nylon monofilament. The fabric shall contain not less than 50 ends and 42 picks per inch, and shall weigh not less than 5.6 ounces per square yard as specified in 4.4.1. The stiffness of the nylon filling shall be 0.13 (± 0.01) load pounds as specified in 4.4.1. As an alternate, chest piece may be 2-ply cotton warp and natural horsehair filling cloth, undyed, having not less than 60 ends and 40 picks per inch, weighing not less than 4.5 ounces per square yard, and containing no sizing when tested as specified in 4.4.1. The horsehair shall meet current Quarantine Laws and pertinent regulations of the U.S. Department of Agriculture as set forth in the Code of Federal Regulations.

3.3.4.2 Felt cloth. The felt piece for padding the chest shall be pressed wool conforming to type III (roll-felt), classification 11A2 of C-F-206.

3.3.4.3 Thread. The thread for seaming and stitching the floating chest piece assembly shall be cotton, soft finish, type IA1 or type IA2, shade White AH, C.A. 66050 in accordance with the Department of Defense Standard Shades for Sewing Threads, ticket No. 50 or 70, 2-ply, conforming to V-T-276.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

Pocketing. The material for the inside pocket and inside pocket stay shall be a twill cloth conforming to class 1 of MIL-C-43718. The shade shall be black and requirements for perspiration and crocking shall not apply. As an alternate for the inside pocket, the material may be a rayon twill or polyester twill as specified in 3.3.2.

3.3.6 Shoulder and sleeve-head pads. The shoulder pads shall conform to type III, class 1 and the sleeve-head pads shall conform to type IV of MIL-P-15064, except that the length shall be 12 to 13 inches.

3.3.7 Tapes.

3.3.7.1 Woven tape. The tape for staying the coat shall be preshrunk cotton, dyed or undyed, conforming to type I and II, and class 1, 2, or 3 of DDD-T-86. The types and widths of the tapes shall be as follows:

Type I - 3/4 inch wide stay for bridle at breakline of lapel
Type II - 3/16 inch wide stay for staying lower front and back armholes

3.3.7.2 Cross-cut tape. The tape for staying the front gorge, shoulder, top armhole (front and back), and back neck shall be dyed or undyed twill cloth conforming to class 1 of MIL-C-43718. The tape shall be cut across the width of the cloth in strips 1/2 (+ 1/16) inch wide. The raw edges of the cross-cut tape shall be treated with a synthetic resin to prevent ravelling (see 4.4.1).

3.3.7.3 Tape fusible. The tape for joining the fronts and facing shall be a natural color woven or non-woven tape with a thermoplastic polyamide resin. The tape shall be 5/8 inch wide (see 4.4.1). As an alternate, cross-cut tape may be used (see 3.3.7.2).

3.3.8 Hanger loop. The hanger loop shall be cotton tubular braid conforming to type III, class 1 of MIL-B-371, or shall be of the material specified in 3.3.2. The braid shall be dyed black and show good colorfastness to crocking and wet-dry cleaning (see 4.4.1).

3.3.9 Threads.

3.3.9.1 Polyester core. The thread used for seaming and stitching shall be a polyester core thread conforming to MIL-T-43548. A polyester-covered, polyester core thread is not allowed. The thread shall be dyed shade Black AA, Cable No. 66043 in accordance with the Department of Defense Standard Shades for Sewing Threads, in the following sizes except when the use of silk or nylon is indicated as an alternate in Table I:

Operation	Ticket No.	Ply
Seaming, stitching and tacking of coat	50, 70	2 or 3
Overedging, blindstitching, and machine felling	70	2 or 3
Button sewing (except automatic shank type - see 3.3.8.5)	30, 50	2 or 3
Buttonhole and bartack	30	2 or 3
Tacking armhole and attaching sleeve-head and pads	30 (white)	2 or 3

Source: https://assist.dla.mil - Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.3.9.1.1 Cotton thread. As an alternate to 3.3.8.1, a cotton thread, dyed Black AA, Cable No. 66043 in accordance with the Department of Defense Standard Shades for Sewing Threads, conforming to V-T-276 may be used in the following sizes and types:

Operation	Type	Ticket No.	Ply
Seaming, stitching, tacking	IC2	50	3
Overedging, blind-stitching, felling	IC2	70	2 or 3
Button sewing	IA3 or IB3	30	3
Buttonhole and bartack	IC2	30	3
Tacking armhole and sleeve head	IA1 or IA2	30	3

3.3.9.2 Basting thread. The thread for basting and tacking shall be a good commercial grade, bleached or unbleached cotton. As an alternate, the covered thread specified for seaming in 3.3.9.1 may be used or a soluble monofilament synthetic thread may be used only for those basting operations where the thread is required to be removed, providing the garment is subsequently given a treatment by a dry-cleaning agent in which the synthetic thread is soluble. When this soluble thread is used, any residue remaining on the garment after the dry-cleaning process shall be brushed off or removed.

3.3.9.3 Silk thread. The silk thread shall be dyed shade Black AA, Cable No. 66043 in accordance with the Department of Defense Standard Shades for Sewing Threads, conforming to V-T-301 in the following types and sizes:

Use	Type	Ticket No.	Ply
Machine stitching	I	0	3
Hand or machine felling	III	A, C	2

3.3.9.4 Nylon thread. Nylon threads may be used as alternates to silk threads or for the operations indicated below:

a. For machine blind stitching and felling - nylon thread conforming to type III, size A/1 or AA/1 of V-T-295.

b. For hand felling - nylon thread conforming to type IV, size A/2 or C/2 of V-T-295.

3.3.9.5 Automatic button sewing. If an automatic machine which sews shank buttons imitating hand sewing is used, the thread shall be nylon waxed monocord, special No. 4, having a breaking strength of 11 pounds and a minimum length per pound of 3,250 yards and shall be tested for these requirements in accordance with test methods outlined in V-T-295.

3.3.9.6 Colorfastness of threads. The dyed threads shall show colorfastness to wet-dry cleaning and light equal to or better than the standard sample when tested as specified in V-T-276, V-T-295, V-T-301, and MIL-T-43548. As a limit of acceptability or when no standard sample is available, the dyed threads shall show good colorfastness to wet-dry cleaning and light when tested as specified in V-T-276, V-T-295, V-T-301, and MIL-T-43548.

Source: https://assist.dla.mil -- Downloaded: 20260-21T01:17Z
Check the source to verify that this is the current version before use.

3.3.10 Gimp. The gimp for reinforcing the buttonholes shall be cotton gimp buttonhole thread conforming to type I or II, size No. 8 of V-T-280. The gimp shall be dyed Black.

3.3.10.1 Colorfastness. The dyed gimp shall show colorfastness to wet-dry cleaning equal to or better than the standard sample when tested as specified in V-T-280. As a limit of acceptability or when no standard sample is available, the dyed gimp shall show good colorfastness to wet-dry cleaning when tested as specified in V-T-280.

3.3.11 Buttons. The silver plated oxidized finish metal buttons for the front shall be type I, style 4, class C, 35-ligne, hopper back conforming to MIL-B-3461.

3.3.12 Labels.

3.3.12.1 Combination label. Each coat shall have a combination personal/identification/instruction label conforming to type VI, classes 10 and 14 of DDD-L-20. The label shall measure not more than 1-7/8 inches in width by 3-1/4 inches in length. The printing shall show colorfastness to dry cleaning and shall bear the following inscription:

NAME:
SERVICE NO:
COAT, WOMAN'S, BLUE, DRESS
FIBER CONTENT: 55% POLYESTER/45% WOOL
CONTRACT NO: DLA-100-00-0-0000 (EXAMPLE)
NAME OF CONTRACTOR:
NAME OF MANUFACTURER (If other than contractor)

DRY CLEAN ONLY

3.3.12.2 Size label. Each coat shall have a separate size label conforming to type VI, class 2 of DDD-L-20 which shall indicate the size and stock number.

SIZE: 12 JP (EXAMPLE)
STOCK NO: 8410-00-000-0000 (EXAMPLE)

NOTE: Abbreviations for the applicable body types shall be "J" for Juniors and "W" for Womens. Abbreviations for the applicable lengths shall be "P" for Petite, "R" for Regular, and "T" for Tall.

3.3.12.3 Removable size ticket. Each coat shall have a commercial type size ticket attached on the outside of the lower left sleeve. The ticket shall be 3 inches long and 1 inch high, made of a suitable plain white cardboard. The corners of the ticket may be double perforated for ease in tacking. The size (12 JP - Example) shall be printed or stamped on the upper left hand corner in black or blue ink. The lettering for the size shall be 1/4 inch in height. Abbreviations for body types and lengths shall be allowed in accordance with 3.3.12.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.4 Design. The fully lined single breasted (split front style) woman's coat has fusible interlining, two outside breast pocket flaps, one inside pocket on lower right, rounded collar ends overlapping half-peaked lapels, two piece set-in sleeves, and is buttoned on the left side with four silver plated Navy eagle buttons (see Figure 1).

3.4.1 Figure. The figure is furnished for information purposes only. To the extent of inconsistencies between the written specification and the figure, the written specification shall govern.

3.5 Patterns. Standard patterns to be used to cut working patterns will be furnished by the Government (see 6.3). The working patterns shall be identical to the Government patterns. Neither the Government patterns nor the working patterns shall be altered in any way, except that additional notches for use during construction are permitted on the working patterns. Minor modifications are permitted where necessary when using automatic equipment. These modifications shall not alter the appearance, serviceability, or dimensional requirements cited in the specification. The patterns provide a 3/8 inch allowance for all seams, except 5/8 inch for joining side seams and 1/2 inch for attaching undercollar to neckline of coat. Unless otherwise indicated in Table I, seams shall be in accordance with these seam allowances.

3.5.1 Pattern parts. The component parts shall be cut from the materials as specified, and in accordance with the following list of pattern parts:

Material	Pattern Parts	Cut Parts
Cloth, tropical, polyester/wool	Front	2
	Side front	2
	Side back	2
	Back	1
	Front facing	2
	Top sleeve	2
	Undersleeve	2
	Topcollar	1
	Undercollar	1 1/
	Pocket flap	4
Cloth, lining	Front lining	2
	Side back lining	2
	Back lining	2
	Top sleeve lining	2
	Undersleeve lining	2
	Pocket welt and facing	1
Cloth, twill	Pocket	1
	Pocket stay	1
Cloth, fusible (fronts)	Front, center interlining	2
	Side front interlining	2
Cloth, fusible (small parts)	Lapel facing interlining	2
	Topcollar interlining	2
	Undercollar interlining	1 1/
	Top sleeve interlining	2
	Undersleeve interlining	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

Material	Pattern Parts	Cut Parts
Haircloth, synthetic	Chest piece	2
Cloth, felt	Chest padding	2
Templates	Undercollar shaper (working)	-
	Lapel shaper (working)	-
	Undercollar stand marker	-
	Finished pocket flap	-
	Finished lapel	-
	Finished collar	-

1/ Pattern may be cut in two pieces with seam allowances added.

3.6 Construction.

3.6.1 Stitches, seams, and stitchings. Stitch, seam, and stitching types as specified in Table I shall conform to the requirements of FED-STD-751. Whenever two or more methods for seam or stitch types are given for the same part of the operation, any one may be used. Seam allowances shall be maintained with seams properly sewn so that no raw edges, runoffs, twists, pleats, puckers, or open seams result. All seams shall start and finish evenly. Thread tension shall be maintained so there is not tight or loose stitching. Where stitch type 401 is used, the looper (under thread) shall be on the inside of the coat. Ends of all seams produced by stitch type 401 shall be caught in other seams or stitching. The bight of the overedge stitching shall be 3/16 inch. The use of a trimming knife in the overedging is prohibited. Buttonholes shall be cut clean and the stitching shall be securely caught in the fabric. The bartacks shall be 3/8 to 1/2 inch long and 1/8 (± 1/32) inch wide.

3.6.2 Thread breaks and ends of seams. Ends of all seams and stitchings, when not caught in other seams or stitchings, shall be backtacked not less than 3/8 inch. The ends of a continuous line of stitching (except label) shall be overlapped not less than 1/2 inch. The ends of the label stitching shall be overlapped not less that 3 stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks of 401 stitching shall be repaired by using 301 stitch type.

3.6.3 Stitches per inch. The minimum and maximum number of stitches per inch shall be as specified in Table I.

3.7 Manufacturing operations requirements. The items shall be manufactured in accordance with operation requirements as specified in Table I. The contractor is not required to follow the exact sequence of operations provided the finished items are identical to those produced by following the sequence of operations as listed in Table I. Minor modifications are permitted where necessary when using automatic equipment. These modifications shall not alter the appearance, serviceability, or dimensional requirements cited in the specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.7.1 Pressing. All pressing operations referenced in Table I shall be performed by using a heated pressing iron or steam pressing machine designed specifically for pressing operations being performed. Any additional under pressing to facilitate manufacture is permissible. Fusibles shall be applied in accordance with the fusible manufacturer's recommended time, temperature, and pressure settings and in accordance with good commercial practice.

3.7.2 Shade and size marking. The component parts of the coat shall be marked or ticketed to insure a uniform shade and size throughout the garment. The following methods are not permitted:

(1) Corrosive metal fastening devices.
(2) Metal devices or sew-on type markings on lining pieces.
(3) Adhesive type tickets which discolor or adhere to the material upon removal of tickets.

NOTE: The use of ink pad numbering machine, rubber stamp or pencil is allowed, provided the numbering does not show on the outside of the garment and wherever possible, is covered by the seam allowance.

3.7.3 Abbreviations in table of operations. The abbreviations used in Table I are as follows:

Stch	-	Stitch
in	-	inch
Ndl	-	Needle
Bob	-	Bobbin
Lpr	-	Looper
Mchne	-	Machine
Brtck	-	Bartack
Comrcl	-	Commercial
smlr	-	similar
Btnhl	-	Buttonhole
incl	-	including
dbl	-	double
chnstch	-	chainstitch

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
1.	Cutting. a. Spread the material without tension having one side of the lay even. The plies shall not be stretched or pulled. b. Cut the coat parts in strict accordance with patterns furnished which show size, placement of component parts, warp directional lines for cutting, and notches for the proper assembly of all parts. The directional lines shall be placed in the warp direction of the cloth unless otherwise indicated on the pattern. The cut parts from the top and bottom plies shall match and correspond to the pattern. The use of drill marks to position pocket flap are prohibited. Perforated paper markers are prohibited on the basic fabric. Felt back paper markers are permitted. c. All polyester/wool parts shall be cut from one piece of material, except the undercollar which may be cut from ends and when so cut shall approximately match the main assembly. When the undercollar is cut from ends, the two parts shall be shade marked and match each other. d. All lining parts shall be cut from one piece of material, except the sleeves which may be cut from ends and when so cut shall approximately match the main lining assembly. When pairs of sleeves are cut from ends, the pairs shall be shade marked and match each other. e. Cut all other component parts listed in 3.5.1 as indicated by patterns from the material specified.				
2.	Replacement of defective components. During the spreading, cutting, and manufacturing process, components having material defects or damages that are classified as defects in MIL-STD-1608 shall be removed from production and replaced with non-defective and properly matched components.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
3.	Size and shade marking. (see 3.7.2) a. All parts shall be marked or ticketed to assure a uniform shade, size, and proper assembly throughout the coat. Parts cut from ends need not be marked or ticketed, however, they shall approximate the main assembly. b. Identify test swatches (basic material and fusible interlining) that represent the every 1000 coat units of production (see 4.4.3.1).				
4.	Fuse interlinings. a. Fuse small parts and fronts for fusible test swatches. NOTE: Fused lots and test swatches shall be allowed to cool to the touch prior to bundle tying or testing. b. Fuse front interlining 1/8 inch back of front edges. c. Fuse side front interlining to side front with armhole even, matching armhole notch and with interlining 5/8 inch from side seam. d. Fuse lapel facing interlining to the front facing with front edge of lapel interlining 1/8 inch back from facing edge. e. Fuse topcollar interlinings at ends of topcollar, 1/8 inch back from topcollar edge, leaving center back free of interlining. f. Fuse undercollar interlining to undercollar, centering interlining. (If two piece undercollar is used, see operations 21b(1), (2), and (3). g. Fuse top sleeve interlining and undersleeve interlining pieces to top sleeve and undersleeve with notches aligned and centered.				
5.	Make fronts. a. Each two piece front shall consist of a fused front and fused side front with a slit dart. The bust lines on both sides shall be alike.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	b. Form and stitch a slit dart in each side front as indicated by marks on pattern. The point shall taper to nothing and dart shall be slit to 1/2 inch of point.	301	OSf-1	10-14	50	50
	c. Press dart open and flat.					
	d. Seam fused front and side sections face to face, working in bust fullness between notches.	301	SSa-1	10-14	50	50
	e. Press seams open and flat maintaining contour and without stretching seam.					
	f. Position cross-cut staying tape 1/8 to 1/4 inch below front gorge, across shoulder, and approximately 4 inches along top of front armhole. Place tape approximately 3/4 inch from edge of corners. Stitch along top edge of tape.	301	SSaa-1	10-14	50	50
	g. Holding a 3/16 inch wide woven tape (see 3.3.7.1, type II) taut, stitch along the lower front armhole extending approximately 1/2 inch from the side seam allowance to the cross-cut staying tape (see operation 5f). Cross-cut tape and 3/16 inch woven tape should abut.	301	SSaa-1	10-14	50	50
	h. Presstaped areas, shrinking out fullness where tape was held taut.					
6.	Make and attach pocket flaps.					
	a. With face sides together, stitch pocket flap together 1/4 inch from raw edge and leave the top (straight) edge open. Trim seamed edges, corners and turn to finished position forcing out edges and corners.	301	SSa-1	10-14	50	50
	b. Press pocket flaps smooth and flat.					
	c. Overedge stitch raw edges together.	503 504 or 602	EFd-1	8-10	70	70
	NOTE: Care shall be taken to prevent stretching when overedging, resulting in the ends protruding beyond the sides of flap when stitched to coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	d. Mark seamline on top edge of flap to conform with finished pocket flap template, measuring 1-3/4 to 2 inches for all sizes.					
	e. Mark pocket flap position on fronts as indicated by marks on pattern.					
	f. Place pocket flap on front with bottom finished edge facing shoulder. Stitch top edge along the marked seamline.	301	LSbk-1(a)	10-14	50	50
	g. Turn pocket flap down and blindstitch underside of flap to front of coat, 1/4 inch from seam line.	Hand or Machine			commercial	
	h. Vertically tack corners 1/4 inch down from top folded edge.	301	smlr to LSbk-1(b)	12-14	50	50
	i. The size and shape of the pocket flap shall conform to the finished breast pocket flap template.					
7.	Make floating chest piece assembly.					
	a. Lay haircloth chest piece on top of felt chest padding matching notch at armhole.					
	b. Quilt haircloth and felt together with rows of stitching 3/8 to 3/4 inch apart, leaving shoulder portion open to accommodate the shoulder pad.	304		4-8	70	70
8.	Make backs.					
	a. The back shall consist of a back and two side sections joined without gathers, puckers, or pleats.					
	b. Position a cross-cut staying tape 1/8 to 1/4 inch below back neck edge from shoulder seam to shoulder seam, and another approximately 4 inches along the top of back armhole, 3/4 inch back from corners. Stitch along top edge of tape.	301	SSaa-1	10-14	50	50
	c. With face sides together, stitch side back pieces to center back, according to notches on pattern.	301	SSa-1	10-14	50	50
	d. Press seams open and flat, maintaining contour and without stretching seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	e. Hold 3/16 inch wide woven tape (see 3.3.7.1, type II) taut and stitch along the lower back armhole extending the tape approximately 3/4 inch from the side seam to the cross-cut stay tape. The cross-cut stay tape and the 3/16 inch wide woven tape should abut.	301	SSaa-1	10-14	50	50
	f. Press taped areas, shrinking out fullness where tape was held taut.					
9.	Prepare front lining.					
	a. Fold and stitch a slit dart in each front lining as indicated on pattern. Points shall taper to nothing and dart shall be slit to 1/2 inch of point.	301	OSf-1	10-14	50	50
	b. With face sides together, stitch front lining to front facing ending the seam 1 to 1-1/2 inches above the bottom of facing-lining assembly, thus facilitating hem felling operation.	301	SSa-1	10-14	50	50
	OR					
	As an alternate, front lining may be stitched to facing all the way to bottom provided spot tacking is performed by machine (see operation 28c).					
	c. Press seam joining front lining to facing, and front dart toward side seam.					
10.	Make inside pocket and attach label.					
	a. There shall be an inside double piped pocket located on right side of coat as indicated by marks on patterns.					
	b. Position pocket welt and facing piece on pocket matching fold lines. Turn under edges of welt and facing piece 1/4 to 3/8 inch and stitch 1/8 inch from folded edge. Selvage need not be turned under. Top edge of the combination label shall be centered, inserted, and caught under the edge of the pocket welt; printing on label shall not be obscured.	301	LSd-1	10-14	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	c. Stitch the remaining three sides of label to pocketing. Label shall be located on the pocket ply next to the coat front. As an alternate, stitch the four sides of label to pocket piece with the top edge of label overlapping pocket welt/facing piece.	301	LSbj-1	10-14	50	50
	d. Position pocket assembly on facing/lining assembly with pocket stay centered on underside of facing/lining assembly according to pocket marks on patterns. Forming 3/16 inch welts, stitch around pocket marks, making a 4-1/4 (±1/4) inch pocket opening.	301	smlr to LSbt-1(a)	10-14	50	50
	e. Cut opening of pocket through pocket facing/lining assembly and stay piece midway between the two rows of stitching; tongue notch the ends of opening and turn pocket piece through opening.					
	f. Form bottom welt by turning seam allowance up into it and topstitch bottom of welt with outer ply of pocket turned upward.	301	LSq-2(b)	10-14	50	50
	g. Fold outer ply of pocket down to finished position. Topstitch ends and top of welt with tongue notch at each end turned under and seam allowance at top of pocket turned downward.	301	LSq-2(b) (shows finished seam at top of pocket opening)	10-14	50	50
	h. Stitch pocket piece at sides securely tacking corners through tongue notch and bottom rounding the corners. The back part of pocket shall be held taut to prevent gapping of pocket opening.	301	SSa-1	10-14	50	50
	i. The finished inside pocket shall measure 4-1/4 (±1/4) inches wide, 5 inches deep and shall extend into the facing 1/2 (±1/8) inch.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
NOTE:	As an alternate, the above pocket opening operations may be accomplished with a double piped pocket machine which stitches, cuts, and turns piped edges in one operation. When this machine is used, the piped piece may be trimmed to permit insertion into the machine. Ends of pocket opening shall be securely tacked. In addition, when this machine is used, the contractor may utilize the machine manufacturer's recommended pocket stay material in addition to the specification material. Close top of pocket on the inside by stitching across the joining seam of top piped piece through all plies.	101 and 301		10-14	A-cotton 50	50
11.	Join back lining.					
	a. Back lining shall consist of two center back and two side back sections.					
	b. With face sides together, join center back seam.	301	SSa-1	10-14	50	50
	c. With face sides together, join side back sections to center back.	301	SSa-1	10-14	50	50
	d. Press side back seams flat, towards center back. Press center back seam towards right side back.					
12.	Join fronts and back linings at sides.					
	a. With a 5/8 inch seam, join the fronts to back at sides.	301	SSa-1	10-14	50	50
	b. Press side seams flat, towards center back.					
13.	Attach floating chest piece assembly to fronts.					
	a. Position floating chest piece assembly on underside of front with haircloth facing the fused interlining. Keep assembly slightly full in order to support the form and shape of fronts.					
	b. Align shoulder of coat front and floating chest piece assembly. Baste through front and floating chest piece assembly parallel to breakline of lapel.	Hand or 301		2-4 or 4-6	50 50 or Commercial	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	c. On outside, baste front to floating chest piece assembly across shoulder and along armhole, allowing room for placement of shoulder pad. The felt padding shall be trimmed along the shoulder so that it will not be caught in the shoulder seaming of coat (see operation 20a).	Hand or 301			50 50	50 or commercial
	d. Position 3/4 inch wide bridle stay tape (type I) over chest piece assembly with the front edge of stay tape within 1/4 inch on the inside of breakline of each lapel from gorge to 1-1/2 inches from bottom of lapel (see 3.3.7.1). Baste stay tape even and smooth for a distance of 3/4 to 1 inch from gorge, then hold tape taut to work in not less than 1/4 inch or more than 3/8 inch breast fullness. The balance of tape shall be basted without tautness or fullness. Stay tape and chest piece assembly shall be stamp marked to assure proper amount of fullness.	Hand or Machine			50 50	50 or Commercial
	e. Blindstitch bridle stay tape along both edges.	103 or 306	SSm-2	4-8	70 70	70
14.	Join fronts and backs at sides. a. With face sides together, join fronts to backs at sides with 5/8 inch seam. The interlining shall not be caught in stitching.	301	SSa-1	10-14	50	50
	b. Press seams open and flat.					
15.	Press fronts. Individually press front edge, lapel and bust of right and left fronts on a women's right and left form steam pressing machine.					
16.	Shape lapels and fronts. a. Mark and shape lapels in accordance with lapel shaper and trim lapel. If necessary, front and bottom frayed edges may be trimmed.					
	NOTE: As a guide, place lapel shaper with breakline indication 1/2 inch from neck edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	b. Mark the bottom turn up 1-1/8 (± 1/8) inches.					
17.	Baste and join facings to front.					
	a. Match, fit and baste facings to each front putting in proper lapel and bust fullness. The facings shall be held slightly taut at bottom edges of fronts. Trim facing edge along front and lapel even with front to gorge notch.	Hand or Machine			Commercial	
	b. With face sides together, seam facing to front while stitching a 5/8 inch fusible tape (see 3.3.7.3) to edge of front extending from lapel notch, across top of lapel, down front and across bottom to a point 2 to 3 inches beyond back edge of facing. The seam allowance for stitching across top of lapel and down the front is 1/4 inch. The fusible tape shall be sewn smoothly and slightly loose along lapel edges without material take-up, and held taut from bottom of lapel breakline to bottom edge. The tape must be pressed and fused to the fused interlining and the back edge of the tape shall not be blindstitched to the fused interlining.	301	SSab-1 and OSa-1	10-14	50	50
	d. Pull basting threads and press edge seam open and flat.					
	e. Notch corner of lapels, trim around rounded corner of lapels, bottom corners and front edges. Turn facing to finished position, work out lapels and bottom corner of fronts. The lapel shall conform to the finished lapel template.					
	f. Baste edges around coat from lapel step, turning up coat hem as marked and rolling the lapel seam to the underside and the joining seam toward the inside of coat along the front and bottom edges.	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	g. Approximately 1 inch from edge, baste facings along lapel fronts (second basting) to a point in line with top edge of flaps, while maintaining the inward roll along the lower front edge.	Hand or Machine			Commercial	
	h. Baste a row of stitching diagonally from lapel break to the point of lapel placing fullness in lapel to allow lapel to roll.	Hand or Machine			Commercial	
	i. Baste along breakline of lapel, allowing fullness in facing to permit lapel to roll.	Hand or Machine			Commercial	
	j. Baste back edge of facing putting fullness over bust.	Hand or Machine			Commercial	
	NOTE: Whenever possible reduce the basting tensions to reduce the pull on the fabric during basting. The smallest size needles and thread should be used (see 6.8).					
18.	Tack facings to front interlining. Tack the inner edge of facings through the floating chest piece assembly with one row of blindstitching from not more than 2-1/2 inches from shoulder seam to bottom of fused front.	Hand or 103 or 306	 SSm-1 SSm-1	2-4 4-6 4-6	50 50 50	 50
19.	Fit and baste body lining to coat. a. Beginning at the inner edge of facing, approximately 3 inches above finished edge of coat, baste lining fronts across bottom, up side seam (seam on seam) to approximately 4 inches below pit of armhole, then diagonally upward forming a front shoulder dart pleat in accordance with marks on pattern with the outside fold of pleat facing the armhole.	Hand or Machine			Commercial	
	b. Baste lining back by joining basting at pit of armhole at side seam, diagonally upward to center back neck edge, taking in excess material and forming a back pleat with the folded edge of the pleat facing the right front of coat (as worn).	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	c. Blindstitch complete bottom turn up of coat.	Hand or 103 or 306	EFl-1 EFl-1	8-10 6-8 6-8	A or C (silk) 0 (silk) 0 0 (silk)
	d. Baste back pleat from neckline to bottom edge of lining. Pleats in lining must be pressed prior to removing basting threads.	Hand or Machine			Commer-cial
	e. Trim facing at neck gorge, and lining at armholes, shoulders and trim lining along the bottom edge of coat.				
	f. Fold bottom edge of lining under approximately 1 inch and position fold 1/2 inch in from finished bottom of coat and baste allowing room for the felling operation.	Hand or Machine			Commer-cial
20.	Join shoulder seam.				
	a. Join shoulder seams of front and back smoothly easing in proper fullness on back and preventing distortion.	301	SSa-1	10-14	50 50
	b. Press shoulder seams open and flat without stretching seam.				
21.	Make collar.				
	a. The topcollar assembly shall consist of a one-piece topcollar of basic material with interlining fused to the ends. The undercollar assembly shall consist of a one or two-piece undercollar of basic material with a one or two-piece fused interlining.				
	NOTE: Both the undercollar and fusible undercollar interlining may be two pieces with seam allowances added. Both shall be cut on the bias.				

Source: https://assist.dla.mil -- Downloaded: 202610-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	b. When the two-piece undercollar assembly is used:					
	(1) With face sides together, stitch 3/8 inch seam along center back of undercollar.	301	SSa-1	12-14	50	50
	(2) Press seam open and flat.					
	(3) Overlap undercollar interlining pieces approximately 1/2 inch at center back and fuse to undercollar.					
	c. To assure correct size and shape, mark undercollar in accordance with the applicable sized undercollar shaper. Position neck edge of undercollar stand marker even with neck edge of undercollar and mark breakline. Trim both plies of material.					
	d. Stitch undercollar assembly on breakline, according to marks made with undercollar stand marker (see operation 21c).	301 or 401	SSv-1 SSv-1	10-14 10-14	50 50	50 70
	e. With face sides together, superimpose center back seam of undercollar to center of topcollar. Baste top edge of undercollar along straight edge of topcollar, distributing proper topcollar fullness. Baste a second row of stitching along breakline and ends of collar.	Hand or machine			Comrcl	
	f. Stitch the undercollar to topcollar 1/8 inch from edge, on the inside of the marked line (see operation 21c).	301	SSa-1	10-14	50	50
	g. Trim excess topcollar even with the undercollar. As an alternate, the stitching and trimming of excess topcollar may be performed in one operation.					
	h. Clip to seam allowance, turn, and baste neck edge of undercollar over the interlining between the outer notches (steps) leaving a 3/8 to 1/2 inch seam allowance on neck edge of topcollar.	Hand or machine			Comrcl	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	i. Trim neck edge of topcollar leaving a 1/4 inch seam allowance on gorge and extending 1 inch beyond the breakline, gradually working to 3/8 inch at center back.					
	j. Remove basting of breakline. Turn collar to finished position, force out top and rounded edges and baste around outer collar edge, rolling the edge of the topcollar to the underside.	Hand or machine			Comrcl	
	k. Flat press assembled collar.					
22.	Attach collar and hanger loop. Finished appearance: The collar shall roll on the finished coat and hug the neckline and the collar edges shall not curl. The collar shall cover the felled seam at the back and the undercollar shall not be exposed at the bottom edge. The collar shall conform to the finished collar template.					
	a. Seam topcollar to front facings at gorge to a point not less than 1 inch back of lapel breakline; notch seam allowance of gorge facing at end of stitching.	301	SSa-1	10-14	50	50
	b. Spread gorge seam open and tack to the chest piece assembly.	Hand or 301	 SSa-1	6-8 10-14	50 50	 50 or Commercial
	c. Baste undercollar to body of coat along neckline putting in proper fullness at shoulders.	Hand or Machine			Commercial	
	d. With hanger loop ends even with the neck edge, center hanger loop at back neck and stitch ends.	301		10-14	50	50
	e. Finished hanger loop shall measure 1-1/2 (± 1/4) inches between inner edges. When constructed of lining fabric, the loop shall finish approximately 1/4 inch wide.	301	EFp-2	8-10	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	f. Stitch lower edge of topcollar to coat across neck from gorge seam to gorge seam. (see operation 28e for alternate method).	301	SSa-1	10-14	50	50
23.	Make sleeves.					
	a. With face sides together, join forearm seam of sleeves 3/8 inch from edge, distributing fullness between notches.	301 or 401	SSbd-1	10-14	50 50	50 70
	b. Shape-press forearm seam open, without stretching.					
	c. Turn up sleeve bottom as indicated by pattern marks and baste along folded edge.	Hand or Machine	OSf-1		Commer-cial	
	d. Press bottom of sleeve and remove basting.					
	e. With face sides together, stitch backarm seam.	301 or 401	SSa-1	10-14	50 50	50 70
	f. Press backarm seam open and flat.					
	g. Blindstitch top of sleeve hem to fused interlining.	Hand or 103 or 306	SSm-1 SSm-1	2-4 4-6 4-6	50 50 50	 50
	OR					
	Tack seam allowance of topsleeves and under sleeves to fused interlining.					
	NOTE: Care should be taken that stitching does not show on the outside.					
24.	Make and tack sleeve lining.					
	a. With face sides together, join the forearm seam of the sleeve lining 3/8 inch from edge, distributing fullness between notches.	301	SSbd-1	10-14	50	50
	b. With face sides together, join backarm seam of sleeve linings.	301	Sa-1	10-14	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	c. The sleeve lining shall extend not less than 3/4 inch above top of sleeve. Tack forearm and backarm seam of sleeve linings to respective forearm seam and backarm seam of sleeves, distributing fullness in lining. The tacking shall extend from not more than 7 inches below top of sleeve to not more than 7 inches above creased bottom edge of sleeve.	Hand or 301		2-4 1/2 to inches in length 6-8	50 1-1/2 50 50 or Commercial
	NOTE: When tacking is done by hand, both ends of stitching shall be securely tacked with not less than 3 stitches.				
	d. Turn sleeve through lining and baste bottom turn up of sleeve lining. Sleeve lining shall have not less than 1-1/4 inch outlet at bottom. Turn sleeves to finished position and assemble in pairs.	Hand or Machine			Commercial
	e. Sleeves may be pressed prior to hanging to facilitate check on balance of sleeves during setting operation.				
25.	Join and press sleeve to armhole. Finished appearance: The sleeves shall hang alike with the front of each in the same relative position. Front and back shall have a rolled effect.				
	a. Set and stitch sleeves to armholes, notch to notch, distributing proper fullness so that there is no puckering, crooked seams, break or twist, fullness concentrated in one area, or front or back of sleeve too tight.	301	SSa-1	10-14	50 50
	b. Press seam flat, shrinking fullness around sleevehead using a suitably shaped pressing buck. Open seam and press across top from back notch to not less than 3 inches nor more than 4 inches forward of shoulder seam.				
26.	Set and tack shoulder pads. a. Center shoulder pads on each shoulder with edge of pad even with edge of armhole and securely tack to shoulder and armhole seam allowance.	Hand or 301		2-4 4-6	50 50 50 or Commercial

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
27.	Baste and tack armholes and sleeve heads.					
	a. Baste around outside of armholes placing lining, back end of shoulder, and shoulder pad in proper place; continue the basting along shoulder seam to gorge seam distributing fullness of lining at armhole and leaving shoulder lining free on the underside.	Hand or Machine			Commercial	
	b. Turn coat to lining side at shoulder and armhole; tack straight edge of each shoulder pad through sleeve armhole seam allowance.	Hand or 301		2-4 4-6	50 50	50 or Comrcl
	c. Lap and baste back shoulder lining over front shoulder lining properly distributing fullness between neck gorge and end of shoulder at armhole. Baste balance of back armholes.	Hand or Machine			Commercial	
	NOTE: In lieu of basting shoulder linings and hand felling in operation 28b, the shoulder seam may be stitched by machine.	301	SSa-1	10-14	50	50
	d. Tack all around armhole seam.	Hand or 301		2-4 4-6	50 50	50 or Commercial
	NOTE: When armholes are tacked by machine, a loose but properly formed and elastic stitch may be used, and when so tacked, operation 27e may be omitted. When armholes are tacked by hand, every other stitch shall be backstitched across the length of the shoulder pad.					
	e. Tack across base of armhole from sleeve notch on back to side seam.	301		4-6	50	50
	f. Having a minimum allowance of 3/8 inch, trim away excess lining, interlining, and shoulder pads.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	g. Tack sleeve head wadding to armhole from front sleeve notch to back seam of sleeve. The sleeve head wadding shall be positioned with the folded edge even with the edge of armhole, placing cloth side away from sleeve and in such a manner as to cause it to fold on itself. The tacking shall be adjacent to the armhole seam and fullness shall be evenly distributed. When armhole is tacked by machine, the sleeve head wadding shall be attached in the armhole tacking operation. When sleeve head waddings are tacked by hand, every other stitch shall be backstitched.	Hand or 301		2-4 4-6	50 50 50 or Commercial
28.	Complete felling.				
	a. Fell lining to armholes. When armholes are hand felled, backstitch pit of armhole from forearm seam to side seam. The sleeve lining shall be properly distributed and seam on seam with sleeve, or fell the top half of the armhole by blindstitch machine which utilizes the bobbin/bobbin case above the seam.	Hand or Machine (Hand type)		8-10 6-8	A or C (silk) A (silk)
	or				
	The sleeve lining may be stitched to the armhole on the inside from forearm seam of sleeve to the backarm seam across undersleeve.	301	SSa-1	10-14	50 50
	b. Fell lining at shoulder. See operation 27c Note for alternate machine method.	Hand		8-10	A or C (silk)
	c. Fell lower opening of facing-lining assembly and across bottom of lining 5/8 to 3/4 inch from inner edge of facing.	Hand		8-10	A or C (silk)
	OR				
	As an alternate, spot tack by machine approximately 1/2 inch from inner edge of facing when front lining is seamed all the way to bottom (see operation 9b).	Machine		6-8	0 0 (silk)
	d. Fell neck edge of undercollar to coat, securely hand tacking corners of undercollar to lapel at notch.	Hand or Machine (Hand type)		8-10 6-8	A or C (silk) A (silk)

Source: https://assist.dla.mil -- Downloaded: 202610-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	e. When hand felling, turn under lower edge of top collar and baste across back. Fell neck edge of topcollar from gorge seam to gorge seam, securely tacking coat hanger loop. (see operation 22f for alternate machine method).	Hand		8-10	A or C (silk)
	f. With the collar overlapping the lapel, fell undercollar to top of lapel (at notch and front end of undercollar) approximately 1-1/2 inches, making sure lapel ends at first buttonhole.	Hand		8-10	A or C (silk)
	g. Position bottom fold of sleeve lining approximately 1 to 1-1/2 inches from the finished bottom edge of sleeve and fell or blindstitch.	Hand or Machine		8-10 8-10	A or C (silk) 0 0 (silk)
	h. Fell or blindstitch lining to coat hem. The top ply of folded edge of lining shall not be caught in the stitching.	Hand or Machine		6-8 6-8	A or C (silk) 0 0 (silk)
29.	Press fronts and collar. Press front edges and collar prior to removing edge basting and buttonhole operation.				
30.	Mark and make buttonholes. a. All buttonholes shall be eyelet end, square bar, cut first type, reinforced with gimp having the stitching securely caught in the fabric, the gimp well covered and the ends of gimp pulled through to the underside. Buttonholes shall be clean and correctly positioned with the purling finishing on the outside.				
	b. The ends of all square bar type buttonholes shall be bartacked in a separate operation from buttonhole making, securely catching ends of gimp and covering the width of the bar. The bartack shall not be more than 1/4 inch long.	Bartack or Hand		2-22 per bartack 10-12 per tack	30 30

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
	c. Mark and sew four 1 to 1-1/8 inch horizontal buttonholes on right front in accordance with marks on pattern. The inside purled edge of each buttonhole eyelet shall be 5/8 (± 1/8) inch from the finished edge, vertically aligned and equally spaced.	But-ton-hole	Stitches per size: 1 inch 1-1/8 inches	53-60 60-70 (not including bartack)	30	30
31.	Clean coat.					
	a. Remove all bastings except edge bastings and lapel bastings which shall be removed after pressing edges.					
	b. All ends of stitching shall be trimmed and loose threads removed from the coat.					
	c. Remove all spots and stains.					
	d. Remove all shade tickets without injury to the material.					
32.	Press coat.					
	Finished appearance: The finished pressed coat shall be free of gloss, wrinkles, creases, spots and impressions from marking ticket, thread, seam or binding. The bust seam shall not break or "cave-in" below the shoulders. The sleeves shall be balanced and hang evenly. The sleeves shall not be creased. The collar shall be creased across the center back of the breakline and roll pressed to meet the lapel.					
	a. Press edge of lapels, fronts, collar and bottom of coat on edge pressing machine.					
	b. Press fronts on women's right and left front form pressing machine.					
	c. Sleeves shall be roll pressed.					
	d. Press balance of fronts, side seams, and back on a suitable pressing machine.					
	e. Press the breakline of collar 3-4 inches across the center back.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	f. Press collar on collar machine stretching outer edge of collar over shoulder area. Collar shall be neither too short nor too long.				
	g. Press lapels. The roll line of the lapels shall extend a uniform distance from the gorge seam. The lapels shall be roll pressed 1 to 1-1/2 inches below the gorge seam toward first button/buttonhole.				
	h. Press armholes and shoulders on an armhole machine. Shoulders may be pressed on a shoulder machine.				
33.	Finish pressing.				
	a. Finish press lining smooth and flat maintaining creased pleat at front shoulders and center back.				
	b. Remove gloss, wrinkles, creases and pressing impressions from under lapels, collar, and pocket flaps.				
	c. Touch up any areas missed by machine pressing.				
	d. Block armholes and shrink top of sleeve.				
	e. Place coat on hanger until thoroughly dry.				
	g. Brush coat.				
34.	Mark and sew buttons.				
	a. Hand or machine sewn buttons shall have the thread ends securely tacked off with not less than two stitches and the thread ends hidden.				
	b. All metal buttons shall be sewn with the eagle in the upright position.				
	NOTE: The button shall be measured from the center of its circumference.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

TABLE I - CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
	c. Mark and sew four 35-ligne short shank metal buttons on the left front 7/8 (± 1/8) inch from front edge corresponding with buttonholes on right front. Sew buttons through all plies of material.	Hand		4 per button (double thread)	50
		or 301		14-16 per button	50
		or 101		14-16 per button	50
		or 205		12 min. per button	No. 4 nylon
35.	Attach removable size ticket. Attach removable size ticket to the outside of lower left sleeve.	Hand or mchne		2-4 stches per tack 6-8 per tack	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.8 Sizes and measurements. Sizes and measurements of finished coat shall be as shown in Table II (see Figure 1). All measurements and tolerances are expressed in inches.

Table II - Sizes and measurements of coat

Size	Bust (A)	Waist (B)	Back Length (C)			Sweep (D)		
			Petite	Regular	Tall	Junior	Misses	Women
4	35-1/2	29	23-1/2	25	26-1/2	--	40-1/2	--
6	36-1/2	30	23-5/8	25-1/8	26-5/8	--	41-1/2	42-1/2
8	37-1/2	31	23-3/4	25-1/4	26-3/4	--	42-1/2	43-1/2
10	39	32-1/2	23-7/8	25-3/8	26-7/8	42-1/2	44	45
12	40-1/2	34	24	25-1/2	27	44	45-1/2	46-1/2
14	42	35-1/2	24-1/8	25-5/8	27-1/8	46-1/2	47	48
16	44	37-1/2	24-1/4	25-3/4	27-1/4	48-1/2	49	50
18	46	39-1/2	24-3/8	25-7/8	27-3/8	--	50	51
20	48	41-1/2	24-1/2	26	27-1/2	--	53	--
Tolerance:								
	± 1/2	± 1/2	± 1/2	± 1/2	± 1/2		(+ 3/4 - 1/2)	

Sleeve Inseam (E):
All Petites (P) - 16-3/4
All Regulars (R) - 17-3/4
All Talls (T) - 18-3/4
Tolerance - ± 1/2

NOTE: Bust, waist, and length of coat measurements shall be taken with coat fully buttoned, placed smooth and flat. Sweep measurement shall be taken with coat unbuttoned and folded at center back. Refer to Figure 1 for A, B, C, D, and E measurements.

A. Bust - Twice the measurement taken across front at base of armholes from folded edge to folded edge.
B. Waist - Twice the measurement taken across front between third and bottom buttonhole.
C. Back Length - Measurement taken from base of undercollar down center of back to bottom edge of coat.
D. Sweep - Twice the measurement taken 2 inches up along hemmed bottom.
E. Sleeve Inseam - Measurement taken along inseam from armhole to bottom edge of sleeve.

3.9 End item. The end item fusible shall have "no strike through" of the adhesive after fusing. The production end item testing shall be as specified in 4.4.5. Results of the end item drycleaning test shall be recorded on Figure 3. Copies of Figures 2 and 3, shall be attached to and become part of the contractor's end item examination record.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

3.10 Workmanship. The finished coats shall conform to the quality established by this specification. As a final step in the contractor's production control plan before formation of a lot, each coat shall be buttoned on a model form and examined for selected defects. A coat containing a selected defect shall not be included in the end item lot. Selected defects are those defects listed in Table IV of MIL-STD-1608. The occurrence of defects shall not exceed the applicable point value or selected defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements (examinations and tests) as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements, however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.3).
2. Quality conformance inspection (see 4.4).

4.3 First article inspection. The first article submitted in accordance with 3.2, shall be inspected as specified for compliance with design, construction, workmanship, appearance, and dimensional requirements.

4.4 Quality conformance inspection. Sampling for inspection shall be performed in accordance with MIL-STD-105, except where otherwise indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

4.4.1 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified, or qualified in this specification or applicable procurement documents. In addition, the contractor shall furnish a certificate of compliance for the resin treatment requirements of 3.3.7.2, the tape requirements of 3.3.7.3, and the colorfastness requirements of 3.3.8. In addition, testing shall be performed on components listed in Table III and in accordance with the characteristics noted. All requirements are applicable to the sample unit. All test reports including Figures 2 and 3 shall contain the individual values used in expressing the final result. The lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size shall be expressed in linear yards and the sample unit shall be 18 linear inches in full width. The sample size shall be in accordance with the following:

Lot size	Sample size (sample units)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

Table III - Component testing

Component	Characteristic	Requirement Paragraph	Test Method
Cloth, fusible, all parts	Color	3.3.3	Visual 1/
	Adhesive type	3.3.3	1/
	Evenness of adhesive	3.3.3	1/ 2/
	Colorfastness to drycleaning	3.3.3	5621
Haircloth (or alternate)	Material identification	3.3.4.1	1/
	Yarns per inch	3.3.4.1	5050 1/ 3/
	Weight	3.3.4.1	5041 1/ 3/
	Sizing content (haircloth only)	3.3.4.1	2611 1/ 3/
	Stiffness (alternate only)	3.3.4.1	5202 1/ 3/

1/ A certificate of compliance is required.

2/ A 12 inch head end per 100 yards of fusible material shall be viewed under a black light for unevenness of adhesive, missing dot, or extreme heavy coating. Any of these conditions observed shall cause rejection of the 100 yard sample.

3/ According to FED-STD-191.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

4.4.2 Daily preproduction testing. The tests listed in Table IV shall be performed each day prior to the start of production.

TABLE IV - Daily preproduction tests

Characteristic	Requirement	Test procedure
Fusing press settings	3.3.3.6	4.4.2.1
Actual fusing temperature	3.3.3.6	4.4.2.2
Bonding strength		
Small parts	3.3.3.3	4.4.2.3
Fronts	3.3.3.3	4.4.2.3

4.4.2.1 Fusing press settings. Before production begins each day, visually check all fusing machine settings for temperature, pressure and conveyor speed dwell time for conformance with manufacturer's recommendations. Nonconforming settings shall be adjusted accordingly. Actual settings will be recorded in the first column of Figure 2.

4.4.2.2 Actual fusing temperature. Two swatches of outershell, 12 inches in the warp direction and 11 inches in the filling direction, shall be cut from the outershell material to be used in the first 2 hours of the day's production. At the same time, one swatch each of small parts and fronts fusible material, 12 inches in the warp (machine) direction and 11 inches in the filling (cross-machine) direction, shall be cut from the material to be used in the first 2 hours of the day's production. All test swatches shall be cut into three equal parts of approximately 3.6 inches by 12 inches. The fusible test swatches may be cut slightly smaller in size to avoid conveyor belt contamination. Sandwich a temperature strip face down between one specimen of outershell material placed face down and a specimen of fronts fusible material placed on top with the adhesive side down. The temperature strip shall be placed slightly within the fusible starter strip. All small parts and fronts fusing tests shall have an approximate 1 inch by full width starter strip or non-fused area incorporated into the top portion of any given bond strength samples. This can be accomplished by placing a thin non-adhesive material between the fusible interlining and outershell before fusing, or by folding the fusible to itself. This sample shall be placed in the center of the fusing press conveyor with the outershell material down. Prepare two additional samples as described above using the fronts fusible material and place them on the left and right sides of the conveyor belt with the outershell material face down. Repeat the process for the small parts fusible material but without using the temperature strips. Lanes may be designated on the samples if necessary. After the fusing press is fully warmed up, run all samples through the press. When all the samples are cool to the touch after running through the fusing press, take the temperature strip specimens, determine the average of the three readings, and record the results in column 2 of Figure 2. Retain each individual temperature reading in an organized self-developed worksheet format. If the average falls outside of the fusible manufacturers recommended range, or if there is a variance in excess of 10°F or 6°C between lanes, determine the cause, correct the problem and repeat the testing process. Actual temperature and time shall be recorded in Figure 2. See 6.6 for suggested temperature strip sources.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

4.4.2.3 Bonding strength. To determine bonding strength, trim all small parts and fronts fusible swatches from the actual fusing temperature test to 1 inch by 12 inch strips. Pinking shears shall not be used to cut strips. The outershell fabric of each shall be clamped at the top, and the fusible material pulled from the starter strips downwards in a vertical direction in a steady continuous motion. A constant-rate-extension (CRE), or a constant-rate-traverse (CRT), or calibrated spring scale type tester may be used. If a spring scale type tester is used it shall be calibrated once weekly. Any calibration procedure used shall assure an accuracy of 1/4 ounce or better, and the date of calibration shall be entered on Figure 2. Average the three bonding strength readings for each fusible type. Retain each individual bonding strength reading in an organized self-developed worksheet format and record the average on Figure 2. If any individual reading fails to meet minimum bonding strength requirement specified in 3.3.3.3 then the cause must be determined, corrections made and the material retested until the problem is resolved before commencing production. In case of bonding strength dispute see 6.7.

4.4.3 In-process inspection. Inspection shall be made at any point or during any phase of the manufacturing process to determine whether operations or assemblies are carried out as specified. The Government reserves the right to exclude from consideration for acceptance any material or service for which in-process inspection has indicated nonconformance.

4.4.3.1 In-process fusing press maintenance and representative production testing. In-process tests listed in Table V shall be performed. Actual fusing temperature and bonding strength testing shall be performed after every 2 hours of fusing production time, and prior to re-starting fusing production after any skipping of fusing for 29 minutes or more. Pressure evenness and dwell time maintenance testing shall be performed once weekly. All representative production testing shall be performed on outershell, and both small parts and fronts fusible materials, sampled from component lots to be consumed in the next 1000 units of coat production. Sample size, and acceptance/rejection criteria shall be as specified in the applicable test procedure.

TABLE V - In-process fusing press maintenance and representative production tests

Characteristic	Requirement	Test procedure
Fusing press maintenance:		
Bonding strength		
Small parts	3.3.3.3	4.4.2.3
Fronts	3.3.3.3	4.4.2.3
Actual fusing temperature	3.3.3.6	4.4.2.2
Pressure evenness	3.3.3.6	4.4.3.2
Dwell time	3.3.3.6	4.4.3.2
Representative production:		
Differential shrinkage	3.3.3.5	4.4.3.3
Appearance (after drycleaning)	3.3.3.5	4.4.3.4
Drycleaned shrinkage	3.3.3.5	4.4.3.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

Characteristic	Requirement	Test procedure
Drycleaned bonding strength		
Small parts	3.3.3.3	4.4.3.4
Fronts	3.3.3.3	4.4.3.4

4.4.3.2 Pressure evenness and dwell time. Cut five, 12 inches in the warp direction by 2 inches in the filling, strips of outershell material and slightly smaller sized fronts fusible material. Place each of the fusible strips with the adhesive side down on the top of the outershell material with the face side down and with a fusible starter strip (see 4.4.2.2). Arrange the five specimens on the fusing press conveyor belt alongside each other in five different lanes consisting of extreme left, middle left, center, middle right and extreme right. Lanes may be marked on each strip if necessary. Run the specimens through the fusing press and using a stop watch, wrist watch or any mechanism that assures proper timing, mark the time elapsed between the time the leading edge of one of the specimens comes under pressure contact and the time it is released from the pressure contact. As an alternate procedure, the dwell time test may be conducted with the outershell differential swatch required in 4.4.3.3. Enter the dwell time on Figure 2. Remove the strips from the fusing machine when adequately cooled, cut fused outershell/fusible laminate to 1 inch filling direction, and perform the bonding test in 4.4.2.3 on all five specimens, recording the results for each specimen in Figure 2. The dwell time should be consistent with the machine speed ratings, and the fusible manufacturers recommended range and all five specimens should meet the minimum initial requirement for bond strength specified in 3.3.3.3. Any variations shall be investigated for cause, correction made, and the testing process repeated.

4.4.3.3 Differential shrinkage. From the outershell material cut three, 12 inches in the warp direction by 11 inches in the filling direction swatches and one each slightly smaller sized (not less than 10.5 inches) swatch from small parts and fronts fusible materials. Mark all swatches with 10 inch square gage marks using drycleaning resistant ink. Run one swatch of the outershell material through the heated fusing press by itself, and record the dimensional change in both directions to the nearest one-half percent. As an alternate, the dwell time test (see 4.4.3.2) may be conducted using this swatch. Prepare the two composite samples with the remaining two outershell swatches placed face down, then place the small parts and fronts fusible material swatches, matching the outershell warp direction, on top with the adhesive side down and with the fusible starter strips (see 4.4.2.2). After running through the fusing press, record the dimensional changes in both directions to the nearest one-half percent. Differential shrinkage shall be calculated as the difference, if any, between the dimensional percent changes in the outershell only material and each of the fusible materials. This information shall be recorded on chart A of Figure 3. If the differential shrinkage exceeds the requirements specified in 3.3.3.5, investigate to determine the cause, correct the problem, and repeat testing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

4.4.3.4 Drycleaning appearance, shrinkage and bonding strength. For all tests use the two small parts and fronts premarked 12 inch by 11 inch fused swatches fabricated in 4.4.3.3. Prior to drycleaning, the two swatches shall be pressed twice each on a top and bottom steam press with closed head for 20 seconds and vacuum for 10 seconds. Both swatches shall be drycleaned three times using a commercial dry cleaning procedure and perchloroethylene solvent. Each swatch shall be steam pressed with 20 second bottom steaming in the non-locked position and vacuum after each of the three drycleanings. After cleaning and pressing, examine the swatches for bubbling, delamination or strike through and record the observations on chart A of Figure 3. Measure the bench marks on the outershell material in both directions for each swatch, determine shrinkage to one-half percent, and record on chart A of Figure 3. Trim each swatch into three 1 inch by 12 inch strips and perform bonding strength tests using the bonding strength procedure in the preproduction testing in 4.4.2.3. Retain each individual bonding strength reading in an organized self-developed worksheet format and record the averages on chart A of Figure 3. Any evidence of bubbling, delamination, or strike through, or either shrinkage or bonding strength not meeting the requirements of 3.3.3.3 shall be investigated for cause, corrections made and retesting performed before continuing production of the 1000 coats represented by the sample.

4.4.4 Examination of the end item. Sampling and examination of the end item shall be performed in accordance with the provisions of MIL-STD-1608 except as otherwise specified. The following defects shall also apply:

	Point Value
LABEL	
Removable size ticket missing, incorrect or illegible	3
FUSIBLE	
Delamination	
1. Partial or complete delamination on any fused component	*
2. Bubbling on any fused component	*
Any strike through or bleed through	*
Any resin transfer to coat	
1. On any fused component	*
2. Non-fused component	3
Quilling effect (protrusion of extraneous fibers through basting needle holes) visible on coat front or under lapel	3

4.4.5 End item testing. One coat shall be randomly selected for end item testing for each 3000 coats or any portion of 3000 coats in the end item lot. Each coat selected shall be initially examined visually for any defects in the fusible catagory of 4.4.4. After initial examination each sample unit shall be drycleaned and pressed three times as described in 4.4.3.4. Each sample coat shall again be visually examined for fusible defects as listed in 4.4.4. If any sample coat contains any fusing defects after three drycleanings and pressings, retesting shall be performed by randomly selecting one coat for each 1000 coats or portion of 1000 coats in the end item lot and repeating the testing procedure. If any sample coat contains any fusing defects after three drycleanings and pressings upon retesting, the end item lot shall be rejected. An end item tesing chart shall be maintained in accordance with Figure 3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

4.4.6 Examination of packaging requirements. Examination of packaging requirements shall be in accordance with the provisions of MIL-STD-1608.

4.4.7 Palletization examination. An examination shall be made to determine that the palletization complies with the section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the end item inspection lot. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5 in accordance with MIL-STD-105.

Examine	Defect
Finished dimensions	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.

5. PACKAGING

5.1 Preservation. Preservation shall be level A, C, or hanger packs (see 6.2).

5.1.1 Level A. Each fully buttoned coat shall be placed front down. Fold in the sides towards the center of the back with the sleeves positioned full length vertically. Fold coat in half by bringing up the bottom edge to the shoulderline. The completely folded coat shall measure approximately 14 inches in length by 12 inches in width. Each coat shall be inserted in a snug-fitting clear polyethylene film bag of not less than 0.003 inch thickness (+ 20% tolerance). All seams and closures shall be formed by heat sealing. A 1/4 inch hole shall be made at one corner of the bag to allow excess air to escape. As an alternate, the polyethylene bag may be of the tuck-in or reverse flap type where a heat seal closure and corner hole are not required, and the final closure shall be made with the flap tucked in or reversed.

5.1.2 Level C. Coats shall be preserved to afford adequate protection against physical damage during shipment from the contractor to the first receiving activity. The package and the quantity per package shall be the same as that normally used by the contractor for retail distribution.

5.1.3 Hanger pack. Coats shall be hung with fronts lapped and unbuttoned and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, B, C, or hanger packs (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

5.2.1 Level A. Ten coats, of one size and length, preserved as specified in 5.1.1, shall be packed in a fiberboard shipping container, assembled, closed and reinforced conforming to type CF, class weather-resistant, variety DW, grade V15c, size 2A of MIL-B-17757. The fiberboard used for fabricating the box liner shall conform to type CF, class domestic of MIL-B-17757. Level A packages shall be placed flat in two stacks and five in depth within the shipping container with every one reversed. Length of the bags shall be parallel to the end panels of the container.

5.2.2 Level B. Ten coats, of one size and length, preserved as specified in 5.1.1, shall be packed in a fiberboard shipping container, assembled, closed and reinforced conforming to type CF, class domestic, variety DW, grade 200, size 2A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class domestic, of MIL-B-17757. Level A packages shall be packed flat in two stacks and five in depth within the shipping container with every one reversed. Length of the bags shall be parallel to the end panels of the container.

5.2.3 Level C. Item preserved, as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. The quantity per shipping container shall be the same as that normally used by the contractor for retail distribution. Containers shall comply with the US Postal Manual, Uniform Freight Classification Rules or National Motor Freight Classification Rules, as applicable.

5.2.4 Hanger pack. When specified (see 6.2) twelve coats of one size (body type and length) only, preserved as specified in 5.1.3 shall be packed in a type I container, using either style A or style B hanger bar in accordance with MIL-C-44192. No mixed sizes are permitted within the same container.

5.3 Marking. In addition to any special marking required by the contract or order, unit packs, intermediate or exterior containers, and palletized unit loads shall be marked in accordance with MIL-STD-129. When hanger pack containers are used, the containers shall have marked on each side in bold clear red or blue lettering not less than two inches high "DO NOT DROP" and "THIS SIDE UP" with arrows pointing to the top of the containers.

5.4 Palletization. When specified (see 6.2) item packed as specified shall be palletized on a 4-way entry pallet in accordance with load type 1A of MIL-STD-147. Each prepared load shall be bonded with primary and secondary straps in accordance with the bonding methods C and D or film bonding F or G. Pallet pattern shall be in accordance with the appendix of MIL-STD-147.

The pallet shall be 4-way, Type IV; Type V, Class 1, Size 2; or Type VIII, fabricated from wood group I, II, III or IV, Grade A of NN-P-71, or 4-way, Style 1, Size A, Type I, Class 1 fabricated from wood groups specified in MIL-P-15011. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall be approved by the contracting officer.

NOTE: When hanger packs are required the containers shall be palletized in accordance with the appendix of MIL-C-44192 using pallet load pattern number 95.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

5.5 MIL-STD-2073. When specified (see 6.2), Preservation and Packing shall be in accordance with MIL-STD-2073-1 and MIL-STD-2073-2.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat is part of the service dress uniform worn by female Navy personnel.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification
b. Sizes (body types and lengths) required (see 1.2)
c. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1.1 and 2.2).
d. When first article sample is required (see 3.2). The item will be tested and should be a first article sample. The contracting officer should include specific instructions in acquisition documents regarding arrangements for examination, quantity, testing and approval of the first article.
e. Levels of preservation and packing required (see 5.1 and 5.2)
f. When palletization is required (see 5.4)
g. When all packaging data is to be found in MIL-STD-2073-1 and MIL-STD-2073-2 (see 5.5).

6.3 Samples and patterns. For access to samples and patterns, address the procuring activity issuing the invitation for bids.

6.4 Recycled material. It is encouraged that recycled material be used when practical as long as it meets requirements of this specification.

6.5 Size (body type and length) abbreviations. The size (body type and length) abbreviations (example -12JP) used in this specification follow the current industry practice of listing numerical size and one letter abbreviations for body type variation (Juniors and Womens only) and length (Petites, Regulars, and Talls).

The size (body type and length) abbreviations used on the patterns list a numberical size, a one letter abbreviation for length (Petites, Regulars, and Talls) and a two letter abbreviation for body type variations (Juniors and Womens only).

6.6 Temperature indicators. Suggested sources for temperature indicators are as follows:

Paper Thermometer Company - (603) 547-2034
MRC Inc., Reatec Division - (215) 687-4300

6.7 Bonding strength dispute procedure. In case of dispute, the average of the first 3 inches of the five highest bonding strength peaks from a chart recording on a CRE Tensile Tester, running at 12 inches per minute shall determine the bonding strength. If splitting is observed, then just the highest peak shall be regarded as the bonding strength.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

6.8 Basting recommendations. In order to assure good basting without the quilling effect (protrusion of extraneous fibers through basting needle holes) the following practices are recommended:

a. Utilize either 70/2 smooth finish cotton/polyester wrap or size A nylon thread. Avoid using threads with coarse, hairy exterior structure.

b. Utilize finest size sewing needle possible (size 12 or 14) with ballpoint. Larger size needles will provide larger holes and better chance for fibrous material to enter.

c. Increase quality control checks on needle changes during production. Dull or burred needle tips will push fibrous material to outershell exterior.

d. Reduce basting sewing tensions and amount of pull on the material being sewn wherever possible.

6.9 Subject term (key word) listing.

Dress clothing, woman's
Fabric, tropical, polyester/wool
Fused interlining
Uniform, dress
Uniform, woman's

Custodian:
Navy - NU

Preparing Activity:
Navy - NU

Review Activity:
DLA - CT

Project No. 8410-N741

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

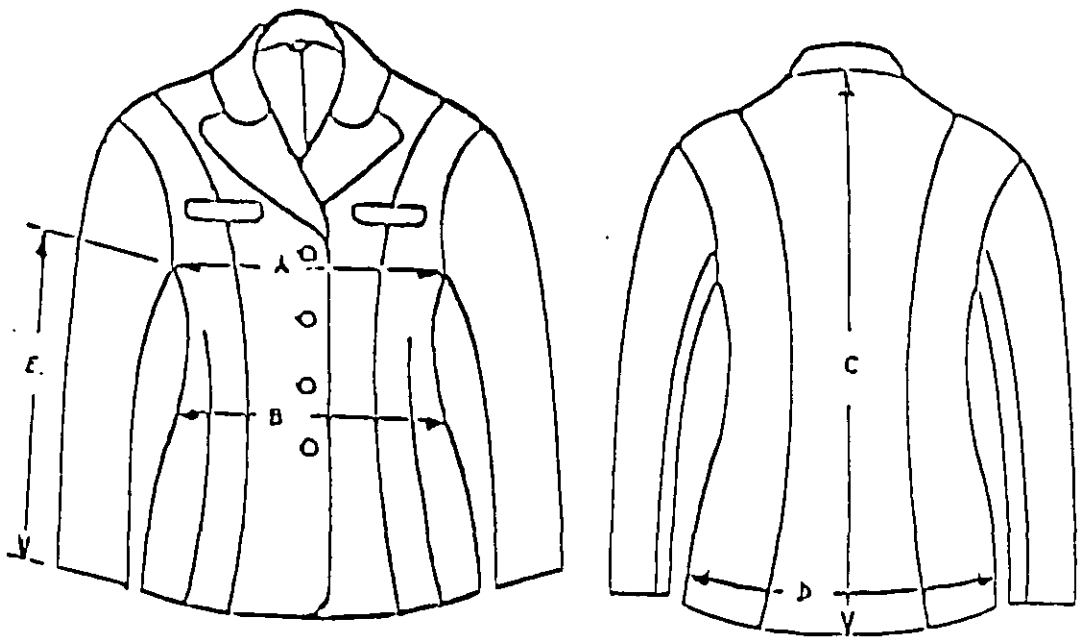


FIGURE 1

COAT, WOMAN'S, BLUE, DRESS

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

CONTRACT # - _____

CONTRACTOR - _____

QAR NAME _____

FUSING PRESS SETTINGS RECOMMENDED BY FUSIBLE MFG. _____

STYLE NO.: _____

TEMPERATURE, F(C)

PRESSURE, PSI (BAR)

DWELL TIME, SEC ___

CHART A

DATE DD/MM/YY	INITIAL DAILY TEST (AFTER MACHINE WARM UP)	(4 HOURS LATER)	FUSING PRESS CLEANLINESS (ONCE DAILY)
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____
MS MT - P - DT / /	T_____ TE BS	T_____ TE BS	T_____ AI: _____

MIN RQMT: 2 LBS. (907 GMS) /INCH OR SPLIT

PRESSURE EVENNESS, BONDING STRENGTH
TEST ONCE WEEKLY
DATE:
___/___/___ _____ AI _____

DWELL TIME, SEC.
TEST ONCE WEEKLY

DATE:	MACHINE SETTING	STOP WATCH READING	
___/___/___			AI _____

SPRING SCALE CALIBRATION
TEST ONCE WEEKLY
DATE:
___/___/___ AI _____

KEY:

AI	Authorized initials
BS	Bonding strength
DT	Dwell time
MS	Machine setting
MT	Machine temperature
P	Pressure
T	Time
TE	Temperature strip reading
I	Small parts, fusible
II	Fronts, fusible

Figure 2

COAT, WOMAN'S, BLUE, DRESS

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

CHART B

REPRESENTATIVE PRODUCTION UNITS/1,000	DATE DD/MM/YY	PROD. LOT #	BS AFTER 3 DRYCLEANS	APPEAR AFTER 3 DRYCLEANS	AI
1 - 1,000	__/__/__				
1,001 - 2,000	__/__/__				
2,001 - 3,000	__/__/__				
3,001 - 4,000	__/__/__				
4,001 - 5,000	__/__/__				
5,001 - 6,000	__/__/__				
6,001 - 7,000	__/__/__				
7,001 - 8,000	__/__/__				
8,001 - 9,000	__/__/__				
9,001 - 10,000	__/__/__				
MIN RQMT: 1.5 LBS. (680 GMS)/INCH OR SPLIT				GOOD	

KEY:

AI - AUTHORIZED INITIALS TO VERIFY CONTRACTOR TESTS
BS - BONDING STRENGTH/ IN., AVE.
DT - DWELL TIME
MS - MACHINE SETTING
MT - MACHINE TEMPERATURE
P - PRESSURE
T - TIME
TE - TEMPERATURE STRIP READING, AVE.
APPEAR - APPEARANCE

Figure 3

COAT, WOMAN'S, BLUE, DRESS

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T01:17Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: *In a continuing effort* to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem *areas such as* wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE NAVY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12503 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE NAVY

Navy Clothing and Textile Research Facility
P.O. Box 59
Natick, MA 01760-0001

Source: https://assist.dla.mil -- Downloaded: 2026-0-21T01:17Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-29628(NU)	COAT, WOMAN'S, BLUE, DRESS

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
	☐ USER
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

Source: https://assist.dla.mil – Downloaded: 2022-10-21 T01:17Z
Check the source to verify that this is the current version before use.