MIL-M-46368B(MU)
11 September 1968
SUPERSEDING
MIL-M-46368A(MU)
31 August 1965

MILITARY SPECIFICATION

MOUNT, TELESCOPE: M134

1. SCOPE

1.1 This specification covers performance requirements, quality assurance provisions, and packaging data relative to a telescope mount designed primarily to provide adjustments in pitch and to compensate for angles of cant for indirect fire (see 6.1).

2. APPLICABLE DOCUMENTS

2.1 The following documents, of the issue in effect on date of invitation for bids or request for proposals, form a part of this specification to the extent specified herein:

SPECIFICATIONS

Military

MIL-F-13926	Fire Control Materiel: General Specification Governing the Manufacture and Inspection of
MIL-P-14232	Parts, Equipment and Tools for Army Materiel, Packaging and Packing of
MIL-I-45607	Inspection Equipment, Supply and Maintenance of

STANDARDS

Military

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-109	Quality Assurance Terms and Definitions

DRAWINGS

U.S. Army Frankford Arsenal

F8626072	Mount, Telescope: M134
IEL 8626072	List of Inspection Documents for Mount, Telescope: M134

PACKAGING DATA SHEET

8626072	Packaging of Mount, Telescope: M134

FSC 1240

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

(Copies of specifiecations, standards, drawings, and packaging data sheets required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Fabrication.- The mount shall be manufactured in accordance with Drawing F8626072 and drawings pertaining thereto.

3.2 Fabrication. - The contractor shall be responsible for adherence to the following requirements of MIL-F-13926:

(a) Order of precedence
(b) Dimensions and tolerances
(c) Inorganic protective surface finishes
(d) Part identification and marking
(e) Workmanship

3,3 Environmental service conditions.

3.3.1 Operating temperatures.- The mount shall meet the applicable requirements of 3.4.11 while exposed to, and thermally stabilized at, ambient temperatures of -40° and +150° Fahrenheit (F). Upon return to a standard ambient temperature between +60° and +90°F the mount shall meet the requirements of 3.3.2 to 3.4.11 inclusive.

3.3.2 Vibration.- The mount shall withstand a vibration of 30 ± 5 cycles per second (cps) frequency with an amplitude of 1/16 inch (1/8 inch maximum excursion) for a period of 5 minutes ± 15 seconds. Subsequent to vibration there shall be no evidence of damage or physical failure, and the mount shall meet the following requirements of this specification.

3.4 Performance.

3.4.1 Orientation.- The mount shall be positioned and oriented as follows:

(a) The mounting surface of the mount in a vertical plane (internal surface).

(b) The locating keyway horizontal.

(c) The pitch and cross level vial bubbles shall be centered within the width of a graduation line.

(d) The locating surface for the telescope shall be horizontal within 1.0 mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

(e) The centerline passing through the two locating pins on the horizontal locating surface for the telescope shall be parallel to the vertical mounting surface of the mount within 1.0 mil.

3.4.2 Elevation travel. - The locating keyway of the vertical mounting surface shall rotate through an excursion of at least 1333 mils in elevation and 445 mils in depression from the position established in 3.4.1.

3.4.3 Crosslevel travel (cant).- The mount shall travel through an excursion of at least 178 mils to the left and 178 mils to the right from the position established in 3.4.1.

3.4.4 Pitch motion. - The mount shall travel through an excursion of at least 178 mils above and 178 mils below the position established in 3.4.1.

3.4.5 Backlash (cant).- Backlash in the cant mechanism (3.4.3) shall not exceed 1.5 mils at zero elevation and zero cant.

3.4.6 Backlash (pitch). - Backlash in the pitch mechanism (3.4.4) shall not exceed 1.5 mils at zero elevation.

3.4.7 Deviation.- A line of sight shall not deviate horizontally from a target point by more than 0.25 mil when the mount is subjected to the requirement of 3.4.2.


3.4.8 Plumb travel. - A line of sight shall track a plumb line within 0.5 mil (total lateral spread) when the mount is subjected to the requirement of 3.4.4.

3.4.9 Mount rigidity.- With the mount positioned as in 3.4.1, apply a twenty pound tangential load at the right side of the telescope support as shown in Figure 1. Release the load and record the movement. Apply the same load at the left side of the telescope support. Release the load and record the movement. The The total movement as indicated by the two readings shall not exceed the values of Table I.

TABLE I

ELEVATION (In Mils)	CANT ANGLE (In Mils)	TOTAL MOVEMENT (In Mils)
0	0	.25
800	0	.75
1100	0	1.75
1333	0	3.50

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

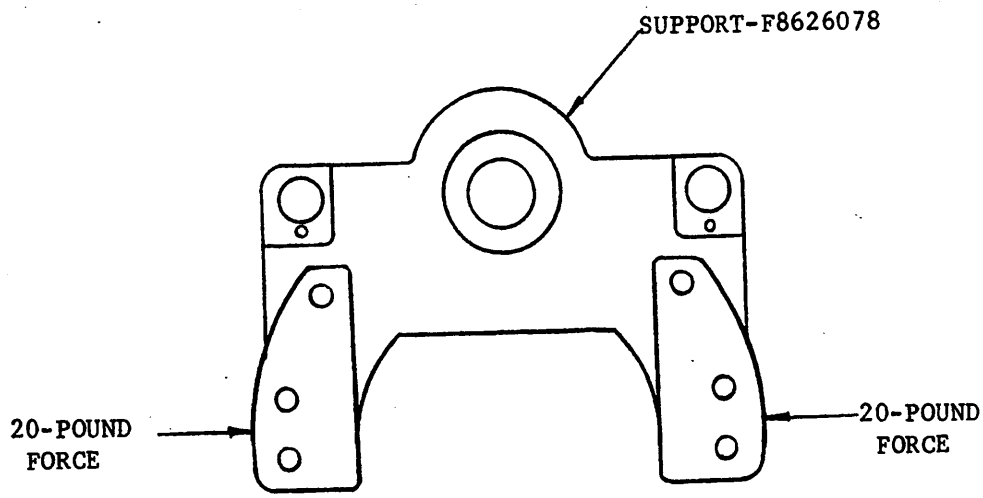

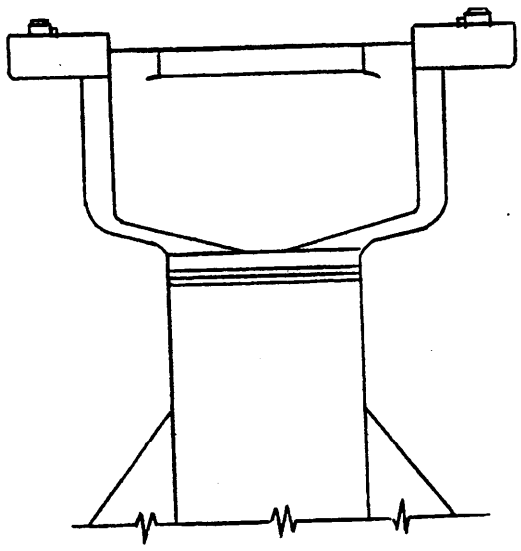


FIGURE I

APPLICATION OF TANGENTIAL LOAD

Source: https://assist.dla.mil -- Downloaded: 20260-22T05:44Z
Check the source to verify that this is the current version before use.

3.4.10 Azimuth correction.- The mount shall make left and right azimuth corrections in accordance with the requirements and values of Table II.

TABLE II
AZIMUTH CORRECTION

ELEVATION (In Mils)	CANT ANGLE (In Mils)	AZIMUTH CORRECTION (In Mils)	TOLERANCE (In Mils)
300	88.9	27.0	.3
600	88.9	59.6	.7
900	88.9	108.8	1.5
1200	88.9	216.8	1.8
300	177.8	54.5	.6
600	177.8	120.3	1.0
1100	177.8	342.4	2.0

3.4.11 Operability.- The operating torques shall be within the values in Table III at the temperatures indicated therein.

TABLE III

Control	Standard Ambient Temperature (+60° to +90°F) and +150°F	-40°F
Cross level knob	4 lb-inch min. to 12 lb-inch max.	20 lb-inch max.
Pitch knob	4 lb-inch min. to 12 lb-inch max.	20 lb-inch max.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.- Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, the supplier may utilize his own facilities or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 General provisions.- The component and subassembly inspection requirements of MIL-F-13926 form a part of the qUality Assurance Provisions of this specification. Definitions of inspection terms shall be as listed in MIL-STD-109.

4.2 First article (initial production) approval.- The requirement for first article approval and the responsibility (Government or contractor) for first article testing shall be as specified in the contract. The sample for

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

first article approval tests shall consist of three (3) telescope mounts plus three (3) each of all items covered by SQAP. The sample shall be manufactured in the same manner, using the same materials, equipment, processes, and procedures as used in regular production. All parts and materials, including packaging and packing, shall be obtained from the same source of supply as used in regular production.

4.2.1 Government testing.- When the Government is responsible for conducting first article approval tests, the contractor, prior to submitting the sample to the Government, shall inspect the sample to insure that it conforms to all the requirements of the contract and submit a record of this inspection with the sample, including certificates of conformance for materials.

4.2.2 Contractor testing.- When the contractor is responsible for conducting first article approval tests, the sample shall be inspected by the contractor for all the requirements of the contract. The sample and a record of this inspection, including certificates of conformance for materials, shall be submitted to the Government for approval. The Government reserves the right to witness the contractor's inspection.

4.3 Inspection provisions.

4.3.1 Submission of product.- Unless otherwise specified by the contracting officer, inspection lot size, lot formation and presentation of lots shall be in accordance with "Submission of Product" provisions of MIL-STD-105.

4.3.2 Examination and tests.

4.3.2.1 Components and subassemblies.- All components and subassemblies shall be inspected in accordance with the inspection provisions contained in Supplementary Quality Assurance Provisions (SQAP) listed in the List of Inspection Documents (IEL), when provided with-the technical data package (TDP). In the absence of SQAP’s the applicable Quality Assurance Provisions of MIL-F-13926 shall apply.

4.3.2.2 Final acceptance inspection.- Subsequent to first article approval, examination and tests related to Section 3 herein shall be performed on a single defect (individual characteristic) basis in accordance with MIL-STD-105 and the sampling plans specified in Table IV herein. Examination and tests for Packaging, Packing and Marking shall be in accordance with MIL-P-14232 and Section 5 herein. The tabulated classification of defects in Table IV shall constitute the minimum inspection to be performed by the supplier after first article approval and prior to Government acceptance or rejection by item or lot.

Source: https://assist.dla.mil -- Downloaded: 202640-22T05:44Z
Check the source to verify that this is the currenversion before use.

TABLES IV - CLASSIFICATION OF DEFECTS

CLASS	CHARACTERISTIC	REQUIREMENT	TEST PROCEDURE
CRITICAL: NONE			
MAJOR: AQL 1.0% Defective			
101.	Vibration	3.3.2	4.6.2.1
102.	Elevation travel	3.4.2	4.6.2.4
103.	Cross level travel	3.4.3	4.6.2.8
104.	Pitch motion	3.4.4	4.6.2.5
105.	Backlash (cant)	3.4.5	4.6.2.9
106.	Backlash (pitch)	3.4.6	4.6.2.6
107.	Deviation	3.4.7	4.6.2.3
108.	Plumb travel	3.4.8	4.6.2.7
109.	Rigidity	3.4.9	4.6.2.10
110.	Azimuth correction	3.4.10	4.6.2.11
111.	Torque (cross level knob)	3.4.11	4.6.2.12
112.	Torque (pitch knob)	3.4.11	4.6.2.12

4.3.3 Acceptance and rejection.- Rejected lots shall be screened for defective characteristics. Removal or correction of defective units resubmittance of rejected lots shall be in accordance with "Acceptance Rejection" as specified in MIL-STD-105.

4.4 Special sampling for environmental testing.

4.4.1 Special sampling.- Sampling inspection for characteristic listed in the following table shall be in accordance with inspection level S3, Table I of MIL-STD-105. Acceptance or rejection of the lot shall be in accordance with AQL 2.5 of Table II-A of MIL-STD-105. Samples shall have met all the requirements and tests outlined in Table IV prior to being subjected to the following examination and tests.

TABLE V

CHARACTERISTIC	REQUIREMENT	TEST PROCEDURE
301. Fabrication	3.1	Certification
302. General specification	3.2	Certification
303. Temperature operating	3.3.1	4.6.1.1
304. Torque cross level knob (+150° & -40)	3.4.11	4.6.2.12
305. Torque pitch knob (+150° & -40°)	3.4.11	4.6.2.12

4.4.2 Failure of sample.- Should any one item of a special sampling fail to meet the specified test requirements, acceptance of the represented inspection lot will be suspended by the Government until necessary corrections have been made by the contractor and the resubmitted samples have been approved (see 4.3.3).

Source: https://assist.dla.mil -- Downloaded: 202640-22T05:44Z
Check the source to verify that this is the currentversion before use.

4.5 Inspection equipment.- Except as otherwise provided for by the contract, the contractor shall supply and maintain inspection equipment in accordance with the applicable requirements of MIL-I-45607.

4.5.1 Government furnished inspection equipment.- Where the contract provides for Government furnished test equipment, supply and maintenance of test equipment shall be in accordance with the applicable requirements specified in MIL-I-45607.

4.5.2 contractor furnished inspection equipment.

4.5.2.1 Government design.- Unless otherwise specified i nthe contract, all inspection equipment specified by drawing number in specifications or SQAP forming a part of the contract shall be supplied by the contractor in accordance with technical data listed in the List of Inspection Documents when provided with the Technical Data Pakcage (TDP).

4.5.2.2 contractor design.- The contract shall design and supply inspection equipment compatible with the "Test Methods and Procedures" specified in 4.6 of this specification and with the component inspection procedures specified in "Examination" and "Test Facilities" requirements of MIL-F-13926. Since tolerance of test equipment is normally considered to be within 10% of the product tolerance for which it is intended, this inherent error in the test equipment design must be considered as part of the prescribed product tolerance limit. Thus, concept, construction, materials, dimensions and tolerance used in the design of test equipment shall be so selected and controlled as to insure that the test equipment will reliably indicate acceptability of a product which does not exceed 90% of the prescribed tolerance limit, and permit positive rejection when non-conforming. Construction shall be such as to facilitate routine calibration of test equipment.

4.5.3 Test equipment.- In conjunction with 4.5.2.2, the following standard test equipment shall be utilized in the performance of the applicable tests-as specified-in 4.6.

	NOMENCLATURE	DESCRIPTION
1.	Hot and cold chamber	Standard type conforming to the accuracies outlined in test facilities specified under test facilities of MIL-F-13926
2.	Torque wrench and scale	Standard shop type accurate to within 10% of drawing tolerance

4.6 Test methods and procedures.

4.6.1 Environmental.

Source: https://assist.dla.mil -- Downloaded: 202610-22T05:44Z
Check the source to verify that this is the current version before use.

4.6.1.1 Temperature test.- The telescope mount shall be subjected to Test Procedure I of MIL-F-13926; however, the temperatures specified in 3.3.1 shall apply. When the telescope mount has been stabilized at the temperature specified, the result of the specified test shall conform to the limits outlined in 3.3.1 using test procedures outlined herein.

4.6.2 Performance.

4.6.2.1 Vibration.- The telescope mount shall be vibrated in accordance with Test Procedure V of MIL-F-13926, however, the duration frequency and amplitude shall be as specified in 3.3.2. After completion of the vibration test, the mount shall be inspected for broken and damaged parts using visual and tactile inspection techniques to assure compliance with 3.3.2.

4.6.2.2 Orientation.- Secure the mount to the extended trunnion of a level and crosslevel type of fixture having the accuracies depicted on Drawing F6523553 by means of an adapter having accuracies shown as Part 6 on Drawing F105556I9. Secure an Inspection Aid Adapter having the accuracies depicted on Drawing F10553898 to the opposite extended trunnion of the level and crosslevel type fixture by the means provided. Prior to securing the mount, assemble supporting adapter by the means provided and set fixture indices to indicate zero elevation and zero cant. Place collimating telescope F5549108 in “V” of adapter and position a plumb line approximately 40 feet from the collimator’s objective lens and in line with collimator’s line of sight. This line of sight to be considered as the intersecting point of the horizontal and vertical reticle line. Rotate fixture elevating handwheel and observe parallelism between optical axis and plumb line. They must be parallel. Make all adjustments by means of fixture leveling screws; reset crosslevel index to zero. Return fixture to zero elevation and place a precision evel over adapter keys. The keys are considered level when the precision level indicates level in one position and when rotated 180 degrees from the original level setting. Secure adapter to fixture. Sight through the collimator and rotate collimator in “V” to position vertical reticle line in coincidence with the plumb line. Place target Figure II behind plumb line and coincide target lines A and B to collimator’s horizontal and vertical reticle lines. Remove collimating telescope from test fixture and assemble the mount to test adapter. Secure by means of 4 bolts. Secure locator pin Part 16 shown on Drawing F10555619 to fixture. “Rotate crosslevel knob and pitch knob to level the pitch and crosslevel bubbles of the mount to within limit specified in 3.4.1(c). Place an inspection aid A8658940 on a parallel over each of the horizontal surfaces perpendicular to the mounting face, then over both surfaces parallel to the mounting surface and then over the quadrant gun pads. All readings must indicate level within the limit outlined in 3.4.1(d). Seat “V” block Part I shown on Drawing F10555619, and collimator over locating pins of mount with base of “V” block resting on horizontal top seating surface. Sight through collimator and observe coincidnece between the intersecting point of target lines C and D Figure IInd the collimator’s optical line of sight. They must coincide within the limits specified in 3.4.1(e). By means of cross level knob, set crosslevel bubble of inspection

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

aid adapter Drawing F10553898 to indicate level. Elevate fixture through full elevation and full depression travel. During this excursion, observe that level vial bubble of-the inspection aid adapter remains in constant position. Any bubble movement indicates seating surface of adapter receiving the inspection aid is in a canted position. Set inspection aid to zero elevation. Return fixture-to zero elevation. Reposition inspection aid on the inspection aid adapter seating pads. Rotate inspection aid 180° and observe level bubble setting. Both level vial bubble positions must indicate identical level settings. When all level reding and points of coincidence have been attained, the mount is orientated in accordance with 3.4.1.

4.6.2.3 Deviation. - With the mount positioned as specified in 4.6.2.2, sight through the collimator telescope and observe extent of deviation in the line of sight (walk off in azimuth direction) when the fixture elevation handwheel is rotated from zero to a minimum of 1333 mils elevation and from zero to a minimum of 445 mils depression. Deviation (walk off) shall not exceed the thickness of the reticle line to assure conformance with the limits specified in 3.4.7.

4.6.2.4 Elevation. - This test can be performed in conjunction with the previous test. Remove "V" block and collimator. Rotate fixture elevation handwheel to maximum elevation and then to maximum depression. Place inspection aid over quadrant pads. Read maximum elevation and depression angles on inspection aid. Both readings must conform with the limits specified in 3.4.2.

4.6.2.5 Pitch motion.- With the fixture positioned as outlined in 4.6.2.2, with "V" block and collimator removed, rotate pitch knob full clockwise and position the inspection aid over quadrant gun pads of the mount and obtain angular reading on inspection aid when level vial indicates level. This reading must be equal to or exceed the limits specified in 3.4.4. Repeat the procedure when the pitch knob has been rotated full counterclockwise.

4.6.2.6 Backlash (pitch motion). - This test may be accomplished in conjunction with the preceding test. This test is accomplished by scribing an index line on the pitch knob and an index line in line with the previous index on the mating casting surface. Rotate the knob one turn beyond the scribe line on the casting and re-establish coincidence. Set the inspection aid over quadrant pads and record the pitch angle after leveling level bubble of inspection aid. Continue one half revolution beyond this point of coincidence and return to previous point of coincidence and observe inspection aid level vial setting. Exercise care not to override points of coincidence. This reading and previous reading must coincide within the limits specified in 3.4.6. Repeat-this test at zero pitch and two other positions each side of the zero pitch setting with the fixture set to zero elevation and zero cant.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

4.6.2.7 Plumb travel. - With the instrument positioned as outlined in 4.6.2.2, plumb travel test is performed by sighting through the collimating telescope toward a plumb line while simultaneously rotating the pitch knob, through full excursion. The line of sight shall not deviate from the plumb line by more than the thickness of the collimator's vertical reticle line to assure conformance with 3.4.8.

4.6.2.8 Crosslevel travel (cant).- With the fixture positioned as outlined in 4.6.2.2, remove "V" block and collimator from mount. Rotate cant knob to full clockwise position and position inspection aid seated on a parallel over one of the mount's top surface used in seating mating panoramic telescope. Angular reading over both surfaces shall be identical to each other and shall be equal to or exceed the limits specified in 3.4.3.


4.6.2.9 Backlash (cant).- This test may be accomplished in conjunction with the preceding test. Prior to the test scribe an index line on the cross-level knob and a mating index line on the casting in line with the previous index line. Rotate the knob one turn and reposition both indices in coincidence. Using an appropriate size parallel, support the inspection aid on one of the seating surfaces at the top of the mount and level the level vial Record this reading and continue to rotate cant knob one half turn beyond point of coincidence and return to point of coincidence. Do not override this point of coincidence. replace the parallel and inspection aid over the same seating surface and observe level vial bubble. Reset the level bubble level if necessary, and observe the angular reading. This reading and the previous reading to be identical within the limits outlined in 3.4.5. Repeat this check at zero cant and two places each side of zero cant at zero elevation only.

4.6.2.10 Rigidity.- With the mount positioned as outlined in 4.6.2.2, sight through collimator telescope and observe where the optical axis falls upon the target with respect to the intersecting point of target lines C and D, Figure II. Record this position. Apply the load tangentially to the mount in the direction of the target. Remvoe the load and observe where the line of sight falls with respect to the intersecting point of target lines C and D. Apply load in the opposite direction. Movement if any, shall be algebraically added, total movement not to exceed the limits specified in 3.4.9. Perform this procedure using elevation angles listed in Table II with zero cant and zero pitch settings set into the fixture and mount.

4.6.2.11 Azimuth correction.- Prior to performing this test, a sighting device capable of measuring azimuth correction readings and having an accuracy equal to or exceeding those depicted on Drawing F10555619 is required.

4.6.2.11.1 The sighting device depicted on Drawing F105556I9 is to be calibrated by setting the reticle's center vertical line parallel to a plumb line. Parallelism is obtained by rotating Collimator F5549108 between set screws of the sighting device.


Source: https://assist.dla.mil -- Downloaded: 202610-22T05:44Z
Check the source to verify that this is the current version before use.

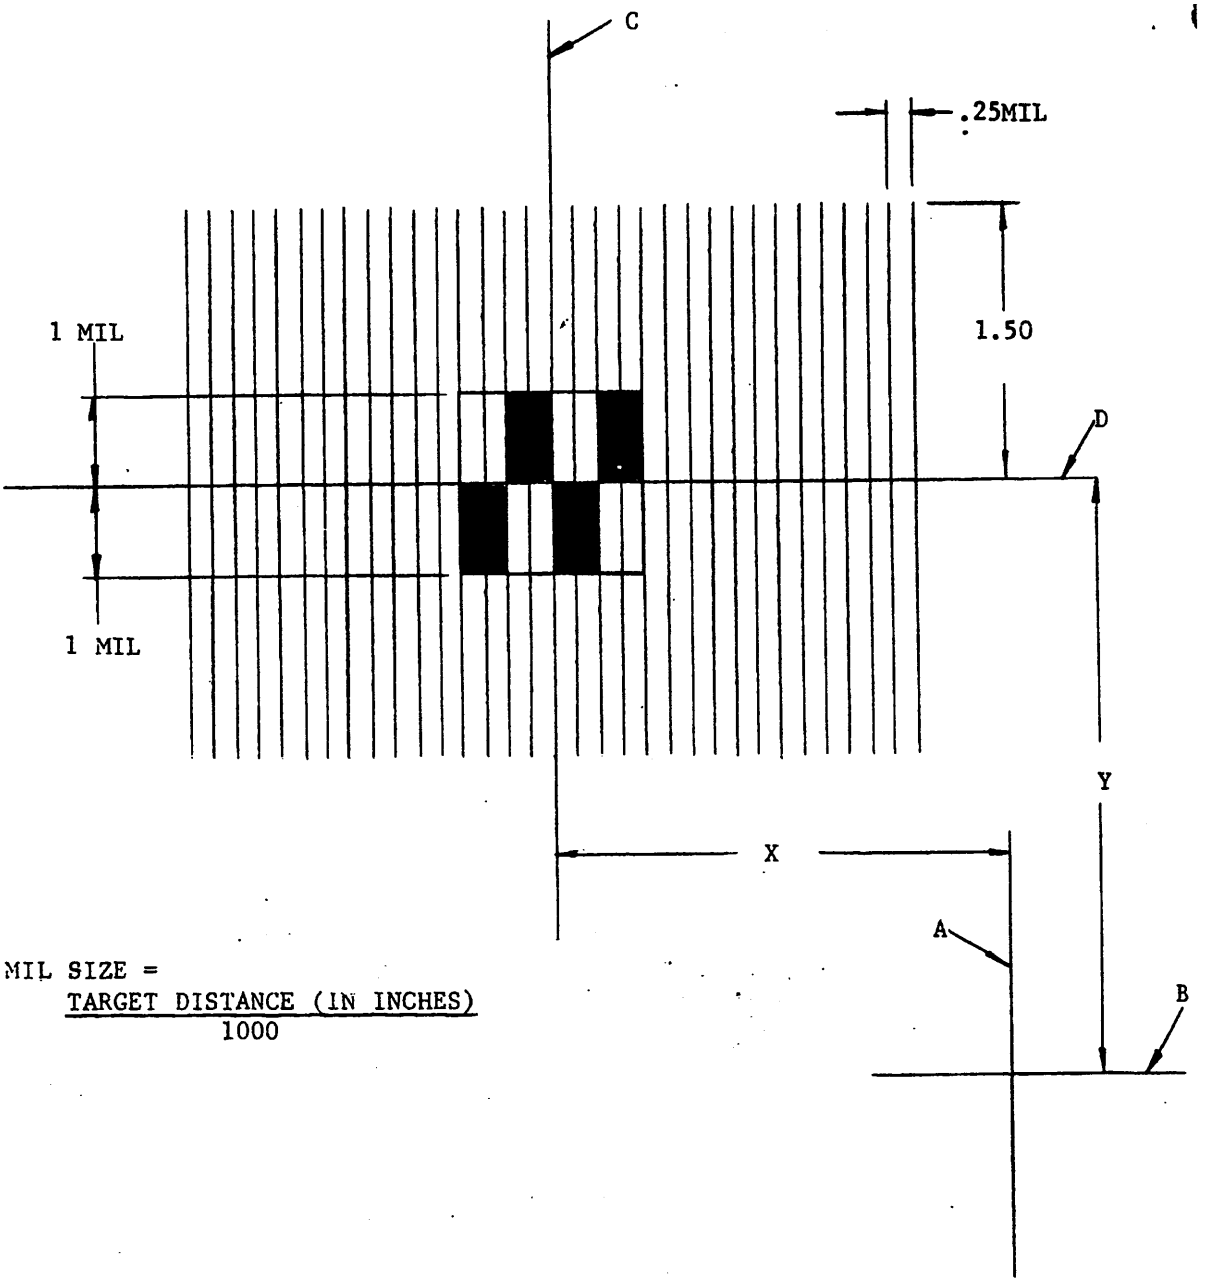

X & Y = Horizontal and vertical displacement between the collimating telescope optical axis when positioned in "V" slot of mounting adapter F10555619 and when positioned in the "V" block secured on top seating surface of Mount M134.

FIGURE II

Source: https://assist.dla.mil -- Downloaded: 202610-22T05:44Z
Check the source to verify that this is the current version before use.

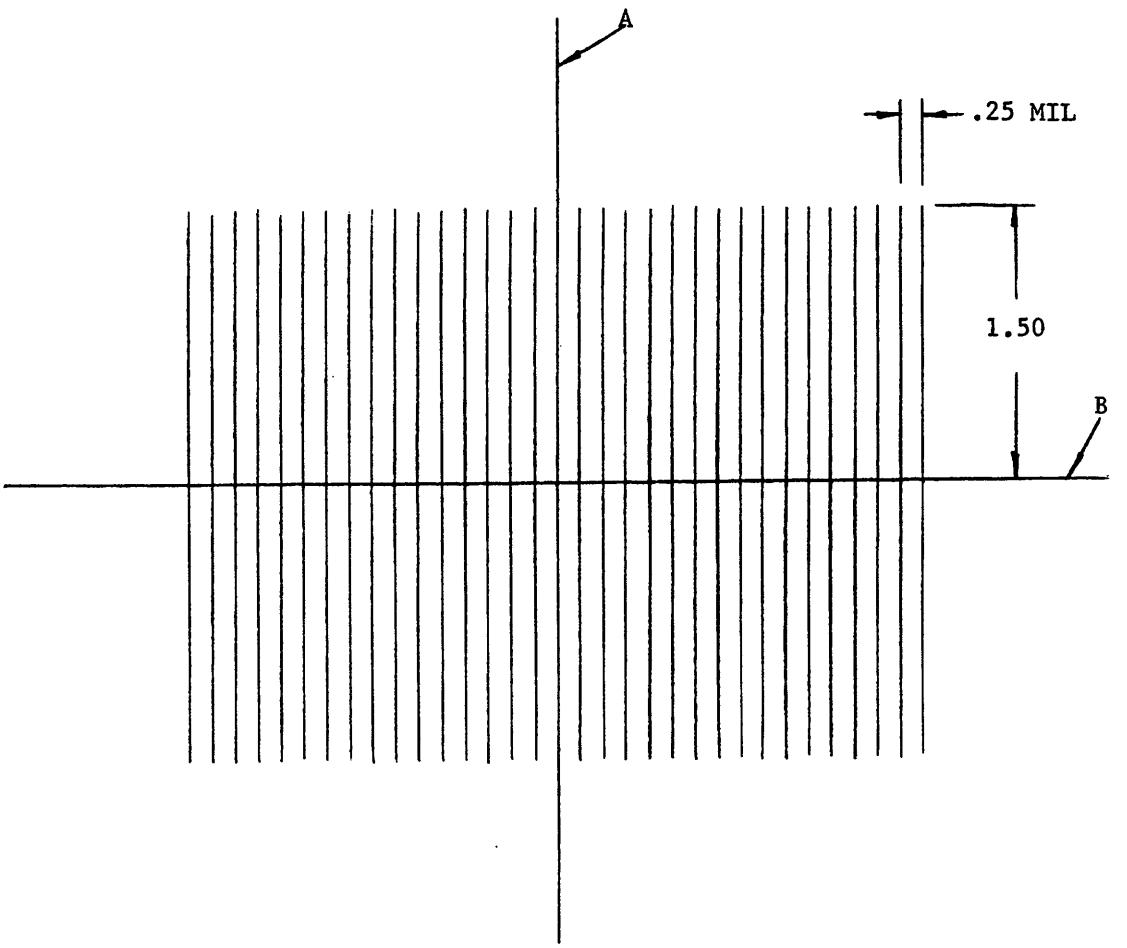

$$\text{MIL SIZE} = \frac{\text{TARGET DISTANCE (IN INCHES)}}{1000}$$

FIGURE III

Source: https://assist.dla.mil -- Downloaded: 202610-22T05:44Z
Check the source to verify that this is the current version before use.

4.6.2.11.2 With vertical reticle line plumb proceed to auto-collimate collimator in the sighting device. This is accomplished by securing a calibrated front surface mirror to a knee or parallel box by means of spring clamps. Position the knee or parallel box on a surface plate and butt machine surface of the sighting device against parallel box or knee. Engage the set pin in the zero setting position (indicating zero azimuth position). Using standard shop techniques auto-collimate the collimator. Auto-collimation is obtained when collimator's reticle is superimposed on itself. Recheck plumb of reticle. When both adjustments have been obtained, secure by tightening set screws.

4.6.2.11.3 Position the device on the mounts top seating surface, engaging the locating pins in the machined keyway. Secure by the means provided. Set fixture, mount and inspection aid adapter as outlined in 4.6.2.2. Sight through the collimator and align target lines A and B (Figure III) to horizontal and vertical centerlines of collimator. Set fixture to a cant angle (Table II). Cant the mount an equal amount in the opposite direction. Cant the inspection aid adapter in the same direction as that of the mount. Set an elevation angle (Table II) into the inspection aid. Position inspection aid on the seating surface of inspection aid adapter. Elevate fixture to position inspection aid level bubble to indicate level. Recheck crosslevel bubble of inspection aid adapter, relevel if required. Recheck level bubble of -inspection aid and adjust by inducing elevation into fixture. When all level bubbles indicate level (inspection aid, inspection aid adapter and pitch level and crosslevel of mount) set the sighting device to the corresponding azimuth correction. (Table II). sight through the collimator and observe coincidence between the tntersecting point target lines A and B and the intersecting point of reticle centerlines. They must coincide within the limits of 3.4.10. Any non-coincidence to be measured on the target. Repeat this procedure at each set of elevation and cant angles specified in Table II of 3.4.10.

4.6.2.12 Operability.- Using standard shop type torque measuring equipment with appropriate adapters determine running torque values of those controls listed in Table III. Perform this test at the temperature specified in Table III to assure conformance with 3.4.11.

5. PREPARATION FOR DELIVERY

5.1 Packaging, packing, and marking. - Packaging, packing, and marking shall be in accordance with MIL-P-14232 and Packaging Data Sheet MIL-P-14232/P8626072. The level of protection shall be as specified in the procurement document.

6. NOTES

6.1 Intended use.- This mount is intended to support the Panoramic Telescope: M113 when mounted on the 105MM Howitzer: M102.

6.2 Ordering data.- Procurement documents should specify the following:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

(a) Title, number, and date of this specification.
(b) Selection of applicable levels of preservation, packaging, and packing (see 5.1).
(c) Applicable packaging data sheet number (see 5.1).
(d) Applicable stock number.

Custodian:

Army - MU

Preparing activity:

Army - MU

project No. 1240-A018

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET

Form Approved
Budget Bureau No. 22-R255

TRUCTIONS: This sheet is to be filled out by personnel, either Government or contractor, involved in the : of the specification in procurement of products for ultimate use by the Department of Defense. This sheet provided for obtaining information on the use of this specification which will insure that suitable products be procured with a minimum amount of delay and at the least cost. Comments and the return of this form be appreciated. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments suggestions submitted on this form do not constitute or imply authorization to waive any portion of the renced document(s) or serve to amend contractual requirements.

CIFICATION

ANIZATION

Y AND STATE

CONTRACT NUMBER

ERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

HAS ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

IS THE SPECIFICATION RESTRICTIVE?

☐ YES ☐ NO *(If "yes", in what way?)*

REMARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity)*

SUBMITTED BY *(Printed or typed name and activity - Optional)*

DATE

FORM 1426 REPLACES EDITION OF 1 OCT 64 WHICH MAY BE USED.

Source: https://assist.dla.mil -- Downloaded: 20261O-22T05:44Z
Check the source to verify that this is the current version before use.