MIL-D-63123A(AR)
17 December 1979
SUPERSEDING
MIL-D-63123(AR)
7 September 1977

# MILITARY SPECIFICATION

# DISPENSER ASSEMBLY

This Specification is approved for use by the U.S. Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

## 1. SCOPE

1.1 This Specification covers the performance and acceptance inspection requirements for the Dispenser Assembly associated with the M130 Aircraft General Purpose Dispenser.

## 2. APPLICABLE DOCUMENTS

2.1 Issue of documents. The following documents of the issue in effect on date of invitation for bids or request for proposals, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-48078 - Ammunition, Standard Qualtiy Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)

FSC: 1095

**Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.**

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

| | | |
|---|---|---|
| MIL-STD-454 | - | Standard General Requirements for Electronic Equipment |
| MIL-STD-781 | - | Reliability Tests: Exponential Distribution |
| MIL-STD-810 | - | Environmental Test Methods |
| MIL-STD-1460 | - | Soldering of Electrical Connections and Printed Wiring Assemblies, Procedures for |

DRAWINGS (See 6.5)

U.S. ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND

| | | |
|---|---|---|
| 9311434 | - | Dispenser Assembly |
| 9312790 | - | Packing and Marking for Drum, Metal, Shipping for Dispenser Assembly and Payload Module Assembly |
| 9321248 | - | Packing and Marking for Box, Exterior for Dispenser Assembly |
| 9313708 | - | Packing and Marking for Drum, Metal, Shipping for M130 Aircraft General Purpose Dispenser |

U.S. ARMY MATERIEL DEVELOPMENT AND READINESS COMMAND

| | | |
|---|---|---|
| 19-48-4138/109-20 PA1000 | - | Unitization Procedures for Boxed Ammunition and Components on Skidded Bases |

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specification procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with the applicable drawings, specifications and standards.

3.2 Components and Assemblies. The components and assemblies shall comply with all requirements specified on Drawing 9311434 and all associated drawings and with all requirements specified in applicable specifications.

3.3 Functioning. The dispenser assembly, having successfully completed burn-in (See 4.5.7), shall perform as specified herein.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

3.3.1 Input. In both the Chaff and Flare modes, upon receipt of a 22.5 to 30 volt direct current (d.c.) dispense pulse, fire 30 payloads in sequence, 1 through 30.

3.3.2 Output. Each output terminal of the dispenser assembly shall be capable of providing 5.25 ± 1.00 amperes d.c. for 15 milliseconds minimum into a resistive load of 1.0 ± 0.1 ohm in response to an appropriate input signal.

3.3.3 Power loss. In the event that power to the dispenser is momentarily interrupted, the dispenser assembly shall retain the location of the next position to be fired in the sequence.

3.3.4 Flare detection signal. In the flare mode, upon flare ignition, the dispenser assembly shall provide a signal of 6.5 volts d.c. minimum into a resistive load of 330 ohms.

3.3.5 Stray voltage. There shall be no stray voltage between any of the 30 firing contacts and ground when tested in accordance with 4.5.1.

3.4 Environmental requirements. The dispenser assembly shall perform as specified in 3.3 after exposure to the environments specified herein. Temperature limits for all tests are defined in MIL-STD-781, Test Level F.

3.4.1 Aircraft vibration. The dispenser assembly shall perform all functions satisfactorily after being subjected to the transportation vibration requirements of MIL-STD-810 Method 514.2, Procedure IIc. The dispenser shall be vibrated along three mutually perpendicular axes as shown in Figure 1. The payload module shall be loaded with 30 inert flares for this test.

3.4.2 Transportation vibration. The dispenser assembly shall perform all functions satisfactorily after being subjected to the transportation vibration requirements of MIL-STD-810, Method 514.2, Procedure X using curve AW of Figure 514.2-7 (change curve to 0.8" displacement (double amplitude between 5&6 Hz). The dispenser shall be vibrated along three mutually perpendicular axes as shown in Figure 1. The payload module shall be loaded with 30 inert flares for this test.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

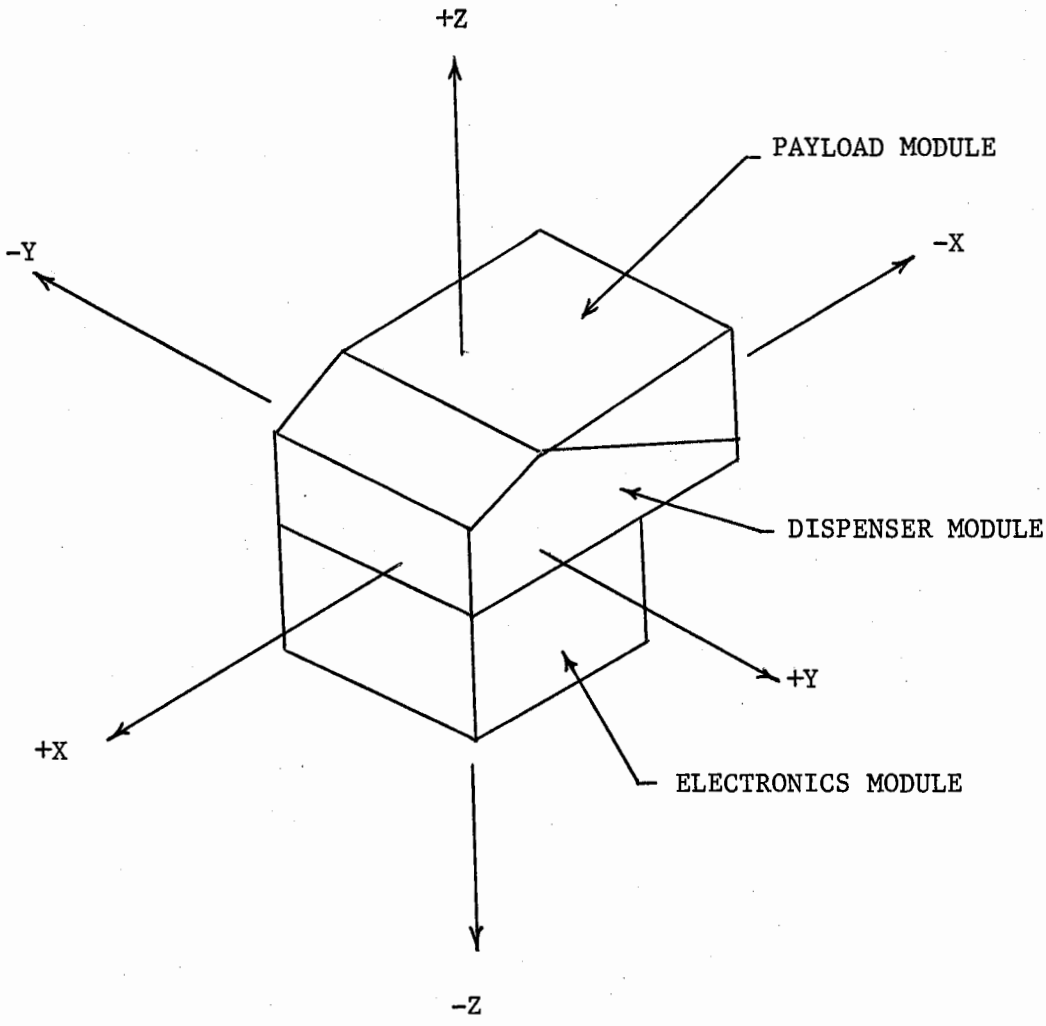



Figure 1. Dispenser System Test Axis Orientation

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

3.4.3 Humidity. The dispenser assembly shall perform all functions satisfactorily after being subjected to MIL-STD-810, Test Method 507.1, Procedure I, (10 days).

3.4.4 High temperature. The dispenser assembly shall perform all functions satisfactorily at +54°C according to MIL-STD-810, Test Method 501.1

3.4.5 Low temperature. The dispenser assembly shall perform all functions satisfactorily at -54°C according to MIL-STD-810, Test Method 502.1

3.5. Wiring and soldering. Soldering of electrical wires, cables, connectors, components and assemblies shall be performed in a thorough, workmanlike manner in accordance with MIL-STD-1460. (Also See 3.7)

3.6 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.7 Cleanliness. Work areas and tools shall be maintained in a clean and orderly condition. All dirt, grease, oil, solder splatter, chips and other contaminating foreign matter shall be promptly removed. Cleaned component leads, terminals, etc., shall not be handled with bare hands. The use of whit lint free gloves is recommended. Smoking, eating or drinking shall not be permitted at any soldering bench or station.

3.8 Workmanship. All parts and assemblies shall be fabricated, loaded and finished in a thorough workmanlike manner, and all manufacturing, processing, and assembling operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corroision products and other foreign matter. The cleaning method used shall not be injurious to any part, nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

## 4. QUALITY ASSURANCE PROVISIONS

4.1 Responsiblity for inspection and standard quality assurance provisions. Unless otherwise specified herein, or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.2 Classification of inspections. The following types of inspections shall be conducted on this item.

a. First Article Inspection
b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with the provisions of 4.3.2 and 4.3.3. The first article sample shall consist of the following items in sample quantities as indicated.

| Part Description | Drawings | Quantity |
|---|---|---|
| Dispenser Assembly | 9311434 | 2 |

4.3.2 Inspections to be performed. See MIL-A-48078 and paragraphs 4.4.2.1 through 4.4.2.17 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

TABLE I. FIRST ARTICLE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Dispenser Assembly | | | | 9311434 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Examination for Defects | 2 | | 3.2 | 4.4.2.13(a) |
| | Burn-in | 2 | | 3.3 | 4.5.7 |
| | Functioning | 2 | | 3.3 | 4.5.1 |
| | Transportation Vibration | 2 | | 3.4.2 | 4.5.5 |
| | Aircraft Vibration | 2 | | 3.4.1 | 4.5.4 |
| | Himidity | 2 | | 3.4.3 | 4.5.6 |
| | Performance at High Temperature | 2 | | 3.4.4 | 4.5.2 |
| | Performance at Low Temperature | 2 | | 3.4.5 | 4.5.3 |
| | Examination for Defects | 2 | | 3.2 | 4.4.2.13(a) |

NOTES: The above tests shall be performed in the order indicated. The two units submitted to environmental testing shall not be returned to the deliverable lot.
(a) Delete Major 105 from 4.4.2.13 for First Article Inspection.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078.

4.4.2 Examination. (See MIL-A-48078). Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311426 |
|---|---|---|---|---|---|
| 4.4.2.1 | Cover Assembly, Dispenser | | | | NEXT HIGHER ASSEMBLY 9311434 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Total length, max. | | 0.40% | 3.2 | Gage |
| 102 | Weld incomplete or inadequate | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Protective finish missing or inadequate | | 0.65% | 3.2 | Visual |
| 202 | Marking missing or improper | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil - Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311427 |
|---|---|---|---|---|---|
| 4.4.2.2 | Plate, Mounting, Dispenser | | | | NEXT HIGHER ASSEMBLY 9311434 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 201 | Position of mounting holes (Dispenser Assembly to Electronic Module) | | 0.40% | 3.2 | Gage |
| 202 | Interior dimensions (length and width) | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Protective finish missing or inadequate | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.3 | Breech Plate Assembly | 1 OF 1 | 9311428 |
| | | | NEXT HIGHER ASSEMBLY 9311437 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 201 | Total length | | 0.40% | 3.2 | Gage |
| 202 | Total width | | 0.40% | 3.2 | Gage |
| 203 | Position of dowel pins (2) | | 0.40% | 3.2 | Gage |
| 204 | Position of bores (2) | | 0.40% | 3.2 | Gage |
| 205 | Position of electrical contact holes (30) | | 0.40% | 3.2 | Gage |
| 206 | Position of mounting screw holes (2) | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 301 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311437 |
|---|---|---|---|---|---|
| 4.4.2.4 | Breech Assembly | | | | NEXT HIGHER ASSEMBLY 9311434 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Components loose, damaged, missing or improperly mounted | | 0.40% | 3.2 | Visual |
| 102 | Height of grounding spring improper | | 0.40% | 3.2 | Gage |
| 103 | Soldering improper | | 100% | 3.5 | 4.4.3.7/Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:





Source: https://assist.dla.mil/ Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.5 | Sequencer Assembly (prior to securing sequence cover) | | | | 9311443 |
| | | | | | NEXT HIGHER ASSEMBLY 9311434 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any component damaged, missing or improperly assembled | | 0.40% | 3.2 | Visual |
| 102 | Gasket Sealing Compound missing or inadequate | | 0.40% | 3.2 | Visual |
| 103 | Thread not coated with sealing compound | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:





Source: http://assist.dla.mil - Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.6 | Printed Wiring Board Assembly, Sequence Switch | 1 OF 1 | 9311464 |
| | | | NEXT HIGHER ASSEMBLY 9311443 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Conformal coating missing or improper | | 0.40% | 3.2 | Visual |
| 102 | Insulating compound missing or improper | | 0.40% | 3.2 | Visual |
| 103 | Orientation of connector receptacle polarizing keyway, improper | | 0.40% | 3.2 | Visual |
| 104 | Any component loose, damaged, missing or improperly mounted | | 0.40% | 3.2 | Visual |
| 105 | Soldering improper | | 100% | 3.5 | 4.4.3.7/Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil - Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311482 |
|---|---|---|---|---|---|
| 4.4.2.7 | Cover, Housing, Sequencer | | | | NEXT HIGHER ASSEMBLY 9311443 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Overall length, width, height | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Protective finish missing or inadequate | | 0.65% | 3.2 | Visual |
| 202 | Marking missing, illegible or incorrect | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil - Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.8 | Housing Assembly, Sequencer | | | | 9311484 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 9311443 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Total length, max. | | 0.40% | 3.2 | Gage |
| 102 | Total width, max | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Protective finish missing or inadequate | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:





Source: Military Standards -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311488 |
|---|---|---|---|---|---|
| 4.4.2.9 | Plate Assembly, Sequencer | | | | NEXT HIGHER ASSEMBLY 9311443 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any component missing, damaged or improperly assembled | | 0.40% | 3.2 | Visual |
| 102 | Adhesive potting missing or inadequate | | 0.40% | 3.2 | Visual |
| 103 | Soldering improper or inadequate | | 100% | 3.5 | 4.4.3.7/Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 100% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311493 |
|---|---|---|---|---|---|
| 4.4.2.10 | Flare Sensor Assembly | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Total length housing | | 0.40% | 3.2 | Gage |
| 102 | Potting missing or improper | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Protective finish missing or inadequate | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123 A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.11 | Contact, Spring Loaded, Electrical | | | | 9311514 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 9311437 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Total length (free), min. | | 0.40% | 3.2 | Gage |
| 102 | Total travel (compressed), min. | | 0.40% | 3.2 | Gage |
| 103 | Spring force incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311516 |
|---|---|---|---|---|---|
| 4.4.2.12 | Spring | | | | NEXT HIGHER ASSEMBLY 9311437 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 201 | Thickness, min. | | 0.40% | 3.2 | Gage |
| 202 | Height of tabs above mounting surface | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: http://assist.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-62123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9311434 |
|---|---|---|---|---|---|
| 4.4.2.13 | Dispenser Assembly | | | | NEXT HIGHER ASSEMBLY 9311430 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any component missing, damaged or improperly assembled | | 0.40% | 3.2 | Visual |
| 102 | Identification plate missing or improperly annotated | | 0.40% | 3.2 | Visual |
| 103 | Sealing compound missing or inadequate | | 0.40% | 3.2 | Visual |
| 104 | Sleeving insulation missing or inadequate | | 0.40% | 3.2 | Visual |
| 105 | Functioning Test | | 100% | 3.3 | 4.5.1 |
| 106 | Burn-in | | 100% | 3.3 | 4.5.7 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil - Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.14 | Packing and Marking for Box, Fiberboard for Dispenser Assembly | | | | 9321249 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any packing component missing | | 0.40% | 3.2 | Visual |
| 102 | Packing not thoroughly dry | | 0.40% | 3.2 | Visual |
| 103 | Markings missing, incomplete or illegible | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Box not securely closed | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23 10:21:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.15 | Sealed Barrier Bag, Prior to Packing in Box | | | | 9321248 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Waterproofness of barrier bag destroyed by puncture or separation of heat seal | | 0.40% | 3.2 | Visual |
| 102 | Excess air not exhaused from bag prior to sealing | | 0.40% | 3.2 | Visual |
| 103 | Evidence of crushed box (Note: Packing should be opened if there is evidence of crushing) | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Heat seal of barrier bag located so that one or more subsequent seals cannot be applied | | 0.65% | 3.2 | Visual |
| 202 | Marking of bag incorrect or unidenti-fiable | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-23 02:02
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.16 | Packing and Marking for Box, Exterior for Dispenser Assembly | | | | 9321248 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Barrier bag or filler missing | | 0.40% | 3.2 | Visual |
| 102 | Packing not thoroughly dry | | 0.40% | 3.2 | Visual |
| 103 | Exterior marking missing, incomplete or illegible | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-23 02:02:02
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-D-63123A(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.17 | Packing and Marking for Drum, Metal Shipping for M130 Aircraft General Purpose Dispenser | 1 OF 1 | 9313708 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Cushions missing or not secured | | 0.40% | 3.2 | Visual |
| 102 | Contents not thoroughly dry | | 0.40% | 3.2 | Visual |
| 103 | Any component missing or damaged | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Markings missing, misleading or unidentifiable | | 0.65% | 3.2 | Visual |
| 202 | Fillers insufficient, loose contents | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Functioning. Each dispenser assembly after compliance with 4.5.7 shall be subjected to this test. The test shall be performed as specified in 4.5.1 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.3 it shall be classified defective and removed from the lot.

4.4.3.2 High temperature. Each dispenser assembly submitted for first article shall be subjected to functioning at high temperature. The test shall be performed after Humidity testing (see 4.4.3.6) as specified in 4.5.2 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.4, the first article sample shall be rejected.

4.4.3.3 Low temperature. Each dispenser assembly submitted for first article shall be subjected to functioning at low temperature. The test shall be performed as specified in 4.5.3 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.5, the first article sample shall be rejected.

4.4.3.4 Aircraft vibration. Each dispenser assembly submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.4 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.1 the first article sample shall be rejected.

4.4.3.5 Transportation vibration. Each dispenser assembly submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.5 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.2 the first article sample shall be rejected.

4.4.3.6 Humidity. Each dispenser assembly submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.6 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.3 the first article sample shall be rejected. Following this test, the dispenser assembly shall be subjected to functioning at high and low temperature.

4.4.3.7 Soldering. Each dispenser assembly shall be inspected for soldering in accordance with 3.5. If any wiring or printed circuit card assembly fails to comply with the requirements of 3.5, the unit shall be classified defective and removed from the lot.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4.4 Inspection equipment. The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the "Paragraph Reference/Inspection Method" column of the tables starting with paragraph 4.4.2.1, and the test paragraphs (see 4.5). The contractor shall submit inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and section 6.3 herein.

4.5 Test methods and procedures

4.5.1 Functioning. The dispenser, excluding those conditioned at high or low temperature, shall be conditioned for four (4) hours minimum at 25 ± 5°C (ambient). Provide the minimum input direct current as specified in 3.3.1 at each of the payload firing contacts into the resistive load as specified in 3.3.2 and measure the output of the flare sensor assembly into the resistive load ± 10% as specified in 3.3.4. Dispenser signals shall be initiated in each of the payload select modes to verify conformance to 3.3.1 and 3.3.3. With the dispenser assembly in the flare mode and a lamp of suitable intensity focused on the flare detection sensor, initiate a dispense signal and measure the output of the flare detection assembly to verify conformance to 3.3.4. Repeat functioning test applying the maximum input direct current as specified in 3.3.1. To verify conformance to 3.3.5, apply 28 ± 4 VDC to the dispenser assembly and test for 0.0 ± 0.2 volts maximum across a 3.0 ± 0.5 ohm load at each of the 30 fire output terminals in each of the payload select modes.

4.5.2 High temperature. After conditioning at 54° ± 2°C according to MIL-STD-810, Test Method 501.1, the dispenser assembly shall be subjected to the functioning test of 4.5.1 at high temperature.

4.5.3 Low temperature. After conditioning at -54° ± 2°C according to MIL-STD-810, Test Method 502.1, the dispenser assembly shall be subjected to the functioning test of 4.5.1 at low temperature.

4.5.4 Aircraft vibration. This test shall be performed as specified in MIL-STD-810, Method 514.2, Procedure IIc assuming the number of missions to be greater than 100. Following this test, examine each dispenser assembly for evidence of damage and submit each item to the functioning test of 4.5.1.

4.5.5 Transportation vibration. This test shall be performed as specified in MIL-STD-810, Method 514.2, Procedure X using curve AW of Figure 514.7 (change curve to 0.8" displacement (double amplitude) between 5&6 Hz). Following this test, examine each dispenser assembly for evidence of damage and submit each item to the functioning test of 4.5.1.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.5.6 Humidity. This test shall be performed as specified in MIL-STD-810, Test Method 507.1, Procedure I, (10 days).

4.5.7 Burn-in. Each dispenser assembly shall successfully complete a minimum of two cycles of burn-in in accordance with procedures of MIL-STD-781. The temperature limits shall be 71 ± 2°C (high), 25 ± 2°C (ambient) and -54 ± 2°C (low) with vibration peak acceleration value of 2.2g ± 10% at a frequency between 20 and 60 hz and a nominal voltage of 28 ± 2 VDC. Actual test duration shall be determined by thermal survey in accordance with MIL-STD-781. If desired, only the Sequencer Assembly (Dwg. 9311443) of the test item need be subjected to burn-in.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging.

5.1.1 Level A. Preservation and packaging shall be as specified on Drawing 9321248 when shipped as a repair part; or Drawing 9313708 when shipped as part of the M130 Dispenser System.

5.2 Packing.

5.2.1 Level A. - Packing shall be as specified on Drawing 9321248 when shipped as a repair part; or Drawing 9313708 when shipped as part of M130 Dispenser System.

5.3 Marking.

5.3.1 Level A. Marking shall be as specified on Drawing 9321248 when shipped as a repair part; or Drawing 9313708 when shipped as part of M130 Dispenser System.

5.4 Unitization.

5.4.1 Level A. Only when shipped as part of the M130 Dispenser System, the dispenser assembly in the drum shall be unitized in accordance with Dwg. 19-48-4138/109-20 PA1000 (DARCOM Ammo Center).

6. NOTES

6.1 Intended use. The Dispenser assembly is part of the Aircraft General Purpose Dispenser, M130.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

6.2 Ordering data. Procurement documents shall specify the following:

a. Title, number and data of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.

6.3 Submission of inspection equipment designs for approval. (See MIL-A-48078) Submit equipment designs as required to Commander, U.S Army Armament Research and Development Command, DRDAR-QAA-I, Dover, New Jersey 07801.

6.4 Distribution of ammunition data cards and test data. Distribution of data cards shall include the following: Commander, U.S Army Armament Research and Development Command, Attn: DRDAR-QAA-M, Dover, New Jersey 07801.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament Research and Development Command (ARRADCOM) may also include drawings prepared by, and identified as, Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under compliance of ARRADCOM.

6.6 Changes from previous issue. Asterisks are not used in this revision with respect to the previous issue, due to the extensiveness of the changes.

Custodian:
Army-AR

Preparing Activity:
Army-AR

Project No: 1095-A-126



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.