MIL-T-81077A(OS)
10 October 1966
Superseding
MIL-T-81077(Wep)
26 May 1964

MILITARY SPECIFICATION

TEST SET, ELECTRICAL CABLE

MARK 444 MOD 0

(For Torpedo Mk 46 Mods 0 and 1)

This specification has been approved by the Naval Ordnance Systems Command, Department of the Navy

1. SCOPE

1.1 Scope. This specification covers the Test Set, Electrical Cable, Mk 444 Mod 0, LD 535760, referred to herein as the "cable tester." The cable tester is of one class and one type. (For the intended use of the cable tester, see 6.1.)

2. APPLICABLE DOCUMENTS

2.1 Government documents. The following documents of the issue in effect on date of invitation for bids or request for proposal form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

PPP-B-636	Boxes, Fiber

MILITARY

MIL-P-116	Preservation, Methods of
MIL-S-901	Shockproof Equipment, Class HI (High Impact), Shipboard Application; Tests for
MIL-E-16400	Electronic Equipment, Naval Ship and Shore; General Specification

FSC 1355

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-129	Marking for Shipment and Storage
MIL-STD-130	Identification Marking of U.S. Military Property
MIL-STD-167	Mechanical Vibrations of Shipboard Equipment

DRAWINGS

NAVAL ORDNANCE SYSTEMS COMMAND

LD 535760	Cable Tester (and all documents listed thereon)

(Copies of documents required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

PUBLICATIONS

Consolidated Classification Committee

Uniform Freight Classification Rules

(Application for copies should be addressed to the Consolidated Classification Committee, 202 Chicago Union Station, Chicago 8, Illinois.)

3. REQUIREMENTS

3.1 Preproduction sample. Unless otherwise specified in the contract or order, the preproduction sample shall:

(a) Be manufactured using the procedures specified for production.

(b) Consist of one cable tester.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.

(c) Be tested as specified in Section 4 herein and is for the purpose of determining, prior to starting production, that the supplier's production methods are capable of yielding items that comply with the technical requirements of the contract.

3.2 Basic requirements

3.2.1 Materials and treatments of meterials and parts. Unless otherwise specified in the contract or order, all materials and treatments of materials and parts used in the manufacture of the cable tester shall be in accordance with the requirements specified herein and with the applicable documents listed in LD 535760.

3.2.2 Gages. The supplier shall provide whatever gages are necessary and adequate to ensure that the materials and parts of the cable tester will meet dimensions and requirements shown on the applicable documents listed in LD 535760. When requested by the supplier, the procuring activity will furnish existing drawings of pertinent Naval final inspection gages for use only in the designing of the supplier's gages. This action does not relieve the supplier of the responsibility for designing and manufacturing the gages needed for the satisfactory fulfillment of the contract requirements.

3.2.3 Interchangeability. Individual parts of assemblies fabricated in agreement with their applicable drawings and specifications shall be interchangeable with mating parts of the unit and other like units. If deviations greater or smaller than the tolerances shown on the drawings or specifications are required for interchangeability, or if hand-fitting beyond that shown on the applicable drawings is required, then changes in dimensions are necessary and revision and correction of the applicable drawings or specification is required. See 3.2.4.

3.2.4 Conflicting requirements. Conflicting requirements arising between this specification or any specifications, publications, or drawings listed herein shall be referred in writing to the procuring agency or appointed agent for interpretation, clarification, and resolution (or correction).

3.2.5 Inspection and test equipment and facilities. The supplier shall furnish and maintain all necessary inspection and test equipment and facilities and shall provide personnel for performing all acceptance tests specified herein. The test equipment shall be adequate to permit performance of the required acceptance tests for the cable tester.

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the current version before use.

3.3 Performance requirements and physical characteristics

3.3.1 Operating modes. The cable tester shall be capable of measuring insulation resistance and checking for continuity in each of three modes as follows:

(a) Mode I (Automatic): When in the Automatic Mode, the cable tester shall step through in sequence, and stop on cable fault. The cable tester can be advanced manually, one or more steps, to continue the test.

(b) Mode II (Manual): When in the Manual Mode, the cable tester will advance, step-by-step, with manual advance.

(c) Mode III (Test Jacks): When in the Test Jacks Mode, accurate measurements of resistance may be made using an external meter. These measurements can be made when the TEST SELECTOR switch is in either the INSULATION or the CONTINUITY position.

3.3.2 Insulation resistance. The cable tester shall be capable of detecting and indicating insulation resistance of less than one megohm, measured at 30 vdc minimum.

3.3.3 Continuity. The cable tester shall be capable of checking continuity by detecting and indicating conductor resistance exceeding one ohm, measured with a current of 1.0 ampere minimum.

3.3.4 Reset. With the RESET switch depressed, the TEST NUMBER monitor shall advance to the number 01.

3.4 Environmental requirements. Unless otherwise specified the cable tester shall be capable of conforming to the performance requirements and physical characteristics of this specification during and after exposure, at any temperature in the applicable range, to the environments and all conditions specified in this section.

3.4.1 Temperature. The cable tester shall be capable of conforming to the temperature requirements of MIL-E-16400, Class 4.

3.4.2 Humidity. The cable tester shall be capable of conforming to the humidity requirements of MIL-E-16400.

3.4.3 Shock. The cable tester shall be capable of conforming to the shock requirements of MIL-S-901, Grade I, Type A, lightweight equipment, except that the cable tester shall be in the nonoperating condition, and the hammer drops shall be from 1 foot, 1-1/2 feet, and 3 feet.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.

3.4.4 Vibration. The cable tester shall be capable of conforming to the Type I vibration requirements of MIL-STD-167, except that the Variable Frequency and Endurance requirements are replaced by the following frequency requirements (3.4.4.1).

3.4.4.1 Vibration frequency (variable). The cable tester in the operating condition, shall withstand vibration (see 6.3.1) from 5 to 15 cps at a table amplitude of 0.030 plus or minus 0.006 inch and from 16 to 25 cps at a table amplitude of 0.020 plus or minus 0.004 inch. The vibrations shall be applied in discrete frequency intervals of 1 cps, and shall be applied for 1 minute at each interval.

3.4.5 Inclination. The cable tester shall be capable of conforming to the inclination requirements of MIL-E-16400.

3.5 Service life. The service life of the cable tester shall be 5 years of normal service with a minimum of 60 days between calibration.

3.6 Identification. The cable tester shall be permanently identified in accordance with MIL-STD-130 and the applicable documents listed in LD 535760.

3.7 Workmanship. The workmanship and finish shall be of sufficiently high grade to ensure satisfactory operation consistent with the requirements of this specification. All parts used in the assembly shall be thoroughly clean and free of excess materials, chips, and loose or splattered foreign materials. The standards of workmanship exhibited in any approved preproduction sample, subject to any qualifications stated in the Government's notice of approval, shall be determinative of the requirements of the contract relative to workmanship insofar as not specifically covered by applicable specifications.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, the supplier may utilize his own facilities or any commercial laboratory acceptable to the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure that supplies and services conform to prescribed requirements.

4.2 Classification of inspection. Inspection of the cable tester shall be classified as follows:

(a) Preproduction inspection

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the current version before use.

(1) Preproduction sample (see 4.3.1).

(2) Preproduction tests (see 4.5).

(b) Periodic production inspection.

(1) Periodic production sampling (see 4.3.2).

(2) Periodic production tests (see 4.6).

(c) Acceptance inspection.

(1) Acceptance sampling (see 4.3.3).

(2) Acceptance tests and examinations (see 4.7).

4.3 Sampling

4.3.1 Preproduction sample. The preproduction sample, manufactured in accordance with 3.1, shall be subjected to the preproduction tests detailed in 4.5 at an activity designated by the procuring activity. Acceptance of the preproduction sample shall be based on no defects in the sample. Further production of the cable tester by the supplier, prior to approval of the preproduction sample, shall be at the supplier's risk.

4.3.2 Periodic production sampling. Periodic production tests detailed in 4.6 shall be performed at an activity designated by the procuring activity. Samples shall consist of cable testers that have satisfactorily passed the acceptance tests and examinations detailed in 4.7, and shall be selected as follows:

Step 1. Upon initiation of preduction, randomly select one unit from each group of 20 units. Upon satisfactory compliance of samples selected from three consecutive groups, proceed to Step 2.

Step 2. Randomly select one unit from each group of 50 units. Continue with Step 2 for the balance of the contract or until a defective unit is found.

4.3.2.1 Defective units. When a defective unit is found in any group the supplier shall:

(a) Determine the cause of the defect.

(b) Determine if the defect is an isolated case.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.

(c) Take the necessary action to eliminate the defect from units on hand and, if so directed by the procuring activity, from those units previously shipped.

(d) Submit to the procuring activity for approval the proposed corrective action to prevent recurrence of the defect.

(e) Return to Step 1 (4.3.2) and proceed as indicated for inspection of units subsequently produced.

4.3.3 Acceptance sampling. The tests and examinations detailed in 4.7 shall be conducted on each cable tester to be delivered; therefore, there is no sampling plan for acceptance. Defective units shall be rejected.

4.4 Test conditions. Unless otherwise specified, the cable testers shall be subjected to tests under the following conditions:

(a) Temperature. 60 to 95 degrees F (room ambient).

(b) Humidity (Relative). Room ambient, up to 95 percent.

(c) Altitude. Normal ground atmospheric pressure.

4.5 Preproduction tests. The preproduction sample, after satisfactorily passing the acceptance tests and examinations (4.7), shall be subjected to the preproduction tests (4.5.2 and 4.5.3). Certified inspection data covering the results of preproduction tests shall be forwarded to the Naval Ordnance Systems Command. Certified inspection data shall consist of the following:

(a) Date of tests and names of persons conducting tests.

(b) Run or test plan used.

(c) Serial number of the cable tester.

(d) Test results of preproduction tests (4.5.2 through 4.5.3).

4.5.1 Preproduction test equipment. The following items of test equipment, or equivalent items, will be required to perform the tests specified herein:

(a) Ohmmeter - Capable of measuring from 1 ohm to 1 megohm, with a full scale accuracy of 5 percent.

(b) Temperature-humidity chamber - Capable of providing the environment specified in 3.4.1 and 3.4.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.

(c) Shock test fixture - Capable of applying shock as specified in 3.4.3.

(d) Vibration test fixture - Capable of applying vibration as specified in 3.4.4 and 3.4.4.1.

(e) Inclination test fixture - Capable of providing inclination attitudes as specified in 3.4.5.

(f) Cable connection in accordance with Figure 1.

4.5.2 Environmental tests. The cable tester shall be subjected to the following environmental tests. Unless otherwise specified, inability of the cable tester to satisfactorily pass the acceptance tests and examination, subsequent to the environmental tests, shall constitute a failure.

4.5.2.1 Temperature. Mount the cable tester in the temperature-humidity chamber.

(a) Nonoperating condition. Subject the cable tester, in the nonoperating condition, to the nonoperating condition temperature test specified in MIL-E-16400.

(b) Operating condition. Subject the cable tester, in the operating condition, to the operating condition temperature test specified in MIL-E-16400.

4.5.2.2 Humidity. Mount the cable tester in the temperature-humidity chamber and subject it to the humidity test specified in MIL-E-16400.

4.5.2.3 Shock. Mount the cable tester as specified in the shock test in MIL-E-16400, and secure it to the shock test fixture. Subject the cable tester to the shock tests specified in MIL-S-901, Grade I, Type A, lightweight equipment, with the exceptions specified in 3.4.3 herein.

4.5.2.4 Vibration. Mount the cable tester on the vibration test fixture as specified in MIL-STD-167. Subject the cable tester to vibration at the amplitudes and for the time periods specified in 3.4.4.1 herein.

4.5.2.5 Inclination. Mount the cable tester on the inclination test fixture for the inclination test as specified in MIL-E-16400, and subject the cable tester to the inclination test as specified therein.

4.5.3 Accelerated life. Subject the cable tester to the accelerated life tests specified in MIL-E-16400. Degradation of performance below specified requirements during this test, or inability to pass the acceptance test subsequent to this test, shall constitute a failure.

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the current version before use.

4.6 Periodic production tests. The periodic production sample, selected in accordance with 4.3.2, shall be subjected to the periodic production tests (4.6.2). The periodic production sample shall then be subjected to and satisfactorily pass the acceptance tests and examinations (4.7). Certified inspection data covering the results of the periodic production tests shall be forwarded to the Naval Ordnance Systems Command. Certified inspection data shall consist of the following:

(a) Items 4.5(a) through 4.5(c).

(b) Test results of periodic production tests (4.6.2).

4.6.1 Periodic production test equipment. The following items of test equipment, or equivalent items, will be required to perform the periodic production tests:

(a) Temperature chamber (see 4.5.1(b)).

(b) Vibration test fixture (see 4.5.1(d)).

4.6.2 Periodic production tests. Subject the periodic production sample to the following tests:

(a) Temperature (4.5.2.1).

(b) Vibration (4.5.2.4).

4.7 Acceptance tests and examinations. The following tests and examinations (4.7.2 through 4.7.4) shall be conducted on each cable tester to be delivered. Failure of the unit to pass any test specified herein shall be considered cause for its rejection.

4.7.1 Acceptance test equipment. An ohmmeter (4.5.1(a)) and checkout cable (4.5.1(f)) are required to perform the acceptance tests specified herein.

4.7.2 Acceptance test setup

(a) Set POWER switch on the front panel of the cable tester to OFF.

(b) Remove the power cable from inside the cover of the cable tester and connect it to the POWER INPUT (J2 connector) on the front panel.

(c) Connect the other end of the power cable to a 110 vac (nominal), 60 cps, source.

(d) Connect leads from the ohmmeter to the TEST JACKS.

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the currentversion before use.

(e) Connect the checkout cable to connectors J1 and J3 as illustrated in Figure 1.

4.7.3 Performance tests. With the cable tester connected to test equipment as specified in 4.7.2, conduct the following tests:

4.7.3.1 Insulation resistance

(a) Rotate TEST MODE switch to AUTO position.

(b) Rotate TEST SELECTOR to INSULATION position.

(c) Turn POWER switch to ON. Observe that POWER lamp lights, and that number 01, illuminated in green, appears on the TEST NUMBER monitor.

(d) Depress ADVANCE switch.

(1) Observe that TEST NUMBER monitor will begin counting automatically.

(2) The TEST NUMBER monitor shall stop counting and the number 22 shall be illuminated in red.

(e) Rotate TEST MODE switch to TEST JACKS position.

(f) External ohmmeter shall indicate 825,000 ohms plus or minus 5 percent.

(g) Rotate TEST MODE switch to the AUTO position.

(h) Depress ADVANCE switch.

(1) Observe thatTEST NUMBER monitor resumes counting automatically.

(2) The TEST NUMBER monitor shall stop counting and the number 47 shall be illuminated in red.

(i) Rotate TEST MODE switch to TEST JACKS position.

(j) External ohmmeter shall indicate 825,00 ohms plus or minus 5 percent.

(k) Rotate TEST MODE switch to AUTO position.

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the currentversion before use.

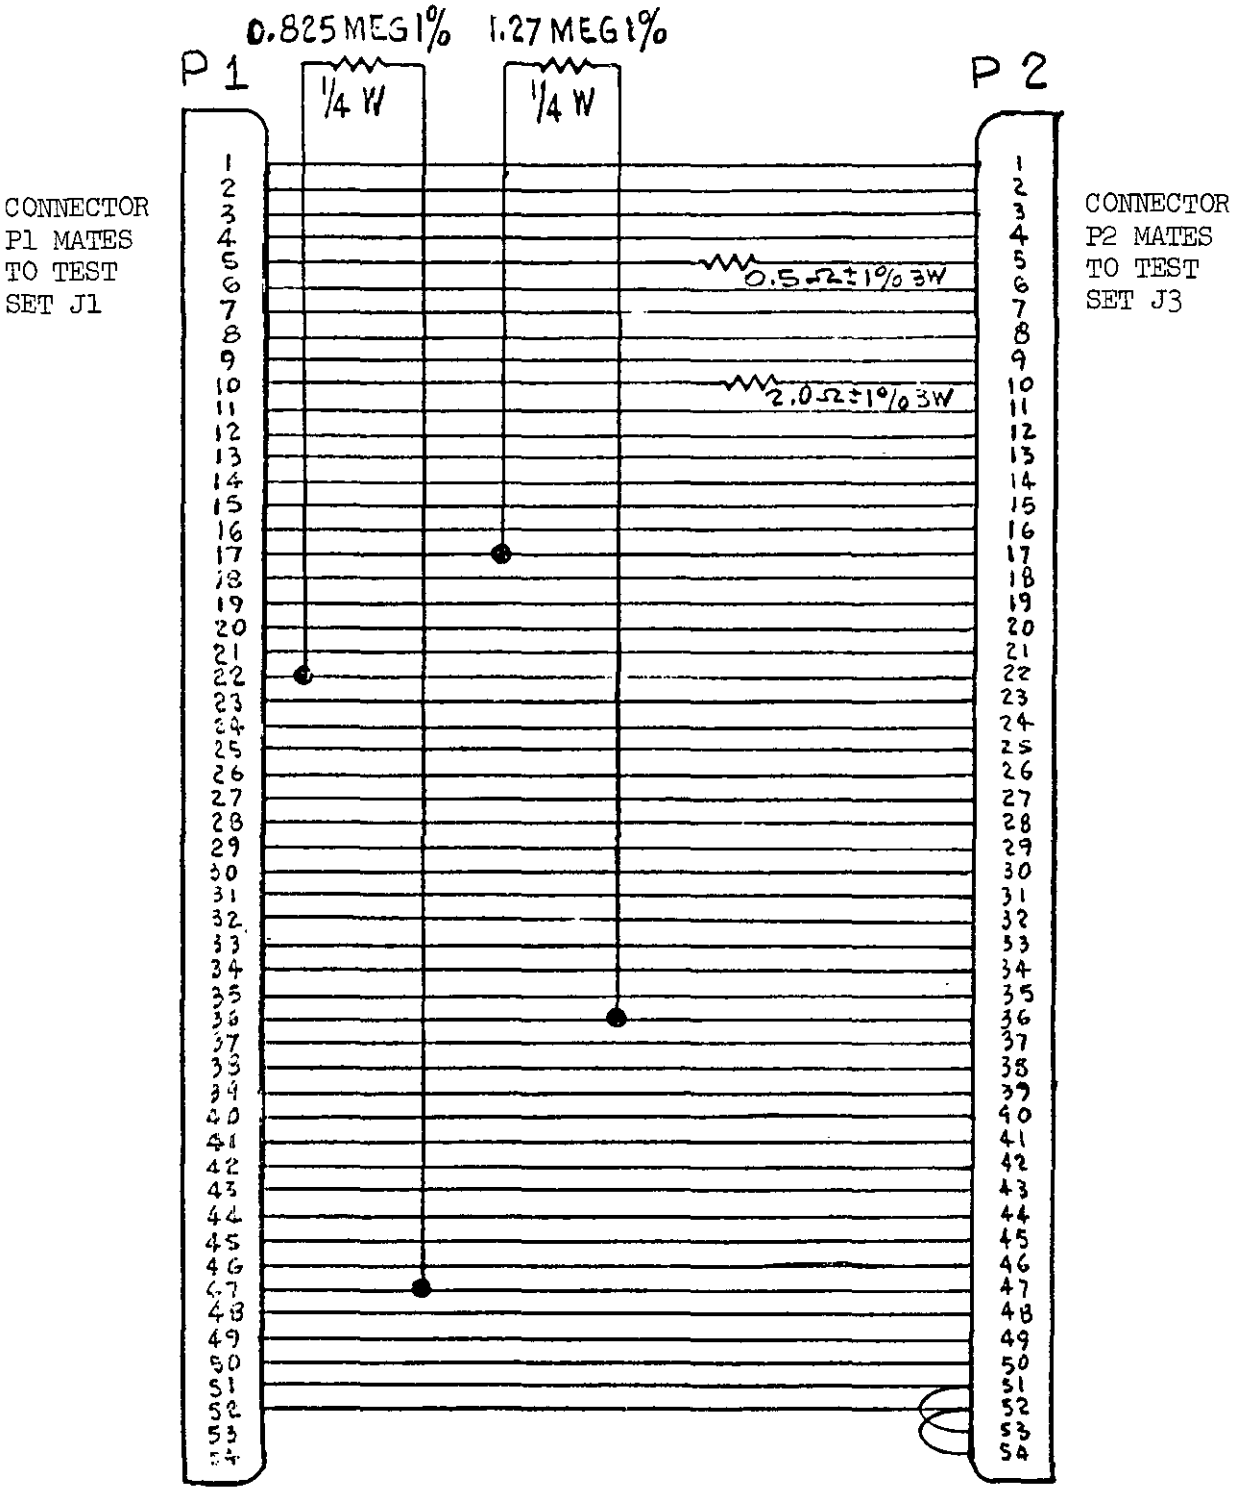


FIGURE 1. CHECKOUT CABLE

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the current version before use.

(l) Depress ADVANCE switch and observe that the TEST NUMBER monitor shall resume counting, automatically, until the "satisfactory end-of-test" has been indicated (see 6.3.5).

(m) Rotate TEST MODE switch to MANUAL position.

(n) Depress ADVANCE switch, repeatedly, until number 17, illuminated in green, appears on the TEST NUMBER monitor.

(1) Rotate TEST MODE switch to TEST JACKS position.

(2) External ohmmeter shall indicate 1.27 megohm plus or minus 5 percent.

(3) Rotate TEST MODE switch to MANUAL position.

(o) Depress ADVANCE switch, repeatedly, until number 22, illuminated in red, appears on the TEST NUMBER monitor.

(1) Rotate TEST MODE switch to TEST JACKS position.

(2) The value shown shall be 825,000 ohms plus or minus 5 percent.

(3) Rotate TEST MODE switch to MANUAL position.

(p) Depress ADVANCE switch, repeatedly, until the number 36, illuminated in green, appears on the TEST NUMBER monitor.

(1) Rotate TEST MODE switch to TEST JACKS position.

(2) The value shown on the external ohmmeter shall be 1.27 megohm plus or minus 5 percent.

(3) Rotate TEST MODE switch to MANUAL position.

(q) Depress ADVANCE switch, repeatedly, until number 47, illuminated in red, appears on the TEST NUMBER monitor.

(1) Rotate TEST MODE switch to TEST JACKS position.

(2) The value shown on the external ohmmeter shall be 825,000 ohms plus or minus 5 percent.

(3) Rotate TEST MODE switch to MANUAL position.

Source: https://assist.dla.mil -- Downloaded: 2026l0-23T04:58Z
Check the source to verify that this is the current version before use.

(r) Depress the ADVANCE switch, repeatedly, and observe that the TEST NUMBER monitor shall resume advancing one number, illuminated in green, with each switch operation until a "satisfactory end-of-test" has been indicated (see 6.3.5).

4.7.3.2 Continuity

(a) Rotate TEST MODE switch to AUTO position.

(b) Rotate TEST SELECTOR to CONTINUITY position.

(c) Observe that number 01, illuminated in green, appears on TEST NUMBER monitor.

(d) Depress ADVANCE switch.

(1) Observe that TEST NUMBER monitor will begin counting, automatically.

(2) The TEST NUMBER monitor shall stop counting and the number 10 shall be illuminated in red.

(e) Rotate the TEST MODE switch to the TEST JACKS position.

(f) The value shown on the external ohmmeter shall be 2.0 ohms nominal.*

(g) Rotate the TEST MODE switch to MANUAL position.

(h) Depress RESET switch and observe that TEST NUMBER monitor advances until the "satisfactory end-of-test" has been indicated (see 6.3.5).

(i) Depress ADVANCE switch repeatedly, until the number 05, illuminated in green, appears on the test number monitor.

(1) Rotate TEST MODE switch to TEST JACKS position.

(2) The value shown on the external ohmmeter shall be 0.5 ohm nominal.*

(3) Rotate TEST MODE switch to AUTO position. The TEST NUMBER monitor shall indicate 10 in red.

*Due to the low current applied with the ohmmeter, this reading may be higher by approximately 0.6 ohm.

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the current version before use.

(j) Jumper J3-10 to J1-10; TEST NUMBER indicator shall advance one step to position 11 and shall advance until position 01 is indicated.

(k) Turn POWER switch to OFF.

4.7.4 Examination of product. The cable tester shall be examined for conformance to the requirements specified herein and LD 535760. Unless otherwise specified, the presence of any one of the following defects shall constitute a failure:

(a) Cable tester not complete; component parts missing.

(b) Component parts not new; evidence of reclaimed, used, or salvaged components.

(c) Evidence of use of unauthorized materials and repairs.

(d) Configuration does not conform to drawing requirements.

(e) Electrical connectors and pin location imcomplete or incorrect.

(f) Identification plate and markings not attached, incorrectly located, illegible, or data incomplete.

(g) Packing and packaging does not conform to Section 5.

(h) Lamps do not light as required.

(i) Wires incorrectly wrapped around terminals.

(j) Components positioned against terminals or other sharp objects.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging. Preservation and packaging shall be Level A or C as specified (see 6.2). Unit package shall consist of one cable tester.

5.1.1 Level A. Preservation and packaging of the cable tester for Level A shipment shall be in accordance with Specification MIL-P-116. Cleaning shall be accomplished in accordance with Process C-1 and drying, if required, shall be accomplished in accordance with Procedure D-1. Equipment case shall serve as rigid metal container.

5.1.2 Level B. Not applicable.

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the currentversion before use.

5.1.3 Level C. Cleaning, drying, preservation, and packaging of the cable tester shall be accomplished in accordance with the supplier's own commercial practice when such practices have been proven by testing or examination to conform to all applicable requirements.

5.2 Packing. Packing shall be Level A or C as specified (see 6.2). Shipping containers shall include one unit package.

5.2.1 Level A. The equipment, when preserved and packaged in accordance with 5.1, shall be overpacked in containers complying with PPP-B-636, Type CF, Class, Weather-Resistant.

5.2.2 Level B. Not applicable.

5.2.3 Level C. The equipment, when preserved and packaged in accordance with 5.1, shall be overpacked in compliance with Uniform Freight Classification Rules or other common carrier regulations applicable to the mode of transportation.

5.2.4 Cushioning or dunnage. Supplier shall provide sufficient cushioning or dunnage material to adequately protect equipment from damage due to shock and vibration loads encountered during handling and transportation, and to ensure safe delivery to receiving activity.

5.3 Marking

5.3.1 Normal marking. In addition to the markings required by the contract or order, unit packages and shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

6.1 Intended use. The cable tester is intended for use in checking the continuity and insulation resistance of the accessible cables within the afterbody, Gas Generator Mk 8 Mod 0, Exercise Head Mk 83 Mod 0, and Warhead Mk 103 Mod 0. The cable tester is a test set using a bridge comparison technique. When an unacceptable conductor is discovered in the cable being tested, the particular test number will be illuminated in red on the TEST NUMBER monitor. The TEST MODE switch can then be set in the TEST JACKS position and an external ohmmeter connected to the TEST JACKS to read an accurate resistance of the unacceptable conductor. The capacity of the cable tester is 52 conductors. The cable tester measures resistance with an accuracy of plus or minus 20 percent.

6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number, and date of this specification.

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the currentversion before use.

(b) Serialization requirements.

(c) Required level of preservation and packaging.

(d) Assigned activity for preproduction and periodic production tests.

(e) All additional samples required shall be provided and inspected at the expense of the supplier when such additional samples are required because of failure of any test set(s) to pass the prescribed periodic production inspections.

(f) Any exceptions to this specification.

6.3 Definitions

6.3.1 Vibration. Vibration is a sinusoidal motion defined by amplitude and frequency. The amplitude may refer to displacement or to acceleration. The displacement is one-half the total excursion given in inches. The acceleration is given in multiples of gravitational acceleration (g's). The frequency is given in cycles per second (cps).

6.3.2 Shock. Shock is an abrupt change in the motion of a body resulting from the sudden application of a large external force of short duration. Shock is described as a pulse in multiples of gravitational acceleration (g's), duration in units of time, milliseconds (ms), and a shock pulse approximating a one-half sine wave. The time duration shall be measured between two points where two lines, tangent at maximum slope, intersect the "zero" g line.

6.3.3 Temperature. The temperature of the environment to which the cable tester is exposed, expressed in degrees Fahrenheit (F).

6.3.4 Humidity. The relative humidity of the environment to which the cable tester is exposed, expressed as a percent.

6.3.5 Satisfactory "end of test". A satisfactory "end of test" shall be indicated when number 01 appears, illuminated in green, on the TEST NUMBER monitor on the front panel of the cable tester.

6.4 Preparation for delivery criteria. Criteria for use of the proper level of preservation, packaging, and packing shall be as follows:

6.4.1 Level A. This level shall be used for those items which are to be shipped to indeterminate destinations or stored under indeterminate conditions for redistribution anywhere.

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the current version before use.

6.4.2 Level B. Not applicable.

6.4.3 Level C. This level shall be used only when it is definitely known that the packaged item is to be shipped to domestic installations for immediate use at the first receiving activity.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.

APPENDIX

10.0 ACCEPTANCE TEST DATA SHEETS

10.1 Scope. This Appendix shall be used to record the acceptance inspections (specified in 4.7) conducted on each Electrical Cable Test Set Mk 444 Mod 0. The values recorded herein shall be used to verify whether or not the item tested has successfully passed the acceptance tests.

10.2 Verification of inspection. Where space is provided in the data sheet to indicate the value or specific reading obtained, the specific reading shall be recorded if a limit or limits are given in the "limits" column. The individual performing the test shall insert his initials above the value observed and recorded. If limits are not given in the "limits" column, the individual performing the test shall certify that the requirements were satisfactorily met, by inserting his initials in the "reading" column.

Electrical Cable Test Set Serial No. _____

Tested by: _____ _____
Operator Date

Witnessed by: _____ _____
Contractor Inspection Date

Witnessed by: _____ _____
NOSC QC Rep Date

Source: https://assist.dla.mil -- Downloaded: 202610-23T04:58Z
Check the source to verify that this is the current version before use.

Inspection	Reference	Limits	Reading
10.3 Test Data			
10.3.1 Insulation resistance			
(a) POWER lamp lights	4.7.3.1(c)		_____
(b) TEST NUMBER monitor advances to 01, illuminates green	4.7.3.1(c)		_____
(c) TEST NUMBER automatically advances to 22, stops, and illuminates red	4.7.3.1(d)		_____
(d) External ohmmeter indicates:	4.7.3.1(f)	780K to 870K ohms	_____ohms
(e) TEST NUMBER monitor automatically advances to 47, stops, and illuminates red	4.7.3.1(h)		_____
(f) External ohmmeter indicates:	4.7.3.1(j)	780K to 870K ohms	_____ohms
(g) TEST NUMBER automatically advances to "satisfactory-end-of-test"	4.7.3.1(l)		_____
(h) TEST NUMBER monitor advances to 17 (manually), illuminates in green			_____
(i) External ohmmeter indicates:	4.7.3.1(n)	1.21 to 1.33 megohm	_____megohm
(j) TEST NUMBER monitor advances to 22 (manually) illuminates in red	4.7.3.1(o)		_____
(k) External ohmmeter indicates:	4.7.3.1(o)	780K to 870 K ohms	_____
(l) TEST NUMBER monitor advances to 36 (manually), illuminates in green	4.7.3.1(p)		_____

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the current version before use.

Inspection	Reference	Limits	Reading
10.3.1 Insulation resistance (con't)			
(m) External ohmmeter indicates:	4.7.3.1(p)	1.21 to 1.33 megohm	_____megohm
(n) TEST NUMBER monitor advances to 47 (Manually), illuminates in red	4.7.3.1(q)		
(o) External ohmmeter indicates:	4.7.3.1(q)	780K to 870K ohms	_____ohms
(p) TEST NUMBER monitor advances to "satisfactory-end-of-test" (manually)	4.7.3.1(r)		_____
10.3.2 Continuity			
(a) TEST NUMBER monitor advances to 01, illuminates in green	4.7.3.2(c)		_____
(b) TEST NUMBER advances automatically to 10, stops, and illuminates in red	4.7.3.2(d)		_____
(c) External ohmmeter indicates:	4.7.3.2(f)	2.0 ohm*	_____ohm
(d) TEST NUMBER monitor advances automatically to "satisfactory-end-of-test"	4.7.3.2(h)		_____
(e) TEST NUMBER monitor advances to 05, (manually), illuminates in green	4.7.3.2(i)		_____ohm
(f) External ohmmeter indicates	4.7.3.2(i)	0.5 ohm*	_____ohm
(g) TEST NUMBER monitor advances automatically to 10, illuminates in red	4.7.3.2(i)		_____

*This reading may be higher by approximately 0.6 ohm.

Source: https://assist.dla.mil -- Downloaded: 202640-23T04:58Z
Check the source to verify that this is the currenversion before use.

Inspection	Reference	Limits	Reading
10.3.2 Continuity (cont'd)			
(h) TEST NUMBER monitor advances to 11	4.7.3.2(j)		_____
(i) TEST NUMBER monitor advances to 01	4.7.3.2(j)		_____

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:58Z
Check the source to verify that this is the current version before use.