INCH-POUND

MIL-C-19516G(MC)
6 March 1991
SUPERSEDING
MIL-C-19516F(MC)
8 June 1987

MILITARY SPECIFICATION

COAT, MAN'S: POLYESTER/WOOL, GABARDINE; BLUE

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for a blue polyester/wool gabardine dress coat.

1.2 Classification. The coats shall be of one type in the following sizes, as specified (see 6.2):

Schedule of Sizes

Extra Short	Short	Regular	Long	Extra Long
30	30	30	30	
32	32	32	32	
33	33	33	33	
34	34	34	34	
35	35	35	35	35
36	36	36	36	36
37	37	37	37	37
38	38	38	38	38

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commanding General (PSE-C), Marine Corps Research, Development, and Acquisition Command, Washington, DC 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC-NA FSC 8405

DISTRIBUTION STATEMENT A: Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the current version before use.

Schedule of Sizes - continued

Extra Short	Short	Regular	Long	Extra Long
39	39	39	39	39
40	40	40	40	40
41	41	41	41	41
42	42	42	42	42
43	43	43	43	43
44	44	44	44	44
46	46	46	46	46
48	48	48	48	48

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation.

SPECIFICATION

FEDERAL

V-B-871 - Button, Sewing Hole, and Button, Staple, (Plastic)
V-T-276 - Thread, Cotton
V-T-280 - Thread, Gimp, Cotton, Buttonhole
V-T-301 - Thread, Silk
NN-P-71 - Pallet, Material Handling, Wood, Stringer Construction, 2 Way and 4 Way (Partial)
UU-P-268 - Paper, Kraft, Wrapping
DDD-L-20 - Label, For Clothing, Equipage, and Tentage (General Use)
DDD-T-86 - Tape, Textile; Cotton, General Purpose (Unbleached, Bleached, or Dyed)

MILITARY

MIL-C-368 - Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371 - Braid, Textile, Tubular
MIL-F-495 - Finish Chemical, Black, for Copper Alloys
MIL-B-3461 - Button, Insignia, Metal, Uniform and Cap
MIL-C-10176 - Cloth, Gabardine, Wool, Polyester and Wool

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

MIL-P-15011 - Pallet, Material Handling, Wood, Post Construction 4 Way Entry
MIL-P-15064 - Pad, Shoulder and Sleeve-head
MIL-C-15065 - Coat, Fronts
MIL-C-16375 - Cloth, Wigan, Cotton
MIL-B-17757 - Box, Shipping, Fiberboard (Modular Sizes)
MIL-C-29365 - Cloth, Nonwoven: Interlining, Fusible, Nylon and Polyester, Polyamine
MIL-C-43718 - Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon
MIL-C-44192 - Container, Shipping and Storage Coat (Hanger Pack)
MIL-C-82252 - Cloth, Broadcloth, Wool, and Wool Synthetic, (Mothproofed)

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-147 - Palletized Unit Load

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Bldg 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094).

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the Manual may be obtained from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

2.2 Other publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted shall be those listed in the issue of the DoDISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606).

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D.C. 20036).

Department of Defense (DoD) Standard
Shades for Buttons 1966

Department of Defense (DOD) Standard Color Card of
Official Standardized Shades For Sewing Threads 1968

(Copies may be obtained from the Color Association of the United States Inc., 200 Madison Avenue, New York, New York 10016).

(Nongovernment standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal agencies).

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, gabardine, polyester/wool, dark blue shade 2312 (see 6.3), 10.6 ounce, conforming to type II, class 12, of MIL-C-10176.

3.3.2 Lining. The material for lining the coat, pocket flaps, collar, vent, and collar eyelet covers, shall be cloth, rayon, twill, black shade 3202 (see 6.3), 3.7 ounce, conforming to class I of MIL-C-368.

3.3.3 Polyester and cotton. The material for making the stay pieces for the front pockets, stays for armhole and shoulder seams, binding for the lower edge of collar interlining, and reinforcement pieces for collar eyelets shall be cloth, polyester and cotton conforming to type I of MIL-C-43718 and shall be black. The requirements for nonfibrous material and seam efficiency shall not apply.

3.3.4 Interlinings.

3.3.4.1 Collar Interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table IV. As an alternate, a 2 ply herringbone (buckram), 86 yarns in warp and 48 yarns in fill, 20-24 ounce weight on 48 inch width produced by Twiss Association, Inc. is acceptable for use in dress coat collars. Additionally, a 3 ply bonded "Bandstand" fabric from Pellon; 2 ply cotton style OC125 from Philadelphia Haircloth and a 2 ply cotton from Eagle Buchram are acceptable.

3.3.4.2 Buckram material. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification, thoroughly cleaned, well carded, drawn and evenly spun.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

3.3.4.3 Weave. The weave of the single plies of the cloth shall be four harness, 2 up and 2 down herringbone twill, 20 ends right and 20 ends left or the cloth shall be plain weave.

3.3.4.4 Yarns per inch. The two plies of the cloth shall each have a minimum thread count per inch of 68 in the warp and 48 in the filling.

3.3.4.5 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin-type laminating material which shall not cause an objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests specified in section 4, Table IV.

3.3.4.5.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests shall conform to the following when tested as specified in section 4, Table IV.

Stiffness, inch-pound	Minimum	Maximum
original	0.60	0.95
after accelerated aging	0.70	0.95
after wet (dry) cleaning	0.50	0.85
after perspiration	0.50	0.85

3.3.4.5.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see section 4, Table IV).

3.3.4.5.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction when tested as specified in section 4, Table IV. After being subjected to the accelerated aging test (see section 4, Table IV), the breaking strength of the cloth shall be not less than the original breaking strength.

3.3.5 Coat Fronts. The coat fronts shall conform to type XI of MIL-C-15065, except that the cotton warp, hairwool filling cloth and the polyester and cotton cloth for the stays shall be dyed black. The dyed polyester and cotton shall show fastness to wet (dry) cleaning only. The dyeing of the cotton warp, hair filling cloth shall be accomplished with a selected direct dye and the dyed cloth shall be after treated, preferably with copper sulfate to meet the requirements specified herein. The dyed cotton warp, hairwool filling cloth shall show fastness to wet

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

(dry) cleaning, perspiration and steam pressing equal to or better than the standard sample. When no standard sample is available or has been established, the dyed cotton warp, hairwool filling cloth shall show good fastness to wet (dry) cleaning, perspiration and steam pressing. As an alternate, a 50 percent polyester, 50 percent rayon synthetic haircloth with a black nylon filling with 42 picks per inch and 52 ends per inch may be used. The haircloth shall be equal to or better than Crown HC-4 synthetic haircloth.

3.3.5.1 Fusible for coat fronts and back vent (alternate). The coat front and vent may be fused using a woven twill cloth fusible conforming to 100 percent cotton warp, 75-90 percent rayon, 10-25 percent wool filling, minimum 3.5 to 4.0 ounces maximum weight, polyamide dot coating in a black or charcoal gray shade. The fusible shall be Kufner Style G35 or National Style 200 FL or Crown Style 241 or equal to or better. The following conditions shall be as directed by the supplier or as follows:

Temperature	-	300°-310°F 150°-155°CE
Time	-	12-15 Seconds
Pressure	-	4-5 PSI

3.3.5.1.1 Chest pieces. Construction and application of chest piece and required components shall be the same as required in MIL-C-15065J. Components requiring haircloth are the chest pieces, top front reinforcement pieces and wedge pieces. The flannel felt shall be the same as stated in MIL-C-15065J, paragraphs 3.3.4.1 and 3.3.4.2. The polyester and cotton cloth required for stays and coverings shall be the same as stated in MIL-C-15065J, paragraph 3.3.3.

3.3.5.2 Fusible interlining for small parts. The fusible interlining for the facings, flaps, pockets, shoulder straps, collars and sleeve pieces shall be a nonwoven cloth 20 percent nylon, 80 percent polyester, polyamide dot, 1.25 to 1.75 ounces per square yard, shade black or charcoal grey. The fusible shall be Pellon Style 8313, Handler 7208 or equal to or better. Fusing conditions shall be as directed by the supplier or as follows:

Temperature	-	280°-290°F 140°-145°CE
Time	-	12-15 Seconds
Pressure	-	4-6 PSI

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

3.3.6 Padding for collar. The material for padding the collar shall be a suitable cotton felt, white, weighing 4.25 to 4.75 ounces per square yard when tested as specified in section 4, Table IV. As an alternate, a 100 percent polyester needle punch felt, white, weighing 4.8 to 5.5 ounces per square yard shall be Penn Pad style 5015 or equal - or - a 100 percent polyester nonwoven fabric equal to or better than Pellon Style No. 954, in shade white may be used.

3.3.7 Sleevehead and shoulder pads. The sleevehead pads shall conform to type IV of MIL-P-15064 and the shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.8 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

3.3.9 Bias binding. The binding for the upper edge of the front pockets, the back edge of the facings, and the raw edge of seam allowance shall be bias cut from the lining material specified in 3.3.2. The binding for the raw edge of seam allowances and back edge of facings shall be 3/4 inch wide, and for the upper edge of the front pockets shall be 1-1/8 inches wide. The binding shall have sized edges.

3.3.10 Piping. The material for piping the shoulder straps, the upper and lower edges of the collar, the upper, lower and back edges of ornamental sleeve pieces, and the bottom and left front edges of the coat shall be cloth, broadcloth, wool, scarlet shade 2501 (see 6.3), 16 ounce, conforming to type I or II, of MIL-C-29405. The scarlet piping on the collar, ornamental sleeve pieces, shoulder strap, left front and bottom edge of coat shall be 1/8-1/16 inch finished width.

3.3.11 Tape. The tape shall be cotton conforming to Type III, class I, of DDD-T-86. The tape for the armholes, back vent, and waist seam shall be 1/4 inch wide and the tape for the right front edge shall be 3/8 inch wide.

3.3.12 Wigan. The material for reinforcing the bottom edge of the sleeves shall be cloth, cotton, wigan, 2.5 ounces, natural color, conforming to type of MIL-C-16375.

3.3.13 Thread.

3.3.13.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A, 3 ply, for all bartacks and all outside seaming and stitching, size F and size B for buttonhole, bobbin or looper and

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

needle threads, respectively, and size 0 or 00 for machine felling. The thread for hand sewing shall be type III, class 3, size C, 2-ply of V-T-301.

3.3.13.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, overedge stitching; and type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for basting shall be a good commercial grade.

3.3.13.3 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.4 Color and colorfastness. All thread shall be black AA, Cable No. 66043, (See DoD Standard Color Card of Official Standardized Shades for Sewing Threads 1968) except cotton thread for basting and for machine tacking armholes, which may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be black AA, cable No. 66043 showing good fastness to wet (dry) cleaning.

3.3.15 Buttons.

3.3.15.1 Insignia buttons. The insignia buttons shall be metal, gold plated, 27-line and 40-line, conforming to type I, style 3, class A, subclass 1 of MIL-B-3461.

3.3.15.1.1 Ring toggles. Ring toggles for securing buttons to ornamental sleeve pieces and shoulders shall conform to MIL-B-3461.

3.3.15.1.2 Reinforcements. The reinforcement discs for buttons secured to shoulders and ornamental sleeve pieces with ring toggles shall be punched from the cloth, cotton, buckram specified in 3.3.4.1. As an alternate, a leather or metal washer may be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

3.3.15.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish, conforming to type II, class D, style 20, or 21, 34-line of V-B-871. The color shall be black BT Cable No. 62001. (See DoD Standard Shades for Buttons 1966).

3.3.16 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, followed by a clear lacquer coating and shall conform to the requirements shown in Figure 1 and the following.

3.3.16.1 Closure finish. All surfaces and edges of the hook and eye shall be clean, smooth, and free from burrs, tool marks, sharp edges and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in section 4, Table IV. All apertures of the finished lacquered hook and eye shall be completely open, and free of any lacquer film or black chemical finish.

3.3.17 Labels. Each coat shall have an identification label, a size label and an instruction label as described in 3.3.17.1, 3.3.17.2 and 3.3.17.3. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.17.1 Identification label. The identification label shall conform to type I, class 1, of DDD-L-20 and shall measure not less than 2-1/2 inches wide by 1-1/2 inches long. The content and format shall be as follows:

Nomenclature (item description)
Contract Number
Name of Contractor
Wool Products Act Information
Dry Clean Only

Size and characters for "Name of contractor" shall be minimum 8 point (approximately 3/32 inch).

3.3.17.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches wide by 1 inch long. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long and Extra Long, and the stock number as shown by the following example:

Source: https://assist.dla.mil -- Downloaded: 20260410-19T06:06Z
Check the source to verify that this is the current version before use.

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label

3.3.17.3 Instruction label. The instruction label shall conform to type I, class 3, of DDD-L-20, and shall measure not less than 2-1/4 inches wide by 4 inches long. The content and format shall be as shown in Figure 2. The letters for the caption shall be not less than 5/32 inch in height and all other letters and figures shall be not less than 1/8 inch in height.

3.3.17.4 Combination label. A combination identification / instruction label conforming to type I, class 15 of DDD-L-20 may be used in lieu of separate labels.

3.4 Design. The coat shall be the U.S. Marine Corps design shown on Figures 3 through 5, a seven-button, single-breasted, quarter-lined coat, having a skirt type front, side-body pieces, waist seam, chest and waist darts; upper and lower patch pockets with flaps to button; a four-piece back with lined center vent; ornamental sleeve ends, stitched down shoulder straps with insignia buttons; and a stand-up collar with single hook and eye for front closure. The top and bottom edges of collar, left front and bottom edges of coat, edges of shoulder straps and top, bottom, and back edges of ornamental sleeve pieces shall be piped with scarlet broadcloth.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working pattern shall be identical to the standard patterns. The standard patterns shall provide 3/16 inch allowance for seams at the right front edge of coat and for pocket flaps; 1/8-inch allowance at left front edge of coat and for shoulder straps; 3/4 inch allowance for side seams; 5/8 inch allowance for center back seam; and 3/8 inch allowance for all other seams except as otherwise specified in Table I. Patterns provide for finished width of collars for short and extra short coats to be 1-3/4 inches and for regular, long and extra long coats to be 2 inches. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 Pattern parts. Coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

Pattern Nomenclature:

Item	Material: Cloth polyester/ wool, gabardine	No. of cut parts
1.	Front, upper	2
2.	Front, lower	2
3.	Facing, right	1
4.	Facing, left	1
5.	Side front	2
6.	Center back	2
7.	Side back	2
8.	Top sleeves	2
9.	Under sleeves	2
10.	Ornamental sleeve piece	2
11.	Pockets, upper	2
12.	Pocket flaps, upper	2
13.	Pockets, lower	2
14.	Pocket flaps, lower	2
15.	Shoulder straps	2
16.	Collar (outer ply)	1
17.	Armhole shield	2

Item	Material: Cloth, rayon lining	No. of cut parts
18.	Front	2
19.	Yoke	1
20.	Top sleeve	2
21.	Undersleeve	2
22.	Pocket flaps, upper	2
23.	Pocket flaps, lower	2
24.	Collar lining	1
25.	Collar eyelet covers	2
26.	Right vent lining	1

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

Pattern Nomenclature: (cont'd)

Item	Material: Polyester and Cotton	No. of cut parts
27.	Pocket stays, upper	2
28.	Pocket stays, lower	2
29.	Collar interlining	1
30.	Pocket lining, upper	2
31.	Pocket lining, lower	2

Item	Material: Cloth, cotton, wigan	No. of cut parts
32.	Reinforcement (bottom edge of sleeve)	2
	Shapers	
33.	Finished pocket shaper, upper	
34.	Finished pocket shaper, lower	
35.	Finished pocket flap shaper, upper	
36.	Finished pocket flap shaper, lower	
37.	Left vent shaper	
	Markers	
38.	Sleeve turnup and sleeve ornamentation marker	

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitching, shall be securely backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Ends of continuous line of stitching shall overlap not less than 1/2 inch except on the labels.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic and lining materials, including pairs of sleeve lining, when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Adhesive-type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

(c) Sew-on tickets.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread	
					Ndl	Bob/ Lpr
1.	Cutting. a. Cut the coats in strict accordance with patterns furnished by the Government. Cut the basic material face to face i.e., the face of one ply of material shall be even and against the face of the next ply below.					

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd) b. Cut all materials in the direction indicated by the directional lines on the patterns. NOTE: Straight of cloth refers to the warp direction. c. Cut all wool gabardine parts of the coat, from one piece of basic material, except the belt loops and front facing may be cut from ends. Parts cut from ends shall harmonize with the shade of the coat. Belt loops and binding for upper edge of collar interlining shall be cut 1 inch wide. d. Cut linings for front, yoke, vent, and collar from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. e. Cut the bias binding (see 3.3.9) from lining material,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd) 3/4 inch wide for the raw back edge of the facings and raw edges of the seam allowances, and 1 to 1-1/8 inches wide for the top edge of front pockets. f. Cut polyester and cotton stays for armhole and shoulder seam on the bias 3/4 inch wide and 4 ± 1/4 inches long for front shoulder and armhole edge. Cut polyester and cotton stays for upper and lower pockets on the straight in accordance with patterns furnished. Cut the polyester and cotton binding for lower edge of collar interlining on the straight 1 inch wide. Cut the reinforcement pieces for collar eyelet not less than 2 inches long and 1-3/4 inches wide. g. Cut the cotton buckram for interlining the collar in accordance with the pattern furnished. Punch the reinforcement discs for buttons secured to shoulders and					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd) ornamental sleeve pieces from the cotton buckram. The reinforcement discs shall be 7/8-inch diameter with a 1/8-inch diameter hole at the center. h. Cut the cotton felt for padding the collar 1-1/4 inches wide and sufficiently long to fold over the ends of the interlining for each size collar. i. Cut the scarlet wool cloth for piping the bottom and left front edge of coat, edges of shoulder straps, collar, and ornamental sleeve pieces on the straight of cloth. The piping shall be cut 5/8 inch wide for shoulder straps, collar and ornamental sleeve pieces and 1-1/8 inches wide for bottom and left front edges of coat. j. Cut the wigan for the bottom edge of sleeves on the bias in accordance with the patterns.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd) k. Dress the left vent in accordance with the patterns furnished.					
2.	Replacement of damaged parts. a. Replace at time of cutting, all parts containing damages such as holes or serious weakening defects such as smashes, multiple floats and slubs likely to develop into a hole, and shade bars. b. Replace all parts damaged during the manufacturing process by needle chews which may be expected to develop into a hole, scissors or knife cuts, tears, holes, mends and burns.					
3.	Shade marking. a. Mark or ticket all component parts (see 3.6.3) cut from one piece of basic material to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled, or ticketed to insure uniform shade and size throughout the garment.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
3.	Shade marking. (cont'd)					
	b. The use of tickets with metal fastening devices or sew-on tickets is prohibited on the rayon lining.					
4.	Make belt loops.					
	Finished appearance. The belt loops shall finish 1/2 inch wide and shall finish smooth and flat without pleats, gathers, puckers or other distortion. The stitching shall be uniformly 1/8 inch from the finished edges.					
	a. The belt loops shall be made from a 1-inch wide strip of basic material.					
	b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges together with a covering stitch.	406	EFh-1	10-14	A	A
	c. Cut the loop for the left and right sides of the coat 3-1/2 inches long, respectively.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread	
					Ndl	Bob/ Lpr
5.	Make upper pockets (creasing machine construction). Finished appearance. The binding shall be uniformly stitched; shall not be tight or full causing puckers, gathers, or pleats; and the basic material shall be securely caught in the stitching. The pleats shall be vertically centered and the folded side edges of the pleats shall be parallel. The pockets shall be uniform in shape and size in accordance with the patterns. The pockets shall be lined with polyester/cotton cloth twill or a fusible interlining may be used in lieu of the polyester /cotton twill cloth. a. Form a vertical box pleat on the outside center of upper pockets with a heated creasing machine. The pleat shall be 1-1/4 inches wide for sizes 30 to 35 coats and 1-1/2 inches wide for sizes 36 to 48 coats, inclusive. Requirements in paragraph 3.3.5.2.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper pockets (creasing machine construction). (cont'd)					
	b. Secure the pleat with a row of stitches 1/16 inch from the top and bottom edges, respectively.	301	SSa-1	10-14	A	A
	c. Stitch the abutted edges of the pleat together on the inside of the pocket with blindstitching.	103	SSm-1	6-8	A	
	d. Place the polyester /cotton twill lining on the underside of pocket or after the pleat is formed and seam together along the top sides and bottom 1/8 to 3/16 inch from the raw edges - or - when the fusible interlining is used, position the interlining on the back side of pocket and fuse.	301 or 401	SSa-1	10-12	A	A
	e. Bind the upper edge of the pockets with 7/8-inch-wide bias binding, with the pleat closed and the outside edge of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge of the binding.	301	BSc-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper pockets (creasing machine construction). (cont'd)					
	f. Turn under and crease the side and bottom edges of the pockets in a heated edge creasing machine. Trim the lower corners or pockets.					
	- or -					
	g. Fold the pocket in half lengthwise and stitch 1-1/4 or 1-1/2 inches from folded edge, as applicable by size.	301	OSf-1	10-14	A	A
	h. Form the pleat and seam across the top and bottom edge, respectively.	301	SSa-1	10-14	A	A
	i. Press pleat in center of pocket flat and smooth.					
	j. Bind the upper edges of pockets with 7/8 inch wide binding, with the pleat closed and top edge of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge of the binding.	301	BSc-1	10-14	A	A
	k. Mark the patch pocket in accordance with the pocket shaper					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper pockets (creasing machine construction). (cont'd)					
	and trim the lower corners of the pocket for better turning.					
	1. Turn under side and bottom edges of pocket at the marks and baste along the edges.	101 or Hand				
	NOTE: When pleat is constructed in accordance with operation 5.f, g, and h., the pockets may be creased as indicated in operation 5.e.					
6.	Make lower pocket.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats; the basic material and both edges of binding shall be securely caught in the stitching. The pockets shall be uniform in shape and size in accordance with finished pocket shaper. The pockets shall be lined with polyester/cotton cloth twill or a fusible interlining may be used in lieu of the polyester /cotton twill cloth.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
6.	Make lower pocket. (cont'd)					
	a. Place the polyester/ cotton twill lining on the underside of pocket and seam together along the top, sides and bottom 1/8 to 3/16 inch from the raw edges. - or - Fusible interlining may be used.	301	SSa-1	10-12	A	A
	b. Bind the upper edge of the pockets with 7/8-inch-wide bias cut rayon binding, with top edges of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	c. Turn under and crease the side and bottom edges of the pockets in an edge creasing machine. - or -					
	d. Mark the pockets in accordance with the pattern, turn under side and bottom edges of the pockets at the marks and baste along the folded edges.	101	EFa-1			

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
6.	Make lower pocket. (cont'd)					
	e. When edges of pockets are turned under and basted (see 6.c.), the pockets shall be pressed and the folded edges creased with a heated pressing iron or pressing machine.					
7.	Make upper and lower pocket flaps.					
	Finished appearance. The pocket flaps shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges, and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The lining shall not be visible on the outside of the flaps. The buttonholes shall be cut-first type, clean cut, well made, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the flaps, and the purling of the buttonholes shall be on the outside of the flaps.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
7.	Make upper and lower pocket flaps. (cont'd)					
	a. The pocket flaps shall be made of one ply of basic material, lined with rayon lining and a fusible interlining.					
	b. Seam the lining to the basic material 3/16 inch from the side and bottom edges, evenly trimming the edges for proper turning.	301	SSe-2 (a)	10-14	A	A
	c. Turn the flaps, working the edges, corners and point out completely. Edgestitch the flaps uniformly 1/8 inch from seamed edges, working the lining back 1/16 inch from finished edge of the flaps.	301	SSe-2 (b)	10-14	A (silk)	A (silk)
	d. Press the flaps smooth and flat with a heated pressing iron or pressing machine.					
	e. Mark and trim the top edge of flaps with the finished shaper so that in the finished coats, the length of the flaps at center point and sides shall conform to measurements shown in Table III.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
7.	Make upper and lower pocket flaps. (cont'd)					
	f. Join the top raw edge of the lining and flap together with overedge stitching.	504 or 505	EFd-1 EFd-1	8-10 8-10	A A	A A
	g. Make a vertical eyelet end square bar type buttonhole with 3/4 inch long cut in the center of each breast patch pocket flap with the inside edge of the eyelet 5/8 inch above the center point.	But-ton-hole		38 per button-hole (not includ-ing tack)	B (silk)	F (silk)
	h. Make a vertical eyelet end square bar type buttonhole in the center of each lower outside hanging pocket flap, cut 3/4 inch long, through the center of each pocket flap, with the inside edge of the eyelet 5/8 inch above the center point.	But-ton-hole		38 per button-hole (not includ-ing tack)	B (silk)	F (silk)
	i. Securely bartack the ends of the buttonholes, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bar-tack (mini-mum)	A (silk)	A (silk)
8.	Make shoulder straps.					
	Finished appearance. The piping shall be uniformly stitched to the shoulder straps					

Source: https://assist.dla.mil -- Downloaded: 20261019T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
8.	Make shoulder straps. (cont'd)					
	without twists, gathers, puckers, pleats and shall be evenly and uniformly worked out to the edges. The straps shall finish smooth and flat and shall be uniform in appearance.					
	a. The shoulder straps shall be made of one ply of basic material and fusible interlining piped with scarlet wool broadcloth.					
	b. Seam a 5/8-inch-wide strip of scarlet piping to the shoulder straps, along front and back edges and around collar end, 1/8 inch from edges.	301	SSe-2 (a)	10-14	A -or- A (silk)	A -or- A (silk)
	- or -					
	c. Fold the scarlet piping, slightly offsetting the raw edges and seam to edge as above.	301	SSav 2 (a)	10-14	A -or- A	A -or- A
	d. Turn back the straps and scarlet piping, uniformly working the folded edge of the piping 1/8 inch beyond the ends of the straps. Topstitch the straps uniformly 3/16 inch from	301	BSm-2 (b)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
8.	Make shoulder straps. (cont'd)					
	the folded edges of piping. Clip the excess scarlet material at the collar end so that the strap will lie flat.					
	e. Press the strap smooth and flat with a heated pressing iron or pressing machine.					
9.	Make collar eyelet cover.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the cover and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	Efa-1 (each side edge)	10-14	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges. Continue stitching across the folded end.	301	SSc-1 (each side edge) OSF-1 (folded end)	10-14	A	A
10.	Assemble collar interlining. (See figure 6).					
	Finished appearance. The collar interlining					

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
10.	Assemble collar interlining. (cont'd) (See figure 6) shall be bound at the top edge with 1-inch-wide strip of basic material and at the lower edge with 1-inch-wide strip of polyester and cotton. The binding shall be uniformly stitched 1/4 inch from the folded edges. The binding shall not be tight or full causing puckers, gathers or pleats. The interlining and edges of the binding shall be securely caught in the stitching. The interlining shall finish with the eyelet reinforcement pieces positioned on the inside and the felt padding positioned on the outside of the interlining. The collar eyelet cover shall be positioned so that in the finished collar, the covers shall be centered over the eyelets.					
	a. Position the eyelet reinforcement at each end of the collar interlining. Bind each edge of the interlining, catching the reinforcements in the seams.	301	BSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
10.	Assemble collar interlining. (cont'd) (see Figure 6)					
	b. Center the strip of felt padding on the outside of the collar interlining with the ends of the padding sufficiently long to fold over each end of the interlining. Seam the padding to the interlining from end to end 1/8 inch from top and bottom edges, respectively, of the padding.	301	SSau-2	10-14	A	A
	c. Lap the raw edge of the collar eyelet covers 1/2 to 5/8 inch on the top inside edge of the collar interlining. Seam the covers to the interlining 1/4 inch from the raw edge of the covers.	301	LSa-1	10-14	A	A
11.	Pipe outer ply of collar. Finished appearance. The piping shall extend the full length along both edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
11.	Pipe outer ply of collar	(cont	d)			
	a. Seam a 5/8-inch-wide strip of scarlet piping to the outer ply 1/8 inch from upper and lower edges.	301	SSe-2	10-14	A -or- A (silk)	A -or- A (silk)
	b. Turn back the piping and outer ply at upper and lower edges, uniformly working the folded edge of the piping 1/8 inch beyond the edge of the outer ply. Topstitch the outer ply uniformly 3/16 inch from the folded edges of the piping.	301	BSm-3 (b)	10-14	A (silk)	A (silk)
	- or -					
	c. Fold the scarlet piping, slightly offsetting the raw edge and seam as above.	301	SSav-2 (a)	10-14	A -or- A (silk)	A -or- A (silk)
	- or -					
	d. Turn back edge of collar and stitch through outer ply 1/16 inch from edge, leaving the folded edge of the slightly offset folded edge of the scarlet piping extending 1/8 inch beyond edge of the outer ply.	301	BSm-3 (c)	10-14	A -or- A (silk)	A -or- A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
12.	Assemble collar. Finished appearance. The collar shall be assembled without twists, gathers, puckers, or pleats. In the finished collar, the ends of the lining shall extend approximately 1/2 inch beyond the right end of the collar and approximately 2-1/2 inches beyond the left end of collar for the extension tab. Eyelet covers shall not be caught in the eyelet operation. a. Position the outer ply of the collar on the outside of the interlining assembly with the basic material on the top edge of the interlining extending uniformly 1/8 inch beyond the scarlet piping on the top edge of the outer ply. Polyester and cotton binding at the bottom edge of the interlining shall not be exposed beyond the scarlet piping on the bottom edge of the collar.					
	b. Seam the outer ply and interlining assembly together with a row of	301	SSa-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
12.	Assemble collar. (cont'd)					
	stitches as close as possible to, but not on top of, the topstitching at the top and bottom edges of the outer ply.					
	c. Lap the top edge of the collar assembly over the top raw edge of collar lining approximately 1/2 inch, with the lining face up. Seam the collar to the lining with a row of stitches as close as possible to, but not on top of, rows of stitches at the upper edge of the collar. The stitching shall extend from center to center of the collar eyelet covers.	301	LSa-1	10-14	A (silk)	A (silk)
	d. Smoothly fold the ends of the collar padding and outer ply to the inside over the ends of the interlining assembly and press smooth and flat with a heated pressing iron or pressing machine.					
	e. Turn collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
13.	Make collar extension tab.					
	Finished appearance. The collar extension tab shall extend 3/4 to 1 inch beyond the folded edge of the left end of collar.					
	a. Turn the top and bottom edges and the end of the collar lining at the left end of the collar to the inside of the lining and baste the turned portion along the top, front and bottom edges to the body of the lining, forming the collar extension tab.	Hand				
	b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges and continue the stitching at the back of tab to top row, forming a 1-3/8 to 1-1/2 inch wide box stitch.	301	SSc-1	10-14 (top & bottom edges) OSf-1 (front edge) SSa-1 (back edge)	A (silk)	A (silk)
14.	Fell ends of outer ply to collar.					
	Finished appearance. The upper and lower edges at each end of the outer ply shall not be visible on the outside of the finished collar.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
14.	Fell ends of outer ply to collar. (cont'd)					
	a. Tack the ends of the outer ply to the reinforcement pieces and to the collar eyelet covers with overcast stitching.	Hand		2-3	C (silk)	
	b. Make one eyelet through all plies of the collar and lining midway ± 1/16 inch between outer edges of scarlet piping and 1-1/2 ± 1/8 inches from finished end of collar. The eyelet shall be well worked and shall finish with a 1/8-inch diameter opening.	Eye-let		20 per eyelet	A (silk)	A (silk)
15.	Make ornamental sleeve pieces.					
	Finished appearance. The piping shall be uniformly stitched to the ornamental sleeve pieces without twists, gathers, puckers or pleats. The ornamental pieces shall finish smooth and flat and shall be uniform in appearance.					
	a. The ornamental sleeve pieces shall be one ply of basic material and one ply of fusible and piped with scarlet.					

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
15.	Make ornamental sleeve pieces. (cont'd)					
	b. Seam a 5/8-inch-wide strip of scarlet piping to the ornamental sleeve pieces 1/8 inch from the top, the scalloped side, and the bottom edges.	301	SSe-2 (a)	10-14	A - or - A (silk)	A - or - A (silk)
	- or -					
	c. Fold the scarlet piping, slightly offsetting the raw edge and seam to edges as above.	301	SSav-2 (a)	10-14	A (silk)	A (silk)
	d. Turn back the sleeve pieces and the scarlet piping at the seamed edges, uniformly working the folded edge of he piping 1/8 inch beyond the edges of the sleeve pieces. Notch excess scarlet material at the top and lower points of ornamental pieces in order to reduce bulkiness. Topstitch the sleeve pieces uniformly 3/16 inch from the folded edge of the piping.	301	BSM-3 (b)	10-14	A (silk)	A (silk)
	e. Press ornamental pieces smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
15.	Make ornamental sleeve pieces.		(cont'd)			
	f. Mark the sleeve pieces for location of insignia buttons as indicated by marks on the pattern. Assemble sleeve pieces in pairs.					
	g. Punch a hole through ornamental sleeve piece at each mark for attaching insignia buttons.					
	h. Insert the shank of the 27 line insignia buttons through the punched holes of each sleeve piece and reinforcement disc and secure each button to sleeve piece with a metal ring toggle.					
16.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top and undersleeves with notches matching and join at the forearm with a 3/8-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
16.	Seam sleeves at forearm. (cont'd)					
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. Mark sleeve end for turnup and mark the top sleeve for positioning the ornamental sleeve piece with pattern marker.					
17.	Baste wigan reinforcement to wool sleeve.					
	a. Position the sleeve on the wigan with marks and notches matching as indicated by pattern.					
	b. Tack the left and right sleeves to the reinforcement pieces along the forearm seam allowance and along the sides of backarm seam allowance. When necessary, trim ends of reinforcement piece even with the back edges of backarm allowance.	101 or 301		4-6 10-14	A	A
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	101				

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
18.	Join ornamental sleeve piece to sleeves. Finished appearance. The ornamental sleeve piece shall be uniformly stitched to the sleeve without twists, gathers, puckers or pleats and shall finish smooth and flat without any raw edges. The folded front edge of the ornamental piece shall not be top stitched. The position of the ornamental sleeve piece shall be as shown on Figure 6. a. Mark the ornamental sleeve piece on the inside 1/4 inch from raw edge. Position the sleeve piece on the sleeve with marks matching and with bottom edge of sleeve piece even with the mark for bottom turnup of the sleeve.					
	b. Seam the ornamental piece to the sleeve at the mark.	301	LSbj 1	10-14	A (silk)	A (silk)
	c. Turn back the ornamental piece at the seam and stitch as close as possible to, but not on top of, the top stitching at the top, bottom, and scalloped	301	LSbj 1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
18.	Join ornamental sleeve piece to sleeves. (cont'd)					
	peaks, leaving 2 openings on the scalloped back to remove and replace button.					
19.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve at the backarm with a 3/8-inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301	SSa-1	10-14	A	A
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
20.	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of the sleeves at the mark and tack the raw edge to wigan reinforcement piece with blindstitching. The basic material shall not be caught in the blindstitching.	301	EFc-1 (b)	4-6	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
21.	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position the top and under sleeve linings in accordance with notches on pattern and join at the forearm and backarm respectively, with 3/8-inch seams.	301 or 401	SSa-1	10-14	A	A
	b. As an alternate, when using a sleeve lining felling machine, join backarm seam and forearm seam of sleeve lining. The distance between the notches on the forearm shall be left open.	301 or 401	SSa-1 SSa-1	10-14 10-14	30 30	30 30
	c. Position the sleeve lining top notches to the top of forearm sleeve seam and top of the backarm sleeve hem. Tack the forearm seam and backarm seam of the sleeve lining to the forearm seam and backarm seam, respectively. The backarm seam tacking	Hand or 301		2-3 4-8	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
21.	Seam sleeve linings. (cont'd)					
	shall extend from approximately the midpoint of the backarm seam to not more than 6 inches above creased bottom edge. The forearm seam tacking shall be for a distance of 1-1/2 to 2 inches below the bottom left open forearm seam notch.					
22.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve linings shall be seamed to sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.					
	b. Seam or tack lining to sleeve backarm and forearm seam allowance, respectively, commencing at the top edge of wigan reinforcement piece and extending to approximately 7 inches from armhole edge at the backarm and	301	SSa-1	6-8	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
22.	Assemble sleeve and sleeve lining. (cont'd)					
	approximately 6 inches from armhole edge at the forearm.					
	c. Pull sleeve through sleeve lining.					
23.	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve linings shall not be short, tight, or twisted at bottom of sleeves. The sleeves shall be properly pressed.					
	a. Turn under the bottom edge of sleeve lining to finish approximately 1-1/2 inches above the finished end of the sleeve and baste to turnup of sleeve.	Hand or 101				
	b. Fell the folded edge of sleeve lining to the turnup of the sleeve with blindstitching.	301 or Hand	EFc-1	6-8 8-10	0 -or- 00 C (silk)	0 -or- 00
	NOTE: The bottom of sleeve lining may be felled without basting.					
	c. Turn sleeves and assemble in pairs.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
24.	Stitch dart in front lining.					
	Finished appearance. The dart shall finish without gathers, puckers or pleats.					
	a. Fold the front lining, matching the cut edges of the underarm dart. Stitch the entire length of the dart 3/8 inch from cut edges at the armhole and tapering to zero at the lower end, as indicated by the mark on the pattern.	301	SSa-1	10-14	A	A
25.	Hem yoke and front lining.					
	Finished appearance. The hem shall be uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers of pleats. The hem shall be 3/8 ± 1/8 inch wide.					
	a. Hem the bottom edge of the yoke and front linings, respectively, with the raw edge turned under and caught in the stitching 1/16 inch from the folded upper edge of hem.	301	EFb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
26.	Make center pleat in yoke lining.					
	Finished appearance. The pleat shall finish smooth and flat without puckers or pleats. The folded edge of the pleat on the outside of the yoke shall be toward the left side.					
	a. Fold yoke lining, in accordance with the notches on the pattern to form a 1/2 inch-wide pleat at the center back.					
	b. Press the pleat smooth and flat from the top to the bottom edges of the yoke lining with a heated pressing iron.					
27.	Make armhole shields.					
	Finished appearance. The armhole shields, of one ply of basic material, shall finish without puckers, gathers or raw edges.					
	a. Bind the rounded edges of armhole shield with bias binding, turning under the outside raw edge of the binding only and catching the turned	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
27.	Make armhole shields. (cont'd)					
	under portion in the stitching 1/16 inch from folded edge.					
28.	Sew on identification and instruction labels.					
	Finished appearance. The identification and instruction labels or combination label shall be positioned so that in the finished coat, each label shall be midway between front and back edges of the facing with the bottom edge of the identification label approximately 4 inches from the bottom edge of the coat and with the bottom edge of instruction label overlapping the margin of the identification label and caught in the same row of stitching.					
	a. Sew the identification and instruction labels or combination label, respectively, to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge of each label except over-lap)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
29.	Seam facing to front lining. Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion. a. Position the lining on the wool facing with the top edges even and bottom finished edge of the lining matched with the notch in the back edge of the facing to insure proper seaming. b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. c. Press the facing lining seam, the underarm dart, and the bottom edge of the lining smooth and flat with a heated pressing iron, turning the raw edges of facing lining seam and underarm dart toward the side.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
30.	Bind facings. Finished appearance. The binding shall be uniformly stitched, and shall not be tight or full causing puckers, gathers, or pleats. The basic material shall be securely caught in the stitching. The binding shall extend from the bottom edge of facing to not less than 1 inch above bottom finished edge of lining.					
	a. Bind the raw back edge of the facing with the 3/4-inch-wide bias -cut binding, with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge.	301	BSb-1	10-14	A	A
31.	Bind backs. Finished appearance. The binding shall be uniformly stitched. It shall not be tight or full causing puckers, gathers or pleats. The basic material shall be securely caught in the stitching.					

Source: https://assist.dla.mil -- Downloaded: 20260-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
31.	Bind backs. (cont'd)					
	a. The raw edge of the center and side backs shall be bound with the 3/4-inch-wide bias cut binding with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge.					
	b. Bind the raw back edge of the left and right center backs, respectively, from the top edge of backs to top end of vent. When binding the left center back, continue to bind the raw edge of left vent from top to bottom edge. The binding is not required along the top edge of the vent.	301	BSb-1	10-14	A	A
	c. Bind the raw side edge of left and right center backs, respectively, from top to bottom edge.	301	BSb-1	10-14	A	A
	d. Bind the raw side edges of left and right side backs from top to bottom edge.	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
32.	Seam lining to right vent.					
	Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Fold vent lining in half lengthwise, face to face, and stitch along the top from the notches to the folded edge, with a 5/16 to 3/8-inch seam. Turn vent lining to the right side, forcing out corner and seam.	301	SSa-1	10-14	A	A
	b. Position the raw edge of lining on the outside of right vent, with notches on the lining in line with the top end of vent; then seam together 3/8 inch from back edge. The lining shall extend from the notches to the bottom finished edge of coat.	301	SSe-2 (a)	10-14	A	A
	c. Turn the lining to the inside with the seam 1/16 to 1/8 inch back of folded edge. Stitch the entire length of vent 1/8 inch from the folded edge.	301	SSe-2 (b)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
33.	Join backs and tape neck Finished appearance. The side and center backs shall be joined without gathers, puckers, or pleats. The folded edge of the left vent shall be in vertical line with the center back seam. In the finished coat, the left center back shall overlap the right center back not less than 3 inches when measured at bottom edge of coat and the left vent shall be 2 ± 1/8 inches wide measured at the bottom piped edge.					
	a. Stitch the 1/4-inch-wide stay tape to the inside of left center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point, continue to stitch diagonally across	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
33.	Join backs and tape neck.	(cont'd)				
	the top end of the left and right vents to the bound edge of the backs.					
	c. Turn the left vent to the inside of the left center back in accordance with the notches and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A (silk)	A (silk)
	d. Join the left and right side backs to the respective center backs with 3/8-inch seams.	301	SSa-1	10-14	A	A
	e. Sew a 1/4 inch wide tape to the inside neck of the back 1/4 inch from the top raw edge and 5/8 inch from back shoulder edge. The tape shall be sewn flat and the center back seam shall be open.	301	SSaa 1	10-14	A	A
34.	Press back seams and vent lining.					
	a. The side and center back seams and vent lining shall be pressed with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
34.	Press back seams and vent lining. (cont'd)					
	b. Notch the top end of the right vent diagonally from the juncture point of the vent and center seam allowance of the right center back to the lower end of the stitching for the center back seam.					
	c. Spread the side and center back seams, respectively, and press flat.					
35.	Baste and stitch vent lining.					
	Finished appearance. The folded edge of the lining shall extend beyond the center seam allowance of the right backpart.					
	a. Baste vent lining to coat.	101 or Hand				
	b. Stitch the upper part of vent lining to the center back on each side of the seam allowance 1/8 inch from seamed edge of lining. Turn coat on the outside.	301	SSa-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
35.	Baste and stitch vent lining. (cont'd)					
	c. Stitch and backstitch across the top end of vent, through the vent lining, from the back center seam to the edge of the vent.	301	SSa-1	10-14	A (silk)	A (silk)
	d. Tack the top of vent opening thru all plies of basic fabric and vent lining 1-3/4 + 1/4 -1/8 inches.	301	SSa-1	10-14	A	A
36.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester and cotton reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide polyester and cotton stays to the underside of the fronts along the shoulder edge and upper front edge of	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
36.	Seam reinforcement stay to armhole and shoulder. (cont'd)					
	the armhole, respectively, 1/8 inch from the outer edges.					
37.	Bind lower fronts.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats. The basic material shall be securely caught in the stitching. The binding shall extend from the waist seam to the bottom edge of the fronts.					
	a. Bind the raw back edge of the lower fronts with the 3/4-inch-wide bias cut binding with the raw outside edge of binding only turned under and caught in the stitching 1/16 inch from the inner folded edge.	301	BSb-1	10-14	A	A
38.	Assemble fronts.					
	Finished appearance. The chest and waist darts shall be properly tapered and shall finish without gathers, puckers or pleats. The upper and lower fronts and side body panel shall be					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
38.	Assemble fronts. (cont'd) joined without gathers, puckers of pleats. a. The fronts shall consist of an upper front, a side body panel, and a lower front (skirt).					
	b. Fold the upper fronts, matching the cut edges of the chest and waist darts. Stitch the entire length of the chest and waist darts 3/8 inch from the cut edges at the upper end of the chest darts tapering to zero at the upper end. The line of stitching shall extend not more than 1/2 inch beyond the point of chest and waist darts.	301	SSa-1	10-14	A	A
	c. Position the upper fronts and sidebody panel with edges even and join with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	d. Spread open the waist darts and the underarm seam and press flat with a heated pressing iron. Press the chest dart flat, turning the cut edges toward the armhole edge.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
38.	Assemble fronts. (cont'd)					
	e. Position the upper and lower fronts with edges even and join at the waist with a 3/8-inch seam and with the 1/4-inch-wide stay tape positioned on the upper fronts 1/4 inch from the lower edge and caught in the stitching.	301	SSa-1	10-14	A	A
	f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the center of the side body panel to not more than 3 inches from the front edge of the fronts.					
	g. Spread open the waist seam and press flat with a heated pressing iron.					
	h. Press and shape the fronts, from the waist to the top edge on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortion to the fronts or armhole of the coat.					

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
39.	Set pockets and pocket flaps. (see figure 7) Finished appearance. The pockets and pocket flaps shall be set without twists, gathers, puckers, pleats or raw edges. The stitching for the raised edge of the flaps shall conform to stitching for setting the pockets. The side edges of the pockets shall not be exposed beyond the sides of the flaps. The pocket and pocket flaps on the left and right side, respectively shall be in horizontal alignment with each other. The front edge of the upper pockets, pocket flaps and pleats shall be in a vertical straight line when buttoned. The top of the breast pocket flaps shall be perpendicular to the front edge of coat when buttoned. The point of the upper pocket flap shall be at the center of the pleat on the upper pockets. The center of the pleat on the upper pockets shall be aligned as accurately as possible with the waist darts in the fronts. On the finished					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
39.	Set pockets and pocket flaps. (cont'd)					
	coat, the top edge of the breast pocket flaps shall be midway between the second and third buttonhole. The top edge of the bottom pocket flap shall be parallel with the waist seam and the front edge of the flap shall be in line with the front edge of upper pocket and the lower front corners of bottom pocket shall be 3/8 inch further back towards side seam. Pockets and pocket flaps shall conform to the measurements shown in Table III.					
	Note: The breast pocket and flap marker (template) constructed by the manufacturer shall be made to ensure that the top of the breast pocket flaps finish perpendicular to front edge of coat.					
	a. Mark the fronts in accordance with the marks on pattern or template when used for position of upper and lower pockets and pocket flaps, ensuring adherence to the finished appearance requirements.					

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
39.	Set pockets and pocket flaps. (cont'd)					
	b. Position the pocket flaps on the outside of the fronts in accordance with the marks for the upper and lower pocket flaps, respectively. Position the polyester and cotton stay pieces for the flaps and top corners of the pockets on the underside of the fronts.					
	c. Seam the pocket flaps to the fronts through the polyester and cotton stay uniformly 1/8 inch from the serged edge of the flap.	301	LSq-2 (a)	10-14	A	A
	d. Turn down the flaps and top stitch the flaps 1/8 inch from the raised edge.	301	LSq-2 (b)	10-14	A (silk)	A (silk)
	e. Position the pockets in accordance with the mark for the upper and lower pockets and seam to the fronts, uniformly 1/8 inch from side and bottom edges. The top corners of the pockets shall be securely tacked through the polyester and cotton stay pieces.	301	LSd-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
40.	Set belt loops. (See figure 8.) Finished appearance. The belt loops shall finish vertically straight and shall be positioned with the back edge of belt loops 1/4 inch in from back end of the lower flaps. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to bottom folded edges.					
	a. Position one end of the 3-1/2-inch long belt loop on the right and left fronts and bartack the loop to the front at the top edge of the lower pocket flaps. Turn under the top end of the loop and bartack the loop to the front 1/8 to 3/16 inch from the folded edge, catching the turned under portion of the loop in the stitching. The bartack at the bottom shall be inside of the loop.	Bar-tack		20 per bar-tack (mini-mum)	A (silk)	A (silk)
41.	Join back and fronts at sides. Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
41.	Join back and fronts at sides.		(cont'd)			
	a. Position the back and fronts with edges even and join at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A
	b. Spread the side seams open and press flat with a heated pressing iron.					
42.	Tape armholes.					
	a. Sew 1/4-inch-wide stay tape around the armhole from a point 1 to 1-1/2 inches above notch on the fronts to 3/4 to 1 inch from shoulder edge on the back.	301 or 401	SSaa-1	10-14	A	A
	b. From the front notch to approximately 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness.	301 or 401	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
43.	Press shoulder blades and armholes.					
	a. Press the shoulder blades and armhole tapes smooth and flat with a heated pressing iron or suitable type pressing machine.					
44.	Shape fronts and trim bottom.					
	Finished appearance. In the finished coat, the left front shall overlap the right front 3-3/4 ± 1/4 inches at the bottom edge.					
	a. Mark and shape the left front edges of the coat. Mark and trim 3/16 inch at the upper left front, from the collar notch to the front edge. Dress the left front on a line running from the front top notch to the waist seam and 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on a straight line from the waist seam to the notch at bottom as indicated on the pattern.					
	NOTE: The left front shall be dressed during the shaping operation in the sewing room.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
44.	Shape fronts and trim bottom. (cont'd)					
	b. Mark the fronts 1-1/4 inches below bottom edge of lower pockets, and trim excess material at the front and back, if necessary. The right front shall not extend below the bottom edge of the left front.					
45.	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the bottom edge of coat and the front and top edge of left front without twists, gathers, puckers or pleats. The piping shall extend from the bottom right front edge to the collar notch at top edge of left front.					
	a. Position the 1-1/8-inch-wide strip of scarlet piping on the outside of the coat with one edge even with the bottom and front edge of left front. Stitch the piping to the coat 1/8 inch from the bottom edge and continue to stitch the piping to the front and top edges of the left front, leaving	301	SSa-1	10-14	A or A (silk)	A or A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
45.	Stitch piping to coat. (cont'd)					
	approximately 3/8 inch extension of piping at the end of each side of back vent for turning under. - or -					
	b. Fold over 1/4 inch of the 1-1/8-inch piping and seam to coat as above.	301	SSav-2 (a)	10-14	A or A (silk)	A or A (silk)
	c. Turn the piping to the inside, working out the corners, and top stitch uniformly 3/16 inch from folded edge of the piping, catching the turned under portion of piping at each end of the back vent. The piping shall finish 1/8 inch beyond the edges of coat. Notch out the excess piping at lower corner of left front to eliminate bulkiness.	301	SSe-2 (b)	10-14	A (silk)	A (silk)
	d. Notch the top edge of the piping approximately 2 inches from the lower front edge of coat.					
	e. Turn under the raw edge of piping along the bottom edge of coat 3/8 inch starting from the notch. Stitch the piping 1/16 to 3/32 inch	301	EFb-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
45.	Stitch piping to coat. (cont'd)					
	from the turned edge, catching the vent lining in the stitching. Continue the stitching of the upturned edge of piping to the bottom edge of coat.					
	f. Press piping at the front and top edges of the left front smooth and flat with a heated pressing iron.					
46.	Interline fronts.					
	a. Properly position the left and right fronts on the respective coat from interlining and baste along the top edge of the upper pocket flap on the outside.	301	Hopper			
	b. Tack the top edge of the upper pocket stay and the front end of the upper and lower pocket stays to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible.	301	Hopper			
	c. Baste the coat front interlining and fronts together, starting approximately 1-1/2 inches above the top	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
46.	Interline fronts. (cont'd)					
	edge of the upper pocket flap and baste along the center of the upper pocket flap and pocket, along the waist dart to the top edge of the lower pocket flap, and then diagonally across the front corner of the lower pocket flap to the front edge of the lower pocket, and from that point continue to baste along the front edge of the pocket to the bottom of the coat.					
	d. Baste across the shoulder, allowing room for setting the shoulder pad and working the fullness toward the armhole. Baste along front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the coat front interlining. Baste along the top edge, from the center basting stitches, from the shoulder to approximately 1-1/2 inches from front edge. Continue to baste along the front edge to the bottom edge of fronts.	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
46.	Interline fronts. (cont'd)					
	e. Trim the coat front interlining 1/4 inch back from the front and top front edge. The bottom of the interlining may be trimmed diagonally. Trim the inner edge of scarlet piping on the left front sufficiently so that in the finished coat, the piping will not be visible in the front buttonholes.					
	f. Place the inner edge of scarlet piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	301 or Hand	Hopper			
	g. Fell upper, front and lower inner edges of piping to the coat front interlining.	301 or Hand	EFc-1	4-6	A	A
	h. Press the left and right fronts, respectively, on a suitable type heated pressing machine with the chest to conform to the shape of the body					
	i. Remove basting stitches from piping.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
47.	Baste facing-lining assembly to right front.					
	a. Position the right facing-lining assembly on the outside of the right front. Baste along the front and continue basting along the bottom edge. The facing shall be held slightly taut across the bottom edge of the front while basting.	301	Hopper			
48.	Join right facing and front with tape.					
	a. Join the right facing to the right front 3/16 inch from the top and front edge of the coat, with the 3/8-inch-wide stay tape positioned on the interlining side of fronts and caught in the stitching. The tape shall be sewn with slight tension and shall extend from the upper collar notch to 1 inch above the bottom edge of the coat. The stay tape shall not be sewn beyond the collar notch. Extend the depth of the collar notch to the end of the seam line.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
48.	Join right facing and front with tape.			(cont'd)		
	b. Fell the inner edge of the 3/8-inch-wide tape to the coat front interlining from top to bottom ends.	301	SSm-1	4-6	A	
49.	Join facing to left front.					
	Finished appearance. The facing shall be uniformly joined to the left front without twists, gathers, puckers or pleats.					
	a. Position the left front to the front facing (face to face) with the waist line seam of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front raw edge of facing. Mark along the top, front and bottom edges of facing.					
	b. Lap the front edge of the left front on the outside of the facing at the marks and join the front to the facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to	301	LSa-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
49.	Join facing to left front. (cont'd)					
	bottom edge of the coat front only. Trim excess facing material where necessary.					
	- or -					
	c. Position left facing and lining assembly on the outside of left front and baste along front.	301 or Hand	Hopper			
	d. Join left front to facing, seaming through all plies, forming a 1/8-inch piping on the left front edge. The line of stitching shall be adjacent to the seam line of the scarlet piping.	301	SSav-2 (b)	10-14	A (silk)	A (silk)
	e. Fell upper front and lower inner raw edges of scarlet piping to the coat front interlining.	301 or Hand	EFc-1 (b)	4-6 4-6	A C (silk)	A
	f. Remove basting on left front, open up facing and front and stitch left front 3/16 inch from edge of scarlet piping.	301	SSaw-2 (b)	10-14	A (silk)	A (silk)
	g. Press the front edge smooth and flat with a heated pressing iron or pressing machine, removing the fullness.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
49.	Join facing to left front. (cont'd)					
	h. Remove basting from right facing; notch at collar terminal and trim upper front corner of facings.					
	i. Spread open the seam joining facing to right front from collar notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.					
50.	Baste fronts.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of left side, working the facing back from the folded edge of the piping.	101 or Hand				
	c. Baste along the front edges on right side, working the seam to the edge of coat. The basting shall extend from collar notch to bottom edge of coat.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
51.	Baste facings (second time).					
	a. Baste the facings to the fronts approximately 1-1/2 inches from the top, front and bottom edge of coat, holding the lower corner of coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing while basting.	Hand or 301	Hopper			
	b. Notch at collar terminal. Turn under and baste the top edge of the left facing to the front from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	301 or Hand	Hopper			
	c. Baste facings to fronts starting approximately 3 inches down from the shoulder edge of facing and as close as possible to the facing-lining seam, placing the fullness over the chest; continue to baste the facing along the inner folded edge of the binding from the bottom end of the facing-lining seam to the mark at lower edge of facing, properly	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
51.	Baste facings (second time). (cont'd)					
	distributing the fullness in the facing. Turn up the bottom edge of facing at the mark and baste along the folded edge.					
52.	Fell facings to fronts and tack to interling.					
	a. Fell the bound edge of left and right facings to the respective fronts with backstitching from top edge of piping at the bottom edge of coat to lower edge of coat front interlining at the waist.	301 or 306	BSa-1	6-8 6-8	0 or 00 (silk)	0 or 00 (silk)
	b. Tack the right and left facing-lining seam allowances to the respective coat front interlining from bottom edge of interlining at the waist to not more than 3 inches below the shoulder edge.	103	SSm-1	4-6	A	
53.	Baste yoke lining to back.					
	a. Properly position and baste the one piece rayon yoke lining to the inside of the back along the center pleat and	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
53.	Baste yoke lining to back. (cont'd)					
	along the armholes, shoulder and bottom edge of the yoke.					
54.	Baste and fell front linings.					
	a. When necessary, trim the back end of lower pocket stays away from side seams.					
	b. Fold the front lining in accordance with the notches, forming the chest pleat, and baste lengthwise along the entire center of pleat. Continue to baste from the lower end of the pleat toward the lower edge of armhole, along side seam and across bottom edge of lining. The folded edge of the pleat on the outside of the lining shall be towards the bottom of coat.	Hand or 301	Hopper			
	c. Turn under the back edge of the front lining and baste to coat, lapping the folded edge over the side seam and yoke lining. The	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
54.	Baste and fell front linings. (cont'd)					
	basting shall be approximately 3/4 inch from back folded edge.					
	d. Fell the turned under portion of lining to side seam allowance of the fronts and to the yoke lining with blindstitching 1/4 to 3/4 inch from back folded edge. Stitching shall extend from bottom finished edge of front lining to the lower edge of armhole.	301 or 503	EFc-1		0 or 00 (silk)	0 or 00 (silk)
55.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the yoke lining even with the back at the neck.					
56.	Edge stitch right front.					
	Finished appearance. The edge stitching on the right front shall be uniform and the same gage as on the pocket flaps.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
56.	Edge stitch right front.	(cont'd)				
	a. Edge stitch the right front uniformly 1/8 inch from the top and front edges. The stitching shall extend from collar notch to bottom edge of coat.	301 or Hand	SSe-2 (shows finish -ed seams)	10-14	A (silk)	A (silk)
57.	Baste shoulder pads.					
	a. Insert shoulder pads between interlining and chest padding of coat front interlining in line with armhole edge and securely tack the pad to the interlining and chest padding only.	301 or Hand				
58.	Press front edges.					
	a. Press the left and right front edges individually smooth and flat with a heated pressing iron or pressing machine.					
59.	Make Buttonholes.					
	Finished appearance. The buttonholes shall be cut first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button and the 34-line sewing hole button. The stitching of the buttonholes shall be					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
59.	Make Buttonholes. (cont'd) securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside. The inside edge of the eyelet end of the buttonholes shall be 1/2 inch from front edge of piping for size 30 to 34 and 5/8 inch from the front piped edge for size 35 to 46. a. Mark the left front in accordance with the marks on the pattern for the location of seven buttonholes. The mark for the bottom buttonhole shall be on the waist seam, the mark for the top buttonhole shall be 7/8 inch below the top piped edge of the front, and the marks for the remaining five buttonholes shall be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
59.	Make Buttonholes. (cont'd)					
	b. Make one horizontal eyelet end, square bar type buttonhole, 1-1/4 inches long, at each of the marks.	But-ton-hole		50 per button (mini-mum) not includ-ing bar-tack	B (silk)	F (silk)
	c. Care should be exercised when making the buttonhole at the waist so that the seam does not come open beyond the ends of the buttonhole.					
	d. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bar-tack	A (silk)	A (silk)
60.	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the fronts to the back at the shoulders with a 3/8-inch seam, working in the proper fullness on the backs in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
60.	Seam shoulders. (cont'd) b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
61.	Set shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched to the coat without twists, puckers, pleats or other distortions. On the finished coat, the straps, including the piping, shall be 2-1/2 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the center of the insignia button; the rounded end of the strap shall be 1/4 to 3/8 inch from the lower edge of collar. a. Position the shoulder straps with the back edge of the strap					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
61.	Set shoulder straps. (cont'd)					
	3/8 to 1/2 inch to the back of the shoulder seam at the armhole and with the rounded end, on the finished coat, to be 1/4 to 3/8 inch from the lower edge of collar.					
	b. Seam the shoulder straps to the coat at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	10-14	A (silk)	A (silk)
62.	Attach shoulder strap buttons.					
	Finished appearance. The center of the insignia buttons in the finished coat shall be 3/4 inch to 7/8 inch from the rounded end of the shoulder strap.					
	a. Mark each shoulder strap for the location of one 27-line insignia button.					
	b. Punch a hole at the mark though the shoulder strap and fronts only. Insert the shank of insignia button through					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
62.	Attach shoulder strap buttons. (cont'd)					
	the hole and reinforcement disc and secure button to coat on inside with a ring toggle.					
	- or -					
	c. Make one eyelet at the mark on each shoulder strap. The eyelets shall be well worked, and shall finish with a 1/8-inch diameter opening.	Eye-let		20 per eyelet (mini-mum)	A (silk)	A (silk)
63.	Baste shoulder.					
	a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges at the front. Baste all plies together on the outside along the front edges of armhole and continue along the shoulder seam, catching the shoulder pad in the basting. Turn coat on the inside.	101 or Hand			Comm-ercial	Comm-ercial
64.	Baste lining at shoulder.					
	Finished appearance. In the finished coat, the yoke lining shall be lapped on the facing-lining assembly.					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
64.	Baste lining at shoulder	(cont'd)				
	a. Turn under edges of back yoke lining at shoulders and baste upper part of each shoulder over the front shoulder lining.	Hand or 301	Hopper			
	- or -					
	b. In lieu of basting the lining at the shoulder as required in 63.a, 64.a, and hand felling as required in 71.e., trim the shoulder edge of the front lining, the coat front interlining, and yoke lining to approximately 3/8 inch from shoulder at the armhole edge and tapering to 1/8 inch at the neck, and join the yoke lining to the facing-lining assembly at the shoulder with a 3/8-inch seam, working in the proper fullness on the back. In the finished coat, the yoke lining shall be lapped on the facing lining assembly at the shoulder seam.	301 or 401	SSa-1	10-14	A	A
65.	Seam neckline with size label and hanger.					
	Finished appearance. The neckline shall					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
65.	Seam neckline with size label and hanger. (cont'd)					
	finish smooth and flat without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and the yoke lining to the coat at the neckline from collar notch to collar notch with a 1/4-inch seam and with the upper edge of the size label and the ends of the coat hanger properly positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A
66.	Set collar.					
	Finished appearance. The collar shall be carefully joined to the coat without twists, puckers, pleats, raw edges or distortion.					
	a. Mark neckline on the outside 1/2 inch from top edge for proper positioning of collar					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
66.	Set collar. (cont'd) from collar notch to collar notch. b. Position the collar with the lower edge lapped on the outside top edge of coat at the mark. c. Seam the collar, from end to end, to the coat as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining. The collar shall not deviate more than 1/8 inch from the collar notches on each end of collar.	301	LSa-1	10-14	A (silk)	A (silk)
67.	Set sleeves. Finished appearance. The armhole sleeve seam shall finish smooth and flat without twists, gathers, puckers or pleats. a. Position sleeves on outside of coat at the armholes with backarm seam of sleeve matching the side-back seam line, and with notch in					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
67.	Set sleeves. (cont'd) top sleeve and fronts matching. b. Join the sleeves to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching. Upon the completion of setting the sleeve, the front edge of the sleeve should hang 1-1/2 inches behind the centerpoint of the lower pocket flap. c. Notch armhole seam allowance on back and front adjacent to each side of the shoulder strap. d. Press fullness of sleeve flat all around armhole, with the seam facing toward the sleeve, with a heated pressing iron on a suitable shaped pressing buck, shrinking fullness and holding armhole short. Care shall be exercised in pressing armhole seam in order not to stretch armhole.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
68.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeves to the front notch of coat.	Hand or 301	Hopper			
69.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole sleeve seam and with one end of the pad matching the notch in the fronts.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
69.	Stitch sleeve head pads and linings at armhole. (cont'd)					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the armhole and the stay for the upper pockets, the front and yoke linings, and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
70.	Baste underarm shield to coat.					
	a. Position the underarm shield on lining side of coat with raw edges even with lower edge of armhole.					
	b. Baste or tack underarm shield at the base of armhole. The shield shall not cover the opening of the inside pocket.	301 or Hand			Comm-ercial	Comm-ercial
	Alternate: The underarm shield may be joined to the lining by superimposing the seam on the seam joining the binding to the shield.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
71.	Fell linings.					
	a. Position the sleeve lining at the armhole with back forearm seams of sleeves and lining matched. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and yoke lining at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of lining and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from approximately 1-1/2 inches to the front of the forearm sleeve lining seam and extend the stitching to the side seam of body lining.	Hand		8-10	C	C
	- or -					
	b. Stitch the sleeve lining by machine to the armhole on the inside from forearm to backarm seam across the undersleeve.	301	SSa-1	10-14	A	A
	c. As an alternate, the armhole lining may be					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
71.	Fell linings. (cont'd)					
	felled utilizing a sleeve lining felling machine that consists of a feed off the arm machine equipped with a lower and upper feed (review specification requirements for felling of sleeve lining in relation to appropriate turn under).					
	1. Stitch sleeve lining to armhole on inside from front sleeve notch to backarm seam across under sleeve.	301	SSa-1	10-14	50	50
	2. Stitch the top sleeve lining to armhole on inside from the front armhole notch to top back arm lining seam across the crown of the top sleeve lining.	306	SSa-1	10-14	50 or mercer-ized cotton 50/2 or 3 or nylon A	50 or mercer-ized cotton 50/2 or 3 or nylon A
	3. Close the previous left opened forearm seam 1/16 to 3/32 inch from edge.	310	SSc-1	10-14	50	50
	NOTE: Alternate construction. When the alternate construction to fell the armhole lining by machine is used, it consists of leaving an opening between the notches of the forearm sleeve lining seam. Stitching the lining to the armhole on the inside from					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
71.	Fell linings. (cont'd)					
	front sleeve notch of sleeve to back arm seam across undersleeve (301 stitch). Utilizing the forearm sleeve opening stitch the top sleeve lining to the armhole of inside by felling machine from front sleeve notch to back arm seam across the crown of top sleeve lining. Close the previous left opened forearm seam					
	d. Fell the lower corners of the front linings to the facings and the front seam allowance, respectively.	Hand		8-10	C (silk)	
	As an alternate, this operation may be performed by machine with two blind tacks on each side.			12	A	
	e. Fell the upper back edge of the front lining to the yoke lining, placing the stitching over the folded edge of front lining. Fell the lower finished edge of yoke lining to the side seam outlet.	Hand		8-10	C (silk)	
	As an alternate, this operation may be performed by machine with two blind tacks on each side.			12	A	
	f. Fell the yoke lining and facing-lining assembly together at the	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
71.	Fell linings. (cont'd)					
	shoulders, placing the stitching over the folded edge of the yoke lining and securing the top end of the chest pleat in the felling.					
72.	Tack facings.					
	a. Securely tack the folded top edge of left facing to the scarlet piping at top edge of coat from collar notch to front edge.	Hand		8-10	C (silk)	
	b. Fell the lower back and bottom edges of facings to the scarlet piping at bottom edge of coat, starting at the top edge of piping and continuing along the back and bottom edge of coat.	Hand		8-10	C (silk)	
	- or -					
	c. The lining may be machine tacked.			12	A	
	d. Stitch the bottom folded edge of facing to coat through all plies. The right facing may be caught in the edge stitching specified in operation 55., continuing to the back edge of facing. The	301	SSc-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
72.	Tack facings. (cont'd) left facing may be caught by superimposing a row of stitching on the piping and raise stitching from back edge of facing and up front edge for 1/2 inch.					
73.	Sew hook and eye to collar. Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of collar without misalignment.					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom of the forward edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of collar through the individual holes at the rear of the hook and eye.	Hand		16 per hook 16 per eye	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
74.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar. - or - As an alternate, the collar lining may be attached to the coat using a simulated hand felling machine.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling.	Hand		8-10	C (silk)	
	d. Fell the collar extension tab from the underside, to the collar, across the left	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
74.	Finish collar. (cont'd)					
	front end of the collar, leaving an opening of 1/4 to 3/8 inch between the stitching line and the inside back edge of the eye to properly engage the hook. Continue felling along					
	the folded top edge to the end of the stitching, joining the lining to the collar.					
	e. Turn the collar eyelet covers to the inside of the collar and fell the cover to the collar lining along the front edge. Continue the felling along the bottom edge for a distance of approximately 1/2 inch from the front edge.	Hand		8-10	C (silk)	
75.	Clean coat.					
	a. Pull all basting thread, trim and remove all loose ends of thread, and remove all spots, stains and tickets without injury to the material.					
76.	Press coat.					
	Finished appearance. The coat shall be well					

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
76.	Press coat. (cont'd) pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. b. Press the entire collar smooth and flat. c. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. d. Press the lower fronts and pockets smooth and flat. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness					

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
76.	Press coat. (cont'd) and lapping the left vent on the right vent. g. Pressing the sleeves smooth and flat, without injury to the buttons on ornamental sleeve pieces, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the bottom edge of the breast pocket. The backarm crease shall be in line with the forearm crease. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. i. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking in the top sleeves.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
76.	Press coat. (cont'd) k. Press lower edge of coat smooth, flat, and even. l. Remove all wrinkles and impressions from under pocket flaps. Remove all impressions of the side and center back seam allowances from the coat. Press linings throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat.					
77.	Mark for buttons. a. Mark the right front for the location of six 40-line insignia buttons and one 34-line sewing hole button to properly engage with the buttonholes in the left front. The mark for the top button shall be in line with right front end of collar and remaining buttons shall be in vertical alignment with top mark and equal distance from the front edge of coat. b. Mark each upper and lower pocket for location of one 27-line					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
77.	Mark for buttons. (cont'd)					
	insignia button to properly engage with the buttonhole in the flaps.					
78.	Sew on buttons.					
	Finished appearance. The buttons shall be securely sewn to the coat and shall properly engage buttonholes in the left front and lower and upper pocket flaps. The insignia buttons on the front and pockets shall finish with the head of the eagle in an upright position. When the coat is buttoned, the center of those buttons between the upper pockets shall be midway between the front edge of the pockets.					
	a. Sew one 40-line insignia button at each of the marks on the right front. The buttons shall be sewn through all plies of material.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double thread)	24/4 24/4	 24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements. (cont'd)

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
78.	Sew on buttons. (cont'd)					
	b. Sew one 34-line sewing hole button at the waist mark on the right front through all plies, necking the button for shank wrapping.	101 or 301 or Hand		21 per button 21 per button 6-8 per button (double thread)	24/4 24/4 24/4	 24/4
	c. Shank wrap the 34-line sewing hole button.	Hand or Machine		4 wraps (double thread) 16 stitches per shank	24/4 24/4	 24/4
	d. Sew a 27 line insignia button at the mark on each upper and lower pocket.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double thread)	24/4 24/4	 24/4 24/4

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Tables II and III.

Table II. Coat measurements 1/

EXTRA-SHORT

Size	Breast 2/	Back Length 3/	Sleeve Length 4/	Collar Length/width/5/
30	32	27	17	14-1/2 x 1-3/4
32	33	27-1/4	17	15 x 1-3/4
33	34	27-3/8	17	15-1/4 x 1-3/4
34	35	27-1/2	17	15-1/2 x 1-3/4
35	36	27-5/8	17	15-3/4 x 1-3/4
36	37	27-3/4	17	16 x 1-3/4
37	38	27-7/8	17	16-1/4 x 1-3/4
38	39	28	17	16-1/2 x 1-3/4
39	40	28-1/8	17	16-3/4 x 1-3/4
40	41	28-1/4	17	17 x 1-3/4
41	42	28-3/8	17	17-1/4 x 1-3/4
42	43	28-1/2	17	17-1/2 x 1-3/4
43	44	28-5/8	17	17-3/4 x 1-3/4
44	45	28-7/8	17	18 x 1-3/4
46	47	29-1/8	17	18-1/2 x 1-3/4
48	49	29-3/8	17	19 x 1-3/4

SHORT

Size	Breast 2/	Back Length 3/	Sleeve Length 4/	Collar Length/width/5/
30	32	28	18	14-1/2 x 1-3/4
32	33	28-1/4	18	15 X 1-3/4
33	34	28-3/8	18	15-1/4 x 1-3/4
34	35	28-1/2	18	15-1/2 X 1-3/4
35	36	28-5/8	18	15-3/4 X 1-3/4
36	37	28-3/4	18	16 x 1-3/4
37	38	28-7/8	18	16-1/4 x 1-3/4
38	39	29	18	16-1/2 x 1-3/4
39	40	29-1/8	18	16-3/4 x 1-3/4
40	41	29-1/4	18	17 x 1-3/4
41	42	29-3/8	18	17-1/4 x 1-3/4
42	43	29-1/2	18	17-1/2 x 1-3/4
43	44	29-5/8	18	17-3/4 x 1-3/4
44	45	29-3/4	18	18 x 1-3/4
46	47	30	18	18-1/2 x 1-3/4
48	49	30-1/4	18	19 x 1-3/4

Source: https://assist.dla.mil -- Downloaded: 20260-19T06:06Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements 1/

REGULAR				
Size	Breast 2/	Back Length 3/	Sleeve Length 4/	Collar Length/width/5/
30	32	29	19	14-1/2 X 2
32	33	29-1/4	19	15 X 2
33	34	29-3/8	19	15-1/4 x 2
34	35	29-1/2	19	15-1/2 X 2
35	36	29-5/8	19	15-3/4 X 2
36	37	29-3/4	19	16 X 2
37	38	29-7/8	19	16-1/4 X 2
38	39	30	19	16-1/2 X 2
39	40	30-1/8	19	16-3/4 X 2
40	41	30-1/4	19	17 X 2
41	42	30-3/8	19	17-1/4 X 2
42	43	30-1/2	19	17-1/2 X 2
43	44	30-5/8	19	17-3/4 X 2
44	45	30-3/4	19	18 X 2
46	47	31	19	18-1/2 x 2
48	49	31-1/4	19	19 X 2

LONG				
Size	Breast 2/	Back Length 3/	Sleeve Length 4/	Collar Length/width/5/
30	32	30	20	14-1/2 X 2
32	33	30-1/4	20	15 x 2
33	34	30-3/8	20	15-1/4 X 2
34	35	30-1/2	20	15-1/2 X 2
35	36	30-5/8	20	15-3/4 X 2
36	37	30-3/4	20	16 x 2
37	38	30-7/8	20	16-1/4 X 2
38	39	31	20	16-1/2 X 2
39	40	31-1/8	20	16-3/4 X 2
40	41	31-1/4	20	17 X 2
41	42	31-3/8	20	17-1/4 X 2
42	43	31-1/2	20	17-1/2 X 2
43	44	31-5/8	20	17-3/4 X 2
44	45	31-3/4	20	18 X 2
46	47	32	20	18-1/2 X 2
48	49	32-1/4	20	19 X 2

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements 1/

EXTRA-LONG				
Size	Breast 2/	Back Length 3/	Sleeve Length 4/	Collar Length/width/5/
35	36	32-1/8	21-1/2	15-3/4 X 2
36	37	32-1/4	21-1/2	16 X 2
37	38	32-3/8	21-1/2	16-1/4 X 2
38	39	32-1/2	21-1/2	16-1/2 X 2
39	40	32-5/8	21-1/2	16-3/4 X 2
40	41	32-3/4	21-1/2	17 X 2
41	42	32-7/8	21-1/2	17-1/4 X 2
42	43	33	21-1/2	17-1/2 X 2
43	44	33-1/8	21-1/2	17-3/4 X
44	45	33-1/4	21-1/2	18 X 2
46	47	33-1/2	21-1/2	18-1/2 X 2
48	49	33-3/4	21-1/2	19 x 2

1/ Tolerance on all measurements except collar: ± 3/8 inch.
Tolerance is on 1/2 breast measurements.
Tolerance for collar length measurements: ± 1/4 inch.

2/ Breast measurement shall be taken with coat buttoned from folded edge to folded edge, in line with pit of armhole, and multiply by 2.

3/ Back length measurement shall be taken along center back seam from lower edge of collar to piped edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of sleeve.

5/ Collar sizes represent length of collar in inches measured from end to end along the center.

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

TABLE III. Pocket and flap measurements. 1/

UPPER POCKETS AND FLAPS			
Size (Short, Regular, Long, Extra Long)	30-35	36-41	42-48
Length of flap at center point.	2-3/4	2-7/8	2-7/8
Length of flap at sides. 2/1	2	2-1/8	2-1/8
Width of flap at top edge	4-1/2	5	5-1/2
Width of pocket at top, side to side edge.	4-1/4	4-3/4	5-1/4
Length of pocket, top to bottom edge.	5-1/2	6	6-1/2

LOWER POCKETS AND FLAPS			
Size (Extra Short, Short, Regular, Long, Extra Long)	30-35	36-41	42-48
Length of flap at center point.	3-3/4	3-3/4	3-3/4
Length of flap at sides. 2/1	2-1/4	2-1/4	2-1/4
Width of flap at top edge, side to side edge.	7	7-5/8	8-3/8
Width of pocket at top edge, side to side edge.	6-3/4	7-3/8	8-1/8
Width of pocket at the bottom, side to side edge.	9-1/4	9-3/4	10-1/2
Length of pocket, top to bottom edge:			
Extra Short	10-1/4	10-1/4	10-1/4
Short	10-1/2	10-1/2	10-1/2
Regular	10-3/4	10-3/4	10-3/4
Long	11	11	11
Extra Long	11-1/2	11-1/2	11-1/2

1/ Tolerance on all measurements: ± 1/8 inch.

2/ Dimension for length of flap at sides shall be taken 1/4 inch in from outer edges of flaps from top to bottom.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS.

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Certification of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specification and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing will be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table IV for characteristics noted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Table IV - Test methods

Components	Characteristics	Rqmt. para.	Test method	No. Determinations per sample unit	Results Reported as:
Cloth, Cotton, Buckram (collar interlining	Material identification	3.3.4.1	1200	1	Pass or fail
	Weave (single ply)	3.3.4.2	Visual	1	Pass or fail
	Texture-threads per inch (single ply)	3.3.4.3	5050		
	- warp			3	Avg. of the 3 det in each direction to the nearest whole number.
	- filling			3	
	Resistance to:				
	- Wet (dry) cleaning (laminated cloth)	3.3.4.4	5622	1	Satisfactory or unsatisfactory to standard. If no standard: good, fair or poor.
	- Accelerated aging (laminated cloth)	3.3.4.4	5622	1	Pass or fail
	- Perspiration	3.3.4.4	5682	1	Satisfactory or unsatisfactory to standard. If no standard: good, fair or poor.
	Stiffness - in. lb.				
	- original 1/	3.3.4.4.1	5202	10	Nearest 0.001 lb.
	- after wet (dry) cleaning 2/	3.3.4.4.1	5622	10	
	- after accelerated aging 3/	3.3.4.4.1	5850	10	
	- after perspiration 4/	3.3.4.4.1	5680	10	

Source: https://assist.dla.mil/ Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Table IV - Test methods

Components	Characteristics	Rqmt. para.	Test method	No. Determinations per sample unit	Results Reported as:
	Weight - oz. per sq. yd.	3.3.4.4.2	5041	5	Avg. of the 5 det to the nearest 0.1 oz.
	Breaking strengths lbs. (laminated cloth)	3.3.4.4.3	5100	5	Avg. of the 5 det in each direction
	- warp direction			5	to the nearest
	- filling direction			5	1.0 lb.
Padding, felt (for collar)	Material identification	3.3.5	1200	1	Pass of fail
	Weight - oz. per sq. yd.	3.3.5	5041	5	Avg. of all det to nearest 0.1 oz.
	Color	3.3.5	Visual	1	Pass or fail
Hook and eye	Material identification 5/	3.3.16	Std Comm'l	1	Pass or fail
	Design	Fig. 1	Visual	1	Pass or fail
	Measurements	Fig. 1	Std Comm'l	1	Pass of fail
	Finish	3.3.16.1	Std Comm'l	1	Pass or fail
	Finish (tackiness) 6/	3.3.16.1		1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

1/ Method 5202, using a moment-weight of 1 pound.

2/ Method 5622, except the material shall be subjected to three 20-minute test cycles.

3/ Method 5850, except the aging process shall be limited to 5 hours at a temperature of 100°C.

4/ Method 5680, except the material shall be immersed in the specified solution for 20 minutes and then air-dried.

5/ Accept a certificate of compliance for this requirement.

6/ Test for tackiness. At room temperature (60° to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.5.1.1 Sampling. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirements specified herein.

Lot size	Sample size (sample unit)
800 or less	2
801 through 22,000	3
22,001 and over	5

The unit for expressing lot size and sample unit for testing each component shall be in accordance with the applicable subsidiary specification and as follows:

Components	Lot size expressed as	Sample unit for testing
Padding for collar	Yards	1/4 yd. full width
Cloth, Cotton Buckram (for collar)	Yards	2 yds. full width
Buttons, (each type and size)	Gross	20 each
Ring, toggle	Gross	5 complete sets
Hook and eye	100 each	2 ea. hook and eye

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects listed in 4.5.3.2, 4.5.3.3, 4.5.3.4 and 4.5.3.5. The model forms used for the separate sizes of coats will be shown below. The sample unit shall be one coat.

Coat Size (S)	Form Size
30-33	30
34-35	32
36-37	34
38-39	36
40-41	38
42-43	40
44-45	42
46-47	44
48	46

NOTE: Tolerance of 1/2 inch in all form measurements.

4.5.3.1 Classification of defects. All defects shall be classified as indicated below except those in the asterisk (*) column numbered 1 - 31 shall be classified as:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When affecting appearance or serviceability, but not seriously.

4.5.3.2 General defects. General defects shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Bartacks	One or more missing, loose or misplaced (except bartacks on buttonholes).		201	
Buttonholes	a. One or more omitted, added, or wrong type.	101		
	b. Not corresponding to size of button (front and flaps):			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		202	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on:			
	- one front buttonhole.		203	
	- two or more front buttonholes.	104		
	- one or more flap buttonholes.		204	
	e. Bartack misplaced, not serving intended purpose on one or more buttonholes:			
	- front buttonholes.		205	
	- flap buttonholes.		206	
	f. One or more broken stitches in:			
	- one front buttonhole.		207	

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	- two or more front buttonholes.	105			
	- one flap buttonhole.				301
	- two or more flap buttonholes.			208	
	g. More than 2 skipped stitches in:				
	- one buttonhole.				302
	- two or more buttonholes.			209	
	h. Ragged edges, affecting appearance.				303
	i. Any uncut buttonhole.			210	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.			211	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified):				
	- one or two stitches.				304
	-three or more stitches.			212	
	l. One or more buttonholes finished with purling on the underside.	106			
Buttons	a. One or more missing, loose, defective or improper size or type.			213	
	b. One or more buttons sewn with the head of the eagle in other than upright position (font and pockets).				305
	c. Bottom button on front not shank wrapped.			214	

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges, unsound soldering; scratches, dents; blemishes or imbedded foreign matter; loose or bent shanks; or are poorly plated or badly shaded.				
Ring toggles and reinforcement discs	Shoulder and ornamental sleeve piece buttons:			
	a. One ring toggle omitted.			306
	b. Two ring toggles omitted.		215	
	c. Three or more ring toggles omitted.	107		
	d. One or more reinforcement discs omitted.		216	
Cleanness	a. Any spot or stain clearly noticeable: - on outside. - on inside.	108		 307
	b. Thread ends not trimmed throughout garment, or one or more bastings not removed, or two or more shade tickets not removed.			308
	c. Any residue of synthetic thread when used not brushed off or removed.			309
Components and assembly	a. Any component part or required operation omitted (not herein classified).		1	
	b. Any defective component or defect of assembly (not herein classified).		2	

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	109		
	b. Wool broadcloth for piping cut on bias.		217	
	c. Any lining part not cut in accordance with directional lines on patterns, or in accordance with specification requirements.		218	
Eyelets	a. One or more omitted or added.	110		
	b. Wrong type.		219	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	111		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.		220	
	e. One or both eyelets uncut.		221	
	f. One or more broken stitches in: - one eyelet. - two eyelets.		 222	310
	g. More than two skipped stitches in one or both eyelets.		223	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Hook and eye	a. Hook or eye omitted.	112		
	b. Not specified type or size.		224	
	c. Hook or eye not securely tacked to ends of collar.		225	
	d. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hook and eye are fastened.	113		
Material defects and damages	a. Any weakening defect, such as smash, multiple float, and loose slub.		3	
	b. Any hole.		4	
	c. Shade bar, unsightly slub, etc., affecting appearance: - on outside. - on inside.		5	 226
	d. Scissors or knife cut, tear, mend, or burn.		6	
	e. Needle chews that may develop into a hole.		7	
NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition weakens the fabric or when it is conspicuously located. Nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows: Material defect . . . . . No defect Workmanship damages . . . . Minor B defect				
Pressing	a. Burned or scorched.		8	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Pressing omitted entire garment.		227	
	c. Armhole stretched.	9		
	d. Poorly pressed (unless otherwise indicated).			312
	e. Basting or pressing impressions not removed.			313
	f. Gloss not removed.			314
	g. Armholes not blocked or poorly blocked.		228	
	h. Edges bulky, i.e., not pressed solid.		229	
	i. Inside of armhole not creased as required.		230	
	j. Armhole seam not pressed open across top as required.		231	
	k. Sleeve not creased at front or backarm seam as specified.			315
	l. Wrinkles or pressing impressions not removed under pocket flap, side, or center back seam allowance.			316
	m. Linings not pressed smooth.			317
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, gathered, puckered or pleated.		232	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Part of garment caught in any unrelated operation or stitching.	10		
	3. Unsightly hand felling or blindstitching exposed on outside of coat affecting appearance.		233	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or back stitched as required.			318
	5. Wrong color of thread or two shades of thread used on outside of coat affecting appearance.	11		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		234	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			319
	c. Open seams:			
	1. On outside (except pocket binding): - up to 1/4 inch inclusive.			320
	- more than 1/4 inch but not more than 1/2 inch.		235	
	- more than 1/2 inch.	114		

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	- any open seam on pocket binding:			
	- up to 1/4 inch inclusive.			321
	- more than 1/4 inch.		236	
	2. On inside:			
	- more than 1/2 inch (except machine felling).		237	
	- up to 1/2 inch inclusive (except machine felling).			322
	- up to 1 inch inclusive (machine felling).			323
	- more than 1 inch (machine felling).		238	
NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.				
	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			324
	- more than 1/8 inch but not more than 1/4 inch.		239	
	- more than 1/4 inch.	115		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			325
	- more than 1/4 inch.		240	
NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	e. Run-offs (see classification of open seams).				
	f. Stitch tension:				
	1. Loose tension resulting in loose seam.	116			
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.			241	
	3. Tight tension (stitches break when normal strain is applied).	117			
NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.					
	g. Stitches per inch (including labels) less than minimum specified:				
	- one or two stitches.				326
	- three stitches.			242	
	- four or more stitches.	118			
	- one or more stitches on labels.				327
NOTE: To be scored only if condition exist on major portion of seam.					
	h. Wrong stitch or seam type.			243	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched):				
	- 1/4 inch or more but not more than 1/2 inch.				328
	- more than 1/2 inch.			244	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

4.5.3.3 Detailed defects (coat buttoned on form). Detailed defects (with coat buttoned on form) shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Shaded parts	a. On outside:			
	1. Any shaded part (except belt loops.		12	
	2. Belt loop badly shaded.			329
	b. On inside:			
	1. Any lining part badly shaded (except sleeve lining).		245	
	2. Any lining part badly shaded or pairs not matching each other.			330
Collar (construction and setting)	a. Interlining omitted.	119		
	b. Interlining tight or twisted, causing puckers on collar, affecting appearance.		246	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.		13	
	d. Piping irregular, affecting appearance.		247	
	e. Collar ends overlapping when fastened.		248	
	f. Collar ends spread open more than 1/4 inch when fastened.	120		

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	g. Binding strip of polyester and cotton lining at bottom edge of interlining omitted.	121			
	h. Binding strip at top edge of interlining other than specified basic material.	122			
	i. Center of eyelets from finished ends of collar: - less than 1-3/8 inches or more than 1-5/8 inches.			249	
	j. One or both eyelets off-center with top and bottom edges of collar by more than 1/16 inch.	123			
	k. Collar off-center by more than 1/4 inch.	124			
	l. Finished width of collar (short sizes): - less than 1-5/8 inches or more than 1-7/8 inches.			250	
	m. Finished width of collar (all other sizes): - less than 1-7/8 inches or more than 2-1/8 inches.			251	
	n. Collar irregular in width by 1/4 inch or more.			252	
	o. Front finished ends of collar uneven in width by 3/16 inch or more.			253	
	p. Binding not exposed or not extending uniformly 1/8 inch beyond piping at top edge of collar.			254	

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	q. Polyester and cotton binding strip exposed beyond bottom edge of collar.			255	
	r. End of collar distorted, twisted or crooked, caused by hand felling or hand stitching exposed on outside of either collar end.			256	
	s. Hand tacking at lower corner of collar to coat insecure or omitted.			257	
Alignment of front buttons and buttonholes	Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.			258	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:				
	- more than 1/8 inch but not more than 1/4 inch.			259	
	- more than 1/4 inch.	125			
	b. Left front at corner longer than right front by:				
	- more than 1/4 inch but not more than 3/8 inch.				331
	- more than 3/8 inch.			260	
	c. Right front at corner exposed beyond bottom of left front by more than 1/8 inch.			261	
Alignment of front waist seams	Out of horizontal alignment by more than 1/4 inch.			262	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Pocket alignment position construction	a. Flaps (all flaps):			
	1. Lining tight or twisted, causing fullness or twist on flaps, affecting appearance.	14		
	2. Overedge stitching on upper edge of flap omitted on:			
	-one flap.			332
	- two or more flaps.		263	
	3. Lining exposed on edge of flap, affecting appearance.		264	
	4. Poorly shaped, not in conformity with flap shaper.	15		
	5. Stitching joining flaps to fronts not caught through polyester and cotton stay-piece.		265	
	6. Corners of flaps not securely backstitched.		266	
	b. Flap buttonholes (position):			
	1. Position of buttonholes from pointed edge of flap (measured to inside edge of eyelet):			
	- less than 1/2 inch or more than 3/4 inch.		267	
	2. Out of alignment with point at center of flap by more than 1/8 inch. inch.		268	
	c. Upper pocket flaps (position):			
	1. Out of horizontal alignment by:			

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	- more than 1/4 inch		16		
	- more than 1/8 inch up to 1/4 inch inclusive	126			
	2. Flap not covering pocket opening:				
	- front corner of 1 or both pockets.	127			
	- back corner of 1 pocket.				333
	- back corner of both pockets.			269	
	3. Lower side of flap edge extending beyond 1 or both edges of 1 or both pockets by 1/8 inch or more.				334
	4. Lower side edge of flap (excluding rounded corners) not covering side edge of pocket by 1/8 to 3/16 inch:				
	- front edge of 1 or both pockets.			270	
	- back edge of 1 or both pockets.				335
	5. Lower side edge of flap (excluding rounded corners) not covering side edge of pocket by more than 3/16 inch:				
	- front edge of 1 or both pockets.	128			
	- back edge of 1 or both pockets.			271	
	6. Point of breast pocket flap from center of pocket pleat:				
	- more than 1/8 inch but not more than 1/4 inch. inch.				336
	- more than 1/4 inch.			272	
	7. Top edge of flap not positioned midway between second and third buttonholes ± 3/16 inch.			273	

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
NOTE: Pockets must be in horizontal alignment with each other as required.					
	8. Staypiece not tacked or not securely tacked to interlining across top edge of front center.				337
	9. Polyester and cotton staypiece omitted on underside of one or both pockets.			274	
	10. Top edge of pocket less than 3/8 inch or more than 5/8 inch below the top stitching of flap.				338
	11. Top edge of flap crooked.			275	
	d. Upper pockets.				
	1. Binding on top edge omitted or not securely caught to fabric, causing binding to pull away from fabric.			276	
	2. One or both pocket corners not securely tacked.			277	
	3. Pleat off center 1/4 inch or more at lower edge of flap.			278	
	4. Pleat formed crookedly, affecting appearance.			279	
	5. Poorly shaped, not in conformity with pocket shaper.		17		
	6. Constructed with fold of pleat on the underside.	129			
	7. Pleat less than 1-1/8 inches or more than 1-3/8 inches wide (sizes 30-35).				339

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	8. Pleat less than 1-3/8 inches or more than 1-5/8 inches wide (sizes 36-46).				340
	9. Front edge of pleat below flap not parallel with front edge of pocket by more than 3/16 inch.			280	
	10. Pleat not stitched closed.				341
	11. Bottoms of pockets out of horizontal alignment by:				
	- 1/4 inch or more but not more than 3/8 inch.			281	
	- more than 3/8 inch.	130			
	12. Front edge of pocket not parallel with front edge of coat when buttoned by:				
	- 1/4 inch or more but not more than 3/8 inch.			282	
	- more than 3/8 inch.	131			
	13. Excessive fullness or tightness at pocket opening, affecting appearance.			283	
	14. Button and buttonhole not aligned, causing noticeable bulge or twist on pocket or flap when buttoned, affecting appearance.			284	
	15. Lower corners of pocket not trimmed.			285	
	e. Upper pockets and flaps measurements:				

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	1. Length of flap (at center point), length of flap (at sides), width of pocket (at top edge, side to side edge), width of pocket (at bottom edge, side to side edge), length of pocket (top to bottom edge). Any of the above dimensions and tolerances included in Table III:				
	- by more than the tolerance but not more than twice the tolerance.				342
	- by more than twice the tolerance.			286	
	f. Lower pocket flaps (position):				
	1. Out of horizontal alignment by:				
	- 1/4 inch or more but not more than 1/2 inch.			287	
	- more than 1/2 inch.	132			
	2. Flap not covering pocket opening:				
	- Front corner of 1 or both pockets.	133			
	- back corner of 1 pocket.				343
	- back corner of both pockets.			288	
	3. Lower side edge of flap extending beyond or both edges of or both pockets by more than 3/16 inch.				344

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	4. Front edge of flap out of vertical alignment with front edge of upper pocket 1/4 inch or more.			289	
	5. Lower side edge of flap (excluding rounded corners) not covering side edge of pocket by 1/8 inch or more but not more than 1/4 inch:				
	- front edge of 1 or both pockets.			290	
	- back edge of 1 or both pockets.				345
	6. More than 1/4 inch:				
	- front edge of 1 or both pockets.	134			
	- back edge of 1 or both pockets.			291	
	7. Front edge of flaps not parallel with front edge of coat by 1/4 inch or more when coat is buttoned.			292	
	8. Polyester and cotton staypiece not tacked or not securely tacked interlining at front corner.			293	
	9. Polyester and cotton staypiece omitted on underside of 1 or both pockets.			294	
	10. Top edge of flap not parallel with the waist seam by 1/4 inch or more.			295	
	g. Lower pockets:				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	1. Binding on top edge omitted or not securely caught in fabric, causing binding to pull away from fabric.			296	
	2. One or both pocket corners not securely stitched.			297	
	3. Pockets poorly shaped, not in conformity with pocket shaper.		18		
	4. Distance between bottom edge of lower pocket and bottom edge of coat:				
	- less than 1 inch but not less than 3/4 inch.				346
	- less than 3/4 inch.			298	
	5. Bottom edge of pocket not parallel with bottom edge of coat by:				
	- 1/4 inch or more but not more than 3/8 inch.			299	
	- more than 3/8 inch.	135			
	6. Bottoms of pockets out of horizontal alignment by:				
	- more than 1/4 inch but not more than 1/2 inch.			300	
	- more than 1/2 inch.	136			
	7. Excessive fullness or tightness at pocket opening, affecting appearance.			201a	
	8. Diagonal position of pocket (front edge from directly below flap to bottom edge) with front edge of coat.				
	- parallel with front edge.				347
	- slanted more than 3/8 inch from front edge (i.e., towards			202a	

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	side seam). - slanted 1/8 inch or more towards front edge.	137		
	9. Button and buttonhole not aligned, causing noticeable bulge or twist on pocket or flap.		203a	
	h. Lower pockets and flaps measurements:			
	1. Length of flap (at center point), length of flap (at sides), width of flap (at top edge, side to side edge), width of pocket at bottom edge, (side edge to side edge) length of pocket (top to bottom edge) for Short, Regular, Long and X-Long. Any of the above dimensions varying from nominal dimensions and tolerances included in Table III: - by more than the tolerance but not more than twice the tolerance - by more than twice the tolerance.		204a	348
Shoulder (construction)	Improper joined or set, causing shoulders or back to twist.	19		
Shoulder pads	a. Not completely caught in armhole tacking.		205a	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		206a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	c. One or both pads omitted.	138			
Shoulder straps	a. Misplaced, i.e., one strap further forward or back from position of other strap affecting appearance.			207a	
	b. Strap stitched to coat too full or twisted, or stitched to coat too tight, causing fullness or twist on front or back of coat.			208a	
	c. Poorly shaped.				349
	d. Shoulder seam exposed beyond back edge of shoulder strap (except rounded end).			209a	
	e. Width of shoulder strap at armhole seam (including piping):				
	- less than 2-1/4 inches but not less than 2-1/8 inches.				350
	- more than 2-1/2 inches but not more than 2-5/8 inches.				351
	- less than 2-1/8 inches or more than 2-5/8 inches.			210a	
	f. Width of shoulder strap across center of insignia button (including piping):				
	- less than 1-1/2 inches but not less than 1-3/8 inches.				352
	- more than 2 inches but not more than 2-1/8 inches.				353
	- less than 1-3/8 inches or more than 2-1/8 inches.			211a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	g. Rounded end of shoulder strap positioned less than 1/4 inch or more than 3/8 inch from collar edge.			354
	h. Piping irregular in width, affecting appearance. Buttons not uniformly set from collar edge by more than 1/4 inch.		212a	
	i. Buttons not uniformly set from collar edge by more than 1/4 inch.		213a	
	j. Center of buttons less than 3/4 inch or more than 7/8 inch from rounded end of strap (including piping).			355
Armholes (construction)	a. Badly stretched.	20		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	21		
	c. Crooked seam.			356
	d. Tape stitching exposed and visible on outside surface.			357
	e. Sleeve head pads not completely tacked to armholes, or misplaced, not serving intended purpose.		214a	
	f. One or both sleeve head pads omitted.		215a	
	g. Armhole not tacked completely or insecurely tacked.		216a	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		217a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Sleeve too far front, i.e., front edge of sleeve less than 1 inch from center point of lower pocket flap button.	22		
	3. Sleeve too far back, i.e., front edge of sleeve more than 1 inch back from center point of lower pocket flap button.	23		
	4. Hang of sleeves in opposite directions, i.e., one sleeve too far forward and one sleeve too far back, tolerance of 1-1/2 inches.	24		
	5. Sleeves tight in arm hole, i.e., roll effect not present at front or back of sleeve.	25		
	b. Sleeve lining:			
	1. Twisted, tight or short, causing bulge, twist or puckering on outside of sleeves.	26		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			358
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at holes or at bottom of sleeves.			359
	c. Construction of sleeves:			
	1. Wigan twisted, tight, or pleated, causing		218a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	ridges or puckering on outside of bottom of sleeves, affecting appearance.				
	2. Tacking on bottom turn-up to wigan omitted or insecure.			219a	
	3. Sleeve bottom edge uneven by more than 1/4 inch.				360
	4. Tacking on 1 or both sleeve lining seams to sleeve seams omitted or insecure.				361
	5. Bottom edge of sleeve lining turnup less than inch or more than 1-1/2 inches up from bottom edge of sleeve.				362
	d. Ornamental sleeve pieces:				
	1. Piping irregular, affecting appearance.			220a	
	2. Ornamental piece stitched to sleeve too full or twisted, affecting appearance.			221a	
	3. Length of ornamental piece (including piping): - less than 5-7/8 inches or more than 6-3/8 inches.	139			
	4. Width at top, center, and bottom points (including piping): - less than 2-3/8 inches or more than 2-7/8 inches.	140			
	5. Poorly shaped, affecting appearance.			222a	
	6. Set on crookedly, affecting appearance.			223a	

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	7. Misplaced, i.e., one piece further forward or back from position of other piece, affecting appearance.		224a	
	8. Bottom edge not horizontal with bottom edge of sleeve by more than 1/8 inch or edge extends beyond bottom edge of sleeve.		225a	
	9. Ornamental piece stitched to sleeve with pointed ends toward forearm seam of sleeve.	141		
	e. Position of buttons on ornamental pieces (measurements made from center of button):			
	1. From top and bottom edges (including piped edge):			
	- less than 3/4 inch but not less than 1/2 inch.			363
	- more than 1 inch but not more than 1-1/4 inches.			364
	- less than 1/2 inch or more than 1-1/4 inches.		226a	
	2. Top or bottom button from scalloped edge including piped edge:			
	- less than 5/8 inch but not less than 3/8 inch.			365
	- less than 7/8 inch but not more than 1-1/8 inches.			366
	- less than 3/8 inch or more than 1-1/8 inches.		227a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	3. Center button from pointed edge (including piped edge): - less than 1-1/8 inches but not less than 1 inch or more than 1-3/8 inches but not more than 1-1/2 inches.			367
	- less than 1 inch or more than 1-1/2 inches.		228a	
	4. Center button not in line with pointed edge by: - more than 1/4 inch.		229a	
Body (outside)	a. Fitting of body and yoke linings: Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	27		
	b. Fitting of front interlining:			
	1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	28		
	2. Too full, causing coat front to have a wavy appearance.	29		
Waist seam	a. Seam not pressed open.		230a	
	b. Seam stretched, affecting appearance.		231a	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		232a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
Chest Darts	a. One or more omitted.	142			
	b. Upper fold of 1 or more darts not facing toward front edge of coat.				368
	c. One or more not extending below breast flap.			233a	
Waist dart and side panel	a. Waist dart not pressed open.			234a	
	b. Side panel seam not pressed open.			235a	
Front and bottom edges	a. Front edges stretched, affecting appearance.			236a	
	b. Tape or piping set on tight, causing puckering on front, affecting appearance.			237a	
	c. Front or bottom piping irregular, affecting appearance. Piping shall be no more than 1/8 inch wide nor less than 1/16 inch wide.			238a	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.				369
	e. Bottom corner of left front poorly shaped, affecting appearance.			239a	
	f. Left front rolling outward below bottom button.		30		
	g. Front edge irregular, affecting appearance.			240a	

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	h. Left forepart overlapping right forepart at bottom. To measure the coat lying flat, match the side seams with the bottoms even. The right shall be 3-1/2 ± 1/4 inches from the outer finished edge of left front.			370
	i. Piping tight on front or bottom edge, causing puckering outside of coat, affecting appearance.		241a	
Front facings	Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	31		
Back side panel seam	a. Not pressed open.		242a	
	b. Curved panel seam on back of coat stretched or distorted, affecting appearance.		243a	
Vent opening	a. Left vent edge stretched, causing vents to spread open, affecting appearance.		244a	
	b. Row of stitching across top of vent opening omitted or insecure or not caught through vent lining.		245a	
	c. Left vent 1/4 inch or more shorter than right vent.		246a	
	d. Left vent 1/4 inch or more longer than right vent.			371
	e. Tape on left edge set on tight, causing puckering on vent edge, affecting appearance.		247a	

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	f. Left vent edge crooked, affecting appearance.		248a	
	g. Left vent backpart overlapping right vent backpart at bottom edge: - less than 3-1/4 inches or more than 3-3/4 inches.			372
	h. Width of left vent measured at bottom piped edge: - less than 1-7/8 inches or more than 2-1/8 inches wide.			373
	i. Row of stitching across top of vent opening less than 1-5/8 inches or more than 2 inches long.			374
	j. Piping exposed and visible on left vent edge.			375
	k. Row of stitching across top of vent opening misplaced, not serving intended purpose.		249a	
4.5.3.4 Detailed defects inside of coat (with coat spread on table). Detailed defects of inside of coat (with coat spread on table) shall be classified as follows:				
Front buttonholes	a. Position from front edge (including piped edge): - less than 1/2 inch or more than 3/4 inch. (sizes 36 - 46.)		250a	
	- less than 3/8 inch or more than 5/8 inch. (sizes 30 - 35.)		251a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	b. More than 1/4 inch from equal spacing.			252a	
	c. Bottom buttonhole above or below waist seam.			253a	
	d. Top buttonhole less than 3/4 inch or more than inch from top edge of			254a	
	e. Unevenly spaced from front edge by more than 3/16 inch.			255a	
Front buttons (positioned and secure sewing)	a. Out of vertical alignment by 1/4 inch or more.			256a	
	b. Center of buttons more than 3/8 inch off-center midway between front edge of upper pockets when buttoned.			257a	
	c. Button stitching caught through interlining (canvas front) but not facing: - on 1 button. - on 2 or more buttons.			258a	376
	d. Button stitching not caught through interlining (canvas front) on 1 or more buttons.	143			
Belt loops	a. Loops less than 3/8 inch or more than 5/8 inch wide.				377
	b. Length of belt loop from top to bottom folded edge: - less than 2-3/8 inches or more than 2-5/8 inches.				378

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. One or both belt loops placed less than 1/8 inch or more than 5/8 inch from back end of lower pocket flap(s).			379
	d. Bottom folded end of loop more than 1/4 inch above top edge of lower flap.			380
	e. Bottom end of loop bartacked through double fold exposing bartack.			381
	f. Omitted: - 2 loops. - 1 loops.	144	 259a	
	g. Loops not perpendicular by: - more than 1/4 inch but not more than 1/2 inch. - more than 1/2 inch.		 260a	382
	h. Top folded end of loop bartacked to forepart less than 1/8 inch or more than 1/4 inch from folded end.			383
Labels	a. Any required label missing, incorrect, illegible or size label not securely caught in stitching.		261a	
	b. Woven instruction or identification label not stitched on 4 sides or not positioned as specified to the outside of right facing.			384
Hanger	a. Hanger omitted or ends not securely stitched.		262a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along collar seam.				385
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.				386
Front facing	a. Fullness or pleats on facings between buttons, buttonholes or between front edge and buttons or buttonholes when buttoned.				387
	b. Tacking on back edge to 1 or both interlinings: - omitted. - insecure or incomplete for a distance of more than 5 inches below shoulder seams, or more than 4 inches above bottom edge of lining.			263a	388
	c. Tacking at back lower edge of facing caught through 1 or both pockets.			264a	
	d. Tacking at back edge of 1 or both facings from bottom edge across scarlet piping omitted or insecure.				389
Back yoke lining	a. Excessive fullness or pleats.				390
	b. Twisted, not affecting smoothness on outside surface of back.				391
	c. Hem twisted, or width less than 1/4 inch or more than 1/2 inch wide.				392

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	d. Bottom raw edge of yoke not turned under in stitching forming hem.				393
	e. Pleat in center of yoke lining omitted.			265a	
	f. Folded edge of center pleat facing the right side of coat.				394
	g. Felling at lower edge of yoke lining to side seam outlet omitted or insecurely felled on one or both sides.				395
Front body linings	a. Excessive puckering or pleated.				396
	b. Twisted, not affecting smoothness on outside of coat.				397
	c. One or both chest pleats on shoulder omitted.			266a	
	d. Folded edge of 1 or both chest pleats facing toward the shoulder.				398
	e. Felling on 1 or more front or back lower corners of forepart lining omitted or insecurely felled to facings or forepart side seam allowance.				399
	f. Back stitch at lower arm-hole edge from approximately 1-1/2 inches to front of forearm sleeve lining seam to side seam of body lining omitted.				400

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	g. Hem twisted, or width less than 1/4 inch or more than 1/2 inch wide.			301a
	h. Bottom raw edge of body lining not turned under in stitching forming hem.			302a
Waist seam	Tape on 1 or both waist seams omitted.		267a	
Collar lining and eyelet covers	a. Collar lining tab left end of collar omitted or extending beyond collar end for a distance of less than 3/4 inch.		268a	
	b. Stitching on end, side edges, or across width of collar tab omitted.		269a	
	c. Ends of collar lining not securely tacked.		270a	
	d. 1 or both eyelet covers omitted.		271a	
	e. 1 or both eyelet covers not covering eyelet.		272a	
	f. Width of collar eyelet covers less than 1-5/8 inches or more than 1-7/8 inches.			303a
	g. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		273a	
	h. Felling along lower corner of 1 or both eyelet covers extending for a distance of more than 3/4 inch.			304a

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)		Minor A	Minor B
	i. Hand felling of lining across the full width at the left or right end of collar omitted.			274a	
Right vent lining	a. Top edge not completely covering edges of center back seam outlets.			275a	
	b. Felling at corners of vent openings omitted or insecure.			276a	
	c. Folded edge of lining not extending beyond center seam allowance of right backpart.				305a
	d. Tight, short, or twisted, causing fullness or twist outside of coat.			277a	
Binding on seam outlets	a. Not securely caught on fabric, causing binding to pull away from fabric easily.			278a	
	b. Binding tight, causing edge of seams to curl and not lie flat.				306a

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

4.5.3.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.3.6 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.5.3.2 through 4.5.3.4

Inspection Level III of MIL-STD-105

AQL's	Major	1.5 DHU
	Major and Minor A (combined)	10.0 DHU
	Total Major, Minor A and Minor B (combined)	40.0 DHU

4.5.3.5

Inspection Level S-3 of MIL-STD-105

One class	4.0 DHU

4.5.4 Examination of packaging. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packaged, selected just prior to closing operation. Defects of closure listed below will be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot. The inspection level shall be S-2 and the AQL's shall be 2.5 DHU.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; of improper size, location, sequence or method of application.
Materials	Any component missing. Any component damaged, affecting serviceability.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate strapping. Bulging or distortion of containers.
Content	Number of coats per shipping container is less than required.

5. PACKAGING

5.1 Preservation and packaging. Preservation and packaging shall be level A or hanger pack.

5.1.1 Level A. Each coat shall be laid on a flat surface, with the front of coat facing up. A bending or non-bending paper-board shoulder form conforming to figure 8 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length so that sleeve ends rest over the lower pockets. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

5.1.2 Hanger packs. The coats shall be hung with fronts lapped and unbuttoned on a 17 inch hanger and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, B, commercial or hanger packs as specified (see 6.2).

5.2.1 Level A. Fifteen (15) coats, of one size only, shall be packed with the collar of every other coat in a reverse position, in a fiberboard shipping container conforming to type SF class weather resistant, grade V2S, size 3A of MIL-B-17757. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60 pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification.

5.2.2 Level B.

5.2.2.1 Method 1. Fifteen (15) coats, of one size only, shall be packed with collar of every other coat in a reversed position, in a fiberboard shipping container conforming to type CF class-domestic, variety SW, size 3A of MIL-B-17757. The fiberboard used in fabricating the box shall be grade 275 and for

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

lining grade 200. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled and closed as specified in the appendix to the box specification.

5.2.2.2 Method 2. When specified (see 6.2) three level B shipping containers (45 coats of one size only) shall be overpacked in a fiberboard shipping container conforming to type SF, class-weather resistant, grade V2S, size 4 of MIL-B-17757, reinforced as specified in the appendix to the box specification.

5.2.3 Commercial. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules, National Motor Freight Classification Rules, U.S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

5.2.4 Hanger pack. When specified (see 6.2) 12 coats of one size packaged as specified in 5.1.2 shall be packed in a type I container (hanger pack) using style A or B hanger bar, in accordance with MIL-C-44192. The hanger packs shall be marked and palletized in accordance with MIL-C-44192.

5.3 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

5.4 Palletization. When specified (see 6.2), coats packed as specified in 5.2 shall be palletized on a 4 way entry pallet in accordance with load type 1A of MIL-STD-147. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C, K and L or O or P. Pallet patterns shall be in accordance with the appendix of MIL-STD-147. The pallet shall be 4-way, Type I, Class 1, Style 1, Size A, Wood Group I, II, III, or IV of MIL-P-15011, or, 4-way, Type IV, V or VIII, Class 1, Style A, Size 2, Wood Group I, II, III or IV, Grade A of NN-P-71. Interlocking of loads shall be effected reversing the pattern of each course. If the container is of a size which does not conform to any of the pallet patterns specified in MIL-STD-147, the pallet pattern used shall first be approved by the contracting officer.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.2 Ordering data.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

6.2.1 Acquisition requirements. Acquisition documents shall specify the following:

(a) Title, number and date of this specification.
(b) Size required (see 1.2).
(c) When first article is not required (see 3.2, 4.4 and 6.4).
(d) Selection of applicable levels of packing (see 5.2).
(e) When palletization is required (see 5.3).
(f) When hanger packs are required (see 5.2.4).

6.3 Standard sample. The standard sample and color sample may be obtained from the acquiring activity or as directed by the contracting officer.

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.5 Figures. Figures 1 through 7 show the general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.7 Subject (Key word) listing.

All-season
Blouse
Dress
Male


6.8 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Preparing activity:

Navy-MC


Project No. 8405-N144

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

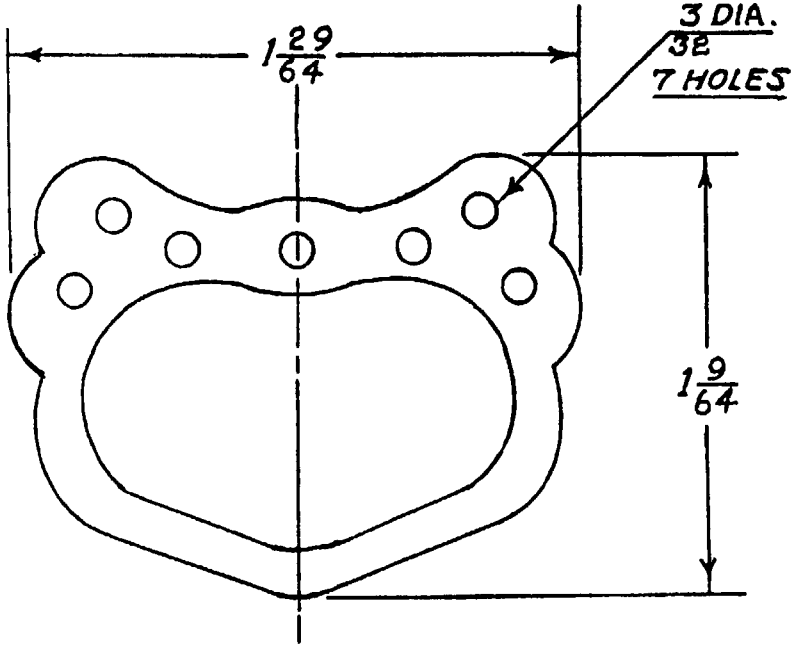


HOOK

FLAT (BEFORE FORMING)

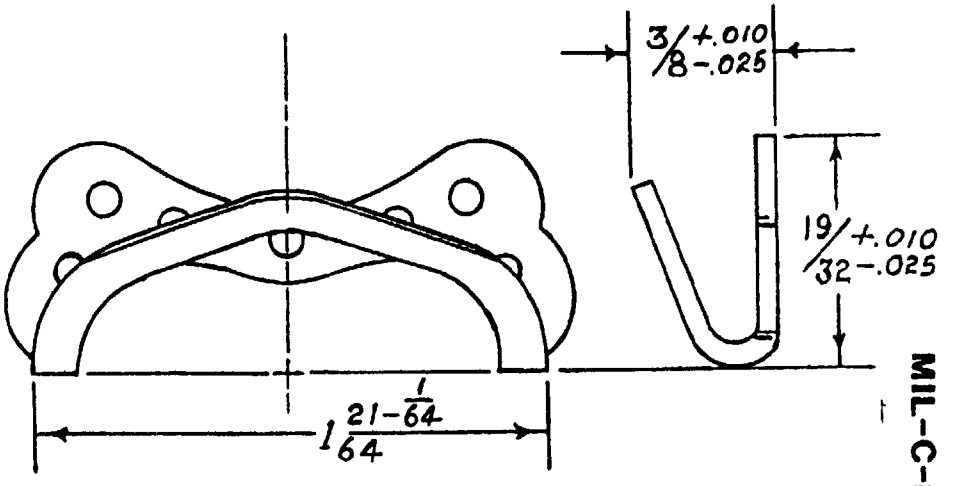

FORMED HOOK

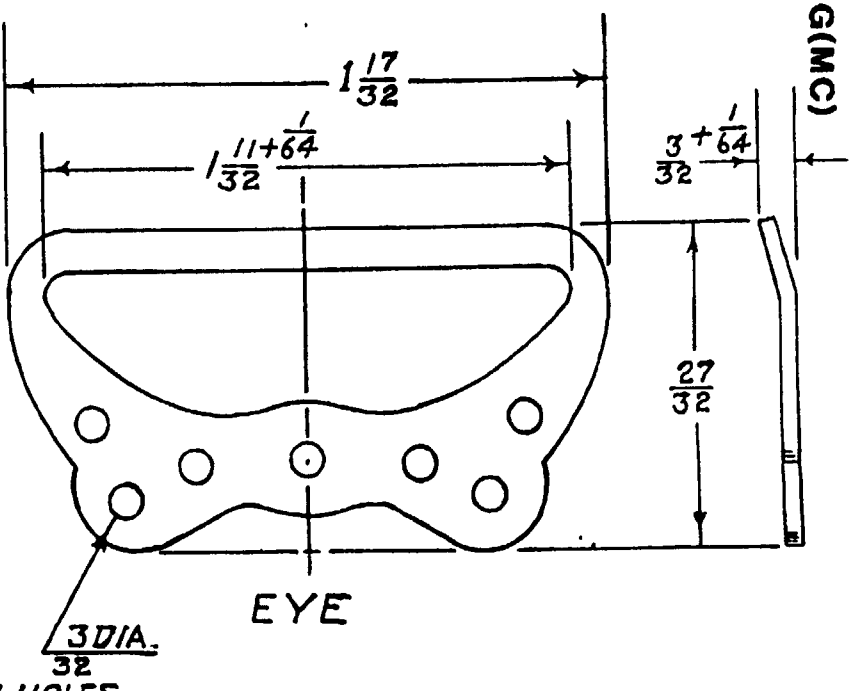

EYE

MAT.-.050 H BRASS 4# HD.

FINISH — CLEAR LACQUER OVER BLACK CHEMICAL FINISH

TOLERANCES: UNLESS OTHERWISE SHOWN
DECIMAL_____ ± —
FRACTIONS____ ± .010
ANGLE_____ ± —

HOOK AND EYE

FIGURE 1. COAT, MAN'S: WOOL GABARDINE; BLUE

MIL-C-19516G(MC)

151

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

TO KEEP YOUR COAT LOOKING SMART INSIST ON IT BEING PROPERLY PRESSED.

PRESSING INSTRUCTIONS

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.
2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH DAMP CLOTH.
3. CREASE ONLY LOWER THREE-FOURTHS OF SLEEVES.

WOVEN INSTRUCTION LABEL

FIGURE 2. COAT, MAN'S: WOOL GABARDINE; BLUE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

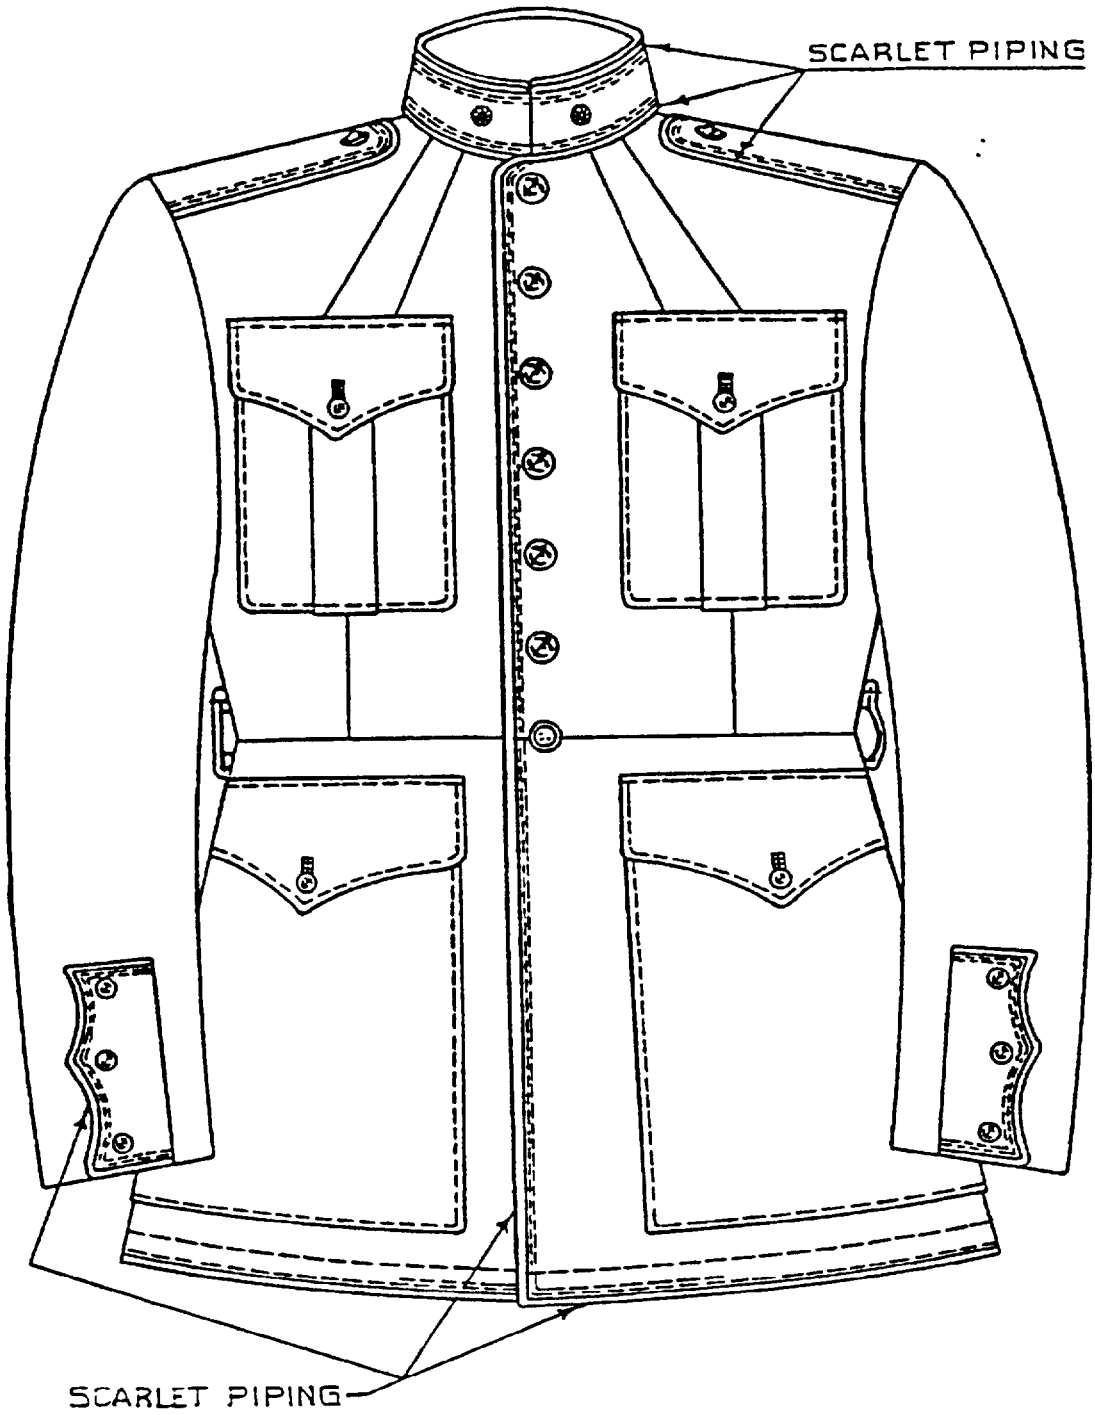


FIGURE 3, COAT, MAN'S, WOOL GABARDINE, BLUE

Source: https://assist.dla.mil -- Downloaded: 20261O-19T06:06Z
Check the source to verify that this is the current version before use.

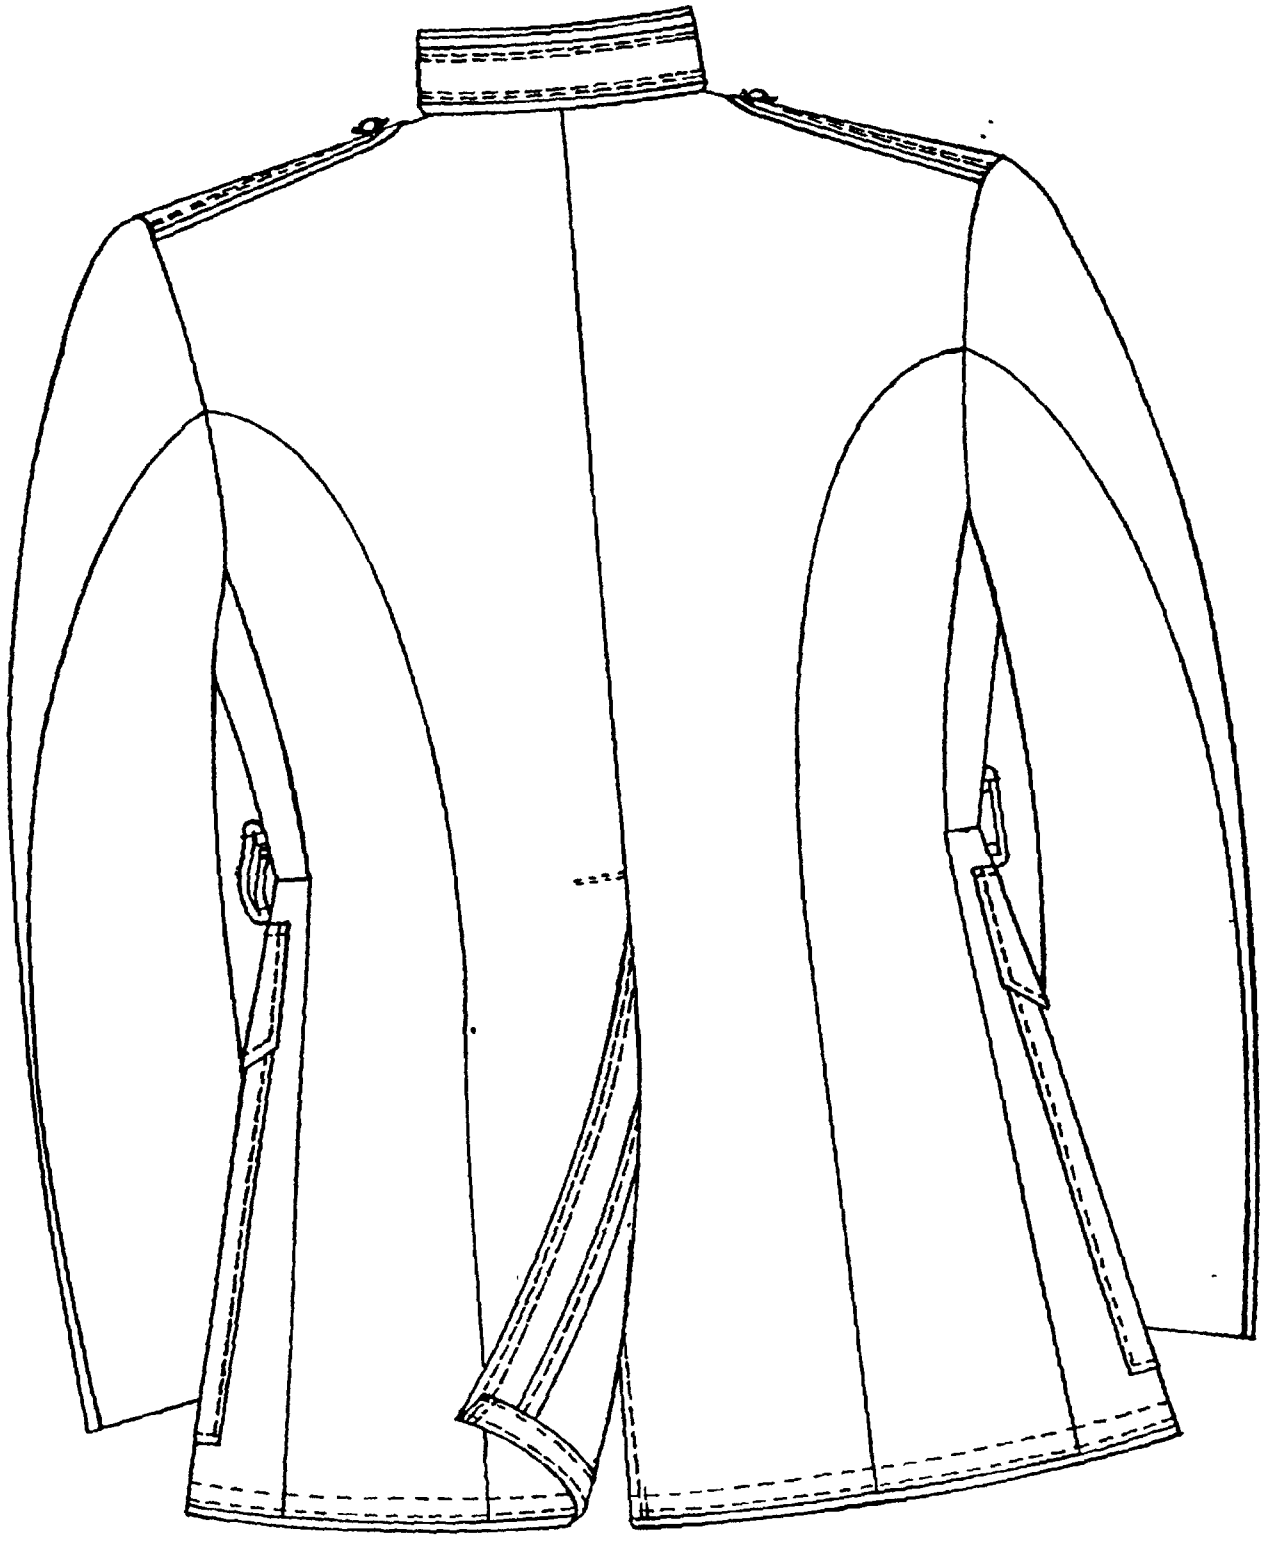


FIGURE 4. COAT, MAN'S: WOOL GABARDINE; BLUE

Source: https://assist.dla.mil -- Downloaded: 20261-19T06:06Z
Check the source to verify that this is the current version before use.

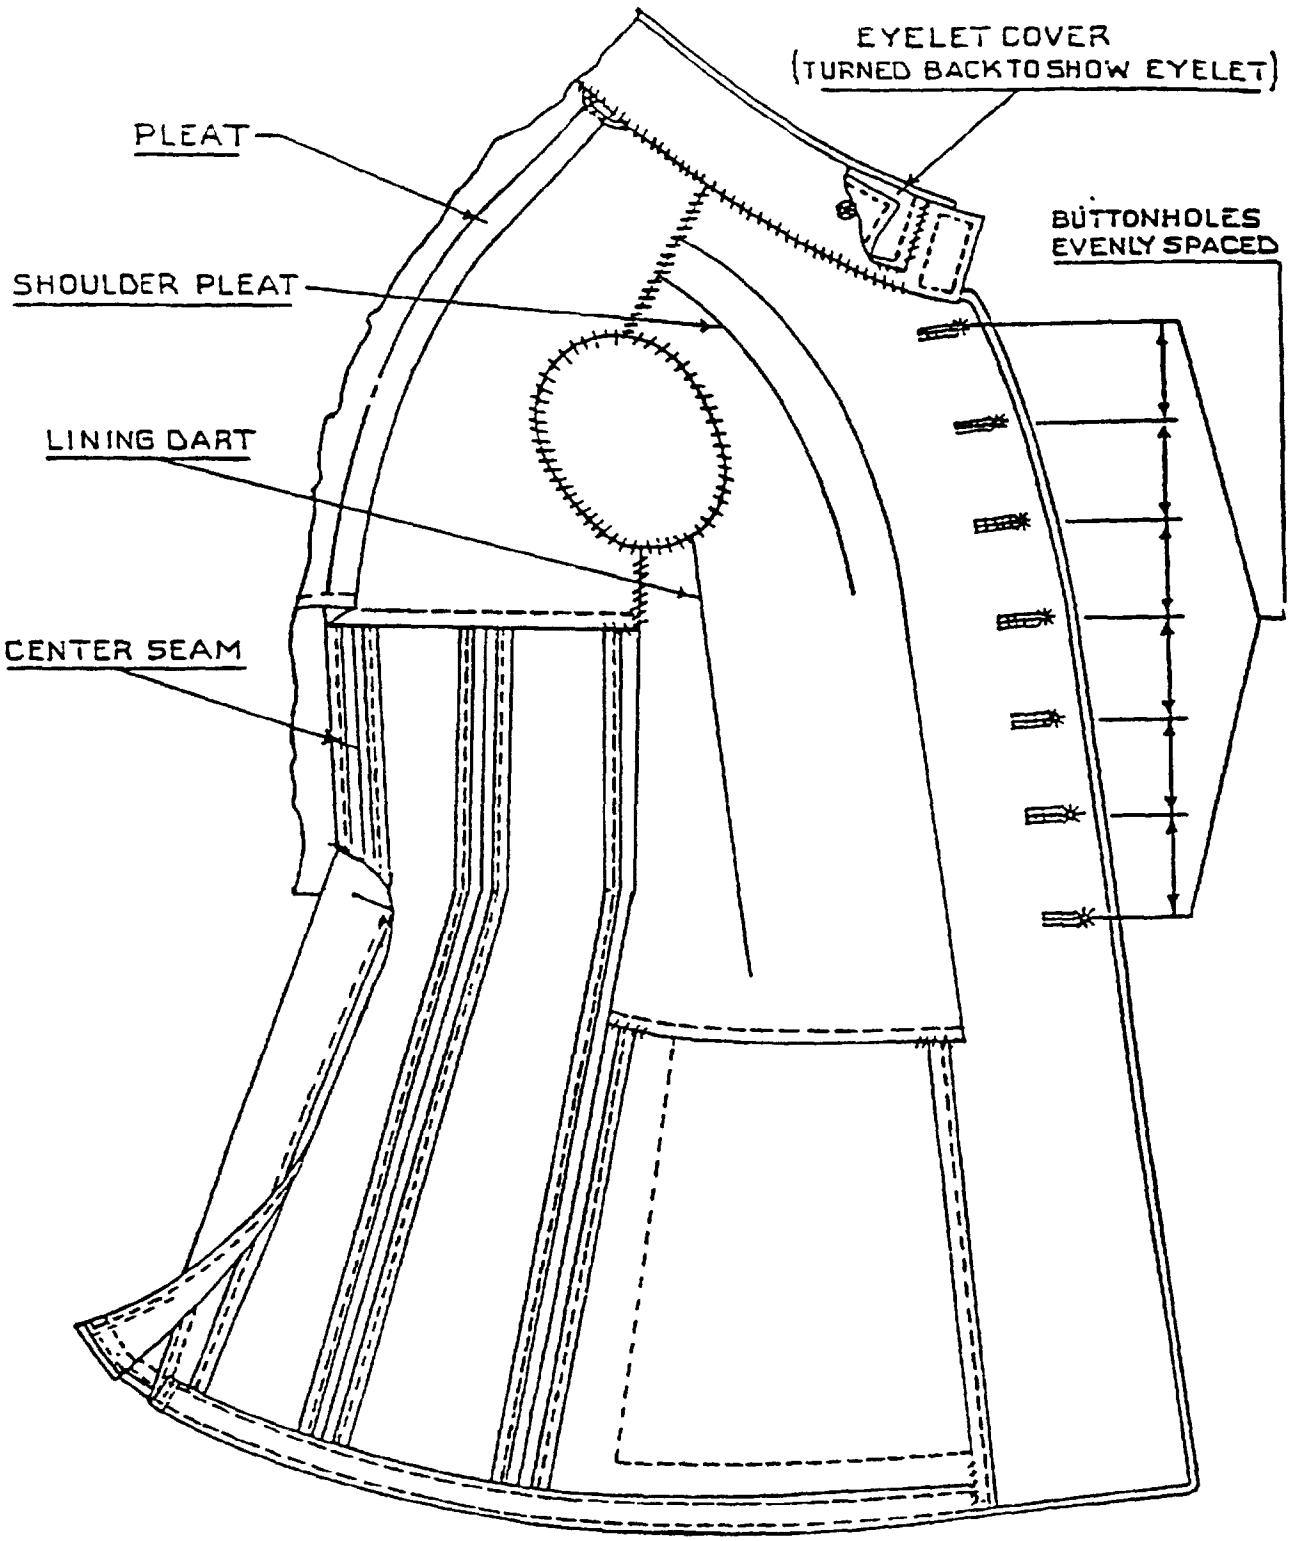


FIGURE 5. COAT, MAN'S, WOOL GABARDINE, BLUE

Source: https://assist.dla.mil -- Downloaded: 202610-19T06:06Z
Check the source to verify that this is the current version before use.


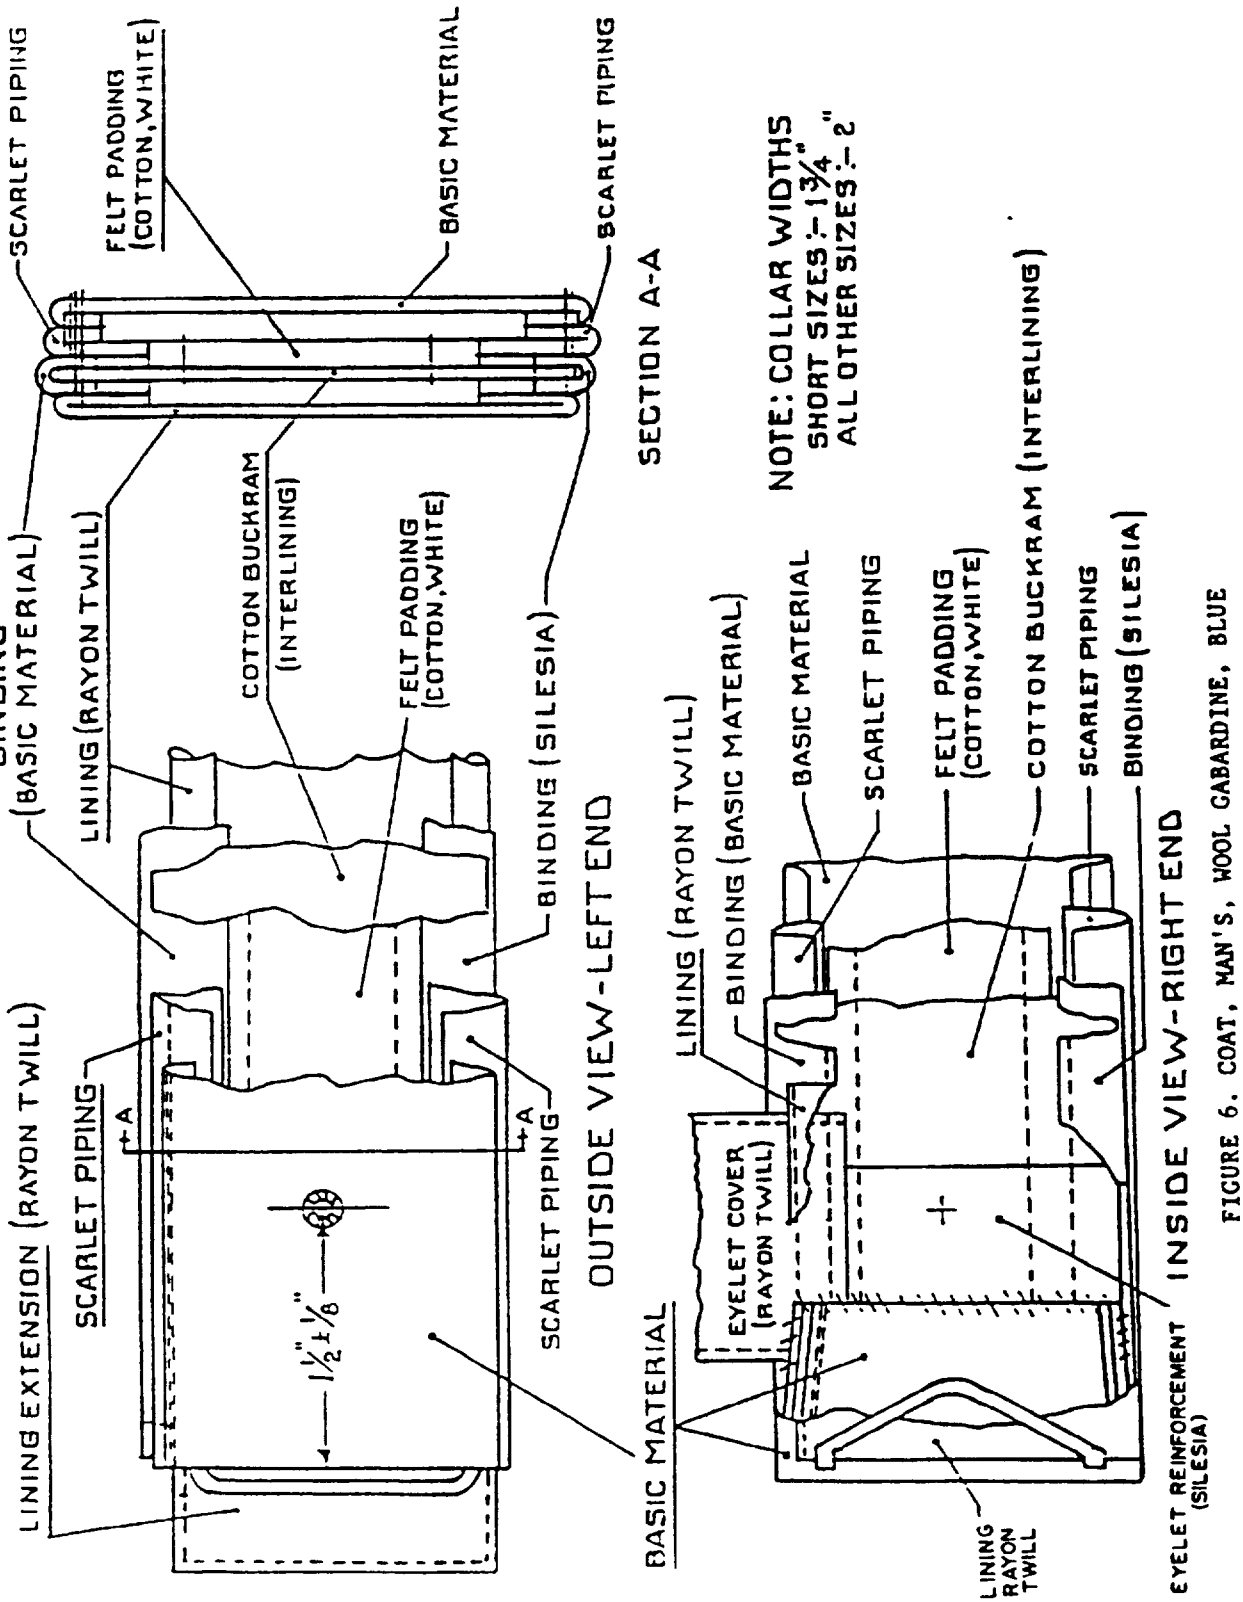


FIGURE 6. COAT, MAN'S, WOOL GABARDINE, BLUE


Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.

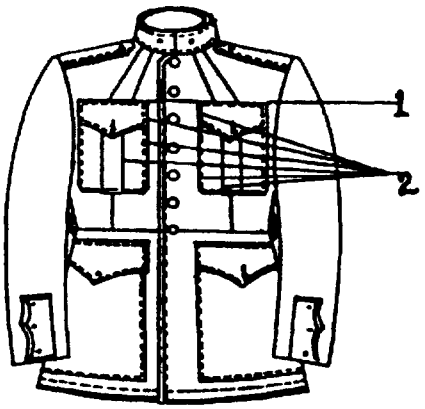

VIEW A

1. Pocket And Pocket Flaps On Left And Right Side Shall Be In Horizontal Alignment With Each Other.


2. Front Edge Of Upper Pockets, Pockets Flaps And Pleats Shall Be In a Vertical Straight Line When Buttoned.

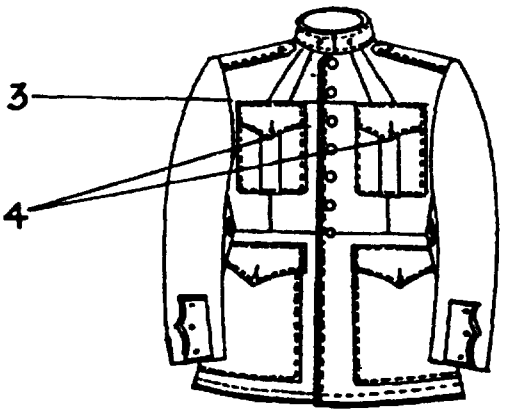

VIEW B

3. Top Edge Of Breast Pocket Flaps Shall Be Midway Between Second And Third Button Holes.


4. The Point Of The Upper Pocket Flap Shall Be At The Center Of The Pleat On The Upper Pockets.

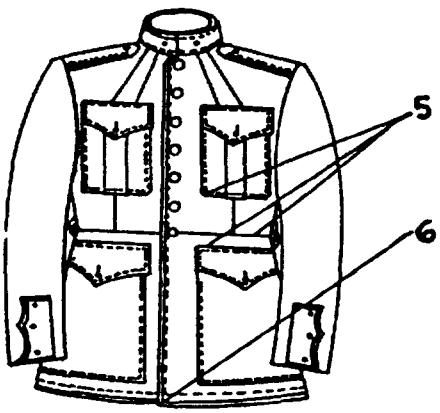

VIEW C

5. Top Edge Of The Bottom Pocket Flap Shall Be Parallel With The Waist Seam And The Front Edge Of The Flap Shall Be In Line With The Front Edge of Upper Pocket.

6. Center Of The Pleat On The Upper Pocket Shall Be Aligned As Accurately As Possible With The Waist Dart In The Front

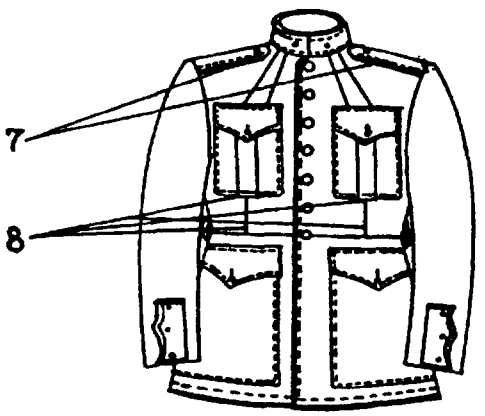

VIEW D

7. Shoulder Straps Shall Be Flat And Smooth Without Any Distortions.

8. Left Front Bottom Edge Shall Be Even With The Right Bottom Edge.

FIGURE 7. COAT, MAN'S: WOOL GABARDINE; BLUE

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.


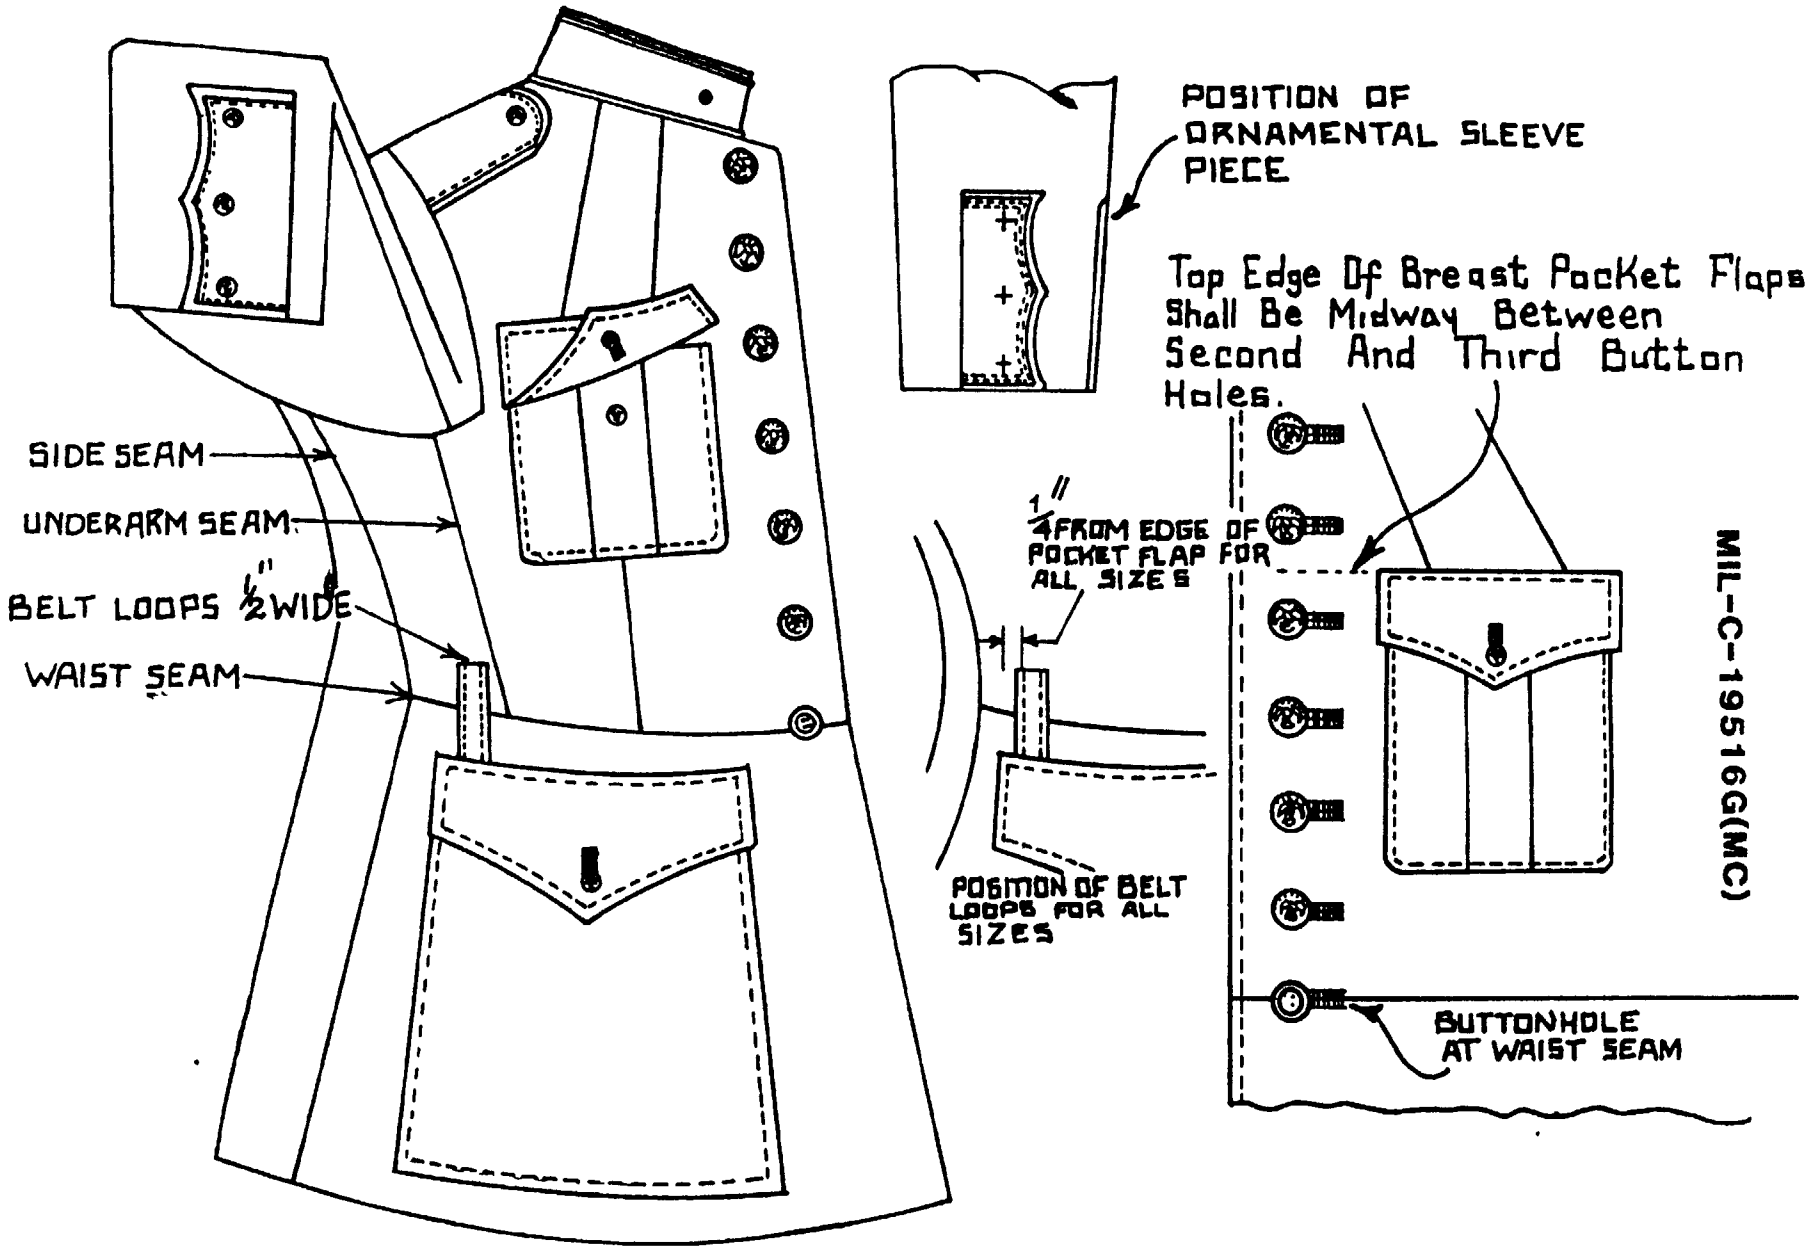


FIGURE 8. COAT, MAN'S: WOOL GABARDINE; BLUE; WITH BELT

Source: https://assist.dla.mil -- Downloaded: 2026-01-19T06:06Z
Check the source to verify that this is the current version before use.

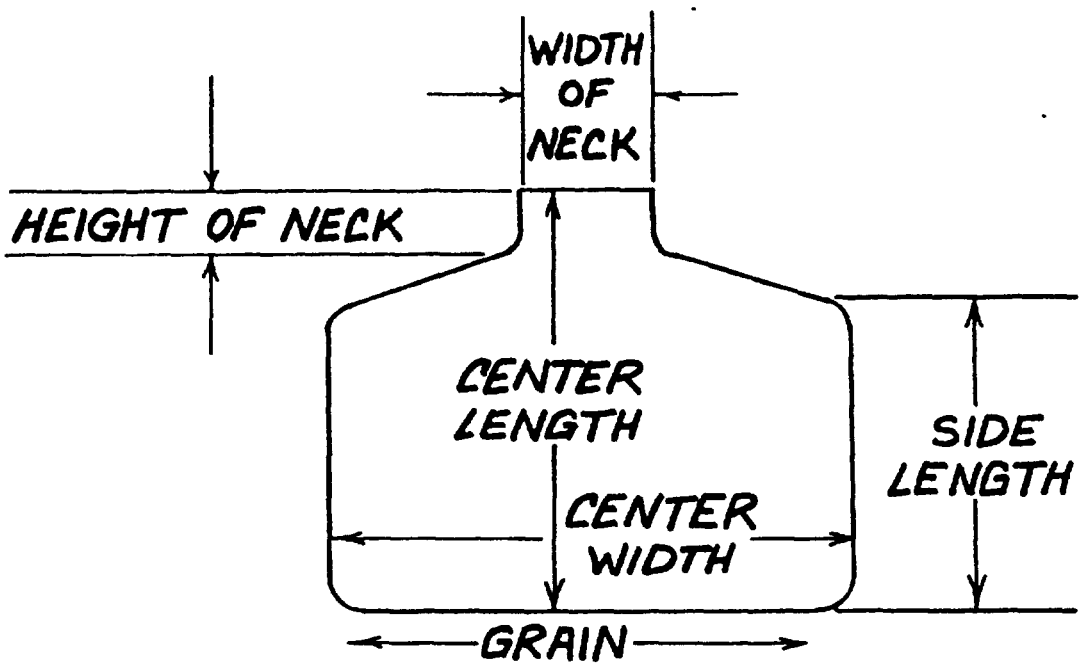

LEGEND

CENTER LENGTH	14-½ INCHES
CENTER WIDTH FOR SIZES:	
30-34	15 INCHES
35-40	18 INCHES
41-48	21 INCHES
SIDE LENGTH	10-½ INCHES
HEIGHT OF NECK	1-½ INCHES
WIDTH OF NECK	3-½ INCHES
PAPERBOARD	0.040 INCH THICK

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

COAT, MAN'S: WOOL GABARDINE; BLUE; WITH BELT

FIG. 9. SHOULDER Board

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T06:06Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-19516G(MC)	6 MARCH 1991

3. DOCUMENT TITLE

COAT, MAN'S: POLYESTER/WOOL, GABARDINE; BLUE

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code)	
Commanding General, Marine Corps Research, Development, and Acquisition Command (PSE-C)	(1) Commercial (202) 696-1186/87/88	(2) AUTOVON 226-1186/87/88
c. ADDRESS (Include Zip Code) Washington, DC 20380-0001	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

DD Form 1426, OCT 89 *Previous editions are obsolete* 198/290

Source: https://assist.dla.mil -- Downloaded: 202640-19T06:06Z
Check the source to verify that this is the current version before use.