MILITARY SPECIFICATION

FUZE, POINT INITIATING BASE DETONATING, XM764

This specification is approved for use by the Armament Research and Development Center (ARDC), US Army Armament, Munitions and Chemical Command (AMCCOM), and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope - This specification establishes the requirements and quality assurance provisions for the manufacture and acceptance of parts and assemblies for the XM764 fuze used in the Cartridge, 120mm, HEAT-MP-T, XM830.

2.0 APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications, standards, and handbooks - Unless otherwise specified, the following specifications, standards, and handbooks of the issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation form a part of this specification to the extent specified herein.

BENEFICIAL COMMENTS (RECOMMENDATIONS, ADDITIONS, DELETIONS) AND ANY PERTINENT DATA WHICH MAY BE OF USE IN IMPROVING THIS DOCUMENT SHOULD BE ADDRESSED TO: COMMANDER, US ARMY ARMAMENT MUNITIONS AND CHEMICAL COMMAND, ATTN: DRSMC-QA, DOVER, NEW JERSEY 07801 BY USING THE SELF-ADDRESED STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL (DD FORM 1426) APPEARING AT THE END OF THIS DOCUMENT OR BY LETTER.

FSC: 1390

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

MILITARY SPECIFICATIONS

MIL-P-116	Preservation, Methods of
MIL-A-13812	Steel Plate, Wrought, Homogeneous, for Ammunition Testing (1/4 to 12 Inches, Incl.)
MIL-A-48078	Ammunition, Standard Quality Assurance Provisions, General Specification for
MIL-E-81111	Explosive Plastic Bonding Molding Powder (PBXN-5)

MILITARY STANDARDS

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	Marking For Shipment and Storage
MIL-STD-202	Test Methods for Electronic and Electrical Component Parts
MIL-STD-331	Fuze and Fuze Components Environmental and Performance Tests for
MIL-STD-454	Standard General Requirements for Electronic Equipment
MIL-STD-810	Environmental Test Methods
MIL-STD-1167	Ammunition Data Card
MIL-STD-1168	Lot Numbering of Ammunition

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

MIL-STD-1234	Pyrotechnics: Sampling, Inspection and Testing
MIL-STD-1235	Single and Multi-Level Continuous Sampling Procedures and Tables for Inspection by Attributes

2.1.2 Other Government documents, drawings and publications - The following Government documents, drawings and publications form a part of this specification to the extent specified herein.

DRAWINGS

U.S. ARMY ARMAMENT, MUNITIONS AND CHEMICAL COMMAND (See 6.8)

12526700	Fuze, PIBD, XM764
12526701	Electrical Schematic
12527234	Packing and Marking for Barrier Bag Assembly for Fuze, PIBD, XM764
12527235	Packing and Marking for Fiberboard Box for Fuze, PIBD, XM764

Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.

2.2 Other publications - The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

American National Standards Institute (ANSI)

ANSI B46.1	Surface Texture, Surface Roughness, Waviness and Lay

(Application for copies shall be addressed to: American National Standards Institute, 1430 Broadway, New York, NY 10018.)

American Society for Testing and Materials (ASTM)

ASTM A751	Chemical Analysis of Steel Products, Methods, Practices
ASTM E8	Tension Testing of Metallic Materials
ASTM E18	Rockwell Hardness and Rockwell Superficial Hardness of Metallic Materials
ASTM E53	Chemical Analysis of Copper
ASTM E62	Photometric Methods for Chemical Analysis of Copper and Copper Alloys

(Application for copies shall be addressed to: American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)

(Technical society and technical association specifications and standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal agencies.)

2.3 Order of precedence - In the event of a conflict between the text of this specification and the referenced specifications cited herein, the text of this specification shall take precedence.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Materials - Materials and finishes shall be in accordance with the applicable drawings and specifications.

3.2 Piece parts and assemblies - The piece parts and assemblies shall comply with all requirements specified on drawings and specifications referenced herein.

3.3 Release mechanism assembly - All release mechanism assemblies shall be tested for arming and non-arming.

3.3.1 Non-Arming - The release mechanism assembly shall not arm when subjected to a minimum centrifuge acceleration of 2,000 gravities when tested per 4.5.2.1.

3.3.2 Arming - The release mechanism assembly shall arm when subjected to a maximum centrifuge acceleration of 4,000 gravities when tested per 4.5.2.2.

3.4 Setback generator assembly - A magnet removed from a setback generator assembly shall have a residual magnetic flux density of 400 Gauss minimum when tested per 4.5.3.

3.5 Housing and mechanism assembly

3.5.1 S2a switch overtravel - The S2 switch fork shall be driven 0.03 inches minimum beyond the initial S2a switch closure position when the rotor moves to the safe position as defined in 4.5.4.1.

3.5.2 Second environment safety - The drag mass pin shall capture the limit pin and shall be seated in the quarter-notch when tested per 4.5.4.2.

3.5.3 Potting voids - Potting voids shall not exceed 0.1 inch in diameter; nor shall voids of any size be attached to the capacitor or diode when examined per 4.5.26.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the current version before use.

3.5.4 Sequence of arming - The arming sequence shall meet the requirements of the applicable drawing when tested as specified in 4.5.4.3.

3.6 Fuze performance - The fuze shall meet the following performance requirements.

3.6.1 Non-function - The fuze shall not produce an explosive output prior to eleven meters from the cannon muzzle when tested as specified in 4.5.5.3.

3.6.2 Function - The fuze shall not produce an explosive output before impact and shall produce an explosive output within two-tenths milliseconds (0.2 msec) after target impact when tested as specified in 4.5.5.4.

3.7 Operating range

3.7.1 Arming range - The fuze shall arm between 11 and 30 meters from the cannon muzzle with 50 percent minimum arming by 20 meters when tested per 4.5.6.

3.7.2 Function range - The fuze shall be capable of initiating an explosive output from the point of fuze arming until four and two-tenths seconds (4.2 sec) after launch.

3.8 Environmental requirements

3.8.1 1.5 meter drop - The fuze shall remain locked in the initial safe position when tested per 4.5.7.

3.8.2 Twelve meter drop - The lead shall not be charred, burnt or detonated when tested per 4.5.8. The rotor shall be locked in a safe position.

3.8.3 Jolt - The fuze shall remain locked in the initial safe position when tested per 4.5.9.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

3.8.4 Jumble - The fuze shall meet the safety requirements of MIL-STD-331, test number 102.1, and the rotor shall remain locked in the safe position when tested per 4.5.10.

3.8.5 Extreme temperature storage - The fuze shall not produce a premature explosive output and shall meet the functional requirements of 3.6.2 when tested per 4.5.11.

3.8.6 Thermal shock - The fuze shall not produce a premature explosive output and shall meet the functional requirements of 3.6.2 when tested per 4.5.12.

3.8.7 Transportation vibration-temperature - The fuze shall remain locked in the initial safe position and shall not produce a premature explosive output and shall meet the functional requirements of 3.6.2 when tested per 4.5.13.

3.9 Embrittlement of springs - Springs shall not break when tested per 4.5.16.

3.10 First article inspection - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples shall be as specified in the contract.

3.11 Workmanship - All parts shall be fabricated and finished in a thoroughly workmanlike manner. Except as otherwise specified, the parts shall be free of cracks, scratches, burrs, dents, gouges, surface defects or any surface discontinuities. The items, subassemblies and piece parts shall be free from dirt, chips, grease, corrosion, and other foreign material. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agent. Cleaned parts and assemblies shall be stored in clean, fiber-free, closed containers. All required markings shall be neat and legible. Exterior surface coatings shall be continuous.

3.11.1 Soldering - Soldered connections shall have a smooth bright appearance with metallic luster and shall not have a gritty, chalky or

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

irregular surface nor exhibit protrusions, pits or voids which expose basis metal or where the bottom of the pit or void is not visible. See MIL-STD-454, Requirement 5.

3.11.2 Molded components - Soundness of the material shall be in accordance with the applicable drawings and specifications. All molded components shall be free of blisters, cracks, checks, inclusions, scratches, voids, and any surface or internal defect which may detrimentally affect serviceability or appearance in the judgment of the appropriate technical agency.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this specification.

4.2 Classification of inspections - The inspection requirements specified herein are classified as follows:

a. First article inspection
b. Quality conformance inspection

4.3 First article inspection

4.3.1 Submission - The contractor shall submit a first article sample, as designated by the contracting officer, for first article tests. The sample shall consist of parts which have been produced by the contractor or furnished by a supplier which have been manufactured using the same production processes, procedures, molds, dies and equipment which will be used in fulfilling the contract. All parts and materials, including packaging and packing, shall be obtained from the same sources of supply as will be used in regular production. A first article sample or portion thereof, as directed by the contracting officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days or whenever a change occurs in manufacturing process, material used, drawing, specification or source of

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

supply as to significantly affect product uniformity as determined by the Government. The first article sample shall consist of the following items in sample quantities indicated.

Part Description	Drawings	Quantity
Fuze, PIBD, XM764	12526700	10 (See Note)
Retainer, Connector	12526703	20
Disc, Closure	12526704	60
Lead Cup Assembly	12526705	20
Shield Assembly	12526706	20
Cup, Lead	12526707	30
Housing and Mechanism Assembly	12526708	20
Pin, Locating	12526709	30
Shield	12526710	30
Connector Assembly	12526711	30
Molded Housing Assembly	12526713	30
Wire, Connector	12526714	40
Pin, Connector	12526715	40
Eyelet	12526716	40
Housing, Connector	12526717	40
Pin, Contact	12526718	40
Tube, Insulating	12526719	40
Mechanism Assembly	12526721	30
Grommet	12526722	210
Receptacle, Retainer	12526723	40
Housing Assembly	12526725	40
90° Contact Assembly	12526726	50
Housing, Rotor	12526727	50
Pin, Housing	12526728	50
S2 Terminal Assembly	12526730	50
Terminal	12526731	60
Wire, Terminal, S2	12526732	60
Housing Assembly, S2	12526733	50
Wire, Ground	12526734	50
Housing, Switch, S2	12526735	60

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the currentversion before use.

Part Description	Drawings	Quantity
Wire, Contact, S2	12526736	60
Plate, Support	12526737	30
Cover, Contact Top	12526739	60
Cover, Contact, Bottom	12526740	60
Contact, 90°	12526741	60
Wire, Contact, 90°	12526742	60
Jack, Connector	12526747	50
Capacitor, Ceramic Monolithic	12526748	50
Resistor	12526749	50
Setback Generator Assembly	12526755	50
Magnet	12526756	60
Disc, Shear	12526757	60
Cover, Bottom	12526758	60
Armature Assembly	12526759	60
Armature	12526763	70
Coil Assembly	12526764	70
Wire, Coil	12526766	AR
Bobbin	12526767	80
Plate Assembly	12526768	70
Plate	12526769	80
Terminal	12526770	150
Insulator	12526771	150
Cam Assembly	12526772	40
Bracket	12526773	60
Cam	12526774	50
Washer	12526775	50
Bushing	12526776	60
Cover Spring	12526777	40
Spring, Drag	12526778	40
Drag Weight Assembly	12526779	40
Screw, Housing	12526780	30
Weight	12526781	50
Pin, Drag, Weight	12526782	50
Release Mechanism Assembly	12526784	40
Cam Follower Assembly	12526785	40

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

Part Description	Drawings	Quantity
Spring, Rotor	12526786	40
Trembler Switch	12526788	50
Follower, Cam	12526789	50
Fork	12526790	50
Spring, Leaf	12526792	90
Leaf, Setback	12526793	110
Screw, Spacer	12526794	90
Release Leaf Assembly	12526795	50
Leaf, Release	12526796	60
Setback Leaf Assembly	12526797	50
Dog, Leaf	12526798	130
Upper Plate Assembly	12526799	50
Spacer	12526800	110
Standoff	12526801	110
Plate, Upper	12526802	60
Lower Plate Assembly	12526803	50
Pin, Leaf	12526804	110
Stud, Spring	12526805	110
Spacer	12526806	110
Plate, Lower	12526807	60
Spring, Anti-Reset	12526808	60
Rotor Assembly	12526809	40
Detonator and Contact Assembly	12526810	50
Rotor and Pin Assembly	12526817	50
Pin, Limit	12526818	60
Pin, Trap	12526819	60
Rotor	12526820	60
Pin, Rotor	12526821	60
Bracket Assembly	12526823	50
Diode, Rectifier	12526824	50
Cover, P.W. Board	12526828	50
Printed Wiring Board Assembly	12526832	40
Cover, Shield	12526837	20
Board, Printed Wiring	12526839	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

Note: The list above makes provision for the submittal of ten pieces of each component and assembly for first article inspection, including sufficient pieces to complete ten of each higher assembly in which the component or assembly is used. The additional quantity of one hundred seventy five (175) fuzes for ballistic and environmental testing is not included in the submittal list.

4.3.2 Inspections to be performed - Ten samples of each part or assembly of the first article sample shall be inspected for conformance with the requirements of the applicable drawing and paragraphs of Section 4.4.2 herein. Additional or excepted inspection shall be in accordance with Table I. See MIL-A-48078.

4.3.3 Rejection - See MIL-A-48078.

4.3.4 Acceptance criteria for ballistic and environmental testing -The following criteria shall be used for first article ballistic and environmental testing.

a. Any fuze which fails to remain in the initial safe position as a result of environmental testing shall reject the first article sample (see 4.5.17). This does not apply to 12 meter drop.

b. Any fuze which shows evidence of a charred, burnt or detonated lead charge or a rotor fails to remain in a safe position as a result of impact during the twelve meter drop test, shall reject the first article sample.

c. Any fuze which produces a premature (see 6.11.1) explosive output; or, functions upon target impact when testing for non-functioning shall reject the first article sample.

d. Four or more fuzes which either fail to function or do not meet the applicable function time requirement shall reject the first article sample. This applies to all ballistic testing, except the arming distance samples.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
	Fuze, Point Initiating Base Detonating, XM764				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Capacitor, Ceramic Monolithic (12526748)	1/			
	Examination for Defects, Except Setback Load Test	10		3.2	4.4.2.10
	Diode, Rectifier (12526824)	1/			
	Examination for Defects, Except Setback Load Test	10		3.2	4.4.2.11
	Molded Housing Assembly (12526713)				
	Examination for Defects, Except Section Only Two Assemblies for Potting Defects	10		3.2	4.4.2.23
	Detonator and Contact Assembly (12526810)	1/			
	Examination for Defects, Except High Gravities Test	10		3.2	4.4.2.24
	Lead Cup Assembly (12526705)	1/			
	Examination for Defects, Except for Dent Test	10		3.2	4.4.2.44
	Housing and Mechanism Assembly (12526708)				
	Trap Pin not Captured by Drag Weight	15		3.5.2	4.4.3.4, 4.5.4.2

NOTES:
1/ Only accepted lots of these components shall be used for first article inspection.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER / NEXT HIGHER ASSEMBLY
	Fuze, Point Initiating Base Detonating, XM764				
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Fuze, PIBD, XM764 (12526700)				
	Examination for Defects	10		3.2	4.4.2.46
	Total	10			
	Ballistic and Environmental Tests				
	Fuze Function	30		3.6.1	4.5.5.4
	Fuze Non-Function	30		3.6.2	4.5.5.3
	Arming Range	25		3.7.1	4.5.6, 4.5.5.2
	1.5 Meter Drop	15		3.8.1	4.5.7
	Twelve Meter Drop	15		3.8.2	4.5.8
	Jolt	9		3.8.3	4.5.9
	Jumble	9		3.8.4	4.5.10
	Extreme Temperature Storage	12		3.8.5	4.5.11, 4.5.5.2
	Thermal Shock	15		3.8.6	4.5.12, 4.5.5.2
	Transportation Vibration - Temperature	15		3.8.7	4.5.13, 4.5.5.2
	Total	175			

NOTES:

HC-685

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

e. Any fuze which causes an early burst (see 6.11.2) shall reject the first article sample.

f. If the requirements of 3.7.1 are not satisfied by the results of the arming range test, the first article shall be referred to the Contracting Officer for disposition.

4.3.5 Process controls and plans - The contractor is advised to prepare written general manufacturing and inspection plans for review by the Government technical agency at the time of the first article submission. When prepared, plans should be updated quarterly; or, as found necessary by the contractor (see 6.3).

4.4 Quality conformance inspection

4.4.1 Lot formation - Lots shall comply with lot formation provisions of MIL-A-48078. In addition, inspection lots shall contain:

a. Electrical components bearing the same lot interfix number from one manufacturer.

b. Detonator and contact assemblies from one lot number from one manufacturer.

c. Springs from the same heat treat batch number from one lot number from one manufacturer.

d. PBXN-5 from one lot number from one manufacturer.

4.4.1.1 Fuze lot - A fuze lot which is assigned a lot number by MIL-STD-1168 shall contain a minimum of one thousand fuzes. A fuze lot thus defined shall be used as the basis for the selection of ballistic test samples.

4.4.2 Examination - Unless otherwise specified, examination for critical, major and minor defects shall be performed in accordance with the classification of defects given in Table II using the sampling plans of MIL-

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

STD-105, Inspection Level II. All nonconforming material shall be rejected (see MIL-A-48078). Continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the Contracting Officer.

a. The roughness comparison specimens prescribed by ANSI B46.1 shall be used as a basis for determining surface roughness (see 6.6).

b. A summary report listing the parts or assemblies inspected for Critical Defects, the number of Critical Defects found and corrective action taken will be prepared monthly by the contractor. A copy will be made available for the Government Quality Assurance Representative servicing the contractor's plant.

c. Where "Visual" is specified as the inspection method for dimensional inspection, the characteristic shall be either scaled, or compared with a specimen of known acceptable quality that has been established as an inspection standard, for conformance to the requirements of the drawing.

d. Where "Visual" is specified as the inspection method for assemblies, the assembly shall be visually examined for completeness, security, function and conformance to specified requirements. When possible, the functioning of the assembly shall be inspected by manual operation.

e. This specification stipulates only those inspection characteristics (examinations and tests) which will be used to determine acceptability. However, if a Government representative, during the performance of verification inspection, finds a defect which is not listed herein, the item inspected containing the defect will be rejected and returned to the contractor.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.1	Bobbin				12526767
					NEXT HIGHER ASSEMBLY 12526764
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Magnet hole diameter		0.65%	3.2	Gage
202	Flange diameter		0.65%	3.2	Gage
203	True position of flange to magnet hole (two places)		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Coil Assembly				12526764
					NEXT HIGHER ASSEMBLY 12526759
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Fails lead peel test		0.65%	3.2	Gage
202	Wire stripping and tinning		0.65%	3.2	Visual
203	Inside diameter, minimum		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.3	Armature				12526763
					NEXT HIGHER ASSEMBLY 12526759
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Depth of bobbin cavity		0.40%		Gage
102	Material incorrect	1/		3.1	4.5.15
Minor					
201	Cover plate cavity diameter		0.65%	3.2	Gage
202	Length from front face to shoulder of cover plate cavity		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ Sample one part per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Plate				12526769
					NEXT HIGHER ASSEMBLY 12526768
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Diameter of magnet clearance hole		0.40%	3.2	Gage
102	True position of outside diameter to magnet clearance hole		0.40%	3.2	Gage
103	Outside diameter incorrect		0.40%	3.2	Gage
104	Material incorrect	1/		3.1	4.5.15
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot.

HC-685

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526759
4.4.2.5	Armature Assembly				NEXT HIGHER ASSEMBLY 12526755
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Coil winding direction incorrect		0.40%	3.2	Gage
102	Depth to bottom of bobbin cavity from rear of plate assembly		0.40%	3.2	Gage
Minor					
201	Evidence of silicone rubber in magnet cavity		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.6	Cover, Bottom				12526758
					NEXT HIGHER ASSEMBLY 12526755
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Magnet clearance cavity diameter		0.40%	3.2	Gage
102	True position of magnet clearance diameter to outside diameter		0.40%	3.2	Gage
103	Outside diameter		0.40%	3.2	Gage
Minor					
201	Thickness of outside diameter		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526757
4.4.2.7	Disc, Shear				NEXT HIGHER ASSEMBLY 12526755
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Hole diameter (5 places)		0.40%	3.2	Gage
102	Material thickness		0.40%	3.2	Gage
103	Outside diameter		0.40%	3.2	Gage
104	True position of five holes to outside diameter		0.40%	3.2	Gage
105	Material incorrect	1/		3.1	4.5.15
106	Temper incorrect	1/		3.1	4.5.15
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one six inch long by one inch, minimum, wide strip per lot.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.8	Magnet				12526756
					NEXT HIGHER ASSEMBLY 12526755
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Perpendicularity of top to diameter		0.40%	3.2	Gage
103	Surface finish on ends		0.40%	3.2	Visual
104	Material incorrect	1/		3.1	4.5.15
Minor					
201	Presence of a residual magnetic field		0.65%	3.2	4.5.3.1
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot.

HC-685

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526755 NEXT HIGHER ASSEMBLY 12526832
4.4.2.9	Setback Generator Assembly				
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Residual flux density of magnet, min 1/		0.40%	3.4	4.5.3
102	Polarity of magnet		0.40%	3.2	Gage
103	Coil resistance		0.40%	3.2	Gage
Minor					
201	Silicone rubber sealant above flush with shoulder on bottom cover		0.65%	3.11	Visual
202	Soldering workmanship		0.65%	3.11.1	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ See 4.4.3.2 for sampling plan if inspection takes place on crimped setback generator assemblies.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526748
4.4.2.10	Capacitor, Ceramic Monolithic				NEXT HIGHER ASSEMBLY 12526832
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Voltage burn-in at 200 volts DC (1/)		100%	3.2	Gage
102	Insulation resistance after burn-in		100%	3.2	Gage
103	Lead solderability	2/		3.2	4.5.18.2
104	Capacitance after burn-in		100%	3.2	Gage
105	Thermal shock, followed by high-g load	3/,4/		3.2	4.5.21
106	Extreme temperature storage, followed by high-g load	3/,4/		3.2	4.5.21
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/: At the option of the contractor, a certified test report (CTR) may be furnished by the supplier of this component in lieu of contractor testing (see 6.9).
2/: See MIL-STD-202 for sample size.
3/: See 4.4.3.9 for sampling plan and acceptance criteria.
4/: Each sample shall meet capacitance and insulation resistance requirements following conditioning.

HC-685

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.11	Diode, Rectifier				12526824
					NEXT HIGHER ASSEMBLY 12526832
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Forward voltage following burn-in, max. (1/)		100%	3.2	Gage
102	Reverse current following burn-in, max. (1/)		100%	3.2	Gage
103	Lead solderability	2/		3.2	4.5.18.2
104	Thermal shock, followed by high-g load	3/,4/		3.2	4.5.21
105	Extreme temperature storage, followed by high-g load	3/,4/		3.2	4.5.21
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

1/: In lieu of contractor testing and at the option of the contractor, a certified test report may be furnished by the supplier of this component (see 6.9).

NOTES:
2/: See MIL-STD-202 for sample size.
3/: See 4.4.3.10 for sampling plan and acceptance criteria.
4/: Each sample shall meet forward voltage and reverse current requirements following conditioning.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.12	Trembler Switch				12526788
					NEXT HIGHER ASSEMBLY 12526832
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Insulation Resistance		100%	3.2	4.5.18.1
102	Internal contact resistance at functional acceleration, max.		100%	3.2	4.5.19
103	Switch closes at non-functional acceleration, min.		100%	3.2	4.5.19
104	One or both terminal welds fail to withstand application of minimum tensile load		0.40%	3.2	4.5.28
105	One or more housing seals fail gross leak test (1/)	10		3.2	4.5.28
106	Lead solderability	2/		3.2	4.5.18.2
107	Extreme temperature storage (3/)	12		3.2	4.5.28
108	Jolt (3/)	12		3.2	4.5.28
109	Transportation vibration (3/)	12		3.2	4.5.28

NOTES:
1/ Samples tested shall not be returned to the lot.
2/ See MIL-STD-202 for sample size.
3/ Each sample shall meet internal contact and insulation resistance requirements following conditioning. One or more samples failing either requirement shall reject the lot.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.12	Trembler Switch				12526788
					NEXT HIGHER ASSEMBLY 12526832
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.13	Wire, Terminal, S2				12526732
					NEXT HIGHER ASSEMBLY 12526730
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Embrittlement	1/		3.9	4.5.16
102	Ultimate tensile strength, min	2/		3.1	4.5.15
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ See 4.4.3.8 for sampling plan.
2/ Sample one part per lot.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526832
4.4.2.14	Printed Wiring Board Assembly				NEXT HIGHER ASSEMBLY 12526713
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Setback generator assembly leak rate excessive		100%	3.2	4.5.20
102	Soldering of components improper		100%	3.11.1	Visual
Minor					
201	Perpendicularity of trembler switch to printed wiring board		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.15	Contact, 90°				12526741
					NEXT HIGHER ASSEMBLY 12526726
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Profile of in-line contact portion at side of contact, including the in-line mounting hole and 90° contact wire hole datum point		0.40%	3.2	Gage
102	Profile of 90° out-of-line contact portion at side of contact, including the in-line contact mounting hole and 90° contact wire hole datum point.		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526739
4.4.2.16	Cover, Contact, Top				NEXT HIGHER ASSEMBLY 12526726
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length of mounting holes		0.40%	3.2	Gage
102	True position of large outside radius to 90^0 contact surface and locating pins for 90^0 contact		0.40%	3.2	Gage
103	True position of small outside radius to 90^0 contact surface and locating pins for 90^0 contact		0.40%	3.2	Gage
104	Large outside radius		0.40%	3.2	Gage
105	Small outside radius		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526740
4.4.2.17	Cover, Contact, Bottom				NEXT HIGHER ASSEMBLY 12526726
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length of mounting pin		0.40%	3.2	Gage
102	True position of large outside radius to 90^0 contact surface and locating pins for 90^0 contact		0.40%	3.2	Gage
103	True position of small outside radius to 90^0 contact surface and locating pins for 90^0 contact		0.40%	3.2	Gage
104	Large outside radius		0.40%	3.2	Gage
105	Small outside radius		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.18	Housing, Rotor				12526727
					NEXT HIGHER ASSEMBLY 12526725
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	True position of housing screw holes to the rotor cavity diameter, including the mechanism mounting surface and cap screw hole		0.40%	3.2	Gage
102	Rotor cavity diameter		0.40%	3.2	Gage
103	True position of rotor cavity to shield interface diameter, including the shield surface shoulder and mechanism mounting surface		0.40%	3.2	Gage
104	Drag sensor cavity diameter		0.40%	3.2	Gage
105	True position of drag sensor cavity to second step diameter and mechanism mounting surface		0.40%	3.2	Gage
106	Surface finish of rotor cavity wall		0.40%	3.2	Visual
107	Distance from top to shield interface shoulder		0.40%	3.2	Gage

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.18	Housing, Rotor				12526727
					NEXT HIGHER ASSEMBLY 12526725
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
108	Depth of rotor cavity		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.19	Housing Assembly				12526725
					NEXT HIGHER ASSEMBLY 12526713
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Distance from top of housing to in-line contact		0.40%	3.2	Gage
102	Depth of 90^{0} contact from wall of rotor cavity		0.40%	3.2	Gage
103	Height of 90^{0} contact above contact covers		0.40%	3.2	Gage
Minor					
201	Insulator portion of 90^{0} bottom contact cover above flush with rotor cavity		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.20	Weight, Drag				12526781
					NEXT HIGHER ASSEMBLY 12526779
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Large diameter		0.40%	3.2	Gage
102	Surface finish		0.40%	3.2	Visual
Minor					
201	True position of pin hole to large diameter		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526779
4.4.2.21	Drag Weight Assembly				NEXT HIGHER ASSEMBLY 12526713
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Pin fails to withstand application of minimum load		100%	3.2	Gage
002	Height of pin from bottom, min	1/	100%	3.2	Gage
Major	None Defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Perform height inspection after load test.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526778
4.4.2.22	Spring, Drag				NEXT HIGHER ASSEMBLY 12526713
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Embrittlement	1/		3.9	4.5.16
Major	None Defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ See 4.4.3.8 for sampling plan.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.23	Molded Housing Assembly				12526713
					NEXT HIGHER ASSEMBLY 12526708
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Drag weight assembly moves upon application of minimum load		100%	3.2	Gage
Major					
101	Electrical requirements		100%	3.2	Gage
102	Drag weight assembly fails to move upon application of maximum load		100%	3.2	Gage
103	Soldering of leads		100%	3.11.1	Visual
104	Potting void(s) excessive or attached to either the capacitor or the diode	1/		3.2	4.5.26
105	Compressive strength of potting, min.	2/		3.2	4.5.27
Minor					
201	Spring cover moves upon application of minimum tensile load		0.65%	3.2	Gage

NOTES:
1/ See 4.4.3.5 for sampling plan.
2/ Pour two coupons per batch of potting.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.23	Molded Housing Assembly				12526713
					NEXT HIGHER ASSEMBLY 12526708
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
202	Uniformity of color of potting material (3/)		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

3/ Color shall be light to medium gray, without white colored streaking.

HC-685

Source: https://assist.dla.mil - Downloaded: 2026-02-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526810 NEXT HIGHER ASSEMBLY 12526809
4.4.2.24	Detonator and Contact Assembly				
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Detonator not shorted in free state		100%	3.2	Gage
Major					
101	Bridge resistance with contact depressed		0.40%	3.2	Gage
102	Contact function	40		3.2	4.5.22.a
103	Steel dent min.-temperature conditioned 2/ 1/	40		3.2	4.5.22.b
104	Time to function, max.-temperature conditioned 2/	3/		3.2	4.5.22.b
105	Steel dent min.-high g conditioned 2/	40		3.2	4.5.22.c
106	Time to function max.-high g conditioned 2/	3/		3.2	4.5.22.c
Minor					
201	Speed nut pull off force, min.		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Use forty samples from contact function.
2/ Any combination of three or more samples to fail to comply with the dent or function time requirements shall reject the lot.
3/ Obtained from the explosive output test.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526818
4.4.2.25	Pin, Limit				NEXT HIGHER ASSEMBLY 12526817
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Width of quarter-section side (two places)		0.40%	3.2	Gage
Minor					
201	Length of cutout		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.26	Pin, Trap				12526819
					NEXT HIGHER ASSEMBLY 12526817
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Width of half section side		0.40%	3.2	Gage
Minor					
201	Length of half section cutout		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.27	Pin, Rotor				12526821
					NEXT HIGHER ASSEMBLY 12526817
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Small diameter		0.40%	3.2	Gage
102	Radius, min		0.40%	3.2	Gage
103	Material incorrect	1/		3.1	4.5.15
104	Hardness	1/		3.1	4.5.15
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T04:27Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.28	Rotor				12526820
					NEXT HIGHER ASSEMBLY 12526817
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Length including anti-assembly tab		100%	3.2	Gage
002	Diameter of anti-assembly tab		100%	3.2	Gage
Major					
101	Outside diameter		0.40%	3.2	Gage
102	Surface finish of outside diameter		0.40%	3.2	Visual
103	True position of rotor pin hole to outside diameter and detonator output hole		0.40%	3.2	Gage
104	True position of trap pin hole to outside diameter and detonator output hole		0.40%	3.2	Gage
105	True position of limit pin hole to outside diameter and detonator output hole		0.40%	3.2	Gage
106	Thickness at end of detonator cavity		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.28	Rotor				12526820
					NEXT HIGHER ASSEMBLY 12526817
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
107	True position of detonator output hole to outside diameter and front positioning face		0.40%	3.2	Gage
108	Length from front positioning face to rear positioning face		0.40%	3.2	Gage
109	Surface finish of rotor hub rear face		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assistdia.mil -- Downloaded: 2020-10-20T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.29	Rotor and Pin Assembly				12526817
					NEXT HIGHER ASSEMBLY 12526809
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Limit pin fails to withstand application of minimum load		100%	3.2	Gage
002	Trap pin fails to withstand application of minimum load		100%	3.2	Gage
003	Rotor pin fails to withstand application of minimum load		100%	3.2	Gage
004	Angularity of limit pin to detonator output hole		100%	3.2	Gage
005	Height of limit pin, minimum	1/	100%	3.2	Gage
006	Height of rotor pin, minimum	1/	100%	3.2	Gage
007	Height of trap pin, min	1/	100%	3.2	Gage
Major	None Defined				
Minor					
201	Angularity of trap pin		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Perform inspection following load tests

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526774
4.4.2.30	Cam				NEXT HIGHER ASSEMBLY 12526772
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Width of cam from base circle to chord point (2 places)		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.31	Pin, Leaf				12526804
					NEXT HIGHER ASSEMBLY 12526803
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Material incorrect	1/		3.1	4.5.15
Minor					
201	Small diameter, minimum		0.65%	3.2	Gage
202	Surface finish on large outside diameter		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.32	Spring, Leaf				12526792
					NEXT HIGHER ASSEMBLY 12526784
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Embrittlement	1/		3.9	4.5.16
Major	None Defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ See 4.4.3.8 for sampling plan.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.33	Follower, Cam				12526789
					NEXT HIGHER ASSEMBLY 12526785
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Width of cam bearing surface		0.40%	3.2	Gage
102	True position of fork mounting hole to the pivot hole and cam bearing surface		0.40%	3.2	Gage
103	Material incorrect	1/		3.1	4.5.15
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ Sample one part per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.34	Cam Follower Assembly				12526785
					NEXT HIGHER ASSEMBLY 12526721
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Fork fails to withstand application of minimum load		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526786
4.4.2.35	Spring, Rotor				NEXT HIGHER ASSEMBLY 12526721
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Embrittlement	1/		3.9	4.5.16
Major					
101	Torque of spring at minimum operating position		0.40%	3.2	Gage
102	Torque of spring 7° from maximum operating position		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ See 4.4.3.8 for sampling plan.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.36	Release Mechanism Assembly				12526784
					NEXT HIGHER ASSEMBLY 12526721
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Assembly arms when tested at 2,000 gravities, min		100%	3.3.1	4.5.2.1
Major					
101	Assembly fails to arm when tested at 4,000 gravities, max		100%	3.3.2	4.5.2.2
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.37	Housing and Mechanism Assembly				12526708
					NEXT HIGHER ASSEMBLY 12526700
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	First electrical closure of detonator contact with the in-line contact prior to ten milliseconds from rotor release		100%	3.5.4	4.5.4.3
Major					
101	S2-a overtravel, minimum	1/		3.5.1	4.5.4.1
102	Last electrical closure of detonator contact with the in-line contact greater than eighteen milliseconds from rotor release		100%	3.2	4.5.4.3
103	Duration of electrical closure of detonator contact with the 90^{0} contact, minimum		100%	3.2	4.5.4.3
104	Gap between rotor housing and support plate, maximum		0.40%	3.2	Gage
105	Ball stakes not in contact with the top of the bottom plate of the mechanism assembly		0.40%	3.2	Visual
106	Closure of switch S2-B prior to S3-B (90^{0} contact)		100%	3.5.4	4.5.4.3

NOTES:
1/ See 4.4.3.3 for sampling plan

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.37	Housing and Mechanism Assembly				12526708
					NEXT HIGHER ASSEMBLY 12526700
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
107	Second environment slot in rotor housing damaged	2/		3.11	Visual
108	Drag weight assembly fails to move freely		0.40%	3.2	Visual/Manual
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

2/ For assemblies inspected for S2-a overtravel

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.38	Pin, Contact				12526718
					NEXT HIGHER ASSEMBLY 12526711
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Protective finish incorrect, improper or inadequate		0.40%	3.2	Visual
Minor					
201	Pin diameter		0.65%	3.2	Gage
202	Material incorrect	1/		3.1	4.5.15
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

1/ Sample one part per lot

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.39	Pin, Connector				12526715
					NEXT HIGHER ASSEMBLY 12526711
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Pin diameter		0.40%	3.2	Gage
102	Protective finish incorrect, improper or inadequate		0.40%	3.2	Certification
Minor					
201	Material incorrect	1/		3.1	4.5.15
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526711
4.4.2.40	Connector Assembly				NEXT HIGHER ASSEMBLY 12526706
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Connector wire fails to maintain a 180 degree minimum wrap around connector housing after application of minimum load	1/,2/		3.2	4.5.23.1
102	Connector wire fails to maintain a 180 degree minimum wrap around contact pin after application of minimum load	1/,2/		3.2	4.5.23.2
103	Evidence of rotation between eyelet and connector housing after application of minimum load	1/,2/		3.2	4.5.23.3
104	Loose wire strand outside contact pin envelope		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Use same samples for these inspections.
2/ Sample size per MIL-STD-105, Table II-A, Inspection Level S-1.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526710
4.4.2.41	Shield				NEXT HIGHER ASSEMBLY 12526706
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Anti-assembly slot width, max		100%	3.2	Gage
002	True position of lead up hole to inside diameter containing anti-rotation slot		100%	3.2	Gage
Major					
101	Run out of lead cup mounting hole to outside diameter		0.40%	3.2	Gage
102	Depth from second largest counterbore to bottom of cavity		0.40%	3.2	Gage
103	Ultrasonic proof mark missing from raw material	1/		3.2	Visual
Minor					
201	Material incorrect	2/		3.1	4.5.15
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Inspect each bar prior to machining
2/ Sample one piece per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526706
4.4.2.42	Shield Assembly				NEXT HIGHER ASSEMBLY 12526700
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Locating pin fails to withstand application of minimum load		0.40%	3.2	Gage
102	Connector housing fails to withstand application of minimum load		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12526707
4.4.2.43	Cup, Lead				NEXT HIGHER ASSEMBLY 12526705
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Bottom thickness min		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.44	Lead Cup Assembly				12526705
					NEXT HIGHER ASSEMBLY 12526700
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Explosive above flush with top of lead cup		100%	3.2	Gage
Major					
101	Depth of dent, minimum, from explosive output test 1/	20		3.2	4.5.24.1
Minor					
201	Density after pressing		0.65%	3.2	4.5.24.2
202	Total volatiles of PBXN-5 incorrect		0.65%	3.1	4.5.24.3
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ 2 or more samples which fail to meet the minimum depth requirement shall reject the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.45	Cover, Shield				12526837
					NEXT HIGHER ASSEMBLY 12526700
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Material incorrect	1/		3.1	4.5.15
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Sample one part per lot

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.46	Fuze, PIBD, XM764				12526700
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
001	Fuze non-function	1/		3.6.1	4.5.5.3
002	Fuze does not remain in the initial safe position when subjected to jolt	9		3.8.3	4.5.9
003	Fuze does not remain in the initial safe position when subjected to jumble	9		3.8.4	4.5.10
Major					
101	Fuze function	2/		3.6.2	4.5.5.4
102	True position of connector pin to outside diameter and locating pin		100%	3.2	Gage
103	True position of locating pin to outside diameter		100%	3.2	Gage
104	Distance across locating pin		100%	3.2	Gage
105	Total length		100%	3.2	Gage
106	Insulation resistance, minimum		100%	3.2	4.5.25

NOTES:
1/ See 4.4.3.6 for sampling plan.
2/ See 4.4.3.7 for sampling plan.

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.46	Fuze, PIBD, XM764				12526700
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
107	Perpendicularity of connector pin to top of fuze		0.40%	3.2	Gage
Minor					
201	Marking incorrect, improper or illegible		0.65%	3.2	Visual
202	Height of connector pin from top, min		0.65%	3.2	Gage
203	Presence of lead cup assembly prior to application of closure disc		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.47	Packing and Marking for Barrier Bag Assembly Fuze, PIBD, XM764 - Prior to Sealing				12527234
					NEXT HIGHER ASSEMBLY
					12527235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	One or more fuzes inserted with contact pin facing downward		0.40%	3.2	Visual
102	One or both cushions missing between layers		0.40%	3.2	Visual
Minor					
201	One or more fuzes missing		0.65%	3.2	Visual
202	One or more separators damaged, allowing adjacent fuzes to touch each other		0.65%	3.2	Visual
203	One or more dessicant bags missing		0.65%	3.2	Visual
204	Humidity indicator missing		0.65%	3.2	Visual
205	Any packaging component not thoroughly dry		0.65%	3.2	Visual/Tactile
206	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.48	Packing and Marking for Barrier Bag Assembly Fuze, PIBD, XM764 - Just Prior to Insertion Into Next Assembly				12527234
					NEXT HIGHER ASSEMBLY
					12527235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Corners not blunted		0.40%	3.2	Visual
102	Box torn, cut or punctured		0.40%	3.2	Visual
Minor					
201	Contents loose		0.65%	3.2	Manual
202	Sealing tape application improper		0.65%	3.11	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.49	Packing and Marking for Barrier Bag Assembly Fuze, PIBD, XM764				12527234
					NEXT HIGHER ASSEMBLY
					12527235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Excess air not removed prior to sealing		0.40%	3.2	Visual
102	Inner fiberboard box crushed 1/		0.40%	3.11	Visual
103	Assembly ruptured or punctured		0.40%	3.2	Visual
104	Heat-seal seam separated		0.40%	3.2	Visual
105	Heat-sealed seam test	2/		3.2	4.5.14
Minor					
201	Heat-seal seam located so that one or more subsequent seams cannot be applied		0.65%	3.11	Visual
202	Marking missing, illegible or incorrect		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
1/ Package should be opened if crushed
2/ See MIL-P-116 for sampling plan

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

TABLE II - QUALITY CONFORMANCE INSPECTION
CLASSIFICATION OF DEFECTS AND TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.50	Packing and Marking for Fiberboard Box for Fuze, PIBD, XM764				12527235
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Box broken or split		0.40%	3.2	Visual
102	Contents loose		0.40%	3.2	Manual
103	Sealing tape missing, broken or loose		0.40%	3.2	Visual
Minor					
201	Marking missing, illegible or incorrect		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

HC-685

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Detonator and contact assembly check test - If the elapsed time between the acceptance of a detonator and contact assembly lot and its assembly into a fuze lot exceeds two years or, if the detonator and contact assembly lot has been subjected to adverse conditions described in 6.4 for any time period since lot acceptance testing, the detonator and contact assembly lot shall be subjected to and must satisfactorily pass the lot acceptance examinations and tests specified herein, except for simulated gun launch which shall not be performed. Testing shall be performed by the contractor on a detonator and contact assembly sample selected by the government (see 6.5).

4.4.3.2 Setback generator assembly (Major Defect)

4.4.3.2.1 Tightened inspection - Beginning with the first inspection lot produced and continuing until three consecutive lots have complied with the requirements of 3.4, twenty five setback generator assemblies shall be randomly selected from each lot and tested per 4.5.3. If two or more units fail to comply with the requirements, the lot shall be rejected.

4.4.3.2.2 Normal inspection - After three consecutive inspection lots have met the acceptance criteria of 4.4.3.2.1, the sample size shall be reduced to ten setback generator assemblies from each lot. If two or more assemblies fail to comply with 3.4, the lot shall be rejected and tightened sampling per 4.4.3.2.1 shall be reinstituted. If one assembly fails to comply, an additional sample of fifteen assemblies shall be selected. If one or more assemblies from the additional sample fail to comply, the lot shall be rejected and tightened sampling per 4.4.3.2.1 shall be reinstituted.

4.4.3.3 S2a switch overtravel (Major Defect)

4.4.3.3.1 Tightened inspection - Beginning with the first inspection lot produced and continuing until three consecutive lots have complied with the requirements of 3.5.1, fifteen housing and mechanism assemblies shall be randomly selected from each lot and tested per 4.5.4.1. If two or more units fail to comply with the requirements, the lot shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.4.3.3.2 Normal inspection - After three consecutive inspection lots have met the acceptance criteria of 4.4.3.3.1, the sample size shall be reduced to ten housing and mechanism assemblies from each lot. If two or more assemblies fail to comply with 3.5.1, the lot shall be rejected and tightened sampling per 4.4.3.3.1 shall be reinstituted. If one assembly fails to comply, an additional sample of fifteen assemblies shall be selected. If one or more assemblies from the additional sample fail to comply, the lot shall be rejected and tightened sampling per 4.4.3.3.1 shall be reinstituted.

4.4.3.4 Second safety environment - Assemblies used in 4.4.3.3 shall be used for this test in first article inspection only.

4.4.3.5 Potting voids (Major Defect)

4.4.3.5.1 Normal inspection - Nine molded housing assemblies shall be selected from the fuze lot and tested per 4.5.26. If one or more units fail to comply with the requirements of 3.5.3, the lot shall be rejected.

4.4.3.5.2 Alternate inspection - A process control approach may be incorporated as an alternative to 4.4.3.5.1.

a. Beginning with the first day's production and continuing until three consecutive days of production have complied with the requirements of 3.5.3, two molded housing assemblies shall be randomly selected from each day's production and tested per 4.5.26. If one or more units fail to comply with the requirements, that day's production shall be rejected.

b. After three consecutive day's of production have met the acceptance criteria of 4.4.3.5.2.a, the sample size shall be reduced to one molded housing assembly from each day's production. If that unit fails to comply with the requirements of 3.5.3 when tested per 4.5.4.1, that day's production shall be rejected and the inspection shall revert to that of 4.4.3.5.2.a.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.4.3.6 Fuze non-function (Critical Defect)

4.4.3.6.1 Tightened inspection - Beginning with the first lot produced and continuing until three consecutive lots have complied with the requirements of 3.6.1, twenty-four fuzes shall be randomly selected from each lot and tested per 4.5.5.3. If any fuze fails to comply with the requirements, the lot shall be rejected.

4.4.3.6.2 Normal inspection - After three consecutive lots have met the acceptance criteria of 4.4.3.6.1, the sample size shall be reduced to twelve fuzes from each lot. If any fuze fails to comply with 3.6.1, the lot shall be rejected and sampling shall revert to the tightened inspection of 4.4.3.6.1.

4.4.3.7 Fuze function (Major Defect) - If any fuze produces a premature explosive output before eleven meters from the muzzle, the lot shall be rejected.

4.4.3.7.1 Tightened inspection - Beginning with the first lot produced and continuing until three consecutive lots have complied with the requirements of 3.6.2, twenty-four fuzes shall be randomly selected from each lot and tested per 4.5.5.4. If one early function occurs or if two or more units fail to comply with the response time requirements, the lot shall be rejected.

4.4.3.7.2 Normal inspection - After three consecutive lots have met the acceptance criteria of 4.4.3.7.1, the sample size shall be reduced to twelve fuzes from each lot. If one early function occurs or if two or more units fail to comply with the response time requirements of 3.6.2, the lot shall be rejected and sampling shall revert to the tightened inspection of 4.4.3.7.1.

4.4.3.8 Embrittlement of springs - A sample of fifteen springs of each type shall be selected from each heat treat batch and tested as specified in 4.5.16. If one or more springs fail to meet the requirements of 3.9, the heat treat batch of springs represented by the sample shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.4.3.9 Capacitor environmental conditioning - A sample of thirty six capacitors shall be selected from each lot for this examination. If two or more capacitors fail to comply with either the insulation resistance or capacitance requirements of the applicable drawing, the lot shall be rejected. If only one sample capacitor fails to comply, then an additional sample of forty four capacitors shall be selected and examined. If two or more capacitors from the additional sample of forty four capacitors fail to comply, then the lot shall be rejected. Testing shall be in accordance with 4.5.21.

4.4.3.10 Diode environmental conditioning - A sample of thirty six diodes shall be selected from each lot for this examination. If two or more diodes fail to comply with either the forward voltage or reverse current requirements of the applicable drawing, the lot shall be rejected. If only one sample diode fails to comply, then an additional sample of forty four diodes shall be selected and examined. If two or more diodes from the additional sample of forty four diodes fail to comply, then the lot shall be rejected. Testing shall be in accordance with 4.5.21.

4.4.4 Inspection equipment - The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in Table II. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6.2 of MIL-A-48078 and 6.2 herein.

4.5 Test procedures

Precaution - This specification covers sampling and testing of chemical, toxic or explosive materials which are potentially hazardous to personnel. Accordingly, it is emphasized that all applicable safety rules, regulations and procedures must be followed in handling and processing these materials.

4.5.1 Test conditions

4.5.1.1 Environmental conditions - Unless otherwise specified for the purpose of test, testing shall be conducted at the following conditions:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

a.	Temperature	$72^{o} \pm 18^{o}F$
b.	Relative Humidity	90% maximum
c.	Barometric Pressure	30 ± 2 inches of mercury

4.5.1.2 Test tolerance - All tolerances specified herein are absolute with no allowance made for measuring equipment inaccuracy. Measurements shall ensure that the values measured are within the tolerances or limits specified.

4.5.2 Release mechanism assembly - The release mechanism assembly shall be mounted in a centrifuge with the leaf pins parallel to the rotating axis with the bearing plate screws pointing away from the center of rotation.

4.5.2.1 Non-arming test - The release mechanism assembly shall be rotated in a centrifuge at the required speed to produce the gravitational force specified in 3.3.1 and then stopped and visually inspected by means of a 3 to 5 power magnification. The assembly shall be considered unarmed if both of the following criteria are met:

a. The release leaf assembly is restrained when the rotor restraining hook of the release leaf assembly is forced toward the armed position with a nonmetallic probe.

b. The pins in the setback leaf assembly and the release leaf assembly rest on the forward flat positions of the setback leaf and the setback leaf assembly, respectively.

4.5.2.2 Arming test - The release mechanism assembly shall be rotated in a centrifuge at the required speed to produce the gravitational force specified in 3.3.2 and then stopped and visually inspected by means of a 3 to 5 power magnification. The assembly shall be considered armed if both of the following criteria are met:

a. The rotor restraining hook of the release leaf assembly has rotated sufficiently to clear the rotor pin track in the lower plate assembly.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

b. The anti-reset spring is locked against the release leaf assembly and, when the release leaf assembly is forced with a nonmetallic probe against the anti-reset spring, the leaf will be retained in the armed position.

4.5.3 Setback generator assembly

4.5.3.1 Residual flux densities - The samples selected for this test shall be disassembled as necessary, and the magnet removed. When measured with an RFL Industries, Inc. Gaussmeter, Model Number 904, or equivalent, the magnetic flux density of the residual field in the magnet shall meet the requirements of 3.4. Care shall be exercised to assure the integrity of each magnet prior to and during this test by utilizing a workplace which is itself a non-magnetic area. Each magnet shall be disposed of in accordance with local, approved procedures.

4.5.3.2 De-Magnetization of magnets - Just prior to assembly, magnets shall be selected for this inspection and gaged to determine the level of background residual magnetism present in each sample. Using the equipment in 4.5.3.1, or equivalent, no magnet shall exhibit a flux density greater than two Gauss from any longitudinal or circumferential field indicated into the material. Failure of any magnet to comply with this requirement shall be cause for the contractor to institute corrective action. Corrective action taken shall be reported to the Quality Assurance Representative (QAR) servicing the contractor's facility.

4.5.4 Housing and mechanism assembly

4.5.4.1 S2a switch overtravel - The housing and mechanism assembly shall be tested for S2a switch overtravel by measuring the movement of the cam follower while moving the rotor to the fully safe position. It is recommended that a non-contact instrument be used such as a microscope with a reticle lens. If a contact instrument is used, care must be exercised that the parts are not distorted and thereby producing an erroneous reading. As the rotor is turned toward the safe position, a reading is to be taken when the S2a switch first closes electrically. A second reading is to be taken when the rotor is driven to the fully safe position. The difference in these readings shall

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

show that the fork which drives the S2 switch wire has moved to meet the requirement of 3.5.1. The test procedure prepared by the contractor shall also contain provisions for a warning, as well as, precautions to prevent snap arming and subsequent damage to the second environment slot in the rotor housing.

4.5.4.2 Second environment safety - The housing and mechanism assembly shall be tested for second environment safety. The unit shall be mounted in the spin fixture as done for the arming test except the drag mass shall not be held out-of-line. The spin fixture shall be run to simulate a 2.5 gravities, minimum, drag and the unit shall be functioned.

4.5.4.3 Centrifuge arming - The Housing and Mechanism Assembly shall be tested for arming in accordance with the requirements of 3.5.4. Each assembly shall be mounted in a spin fixture and rotated at the number of revolutions per minute (RPM), based upon the design of the fixture, which produces fifteen gravities maximum (15 g's) of drag deceleration on the assembly. Each of the following characteristics shall be noted on an oscilloscope trace of the arming sequence switching functions:

a. The first electrical closure of the detonator contact with the in-line contact of the assembly shall be greater than ten milliseconds from the time of rotor release (Critical Defect).

b. The last electrical closure (steady state condition) of the detonator contact shall be less than eighteen milliseconds (Major Defect).

c. The electrical closure of the detonator contact with the ninety degree (90°) contact shall be greater than fifty microseconds for one continuous (steady state) pulse (Major Defect).

d. The arming sequence shall be such that the trembler switch (S4) is in the firing circuit prior to the first electrical closure of the detonator contact with the ninety degree (90°) contact (see drawing 12526701 and Figures 1 and 2 for explanation of switching positions) (Major Defect).

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:27Z
Check the source to verify that this is the currentversion before use.

4.5.5 Ballistic testing - Fuze samples selected (see 4.5.5.2) for ballistic testing shall be assembled into cartridges at a Government designated facility.

4.5.5.1 Preconditioning - The fuze samples selected for ballistic testing shall be equally divided into two groups. The first group shall be environmentally conditioned by subjecting the fuzes to sequential thermal shock and transportation vibration at temperatures per 4.5.12 and 4.5.13. The order of conditioning is interchangeable. Fuzes which are conditioned in this manner shall be suitably marked. The second group of fuzes shall not be environmentally conditioned in any manner and shall also be suitably marked. Markings are to be carried forward through cartridge assembly levels.

4.5.5.2 Assembly and firing of test cartridges - The samples which are to be ballistically tested shall be assembled into XM830, HEAT-MP-T cartridges per drawing 12526622, or equivalent approved by the contracting officer, and fired in an XM256 cannon. The cartridges assembled from each fuze group shall be equally divided into three groups for temperature conditioning, one group each at $+52^{o}$ minus $3^{o}C$, $+21^{o}$ plus or minus $1.5^{o}C$, and -37.5^{o} plus $3^{o}C$. Temperature conditioning of cartridges shall be as specified until all propelling charges are stabilized at a uniform temperature, which normally requires a period of twenty four hours, minimum. Following removal from temperature conditioning, each cartridge shall be chambered and fired within ten minutes. Video camera coverage shall be used to provide documentation coverage of each projectile's flight from the cannon to target location. A marker which identifies the eleven meter minimum fuze arming distance shall appear in the field of view of this camera. The inclusion of photographic coverage or other instrumentation to monitor the operation of the cannon, case base ejection, cartridge case residue, etc., shall be at the testing facility's discretion. Failure of this or other equipment not essential to fuze ballistic testing shall not be cause for delay nor cessation of fuze acceptance tests.

4.5.5.3 Fuze non-function - Each cartridge shall be fired at a one-inch thick, minimum, vertical plywood target which has been positioned at 10.49 plus 0.50 meters from the cannon muzzle. High-speed motion camera coverage

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

shall be placed at the target location. Observation shall be made for projectile function and shaped-charge jet formation on or after target impact. Each fuze sample shall meet the requirements of 3.6.1.

4.5.5.4 Fuze function - Each cartridge shall be fired at a one-inch thick, minimum, vertical plywood target which has been positioned at thirty plus 0.5 meters from the cannon muzzle. High-speed motion camera coverage shall be placed at the target location, perpendicular to the line of projectile flight. Observation shall be made for projectile function and shaped-charge jet formation on target impact. The film used for target camera coverage shall have timing marks suitable for determination of the elapsed time from projectile target impact and fuze functioning, as evidenced by the formation of a fireball. Each fuze sample shall meet the requirements of 3.6.2.

4.5.6 Arming range - The procedures for performing the Arming Range test shall be as prescribed by MIL-STD-331, Test Number 208.1, Phase II, Procedure II (also known as the Impact-Safe Distance test). For testing purposes, failure is defined as a negative (non-function) response on the target media. If a failure results from the first trial, the second trial is at the average of the first trial and upper arming distance (thirty meters). The fuzes selected for this test shall be assembled into cartridges and fired in accordance with 4.5.5.4, except that all cartridges shall be temperature conditioned at 21° plus or minus $1.5^{o}C$ for twenty four hours, minimum, prior to firing.

4.5.7 1.5 meter drop - The equipment and procedure for performing the 1.5 meter drop test shall be as prescribed by MIL-STD-331, Test Number 111.1, Procedure 2, Criteria A. Bare fuzes shall be dropped in each of the five orientations specified by the test procedure. Each fuze shall be recovered, X-rayed and then disassembled in order to determine compliance with 3.8.1. The fuzes subjected to this test shall be disposed of in accordance with approved local procedures (see 4.5.17).

4.5.8 Twelve meter drop - The equipment and procedure for performing the twelve-meter drop test shall be as prescribed by MIL-STD-331, Test Number

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the currentversion before use.

103.2, Procedure 1. The fuzes selected for this test shall be assembled into inert cartridges, packaged and dropped to provide the impact orientations (one third in each axis) specified in the procedure. Each fuze shall be recovered, X-rayed (see 4.5.17) and then disassembled in order to determine compliance with 3.8.2. The fuzes subjected to this test shall be disposed of in accordance with approved local procedures (see 4.5.17).

4.5.9 Jolt - The equipment and procedures for performing the Jolt test shall be as prescribed by MIL-STD-331, Test Number 101.2, Procedure II. Bare fuzes shall be placed in the test fixture; and, the orientation of the fuzes in the horizontal test phase shall be random. Each fuze shall be radiographed and disassembled in order to determine compliance with 3.8.3 (see 4.5.17 for radiographic procedure). Fuzes subjected to this test shall be disposed of in accordance with approved, local procedures.

4.5.10 Jumble - The equipment and procedures for performing the Jumble test shall be as prescribed by MIL-STD-331, Test Number 102.1. The size of box to be utilized shall be either A or B as described in the test procedure. Each fuze shall be radiographed and disassembled in order to determine compliance with 3.8.4 (see 4.5.17 for radiographic procedure). Fuzes subjected to this test shall be disposed of in accordance with approved, local procedures.

4.5.11 Extreme temperature storage - The equipment and procedures for performing the Extreme Temperature Storage test shall be as prescribed by MIL-STD-331, Test Number 112.1, Procedures II and III. One-half of the fuzes allotted for this test shall be temperature conditioned according to Procedure II and the remaining half to Procedure III. Following the conditioning, but prior to assembly into cartridges, each fuze shall be radiographed in accordance with 4.5.17. The test cartridges shall be tested for operability in accordance with 4.5.5.4, except that the cartridges containing the fuzes conditioned per Procedures II and III shall be temperature conditioned respectively at (minus) 37.5^{o} + $3^{o}C$ and (plus) 52° - $3^{o}C$ for twenty four hours, minimum, prior to firing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.5.12 Thermal shock - The equipment and procedures for performing the Thermal Shock test shall be as prescribed by MIL-STD-331, Test Number 113.1. Following the conditioning, but prior to assembly into cartridges, each fuze shall be radiographed in accordance with 4.5.17. The test cartridges shall be tested for operability in accordance with 4.5.5.4.

4.5.13 Transportation vibration-temperature - The equipment and procedures for performing the Transportation Vibration-Temperature test shall be as prescribed by MIL-STD-331, Test Method 119, Procedure 1. Following the conditioning, but prior to assembly into cartridges, each fuze shall be radiographed in accordance with 4.5.17. The test cartridges shall be tested for operability in accordance with 4.5.5.4.

4.5.14 Security of barrier bag heat seal - The procedure for the performance of the barrier bag heat seal security test shall be prescribed for the "Heat Seal Test" in MIL-P-116. The load applied shall be fifty ounces.

4.5.15 Material examination - When this paragraph is specified, a random sample from each lot shall be selected and tested as follows:

a. When a material evaluation is required, the sample conformance to chemical composition shall be determined in accordance with ASTM A751, E53 or E62 as applicable.

b. When a hardness or temper is required, the sample shall be tested for hardness in accordance with ASTM E-18.

c. When an ultimate tensile strength is required, the sample shall be tested in accordance with ASTM E-8.

d. When the physical dimensions of the sample make the determination of the physical properties cited above impracticable, the contractor shall provide a sample of the raw material from which the component was fabricated. This sample shall then be used to make the largest obtainable specimen as prescribed by the test method in question.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.5.16 Embrittlement of springs - The drag mass springs selected for this test shall be pulled to the minimum point of permanent distortion without breaking. The rotor springs and setback leaf springs selected for this test shall be twisted to the point of permanent distortion in the direction which simulates normal function of the spring without breaking. The springs tested shall be disposed of in accordance with local approved procedures.

4.5.17 Radiographic inspection of fuzes

4.5.17.1 Fuze rotor safety x-ray - The fuze shall be subjected to radiographic x-ray to assure rotor safety prior to final assembly. The x-rays shall be of sufficient quality to observe the characteristics of the XM764 fuze. The fuze shall be determined to be in the safe, unarmed condition if all of the following characteristics are observed.

a. In a radiograph made perpendicular to the plane of the rotor rotation and with the J1 connector pin oriented on the left:

(1) The detonator contact button shall be located approximately 83 degrees counterclockwise from the inline electrical contact. See Figure 3.

(2) S2 terminal wire shall be bent to the right. See Figure 3.

b. In a radiograph made viewing 90 degrees counterclockwise (CCW) from that described above, the position of the drag mass shall be in its trapped position. See Figure 4.

4.5.17.2 Post environmental conditioning x-rays - Fuzes which have been subjected to environmental conditioning in accordance with 4.5.7, 4.5.9, 4.5.10, 4.5.11, 4.5.12 or 4.5.13 shall be examined for fuze arming safety in accordance with 4.5.17.1. For the fuzes subjected to 4.5.7, 4.5.9 and 4.5.10, the radiographs shall be taken prior to disassembly of the fuzes. For the fuzes subjected to 4.5.11, 4.5.12 and 4.5.13, the radiographs shall be taken immediately following the conditioning and again, just prior to their assembly into projectiles for ballistic testing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.5.18 Electrical component testing

4.5.18.1 Insulation resistance - The procedure for performing this test is contained in MIL-STD-202, Method 302. The test shall be performed at a voltage of 200 VDC.

4.5.18.2 Lead solderability - The procedure for performing this test is contained in MIL-STD-202, Method 208 D. A shelf life not to exceed nine months shall be maintained for component lots which successfully pass the test.

4.5.19 Centrifuge testing of the trembler switch - Each trembler switch shall be mounted in a centrifuge and tested per drawing 12526846 Method 6A for functioning and Method 6B for non-function.

4.5.20 Setback generator assembly leak test - After soldering and mounting to the printed wiring board, each setback generator shall be tested for the integrity of the crimped and caulked seal to preclude potting intrusion into the generator. The access hole in the top of the armature shall be used in this test. Using an appropriate setup, atmospheric pressure inside each generator shall be reduced to ten millimeters of mercury (10mm H_G), maximum. A means of monitoring the pumping side (access hole) of the test setup shall be included. A pressure drop exceeding five percent of an atmosphere, in 10 seconds after pumping ceases, shall be cause for the rejection of the setback generator assembly under test. At the contractor's option, a coupling material, such as petroleum jelly, may be used to facilitate the attainment of reduced pressure inside each generator; however, this material shall be removed in its entirety prior to assembly of the closure disc. Care shall also be exercised to prevent the depositing of any couplant in the armature access hole at any time during the test. Setback generator assemblies found to have the couplant in the access hole shall be cleaned and then subjected to a retest.

4.5.21 High-g load test - Components subjected to this test shall be prepared in accordance with drawing 12526846. A gravity pulse conforming to the typical setback curve for the XM830 cartridge when fired in the XM256

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the currentversion before use.

cannon shall be forty-four thousand Gravities (44,000 G's), minimum. This pulse may be obtained by using an airgun or the XM256 cannon, itself.

4.5.22 Detonator and contact assembly testing - Detonator and contact assemblies shall be prepared as prescribed by drawing 12526846 and subjected to the following conditioning and tests.

a. Contact Function - The sample shall be examined for Contact Function per Method 7A of drawing 12526846.

b. Temperature Conditioned - The sample shall be conditioned by Extreme Temperature Storage, Method 1 of drawing 12526846. The samples shall then be tested for Explosive Output and Function Time per Method 7B and Method 7C, respectively, of drawing 12526846.

c. High G Conditioned - The sample shall be conditioned by High-G shock load, Method 4 of drawing 12526846. The samples shall then be tested for explosive output and function time per Method 7B and Method 7C, respectively, of drawing 12526846.

4.5.23 Connector assembly load tests - The following tests shall be performed in the manner indicated for all samples selected.

4.5.23.1 Connector wire and connector housing - For this test, remove the insulating tube and expose the swaged end of the connector pin. The required tensile load shall be applied by clamping the connector wire and supporting the connector housing. Examine each eyelet for evidence of wire strand separation from the crimped section of the eyelet.

4.5.23.2 Connector wire and contact pin - The required tensile load shall be applied by clamping the connector wire and restricting the movement of the contact pin in a suitable fixture. Care should be exercised to prevent twisting of the assembly upon application of the load. Examine each assembly for evidence of wire strand separation from the crimped section of the contact pin.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

4.5.23.3 Connector pin and eyelet - The required compressive load on the swaged end of the connector pin shall be applied by supporting the open end of the connector housing. The fixture used for support shall have a cavity in which the free end of the connector pin shall be placed in order to prevent distortion and movement of the connector pin during this test. The load shall be applied to the swaged end of the connector pin with a conical-shaped tool of a size which will not disrupt the swaged material. Examine each assembly for evidence of looseness between the connector housing eyelet or connector pin.

4.5.24 Lead cup assembly tests

4.5.24.1 Output test - The lead cup assemblies selected for the output test shall be placed in aluminum sleeves for confinement. The sleeves shall conform to the material and dimensional requirements of MIL-STD-331, Test Method 301.1, which will be used to conduct this test. An M69 Detonator shall be used to initiate the lead cup assemblies tested; and, the detonators shall be initiated by using a 0.564 microfarad max. capacitor charged to a voltage of seventy-eight volts, DC (78.0 VDC). The air gap between the lead cup and detonator shall be 0.06 $\pm$ 0.001 inches. The dent made in the steel blocks used for this test shall be measured and compared to the requirement of the applicable drawing. The firing response time of the detonators used shall be taken for information only and the lot of detonators used shall be noted on the test record.

4.5.24.2 Density of PBXN-5 explosive powder after pressing - Explosive density after pressing into lead cups shall be determined by first weighing and measuring a sample of lead cups. Secondly, remeasure the lead cups after pressing, including the applicable PBXN-5 dimensions and reweigh the lead cup assemblies. Finally, divide the weight of the PBXN-5 determined by the calculated volume filled with the explosive to obtain the density.

4.5.24.3 Volatiles of PBXN-5 prior to pressing - The procedure for performing this test is as described in MIL-STD-1234, Test Method 102.2. The amount of total volatiles determined shall be compared to the requirements of

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

the applicable specification. This test shall be performed no more than sixty days prior to actual date of pressing into lead cups.

4.5.25 Insulation resistance (Hi-Pot) test - Insulation resistance shall be measured between the shield (case ground) and connector assembly (positive lead). The voltage level shall be two hundred volts, DC (200 VDC) and shall be applied for five seconds, minimum. Suitable protection should be provided for both the test operator, as well as for the test equipment for the unlikely event of initiating a detonator upon application of voltage.

4.5.26 Potting voids - The molded housing assembly shall be sectioned by cutting slices perpendicular to the fuze axis using a cutoff wheel with a 0.062 inch maximum thickness. The sections shall be no larger than 0.1 inches thick with a smooth, clean finish without evidence of burning. The first cut shall start 0.1 inches from the outside surface of the PWB cover. Subsequent cuts shall permit examination above and below Diode and between the Setback Generator Assembly and the Rotor Housing. Any voids observed shall be cut in two to permit measurement of the maximum dimension.

4.5.27 Compressive strength - Test bars shall be prepared and tested in accordance with drawing 12526831.

4.5.28 Trembler testing - The lead strength and environmental tests shall be tested in accordance with drawing 12526788.

5. PACKAGING

5.1 Cleaning - If required, fuzes shall be cleaned in accordance with MIL-P-116, Process C-1.

5.2 Drying - If required, fuzes shall be dried in accordance with MIL-P-116.

5.3 Unit and intermediate packaging

5.3.1 Level A - Not applicable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

5.3.2 Level B - Not applicable.

5.3.3 Level C - Two layers of twenty five fuzes each shall be unit and intermediate packaged in accordance with 12527234. Layering is permitted only if the fuzes themselves are not subjected to the stacking loads of the upper layer. Separators, Fillers and Cushions shall be used in accordance with 12527234. The Inner Fiberboard Box shall be enclosed in a Type I, Class F, Barrier Bag in accordance with 12527234.

5.4 Packing

5.4.1 Level A - Not applicable.

5.4.2 Level B - Not applicable.

5.4.3 Level C - The package described in 5.3.3 shall be overpacked and sealed in a telescoping outer Fiberboard Box in accordance with 12527235.

5.5 Marking

5.5.1 Level A - Not applicable.

5.5.2 Level B - Not applicable.

5.5.3 Level C - Marking shall be in accordance with 12527235, MIL-STD-129 and the Code of Federal Regulations (CFR), Title 49.

5.6 Shipping - When items from more than one lot are shipped together, each lot shall be kept separate and the division between lots shall be clearly indicated to prevent mixing of lots in transit.

5.7 Reuse of packaging materials - Reuse of all packaging material except Dessicant Bags and Moisture Indicators is permissible and recommended when considered economically feasible by the procuring contracting officer and the material is in a reusable condition.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:27Z
Check the source to verify that this is the currentversion before use.

6. NOTES

6.1 Intended use - The item described by this specification is intended for use in the XM830 cartridge.

6.2 Ordering data

6.2.1 Acquisition requirements - See MIL-A-48078.

6.2.2 Data requirements - Deliverable data requirements by this specification is cited in the following paragraphs:

Paragraph	Data Requirement	Applicable DID
4.3.5	Process and Process Controls	DI-P-1604
4.4.4	Inspection Equipment Designs	DI-R-1714
6.2.1	Ammunition Data Card	DI-L-1410

Copies of data item descriptions required by the contractor in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.

6.2.2.1 Delivery of data to the technical activity - The following address is to be added to those listed in the contract (Form DD 1423) for the delivery of one copy, each, to the technical agency of the Ammunition Data Cards and Quality Inspection Defect Reports prepared by the contractor for the duration of the contract: Commander, Armament Research and Development Center (ARDC), US Army Armament, Munitions and Chemical Command (AMCCOM), ATTN: DRSMC-QAT-A(D), Dover, New Jersey 07801.

6.3 Process and statistical controls - This specification reduces the amount of Government-required inspection insofar as limiting piece part/component inspection in favor of assembly inspection or testing. Accordingly, the contractor is advised to establish and maintain a system of statistical quality controls designed to maximize the production of acceptable assemblies and fuzes.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the current version before use.

6.3.1 Process definitions - The process definition describes the tools, equipment and techniques used to manufacture fuze hardware and assemblies. It is suggested that the process definition include the following parts and assemblies: coil winding and support; coil, shear disc and armature plate assembly; generator magnetization; generator sealing; component lead wire bending; encapsulation preparation and application to the molded housing assembly; assembly of upper and lower plate assemblies; bracket and cam assembly; release mechanism assembly; tensioning the rotor spring; and all staking operations.

6.3.2 Process controls - Process controls and inspections, including destructive tests, to assure proper quality of specific parts and assemblies will be identified. The sample size and frequency will specify and contain, as a minimum, the requirements of section four, herein.

6.3.3 Format of plans - The contractor's written plan of process and process controls can be prepared in the contractor's format; however, the format specified in Data Item description DI-P-1604 is suggested.

6.3.4 Test reports - The results of the destructive load tests specified by the process control plan will be prepared in a format of the contractor's choice. It is recommended that a copy be furnished to the Government Quality Assurance Representative servicing the contractor's plant.

6.4 Adverse conditions - Examples of exposure to adverse conditions are indications of (1) corrosion products on the detonator and contact assembly, (2) moisture or water marks or stains on the exterior packing, (3) cuts, scrapes, scuff marks, gouges or tears on the inner packing or (4) compromised integrity of the barrier bag and security of the seal.

6.5 Cost of check test - The contracting officer will arrange for the contractor to be reimbursed for the expense incurred in performance of the detonator and contact assembly check test. The test shall be performed at Government expense without cost to the contractor who loaded the detonators or to the contractor assembling the fuze and shall not constitute a basis for rejection against either contractor except where deterioration has occurred as

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

a direct result of carelessness in activities such as handling and storage permitted while the detonator lot was under the jurisdiction of either contractor.

6.6 Visual examination qualification - When compliance with a requirement is in doubt as a result of a visual examination, the characteristic may be measured or gaged to determine acceptability.

6.7 Firing record information - The firing records shall include the serial numbers of all weapon and fire control components and weapon to target azimuth. Stock component lot identifications for warmers, spotting or rangers shall be recorded, as well as the lot numbers of reference components used, if any. The record shall include the number of prior firings from both the breech and the cannon tube, including the estimated remaining life of the tube before and following the test.

6.7.1 Round-by-round data - For each round fired, the test record shall contain the sequence of firing, deflection, elevation, time of firing, muzzle velocity (if applicable), tracer function, flight characteristics prior to target impact, chamber pressure (if cannon is so equipped) metal parts security, case base extraction and combustible case residue data.

6.8 Drawings - Drawing listed in Section 2 of this specification under the heading US Army Armament Munitions and Chemical Command (AMCCOM) may also include drawings prepared by, and identified as Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, or Picatinny Arsenal drawings, or U.S. Army Armament Research and Development Command. Technical data originally prepared by these activities is now under the cognizance of AMCCOM.

6.9 Certified test report - When certification requirements are specified, the contractor shall furnish the certificates to the Government. A certificate is in addition to and not in lieu of any rights of the Government under the contract. A certificate will not be used as the sole basis for Government acceptance, unless so indicated in the contract. As a minimum, a Certified Test Report shall contain the following:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

a. Name of company and date.

b. Contract number and part number.

c. Complete nomenclature of the supplies, together with the lot number. The quantity in each lot or shipment shall be given.

d. All inspections and tests required by the contract or technical documentation shall be recorded in test reports. These reports shall identify each lot submitted for acceptance by lot number; specification or drawing; revision and date; number of specimens tested; specified characteristics and requirements; and, actual results obtained.

e. A statement certifying that material supplied meets all requirements of the applicable drawing.

f. Signature and title of the certifying official.

6.10 Definition of levels of packaging and packing

6.10.1 Level A - For unrestricted shipment (OCONUS) and storage.

6.10.2 Level B - For OCONUS shipment and storage.

6.10.3 Level C - For CONUS shipment and very limited storage.

(For further information concerning levels of packaging and packing, consult Army Regulation (AR) 700-15.)


6.11 Function definitions - The following definitions apply to fuzed cartridges which have been gun fired.

6.11.1 Premature - A premature is a projectile function which occurs at any point prior to the fuze's safe separation distance (non-function) of eleven (11) meters from the gun muzzle.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the currentversion before use.

6.11.2 Early burst - An early burst is any in-flight projectile function after eleven (11) meters from the gun muzzle and prior to impact.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

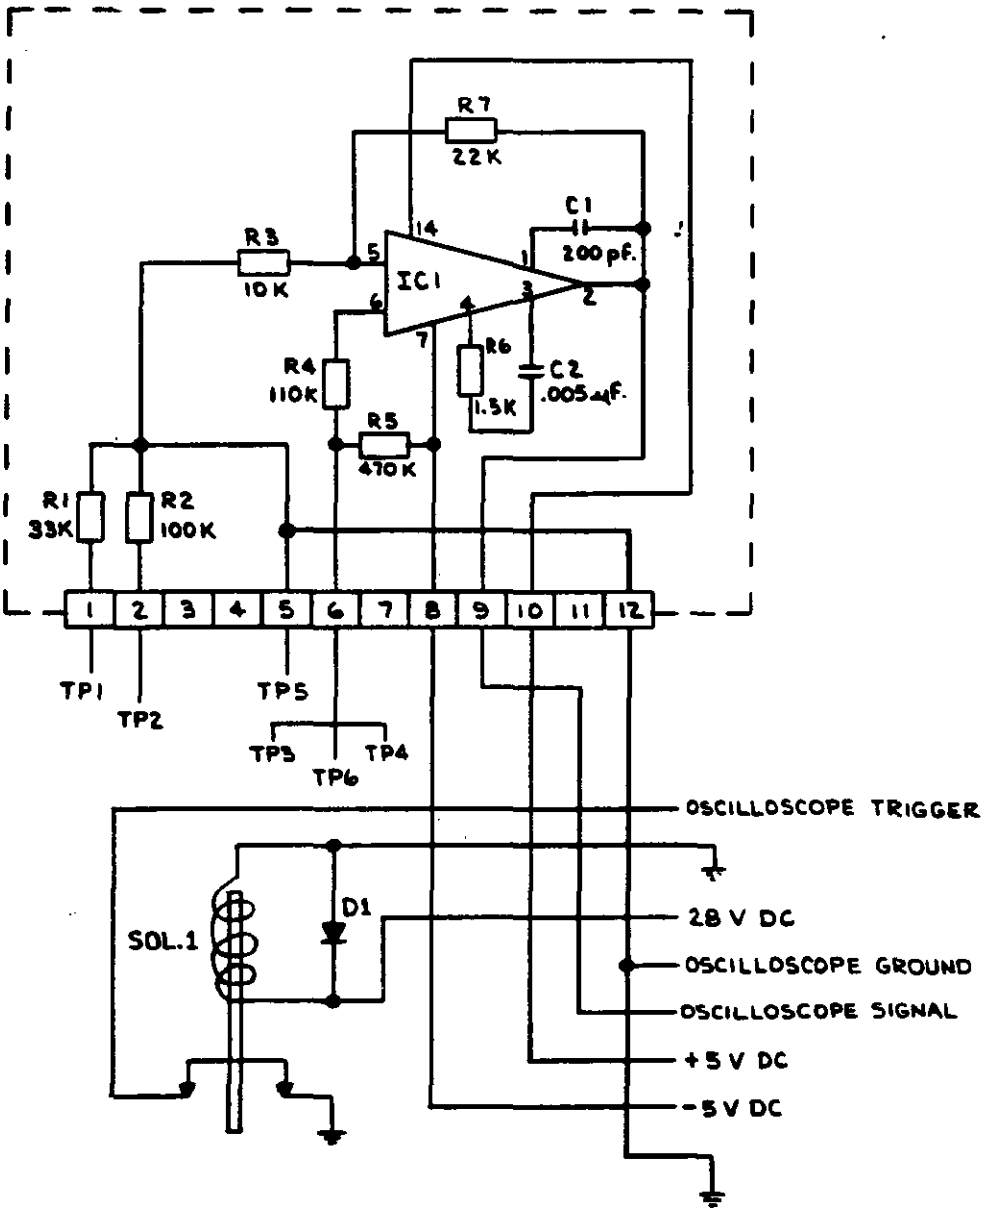


R1 - 33K ohms
R2 - 100K ohms
R3 - 10K ohms
R4 - 100K ohms
R5 - 470K ohms
R6 - 1.5K ohms
R7 - 22K ohms

C1 - 200pf.
C2 - .005μF.
IC1 - MC1437P
SOL.1 - ROTOR RELEASE SOLENOID
D1 - IN4004

CENTRIFUGE TEST CIRCUIT
FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:27Z
Check the source to verify that this is the current version before use.

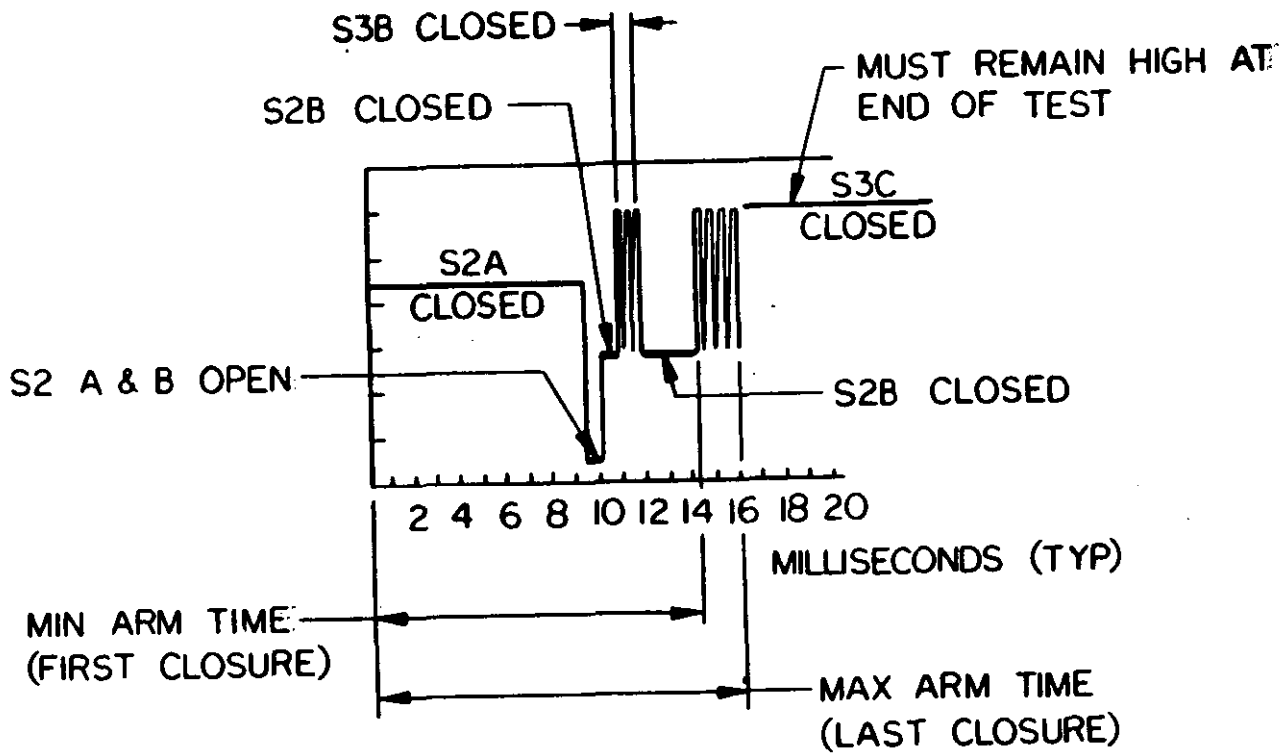

TYPICAL OSCILLOSCOPE TRACE

FIGURE 2

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:27Z
Check the source to verify that this is the currenversion before use.

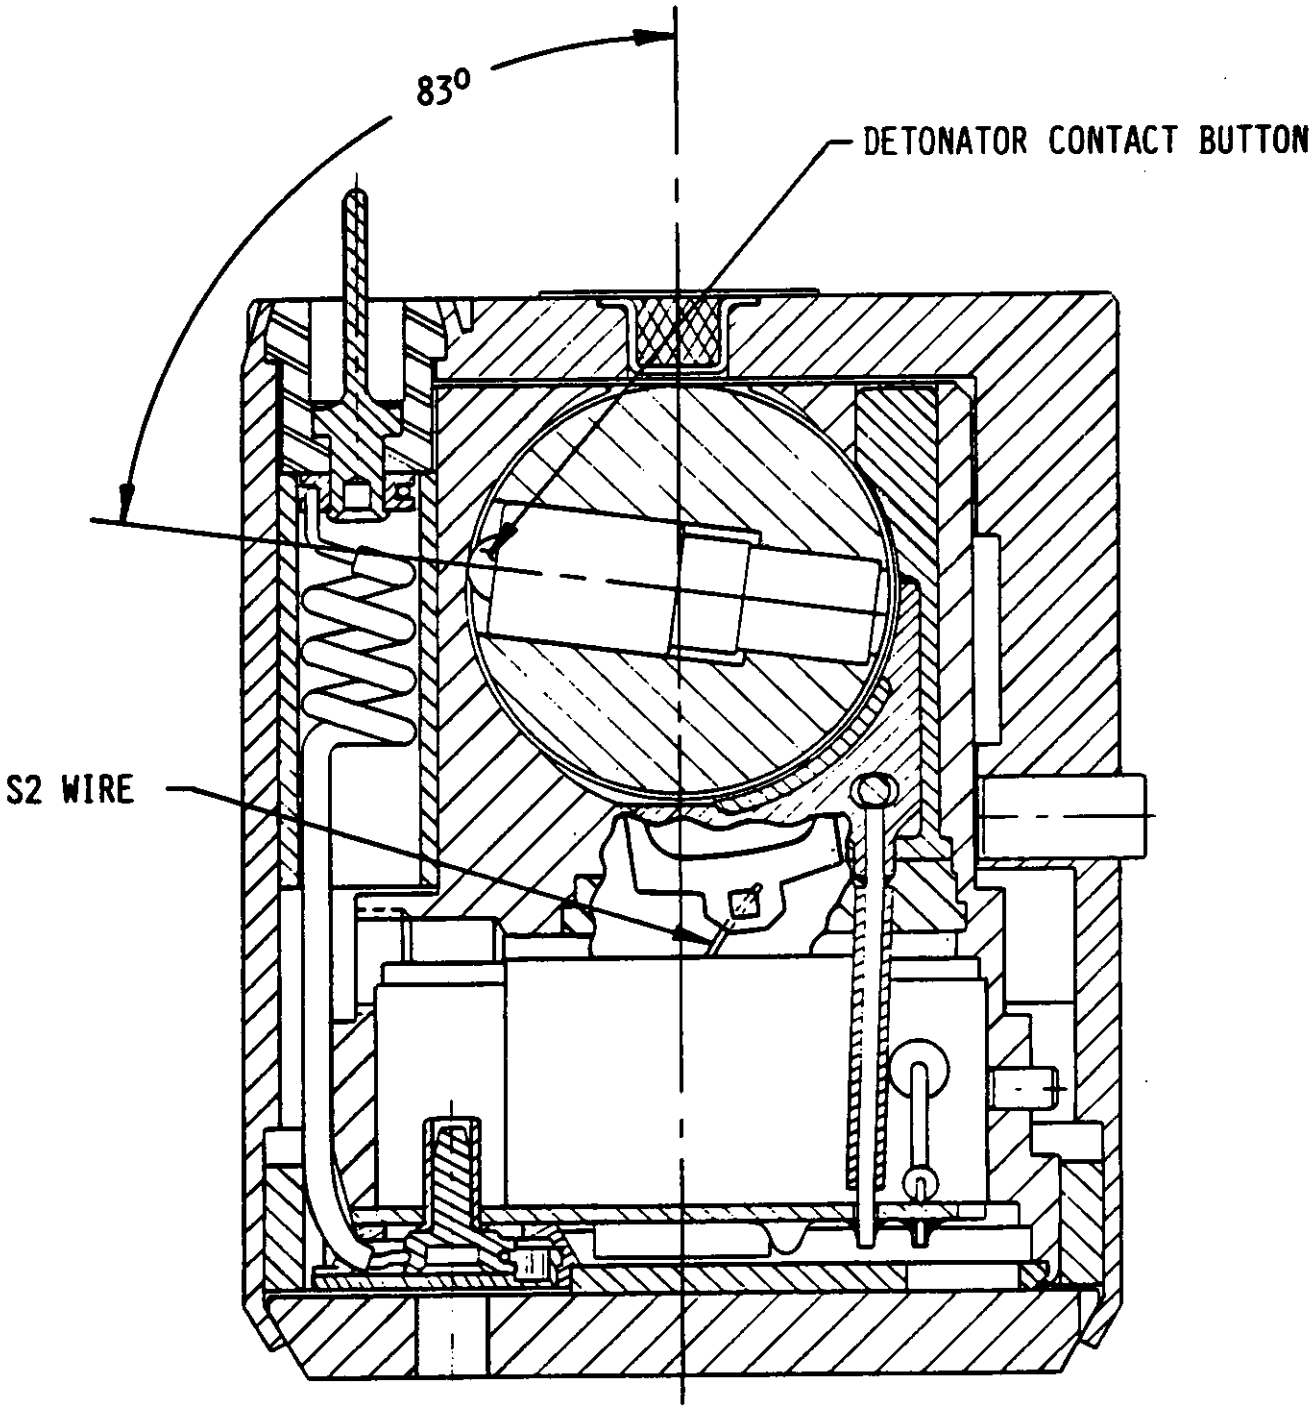


FIGURE 3

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

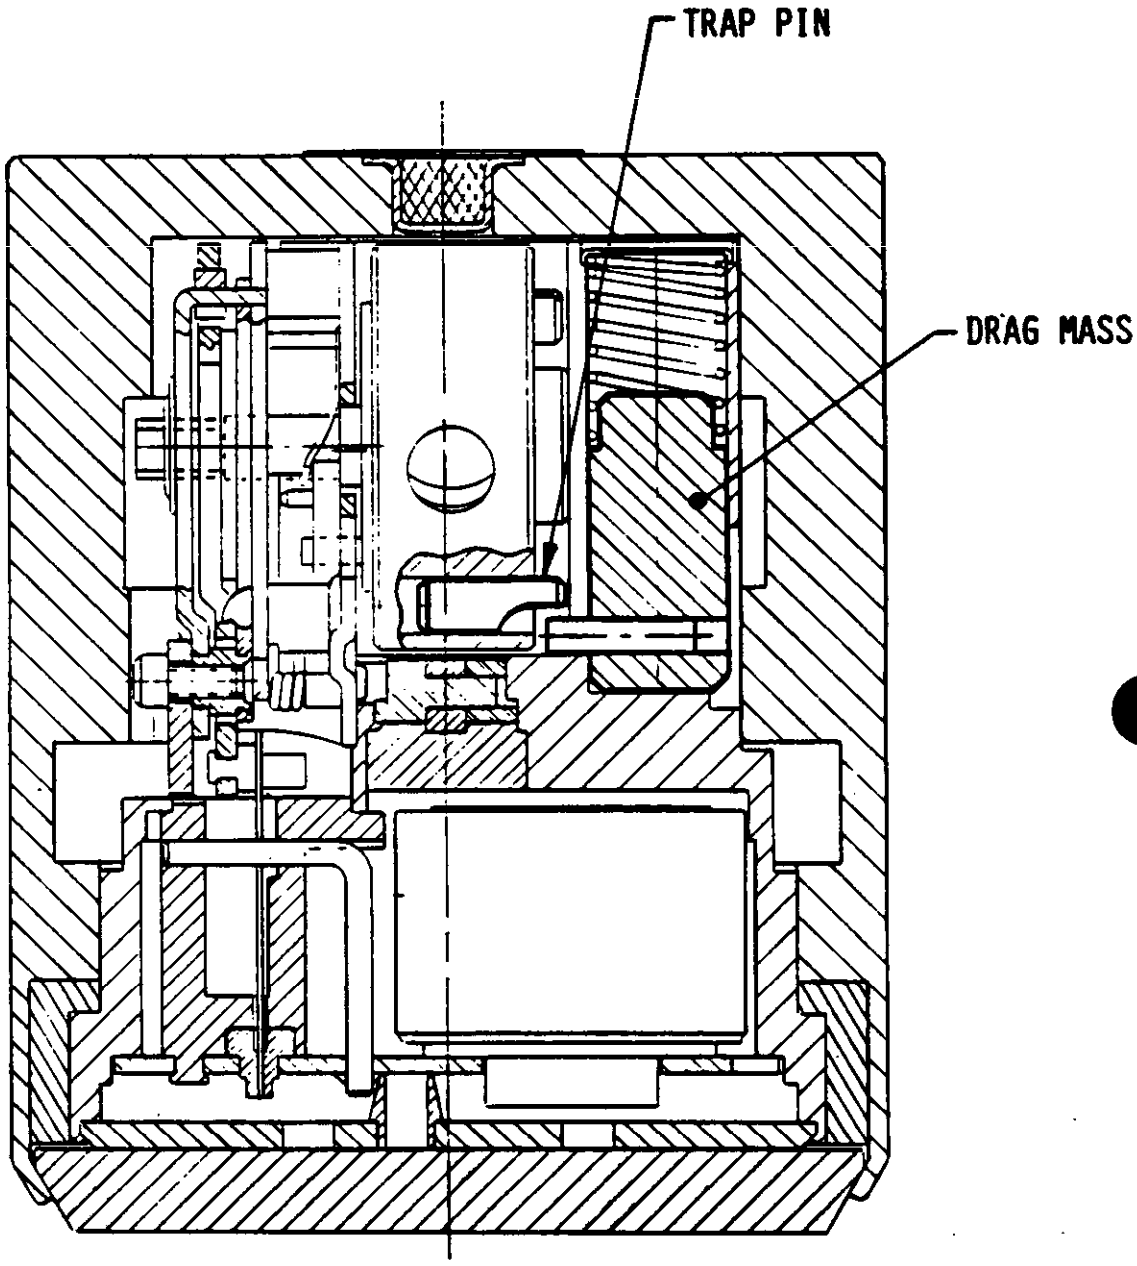


FIGURE 4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

Custodian:
ARMY-AR

Preparing Activity:
ARMY-AR

Project Number: 1390-A447

U.S. GOVERNMENT PRINTING OFFICE: 1988 - 505-038/22409

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:27Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

COMMANDER
US ARMY ARMAMENT MUNITIONS & CHEMICAL COMMAND
ATTN: DRSMC-QA
DOVER, NJ 07801 5001

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:27Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-F-63499 (AR)	DUZE, POINT INITIATING BASE DETONATING, XM764

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
	☐ USER
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil – Downloaded: 2026-02-26T04:27Z
Check the source to verify that this is the current version before use.