MIL-F-48057B(AR)
17 FEBRUARY 1981
SUPERSEDING
MIL-F-48057A(PA)
20 February 1975

MILITARY SPECIFICATION

FUZE, ROCKET, PIBD, M438 SUB-ASSEMBLY WITH DETONATOR

This specification is approved for use by the US Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the quality assurance provisions and special requirements not covered by the drawings for parts and assembly of the Fuze, Rocket, PIBD, M438 Sub-Assembly with Detonator, with option of one (1) of two (2) Power Supply Sources: Thermal Battery or Magnetic Impulse Generator (MIG).

1.2 Classification. The power supply option for the Fuze M438, covered by this specification shall be of the following types, as specified:

Type I, Fuze, Rocket, PIBD, M438 Sub-Assembly, Part No. 9259237, consisting of:

a. Power Supply Part No. 11707051 (Thermal Battery)
b. Safety and Arming Device, Part No. 11008351
c. Impact Switch, Part No. 11714370-2
d. Base Assembly, Part No. 9259250

Type II, Fuze, Rocket, PIBD, M438 Sub-Assembly, Part No. 11830059 consisting of:

a. Power Supply, Part No. 11830060 (Magnetic Impulse Generator)(MIG)
b. Safety and Arming Device, Part No. 11830062
c. Impact Switch, Part No. 11714370-2
d. Base Assembly, Part No. 11830052

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids, or request for proposals, form a part of this specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

MILITARY

MIL-D-45495	Detonator, Electric M84, Parts for and Loading, Assembling and packing.
MIL-A-48078	Ammunition, Standard Quality Assurance Provisions, General Specification for
MIL-P-60949	Power Supply Part 11707051

STANDARDS

MILITARY

MIL-STD-129	Marking for Shipment and Storage
MIL-STD-202	Test methods for electronic and electrical component parts
MIL-STD-331	Fuze and fuze components, environmental and performance tests
MIL-STD-810	Environmental Test Methods for Aerospace and Ground Equipment
MIL-STD-1167	Ammunition Data Card
MIL-STD-1460	Soldering of Electrical Connections and Printed Wiring Assemblies, Procedure for

DRAWINGS (SEE 6.7)

U.S. ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND (ARRADCOM)

9259237	Fuze, Rocket, PIBD, M438 Sub-Assembly with Detonator (Type I)
9259262	Fuze, Rocket, PIBD, M438 Sub-Assembly, with Detonator and Fuze Components
11830059	Fuze, Rocket, PIBD, M438 Sub-Assembly with Detonator (Type II)
11830060	Magnetic Impulse Generator Assembly (Type II)
11830062	Safety and Arming Device (Loaded) (Type II)

HARRY DIAMOND LABORATORIES

11008351	Safety and Arming Device (Loaded) (Type I)
11707051	Power Supply Assembly (Type I)
11714370	Impact Switch Assembly (Type I and Type II)

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement function should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposals shall apply.

CODE OF FEDERAL REGULATIONS

Title 49 - Transportation, parts 100-199

(The Code of Federal Regulations is available from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402. Orders shall specify 49 CFR 100-199).

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with applicable drawings, specifications and standards.

3.2 Components and assembly. The parts and assembly shall comply with all requirements specified on drawings (dwgs), 9259237, 9259262, 11830059 and associated drawings, and with all requirements specified in applicable specifications and standards for Type I and Type II, unless otherwise specified.

3.3 Safety and arming device (S&A). Dwg. 11008351 (Type I) or 11830062 (Type II). (References to "MIL-D-60953" on Type I S&A drawings shall be changed to "MIL-F-48057", wherever they occur.)

3.3.1 Non-arming. The device shall not release the power supply striker (Type I) or the release pin (Type II) nor shall the detonator rotate into line with the explosive train when any acceleration between zero and 12 g's is applied in any direction.

3.3.2 Arming. The device shall release the power supply striker (Type I) or the Release Pin (Type II) and the detonator shall rotate into line with the explosive train, and the arming detent shall engage the rotor when any acceleration between 27 and 40 g's is applied coincident with the longitudinal axis toward the open end of the Striker (Type I) or the release pin (Type II) housing.

3.3.3 Arming time.

3.3.3.1 Twenty-seven g. The time between the application of the acceleration and the arming of the device shall be between 1.23 and 1.70 seconds. The device shall meet this requirement at any temperature between minus 40 and plus 160 degrees F.

3.3.3.2 Forty g. The time between the application of acceleration and the arming of the device shall be between 1.03 and 1.35 seconds. The device shall meet this requirement at any temperature between minus 40 and plus 160 degrees F.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

3.3.4 Continuity (loaded armed condition). The resistance measured between the two solder terminals through the detonator with the rotor in the armed position shall be 3.5 ohms + 1.5 ohms. CAUTION - ANY CONTINUITY MEASUREMENT WHICH SHALL PASS ELECTRICAL CURRENT THROUGH THE DETONATOR SHALL BE LIMITED TO ONE MILLIAMPERE MAXIMUM.

3.3.5 Rotor reset capability. The rotor shall have the capability of automatically resetting itself to the extreme safe position whenever the rotational arming torque is removed after the rotor has traveled through an angle of rotation of up to 35 degrees from its starting position.

3.3.6 Insulation resistance, armed position, unloaded. The resistance measured between the ground and positive solder terminals of the switch shall be not less than 30 megohms at 500 volts.

3.3.7 Power supply striker release time (Type I only). When tested on a centrifuge the time between release of the setback weight and the release of the power supply striker shall be between .35 second minimum arming time and .40 second maximum. The device shall meet this requirement at any temperature between minus 40 and plus 160 degrees F and any acceleration between 27 and 40 g.

3.3.8 Release pin release time (Type II only). During the arming time tests the time between release of the setback weight and the release of the Release Pin shall be not less than 0.20 second or more than 0.85 second.

3.3.9 Setback weight return capability. The setback weight after being bottomed to the base of the main frame by a force of 20 lbs, applied equally to its two top surfaces and then released, shall return in a continuous motion to the fully safe position of locking the rotor.

3.3.10 Spring embrittlement. Neither the setback spring dwg. 11008392 nor the detent spring dwg. 11706267 shall break when extended to the point of minimum permanent distortion.

3.3.11 Spring set. The setback spring dwg. 11008392, after being subjected to a temperature of 175-180°F at a compressed length of .750 inch for 24 hours and then allowed to cool at ambient for 24 hours, shall return to .015 inch of its original free length.

3.4 Power supply. Dwg 11707051 (Type I) or 11830060 (Type II)

3.4.1 Type I only. The Power Supply shall meet all the applicable requirements of MIL-P-60949.

3.4.2 Type II only (MIG).

3.4.2.1 Spring Force. The force of the MIG spring measured at 0.125 inch compression shall be 6.50 pounds ± 1.00 pound.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

3.4.2.2 Energy storage capability. The MIG shall have the capability to store a minimum of 22 volts on the 1.5 MFD firing capacitor of the Base Assembly (11830052), within 20 milliseconds at ambient temperature.

3.4.2.3 Helicopter vibration. The MIG shall function as specified in 3.4.2.2 after subjection to the Helicopter Vibration Test in accordance with Appendix A.

3.5 Potted base assembly. Dwg 9259250 (Type I) or 11830052 (Type II)

3.5.1 Function. The electronic circuit shall function when a voltage of 18 to 32 VDC is applied to the input terminal of the assembly. The device shall meet this requirement at any temperature between minus 40 and plus 160 degrees F.

3.5.2 Non-function. The electronic circut shall not function when a voltage of 8.0 ± .5 VDC is applied to the input terminal. The device shall meet this requirement at any temperature between minus 40 and plus 160 degrees F.

3.5.3 Continuity test. The resistance measured between the green and black wires shall be 100 ± 10 ohms.

3.5.4 Capacitor discharge test (Type II only). The Capacitor, when charged to 22 volts, shall not discharge to less than 15 volts within 30 seconds at any temperature from -40° to +160°F.

3.6 Impact switch. Dwg. 11714370. The Impact Switch shall meet all the requirements of the Specification Control Drawing Part No. 11714370-2 with the exception of 3.1.3.

3.7 M84 electric detonator. The pin and plug assembly of the M84 electric detonator shall be of the glass bonded type, and shall meet all the requirements of MIL-D-45495 except no marking shall appear on the detonator. The sealant used on the plug end of the detonator shall not extend more than 0.030 inch up the pin from the glass seal.

3.8 Sub-assembly. Dwg 9259237 (Type I) or 11830059 (Type II)

3.8.1 Non-arm. The fuze sub-assembly shall not release the power supply striker (Type I) or the Release Pin (Type II) nor shall the detonator rotate into line with the explosive train when subjected to an acceleration of 12.0 ± 0.5 g's for a minimum of five (5) seconds.

3.8.2 Arming time. The rotor assembly of the S&A shall rotate from the fully safe position to the fully armed position and detent in not less than 1.03 seconds or more than 1.35 seconds when subjected to an arming acceleration of 40.0 ± .5 g's.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

3.8.3 Firing. The detonator of the fuze sub-assembly shall function after arming and application of an external voltage to the fuze firing circuit in the centrifuge.

3.8.4 Jumble. The sub-assembly assembled in a test fixture shall pass Test 102 of MIL-STD-331, except that the electric detonator and/or the striker (Type I) or the Release Pin (Type II) may initiate as long as this occurs with the rotor in the safe position. (See 6.5)

3.8.5 Jolt. The sub-assembly in a test fixture shall pass Test 101 of MIL-STD-331, except that the electric detonator and/or the striker (Type I) or the Release Pin (Type II) may initiate as long as this occurs with the rotor in the safe position. (See 6.5)

3.8.6 Vibration. The sub-assembly shall function as specified after subjection to the Helicopter Vibration Test in accordance with Appendix A.

3.8.7 Forty-foot drop. The complete fuze, warhead and motor assembly shall withstand the Forty-Foot Drop Test specified in MIL-STD-331. To satisfy the requirements of MIL-STD-331, the disassembled fuze must display the conditions listed in 6.5.

3.8.8 S&A position. The safe position of the S&A shall be verified just before insertion into the fuze body. After insertion of the S&A, fuze handling shall be controlled to preclude any chance of inadvertent arming or substitution of the S&A until assembly of the safe handling plug.

3.8.9 Five-foot drop. The fuze sub-assembly shall be safe to handle, fire, or dispose of following the five-foot drop test. It need not be operable and the electric detonator and/or the striker (Type I) or Release Pin (Type II) may initiate as long as this occurs with the rotor in the safe position.

3.9 Fuze performance. The fuzes, both Type I and Type II, shall comply with the following requirements prior to acceptance of the lot.

3.9.1 Fuze function. The fuze shall arm and cause the warhead to detonate upon impacting natural ground surface or target impact. The fuze shall meet this requirement at any temperature between minus 40 and plus 150°F.

3.9.2 Air bursts. There shall be no fuze function in the launcher or in flight before impact.

3.10 First article inspection. This specification contains technical provisions for First Article Inspection. Requirements for the submission of First Article Samples by the contractor shall be as specified in the contract.

3.11 Solder. Soldering shall be as specified in MIL-STD-1460.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

3.12 Workmanship.

3.12.1 Mechanical. All parts and assemblies shall be free from burrs, chips, sharp edges, cracks, unblended radii, surface blisters, excess flash, corrosion products, and other foreign matter. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agents. Surface coating shall be continuous except for a few slight scratches not exposing the base material. The loading and assembly operations shall be performed in a thorough, workmanlike manner consistent with the best practices of the industry. All required markings shall be neat and sharply defined.

3.12.2 Electrical. Cable assemblies and wires shall be dressed in such manner as to prevent pinching or chafing of the wire insulation. Ends of wires shall be free from burrs, sharp edges, or points. All parts shall be free from flux, chips, dirt, grease, rust, or foreign material.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The following types of inspection shall be conducted on this item.

a. First Article Inspection
b. Quality Conformance Inspection

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a First Article Sample as designated by the contracting officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated.

	Drawings		
Part Description	Type I	Type II	Quantity
Cup, Booster	9259244	9259244	10
Cup, Lead Booster	9259246	9259246	10
Sleeve	9259266	11830044	5/cavity
Sleeve, Fuze	9259239	9259239	10

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

Drawing (Continued)

Part Description	Type I	Type II	Quantity
Base Assy.	9259250	11830052	30
Power Supply Striker	11707120		10
Housing, Striker	11008372		10
Spring, Striker	11008365		10
Firing Pin Release Lever Assembly	11008364		10
Release Pin		11830038	10
Housing, Release Pin		11830045	10
Release Pin Lever Assembly		11830039	10
Rotor Assembly	11706269	11706269	30
Spring, Detent	11706267	11706267	10
Spring, Setback Weight	11008392	11008392	20
Main Frame Assembly	11008389	11008389	10
Escapement Gear and Pinion Assembly	11001692	11001692	25
Escapement Assembly	11008394	11830063	10
Gear & Pinion Assembly #1	11001687	11001687	25
Inner Plate Assembly	11008395	11008395	10
Gear & Pinion Assy. #2	11001689	11001689	25
Outer Plate Assembly	11008400	11008400	10
Lever Assembly	11706262	11706262	30
Safety & Arming Device	11706291	11830056	80
Safety & Arming Device	11008351	11830062	25
Bobbin Assembly		11830027	20
Spring, Armature		11830037	10

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

Drawing (Continued)

Part Description	Type I	Type II	Quantity
Magnetic Impulse Generator Asssembly		11830060	25
Power Supply	11707051		MIL-P-60949
Impact Switch Assembly	11714370	11714370	P/N 11714370-2
Fuze, Rocket, PIBD, M438, Sub-Assy w/Detonator	9259237	11830059	89
Fuze, Rocket, PIBD, M438, Sub-Assy w/Detonator and Fuze Components (Fuze Function Test)	9259262 (9259237)	9259262 (11830059)	32

The first article sample for the fuze function test shall be sent to a government designated facility to be loaded with a booster assembly in accordance with the latest drawings and specifications. The fuzes shall then be assembled to the appropriate rounds and fired in accordance with the applicable acceptance test procedures at a testing area designated in the contract.

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.

4.3.4 Process specification plastic parts. When a multiple cavity mold is used in the fabrication of plastic components, five (5) components from each mold cavity shall be included in the First Article Sample. The components shall bear a mark which identifies the component with the individual cavities.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 9		DRAWING NUMBER
	Fuze, Rocket, PIBD, M438 with Detonator and Components				listed below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Booster (Dwg. 9259244)				
	Examination for defects	10		3.2	4.4.2.1
	Cup, Lead Booster (Dwg. 9259246)				
	Examination for defects	10		3.2	4.4.2.2
	Sleeve (Dwg. 9259266 or 11830044)				
	Examination for defects	5/ cavity		3.2	4.4.2.3
	Sleeve, Fuze (Dwg. 9259239)				
	Examination for defects	10		3.2	4.4.2.4
	Base Assembly (Dwg. 9259250 or 11830052)				
	Examination for defects	30		3.2	4.4.2.5
	Function Test	30		3.5	4.5.4 (a,b)

NOTES:

a. Temperature condition a min of 4 hrs
b. Base assemblies to be tested at -40°F

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 9		DRAWING NUMBER listed below
	Fuze, Rocket, PIBD, M438 with Detonator and Components				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Fuze, Rocket, PIBD, M438 Sub-Assembly w/detonator (Dwg. 9259237 or 11830059)				
	Examination for defects	89		3.2	4.4.2.6
	S&A Position Check	89		3.8.8	4.5.10
	Jolt and Jumble	12		3.8	4.5.14/6.5
	Forty-Foot Drop	4		3.8.7	4.5.13/6.5
	Five-Foot Drop	25		3.8.9	4.5.16/6.5
	Helicopter Vibration	48		3.8.6	4.5.15
	Non-Arming	48(a)		3.8.1	4.5.17
	Arming	48(a)		3.8.2	4.5.17
	Firing	48(a)		3.8.3	4.5.17
	Fuze, Rocket, PIBD, M438 (Dwg. 9259262)				
	Fuze Function Test at +150°F	16		3.9	4.5.18(b)/6.6
	Fuze Function Test at -40°F	16		3.9	4.5.18(b)/6.6
	Power Supply Striker (Dwg. 11707120)				
	Examination for defects	10		3.2	4.4.2.9
	Housing, Striker (Dwg. 11008372)				
	Examination for defects	10		3.2	4.4.2.10

NOTES:

a. Samples taken from Helicopter Vibration.
b. Temperature condition a min. of 4 hrs.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE			SHEET 3 OF 9	DRAWING NUMBER
	Fuze, Rocket, PIBD, M438 with Detonator and Components				listed below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Spring, Striker (Dwg. 11008365)				
	Examination for defects	10		3.2	4.4.2.11
	Load at Comp. length .490 in.	10		3.2	4.4.2.11
	Load at Comp. length .765 in.	10		3.2	4.4.2.11
	Firing Pin Release Lever Assembly (Dwg. 11008364)				
	Examination for defects	10		3.2	4.4.2.12
	Push off test	10		3.2	Gage/Dwg Note
	Release Pin (Dwg. 11830038)				
	Examination for defects	10		3.2	4.4.2.13
	Housing, Release Pin (Dwg. 11830045)				
	Examination for defects	10		3.2	4.4.2.14
	Release Pin Lever Assembly (Dwg. 11830039)				
	Examination for defects	10		3.2	4.4.2.15
	Push off test	10		3.2	Test Fixture/Dwg Note

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 4 OF 9		DRAWING NUMBER
	Fuze, Rocket, PIBD, M438 with Detonator and Components				listed below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Rotor Assembly (Dwg. 11706269)				
	Examination for defects	30		3.2	4.4.2.16
	Annular gear pull off test	10		3.2	4.5.5.1
	Lock roller push off test	10		3.2	4.5.5.2
	Lever pin pull off test	10		3.2	4.5.5.12

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 5 OF 9		DRAWING NUMBER listed below
	Fuze, Rocket, PIBD, M438 with Detonator and Components				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Escapement Gear & Pinion Assembly (Dwg. 11001692)				
	Examination for defects	25		3.2	4.4.2.17
	Push off test	25		3.2	4.5.5.6
	Gear & Pinion Assembly #1 (Dwg. 11001687)				
	Examination for defects	25		3.2	4.4.2.18
	Push off test	25		3.2	4.5.5.4
	Gear & Pinion Assembly #2 (Dwg. 11001689)				
	Examination for defects	25		3.2	4.4.2.19
	Push off test	25		3.2	4.5.5.5
	Main Frame Assembly (Dwg. 11008389)				
	Examination for defects	10		3.2	4.4.2.21
	Load test of spring stud	10		3.2	4.5.5.3
	Escapement Assembly (Dwg. 11008394 or 11830063)				
	Examination for defects	10		3.2	4.4.2.22
	Load test of pillars	10		3.2	4.5.5.9

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)

PARAGRAPH	TITLE		SHEET 6 OF 9		DRAWING NUMBER
	Fuze, Rocket, PIBD, M438 with Detonator and Components				listed below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Inner Plate Assembly (Dwg. 11008395)				
	Examination for defects	10		3.2	4.4.2.23
	Load test of bridge rivet	10		3.2	4.5.5.10

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 7 OF 9		DRAWING NUMBER listed below
	Fuze, Rocket, PIBD, M438 with Detonator and Components				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Outer Plate Assembly (Dwg. 11008400)				
	Examination for defects	10		3.2	4.4.2.24
	Load test of lock spring stud	10		3.2	4.5.5.11
	Lever Assembly (Dwg. 11706262)				
	Examination for defects	30		3.2	4.4.2.20
	Shaft torque test	15		3.2	4.5.5.7
	Pallet lever push off test	15		3.2	4.5.5.8
	Safety & Arming Device (unloaded) (Dwg. 11706291 or 11830056)				
	Examination for defects	80		3.2	4.4.2.25
	Non-Arm	80		3.3.1	4.5.11.2.1 or 4.5.11.2.2
	Arm Time (27 g's)	40		3.3.3	4.5.11.3
	Arm Time (40 g's)	40		3.3.3	4.5.11.4
	Insulation Resistance	80		3.3.6	Megohmmeter
	Setback weight return capability	80		3.3.9	4.5.6
	Rotor reset capability	80		3.3.5	4.5.7
	Safety & Arming Device (loaded) (Dwg. 11008351 or 11830062)				
	Examination for defects	25		3.2	4.4.2.27
	Circuit Continuity	25		3.3.4	4.5.8
	Non-Arming	25		3.3.1	4.5.11.3

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 8 OF 9		DRAWING NUMBER listed below
	Fuze, Rocket, PIBD, M438 with Detonator and Components				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Bobbin Assembly (Dwg. 11830027) Examination for defects	20		3.2	4.4.2.28

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 9 OF 9		DRAWING NUMBER listed below
	Fuze, Rocket, PIBD, M438 with Detonator and Components				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Spring, Armature (Dwg. 11830037)				
	Examination for defects	10		3.2	4.4.2.29
	Load deflection	10		3.4.2.1	4.5.12.2
	Magnetic Impulse Generator Assy (Dwg. 11830060)				
	Examination for defects	25		3.2	4.4.2.30
	Helicopter vibration	25		3.4.2.3	4.5.12.1
	Energy storage capacity	25		3.4.2.2	4.5.12.3
	Spring, Detent (Dwg. 11706267)				
	Examination for defects	10		3.2	4.4.2.8
	Spring embrittlement	10		3.3.10	4.5.1.1
	Spring, Setback Weight (Dwg. 11008392)				
	Examination for defects	20		3.2	4.4.2.3.31
	Spring embrittlement	10		3.3.10	4.5.1.1
	Setback weight spring set	10		3.3.11	4.5.1.2

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of M438 fuze sub-assemblies shall contain:

a. M-84 detonators of one lot interfix number from one manufacturer.
b. Impact switches of one lot interfix number from one manufacturer.
c. Magnets from one manufacturer (Type II only).
d. Safety and arming devices from not more than two lots.

4.4.2 Examination. See MIL-A-48078

a. Sampling plans. Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans for Major and Minor Defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9259244 9259244
4.4.2.1	Cup, Booster		NEXT HIGHER ASSEMBLY 9259254 9259254

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	Splits, Tears or Fractures		100%	3.2	Visual
Major					
101	Outside Diameter		0.40%	3.2	Gage
102	Inside Diameter		0.40%	3.2	Gage
Minor					
201	Length (min.)		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9259246 9259246
4.4.2.2	Cup, Lead Booster				NEXT HIGHER ASSEMBLY 9259254 9259254
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major B					
101	Outside Diameter		0.40%	3.2	Gage
102	Diameter of lead cavity (max.)		0.40%	3.2	Gage
103	Depth of lead cavity min.		0.40%	3.2	Gage
104	Length, max.		0.40%	3.2	Gage
Minor					
201	Protective finish missing or damaged		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9259266 11830044
4.4.2.3	Sleeve				NEXT HIGHER ASSEMBLY 9259237 11830059
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major 101	Mold Inspection	5/ cavity		3.2	4.5.3
Minor 201	Evidence of poor workmanship		.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9259239 9259239
4.4.2.4	Sleeve, Fuze		NEXT HIGHER ASSEMBLY 9259262 9259262

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside Diameter (max.)		0.40%	3.2	Gage
103	Inside Diameter (min.)		0.40%	3.2	Gage
104	Straightness of sleeve wall		0.40%	3.2	Gage
Minor					
201	Protective finish missing or damaged		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.5	Base Assembly		9259250 11830052
			NEXT HIGHER ASSEMBLY 9259237 11830059

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Function Test		100%	3.5	4.5.4
102	Potting above top edge of housing or incompletely covering components		0.40%	3.2	Visual
103	Orientation of wires		0.40%	3.2	Visual
104	Height of pins		0.40%	3.2	Gage
105	Seal Missing		0.40%	3.2	Visual
Minor					
201	Wires damaged		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.6	Fuze, Rocket, PIBD, M438 Sub-Assembly	1	1	9259237 11830059
				NEXT HIGHER ASSEMBLY 9259262 9259262

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Jolt	12		3.8.5	4.5.14
2	Jumble	12		3.8.4	4.5.14
3	S&A position check		100%	3.8.8	4.5.10
4	Helicopter vibration	48		3.8.6	4.5.15
5	Non-Arming	48(a)		3.8.1	4.5.17
6	Arming Time Min.	48(a)		3.8.2	4.5.17
7	Five-Foot Drop	15		3.8.9	4.5.16/6.6
8	Forty-Foot Drop (b)	4		3.8.7	4.5.13/6/6
Major					
101	Shipping plug missing or not secured		100%	3.2	Visual
102	Detonator shield improperly assembled		100%	3.2	Visual
103	Ring shield improperly assembled		100%	3.2	Visual
104	Improper wiring		0.40%	3.2	Visual
105	No clearance between power supply terminal & annular gear (prior to assembly of detonator shield)		0.40%	3.2	Visual
106	Arming Time Max.	48(a)		3.8.2	4.5.17
107	Firing	48(a)		3.8.3	4.5.17
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

a. Samples taken from Helicopter Vibration
b. First Article only

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9259262 9259262
4.4.2.7	Fuze, Rocket, PIBD, M438 Destructive Lot Acceptance Test				NEXT HIGHER ASSEMBLY 9258192 9258192
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Fuze Function Test at +150°F	16		3.9	4.5.18(a)/6.6
102	Fuze Function Test at -40°F	16		3.9	4.5.18(a)/6.6
Minor	None Defined				

NOTES:
a. Temperature condition a min. of 4 hrs.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMACE INSPECTION

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11706267 11706267
4.4.2.8	Spring, Detent				NEXT HIGHER ASSEMBLY 11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Spring embrittlement	10	(a)	3.3.10	4.5.1.1
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:
(a) If one or more springs are found defective, the spring lot shall be rejected.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11707120
4.4.2.9	Power Supply Striker (Type I only)				NEXT HIGHER ASSEMBLY 11008351
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
Major					
101	Large diameter (max.)		0.40%	3.2	Gage
102	Large diameter (min.)		0.40%	3.2	Gage
Minor					
201	Chamfer on large dia. (max.)		0.65%	3.2	Gage
202	Chamfer on large dia. (min.)		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008372
4.4.2.10	Housing Striker (Type I only)				NEXT HIGHER ASSEMBLY 11706295
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Spring hole diameter (max.)		0.40%	3.2	Gage
102	Spring hole diameter (min.)		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008365
4.4.2.11	Spring, Striker (Type I only)				NEXT HIGHER ASSEMBLY 11008351
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Load at comp. length .490 in. .125 dia hole over a .065 pin		0.40%	3.2	Gage/Dwg Note
102	Load at comp. length .765 in. .125 dia hole over a .065 pin		0.40%	3.2	Gage/Dwg Note
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008364
4.4.2.12	Firing Pin Release Lever Assembly (Type I only)				NEXT HIGHER ASSEMBLY 11706295
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Angle of flat $10^{0} + 2^{0} -1^{0}$		0.40%	3.2	Gage
102	Push off test		0.40%	3.2	Gage/Dwg Note
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11830038
4.4.2.13	Release Pin (Type II only)				NEXT HIGHER ASSEMBLY 11830062
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Pin O.D. (small end)		0.40%	3.2	Gage
102	Length from End of Pin to Shoulder		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11830045
4.4.2.14	Housing, Release Pin (Type II only)				NEXT HIGHER ASSEMBLY 11830053
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Thru hole inside diameter		0.40%	3.2	Gage
102	True position of threaded holes		0.40%	3.2	Gage
103	Symmetry of milled slot		0.40%	3.2	Gage
104	True position of release pin lever hole		0.40%	3.2	Gage
105	Release pin lever counterbore depth		0.40%	3.2	Gage
106	Diameter of node		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11830039
4.4.2.15	Release Pin Lever Assembly (Type II only)				NEXT HIGHER ASSEMBLY 11830053
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Push Off Test		0.40%	3.2	Test Fixture/Dwg Note
102	Angle of centerline of hook to flat on shaft		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11706269 11706269
4.4.2.16	Rotor Assembly				NEXT HIGHER ASSEMBLY 11706291 11830056
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Annular gear pull off test		100%	3.2	Test Fixture/4.5.5.1
Major					
101	Lock roller push off test		0.40%	3.2	Test Fixture/4.5.5.2
102	Length of terminal pins (max.)		0.40%	3.2	Gage
103	Lever Pin pull off test		0.40%	3.2	Test Fixture/4.5.5.12
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.2.17	Escapement Gear & Pinion Assembly		1 1		11001692 11001692
					NEXT HIGHER ASSEMBLY
					11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Push off test		100%	3.2	Test Fixture/4.5.5.6
Major	None Defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11001687 11001687
4.4.2.18	Gear & Pinion Assembly #1				NEXT HIGHER ASSEMBLY 11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical 1	Push off test		100%	3.2	Test Fixture/4.5.5.4
Major	None Defined				
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11001689 11001689
4.4.2.19	Gear & Pinion Assembly #2				NEXT HIGHER ASSEMBLY 11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical 1	Push off test		100%	3.2	Text Fixture/4.5.5.5
Major	None Defined				
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 11706262 11706262
4.4.2.20	Lever Assembly		NEXT HIGHER ASSEMBLY 11008394 11830063

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Shaft torque test		100%	3.2	Test Fixture/4.5.5.7
2	Pallet lever push off test		100%	3.2	Test Fixture/4.5.5.8
Major	None Defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48057B(AR)
TYPE I TYPE II

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008389 11008389
4.4.2.21	Main Frame Assembly				NEXT HIGHER ASSEMBLY 11706291 11830056
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major 101	Load test of spring stud		0.40%	3.2	4.5.5.3
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.22	Escapement Assembly	1	1	11008394 11830063
				NEXT HIGHER ASSEMBLY
				11706291 11830056

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major 101	Load test of pillars		0.40%	3.2	4.5.5.9
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

MIL-F-48057B(AR)
TYPE I TYPE II

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008395 11008395
4.4.2.23	Inner Plate Assembly				NEXT HIGHER ASSEMBLY 11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major 101	Load test of bridge rivet		0.40%	3.2	4.5.5.10
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008400 11008400
4.4.2.24	Outer Plate Assembly				NEXT HIGHER ASSEMBLY 11008394 11830063
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major 101	Load Test of Lock Spring Stud		0.40%	3.2	4.5.5.11
Minor 201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 11706291 11830056
4.4.2.25	Safety & Arming Device (Unloaded)		NEXT HIGHER ASSEMBLY 11706290 11830058

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Gap between Annular Gear and #2 Gear, Max.		100%	3.2	Gage/Drawing Note
2	Setback weight return capability		100%	3.3.9	4.5.6
3	Rotor reset capability		100%	3.3.5	4.5.7
Major					
101	.115 dia. pin shall not pass release lever with S&A in safe position (device without firing pin and spring installed for Type I)		0.40%	3.2	Gage
102	Frame outside diameter (Max.)		0.40%	3.2	Gage
103	No rotor freedom in "safe position"		0.40%	3.2	Visual
104	Release lever spring damaged or not hooked (Type I only)		0.40%	3.2	Visual
105	Height, top of striker housing to inside bottom of main frame, max. (Type I only)		0.40%	3.2	Gage
106	Insulation resistance		0.40%	3.3.6	Megohmmeter
107	Dimension bet annular and No. 2 gears		0.40%	3.2	Gage
108	Lubricant missing		0.40%	3.2	Visual
109	Non-Arm Test		100%	3.3.1	4.5.11.2.1 or 4.5.11.2.2
110	Arm Time Test		100%	3.3.3	4.5.11.4
111	Arm Time Test		0.40%	3.3.3	4.5.11.3
Minor					
201	Screws not staked		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.26	Safety & Arming Device, Less Power Supply Striker Assy (Type I) or Release Pin (Type II)	1	1	11706290 11830058
				NEXT HIGHER ASSEMBLY
				11008351 11830062

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Detonator improperly assembled		0.40%	3.2	Gage & visual
102	Circuit Continuity		100%	3.3.4	4.5.8
Minor	None Defined				

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 11008351 11830062
4.4.2.27	Safety & Arming Device Assembly				NEXT HIGHER ASSEMBLY 9259237 11830059
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Non-Arming (a)		100%	3.3.1	4.5.11.3
102	Power Supply striker improperly assembled (Type I only)		100%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

a. Only when S&A is packaged separately

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.28	Bobbin Assembly (Type II only)	1 OF 1	11830027
			NEXT HIGHER ASSEMBLY 11830057

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Inside diameter (min.)		0.40%	3.2	Gage
102	Outside diameter (max.)		0.40%	3.2	Gage
103	Overall length		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.29	Spring, Armature (Type II only)	1	1	11830037
				NEXT HIGHER ASSEMBLY 11830057

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Free length		0.40%	3.2	Gage
102	Load deflection		0.40%	3.4.2.1	14.5.12.2
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.30	Magnetic Impulse Generator Assy (Type II only)	1	1	11830060
				NEXT HIGHER ASSEMBLY 11830059

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Energy storage capacity		0.40%	3.4.2.2	4.5.12.3
102	Helicopter vibration	15		3.4.2.3	4.5.12.1
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 11008392 11008392
4.4.2.31	Spring, Setback Weight		NEXT HIGHER ASSEMBLY 11706291 11830056

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Spring embrittlement	10	(a)	3.3.10	4.5.1.1
102	Setback weight spring set	10	(a)	3.3.11	4.5.1.2
Minor					
201	Evidence of poor workmanship		0.65%	3.12	Visual

NOTES:

(a) If one or more springs are found defective, the spring lot shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables and the applicable parts of MIL-P-60949 and P/N 11714370-2.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in 4.5 and in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See section 6 of MIL-A-48078 and section 6.3 herein. The contractor shall submit all inspection equipment designs to the government for evaluation and approval prior to fabrication of such inspection equipment.

4.4.4.1 Contractor inspection system. As part of contractor's approved quality procedure, there shall be a provision for checking the adequacy of inspections made in connection with listed critical or major defects. These procedures shall include the following provisions:

4.4.4.1.1 Handling procedure. A Design Agency approved procedure shall be instituted that shall preclude unauthorized handling of the S&A's and fuzes from the S&A position check until the safe handling plug has been installed. The procedure shall be fail safe to eliminate armed fuzes from being introduced in the lot. Fail safe is defined as follows: Any equipment failure shall operate to cause rejection of the part or otherwise prevent its subsequent use.

4.4.4.1.2 Indentification of rejected material. All material listed below, rejected as containing defects, shall be isolated to preclude its inclusion with acceptable material:

a. A sub-assembly which fails the requirements of 4.5.13, 4.5.14 or 4.5.16.
b. A S&A which fails the requirements of 4.5.6, 4.5.7, 4.5.8, 4.5.9, 4.5.10 or 4.5.11.
c. A base assembly which fails the requirements of 4.5.4.
d. A MIG which fails the requirements of 4.5.12.

4.4.4.2 Use of simulated defect standards. The following listed verified inspections shall be validated and inspection equipment verified once per shift using Design Agency approved item facsimilies or standards containing the defects and supplied by the contractor. The contractor shall resupply the item facsimilies when it is determined by the Government that the facsimilies are no longer representative enough of the product to make it unidentifiable to the contractor inspection personnel, or it is not functioning in the necessary manner and cannot be corrected satisfactorily. These standards should be

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

inert and readily identifiable to the Government to ensure recovery should they be inadvertently introduced into production. Simulated defect standards used to verify the following verified inspections should be constructed and identified in such a manner that they are not readily recognizable to the contractor inspection personnel as defect standards. Standards should be used so that their number, time and sequence of introduction into the inspection cycle is known only to those personnel responsible for checking the accuracy of the operation. Adequacy of the standards shall be verified at least once each week.

VERIFIED INSPECTION

Paragraph 4.5.10 - S&A Position Check
Paragraph 4.5.6 - Setback Weight Return Capability

NOTE: When there is automatic detection and automatic rejection of defective items to a controlled area or a controlled rejection of defective items, it is permissible for the defect standards to be identifiable and their introduction into production noticeable to contractor inspection personnel.

4.4.4.3 Undected defect standards. Provisions shall be established for the corrective action to be taken where the equipment or contractor inspection personnel fail to identify a standard as defective. These provisions shall include a reinspection of all acceptable material subsequent to the last acceptable verification check as a minimum.

4.5 Test methods and procedures.

PRECAUTION: This specification covers sampling and testing of chemical, toxic or explosive materials which are potentially hazardous to personnel. Accordingly, it is emphasized that all applicable safety rules, regulations and procedures must be followed in handling and processing these materials.

4.5.1 Spring tests.

4.5.1.1 Spring embrittlement. The spring shall be stretched along its longitudinal axis in the case of a coil spring, or bent in the case of a flat spring until the spring no longer returns to its original position. When the spring no longer returns to its original length or profile, it shall be considered distorted permanently. Any spring that breaks prior to this point shall be classed defective.

4.5.1.2 Setback weight spring set. The springs shall be measured at their original free length, assembled in a restraining fixture in accordance with 4.4.4 and compressed to a normal height of .750 inch, placed in an oven and subjected to a temperature of not more than 180 degrees Fahrenheit (F^{o}) or less than $175^{o}F$ for 24 hours. The springs shall be removed from the oven and be cooled to ambient temperature. After cooling the springs for 24 hours minimum, the springs shall be measured and the measurement shall be compared to the original free length to ascertain compliance with the specified requirement. Any spring that fails the requirement shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.2 Check test for deterioration of detonators. If the total time between original acceptance of any detonator lot and the assembly of that lot into the fuzes exceeds two years, at any time since previous tests, the detonator lot shall be subjected to and must satisfactorily pass the functioning and output tests specified in MIL-D-45495 immediately before the detonator lot is assembled into the fuzes. The test shall be performed by the contractor on detonators randomly selected by a Government Inspector. The test shall be conducted at Government expense without cost to the contractor who loaded the detonators or the contractor who is to assemble the detonators into the fuzes. The test shall not constitute a basis for fuze lot rejection against either contractor except where deterioration has occurred as a direct result of carelessness in handling, storage, etc., permitted while the detonator lot was under the jurisdiction of either contractor.

4.5.3 Dimensional control of molded or plastic parts. After continuous production of each 5000 components from each cavity of each mold, five components per cavity per mold shall be consecutively produced and inspected for all drawing requirements. If any part fails to meet all drawing requirements, production shall be stopped and the mold corrected. During production the molding procedure shall be monitored for uniformity of molding practices.

4.5.4 Base assembly function test.

a. A Power Supply is required to perform the respective electronic circuit function and non-function tests for Type I and Type II.

b. Resistance shall be tested in accordance with method 303 of MIL-STD-202.

c. Any base assembly that fails to meet the requirements of 3.5 shall be classed defective.

4.5.5 S&A mechanical tests.

4.5.5.1 Pull off test of annular gear. Apply a load perpendicular to the rotor and in such a direction as to test the assembly of the annular gear pins to the annular gear and the rotor. The resistive force shall act against the rotor. Any annular gear that fails the drawing requirement shall be classed defective.

4.5.5.2 Push off test of lock roller pin. Apply an axial load perpendicular to the rotor and in such a direction as to test the strength of the assembly of the lock roller pin to the rotor. The resistive force shall act against the rotor. Any lock roller pin that fails the drawing requirement shall be classed defective.

4.5.5.3 Load test of spring stud. Apply an axial load perpendicular to the main frame and in such a direction as to test the assembly of the spring stud and the main frame. The resistive force shall act against the rotor housing. Any spring stud that fails the drawing requirement shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.5.4 Load test of No. 1 gear and pinion assembly. Apply an axial load perpendicular to the No. 1 gear and in such a direction as to test the assembly of the No. 1 gear and pinion. The resistive force shall act against the No. 1 gear. Any No. 1 gear and pinion assembly that fails the drawing requirement shall be classed defective.

4.5.5.5 Load test of No. 2 gear and pinion assembly. Apply an axial load, perpendicular to the No. 2 gear and in such a direction as to test the assembly of the No. 2 gear and pinion. The resistive force shall act against the No. 2 gear. Any No. 2 gear and pinion assembly that fails the drawing requirement shall be classed defective.

4.5.5.6 Load test of escapement gear and pinion assembly. Apply an axial load perpendicular to the escapement gear and in such a direction as to test the assembly of the escapement gear and pinion. The resistive force shall act against the escapement gear. Any escapement gear and pinion assembly that fails the drawing requirement shall be classed defective.

4.5.5.7 Torque test of lever shaft. Apply a torque parallel to the shaft so as to test the resistance to radial motion between the lever and the shaft. Any lever shaft that fails the drawing requirement shall be classed defective.

4.5.5.8 Load test of lever pallet. Apply an axial load perpendicular to the lever and in such a direction as to test the assembly of the lever and the lever pallet. The resistive force shall act against the lever. Any lever pallet that fails the drawing requirement shall be classed defective.

4.5.5.9 Load test of pillars. Apply an axial load perpendicular to the inner plate and in such a direction as to test the assembly of the pillars to the inner plate and outer plate. The resistive force shall act against the inner plate. Any pillars that fail the drawing requirement shall be classed defective.

4.5.5.10 Load test of bridge rivet. Apply an axial load perpendicular to the inner plate and in such a direction as to test the assembly of the inner plate and bridge. The resistive force shall act against the bridge. Any bridge rivet that fails the drawing requirement shall be classed defective.

4.5.5.11 Load test of lock spring stud. Apply an axial load perpendicular to the outer plate in such a direction as to test the assembly of the outer plate and lock stud assembly. The resistive force shall act against the outer plate. Any lock spring stud that fails the drawing requirement shall be classed defective.

4.5.5.12 Load test of lever pin. Apply an axial load perpendicular to the rotor in such a direction as to test the lever pin and rotor assembly. This resistive force shall act against the rotor. Any lever pin that fails the drawing requirement shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.6 Setback weight return capability. The S&A in the safe position shall be assembled to the test equipment in accordance with 4.4.4. The S&A shall be securely held in place during a 20 pound load test with a hold down force. The 20 pound load shall be applied at an average rate of 300 ± 50 inches per minute to the setback weight. It is mandatory that the setback weight maintain contact with the 20 pound load applicator until fully bottomed. The 20 pound force shall then be removed. S&A's failing to completely return to the fully safe position shall be classed defective and removed from the lot. Defect standards for verification of the inspection process shall be in accordance with 4.4.4.2 and 4.4.4.3. Defect standards for use with automatic equipment shall be as follows:

a. Units with setback weights which bind when depressed and remain in the depressed condition.

b. Units with setback weights which start to return but do not completely return to the original locking position.

c. Units with setback weights which return from the depressed condition at a slower than the normal rate causing rejection.

4.5.7 Rotor reset capability. The loaded S&A device shall be assembled to the test fixture. The rotor shall be rotated to a position at least 30°, but not more than 35°, from the fully safe position. The rotor shall return to the fully safe position without any assistance. Any S&A that fails to meet the requirement shall be classed defective.

4.5.8 Continuity. The resistance of the loaded S&A will be measured between the two soldered terminals through the detonator with the rotor in the armed position. The resistance shall be 3.5 ohm ± 1.5 ohm. The resistance shall be measured with test equipment which will not pass more than 1 milli-ampere. Any S&A that fails to meet the requirement shall be classed defective.

4.5.9 Insulation resistance. The isulation resistance of the unloaded S&A, in the armed position, measured between the ground and positive terminals of the switch, shall be not less than 30 megohms at 500 VDC. Standard measuring equipment may be used for this test. Any S&A that fails to meet the requirement shall be classed defective.

4.5.10 S&A position check. The S&A position, before insertion into the subassembly, shall be inspected. Any armed S&A shall be considered defective and removed from the lot, and the assembly operation shall be halted until operation is corrected to Government satisfaction. The inspection shall be performed to the requirements of 3.8.8 using procedures in accordance with 4.4.4.2 and 4.4.4.3 and equipment in accordance with paragraph 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

Defect standards with semi-armed and fully armed conditions shall be introduced at various times to verify test performance. The Design Agency approved handling procedure to preclude untested S&A's from being introduced into the fuze prior to the safe handling plug being installed shall also be assessed when the standards are introduced. If an improper procedure is being used as determined by the Government, all fuzes accepted subsequent to the last acceptable handling procedure assessment shall be screened as determined by the Government.

4.5.11 S&A function test.

4.5.11.1 Equipment. The S&A shall be tested in a horizontal type centrifuge. The length from the center of rotation to the aft end of the setback weight shall be greater than 10 inches. The S&A shall be fixtured to orient the striker housing (Type I) or the release pin housing (Type II) toward the center of rotation along the longitudinal axis. The fixture will provide a device for holding the setback weight captive, which can be released when the specified "g" limits are reached. This test equipment shall be capable of operation at temperatures of ambient, -40°F and 160°F, with a tolerance of ± 5°, and with an acceleration tolerance of ± .10 g. Time measuring equipment shall be accurate within ± 0.01 second.

4.5.11.2 Non-arming.

4.5.11.2.1 Non-arming (Type I only). The device containing a power supply striker and spring but no explosives shall be placed in the centrifuge and tested at 12 g for five seconds. The device shall meet the requirements of 3.3.1. Any S&A that fails to meet the requirement shall be classed defective.

4.5.11.2.2 Non-arming (Type II only). Each unloaded S&A with dummy Release Pin and the Release Pin lever latched, in a spring loaded fixture which simulates the MIG spring, upon release of the setback weight, shall not release the Release Pin nor shall the rotor rotate into the armed position when subjected to an acceleration of 12 g's for a minimum of 5 seconds. Any S&A that fails to meet the requirement shall be classed defective.

4.5.11.3 Non-arming before packaging. The device completely assembled shall be tested in the centrifuge at 12 g for five seconds. The device shall meet the requirements of 3.3.1. Any S&A that fails to meet the requirements shall be classed defective.

4.5.11.4 Arming 27 g's. Each S&A shall be tested as in 4.5.11.2.1 or 4.5.11.2.2 except that the rotor shall rotate from the fully safe position to the fully armed and detented position and meet the timing requirements of 3.3.3 and 3.3.7 (Type I) or 3.3.8 (Type II) when subjected to an acceleration of 27 g's. Any S&A that fails to meet the requirement shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.11.5 Arming 40 g's. Each S&A shall be tested as in 4.5.11.2.1 or 4.5.11.2.2 except that the rotor shall rotate from the fully safe position to the fully armed and detented position and meet the timing requirements of 3.3.3 and 3.3.7 (Type I) or 3.3.8 (Type II) when subjected to an acceleration of 40 g's. Any S&A that fails to meet the requirement shall be classed defective.

4.5.12 Magnetic impulse generator (MIG) test.

4.5.12.1 Helicopter vibration. The assemblies shall be conditioned as required in 3.4.2.3. Following conditioning, the assemblies shall be assembled into a test fixture which contains a simulated Release Pin assembly in the cocked position and a simulated potted base assembly. The unit shall be activated by the release of the Release Pin and the voltage output measured in accordance with the requirements of 3.4.2.2. Any MIG that fails the requirement shall be classed defective.

4.5.12.2 MIG spring force. Apply the specified load perpendicular to the bobbin assembly thru the hole in the forward end plate and inspect for conformance to 3.4.2.1. Any MIG that fails the requirement shall be classed defective.

4.5.12.3 Energy storage capacity. The MIG shall be tested for storage capacity by assembly into a fixture which contains a simulated Release Pin assembly in the cocked position and a simulated potted base assembly. The unit shall be activated by the release of the release pin, and the voltage output measured and recorded. The same unit shall be measured and the voltage recorded to meet the requirements of 3.4.2.2. Any MIG that fails the requirement shall be classed defective.

4.5.13 Forty-foot drop. The sub-assembly with inert lead, inert booster, inert warhead and motor shall be subjected to the Forty-Foot Drop Test as specified in MIL-STD-331 with the exception that the round shall be dropped base down only. The complete pack as specified by the procuring agency shall be used. Any sub-assembly that fails the requirements shall be classed defective.

4.5.14 Jolt and jumble. The sub-assembly shall be subjected to the Jolt Test specified in MIL-STD-331 with the exception that the fuze shall not be disassembled and inspected after the Jolt Test. After completion of the Jolt Test, the same fuze shall be subjected to and withstand the Jumble Test specified in MIL-STD-331. Any sub-assembly that fails the requirements shall be cause for lot rejection.

4.5.15 Vibration. The helicopter vibration test shall be performed on a random sample of 48 fuze sub-assemblies selected from each lot. The sample fuzes shall be subjected to the helicopter vibration test in accordance with 3.8.6. Following vibration, the fuzes shall be subjected to the tests and acceptance or rejection criteria specified in 4.5.17.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.16 Five-foot drop. The sub-assembly with inert lead, inert booster and inert warhead shall be subjected to Test 111 of MIL-STD-331. The lot shall be rejected if any unit fails to meet the requirements of 3.8.9 with additional definitions in 6.5.

4.5.17 Sub-assembly function tests. Following the conditioning of 4.5.15, the units shall be tested in a centrifuge of the horizontal type utilizing a swing table. The radial arm used in acceleration calculation shall be measured to the center of the swing table. The item shall be mounted on the swing table and positioned so that the setback weight is located at 3 o'clock as viewed from the base of the S&A. When the centrifuge has reached the required RPM the holding solenoid is actuated allowing the swing table to rotate into the "G" field. The arming time start signal shall be located at $45^{o} \pm 1^{o}$ preceding the in-line position and the arming time shall stop at rotor detent. The arming time shall be recorded to the nearest millisecond using an acoustic pick-up which feeds the arming cycle noise signal to the recorder.

4.5.17.1 Non-arm. The sub-assembly, without shipping plug, shall be assembled to the test equipment and accelerated to 12.0 ± .5 g's for a minimum of five seconds. Observation shall be made for the S&A in the safe position.

4.5.17.2 Arming time. The equipment shall accelerate the sub-assembly to 40.0 ± .5 g's and the arming time shall be recorded.

4.5.17.3 The detonator function test shall occur within 20 seconds after S&A arming by application of 28 ± .5 VDC to the input terminal of the fuze firing circuit. Sub-assemblies which fail to fire shall be carefully removed from the centrifuge after a time lapse of five minutes.

WARNING: The test may be dangerous and should be performed behind a suitable barrier.

4.5.17.4 The sub-assemblies shall be subjected to the tests and acceptance or rejection criteria as specified in Table II.

TABLE II

SAMPLE SIZE 48

TEST	ACCEPT	REJECT	DEFECT
Non-Arm	0	1	Critical
Arming Time			
Under Min.	0	1	Critical
Over Max.	0	1	Major
Fail to Arm	0	1	Major
Firing	0	1	Major

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

4.5.18 Fuze function test. A random sample of 32 fuzes shall be selected from each fuze assembly lot for this test. The sub-assemblies shall be sent to a Government designated facility to be loaded with a booster assembly in accordance with the latest drawings and specifications. The fuzes shall then be assembled to the appropriate rounds and fired from a 2.75 inch Rocket Launcher or equivalent situated on the ground to impact on natural terrain at a distance of 5000 meters. If no defect is found, the lot shall be accepted. If two or more fuzes fail to comply with the requirement specified, the lot shall be rejected. If one defect is found, a second sample of 32 fuzes shall be tested. If the combined number of defects in both the first and second samples is two or more, the lot shall be rejected.

5. PREPARATION FOR DELIVERY

5.1 Packaging. Packaging shall be as specified in the contract.

5.2 Marking. Marking shall be in accordance with MIL-STD-129, and shall identify the fuze type as Type I or Type II.

5.3 Ammunition data cards. Data card information shall be as specified in MIL-STD-1167.

6. NOTES

6.1 Intended use. The components covered by this specification are intended for use in the 2.75 Inch Rocket System.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of inspection equipment designs for approval. See 6.2.3 of MIL-A-48078. Submit equipment designs, as required, to: Commander, U.S. Army Armament Research & Development Command, ATTN: DRDAR-QAF-I, Dover, NJ 07801.

6.4 First article. When a first article is required for inspection and approval, see 3.10 and 4.3.

6.5 Safety definitions. A safe device shall be one in which:

a. The rotor shall be in safe position and secured by the setback weight such that it cannot be turned to the armed position.

b. The lock roller pin on the rotor shall not be broken.

c. The setback weight shall be in the full forward position raised to its highest position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

d. No loose explosive is present.

e. The power supply firing pin shall be set, and locked and in the "cocked" position (Type I only).

f. The power supply shall not have been initiated.

6.6 Government furnished parts.

6.6.1 Packaging and packing. The Procuring Agency will provide the packaging and the packing for the Forty-Foot Drop.

6.6.2 Warheads and Motors. The Procuring Agency will provide the warheads and rocket motors for the Drop Test and Fuze Function Test.

6.7 Drawings. Drawings listed in Section 2 of this specification under the heading U.S. Army Armament Research and Development Command, (ARRADCOM) may also include drawings prepared by, and identified as Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal or Picatinny Arsenal Drawings. Technical data originally prepared by these activities is now under the cognizance of ARRADCOM.

6.8 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:

Army - AR

Preparing Activity

Army - AR


Project No: 1340-A-578

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.

APPENDIX A

HELICOPTER VIBRATION

One 15 minute sinusoidal sweep (5-500-5 HZ) shall be performed for each of three axes. No dwell time shall be spent on any one frequency. A search for resonance shall not be done.

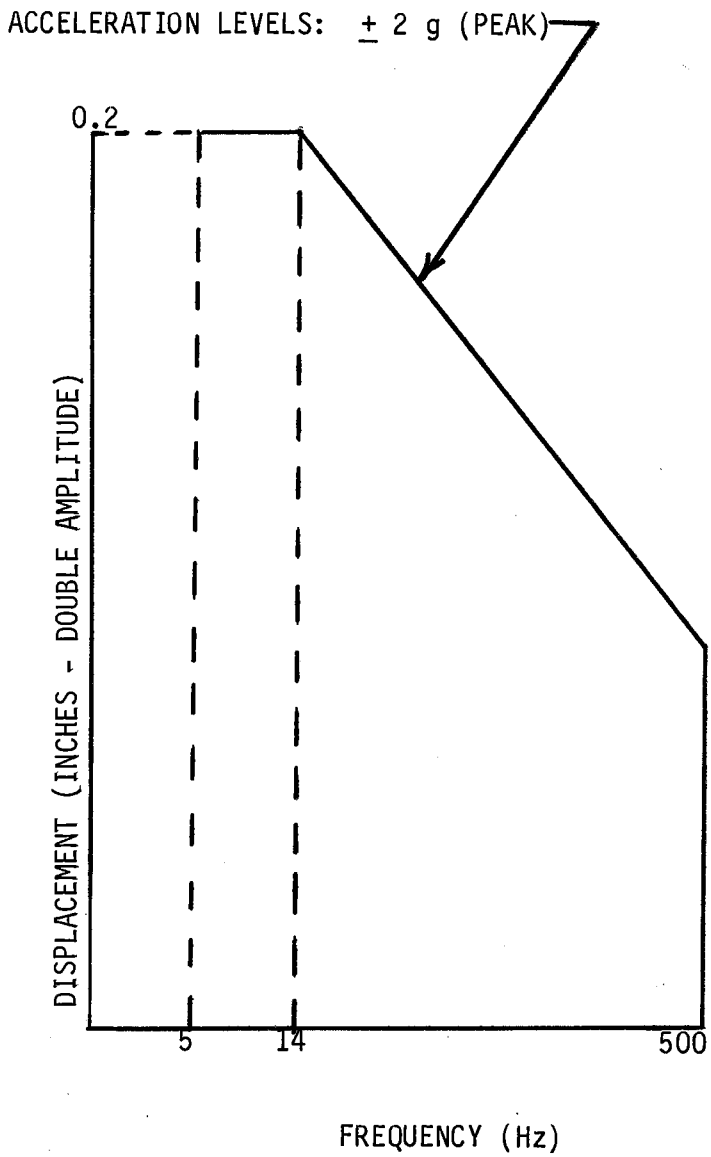

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:11Z
Check the source to verify that this is the current version before use.