MILITARY SPECIFICATION

SHELTER, ELECTRICAL EQUIPMENT S-584( )/TRC-152(V)

This specification is approved for use by Communications Research and Development Command, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope.- This specification covers the air or vehicular transportable shelter facility part of the Radio Repeater Set AN/TRC-152(V). This assemblage may be used in 12 or 24 channel pulse code modulation systems as a radio repeater, a radio terminal, or a cable repeater. (See 6.1 and 6.5)

1.2 Description.- Shelter Electrical Equipment S-584( )/TRC-152(V) hereinafter called the shelter facility, includes a modified S-280( )/G shelter and all racks, brackets, shelves, tie-downs, patch panel, electrical components and wiring to enable installation and operation of the assemblage components of the AN/TRC-152(V).

2. APPLICABLE DOCUMENTS

2.1 Issue of Documents.- The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Communications, Research and Development Command, ATTN: DRDCO-CM-DM Fort Monmouth, New Jersey 07703 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

MILITARY

MIL-P-116	Preservation, Methods of
MIL-C-3885	Cable Assemblies and Cord Assemblies (for use in Electronic and Associated Electrical Equipments)
MIL-W-6858	Welding, Resistance, Aluminum, Magnesium, Non-Hardening Steels or Alloys, Nickle Alloys, Heat-Resisting Alloys & Titanium, Spot & Seam
MIL-T-7928	Terminals, Lug & Splice, Crimp Style Copper
MIL-M-13231	Marking of Electronic Items
MIL-F-14072	Finishes for Ground Electronic Equipment
MIL-W-45205	Welding, Gas, Metal-Arc & Gas, Tungsten-Arc, Aluminum Alloys, Readily Weldable for Structures, Excluding Armor
MIL-S-55507	Shelter, Electrical Equipment (with or without equipment), Packaging of

STANDARDS

MILITARY

MIL-STD-105	Sampling Procedures & Tables for Inspection by attributes.
MIL-STD-252	Wired Equipment, Classification of Visual & Mechanical Defects
MIL-STD-461	Electromagnetic Interference Characteristics Requiremens for equipment
MIL-STD-810	Environmental Test Methods
MIL-STD-1235	Single and Multi-level Continuous Sampling Procedures & Tables for Inspection by Attributes
MIL-STD-1474	Noise Limits for Army Material

DRAWINGS

MATERIEL READINESS COMMAND

DL-SC-B-914077	Shelter Electrical Equipment S-584( )/ TRC-152(V)
SC-D-914098	Power Schematic
SC-F-914099	Signal Schematic

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer. Both the title and number or symbol should be stipulated when requesting copies)

3. REQUIREMENTS

3.1 First article.- When specified in the contract, the contractor shall furnish first article units in accordance with 4.3.

3.2 Construction.- The shelter facility shall be constructed in accordance with the drawings as listed on DL-SC-B-914077 and the requirements specified herein. (See 3.25)

3.3 Electrical installation.- (See 4.6)

3.3.1 Power system wiring and components.- The completed in-place power distribution system shall meet the following requirements:

3.3.1.1 Continuity of conductors.- Continuity shall exist between each pin of the power entrance connectors and respective circuit terminations and shall be less than 3 ohms. (See 4.6.1 and 4.6.1.1)

3.3.1.2 Dielectric breakdown voltage.- The insulation of all power wires, cables, and components shall withstand, without flashover or insulation breakdown, a potential of 500 volts DC applied continuously for not less than 30 seconds. (See 4.6.1 and 4.6.1.2)

3.3.1.3 Insulation resistance.- The resistance of insulation between any two circuit conductors and also between each of the four ungrounded power line conductors and shelter facility ground terminal shall not be less than 100 megohms. (See 4.6.1 and 4.6.1.3)

3.3.2 Power distribution and operational functions.- Main power branch distribution and circuit switching functions thereof shall meet the operational requirements as shown in the power schematic drawing when tested in accordance with 4.6.2.

3.3.3 Signal system wiring and components.- The completed in-place signal system installation shall meet the following requirements:

3.3.3.1 Continuity.- Continuity shall exist between end terminations of all signal wires and shall be less than 3 ohms, unless otherwise specified herein. (See 4.6.3 and 4.6.3.1)

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

3.3.3.2 Dielectric strength of insulation.- The insulation of all signal wires, cables, and components shall withstand, without flashover or insulation breakdown, a potential of 500 volts DC applied continuously for not less than 5 seconds. (See 4.6.3.2)

3.3.3.3 Insulation resistance.- The resistance of insulation of each signal line conductor and all other signal line conductors connected to ground shall not be less than 100 megohms. (See 4.6.3.3)

3.3.4 Video (rf) system wiring and components.- Installation of video and rf cable assemblies and connecting components (including plugs, connectors, adapters, fittings, receptacles and lightning protectors) shall be in accordance with the drawings. The completed in-place video and rf system installation shall meet the following requirements:

3.3.4.1 Continuity.- The point-to-point continuity of all rf cable assembles shall not exceed 1 ohm. (See 4.6.4 and 4.6.4.1)

3.3.4.2 Dielectric and insulation resistance.- The insulation of all video and rf cables, components and lightning protectors shall withstand the following potentials with the insulation resistance not less than 100 megohms. (See 4.6.4.2)

a. 1500 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video entrance box with lightning protector elements removed.

b. 1100 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video entrance box with lightning protector elements in place.

c. 1700 volts RMS, 25 - 100 Hz, applied continuously for not less than 30 seconds to all rf transmission lines terminated at the entrance box.

3.3.5 Cable assemblies, power and audio frequency.- All power and audio frequency cable and cord assemblies shall be fabricated in accordance with the drawings and meet the continuity, dielectric, insulation resistance, and pull-out requirements of MIL-C-3885. (See 4.4)

3.3.6 Suppression of electromagnetic interference.- The motors in the ventilating equipment used in the shelter facility shall meet the emanation limits of MIL-STD-461 for tactical equipment, if other than those items defined by the drawings. (See 4.4)

3.4 Systems operation.- With all operational equipment of the AN/

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

TRC-152(V) assemblage installed, the operational requirements of all power and signal cable assemblies, switches, connectors and operational equipment shall be met when tested in accordance with 4.7.

3.5 Vehicular transportation.- The shelter facility shall be capable of being transported over cross-country terrain by military vehicle without sustaining any damage such as buckling, cracking, delamination, or other permanent deformation. (See 4.8)

3.6 Railroad transportation.- The shelter facility shall be capable of being loaded, blocked and braced on a flatcar for shipment by rail and shall be subjected to and withstand the tests of 4.9 without sustaining any permanent damage such as buckling, cracking, delamination or other permanent deformation.

3.7 Drop tests.- The shelter facility shall be capable of withstanding drops of 18 inches onto concrete without sustaining any permanent damage such as buckling, cracking, delamination, or other permanent deformation. (See 4.10)

3.8 Watertightness.- The shelter facility shall be capable of withstanding the test of 4.11. During and after the test there shall be no leakage into the facility or its walls, floor, roof or doors.

3.9 Fording.- The shelter facility shall be capable of withstanding the test of 4.12. During and after the test there shall be no leakage into the facility or its walls, floor or doors.

3.10 Humidity.- Hardware sample shall have no evidence of corrosion, rust or deterioration after testing. (See 4.13)

3.11 Mounting inserts.- All mounting inserts shall be installed without the use of any auxiliary materials such as adhesive and, when installed, each insert shall be capable of withstanding the tensile load and the torque load referenced in 4.14. There shall be no damage or permanent distortion to the shelter mounting surface or insert head or the threads and the inserts shall not have rotated from its original position. Inserts threads shall be free of paint.

3.12 Acoustical Noise.- The acoustical noise shall not exceed the criteria specified in MIL-STD-1474A(MI), Table 2, Category F. (See 4.15).

3.13 Cleaning.- (See 3.25)

3.13.1 Parts.- After fabrication, parts shall be cleaned in accordance with good commercial practice or as specified in he applicable portions of Specification MIL-F-14072. Cleaning processes shall have no

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

deleterious effect. Corrosive material shall be removed completely before the parts are assembled. After assembly, units shall be cleaned thoroughly and shall be free from particles of solder, flux, scale, and any other foreign material. In addition, when necessary, such cleaning shall also be performed before and after final assembly of the units.

3.13.2 Units.- After assembly, the equipment shall be cleaned thoroughly and shall be free from excess solder or flux, loose hardware and other foreign material.

3.14 Finish.- The shelter facility shall be finished in accordance with Specification MIL-F-14072 and the equipment drawings. (See 3.25 and 4.4)

3.15 Marking.- (See 3.25 and 4.4)

3.15.1 General.- Marking shall conform to Specification MIL-M-13231 and the drawings.

3.15.2 Nameplates.- Shelter facility shall be provided with a nameplate in accordance with the drawings. Each nameplate shall be imprinted with a sequential serial number.

3.15.3 Aircraft loading data plate.- The shelter facility shall be provided with data plates in accordance with the drawings, imprinted with the dimensions which locate the center-of-gravity of the shelter facility and the assemblage in the three planes; the gross weight of the shelter facility and assemblage; and the bearing pressure on the bottom of the skids. The shelter assemblage is the shelter facility with operational equipments or dummy loads in place. The location of the centers-of-gravity shall be determined by the contractor using the first article of production.

3.15.4 Interior and exterior marking.- All interior and exterior markings shall be as defined on the drawings.

3.16 Riveting.- Riveted joints shall be tight, the joined parts shall be undamaged, and the rivet heads shall be properly seated and tight against their bearing surfaces. Rivets shall conform to requirement 12 of MIL-STD-454. (See 3.25 and 4.4)

3.17 Seal, water vapor.- All joints of the framing for the exhaust blower, power and antenna entrance boxes and air conditioner ports shall be sealed to provide a barrier against the entrance of water vapor to the core material of the shelter panels and to the interior of the shelter. All joints and edges shall be assembled and sealed in a manner

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

to prevent collection and retention of moisture. All exterior rivets, screws and fasteners shall be dipped in sealer prior to installation. The sealer shall be a one-part sealant Silastic, 738 as made by Dow Corning, or equal using the manufacture recommended primer. (See 3.25 and 4.18).

3.18 Securing of Parts.- Brackets, Lugs, Flanges, Inserts, Bolts, and other mounting arrangements shall retain components of the facility securely so that loosening, wear of mounting arrangements or permanent separation of parts or components will not occur when the equipment is subjected to the specified drop and transport tests. (See 3.25 and 4.18)

3.19 Soldering.- (See 3.25 and 4.18)

3.19.1 Solder and flux.- Solder and flux shall be as defined on the drawings.

3.19.2 Acid or acid salts.- No acid or acid salts shall be used in preparation for or during soldering; however, exception permitted for preliminary tinning of electrical connections and for soldering of mechanical joints not used to complete electrical circuits, but in no case shall acid or acid salts be used where they can come in contact with insulation material. Where acid or acid salts are used, as permitted above, they shall be completely neutralized and removed immediately after use.

3.19.3 Process.- There shall be no sharp points or rough surfaces resulting from insufficient heating. The solder shall feather out to a thin edge, indicating proper flowing and wetting actions, and shall not be crystallized, overheated, or underheated. The minimum necessary amount of flux and solder shall be used for electrical connections. Any means employed to remove an unavoidable excess of flux shall not incur the risk of loose particles of flux, brush bristles, or other foreign materials remaining in the equipment; flux being spread over a larger area; or damage to the equipment. Insulation material that has been subjected to heating during the soldering operation shall be undamaged and parts fastened thereto shall not have become loosened.

3.20 Tropicalization of material.- Canvas, webbing, wood, etc. shall be treated to be resistant to moisture and fungi as indicated on the drawings as follows:

3.20.1 Treating materials.- Treating materials containing a mercury-bearing fungicide shall not be used. The contractor shall determine that the treating material is compatible with the material or surface to be treated. Selection of treating materials shall be such that any increase in flammability of treated material will be held to the practical minimum.

3.20.2 Toxicity.- Treating materials shall cause no skin irritation or other injury to personnel handling the treated material during fabrication, transportation, operation, or maintenance of the equipment, or during use of the finished items when used for the purpose intended.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

3.20.3 Flexibility.- Treatment shall not affect the flexibility of treated materials, to the extent that the equipment may fail to meet specified requirements when subjected to specified service conditions.

3.20.4 Statement of treatment.- The contractor shall submit for approval, to the contracting officer, a statement describing in detail the materials to be treated and the treating materials and processes that he proposes to use. (See 6.7)

3.21 Welding.- Welded joints shall be as defined by the drawings and shall be such that grinding on the finished weld will be unnecessary except where grinding is specified on the drawings. Inert gas-shielded arc welding (MIG) using helium, argon, or a mixture of the two shall be used for arc welding of aluminum. Welds shall conform to MIL-W-6858 CL. B and MIL-W-45205 CL.B as applicable. All surfaces to be welded shall be cleaned in accordance with good commercial practice and shall be free of scale, paint, grease, and other foreign materials. Welds shall have thorough penetration and good fusion and shall be free of scabs, blisters, abnormal pock marks, cracks, voids, slag inclusions, and other harmful defects. Inert-gas-shielded arc welding shall be used for welding of aluminum except where spot welds are used. Welded assemblies shall be cleaned to remove any scale, oxidation products, and excess flux. Any acid used in cleaning shall be completely neutralized and removed. (See 4.4)

3.22 Wiring and cabling.- (See 3.25 and 4.18) Wiring and cabling shall be in accordance with the drawings and shall be neat and sturdy.

3.22.1 Slack.- Wires and cables shall be as short as practical except that sufficient slack shall be provided:

a. To prevent undue stress on cable forms, wires, and connections.

b. To permit removal from rack of operational equipments, having wiring or cables to connectors at back of equipment, so that cable may be connected or disconnected.

c. To facilitate field repair of broken or cut wires.

d. To prevent chafing or breaking of wires due to repeated flexing of hinged parts.

3.22.2 Protection.- Wires and cables shall be so placed and protected as to avoid contact with rough or irregular surfaces or sharp edges. Wires shall not be bent sharply where they enter insulation materials.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

3.22.3 Splicing.- Wires in a continuous run between two terminals shall not be spliced during the wiring operation unless specifically indicated by the drawings.

3.22.4 Solderless terminal lug connections.- Crimping of solderless terminal lugs shall be so accomplished that the connections will meet the resistance (voltage drop) and tensile strength requirements and tests of MIL-T-7928. (See 4.4 and 4.16)

3.22.5 Identification of wiring.- Wiring shall be identified by color coding and wire pair marking, as indicated on the drawings.

3.22.6 Cord Assemblies.- Power cable and cord assemblies shall be fabricated in accordance with the drawings and meet the requirements and tests of MIL-C-3885. (See 4.4)

3.22.7 Testing.- Power and signal wiring of the S-584( )/TRC-152 (V) shall be subjected to and pass the tests described in 4.6.

3.23 Suppression of radio frequency interference.- The motors in the exhaust fans, fluorescent lighting and other electrical devices used in the shelter facility shall meet the emanation limits of MIL-STD-461 for tactical support equipment, if other than those items defined by the drawings. (See 4.4)

3.24 Interchangeability.- Like units, assemblies, subassemblies, and replaceable parts shall be physically and functionally interchangeable without modification of such items or of the equipment. (See 4.17) Individual items shall not be hand-picked for fit or performance. Reliance shall not be placed on any unspecified dimension, rating, characteristic, etc.

3.25 Workmanship.- (See 4.18) The equipment shall be manufactured and assembled in accordance with the applicable portions of the following paragraphs:

3.2	Construction
3.3	Electrical installation
3.11	Mounting inserts
3.13	Cleaning
3.14	Finish
3.15	Marking
3.16	Riveting
3.17	Seal, water vapor
3.18	Securing of parts
3.19	Soldering
3.20	Tropicalization
3.21	Welding
3.22	Wiring and cabling

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.- Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 Classification of inspection.- The inspections shall be classified as follows:

a. First article inspection (does not include packaging). (see 4.3)

b. Inspection covered by subsidiary documents. (see 4.4)

c. Quality conformance inspections.

(1) Quality conformance inspection of equipment before packaging. (See 4.5)

(2) Quality conformance inspection of preparation for delivery. (See 4.20)

4.3 First article.- Unless otherwise specified in the contract or purchase order, the first article inspection shall be performed by the contractor. (See 3.1)

4.3.1 First article units.- The contractor shall furnish one (1) first article unit of the complete S-584( )/TRC-152(V).

4.3.2 First article inspection.- The first article inspection shall consist of inspections specified in Table I and shall be performed in the order specified therein.

4.3.3 First article data.- The first article test plan and test report(s) shall be as required in the contract or purchase order.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

TABLE I - First Article Inspection

Inspections	Rqr Para	Test Para
1. Inspection covered by subsidiary documents	-	4.4
2. Interchangeability	3.24	4.17
3. Mounting Insert	3.11	4.14.1
4. Solderless-terminal-lug connection	3.22.4	4.16
5. Humidity	3.10	4.13
6. Visual & Mechanical	3.25	4.18
7. Electrical Installation	3.3	4.6
8. System Operation	3.4	4.7
9. Acoustical Noise	3.12	4.15
10. Vehicular transportation	3.5	4.8
11. Railroad transportation	3.6	4.9
12. Drop tests	3.7	4.10
13. Watertightness	3.8	4.11
14. Fording	3.9	4.12
15. Repeat 7 - Electrical Installation	3.3	4.6
16. Repeat 8 - System operation	3.4	4.7

4.4 Inspection covered by subsidiary documents.- The following shall be inspected under the applicable subsidiary documents as part of the inspection required by this specification, and the inspection requirement specified in the contract or purchase order:

Item	Where required
Cable & Cord Assemblies	3.3.5 & 3.22.6
Interference Suppression	3.3.6
Finish	3.14
Marking	3.15
Riveting	3.16
Welding	3.21
Solderless terminal lug connections	3.22.4

4.5 Quality conformance inspection of equipment before packaging.- The contractor shall perform the inspection specified in paragraph 4.4 and 4.5.1 through 4.5.4. This does not relieve the contractor of his

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

responsibility for performing any additional inspection which is necessary to control the quality of the product and to assure compliance with all specification requirements.

4.5.1 Group A inspection.- Each unit on contract or purchase order shall be inspected for conformance to the inspections specified in Table II. Discrete lots shall be formed from units that pass this inspection. Factors of lot composition not defined herein, or in the contract or purchase order, shall be in accordance with MIL-STD-105. Each lot shall be subject to sampling inspection utilizing the procedures of MIL-STD-105, using the general inspection levels, and AQL's indicated in Table II.

4.5.1.1 Order of inspection within Group A.- Group A inspection shall be performed in the order listed in Table II.

TABLE II Group A Inspection

Inspection	Reqt Para	Test Para	AQL % Major	Minor
Visual & Mechanical	3.25	4.18	1.0	4.0
Electrical Installation	3.3	4.6	1.0	*

* All defects are major.

4.5.2 Group B Inspection.- Group B inspection shall normally be performed on inspection lots that have pased Group A inspection, except for Interchangeability and Mounting Insert Inspections which are performed prior to Group A. This inspection shall conform to Table III and to the special inspection levels of Table I of MIL-STD-105.

4.5.2.1 Group B sampling plans.- The Group B sampling plans for the AQL's listed in Table III shall be as follows:

AQL	Inspection Level
4.0%	S-4
2.5	S-4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

4.5.2.2 Order of inspection within Group B.- Group B inspection shall be performed in the order listed in Table III.

TABLE III - Group B Inspection

Inspection	Reqt Para	Insp Para	AQL % (See 4.5.2.1)
Mounting Insert	3.11	4.14.2	4.0
Interchangeability	3.24	4.17	4.0
Watertightness	3.8	4.11	2.5
Fording	3.9	4.12	2.5

4.5.3 Group C inspection.- This inspection shall be as listed in Table IV.

TABLE IV - Group C Inspection

Inspection	Reqt Para	Test Para
Solderless terminal lug connection	3.22.4	4.16
Mounting inserts	3.11	4.14.1
System operation	3.4	4.7
Acoustical noise	3.12	4.15
Vehicular transportation	3.5	4.8
Railroad transportation	3.6	4.9
Drop tests	3.7	4.10
Humdidity	3.10	4.13

NOTE: The order of inspection of Group C with respect to Groups A and B shall conform to the order specified in 4.3. The order of inspection within Group C for all inspections listed shall be as listed in Table IV. Units subject to Group C Drop Tests shall subsequently be subjected to and meet the watertightness and fording tests of 4.11 and 4.12.

4.5.3.1 Sampling for inspection of solderless-terminal-lug-connections.- Five specimens of each combination of wire and terminal produced

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

each week shall be prepared for inspection. A specimen is a 1 (one) foot length of wire on which a terminal lug has been applied, using the same tools and procedures used in crimping the terminal lugs in production.

4.5.3.2 Sampling for inspection of Drop Tests.- One sample, representative of the first 10 units or fraction thereof produced, shall be subjected to the drop tests. This sample shall be the same unit previously subjected to the truck and rail transportation tests of 4.5.3.3. Thereafter, one sample from each additional 150 units or fraction thereof produced shall be subjected to the drop tests.

4.5.3.3 Sampling for other inspection.- For inspection tests listed below one unit shall be selected at random from the first 10 units or a fraction thereof which have been produced, unless otherwise specified in the contract. Selection of the unit will be made by the Government.

a. Mounting inserts

b. System operation

c. Acoustical noise

d. Vehicular transportation

e. Railroad transportation

f. Humidity

4.5.3.4 Group C failures.- Actions required relative to Group C failures shall be as specified in the contract or purchase order.

4.5.4 Reinspection of conforming Group B and Group C sample units.- Unless otherwise specified, sample units which have been subjected to and passed Group B or Group C inspection, or both, may be accepted on contract provided that they are resubjected to and pass Group A inspection after repair of all visible damage.

4.5.5 Alternate Group A Audit and Group B inspection procedures.- The contractor may elect to use a continuous sampling and inspection plan instead of the lot inspection plans from MIL-STD-105. If this alternate is selected the procedure of implementation must be in accordance with MIL-STD-1235, "Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes". Sampling plans for the AQL's listed in Table II Group A inspection and Table III Group B inspection shall be selected from Tables VIII, IX and X of MIL-STD-1235 which are for f=1/2.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

The number of units in the Production Interval shall be the entire production quantity unless otherwise specified in the contract. Before starting production contractor shall notify the contracting officer in writing which method he intends to use. The method may not be changed during production without written approval of the Government.

4.6 Electrical installation tests.- The shelter facility shall be subjected to the tests of 4.6.1 through 4.6.4 below. Before applying power to the shelter facility, an electrical ground connection at the power entrance box shall be made. Power to be supplied shall be 115 VAC, 60 Hertz.

4.6.1 Power systems and components installation tests.- Refer to the Power Schematic Plate Drawing SC-D-914098.

a. Remove or disconnect the following electrical loads:

(1) All fluorescent, incandescent and neon lamps.

(2) All fluorescent lamp starters.

(3) Blowers and heaters.

b. Remove power distribution box cover panel and disconnect conductors from the voltmeter terminals. Position or isolate the disconnected leads so as not to short to each other or facility ground.

4.6.1.1 Continuity of conductors.- Continuity resistance tests which meet the requirements of paragraph 3.3.1.1 shall be performed on each power line circuit in accordance with the following paragraphs. A calibrated low resistance ohmmeter or equivalent shall be used in performthe test.

a. Place the following controls in the ON position:

(1) All circuit breakers.

(2) Fluorescent lamp switches.

(3) Incandescent lamp switch.

(4) Blackout bypass switch (to bypass position).

(5) Blower switches.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

b. Measure continuity resistance from pin 1 of 115V power connector IN located at the power entrance box to each of the following:

(1) Brass (hot) contacts of all convenience, intercom, heater, and blower receptacles.

(2) Black wire termination at each fluorescent and incandescent lamp.

(3) Pin 1 of 115V power connector OUT.

c. Place all controls listed in step a in the OFF position except main circuit breaker.

d. Repeat step b measuring continuity resistance from pin 2 of 115V power connector IN to the silver contacts of each power receptacle, white wire termination at each fluorescent and incandescent lamp, and pin 2 of 115V power connector OUT.

e. Place main circuit breaker in the OFF position.

f. Measure continuity resistance from pin 4 (ground) of 115V power connector IN to each of the following:

(1) Ground Terminal at each power receptacle.

(2) Ground Terminal located at power entrance box, power distribution box, equipment racks and raceways.

(3) Pin 4 of 115V power connector OUT.

4.6.1.2 Dielectric breakdown voltage.- The dielectric strength of insulation of all power wires, cables, and components shall meet the requirements of paragraph 3.3.1.2. A non-destructive DC dielectric tester shall be used in performing the tests. Test procedures shall be as follows:

CAUTION Take preventative measures that will preclude personnel from coming into contact with conductors under test during performance of ALL dielectric and insulation resistance tests. Discharge each conductor to ground following each test in order to eliminate the danger of electric shock.

a. Place all circuit controls listed under 4.6.1.1.a in the ON position except the fluorescent lamp switch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

b. Test between pin 1 and pin 4 of 115V power connector IN. Adjust tester to an output value of 500 volts DC for not less than 30 seconds. The dielectric strength requirements shall be met.

c. Place fluorescent lamp switches in the ON position.

d. Repeat step b with tester connected first across pins 1 and 2 and then across pins 2 and 4 of 115V power connector IN.

4.6.1.3 Insulation resistance.- The insulation resistance shall meet the requirement of paragraph 3.3.1.3 when tested in accordance with the following procedures. A megohmeter or equivalent shall be used in performing the tests.

a. Place all circuit controls listed under 4.6.1.1a in the ON position except the blackout bypass switch and fluorescent lamp switches.

b. Close shelter door securely.

c. Test between pins 1 and 4 of 115V power connector IN. The tester output voltage shall be between 100 and 500 volts DC. Maintain this potential until the meter indicator has ceased fluctuating and indicates a steady or increasing insulation resistance. The insulation resistance requirement shall be met.

d. Place the blackout bypass switch in the ON position.

e. Repeat step c with the tester connected first across pins 1 and 2 and then across pins 2 and 4 of 115V power connector IN.

4.6.2 Power distribution and operational function tests.- Power distribution and operational function tests shall be performed on each power line circuit in accordance with the following paragraphs.

4.6.2.1 Test preparation.- (Refer to power schematic plate.)

a. Replace or reconnect all electrical loads and voltmeter which were removed or disconnected by 4.6.1.a and 4.6.1.b.

b. Close power distribution box panel cover.

c. Place all circuit breakers and switches in the OFF position.

d. Place an 115 volt AC test lamp with grounding plug into all convenience, heater, equipment and intercom receptacles.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:59Z
Check the source to verify that this is the current version before use.

e. Open outer exhaust port cover of blower and insert AC line plug of blower into appropriate receptacle.

4.6.2.2 Test for 115 volt AC prime power.-

a. Apply 115 volt AC 60 hertz, single phase prime power to the shelter facility at 115V power connector IN. The power indicator lamps at the power distribution panel shall light.

b. Measure line voltage by connecting a calibrated AC meter (0 - 150 volt scale) between pins 1 and 2 of 115 VAC power connector OUT.

c. Read voltage indicated on shelter facility voltmeter. The voltage reading shall be within ± 2% of the voltage measured in step b above.

d. Place main circuit breaker in the ON position.

4.6.2.3 Tests of circuit breakers and switches.-

a. Lights circuit breaker (CB 1).-

(1) Place circuit breaker CB 1 in the ON position. Neon lamp above CB 1 shall light.

(2) Place blackout bypass switch and fluorescent lamp switches in the ON position. All fluorescent lamps shall light.

(3) Place incandescent lamp switch in the ON position. All incandescent lamps shall light.

(4) Place CB 1 in the OFF position. All lamps mentioned in steps (1) thru (3) shall go out.

(5) Replace CB 1 in the ON position to restore light.

(6) With shelter door open, place blackout bypass switch in the blackout position. All fluorescent and incandescent lamps shall go out.

(7) Close shelter door. All fluorescent and incandescent lamps shall light.

(8) Place fluorescent lamp switches in the OFF position. All fluorescent lamps shall go out.

(9) Place incandescent lamp switch in the OFF position. All incandescent lamps shall go out.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

(10) Open door and restore lights by placing blackout bypass switch, fluorescent light switch and incandescent light switch in the ON position.

b. Blowers circuit breaker (CB 2)

(1) Place circuit breaker CB 2 in the ON position. Neon lamp above CB 2 shall light.

(2) Place roadside blower switch in the ON position. Roadside blower shall operate and shall exhaust air from shelter.

(3) Place curbside blower switch in the ON position. Curbside blower shall operate and shall exhaust air from shelter.

(4) Place circuit breaker CB 2 in the OFF position. The neon lamp above CB 2 shall go out and both blowers shall cease to operate.

c. Heater No. 1 circuit breaker (CB 3)

(1) Place circuit breaker CB 3 in the ON position. The neon lamp above tandem circuit breaker CB 3 and test lamp in Heater No. 1 receptacle shall light.

(2) Place CB 3 in the OFF position. The lamps mentioned in step (1) shall go out.

d. Intercom and convenience circuit breaker (CB 4)

(1) Place circuit breaker CB 4 in the ON position. The neon lamp above circuit breaker CB 4 and test lamps in Intercom and convenience 1 & 2 receptacles shall light.

(2) Place circuit breaker CB 4 in the OFF position. The lamps mentioned in step (1) shall go out.

e. Heater No. 2 Circuit Breaker (CB 5) Repeat steps (1) and (2) of Heater No. 1 circuit breaker (CB 3) test for CB 5.

f. Equipment Circuit Breakers (CB 6)

(1) Place circuit breaker CB 6 in the ON position. The neon lamp above CB 6 shall light and test lamps in the equipment receptacles shall light.

(2) Place circuit breaker CB 6 in the OFF position the lamps mentioned in step (1) shall go out.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

g. Main Circuit Breaker (CB 7)

(1) Place all circuit breakers and switches in the ON position, all lamps shall light and both blowers shall operate.

(2) Place main circuit breaker in the OFF position. All lamps shall go out and the blowers shall cease to operate.

(3) Place all circuit breakers and switches in the OFF position.

4.6.3 Signal system wiring and components installation tests.-

4.6.3.1 Continuity Tests.- The point to point continuity resistance of all signal lines shall meet the requirements of paragraph 3.3.3.1 as described in the following paragraphs. A low resistance continuity tester or equivalent shall be used to test continuity resistance.

a. Using the "RADIO-TO-CABLE PATCH THRU" patch cord connect between the radio "PATCH THRU SYS-1" and TD-754 "PATCH THRU SYS-1" at the patch panel. Repeat for systems 2 & 3.

b. Continuity resistance of 3 ohms or less shall exist between the following pins of cable assemblies marked "GRC-103 PATCH THRU SYS-1" and TD-754 "PATCH THRU SYS-1"; C to E, E to F, A to G, and B to H respectively.

c. Using the "RADIO-TO-CABLE O.W." patch cord connect between the GRC-103 "ORDER WIRE SYS-1" and TD-202/U "ORDER WIRE SYS-1" at the patch panel. Repeat for systems 2 and 3.

d. Continuity resistance of 3 ohms or less shall exist between the following pins of cable assemblies marked "AN/GRC-103 ORDER WIRE SYS-1" and TD-202 "ORDER WIRE SYS-1"; A to A, B to B, C to C, D to D. Repeat for systems 2 & 3.

e. Using the "12 CH RADIO REPEATER PATCH THRU" patch cord connect between the GRC-103 "PATCH THRU SYS-1" and GRC-103 "PATCH THRU SYS-2" at the patch panel.

f. Continuity resistance of 3 ohms or less shall exist between the following pins of cable assemblies marked "GRC-103 PATCH THRU SYS-1" and "GRC-103 PATCH THRU SYS-2"; D to E, E to G, J to J and G to E. Repeat for Systems 1 and 3.

g. Using the "CABLE REPEATER PATCH THRU" patch cord connect between the TD-754 "PATCH THRU SYS-1" and TD-754 "PATCH THRU SYS-2" at the patch panel.
panel.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

h. Continuity resistance of 3 ohms or less shall exist between the following pins of cable assemblies marked "TD-754 PATCH THRU SYS-1" and "TD-754 PATCH THRU SYS-2": A to E, B to F, E to A, and F to B. Continuity shall exist between pins C and D of the same cable assemblies. Repeat for Systems 1 & 3.

i. Continuity resistance of 5 ohms or less shall exist between the following:

(1) Phone binding Post A at the power entrance box to tip of wiremold phone jack.

(2) Phone binding Post B at the power entrance box to ring of wiremold phone jack.

(3) Intercom binding Post A at the power entrance box to tip of the wiremold intercom jack.

(4) Intercom binding Post B at the power entrance box to ring of the wiremold intercom jack.

4.6.3.2 Dielectric Breakdown Tests.- The dielectric strength of all signal lines shall meet the requirements of paragraph 3.3.3.2. A non-destructive DC dielectric test instrument shall be used in performing the test.

NOTE: Take preventative measures that will preclude personnel from coming into contact with conductors under test during all dielectric and insulation resistance tests. Discharge each conductor to ground following each test to eliminate danger of shock.

a. Using appropriate test jigs or fixtures, connect the following to shelter facility ground terminal:

(1) All binding posts located at the Power Entrance Box.

(2) All orderwire conductors of all three systems.

b. Connect tester between shelter facility ground terminal and one of the orderwire conductors. Remove ground connection from the orderwire conductor.

c. Adjust tester to 500 volts DC output and maintain this potential for a continuous period of not less than 5 seconds. There shall be no breakdown. Adjust the tester to 0 volts DC and re-establish the ground connection to the conductor under test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

d. Repeat steps b. and c. for all other orderwire phone and intercom wires.

4.6.3.3 Insulation Resistance Test.- Insulation resistance of all signal lines shall meet the requirements of paragraph 3.3.3.3 when tested in accordance with the following paragraphs. A megohmeter tester or equivalent shall be used in performing the test.

a. Repeat step a. of paragraph 4.6.3.2.

b. Repeat step b. of paragraph 4.6.3.2.

c. Adjust tester to a value of not less than 100 or more than 500 volts DC output. Maintain this potential for one minute or until the indicating meter has ceased fluctuating and indicates steady or increasing insulation resistance. The insulation resistance requirement shall be met. Re-establish ground connection to conductor under test.

d. Repeat steps b. and c. above for all other orderwire, phone and intercom wires.

4.6.4 Video (rf) system wiring and components installation tests.-

4.6.4.1 Continuity tests.- The point to point continuity resistance of all rf cable assemblies (inner conductor to inner conductor and shield to shield) shall meet the requirements of paragraph 3.3.4.1. Test procedures shall be as follows:

From Patch Panel Marked	To Cable Assembly Marked
TD-202 12 Ch PCM OUT SYS-1	TD-202 PCM OUT SYS-1
TD-202 12/24 Ch PCM IN SYS-1	TD-202 PCM IN SYS-1
TD-202 TIM IN SYS-1	TD-202 TIM IN SYS-1
TD-202 TIM OUT SYS-1	TD-202 TIM OUT SYS-1
TD-202 PCM OUT-2 SYS-1	TD-202 PCM OUT-2 SYS-1
TD-202 PCM IN-2 SYS-1	TD-202 PCM IN-2 SYS-1
TD-202 TIM OUT-2 SYS-1	TD-202 TIM OUT-2 SYS-1
TD-754 12 Ch PCM OUT SYS-1	TD-754 PCM OUT SYS-1
TD-754 12/24 Ch PCM IN SYS-1	TD-754 PCM IN SYS-1
TD-754 TIM IN SYS-1	TD-754 TIM IN SYS-1
TD-754 TIM OUT SYS-1	TD-754 TIM OUT SYS-1
TD-754 PCM IN-2 SYS-1	TD-754 PCM IN-2 SYS-1
TD-754 PCM OUT-2 SYS-1	TD-754 PCM OUT-2 SYS-1
TD-754 TIM OUT-2 SYS-1	TD-754 TIM OUT-2 SYS-1
AN/GRC-103 12 Ch PCM OUT SYS-1	GRC-103 PCM SYS-1
AN/GRC-103 12/24 Ch PCM IN SYS-1	GRC-103 VIO TR SYS-1
AN/GRC-103 TIM OUT SYS-1	GRC-103 RCVR TIM SYS-1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

From Patch Panel Marked	To Cable Assembly Marked
AN/GRC-103 24 Ch Ch RAD PCM OUT	GRC-103 VID 24 Ch SYS-1
TD-202 24 Ch RAD PCM OUT	TD-202 FROM RAD RCVR SYS-1
TD-202 24 Ch RAD PCM IN SYS-1	TD-202 RAD XMTR SYS-1
TD-754 FROM CABLE SYS-1	TD-754 FROM CABLE SYS-1
TD-754 TO CABLE SYS-1	TD-754 TO CABLE SYS-1
VID ENT BOX FROM CABLE SYS-1	VID ENT BOX IN (M) SYS-1
VID ENT BOX TO CABLE SYS-1	VID ENT BOX OUT (F) SYS-1
AN/GRC-103 LOOPBACK SYS-1	AN/GRC-103 LOOPBACK SYS-1
PIN A	PIN A
PIN B	PIN B
PIN C	PIN C
PIN D	PIN D

b. Repeat steps of 4.5.4.1 for systems 2 and 3.

4.6.4.2 Dielectric breakdown and insulation resistance tests.- The dielectric strength and insulation resistance shall meet the requirements of paragraph 3.3.4.2. Test procedures shall be as follows:

a. Remove all lightning protectors elements from the video entrance box.

b. Apply test potential of 1500 volts dc across each rf connector and ground patch at the patch panel.

c. Replace lightning protector elements and repeat test for all VID ENT BOX rf connectors with a test potential of 1100 volts.

d. Apply test potential of 1700 Volts RMS, 25-100 Hz between each antenna connector and ground at the ANT ENT BOX.

4.7 Systems operation test.- Install all operational equipment in their respective rack locations and connect all power, signal (audio) and rf cable assemblies to their designated receptacles and connectors.

4.7.1 24 Channels Radio - To - Cable conversion operational check.- (See Figure 1 for block diagram test setup)

a. Position TD-660's and TD-754 outside the AN/TRC-152 so as to facilitate connections to the video entrance box.

b. Fabricate two cable assemblies to interconnect the external TD-754's with the video entrance box connectors. The cable assemblies shall contain one UG-1837 connector at one end and a female and male mhv

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

connectors at the other end. The male pin at the UG-1837 shall be connected to the female mhv connector; the female of the UG-1837 shall be connected to the male mvh connector.

c. Using one of the fabricated cable assemblies interconnect an external TD-754 to SYS-1 video entrance connector. Repeat for SYS-2 video connector using the remaining external TD-754.

d. Interconnect external TD-754's and TD-660's as shown in Figure 1.

e. At the mux patch panel make the following cable connections using "mux patch cords":

TD-754 SYS-1	TO	TD-202 SYS-1
12/24 Ch PCM IN		12 Ch PCM OUT
12 Ch PCM OUT		12/24 Ch PCM IN
TIM OUT		TIM IN
TIM IN		TIM OUT
PCM IN-2		PCM OUT-2
PCM OUT-2		PCM IN-2

TD-754 SYS-2	TO	TD-202 SYS-2
12/24 Ch PCM IN		12 Ch PCM OUT
12 Ch PCM OUT		12/24 Ch PCM IN
TIM OUT		TIM IN
TIM IN		TIM OUT
PCM IN-2		PCM OUT-2
PCM OUT-2		PCM IN-2

f. At the cable patch panel make the following cable connections using "cable patch cords":

TD-754 SYS-1	TO	VID ENT BOX SYS-1
TO CABLE		TO CABLE
FROM CABLE		FROM CABLE

TD-754 SYS-2	TO	VID ENT BOX SYS-2
TO CABLE		TO CABLE
FROM CABLE		FROM CABLE

g. At the radio patch panel make the following cable connections using "radio patch cords":

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

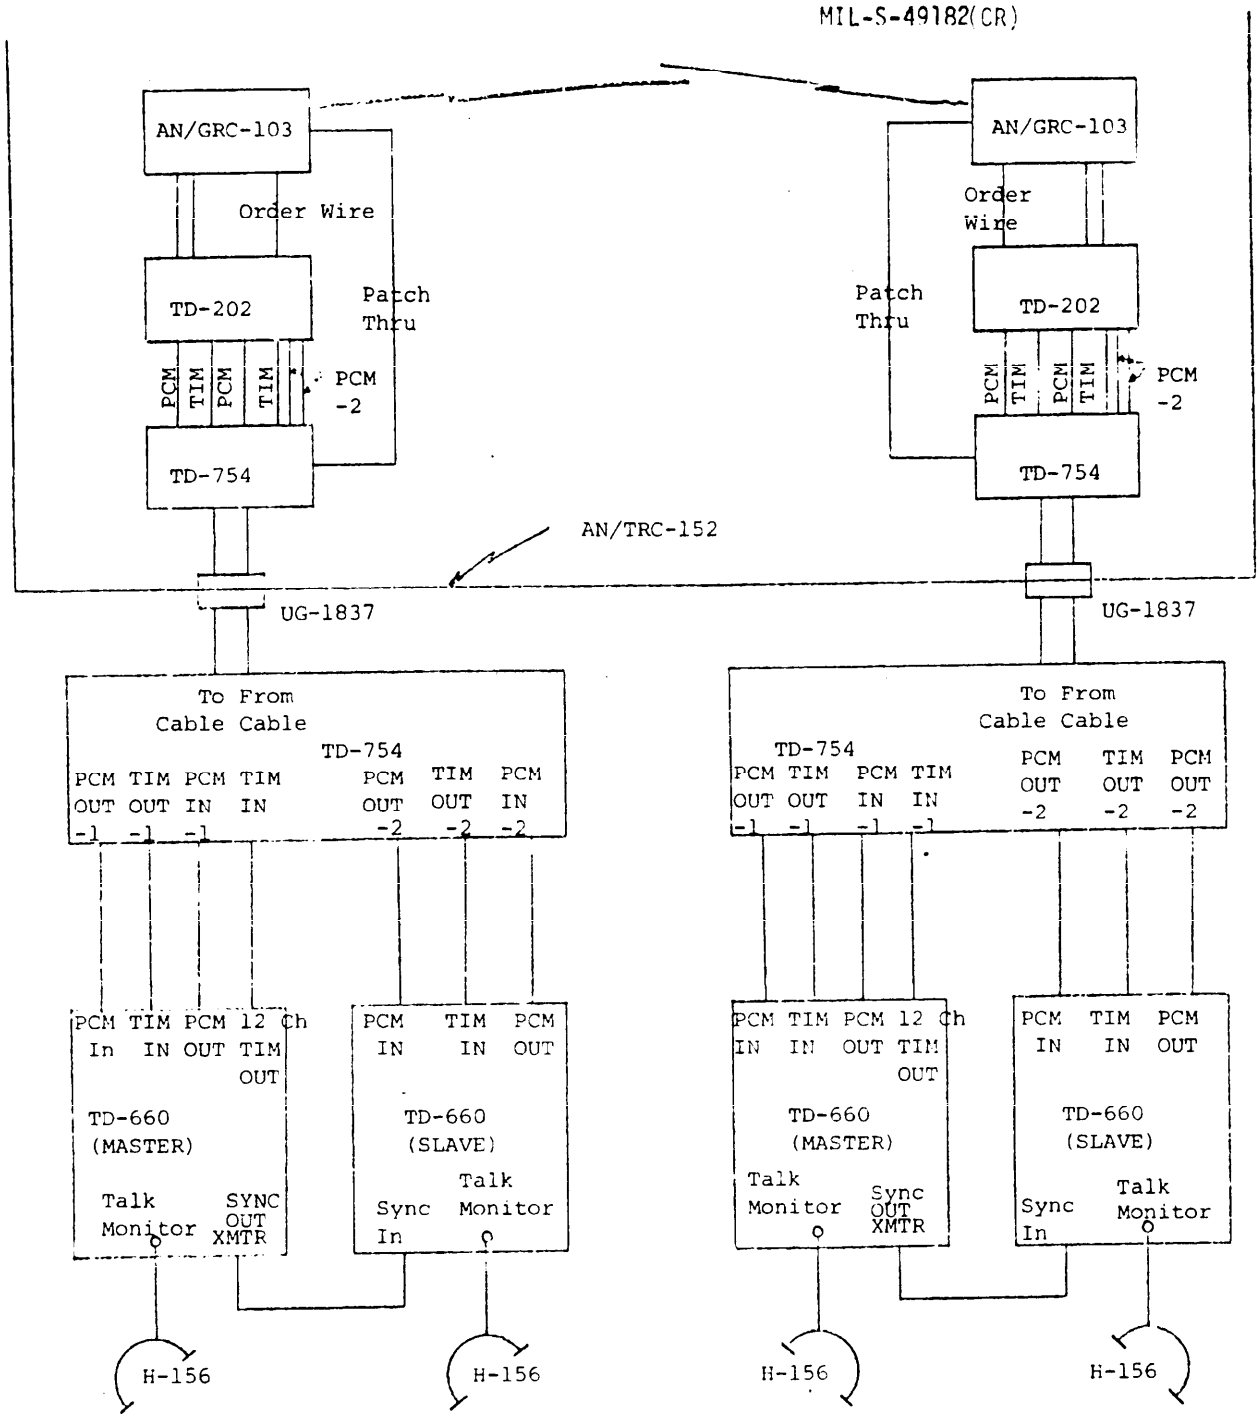


FIGURE 1 Twenty-Four Channel Test Set-Up

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

AN/GRC-103 SYS-1	TO	TD-202 SYS-1
12/24 Ch PCM IN		24 Ch RAD PCM OUT
24 Ch RAD PCM OUT		24 Ch RAD PCM IN
AN/GRC-103 SYS-2		**TD-202 SYS-2**
12/24 Ch PCM IN		24 Ch RAD PCM OUT
24 Ch RAD PCM OUT		24 Ch RAD PCM IN

h. At the order wire patch panel make the following cable connections using the "radio-to-cable patch thru" patch cords: AN/GRC-103 Patch Thru SYS-1 to Mux Patch Thru SYS-1; and AN/GRC-103 Patch Thru SYS-2 to Mux Patch Thru SYS-2.

i. At the order wire patch panel make the following cable connections using the "radio-to-cable order wire" patch cords: AN/GRC-103 Order Wire SYS-1 to Mux Order Wire SYS-1; and AN/GRC-103 Order Wire SYS-2 to Mux Order Wire SYS-2.

j. Connect Cable Assemblies CG-1859/u (40 ft) or CG-3443/u (80 ft) to ANT-1 and ANT-2 connectors at the antenna entrance box. Connect other ends to Cable Assemblies CG-718( )/G (6 ft) or CG-3444/U (3 1/2 ft) using Adapter UG-1375( )/U. Connect other ends of the CG-718( )/G or CG-3444/U to Dummy Loads DA-189/GRC. Separate the dummy loads to a distance of about 5 feet. NOTE: During the radio tuning procedures it might be necessary to move the dummy loads accordingly to receive a suitable signal, or it might be necessary to completely disconnect both dummy loads and adjust the ends of the unterminated cable assemblies until a good signal is received.

k. Perform the following procedures on each Multiplexer TD-754/G:

(1) Operate the CABLE POWER switch to OFF.

(2) Check to see that the correct plug in panels are seated firmly in their proper slots.

(3) Operate the MODE switch to 12.

(4) Operate the NORM OPR - ZERO SET - READ switch to NORM OPR.

(5) Operate both MILE switches to 1/4.

(6) Operate the TONE- OFF switch to OFF.

(7) Operate the AC POWER switch to ON. Check to see that the AC POWER and ALARMS NO CABLE CUR indicators light and the buzzer sounds. To silence the alarms depress the BUZZER OFF switch.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

e. Perform the following preliminary procedures on each Multiplexer TD-202/U:

(1) Operate OPR/TEST switch to OPR, and TRAFFIC SEL switch to 12.

(2) Operate the AC POWER switch to ON. The AC power indicator shall light and the buzzer on the TRAFFIC Alarm shall sound. To silence the alarm depress the BUZZER OFF switch.

m. Perform the following preliminary, tuning and operating procedures on each Radio Set AN/GRC-103.

(1) Set the transmitter XMTR CHANNEL and XMTR TUNE controls to the assigned transmitter channel number.

(2) Set the receiver XMTR CHANNEL control to the assigned transmitter channel number.

(3) Set the receiver RCVR CHANNEL and RCVR SIG controls to the receiver channel number. (Separate receiver and transmitter by at least 40 channels.)

(4) Set the transmitter AC POWER switch to ON/RESET and verify that the centrifugal fan starts. AC POWER lamp lights, LOW POWER lamp lights, SYNC lamp may light momentarily (lamp goes out within 10 seconds), and a buzzer may sound (press BUZZER OFF pushbutton to silence buzzer).

(5) Set receiver AC POWER switch to ON and verify that the AC POWER lamp lights, order wire unit POWER lamp lights. LOW SIGNAL lamp lights, SYNC lamp may light momentarily (lamp goes out within 10 seconds), buzzer may sound (press BUZZER OFF to silence buzzer), and loud rushing sound is heard in order wire unit handset.

(6) Set transmitter meter switch to 12 VDC. Meter shall read in the green band.

(7) Set transmitter meter switch to 28 VDC. Meter shall read in the green band.

(8) Set transmitter meter switch to 600 VDC. Meter shall read in the green band.

(9) Set transmitter switch to OSC. Meter shall read between 25% and 90% of full scale.

(10) Set transmitter switch to DOUBLER. Meter shall read between 25% and 90% of full scale.

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T03:59Z
Check the source to verify that this is the current version before use.

(11) Set transmitter meter switch to MULT. Meter shall read between 25% and 90% full scale.

(12) Set transmitter meter switch to DRIVER. Tune PWR OUT PEAK control for maximum meter reading. Meter shall read between 25% and 90% of full scale.

(13) Set transmitter switch to PWR OUT. Tune PWR OUT PEAK control for maximum meter reading. Meter shall read between 25% and 90% full scale.

(14) Set transmitter meter switch to REFL PWR. Tune receiver XMTR DUPL control for minimum transmitter reading. Check to see that receiver XMTR CHANNEL indicator is within 10 channels of the assigned transmitter channel number.

(15) Set receiver meter switch to XMTR DUPL. Meter shall read between 25% and 90% of full scale.

(16) Set receiver meter switch to REFL PWR. Meter shall read less than 20% of full scale.

(17) Set transmitter meter switch to 12 CH PCM. Adjust transmitter INPUT control until transmitter meter indicates in green band.

(18) Set receiver meter switch to +12 VDC. Meter shall read in green band.

(19) Set receiver meter switch to -12 VDC. Meter shall read in green band.

(20) Wait until SYNC lamp goes out. NOTE: The sync lamp may light momentarily, or may not light at all. Set receiver meter switch to OSC. Meter shall read between 25% and 90% full scale.

(21) Set receiver meter switch to DOUBLER. Meter shall read between 25% and 90% full scale.

(22) Set receiver meter switch to MULT. Adjust MULT PEAK control for maximum meter reading. Meter shall read between 25% and 90% full scale. LOW SIGNAL lamp will go out if distant transmitter is operating properly. (NOTE: Move the dummy loads accordingly to improve the receive signal. If the signal strength is still low remove one dummy load and leave cable assembly unterminated.) The loud rushing sound in the order wire handset shall disappear when the LOW SIGNAL lamp goes out. The buzzer may sound. Push BUZZER OFF button to silence buzzer.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:59Z
Check the source to verify that this is the current version before use.

(23) Set meter switch to RCVR SIG. Meter shall read between 25% and 90% of full scale.

(24) Push RING button on radio order wire unit of system 1. At 1600 hz signalling tone is heard at the O.W. handset and at both TD-754's.

(25) Repeat step (24) signalling from system 2 O.W.

(26) Communicate between the order wire handsets, and between the O.W. handsets and TD-754.

n. Operate external Multiplexers TD-754's and TD-660's according to their instruction manuals.

o. All equipment shall be operational. To silence the alarms depress the BUZZER OFF switches. If normal indications are not encountered during the following procedures, do not continue until proper indications are obtained. If proper indications cannot be obtained by adjustments or replacement of panels, replace the equipment.

p. The following operating procedures apply to both TD-202/U's.

(1) Operate METER SELECT switch to the following positions and check for proper indications on TEST ALIGN meter.

POSITION	INDICATION
TIM IN	GREEN
PCM IN	GREEN
TO RADIO XMTR*	HAIRLINE

*Adjust OL on panel 5A2 for hairline indication on TEST ALIGN METER, with distant TD-202/U set to FROM RADIO RCVR. Local radio must adjust PCM level for proper indications. Distant TD-202/U must adjust RL and OL on panel 5A3 for green area indication and peak indication respectively.

FROM RADIO RCVR**	HAIRLINE

**Adjust RL on panel 5A3 for green area and CL on panel 5A3 for peak indication with distant TD-202/U set to RADIO XMTR. Distant TD-202/U must adjust OL on panel 5A2 for hairline indication. Distant radio must adjust PCM level for proper indications.

(2) Operate SERV SEL to O. At distance radio transmitter set multimeter selector switch to 1 KC MOD (test tone). Adjust ORDER WIRE control knob until TEST ALIGN indicates in yellow area. Turn distance radio test tone off.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:59Z
Check the source to verify that this is the current version before use.

(3) Repeat step (2) with distant TD-202/U and local radio transmitter test tone on. After adjustment turn test tone off.

(4) Set SERV SEL switch to the positions and observe TEST ALIGN meter for proper indications. Make necessary voltage adjustments.

SWITCH POSITION	METER INDICATION
+10	Hairline
+4.5	Hairline
-4.5	Hairline

(5) Set SERV SEL switch to the following positions. If TEST ALIGN meter does not indicate in green area, replace appropriate panel.

A Panel 5A3 (Input from radio present and RL adjusted)
B Panel 5A4
C Panel 5A5 (CL adjusted; may not be in green area)
D Panel 5A5

q. The following procedures apply to both TD-754/G's.

(1) Operate METER SELECT switch to the following positions and check for proper indications on TEST ALIGN meter:

POSITION	INDICATION
TIM IN	GREEN
PCM IN-1	GREEN

(2) Operate METER SELECT switch to SERV FAC.

(3) Perform the following order wire communication checks and alignments:

(a) Connect headset or handset to the HEADSET connector of each combiner.

(b) Momentarily operate the TALK OFF SIG switch on one combiner to SIG. The CALL indicator shall light and the buzzer shall sound on the other combiner. Place TALK OFF SIG switch to OFF.

(c) Repeat step (b) reversing the process.

(d) Place the TALK OFF SIG switches of both combiners to TALK. Communicate between the headsets connected to the combiners.

(e) Operate the SERV SEL switch to "0".

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

(f) Operate TONE OFF switch, located on panel 12A2 of both combiners to TONE.

(g) Adjust CRL potentiometer, located on panel 12A3, of both combiners to mid-scale green TEST ALIGN meter indication.

(h) Operate the TONE OFF switch to OFF.

(4) Operate the SERV SEL switch to the following positions and check for hairline indication on TEST ALIGN meter. Do not continue until proper indications are obtained. If adjustments are necessary, set appropriate control for hairline indication on TEST ALIGN meter. If proper indication cannot be obtained, replace appropriate fuse.

+28V	Subassembly 12A1	
+12V	Subassembly 12A1	(+12V ADJ)
+ 4V	Subassembly 12A1	(+ 4V ADJ)
- 6V	Subassembly 12A1	(- 6V ADJ)

(5) Operate SERV SEL switch to the following positions. If TEST ALIGN meter does not indicate in green area, replace appropriate panel. Do not continue until proper indications are obtained.

A	Panel 12A4
B	Panel 12A4
C	Panel 12A4
D	Panel 12A4
E	Panel 12A4
F	Panel 12A4
G	Panel 12A4
H	Panel 12A4
J	Panel 12A4
K	Panel 12A4
M*	Panel 12A3
O	Panel 12A2

*TEST TONE switch to ON.

r. Perform the following two-way speech tests:

(1) Operate all selector switches on the TD-660 to OFF.

(2) Connect Handset H-156/U to the TALK MONITOR receptacle of each TD-660.

(3) Operate selector switch III to TALK.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

(4) Starting at channel 1 position of selector switch IV, perform a two-way speech test for each channel in sequence, observing that each channel gives satisfactory speech quality.

s. Repeat c thru r above substituting system 3 for system 2 respectively.

4.7.2 12 Channels Radio - To - Cable conversion operational check.- (See Figure 2 for block diagram test setup)

a. Interconnect the external TD-754's and TD-660's as shown in Figure 2.

b. At the mux patch panel make the following cable connections using "Mux patch cords".

TD-754 SYS-1	TO	AN/GRC-103 SYS-1
12 Ch PCM OUT		12/24 Ch PCM IN
12/24 Ch PCM IN		12 Ch PCM OUT
TIM IN		TIM OUT
TD-754 SYS-2	**TO**	**AN/GRC-103 SYS-2**
12 Ch PCM OUT		12/24 Ch PCM IN
12/24 Ch PCM IN		12 Ch PCM OUT
TIM IN		TIM OUT

c. At the cable patch panel make the following cable connections using "cable patch cords".

TD-754 SYS-1	TO	VID ENT BOX SYS-1
TO CABLE		TO CABLE
FROM CABLE		FROM CABLE
TD-754 SYS-2	**TO**	**VID ENT BOX SYS-2**
TO CABLE		TO CABLE
FROM CABLE		FROM CABLE

d. At the order wire patch panel make the following cable connections using the "radio to cable patch thru" patch cords: AN/GRC-103 Patch thru SYS-1 to Mux Patch Thru SYS-1 and AN/GRC-103 Patch Thru SYS-2 to Mux Patch Thru SYS-2.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

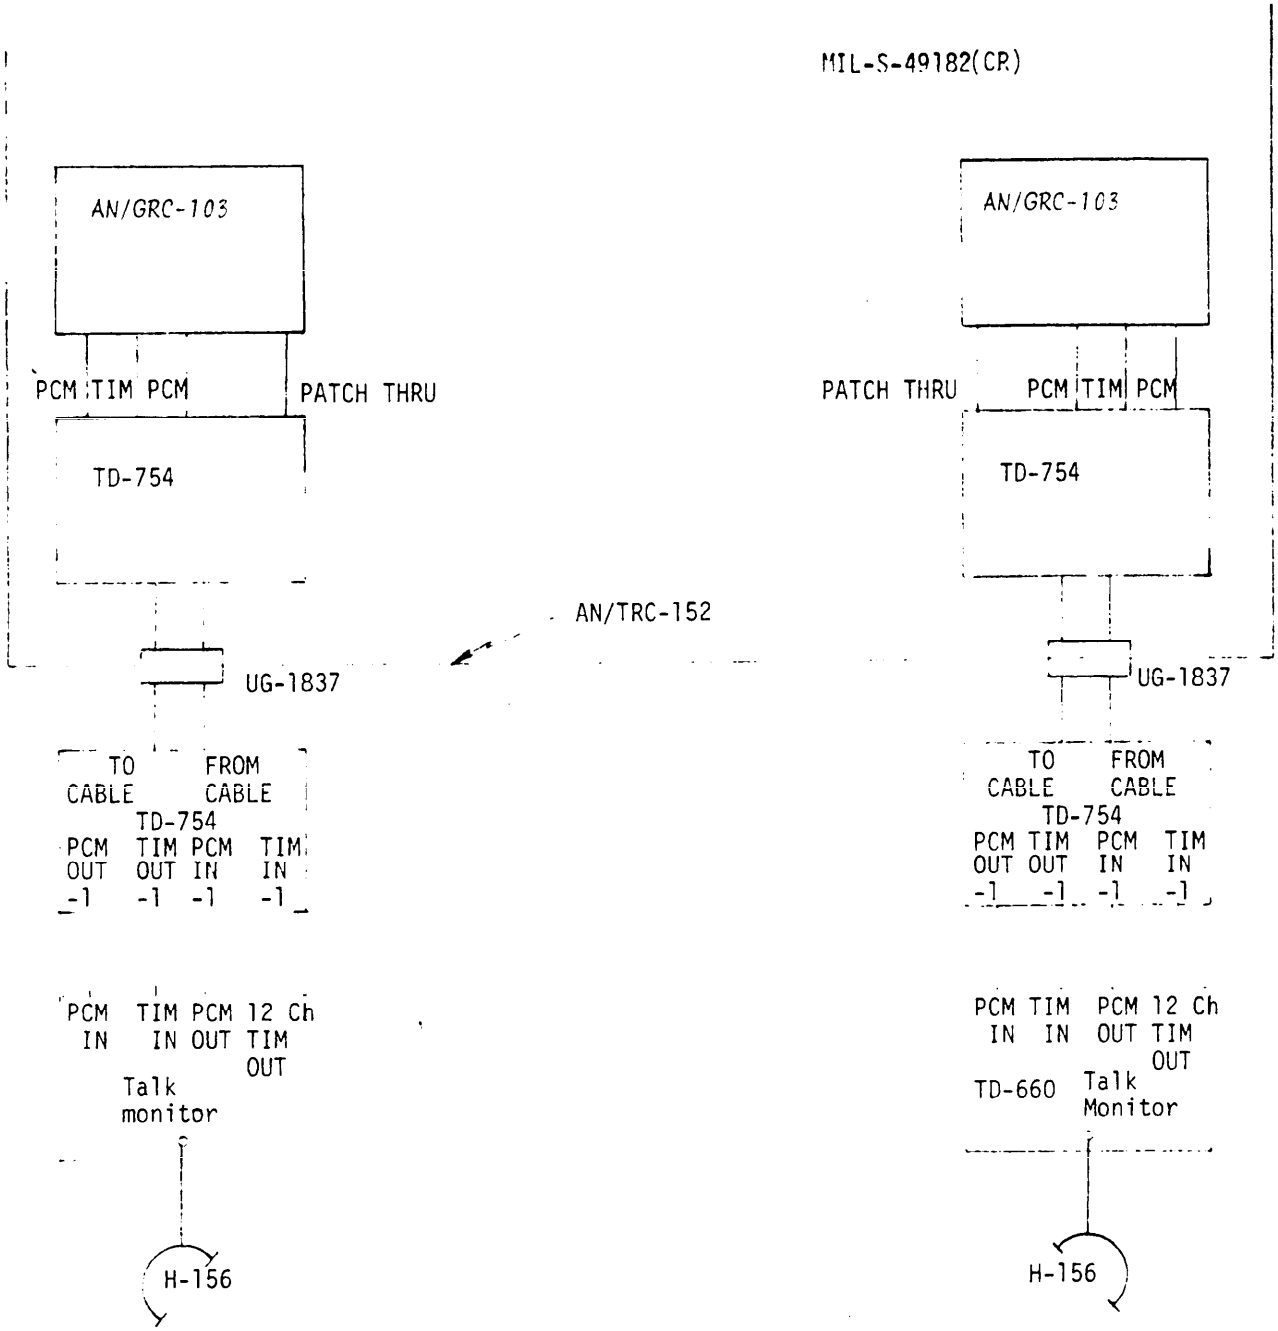


FIGURE 2 TWELVE CHANNEL TEST SET-UP

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

e. Repeat procedure 4.7.1.r.

f. Repeat procedures a. thru e. above substituting SYS-3 for SYS-2.


4.8 Vehicular Transportation test.- The shelter facility shall be secured (and blocked to prevent shifting) to a government furnished 2 1/2 ton, M-35, truck and transported over the specially prepared course described in para 4.8.1 for 10 laps at each of the speeds 5 mph, 10 mph, 15 mph and 18-20 mph. A lap is defined as traversing the course in one direction. The facility shall meet the requirements of paragraph 3.5 after completion of the test. (Note: The shelter facility shall be loaded to simulate the AN/TRC-151(V) using live loads.) (See 6.1)

4.8.1 Vehicular Transportation Course.- T e course for the military truck transportation test shall have twelve (12) 4-inch by 8-inch timbers placed 25 feet apart on the 8-inch face and with the 4-inch face fully above ground. The top edges shall have 1 x 1 inch chamfers. The sixth and twelfth timbers shall be placed at 45 degrees to the travel, and all other timbers shall be placed perpendicular to the direction of travel. The timbers shall be anchored down securely by any effective means. The surface on which the timbers are placed shall be hard and level.

4.9 Rail Transport, Impact test.- The shelter facility loaded as specified in paragraph 4.8 secured to a flatcar shall be impacted by a loaded gondola car. The test shall be performed on a straight and level stretch of track. The test flatcar with its timber blocking and shelter facility tie down slings, shall be as specified in Figure 3 and shall meet the provisions of the test as specified in para 4.9.1. The test flatcar (less the shelter facility) and the two empty flatcars coupled to it shall each weigh 45,000 to 55,000. The loaded gondola car shall meet the provisions of the test as specified in paragraph 4.9.2 and shall have a total weight of 165,000 pounds. The loaded gondola car totaling 165,000 pounds traveling at 9 miles per hour (or equivalent energy conditions acceptable to the Government Technical Representative) shall be impacted against the stationary loaded test car coupled to the two empty flatcars with brakes off. The test shall consist of four impacts. The first two impacts shall be with the door end of the shelter facing the loaded Gondola car; the second two impacts shall be with the door end of the shelter facing the opposite direction from the loaded Gondola car. The lashing, blocking and wedges holding the shelter facility in place shall be tight at the start of each run. If the blocking is torn loose or the lashing is broken during impact, the run shall be repeated. After each impact the shelter facility shall meet the requirements of paragraph 3.6.

4.9.1 Test flatcar.- The wooden planking of the test flatcar bed shall be in good condition. All 6 x 6 inch blocking shall be secured to the bed of the flatcar using 10 inch spikes on 12 inch centers. The blocking along the door end and opposite end of the shelter shall fit tightly against the

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

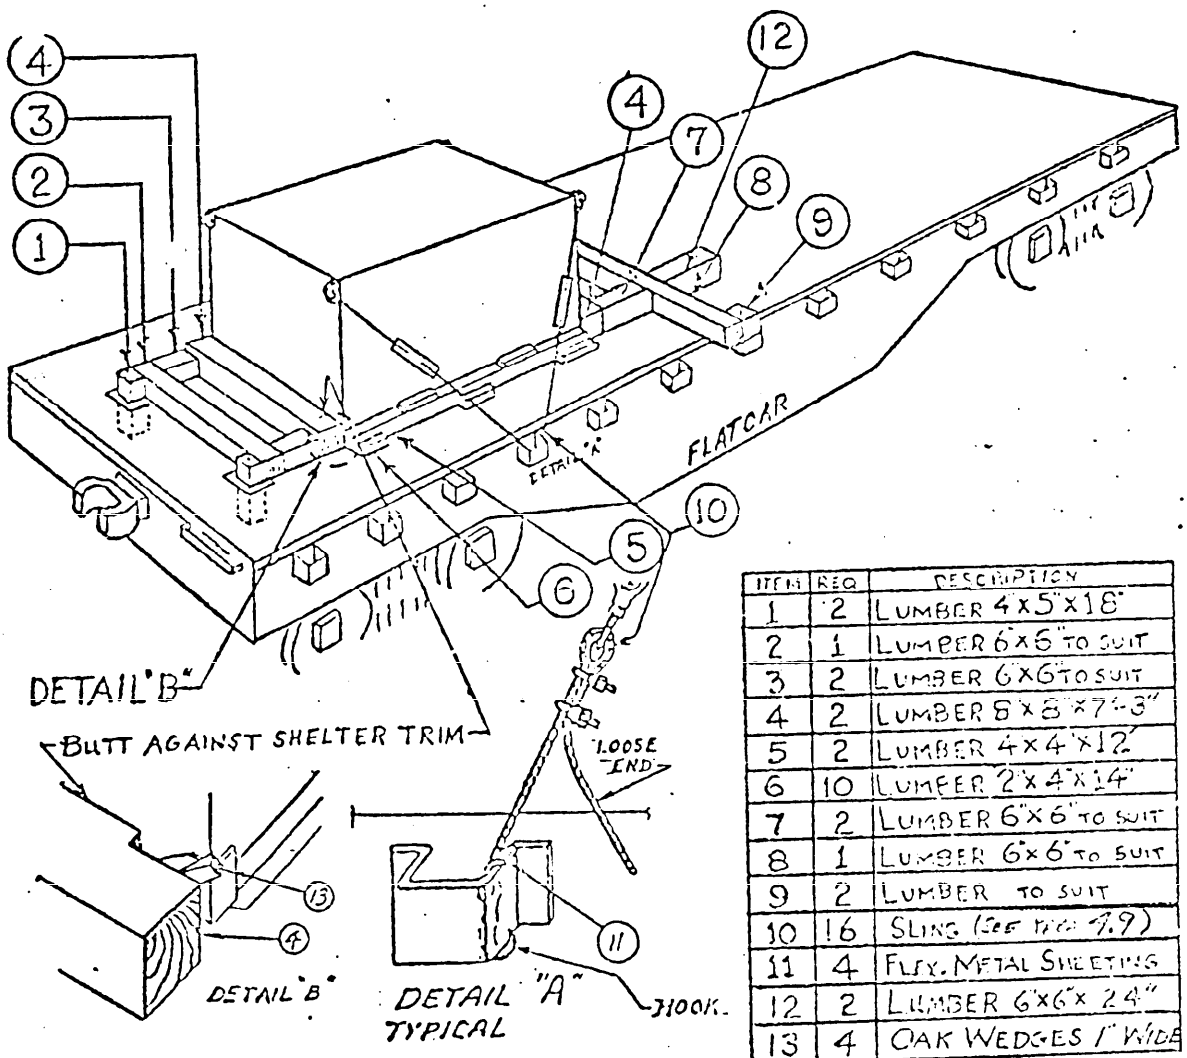

ITEM	REQ	DESCRIPTION
1	2	LUMBER 4"x5"x18"
2	1	LUMBER 6"x6" TO SUIT
3	2	LUMBER 6"x6" TO SUIT
4	2	LUMBER 8"x8"x7'-3"
5	2	LUMBER 4"x4"x12'
6	10	LUMBER 2"x4"x14"
7	2	LUMBER 6"x6" TO SUIT
8	1	LUMBER 6"x6" TO SUIT
9	2	LUMBER TO SUIT
10	16	SLING (See Fig. 7.9)
11	4	FLEX. METAL SHEETING
12	2	LUMBER 6"x6"x 24"
13	4	OAK WEDGES 1" WIDE

NOTES:
a. The blocking lumber shall be notched to accomodate towing eyes and bolts. Wedge item 13 between towing corner forging and item 4 notch (Detail B)
b. The blocking lumber shall be rigidly fastened to the floor of the flatcar.

FIGURE 3 SHELTER SECURED ON FLATCAR

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

corner castings along the full length of the castings except as necessary to clear the towing shackles, this shall be accomplished by means of power sawed notches. The blocking along the other two sides of the shelter shall fit tightly against the corner castings, along the full length of the castings. These four blocking members shall be notched or shimmed to contact the trim along the sides of the shelter. The 4 x 4 and 2 x 4 inch blocking shall be nailed to the bed of the flatcar as shown in Figure 3. All other blocking shall be firmly secured as shown in the figure. Lashing shall consist of four wire rope slings, each including 3/8 inch diameter 6 x 19, flexible steel, preformed wire rope (having a breaking strength of 10,600 pounds minimum), turnbuckles, two hooks, with thimbles and fasteners as required; the breaking strength of the sling shall be 9000 pounds minimum. Before each impact, each sling shall be taut (600 - 800 pounds tension).

4.9.2 Loaded Gondola Car.- The load in the loaded gondola car shall be one of the following:

a. A coarse size of either coal, crushed stone, gravel, concrete or metal scrap (other than sheet metal, metal shavings or other springy forms of metal).

b. Chunk, slab, block or plate forms of the preceding acceptable materials, constrained to prevent shifting.

4.10 Drop tests.-

4.10.1 Flat drop.- The shelter facility loaded as in para 4.8 will be lifted 18 inches from the ground and allowed to fall freely with the skids impacting onto a hard substantial concrete surface. The test shall be performed once. Upon completion of this drop, the facility shall meet the requirements of para 3.7.

4.10.2 Rotational drop.- The shelter facility loaded as in Para 4.8 shall have one skid (or the knuckles of the skids) resting on a nominal 4 inch high timber. The outer edge of the opposite skid (or the opposite knuckles of the skids) shall be raised 18 inches and the shelter facility shall be allowed to fall freely onto a hard substantial concrete surface. This impact shall be performed four times, once for each bottom edge of the shelter facility. On completion of these drops, the shelter facility shall meet the requirements of para 3.7.

4.11 Watertightness Test.- The shelter facility, without the use of any additional external sealing, caulking, taping, etc. shall be subjected to the following two part test. (NOTE: Perform tests with inside covers of entrance boxes removed.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

a. Each of the five exposed surfaces of the shelter facility, with covers closed, shall be sprayed with water from nozzles, model G29SQ (or GG29SQ) as made by Spraying Systems Co., Bellwood, Illinois, or equal, pointing directly at the surface and arranged to provide uniform coverage of the surface. Each end panel shall be tested using nine nozzles, each side using nine nozzles, and the roof using four nozzles. Each nozzle shall operate at a pressure of forty psig at the nozzle, and shall be located nineteen inches from the panel with the exception of the roof nozzles which shall be at a distance of thirty-two inches. All of the five surfaces shall be simultaneously subjected to the test of this paragraph unless otherwise specified by the contracting officer. (See Figure 4 for nozzle location.) Each panel shall be sprayed for a period of 20 minutes. (If the watertightness test is to be followed by the fording test of para 4.12, the bottom row of nozzles may be eliminated with the exception of the nozzles facing the door end panel.) Upon completion of the above test the shelter facility shall meet the requirements of para 3.8. To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the Government at the time of testing. After this determination, the holes shall be sealed with rivets and sealer.

b. Open all covers to operating position (with exception of the air conditioner covers and the door vent panel at the rear of the shelter) and repeat a. above.

4.12 Fording test.- The shelter facility shall be immersed in water for 1 hour to a depth of 21 inches (measured from the bottom of the skids) and meet the requirements of para 3.9. No special fording kits shall be used. The shelter shall be restrained from floating by external tie downs. To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the Government at the time of testing. After this determination, the holes shall be sealed with rivets and sealer.


4.13 Humidity test.- A hardware sample of five of each size and type (if the total quantity of any size or type is less than five, all shall be tested) of bolt, screw, nut, flat washers, lock washers and rivnuts shall be randomly selected for test. The hardware sample shall be subject to the humidity test specified in Method 507, Procedure II of MIL-STD-810 to determine conformance to the requirements of paragraph 3.10.

4.14 Mounting insert tests.-

4.14.1 First article and Group C insert test.- Four of each size insert shall be randomly selected for test. Each insert shall be tested with an axial load followed by a torque load in accordance with Table V. After test the requirements of paragraph 3.11 shall be met. Failure of any insert shall be cause for rejection of the sample equipment. This test shall be conducted prior to installation of brackets, racks, etc.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

TEST SCHEDULE: - CONTINUED. TABLE VI

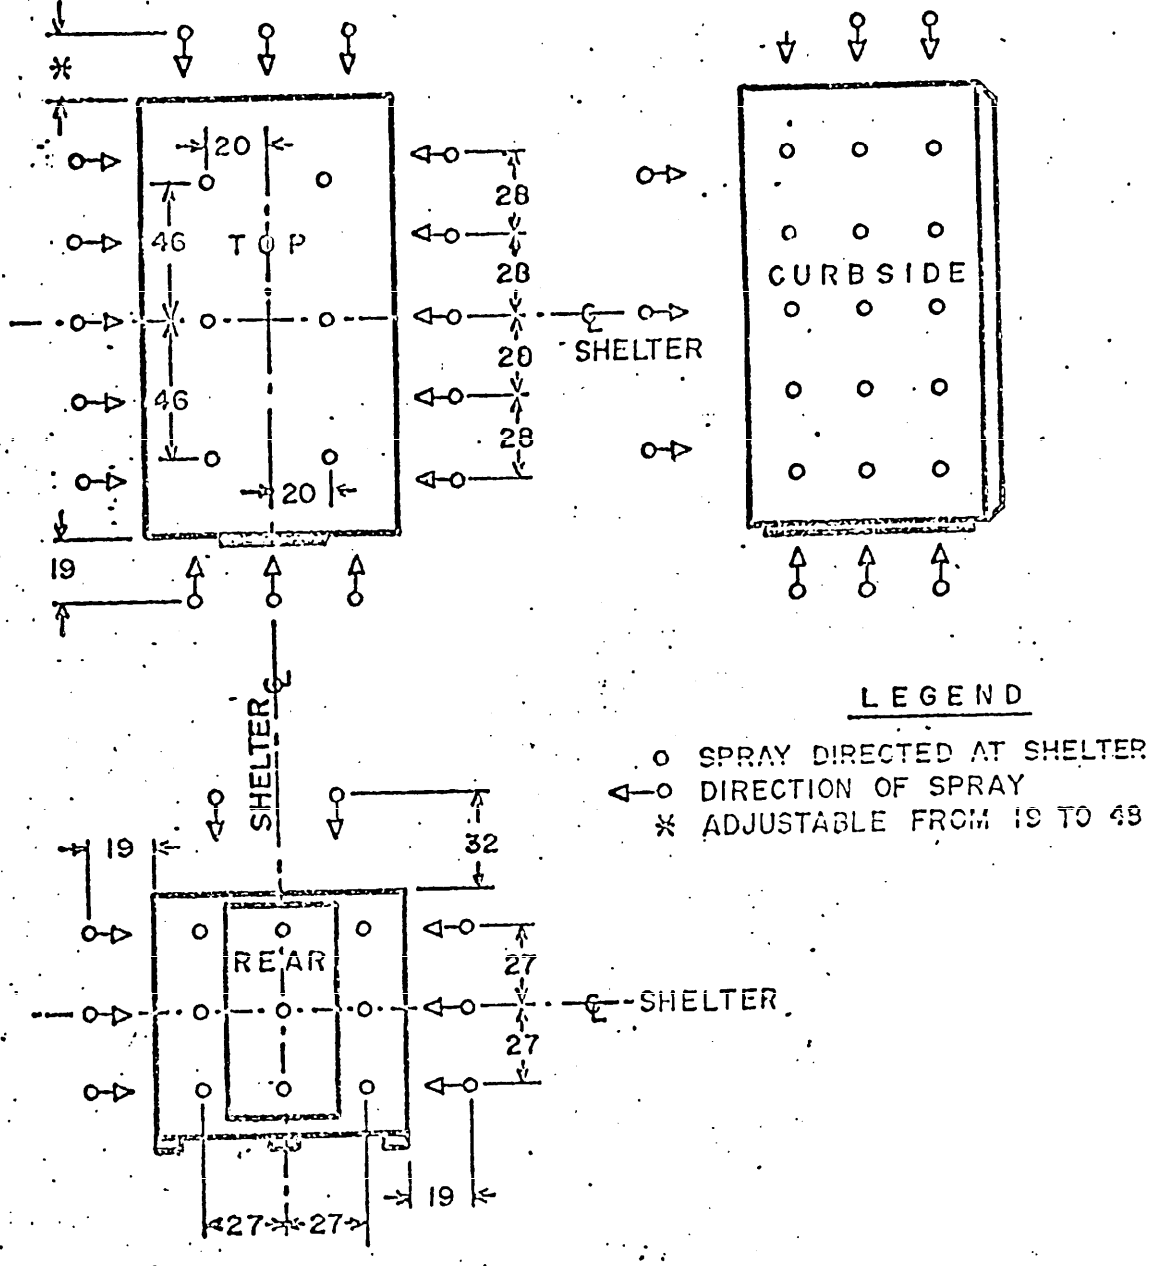

NOTES

1 NOZZLES SHALL BE PERPENDICULAR TO SHELTER.
2 UNLESS OTHERWISE SHOWN ALL DIMENSIONS SHALL BE TAKEN FROM INDICATED CENTER LINES.
3 GAGES SHALL BE PERMANENTLY INSTALLED IN PIPING TO INDICATE PRESSURE AT REMOTE NOZZLES.
4 ROADSIDE NOZZLE LOCATIONS SAME AS CURBSIDE.
5 FRONT NOZZLE LOCATIONS SAME AS REAR.
6 DIMENSIONS ARE IN INCHES.

NOZZLE LOCATIONS

FIGURE 4

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

4.14.2 Group B insert test.- Five of each size insert (if the total quantity of any size is less than five, all of that size shall be tested) shall be randomly selected in each sample equipment. Each selected insert shall be tested in accordance with Table V. After test the requirements of 3.11 shall be met. Failure of any insert shall be cause for rejection of the sample equipment. This test shall be conducted prior to installation of brackets, racks, etc.

TABLE V Mounting Insert Loads

Insert	First Article and Group C Test		Group B Test	
	Axial (Lbs)	Torque (In Lbs)	Axial (Lbs)	Torque (In Lbs)
5/16-18	2000	100	1000	100
1/4-20	1300	60	650	60
#10-32	600	23	300	23

4.15 Acoustical noise test.- The shelter facility shall be located in an area remote from excessive machinery, vehicle and other noise operating sources to reduce ambient noise to a minimum, with the shelter door closed. Only necessary test personnel shall be present in the shelter. Using Octave Band Analyzer, General Radio Corporation, Model 1558A, or equal, and Microphone, Piezoelectric, General Radio Corporation Model 1560-P6 or equal, record ambient noise levels over the frequency ranges specified in 3.12. Operate the exhaust blowers and repeat noise level recording at the same frequency levels as above. The noise levels, corrected from ambient shall meet the requirements of 3.12.

4.16 Testing of solderless terminal-lug connections.- Connections made with solderless terminal-lug shall be tested for conformance to 3.22.4.

4.17 Inspection for interchangeability.- The dimensions listed below shall be gaged or measured to determine compliance with the physical interchangeability requirements of 3.24. When a dimension is not within specified or design limits, it shall be considered a defect.

a. Size and mounting dimensions of brackets and mounting plates.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

b. Size and mounting dimensions of racks and cabinets.

4.18 Visual and mechanical inspection.- The shelter facility shall be examined for the defects listed in Standard MIL-STD-252, the requirements of 3.25 and Table VI.

TABLE VI Classification of Visual and Mechanical Defects

Classification	Defects
Major	1. Mounting plates missing or mislocated.
	2. Aircraft loading data plate, instruction or nameplate omitted, incorrect or illegible.
	3. Welds - cracked or porous. Inspection of welded assemblies, such as equipment racks, entrance boxes, etc., should be made prior to final paint application.
	4. Sealer improperly applied (holes, separations, or lack of adhesion).
	5. Mounting inserts missing or mislocated.
	6. Burrs or sharp edges in wire duct not removed.
	7. Equipments or bracketry loose or missing.
	8. Doors, etc., inoperative.
	9. Electrical receptacles, switches, jacks, connectors, wire ducts or other electrical components loose, improperly located or inoperative.
	10. Locking or holding devices missing or inoperative.
	11. Gaps between sections of wire duct exceed 1/16".
	12. The blower housing does not align properly with the mounting inserts of the shelter facility.
	13. Ground stud not properly sealed.
	14. Bulkhead Power and Signal connector fasteners not sufficiently tight.
	15. Electrical schematics missing.
Minor	1. Doors not easily operable.
	2. Fastening devices difficult to operate.
	3. Finish - abrasions or scratches.
	4. Burrs and sharp edges on bracket not removed.
	5. Screws loose.
	6. Gaskets, not completely and securely adhered.
	7. Electrical schematics not properly adhered to wall.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

4.19 Quality conformance inspection of preparation for delivery.- Preparation for delivery shall be inspected in accordance with Specification MIL-P-116 to determine conformance to the requirements of Section 5.

4.20 Rough handling test (Preparation for delivery).- When rough handling test in accordance with Specification MIL-P-116 is required by the contract, the following functional tests shall be conducted to determine freedom from operation malfunction caused by rough handling:

Paragraph 4.6 Power and Signal Wiring

Paragraph 4.18 Visual and Mechanical

5. PACKAGING

5.1 Packaging requirements.- Packaging requirements shall be in accordance with MIL-P-55507.

6. NOTES

6.1 Intended use.- The Shelter, Electrical Equipment S-584( )/TRC-152(V) is the shelter facility portion of the AN/TRC-152(V) and it is used to house the following operational equipments:

a. 3 ea. AN/GRC-103 Radio Sets

b. 3 ea. TD-754( )/G Multiplexers

c. 3 ea. TD-202( )/U or TD-1250( )/U Multiplexers

d. 1 ea. LS-147F/FI Intercommunication Station

e. 1 ea. TA-312( )/PT Telephone Set

6.2 Ordering data.- Procurement documents should specify the following:

a. Title, number and date of this specification and any amendment thereto.

b. First Article and Group C inspection of the shelter facility requires use of contractor fabricated dummy loads or the government furnished live loads (operational equipment) as specified in the bid request and contract.

c. A list of government furnished equipments required as part of the S-584( )/TRC-152(V).

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the current version before use.

d. A list of equipments to be government loaned for testing purposes.

6.3 Inspection.- Inspection is the examination or testing, or both of supplies to determine compliance with applicable requirements. Sampling is an element of inspection.

6.3.1 Examination.- Examination consists of simple, generally nondestructive determinations of compliance, without use of special test equipment.

6.3.2 Testing.- Testing consists of determinations of compliance, using technical means.

6.4 Group C inspection.- Approval to ship may be withheld, at the discretion of the government, pending the decision from the contracting officer on the adequacy of corrective action. (See 4.5.3.4)

6.5 Nomenclature.- The parenthesis in the nomenclature will be fdeleted or replaced by a letter identifying the particular design, for example: S-584R/TRC-152(V). The contractor should apply for nomenclature in accordance with the applicable clause in the contract.

6.6 Verification inspection.- Verification by the government will be limited to the amount deemed necessary to determine compliance with the contract and will be limited in severity to the definitive quality assurance provisions established in this specification and the contract. The amount of verification inspection by the government will be adjusted to make maximum utilization of the contractor's quality control system and the quality history of the product.

6.7 Tropicalization of material.- All materials of construction are specified on the drawings and are Fungus-inert. Substitution of any materials other than specified must be approved by the contracting officer. The material will only be approved after the contractor tests the material for Fungus-Resistance satisfactorily in accordance with requirement 508 of MIL-STD-810.

Custodian:
ARMY - CR

Preparing Activity:
ARMY - CR

Project No. 5410-A234

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

to facilitate observation and ... shall be scribed on each side of the area

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-S-49182 (CR)

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

HQ. USA CORADCOM
ATTN: DRDCO-CM-DM
Fort Monmouth, NJ 07703

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426 EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:59Z
Check the source to verify that this is the currentversion before use.

FOLD

HQ, USA CORADCOM
ATTN: DRDCO-CM-DM
Fort Monmouth, NJ 07703

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID



HQ, USA CORADCOM
ATTN: DRDCO-CM-DM
Fort Monmouth, NJ 07703

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:59Z
Check the source to verify that this is the current version before use.

aspects of the [illegible]