INCH-POUND

MIL-W-48856B (AR)
w/ AMENDMENT 5
8 March 2019
SUPERSEDING
MIL-W-48856B (AR)
w/Amendment 4
25 September 2002

MILITARY SPECIFICATION

WARHEAD SECTION, GUIDED MISSILE, H.E. M258E6 and M258E7 LOADING, ASSEMBLING AND PACKING

Inactive for new design after 8 March 2019

This Specification is approved for use by the U.S. Army Armament Munitions and Chemical Command, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification contains the quality assurance provisions for the loading, assembling, and packing of warhead section. Guided Missile, H.E., M258E6 and Guided Missile, H.E., M258E7.

1.2 Classification.

M258E6 - The warhead section provides the explosive output to detonate the Stinger Missile either upon impact with a target or an automatic time out.

M258E7 - Provides all the functionality of the M258E6, with the additional ability to detonate the Stinger Missile upon sensing proximity to a target.

Comments, suggestions, or questions on this document should be addressed to the Commander, U.S. Army ARDEC, ATTN: RDAR-EIQ-SA, Picatinny Arsenal, NJ 07806-5000 or emailed to usarmy.picatinny.ardec.list.ardec-stdzn-branch@mail.mil. Since contact information may change, you may want to verify the currency of this address information using the ASSIST Online database at https://assist.dla.mil/

AMSC N/A FSC 1336

DISTRIBUTION STATEMENT A. Approved for public release; Distribution is unlimited to DoD .

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements of documents cited in sections 3 and 4 of this specification, whether or not they are listed.

2.2 Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

DEPARTMENT OF DEFENSE STANDARDS

MIL-E-46495 - Explosive Composition. HTA-3

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification for

MIL-F-48863 - Fuze, Guided Missile, M934E6 Parts Assembly, loading and packing for

MIL-P-50977 - DELETED

(Copies of these documents are available online at http://quicksearch.dla.mil/)

2.2.2 Other Government documents, drawings, and publications. The following other Government documents, drawings and publications below form a part of this document to the extent specified herein. Unless otherwise specified, the issues are those cited in the solicitation.

U.S. ARMY ARMAMENT RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC) DRAWINGS

9210109 – PBX, Pellet
9297066 – Fuze, Guided Missile: M934E6
9322206 – Packing and Marking for Shipping Container for Box, Ammo, M2A1 for Warhead Section. GM, H.E., or Inert, M258 Series
9344462 – Warhead Body Assembly
9378271 – Warhead Section, Guided Missile, HE., M258E6
13051777 - Warhead Body Assembly, Antenna
13051779 – Warhead Section, Guided Missile, HE., M258E7
13052431 – Fuze, Guided Missile: M934E7

(Copies of these drawings may be requested online at usarmy.pica.rdecom-ardec.list.drawing-request-help-desk@mail.mil or from US Army ARDEC, ATTN: RDAR-EIS-PE, Picatinny Arsenal, NJ 07806-5000.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

2.3 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract

CODE OF FEDERAL REGULATIONS

49 CFAR 100-180 –Department of Transportation Rules and Regulations for the Transportation of Explosive and Other Dangerous Articles.

(Title 49CFR is available from Superintendent of Documents, Government Printing Office, Washington. DC. Orders for the above publication should cite "49 CFAR 100-180 (latest revision)").

AMERICAN SOCIETY FOR QUALITY CONTROL (ASQC)

Z1.4 - Sampling Procedures and Tables for Inspection by Attributes

(Applications for copies should be addressed to the American Society for Quality Control, 611 East Wisconsin Ave, Milwaukee, WI 53202)

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM E1742/E1742M - Standard Practice for Radiographic Examination

(Application for copies should be addressed to the American Society for Testing and Materials, 100 Barr Harbor, West Conshohocken, PA 19428-2959)

2.4 Order of precedence. Unless otherwise noted herein or in contract in the event of a conflict between the text of this document and the references cited herein, the text of this specification takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained

3. REQUIREMENTS

3.1 Material. Materials shall be in accordance with the applicable drawings and specifications.

3.1.1 PBX pellets. PBX pellets shall comply with the requirements of Drawing 9210109.

3.1.2 Explosive. The explosive shall comply with specification MIL-E-46495 Type II

3.2 Components and assemblies. For the M258E6, components and assemblies shall comply with all requirements specified on Dwg 9378271.. For the M258E7 , components and assemblies shall comply with all requirements specified on Dwg 13051779

3.3 Radiographic examination. Warheads shall be radiographically examined in accordance with ASTM E 1742 and shall not exceed the "maximum allowable cast defects" noted hereunder. The minimum

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

optical density of each radiograph in the area being inspected shall not be less than 1.25 and shall be within a density range that will permit proper identification of gap or separation defects.

Maximum allowable Cast Defects	
Cast Defect	Segment A and Surface 1
Total projected area (sq. in.) of all cavities in the plane of observation	1/16 sq. in.
Maximum projected length (in.) of any cavity in the plane of observation	1/4 in.
Maximum projected length (in.) of any crack in the plane of observation	1/4 inch
Maximum projected area (sq. in) of any crack in the plane of observation	zero sq. in.
Piping cavities, maximum number allowed in the plane of observation	zero sq. in
Annular rings, maximum number allowed in plane of observation	zero sq. in
Cast Defect	Surface 2
Maximum depth (in.) of cavities	1/8 in
Maximum width (in.) of cavities	1/16 in
Maximum length (in.) of cavities	1/2 in.
Note. Cavities having a maximum projected dimension in any direction of 1/32 inch or less and cracks having a maximum dimension of 1/4 inch or less shall be disregarded provided that they are separated by 1/2 inch of solid explosive. Cavities having a maximum projected dimension of 1/32 inch or less not separated by 1/2 inch of solid explosive shall be included in the computation of total area. For the M258E6 see Figure 1A for definition of surfaces and segments. For the M258E7 see Figure 1B for definition of surfaces and segments.	

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3.4 Warhead Body Loading Assembly continuity requirements. The Warhead cable and connector shall meet the following continuity requirements prior to loading of explosives and after machining of explosives: (For the M258E6, see dwg 9344462 for PIN # identification. For the M258E7 see dwg 13051777for PIN # identification)

Warhead Cable Continuity (see 6.6)				
	P3 - pin#	**P3 - Pin#**	**J1 – PIN #**	**Resistance (ohms)**
1	4 to		3	≤ .5
2	6 to		4	≤ .5
3	7 to		5	≤ .5
4	10 to		1	≤ .5
5	13 to		2	≤ .5
6	9 to	2		≤ 50
7	Each P3 pin to the Warhead case			≥10 MEG
8	Each P3 Pin to all other P3 Pins shorted together. (Pin 9 to 2 of P3 connector and vice versa not included.)			≥10 MEG
≤ means "less than or equal to" ≥ means "more than or equal to"				

3.5 Fuze, Guided Missile, prior to assembly into warhead section. For the M258E6, the Fuze is drawing number is 9297066. For the M258E7, the Fuze is drawing number is 13052431. The Fuze shall meet the following requirements:

3.5.1 Fuze safe condition. The fuze shall be in a safe and operable condition. (Appearance of only a green surface through the fuze window indicates the unit is safe. Appearance of the entire tip of the rotor primary lock pin, which is shiny and silver in color, indicates that the fuze will not arm. Appearance of an orange and green surface through the window indicates that the unit is in the abort condition. Appearance of an orange surface through the window indicates that the unit is armed. The viewing angle should be perpendicular to the fuze window.)

3.5.2 Isolation resistance (detonation). The isolation resistance (see 6.6) between J3 (see 6.5) pins 6 and 8 shall be greater than or equal to 300K OHMS. The positive terminal of the measurement instrument shall be in pin 6. The measurement may exhibit a capacitor charging characteristic when ohmmeter is connected. (The Detonator should be considered electrically armed if this test measurement is incorrect. Test current to be limited to 0.25µA.)

3.5.3 Fuze configuration number. For the M258E6, the fuze configuration number, 9297066, shall be clearly marked. For the M258E7, the fuze configuration number, 13052431, shall be clearly marked.

3.5.4 Fuze condition. The fuze shall not be damaged nor show evidence of corrosion or foreign material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3.5.5 Fuze isolation resistance. The isolation resistance between the fuze connector and the fuze base shall be:

Resistance between J3 pins (see 6.5) & Fuze base (see 6.6)	
1 thru 21 to Fuze Base (+ terminal)	≥10 MEG OHMS
1 thru 21 (+ terminal) to Fuze Base	≥10 MEG OHMS

3.5.6 Electrical continuity. The continuity between pins shall be as follows:

Warhead Cable Continuity (see 6.6)				
	J3 PIN# (see 6.5)	J3 PIN#	TEST CURRENT 1/ (ma)	RESISTANCE (ohms)
1	6(+)	8	0.25µA	≥ 300K 2/
2	15(+)	21	1	≤ 0.3
3	10(+)	21	1	≤ 0.3
4	11(+)	21	1	≤ 0.3
5	15(+)	16	1	10.8 ± 2.0
6	15(+)	12	1	4.0±1.2
7	18(+)	8	0.1	2.2K ± 0.2K
8	3(+)	8	0.1	3.3K ±0.3K
9	13(+)	8	0.1	1.0 K ± 0.1K
10	20(+)	8	0.1	5.1K ± 0.5K
11	14(+)	6	10µA	51K ± 5K
12	5(+)	10	0.25µA	≥1M
13	7(+)	11	1µA	≥30K 2/
14	5(+)	7	0.25µA	≥ 1 MEG
Note 1/ Test current not to exceed 105% of current specified. 2/ Exhibits capacitor charge current when test set is first connected.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3.6 Warhead Section, Guided Missile, after connection of P3 to J3 (see 6.5).

3.6.1 The continuity between pins shall be as follows:

CONTINUITY BETWEEN PINS (see 6.5 and 6.6)			
	POSITIVE TERMINAL	NEGATIVE TERMINAL	RESISTANCE (OHMS)
1	J1-1	J3-21	≤.8
2	J3-10	J1-1	≤.8
3	J3-11	J1-1	≤.8
4	J1-3	J3-10	≥1M
5	J1-4	J3-11	≥30K
6	J1-2	J1-5	2.2K ± 0.2K
7	J3-20	J1-5	5.1K ± 0.5K

3.6.2 Warhead isolation resistance. The isolation resistance between all J1 pins and warhead case, and between all accessible J3 (see 6.5) pins and the warhead case, shall be as follows:

WARHEAD ISOLATION RESISTANCE (see 6.6)		
	RESISTANCE BETWEEN ALL PINS AND WARHEAD CASE	RESISTANCE (OHMS)
1	All pins + DC	≥10 MEG
2	All pins – DC	≥10 MEG

3.7 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.7.1 Test per MIL-F-48863C. The warhead section shall be subjected to the Thermal Shock, Transportation Vibration, and Flight Vibration Test environments in accordance with MIL-F-48863C, paragraphs 4.5.6, 4.5.7. and 4.5.9 respectively.

3.7.2 Sequential testing. After sequential testing the fuze shall be removed from the warhead sections; they shall be 30g arm tested, and dent tested by the self-destruct method in accordance with MIL-F-48863C. Acceptance shall be based upon compliance with the requirements of MIL-F-48863C for internal impedances, flight motor ignition time, flight motor dwell time, arm time, self-destruct time and dent. Warhead acceptance shall be based upon high order detonation.

3.8 Workmanship. All warheads shall be loaded in a thorough manner. Warhead assemblies, kettles and related pouring apparatus shall be free of dirt, grease, rust, corrosion products or other foreign material. Care shall be taken during loading or subsequent heat probing of the explosive cast that the electrical filter and wiring harness within the loading cavity are not damaged. All exterior warhead surfaces and electrical connectors shall be free of explosive, and contamination caused by chemicals, foreign matter or dirt. Attentive care shall be taken in mating the fuze and warhead connectors so as not to damage the connector pins or damage wiring. Broken or cracked connectors, damaged electrical wiring

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

harnesses or damaged fuzes shall not be used for assembly into warhead sections. Required markings shall be neat and sharply defined.

4. VERIFICATION

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspection. The following types of inspection shall be conducted on this item:

a. First article inspection.

b. Quality conformance inspection.

4.3 First article inspection.

4.3.1 Submission. The first article sample shall consist of the following items in sample quantities as indicated.

FIRST ARTICLE SUBMISSION QUANTITY (M258E6)			
#	Part description	Drawing number	Quantity
1	Pellets, PBX	9210109	6
2	Warhead, Body, Loading Assembly	9378270	6
3	1/ Warhead Section, GM, H.E. M258E6	9378271	6
Note 1/: Fuze & loaded warhead should be supplied unassembled to each other.			

FIRST ARTICLE SUBMISSION QUANTITY (M258E7)			
#	Part description	Drawing number	Quantity
1	Pellets, PBX	9210109	6
2	Warhead, Body, Loading, H.E. w/ Antenna	13051778	6
3	1/ Warhead Section, GM, H.E. M258E7	13051779	6
Note 1/: Fuze & loaded warhead should be supplied unassembled to each other.			

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with lot formation provisions of MIL-A-48078. In addition, inspection lots shall contain:

a. PBX pellets from not more than one lot interfix from one manufacturer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

b. HTA-3 from not more than one lot interfix of one manufacturer.

4.4.2 Examination. See MIL-A-48078.

a. Sampling Plans. Unless otherwise specified in the Classification of Defects and test tables, sampling plans for major and minor defects shall be in accordance with ANSI/ASQC Z1.4, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TEST

PARAGRAPH	TITLE Warhead Section, GM, H.E., M258E6 Warhead Section, GM, H.E., M258E7	SHEET 1 OF 2		DRAWING NUMBER See Below
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY INSPECTION METHOD REFERENCE
	PBX Pellet (Dwg. 9210109) Examination for defects	6	3.1 3.1.1	4.4.2.1
	Warhead Body Loading Assembly (Dwg. 9378270 for M258E6) (Dwg. 13051778 for M258E7) Examination for defects	6	3.1, 3.1.2	4.4.2.2
	Warhead Section, GM, H.E., (Prior to assembly of fuze to warhead) (Dwg.9378271 for M258E6) (Dwg 13051779 for M258E7) Examination of defects	6 1/	3.2	4.4.2.3
	Fuze, Guided Missile (Prior to assembly of fuze to warhead section) (Dwg.9378271 for M258E6) (Dwg 13051779 for M258E7) Examination for defects	6 1/	3.2	4.4.2.4

NOTES:
1/ These components will be assembled to form the warhead sections for the sequential examination first article test (see sheet 2 of Table I).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TEST

PARAGRAPH	TITLE			DRAWING NUMBER
	Warhead Section, GM, H.E., M258E6 Warhead Section, GM, H.E., M258E7	SHEET 2 OF 2		9378271 (E6) 13051779 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY INSPECTION METHOD REFERENCE
	Sequential Examination	6	3.2	
	Warhead Section, GM, H.E.			
	Examination for defects	6	3.2	4.4.2.5
	Thermal shock 2/	6	3.7.1	MIL-F-48863C (4.5.6)
	Transportation vibration -50ºF	3	3.7.1	MIL-F-48863C (4.5.7)
	Transportation vibration +160ºF	3	3.7.1	MIL-F-48863C (4.5.7)
	Flight vibration -50ºF	3	3.7.1	MIL-F-48863C (4.5.9) 4/
	Flight vibration +140ºF	3	3.7.1.	MIL-F-48863C (4.5.9) 4/
	Five foot drop -50 ºF			MIL-STD-331
	a. Forward end down	1		Test 111 5/
	b. Scribe line down	1		
	c. Scribe line 90º from b.	1		
	Five foot drop +140ºF			MIL-STD-331
	a. Forward end down	1		Test 111 5/
	b. Scribe line down	1		
	c. Scribe line 90º from b.	1		
	Evaluate warhead section	6	3.2	4.4.2.5
	Evaluate fuze 3/	6	3.7.2	MIL-F-48863C
	Evaluate warheads 3/	6	3.7.2	4.5.7

NOTES:
2/ After the test, condition 3 units hot & 3 units cold, then maintain temperatures in subsequent tests.
3/ For information only.
4/ Fuze power shall not be applied under any circumstances.
5/ Criteria B of MIL-STD-331, Test 111 shall apply with thread damage acceptable

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE			DRAWING NUMBER
4.4.2.1	PBX, Pellet	SHEET 1 OF 1		9210109
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY 9378271 (E6) 13051779 (E7) INSPECTION METHOD REFERENCE
Critical	None defined			
Major	M258E6 & M258E7			
101	Pellet diameter	0.40%	3.1.1	Gage
102	Pellet height	0.40%	3.1.1	Gage
103	Pellet density	0.40%	3.1.1	Gage
Minor	M258E6 & M258E7			
201	Presence of cracks or laminations	0.65%	3.1.1	Visual
202	Evidence of poor workmanship	0.65%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE			DRAWING NUMBER
4.4.2.2	Warhead Body Loading Assembly (M258E6) Warhead Body Loading, H.E. w/ Antenna M258E7)	SHEET 1 OF 2		9378270(E6) 13051778 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY 9378271 (E6) 13051779 (E7) INSPECTION METHOD REFERENCE
Critical	M258E6 & M258E7			
1	Explosive on threads	100%	3.2	Visual
2	Explosive on fuze mounting shelf & cavity	100%	3.2	Visual
Major	M258E6 & M258E7			
101	Continuity does not conform to requirements prior to loading	100%	3.4	4.5.3/4.5.5/Gage
102	Radiographic examination	100%	3.3	4.5.2/Visual
103	Explosive composition	3 2/	3.1.2	4.5.1/Gage
104	Density of explosive	3 2/	3.1.2	4.5.1/ Gage
105	Moisture content of explosive	3 2/	3.1.2	4.5.1/ Gage
106	Explosive weight.	100%	3.2	4.5.6/ Gage
107	Warhead weight	100%	3.2	Gage
108	Distance from explosive to fuze mounting Shoulder	0.40%	3.2	Gage
109	J1 connector damaged, not secure 1/, or Misaligned prior to loading	100%	3.2	Visual/Manual/ Gage
110	P3 connector damaged prior to loading	100%	3.2	Visual/Manual
111	Continuity does not conform to requirements after loading	100%	3.4	4.5.3/4.5.5/Gage
112	P3 connector damaged after loading	100%	3.2	Visual/Manual
	M258E7			
113	GPPO connector and cable damaged prior to loading (2X)	100%	3.2	Visual/Manual
114	GPPO connector and cable damaged after to loading (2X)	100%	3.2	Visual/Manual

NOTES:
1/ No perceptible angular movement due to finger pressure.
2/ By pour

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE	SHEET 2 OF 2		DRAWING NUMBER
4.4.2.2	Warhead Body Loading Assembly (M258E6) Warhead Body Loading, H.E. w/ Antenna M258E7)			9378270(E6) 13051778 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY 9378271 (E6) 13051779 (E7) INSPECTION METHOD REFERENCE
Minor	M258E6 & M258E7			
201	Diameter of pellet cavity	0.65%	3.2	Gage
202	True position of pellet cavity with large inside diameter	0.65%	3.2	Gage
203	Loose explosive material in pellet cavity	0.65%	3.2	Visual
204	Evidence of poor workmanship	100%	3.8	Visual
	M258E7			
205	Presence of GPPO connector cover prior to and after loading (2X)	100%	3.2	Visual

NOTES:
1/ No perceptible angular movement due to finger pressure.
2/ By pour

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE	SHEET 1 OF 1		DRAWING NUMBER
4.4.2.3	Warhead Section, GM, M258E6 (Prior to Assembly of fuze to Warhead) Warhead Section, GM, M258E7 (Prior to Assembly of fuze to Warhead)			9378271 (E6) 13051779 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY INSPECTION METHOD REFERENCE
Critical	None defined			
Major	M258E6 & M258E7			
101	Max. height of pellet above explosive (prior to pad mounting)	0.40%	3.2	Gage
Minor	M258E6 & M258E7			
201	Felt pad missing, loose, or misaligned	0.65%	3.2	Visual/Manual
202	Evidence of poor workmanship	100%	3.8	Visual
	M256E7			
203	Presence of GPPO connector cover prior to and after fuze assembly to warhead (2X)	100%	3.2	Visual
NOTES:				

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE			DRAWING NUMBER
4.4.2.4	Fuze, Guided Missile M934E6 (Prior to Assembly of Fuze to Warhead Section) Fuze, Guided Missile M934E7 (Prior to Assembly of Fuze to Warhead Section)	SHEET 1 OF 1		9297066 (E6) 13052431 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY 9378271 (E6) 13051779 (E7) INSPECTION METHOD REFERENCE
Critical	M258E6 & M258E7			
1	Orange flag visible through window	100%	3.5.1	Visual
2	Green flag not visible through window	100%	3.5.1	Visual
3	Continuity between J3 pins 6 to 8 1/	100%	3.5.2	4.5.4/4.5.5/Gage
Major	M258E6 & M258E7			
101	Isolation resistance does not conform to Requirements	100%	3.5.5	4.5.4/4.5.5/Gage
102	Continuity does not conform to Requirements	100%	3.5.6	4.5.4/4.5.5/Gage
103	Evidence of corrosion, foreign material or damaged parts	100%	3.5.4	Visual
104	Head of primary pin lock totally visible	100%	3.5.1	Visual
Minor	M258E6 & M258E7			
201	Marking omitted, misleading or unidentifiable	0.65%	3.2	Visual
202	Evidence of poor workmanship	100%	3.8	Visual

NOTES
1/ See 6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Conformance inspection by classification of characteristics

PARAGRAPH	TITLE			DRAWING NUMBER
4.4.2.5	Warhead Section, GM, H.E., M258E6 Warhead Section, GM, H.E., M258E7	SHEET 1 OF 1		9378271 (E6) 13051779 (E7)
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY INSPECTION METHOD REFERENCE
Critical	None defined			
Major	M258E6 & M258E7			
101	Continuity (connectors P3 & J3 not assembled to each other 3/)	100%	3.4	4.5.4/4.5.5/Gage
102	Continuity (connectors P3 & J3 assembled to each other)	100%	3.6.1	4.5.4/4.5.5/Gage
103	Isolation resistance (connectors P3 & J3 assembled to each other)	100%	3.6.2	4.5.4/4.5.5/Gage
104	Distance from aft end of warhead to fuze window, (min.)	100%	3.2	Gage
105	Distance from aft end of warhead to top of fuze, (min.)	100%	3.2	Gage
106	Distance from aft end of warhead to P3 connector, (min.)	100%	3.2	Gage
107	Torque of warhead set screws	0.40%	3.2	Gage
108	Presence of J3 connector fastener	0.40%	3.2	Visual
109	Center of gravity	2/	3.2	Gage
110	Roll unbalance 1/	2/	3.2	Gage
111	Functional check for thread engagement	100%	3.2	Gage
112	Location and orientation of J3 Connector	100%	3.2	Gage
113	J1 connector keyway orientation	100%	3.2	Gage
114	J1 connector loose or damaged	100%	3.2	Gage
	M258E7			
115	Presence of Epoxy (2X)	100%	13051779 Note 16	Visual
Minor	M258E6 & M258E7			
201	Marking missing or improper	0.65%	3.2	Visual
202	Evidence of poor workmanship	100%	3.8	Visual

NOTES:
1/ Roll unbalance can be calculation from the weight and location of the center of gravity.
2/ The units shall be sampled in accordance with paragraph 4.5.8
3/ See 6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables.

4.4.4 Inspection Equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and 6.3 herein.

4.5 Test methods and procedures.

4.5.1 Composition, density and moisture content of explosive charge. The charge sample and the wafers shall be analyzed and tested as detailed in Specification MIL-E-46495. Failure to meet one or more of the requirements shall class the batch defective. Water may be used as a substitute for mercury in the determination of density of the explosive as specified in MIL-E-46495. The three (3) wafers shall be poured from each batch for this test. (One near start of pour, one near the middle and one near end of pour.) Pour shall be sufficient for 100 units max.

4.5.2 Radiographic examination. Radiographic examination shall be in accordance with ASTM E 1742. The explosive charge shall be radiographically examined by directing the beam normal to the longitudinal axis of the unit. A second exposure shall be made after rotating the unit 90 degrees on its longitudinal axis.

4.5.3 Warhead continuity. All warhead cable electrical measurements shall be made with a current of less than 1 milliampere and voltage of less than 20 volts.

4.5.4 Fuze and Warhead continuity. All fuze and warhead section electrical measurements shall be made with a current of less than 1 milliampere and voltage of less than 3.5 volts

4.5.5 Circuit continuity test. The assembly being tested shall be connected to the approved continuity tester. This test shall be conducted in an explosive area with explosive handling safety procedures in effect (see 6.6).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

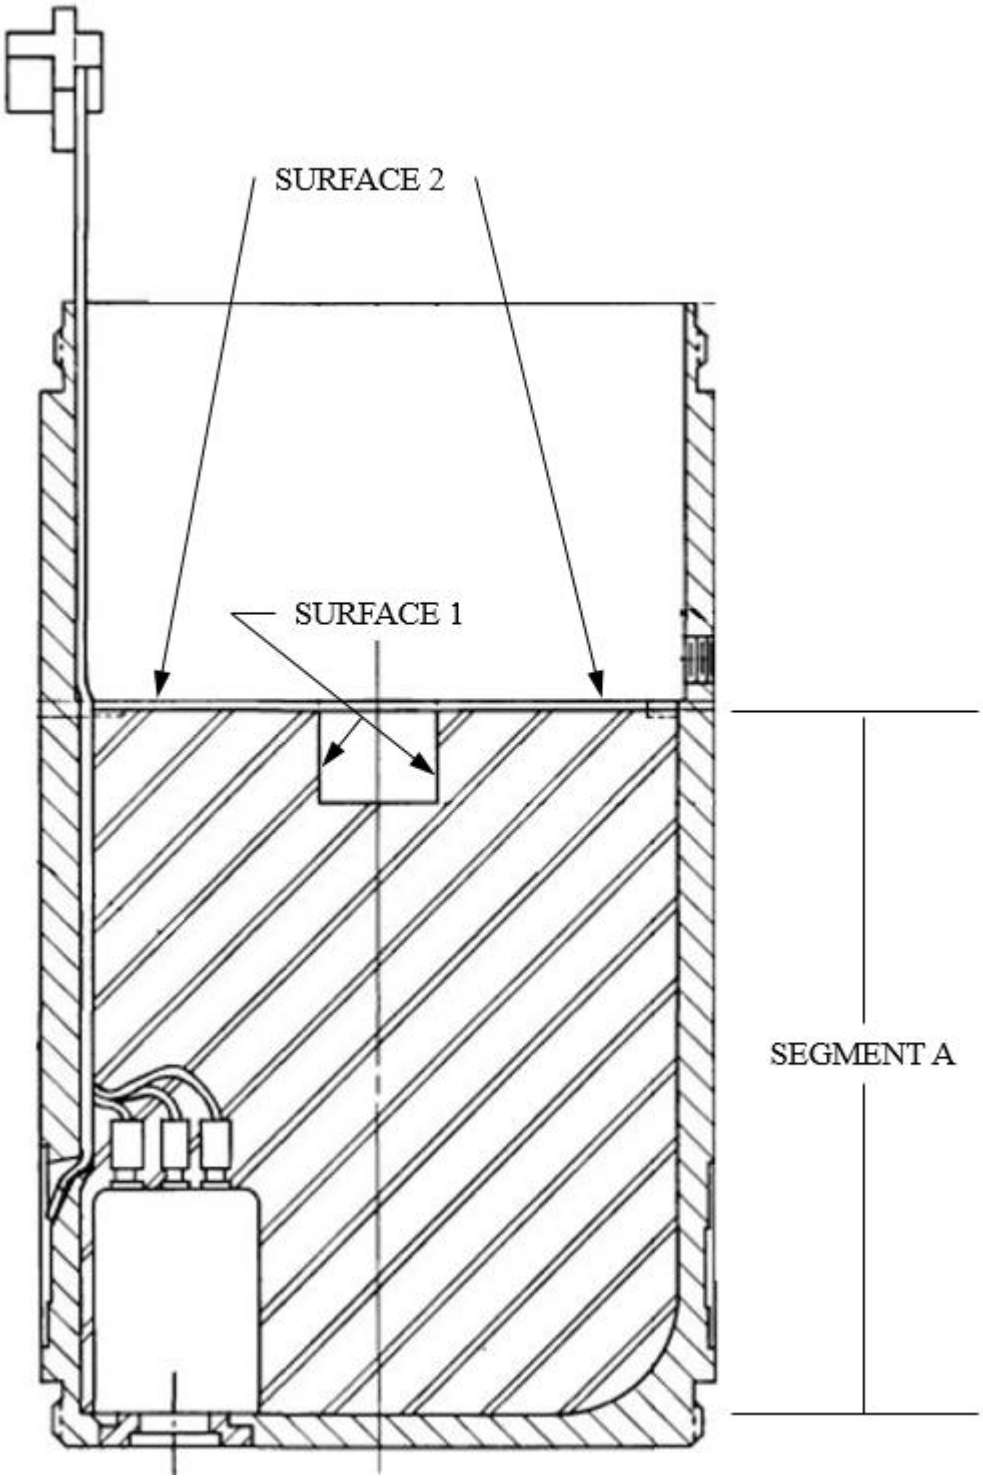


Figure 1A. M258E6 RADIOGRAPHIC SURFACE AND SEGMENTS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

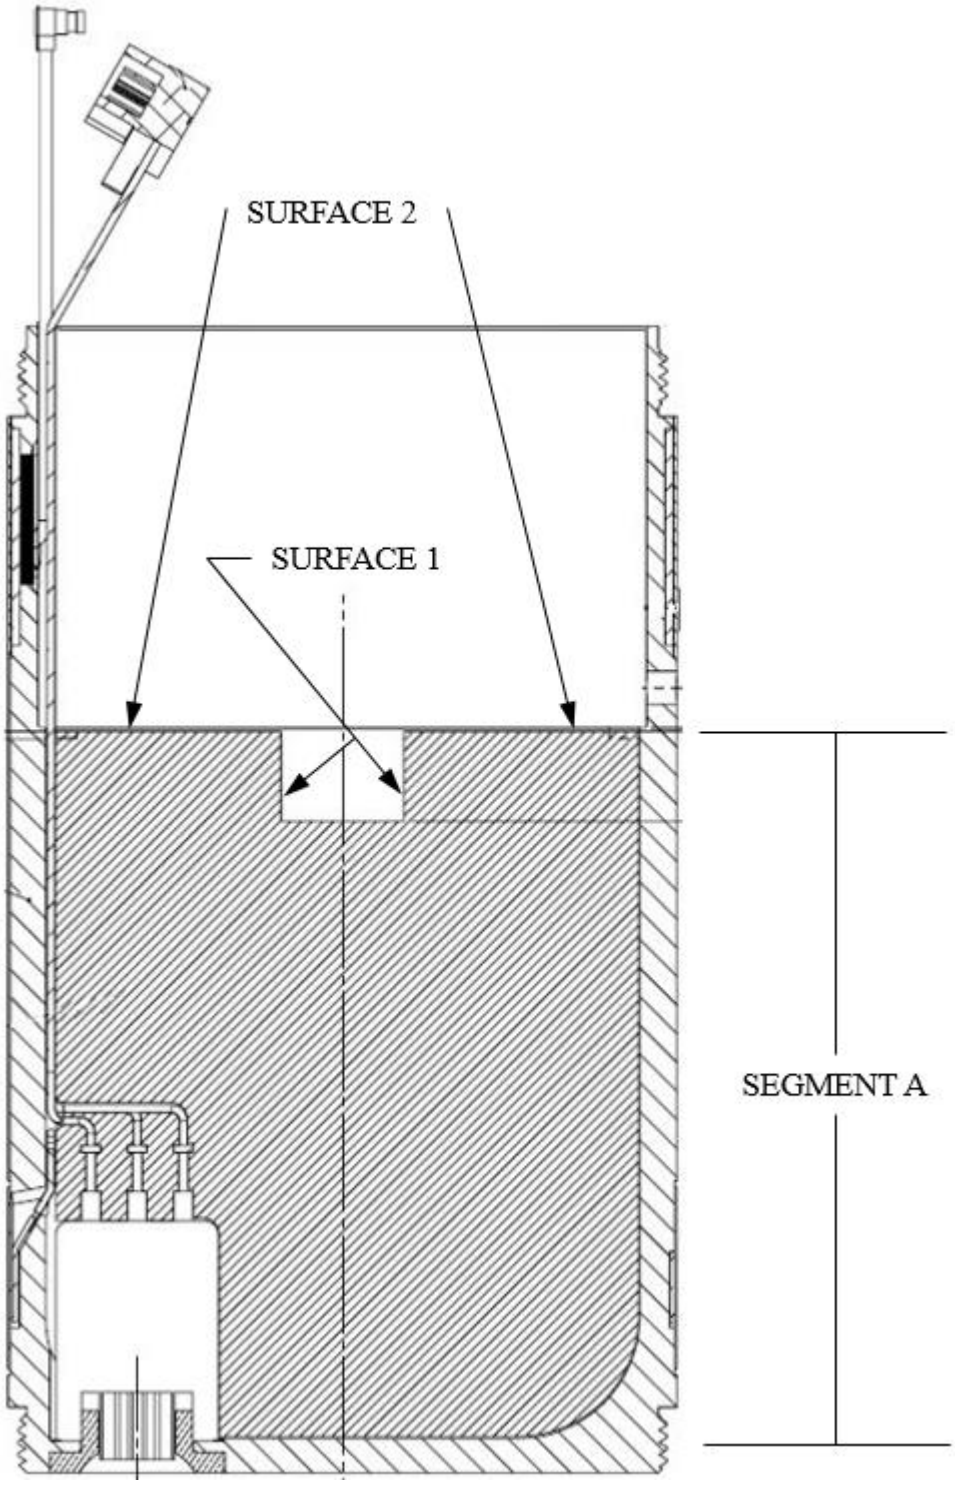


Figure 1B. M258E7 RADIOGRAPHIC SURFACE AND SEGMENTS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

4.5.6 Explosive weight. The warhead is to be serialized, and weighed immediately prior to loading and again after explosive machining. The difference in weights will be considered the explosive weight.

4.5.7 Warhead evaluation. The warheads shall be detonated utilizing the detonator and lead simulating the fuze explosive train configuration.

4.5.8 Center of gravity and roll unbalance. These tests shall be conducted 100% until either 250 defect-free units or 5 defect-free melt-pour explosive batches have been tested. After either defect-free 250 units or 5 defect-free melt-pour explosive batches have been tested, the sampling frequency shall be reduced to 1 in 25 units. If a defect is encountered in the reduced sample, the previous 50 units and next 250 units shall be inspected 100%. If no defects are found during the screening, then the sampling shall be reduced to 1 in 25 units.

5. PACKING

5.1 Packaging Requirements. Packaging shall be as specified on drawing 9322206 and 6.4 herein.

5.2 Packing and marking. Packing and marking shall be as specified on drawing 9322206.

5.3 Transportation regulations. 49 CFR 100-199, Interstate Commerce Commission Rules and Regulations for Transportation of Explosives and Other Dangerous Articles shall be complied with.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The warhead sections covered by this specification are intended for use on the M528 Series Warhead Sections for the Stinger Missile.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of contractor inspection equipment design for approval. Submit copies of designs as required to: Commander, US Army ARDEC, ATTN: RDAR-QEM-A, Picatinny Arsenal, New Jersey 07806-5000.

6.4 Performance Oriented Packaging(POP), for the M2 Series Ammo Can. Prior to shipment, the manufacturer will make sure the container has been tested by a government approved Performance Oriented Packaging (POP) test Laboratory for compliance with POP requirements in accordance with Title 49 Code of Federal Regulations. Test will be to a weight at least 10% greater than the actual gross weight to be marked on the tested container. POP marking will not be applied to the container until verified by the government. The POP test report will be generated by the Manufacturer/Laboratory in accordance with DI-PACK-81059 (Data Item Description) following the test. The report should be kept on file by the contractor and should also be submitted in accordance DI-PACK-81059 to the U.S. Army RDE Command – Armament Research, Development and Engineering Center, ATTN: RDAR-EIL-P, Picatinny Arsenal, New Jersey, 07806-5000. For multi-year contracts, the contractor will re-perform POP testing at a certified test

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

laboratory if: (a) the initial POP test report expires before the end of the contract or (b) there is a change in container manufacturer or design of the exterior shipping container. No re-test is needed if all packaging is purchased while under an unexpired POP test.

6.5 J3 Connector Reference. For the M258E6, references to J3 are in regards to the Electrical Connector (9282672). For the M258E7, references to J3 are in regards to the Micro-D connector (13051691).

6.6 Electrical Measurement Safety. All electrical measurements should be performed behind a safety approved barricade

6.7 Amendment notations. The margins of this amendment are marked with an asterisk or vertical lines to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment

Custodian:
Army-AR

Preparing activity:
Army–AR
(Project 1336-2019-001)

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.