MIL-O-16736E(NU)
25 June 1980
SUPERSEDING
MIL-O-16736D(SA)
26 April 1976

MILITARY SPECIFICATION

OVERCOAT, WOMAN'S (WITH REMOVABLE LINER, ENLISTED)

This specification is approved for use by the Navy Clothing and Textile Research Facility, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope This specification covers the requirements for a wool overcoat with a removable liner.

1.2 Classification The overcoat shall be of one type, in the following sizes and lengths (see 6.2):

Sizes

6, 8, 10, 12, 14, 16, 18, 20, 38, 40, 42, and 44

Lengths

Short, Regular, and Long

2. APPLICABLE DOCUMENTS

2.1 Issue of documents The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein:

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to Navy Clothing and Textile Research Facility, 21 Strathmore Road, Natick, MA 01760 or by using the self-addressed standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

☆U.S. GOVERNMENT PRINTING OFFICE: 1980—603-121/3007 FSC 8410

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-B-871	- Button, Sewing Hole, and Button, Staple (Plastic)
V-F-106	- Fasteners, Slide Interlocking
V-T-276	- Thread, Cotton
V-T-280	- Thread, Cotton Gimp, Buttonhole
V-T-285	- Thread, Polyester
V-T-295	- Thread, Nylon
V-T-301	- Thread, Silk
CCC-C-438	- Cloth, Buckram, Cotton
DDD-L-20	- Label; For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton
MIL-B-371	- Braid, Textile, Tubular
MIL-C-823	- Cloth, Serge, Wool; Wool and Nylon, Polyester and Wool
MIL-B-1860	- Buckle, Slide, Plastic
MIL-C-15065	- Coat Fronts
MIL-C-17155	- Cloth, Knitted, Nylon Fleece
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-B-17757	- Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-21852	- Cloth, Taffeta, Nylon
MIL-T-43548	- Thread, Polyester, Cotton-covered
MIL-C-43718	- Cloth, Twill, Polyester: Polyester and cotton: Polyester and Rayon
MIL-C-43525	- Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back

STANDARDS

FEDERAL

FED-STD-751	- Stitches, Seams, and Stitchings

MILITARY

MIL-STD-129	- Marking for Shipment and Storage
MIL-STD-1392	- Provisions for Evaluating Quality of Overcoats, Women

(Copies of specifications, standards, drawings and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

LAWS AND REGULATIONS

US POSTAL SERVICE MANUAL

(Copies of the manual may be obtained from the Superintendent of documents, US Government Printing Office, Washington, DC 20402.)

2.2 Other publications The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to American Trucking Association, ATTN: Traffic Department, 1616 P Street, NW Washington, DC 20036.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, ILL 60606).

3. REQUIREMENTS

3.1 Sample Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample, in which case this specification shall govern.

3.2 First article When specified (see 6.2) the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3).

3.3 Materials

3.3.1 Basic material for overcoat The basic material for the overcoat shall be wool, serge, shade Blue 3346 conforming to type I, class 8 of MIL-C-823.

*3.3.2 Basic material for liner The basic material for the removable liner shall be knitted nylon fleece, conforming to type III, Black 3234 of MIL-C-17155.

3.3.3 Cloth, nylon The material for lining the overcoat and binding the overcoat and liner shall be nylon taffeta cloth, conforming to Type IV of MIL-C-21852. The color of the material shall be black. The material for the binding shall be cut on a 45 (± 5) degree angle in strips of 7/8 to 1 inch wide. The ends of the strips shall be joined together by stitch type 301 and the seam type SSa-1 with 10 to 12 stitches per inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.3.4 Cloth, sleeve, liner The material for the sleeves for the removable liner shall conform to Type II of MIL-C-43525. The color shall be black.

3.3.5 Front interlining The interlining for the overcoat fronts shall conform to Type VIII and the construction thereto of MIL-C-15065.

3.3.6 Collar interlining The material for interlining the collar shall be cotton, buckram, unbleached or bleached conforming to Type I, class 2 of CCC-C-438.

3.3.7 Pocketing The material for the pockets and stay for coat pockets shall be cotton silesia, conforming to Type I of MIL-C-326, or a twill cloth conforming to class 1 of MIL-C-43718, except that the colorfastness requirement for crocking shall not apply. The shade shall be black.

3.3.8 Wigan The material for interlining bottom of sleeves shall be cotton, wigan, natural or grey shade conforming to Type I of MIL-C-16375.

* 3.3.9 Tapes

3.3.9.1 Cotton tape The cotton tape for staying the coat shall be preshrunk conforming to class 1 or class 2 and shall be in the following types and widths of DDD-T-86:

Type I, 3/4 inch wide - stay for bridle at breakline of lapel.
Type II, 3/16 inch wide - stay for raglan sleeve seam edge on front and back, front gorge and back neck.
Type III, 1/2 inch wide - stay for lapel, front and bottom edges, along fold of left back vent and welt of pockets.

* 3.3.9.2 Tape, fusible web. The tape for joining the fronts and facings shall be a non-woven thermoplastic polyamid resin, natural color, 18 to 32 grams per square yard and 5/8 inch in width (see 4.4.1).

3.3.10 Braid The braid for the overcoat hanger, vent and button loop, when used in lieu of material specified in 3.3.3 shall be black, cotton, tubular conforming to Type III, class 1 of MIL-B-371.

3.3.11 Buckle The buckle shall conform to class 3, size 1 7/8 inches of MIL-B-1860. The color of the buckle shall be black.

3.3.12 Buttons The buttons shall be plastic, 24-line, 30-line, and 45-line, style 20 and 21; and 18 line, style 15, conforming to Type II, class D of V-B-871. The buttons shall be black and have a glossy finish.

3.3.13 Thread

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.3.13.1 Thread-polyester, cotton-covered The thread shall be dyed shade Black AA, CA 66043 and shall conform to MIL-T-43548 as follows:

Use	Ticket No.	Ply
Seaming, stitching, buttonholes and bartacks	50, 70	2 or 3
Button sewing		
Hand	16	2 or 3
Machine	20	2 or 3

3.3.13.2 Thread, cotton As an alternate to the polyester cotton-covered thread listed in 3.3.13.1 a cotton thread may be used. When this option is exercised, the thread shall match shade Black AA, CA 66043, conforming to V-T-276 as follows:

Use	Type	Ticket Number	Ply
Seaming and stitching	IC2	0 or 00	3
Buttonholes, buttons and bartacks	IC2	A	3
Button sewing			
Hand	IB3	12 or 16	4
Machine	IA3	20	4

3.3.13.3 Basting thread The cotton thread for basting and tacking shall be a good commercial grade, bleached or unbleached. A monofilament synthetic thread may be used for only those basting operations where the thread is required to be removed provided the garment is subsequently given a treatment by a cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.4 Thread, silk Where used as indicated in Table I, the silk thread for hand and machine felling in the overcoat shall be dyed black conforming to V-T-301 as follows:

Use	Type	Class	Size designation	Ply
Machine felling	I		0	3
Hand felling	III	3	A, C	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.3.13.5 The following threads may be utilized as alternates to the silk threads specified above for the operations indicated.

a. For machine felling - nylon thread conforming to Type III, size A/1 or AA/1 of V-T-295
b. For hand felling - nylon thread conforming to Type IV, size A/2 or C/2 of V-T-295

3.3.13.6 Colorfastness of threads The dyed threads shall show fastness to wet-dry cleaning and light equal to or better than the standard sample when tested as specified in V-T-276, MIL-T-43548, V-T-295 or V-T-301. When no standard sample is available, the dyed threads shall show a minimum of "good" fastness to wet-dry cleaning and light when tested as specified in V-T-276, MIL-T-43548, V-T-295 or V-T-301.

3.3.14 Gimp The gimp for reinforcing the buttonholes shall be thread, cotton gimp buttonhole, dyed black, conforming to Type I or Type II, size number 8 of V-T-280.

3.3.14.1 Colorfastness of gimp The dyed gimp shall show fastness to wet-dry cleaning equal to or better than the standard sample when tested as specified in V-T-280. When no standard sample is available, the dyed gimp shall show a minimum of "good" fastness to wet-dry cleaning when tested as specified in V-T-280.

3.3.15 Label Each overcoat shall have a combination identification, instruction and personal label conforming to type I, classes 1, 3 and 10 of DDD-L-20. The printing shall show fastness to dry cleaning and shall bear the following inscription:

NAME:
SERVICE NO:
OVERCOAT, WOMEN'S (WITH REMOVABLE LINER, ENLISTED)
FIBER CONTENT: OVERCOAT 100% WOOL
LINER 100% NYLON
CONTRACT NO: DLA-100-00-0-0000
NAME OF CONTRACTOR:

DRY CLEAN ONLY

3.3.15.1 Size label Each overcoat shall have a size label conforming to type I, class 2 of DDD-L-20. The label shall be of sufficient dimensions as to indicate size and stock number. The inscription shall be as follows:

Size - 16R (Example)
Stock number - 8410-00-000-0000 (Example)

Abbreviations for the applicable lengths shall be S for short, R for regular and L for long.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.3.15.2 Label, liner Each removable liner shall have a instruction and size label conforming to type I, classes 2 and 3 of DDD-L-20. The label shall be of sufficient dimension as to indicate size and instruction. The inscription shall be as follows:

SIZE 16R (Example)

DRY CLEAN ONLY

3.3.16 Slide fastener The slide fastener for the overcoat and liner shall be type IV, style 1, size L, with short tab pull conforming to V-F-106, except that all metal components of the slide fastener shall be fabricated of brass and be from the same supplier (see 4.4.1). The length of the slide fastener shall be 4 inches shorter than the liner.

3.3.16.1 Tape for the slide fastener The slide fastener tape shall be a cotton or synthetic or a combination. The tape shall be dyed black and show good fastness to wet-dry cleaning as specified in V-F-106.

3.4 Design The overcoat shall be made from wool serge material. It shall be full length, double breasted, loose fitting with a center back vent, 1/2 lined back and 3/4 lined front, and shall have an all-around belt with buckle. It shall have lined, two piece raglan sleeves with sleeve tabs positioned and buttoned on front sleeves. The collar shall be convertible type with rounded ends overlapping lapels and detachable collar tab. The overcoat shall also have a removable zippered liner (see figure 1 and 2).

3.4.1 Figures The figures are furnished for information purposes only. Any inconsistencies between the specification and the figures, the specification shall govern.

3.5 Patterns Standard patterns will be furnished by the Government to the contractor for use in cutting working patterns (see 6.3). The working patterns shall be identical to the Government patterns. Neither the Government patterns nor the contractor's working patterns shall be altered in any way. The seam allowance shall be as indicated on patterns except where otherwise specified.

3.5.1 Pattern parts The component parts for the overcoat and liner shall be cut from the materials as specified, and in accordance with the number of pattern parts required for the manufacturing process as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Material	Nomenclature of pattern parts	Cut parts
OVERCOAT		
Cloth, wool, serge	Back	2
	Front	2
	Front facing	2
	Neck facing	1
	Front sleeve	2
	Back sleeve	2
	Sleeve tab	4 1/
	Topcollar	1
	Topcollar stand	1
	Belt	1
	Undercollar, front part	2
	Undercollar, back part	2
	Pocket welt	2
	Collar tab	2 2/
	Loops	no pattern
Cloth, nylon lining	Back yoke	2
	Front	2
	Front sleeve	2
	Back sleeve	2
	Lining strip for facing (bellows) (bias-cut)	2
	Neck facing	1
	Right back vent facing piece	1
Cloth, cotton, wigan	Sleeve bottom interlining (bias)	2
Cloth, cotton, silesia or twill cloth	Slash welt pocket	4
Cloth, cotton buckram	Undercollar, front part	2
	Undercollar, back part	2
Templates	Undercollar shaper	-
	Collarstand marker	-
	Lapel shaper	-
REMOVABLE LINER		
Cloth, nylon fleece	Back	1
	Front	2
Cloth, satin acetate or Rayon Face and Rayon or Cotton back	Front sleeve	2
	Back sleeve	2

1/ Sleeve tabs, when cut from one piece of material, shall be cut 2.
2/ Collar tabs, when cut from one piece of material, shall be cut 1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.6 Stitches, seams, and stitching Stitch, seam, and stitching types as specified in Tables I and II shall conform to FED-STD-751. Whenever two or more methods for seam or stitch types are given for the same part of the operation, any one may be used. Unless otherwise specified, raise, top, and edgestitching shall be 3/8 inch from folded edge. Where stitch type 401 is used, the looper (underthread) shall be on the inside of the overcoat and liner.

3.6.1 Stitches per inch The range of stitches per inch as specified in Tables I and II shall be interpreted to mean the minimum and the maximum number permitted.

3.6.2 Thread breaks and ends of seams The ends of all seams and stitchings produced with 301 stitch type, when not caught in other seams or stitching shall be backtacked not less than 3/8 inch. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks on 401 seaming may be repaired using 301 stitch type. When stitch type 401 is permitted as an option it shall not be used unless the ends are caught in other seams or stitching.

3.7 Construction The overcoat and liner shall be manufactured in accordance with all the operations shown in Tables I and II. The contractor is not required to follow the exact sequence of operations, provided that the finished overcoats are identical to those produced by following the sequence of operations as listed in Tables I and II respectively.

3.7.1 Pressing All reference to pressing as required in Tables I and II shall be accomplished with a heated pressing iron or machine. Seams, when pressed open shall be smooth and flat.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
1	Cutting a. Spread the material face to face, that is the face of one ply of material shall be over and against the next ply below. b. Lay the material in uniform widths and lengths. The plies are not to be stretched nor full, and one side of the lay shall be even. Mark each component part in the top of the main lay with the size of garment. c. The overcoat shall be cut in strict accordance with patterns furnished which show size, placement of component parts, warp directional lines for cutting, and instructions and notches for the proper assembly of component parts. Drill mark for position of pockets is prohibited. Wax crayon for the marking of outer edges of patterns or paper markers with a felt backing is permissible for cutting wool. Perforated paper marker is prohibited on wool but may be used for cotton components. d. The component wool parts of the overcoat shall be cut from one piece of material except the collar tab, undercollar parts and underply of sleeve tabs which may be cut from ends and when so cut shall match the main assembly. When undercollar parts are cut from ends, the four parts shall be shade marked and shall match each other.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
1.	Cutting (cont'd) e. The component nylon parts of the overcoat shall be cut from one piece of material except the sleeves, lining strip (bellows) for facing, right back vent facing, and neck facing which may be cut from ends and when so cut shall match the main assembly. When pairs of sleeves are cut from ends, the four parts shall be shade marked and shall match each other. f. Cut nylon binding for the overcoat (see 3.3.3).					
2.	Replacement of defective components During the spreading, cutting and manufacturing process, components having material defects or damages that are classified as defects in MIL-STD-1392 shall be removed from production and replaced with non-defective and properly matched components.					
3.	Shade and size marking a. All component parts of the basic material and lining including undercollar parts and sleeve linings whether cut from ends or in the main lay shall be marked or ticketed to assure a uniform shade and size throughout the overcoat. Other parts cut from ends need not be shade marked. b. The use of metal fastening or machine sewn on tickets for shade and identification marking is permitted on the wool and nylon fleece lining fabric, but is prohibited on the nylon lining. When metal stapled tickets are used, the wire shall be aluminum. Also adhesive tickets which discolor or adhere to the material upon removal of the tickets are prohibited.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
3.	Shade marking (cont'd)					
	c. The use of ink pad numbering machine, rubber stamp or pencil is acceptable provided the numbers are legible and do not show through on the outside of the wool or lining assembly wherever possible, numbers shall be on the seam allowance.					
4.	Make interlining for overcoat fronts					
	The interlining for the overcoat fronts shall conform to the requirements and construction as specified (see 3.3.5).					
5.	Make belt loops					
	a. Fold a strip of the basic fabric lengthwise with the edges abutted at center and double stitch not less than 3/16 inch gauge, using a cover stitch on the underside.	406	EFh-1	8-10	50	50
	OR					
	b. Fold a strip of the basic fabric lengthwise. Turn under both raw edges and stitch each edge 1/16 to 1/8 inch from the edge.	301 or 401	EFp-2	8-10	50 50	50 70
	OR					
	c. Fold a strip of the basic fabric with both edges turned in and the turned in edges abutted and stitched with the covering stitch on the underside.	103	EFae-1	8-10	50	
	d. The finished belt loops shall measure 5/16 to 7/16 inch wide.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
6.	Make belt					
	a. The belt shall be one-piece of basic material.					
	b. Fold belt in half lengthwise face to face, seam edges together 3/8 inch from raw edge.	301	SSa-1	12-16	50	50
		or 401			50	70
	c. Press seam open and flat with a heated pressing iron; centering the seam between the folded edges.					
	d. Stitch a point at one end 1/4 inch from the raw edge.	301	SSae-2(a)	12-16	50	50
		or 401			50	70
	e. Turn belt to finished position; topstitch sides and point.	301	OSf-1 and SSae-2(b)	12-16	50	50
	f. Fold unfinished end of belt over buckle bar 2 (± 1/4) inches.					
	g. Turn under raw edge of unfinished end 1/4 inch and double stitch to the belt 3/16 inch gauge with outer rows 1/16 to 1/8 inch from fold at end. The ends of stitching shall be connected to form a rectangular line of stitching.	301	LSd-2	12-16	50	50
	h. The finished belt shall measure 1 3/4 (± 1/8) inches.					
7.	Make collar tab					
	a. Collar tab shall be made from two pieces of the basic material.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
7.	Make collar tab (cont'd)					
	OR					
	As an alternate, may be cut from one piece of material.					
	b. Seam edges of collar tab 1/4 inch from raw edges face to face leaving one side open for turning operation. Trim ends, turn to finished position, work out edge and edgestitch 1/16 inch. The ends of the tabs shall be rounded and uniformly shaped.	301	SSe-2 and SSc-1	12-16	50	50
	c. Press collar tab smooth and flat.					
	d. Make buttonholes in collar tab (see operations 36 and 37).					
	e. The finished collar tab shall measure 1 1/2 (+ 1/4) inches wide except at rounded ends and 4 1/2 (+ 1/4) inches long.					
8.	Make sleeve tabs					
	a. The sleeve tabs shall be made from two pieces of the basic material.					
	OR					
	As an alternate, may be cut from one piece of material					
	b. Seam the edges of sleeve tab face to face 1/4 inch from raw edges. Turn to finished position, work out point and edges and edge stitch.	301	SSae-2	12-16	50	50
	c. Make a buttonhole in each tab (see operations 36 and 37).					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
8.	Make sleeve tabs (cont'd) d. The finished sleeve tabs shall measure 2 (± 1/8) inches wide and 5 1/2 (± 1/2) inches long in finished sleeve.					
	e. Press sleeve tabs smooth and flat.					
9.	Make sleeves a. The sleeve shall consist of two pieces; a front sleeve and a back sleeve.					
	b. Join 1/4 inch from raw edges, front and back top-seam of sleeves, face to face, allowing 5/8 inch outlet on back sleeve (positioning raw edge of front sleeve 3/8 inch from raw edge of back sleeve) and simultaneously catching a nylon stay positioned on back sleeve from approximately 1 inch in from shoulder neck edge to approximately 1 inch beyond second notch. Turn and raisestitch with front sleeve on top of back sleeve. Care shall be taken not to stretch upper section (shoulder portion) of top seam of sleeve.	301	LSs-2 and SSab-1	12-16	50	50
	c. Stitch sleeve interlining (wigan) to top seam and to sides of underarm seam. Bottom edge of sleeve interlining shall be 1/2 to 3/4 inch below turn-up notches. Trim ends of sleeve interlining even with edges of sleeve.	301	LSbj-1 and LSs-2(a)	12-16	50	50
	d. Mark and baste the turn-up of sleeve bottom as indicated by notches on pattern.	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
9.	Make sleeves (cont'd) e. Press turn-up and top seam of sleeve and remove basting. Care shall be taken not to stretch shoulder portion of top seam.					
	f. Position and stitch sleeve tab on back sleeve the same distance as indicated by notches on front sleeve underarm seam. Stitching shall not be exposed on the outside of finished sleeve. Bottom edge of sleeve tab shall be 2 1/2 (± 1/4) inches from finished bottom edge of sleeve. Care shall be taken to have sleeve tab parallel with the finished bottom edge of sleeve.	301	SSa-1	12-16	50	50
	g. Join underarm seam of sleeve 3/8 inch from the folded edge simultaneously catching the prestitched sleeve tab in the seam.	301	SSa-1	12-16	50	50
	h. Press underarm seam of sleeve open with the sleeve tab flat against the front sleeve.					
	i. Blindstitching top edge of sleeve turn-up to interlining. The blindstitching shall not be caught on outside.	103 or 301 or Hand	EFc-1(b)	4-8 4-8 1-2	50 50 50	50
10.	Make sleeve lining a. The sleeve lining shall consist of 2 pieces; a front sleeve and a back sleeve.					
	b. Seam top seams and underarm seam of sleeve lining face to face 3/8 inch from raw edges.	301	SSa-1	12-16	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
11.	Tack sleeve lining to wool sleeve					
	a. Position sleeve lining to sleeve with the sleeve lining extending 3/4 to 1 inch above top of sleeve. Tack underarm seam and top seam of lining to underarm seam and top seam of sleeves respectively, distributing lining fullness properly. The tacking of underarm seam shall start not less than 3 inches nor more than 5 inches from top of sleeve and finish not less than 3 inches nor more than 5 inches up from finished edge of sleeve. The tacking of top seam shall start not less than 9 inches nor more than 11 inches from top of sleeve and finish not less than 3 inches nor more than 5 inches up from finished edge of sleeve. When tacking is done by hand, both ends of stitching shall be securely tacked with not less than 3 stitches.	301 or Hand	SSa-1	4-8 2-4	50 50	50
	b. Turn sleeves through lining and baste turn-up of sleeve lining (see oper 34.b.1). Turn sleeves to finished position and assemble in pairs.	Hand or Machine			Commercial	
12.	Make collar					
	a. The collar shall consist of a one-piece top-collar, a one-piece topcollar stand and a four-piece undercollar (front parts and back parts).					
	b. Seam the four undercollar wool pieces together 1/4 inch from the raw edges.	301	SSa-1	12-16	50	50
	c. Press the seams open and flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
12.	Make collar (cont'd)					
	d. Seam the four undercollar interlining pieces together with 1/2 inch overlap seams 1/4 inch from the raw edge.	301	LSa-1	12-16	50	50
	e. Mark breakline of undercollar in accordance with undercollar shaper.					
	f. Stitch undercollar to undercollar interlining at breakline	301	SSv-1	12-16	50	50
	g. Pad area between breakline stitching and the top edge of undercollar with not less than 6 equally spaced rows of blindstitching and not less than 3 equally spaced rows of blindstitching between breakline and neck edge of undercollar.	103 or 301 or Hand	SSm-9	4-8 4-8 2-4	50 50 50	50
	h. Crease undercollar at breakline and press with a heated pressing iron on a suitable pressing buck. Center area of the creaseline shall be straight for a distance of 3 to 4 inches.					
	i. As an alternate, operations 12e, 12f and 12h may be omitted with the breakline being creased during pressing (see oper 38j).					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
12	Make collar (cont'd) j. Mark and shape the undercollar with undercollar shaper and collarstand marker of proper size to insure correct size and shape. Trim edge of undercollar and interlining except between notches at neck edge. Trim interlining from neck edge of undercollar between notches.					
	k. Join topcollar stand to topcollar face to face 1/4 inch from the raw edge, distributing proper fullness on collar stand between center notch and each end.	301	SSa-1	12-16	50	50
19	l. Press seam open and flat.					
	m. Position undercollar on top collar and baste, allowing proper fullness on rounded ends of top collar.	Hand or Machine			Commercial	
	n. Seam around edges except at neck edge between notches, 3/16 inch from raw edge.	301	SSae-2(a)	12-16	50	50
	o. Trim and notch seam allowance where necessary. Turn, force out edge and baste along edge.	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
12.	Make collar (cont'd)					
	p. Turn under the neck edge of undercollar over edge of interlining; baste and press along folded edge. Care shall be taken not to stretch the neck edge of undercollar in pressing.	Hand or Machine			Commercial	
13.	Make dart in fronts					
	a. Seam front bust darts 1/4 inch from the raw edge, in accordance with pattern, tapering seam to a point.	301	SSa-1	12-16	50	50
	b. Press dart seam open and flat.					
14.	Make slash welt pockets					
	a. There shall be a slash welt pocket in each front section. The welt shall be one piece.					
	b. Position a 1/2 inch wide tape approximately 1/8 inch off center on under ply of welt to stay the folded edge. Stitch 1/16 to 1/8 inch from top edge of tape. The stitching shall not be visible on the outer ply of welt.	301	SSav-2 only (except row of stitching)	12-16	50	50
	c. Stitch, 3/8 inch from the raw edge, face to face, the outer pocket piece to under ply of welt.	301	SSa-1	12-16	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
14.	Make slash welt pockets (cont'd)					
	d. Fold welt in half lengthwise and stitch the ends 1/4 inch from the edge, terminating the stitching at the ends of seam joining the outer ply of pocket to underply of welt. Trim corners, turn to finished position, working out seamed edges and points of welt.	301 or 401	SSae-2(a)	12-16	50 50	50 70
	e. Edgestitch the seamed edges and fold of welt.	301	SSae-2(b) and OSf-1	12-16	50	50
	f. Press welts with a heated pressing iron, holding folded edge straight.					
	g. Mark width of outer ply of welt in accordance with finished measurement (see oper 15k)					
15.	Assemble hanging pocket and welt on foreparts					
	a. Mark foreparts in accordance with pattern for positioning of pocket welt.					
	b. Stitch welt to front through all plies as indicated by marks on pattern, catching pocket stay on the underside. As an alternate, the top ply of the welt may be stitched to the front.	301	LSbj-1	12-16	50	50
	*c. Stitch on all four sides the combination label to the inner pocket piece. On the finished pocket the label shall be centered between the ends of the pocket opening with bottom edge of label 3/16 to 1/4 inch from pocket opening. Printing shall face outside of overcoat. Stitching shall not be through lining.	301	LSbj-1	12-16	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
15.	Assemble hanging pocket and welt foreparts d. The ends of welt seam allowance may be clipped.					
	e. Stitch inner ply of pocket piece to front with the stitching approximately 1/2 inch from the seam joining top ply of welt to front.	301	LSbj-1	12-16	50	50
	f. Cut opening of pocket between the two rows of stitching and tongue notch ends.					
	g. When alternate method in operation 15b is used, the seam allowance of top ply of welt shall be turned up and stitched on the underside adjacent to the welt setting seam. Stitch through under ply of welt simultaneously catching the prestitched stay. In the finished overcoat, the welt setting seam shall be spread open.					
	h. Turn pocket through cut opening to finished position.					
	i. Stitch ends of welt through front, underply of pocket and stay from the welt joining seam to back edge of welt with a 5/16 inch gauge double row of stitching connected diagonally inward from the back corners of welt. The inner row of double stitching shall be superimposed on the stitching performed in operation 14e.	301		12-16	50	50
	j. Close pocket by seaming top, front and bottom 1/2 inch from edge.	301	SSa-1	12-16	50	50
	k. The finished welt shall measure 1 1/4 (± 1/8) inches wide and 6 1/2 (+ 1/4) inches long.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
16.	Baste front interlining					
	a. Position front interlining on respective fronts with the interlining extending well beyond armholes and neck edges. Baste through all plies of material along the vertical center of the fronts from approximately 2 inches below top point of front to approximately 1 1/2 inches above bottom edge of front, clearing pocket.	Hand or Machine			Commercial	
	b. Baste from lapel breakline across top of front and around armhole approximately 1 inch from edge and continue basting along back edge to bottom of forepart.	Hand or Machine			Commercial	
	c. Baste along breakline of lapel and continue basting down front to bottom approximately one inch from edge.	Hand or Machine			Commercial	
	d. Baste across top and down front edge of pocket through front interlining and front.	Hand or Machine			Commercial	
	e. Tack top and front edge of pockets to front interlining with 2 rows of blindstitching; the first row on the edge and the second row adjacent but not deeper than the seam line.	103 or	SSm-2	4-6	50 or Comm'l	50 or comm'l
		301 or		4-6	50 or Comm'l	
		Hand		2-4	50 or Comm'l	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
16.	Baste front interlining (cont'd)					
	f. Mark the breakline of each lapel. Position and baste a 3/4 inch wide bridle stay to interlining, adjacent to but behind the breakline of each lapel. The bridle stay shall extend from top raw edge of gorge seam to 1 (± 1/4) inch from front edge at the bottom of lapel. Stay shall be held taut distributing bust fullness evenly on fronts.	Hand or Machine			Commercial	
	g. Pad interlining to coat front lapels with not less than eight equally spaced rows of blindstitching. Fullness shall be distributed between rows of stitching in order to roll the lapel.	103 or	SSm-8	6-8	50	
		301 or		6-8	50	50
		Hand		2-4	50	
	h. Blindstitch the bridle stay to coat front interlining along both edges.	103 or	SSm-2	6-8	50	
		301 or		6-8	50	50
		Hand		2-4	50	
17.	Make back and finish center vent					
	a. The back shall consist of two pieces with a center back vent.					
	b. Join center backs face to face 1/2 inch from the raw edge, continue stitching across top of the left and right vent to 3/4 to 1 inch from raw edge of extensions.	301	LSq-2(a)	12-16	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of the overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
17.	Make back and finish center vent (cont'd)					
	c. Stitch a 1/2 inch wide tape to the underside of the left back vent turn under, adjacent to the fold line for the entire length of the vent. The stitching shall be 1/16 to 1/8 inch from the edge of the tape next to the fold line and shall not be exposed on the outside.	301		12-16	50	50
	d. The loop shall be centered with an opening of not more than 7/8 inch in length in the finished vent.					
	e. Bind inner edge of left back vent simultaneously catching the ends of the button loop. The edges of the loop ends shall be abutted and the loop overlap the face of the left back vent turn under. The ends may be pretacked.	301	BSc-1	12-16	50	50
		or 401			50	70
	NOTE: When nylon binding is used, loops shall be formed from a strip of bias-cut nylon lining. Fold binding in half lengthwise face side out turn in raw edges parallel to the fold and stitch 1/16 inch from edge. The finished loops shall measure 1/4 (± 1/16) inch wide.	301	EFp-1	12-16	50	50
	f. Fold left vent under as indicated by notch on pattern and edgestitch.	301	OSf-1	12-16	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
17.	Make back and finish center vent (cont'd)					
	g. Stitch 1/16 to 1/8 inch from the raw edge, the nylon lining vent piece facing to underside along outer edge of right back vent, turning under the inner edge at top edge of vent to form a point.	301	SSa-1	12-16	50	50
	h. Turn under and baste, the remainder of the inner raw edge of nylon right back vent piece facing to finish 3 3/4 (± 1/4) inches wide below top point.	Hand or Machine			Commercial	
	i. Bind both edges of center back seam and outer edge of right back vent with bias-cut nylon binding from neck to bottom, slitting left back seam allowance at top of vent for depth of binding if required.	301 or 401	BSc-1	12-16	50 50	50 70
	j. Turn center seam against left back and raise stitch from neck to top of vent with the stitching aligned with edge stitching on the vent.	301	LSq-2(b)	12-16	50	50
	k. Secure top of left back vent to right back vent with a row of diagonal stitching for 3/4 to 1 inch. Row of stitching shall end on row of raised stitching.	301	SSv-1	12-16	50	50
	l. The finished left vent shall overlap the finished right vent 2 3/4 (± 1/4) inches.					
18.	Tape armholes of back and front					
	a. Sew a 3/16 inch wide stay tape at armholes of back and fronts from side seam to top of back and fronts respectively. The front interlining shall not be caught in the taping of the front armhole.	301	SSaa-1	12-16	50	50
	b. Press tape at armholes.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
19.	Stay neck of back and front gorge Sew a 3/16 inch wide stay tape to neck of back and front gorge. Top edge of tape shall be 3/8 (± 1/8) inch from top of back neck and front gorge and ends of tape shall clear the seam allowance joining sleeves to front and back. The stitching shall not be exposed on the outside of overcoat below neck edge of under-collar.	301	SSa-1	12-16	50	50
20.	Join side seams					
	a. Bind sides of fronts with a bias-cut nylon binding.	301 or 401	BSc-1	12-16	50 50	50 70
	b. Join side seams (back over front) with the stitching 3/8 inch in from edge of back and the front extending 3/8 inch beyond back.	301	LSs-2(a)	12-16	50	50
	c. Turn and raise stitch (back on top of fronts).	301	LSs-2(b)	12-16	50	50
21.	Attach front facing and front lining					
	a. Join 1/4 inch from raw edges, wool front facings to wool back neck facing. Spread seams open and stitch 1/16 inch from folded edge on each side of seamline.	301	SSz-3	12-16	50	50
	*b. Bind inner edge of wool facing and neck piece with nylon binding.	301 or 401	BSc-1	12-16	50 50	50 70
	*c. Seam front edge of front lining to the facing 1 1/2 inches from inner edge of facing. The bottom of front lining shall be turn under and lapped over the lining strips (bellows). Continue the stitching to the bottom of the facing through and 1/2 inch from the raw edge of the lining strip.	301	SSa-1 and LSa-1	12-16	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
22.	Press fronts Press front edge, lapel and bust of right and left forepart individually on a suitably shaped pressing block with a steam pressing machine.					
23.	Shaped fronts a. Mark and shape lapels in accordance with lapel shaper. b. Shape and trim fronts and bottom edges of overcoat matching vent lengths. Clip ends of binding from side seams and vent. c. Trim interlining 5/16 (± 1/16) inch along lapel and front edges and 1/8 (± 1/16) inch inside the hem fold line at bottom of overcoat. d. Trim bottom of left front taking off 1/4 inch at front edge and tapering to nothing for a distance of 5 (± 1) inches. The left front shall be 1/4 inch shorter than the right front. e. The interlining at the bottom may be cut diagonally so that the interlining is not caught in the stitching across bottom of facing. f. Marking and trimming of lapels, fronts and bottom edges may be performed with a clicker machine.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
24.	Mark and bind bottom turn up					
	a. Mark bottom turn up 1 1/4 (± 1/4) inches.					
	b. Trim left vent turn under even with hem fold line from the inner edge to approximately 3/8 inch from fold line, eliminating bulk.					
	c. Bind the bottom of overcoat with nylon binding. Raw edge of binding shall be on the inside edge of finished hem.	301 or 401	BSb-1	12-16	50 50	50 70
25.	Make back yoke lining					
	a. The back lining shall consist of two pieces.					
	b. Join back lining pieces at center back (back to back of fabric) 1/4 inch from the raw edge; turn and topstitch 3/8 inch from the folded edge enclosing raw edges on underside.	301	SSae-2	12-16	50	50
	c. Form a hem at bottom of lining by turning in raw edge 1/4 inch and folding over bottom to finish 1/2 (± 1/8) inch wide (hem). Edgestitch 1/16 inch from folded edge.	301	EFb-1	12-16	50	50
26.	Baste yoke to back					
	Fit and baste on back along neck, armholes and sides, forming a 3/8 to 1/2 inch pleat at center of back. The pleat shall start from the top of yoke and taper to nothing approximately 6 inches from bottom of hem.	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
27.	Join the facing and body lining to overcoat					
	a. Match, fit and baste facings and front lining to overcoat putting in proper fullness in the lapel and bust.	Hand or Machine			Commercial	
	b. Position front edges of facing and overcoat, face to face, and stitch a 1/2 inch wide tape 1/8 to 3/16 inch from edge of overcoat and facing starting from lapel notch, across top of lapel, down front and across bottom 2 1/2 (+ 1/2) inches beyond back edge of facing. The bottom end of lining strip shall be folded to form a bellows when stitching across facing.	301	SSab-1 and SSau-2 (except only one row of stitching)	12-16	50	50
	c. Blindstitch back edge of tape on fronts and lapels to interlining.	103 or	SSm-1	4-8	50	
		301 or		4-8	50	50
		Hand		2-4	50	
	* NOTE: As an alternate to operation 27b and 27c, a 5/8 inch fusible tape may be used in lieu of the 1/2 inch tape. When this method is used, the tape must be pressed and fused to the interlining and the back edge of the tape shall not be blindstitched to the interlining.					
	d. Press edges of lapels, fronts and bottom of facings flat and smooth.					
	e. Notch corner of lapels and trim the edges of fronts from lapel to bottom. The edges may be trimmed with a blade attachment in the stitching and taping operation.					
	f. Remove basting and press edge seams open and flat.					
	g. Turn overcoat to finished position, work out rounded corner of lapel and bottom front corner of overcoat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
27.	Join the facing and body lining to overcoat (cont'd)					
	h. Baste edges (first basting) of lapels, fronts, and bottoms matching vent lengths.	Hand or Machine			Commercial	
	i. Baste facings (second basting) 1 1/2 (± 1/2) inches across and down lapels and fronts to back edge of facing.	Hand or Machine			Commercial	
	j. Baste facings (third basting) 1 (± 1/2) inch along the inner edge properly distributing fullness of facing within the bust area and holding lower corner of overcoat rolled in such a manner as to cause lower front edge of forepart to roll inward.	Hand or Machine			Commercial	
	k. Place a row of basting diagonally from lapel breakline to the point of lapel placing proper fullness in facing to allow lapel to roll.	Hand or Machine			Commercial	
	l. Baste along breakline of lapel placing proper fullness over bust.	Hand or Machine			Commercial	
	m. Blindstitch seam allowance joining front edge of front lining to inner edge of front lining strip to interlining starting 3 (± 1/2) inches from the top edge and ending at the step edge of front lining strip.	103 or 301 or Hand	SSm-1	4-8 4-8 2-4	50 50 50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
27.	Join the facing and body lining to overcoat (cont'd)					
	*n. Baste front lining wide around armholes and below shoulder seams. Turn under and baste side and bottom edges of front lining. The front lining shall overlap the back yoke at the side seam. As an alternate, the side seam allowance of the front and back yoke lining may be trimmed to allow for a 3/8 inch seam by machine.	Hand or Machine			Commercial	
		301	SSa-1	10-12	50	50
	o. Baste edge of lining strips to forepart forming a bellows.	Hand or Machine			Commercial	
	p. Trim away the excess lining and interlining extending beyond armholes and neck edges.					
28.	Set sleeves in armholes					
	a. Set sleeve to armhole, according to notches and stitch 3/8 inch from the raw edge. The underarm seam shall coincide with the side seam (1/4 inch tolerance from side seam of body). Care shall be taken not to stretch upper part of armhole seam.	301	SSa-1	12-16	50	50
	b. Press armhole seam shrinking out fullness in the sleeve and press open upper part of armhole seam.					
	c. Topstitch all around armholes (front and back)	301	OSa-1	12-16	50	50
	d. Baste around armhole from outside of overcoat positioning lining and interlining in proper place	Hand or Machine			Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
28.	Set sleeves in armholes (cont'd)					
	e. Tack all around armhole seam allowance through interlining and lining.	103 or		2-4	50 or Commercial	
		301 or		2-4	50 or Commercial	50 or Commercial
		Hand		2-4	50 or Commercial	
	f. Baste the front and back upper ends of sleeve lining in position with the seam allowance turned under and lapped over the front and back lining.	Hand or Machine			Commercial	
29.	Make nylon hanger loop (when used in lieu of braid)					
	The hanger loop shall conform to the requirements specified in operation 17e.					
30.	Set collar and attach hanger					
	a. Seam topcollar to gorge of facing to a point not less than 1 inch back of lapel breakline; notch seam allowance of gorge facing at end of stitching.	301	SSa-1	12-16	50	50
	b. Spread gorge seam and tack to neck seam of overcoat catching the top edge of interlining and the end of bridle tape.	Hand or		4-8	50	
		301		12-16	50	50
	c. Baste undercollar to overcoat neck line.	Hand or Machine			Commercial	
	d. Tack neck outlet of overcoat and lining across back to undercollar interlining with a blindstitch.	103 or	SSm-1	4-8	50 or Commercial	
		301	or	4-8	50 or Commercial	50 or Commercial
		Hand		4-6	50 or Commercial	

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
30.	Set collar and attach hanger (cont'd)					
	e. Turn under and baste the neck edge of the top-collar stand to the neck.	Hand or Machine			Commercial	
	f. Fell the undercollar to the overcoat and tack the corners by hand.	Hand or Machine and Hand		8-10 6-10 8-10	C (silk) A (silk) C (silk)	
	g. Fell topcollar stand to neckline of overcoat, simultaneously catching the size label in the stitching.	Hand		8-10	C (silk)	
	h. Position a hanger loop at center of back (± 1/2) inch with the bottom edge even with the bottom edge of the topcollar stand. The finished hanger loop shall measure 2 1/2 (± 1/4) inches between the bartacks.					
	i. Bartack across the width of the ends of hanger, 1/8 to 3/16 inch from each end of hanger through all plies of material. The bartack shall cover the ends of the hanger.	Bartack	LSd-1	28 per bartack	50	50
	j. The finished collar shall measure 4 (± 1/4) inches wide at the center of back.					
	k. In lieu of operations d, e and g, stitch lower edge of topcollar across neck from gorge seam to gorge seam, catching the size label in the stitching.	301	SSa-1	10-12	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
31.	Edgestitching Edgestitch the fronts, lapels and collar. The row of stitching shall continue and extend across the bottom for a distance of 1/2 to 1 inch beyond inner edge of facing.	301	SSae-2(b) shows finished seam	12-16	50	50
32.	Attach belt loops to overcoat a. There shall be four loops; all of uniform width; three belt loops attached to overcoat back and one inserted at buckle end of belt.					
	b. Position 3 belt loops as indicated by pattern marks; one on each side seam and one on the center back seam with the ends of each loop positioned between the seam line and raise stitching. Turn under the ends of loops and seam on the underside.	301	LSd-1	12-16	50	50
	c. The finished loop openings shall measure 2 1/4 (± 1/8) inches between the ends.					
	d. Form a belt loop (for belt keeper) face to face and stitch or bartack raw ends together 3/8 to 1/2 inch from raw edges.	301 or Bartack	SSa-1	12-16 28 per bartack	50 50	50 50
	e. Insert belt through belt keeper loop and tack to underply, or bartack through both plies of belt 4 (± 1/2) inches from buckle with the spread seamed ends superimposed on the centered seamline.	Hand or Bartack		4-6 per tack 28 per bartack	A or C (silk) 50	 50
	f. The finished loop shall provide easy entry of belt but shall not be more than 1/4 inch wider than the belt.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
33.	Press fronts Press fronts prior to the buttonhole operation.					
34.	Complete felling a. Hand fell the following:	Hand		8-10	C (silk)	
	(1) Sleeve lining all around armholes, or the sleeve lining and yoke armhole lining seams may be trimmed to allow for a 3/8 inch seam and sewn by machine. (2) Front lining over back yoke. (3) Tack bottom of yoke to side seams. (4) Back edge of facings for depth of bottom hem. (5) Ends of bottom hem to vent edges with end of binding at top of hem turned under and caught by the felling stitches. (6) Underside of neck facing to lining extending between the top ends of stitching on front facings. NOTE: This operation shall be performed only if topcollar and the neck of the yoke is not completely sewn to the neck of the overcoat by machine. (7) Top of vent with right back vent lapped over left back with bound edges even, extending from point of rayon facing on right back vent to finish even with end of diagonal stitching through left coat back vents.	301	SSa-1	10-12	50	50
	b. Hand or machine fell the following:	Hand or Machine		8-10 6-10	A or C (silk) O (silk)	O (silk)
	(1) Sleeve lining 1 1/8 (± 1/8) inches from bottom of sleeve. (2) Below yoke at side seams and bottom edge of front lining to overcoat front and top of lining strip. (3) Inner (turned under) lining edge of right back vent to back.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
34.	Complete felling (cont'd) (4) Inside bound edge of left back vent to back from top of vent to top of hem. (5) Entire top edge of hem. (6) Lining strips (bellows) to front.					
35.	Clean overcoat a. Remove all basting. b. Trim all ends of stitching and remove all loose threads. c. Remove all but one shade ticket for pairing with liner. d. Remove all spots and stains without injury to the material.					
36.	Mark location of all buttonholes a. Mark position of four horizontal buttonholes on lower right front and one horizontal buttonhole on lower left front to correspond with second from top-buttonhole on right front. One on the lapel of each front 2 (± 1/8) inches down and parallel to the step. Inside purled edge of eyelets shall be 1 (± 1/8) inches from the finished front edge. First and fourth lower buttonholes shall be placed in accordance with pattern perforations and the remaining buttonholes shall be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
36.	Mark location of all buttonholes b. Mark position of 4 buttonholes as follows: (1) Two in collar tab centered and parallel to the sides of tab with inside purles edge of each eyelet 1/2 (± 1/8) inch from finished end of tab. (2) One in each sleeve tab centered and parallel to the sides of tab with the inside purled edge of eyelet 3/4 (± 1/8) inch from finished end of tab.					
37.	Make all buttonholes a. All buttonholes shall be eyelet end, square bar, cut first type, well work and reinforced with gimp with the stitches securely caught in the fabric and the ends of the gimp pulled through the underside. Buttonholes shall be clean and correctly positioned with the purling finishing on the outside and face side for the lapel.					
	b. The ends of all buttonholes shall be tacked by hand or machine with a 1/4 inch bartack in a separate operation from buttonhole making; securely catching ends of gimp and covering the width of the bar.	Bartack or Hand		21 per bartack 10-12 per tack	50 50	50
	As an alternate, the buttonholes on the sleeve tab and the collar tab may be constructed with a cross-bar machine that sews a buttonhole and bartacks the end in one operation.	or				
	c. Stitch 1 1/8 (± 1/8) inch buttonholes in accordance with location specified in operation 36a.	Button-hole		85-90 per buttonhole not including tack	50	50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
37.	Make all buttonholes (cont'd) d. Stitch 3/4 to 7/8 inch buttonholes in accordance with location specified in operations 36b (.) and 36b (2).	Button-hole		40-45 per button-hole not including tack	50	50
38.	Pressing (machine) a. Press edges and bottom (edge pressing machine). b. Press each front (front machine or suitable pressing buck). c. Press balance of fronts, side seams, and back (body machine). d. Roll press sleeves. e. Press collar (collar machine). f. Mark breakline of undercollar in accordance with undercollar shaper. Press collar on breakline from shoulder seam to shoulder seam without stretching collar. g. Press remainder of collar leaf flat and smooth. h. Crease lower front and back part of armhole solid on the inside edge of armhole. i. Press lapels. j. When alternate method of forming breakline is used (see operation 12i), the breakline shall be creased on collar from gorgeseam to gorgeseam. The breakline shall be the same as if the stitching operation was performed.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
39.	Finish press a. Press lining smooth with hand pressing iron. Press vertical pleat in lining on center back. b. Press belt flat and smooth. c. Remove gloss and impressions from undercollar and lapels, sleeve tabs, and pocket welts. d. Press any wrinkles missed by previous operation. e. Brush overcoat.					
40.	Mark and attach buttons a. All attached buttons (except stays and button located on top seam of sleeves) shall be aligned with corresponding buttonhole eyelet so that no bulging or distortion occurs when fronts, lapels or sleeve tabs are buttoned.					
	b. Buttons shall be attached to specific locations (see below) either by hand or machine.	Hand		4 per button with double thread	16	
		or				
		Machine		14 to 16 per button or 20 to 24 per button	20	20

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
40.	Mark and attach buttons (cont'd) c. All buttons except for buttons on the lower right front, shall be wrapped by hand or machine to form a shank with thread ends securely tacked off with not less than two stitches and thread ends hidden. The left front buttons and inside waist (anchor) button on right front facing shall be wrapped six times. All other buttons shall be wrapped four times. d. Mark location and sew five 45-line buttons to each lower and lapel front through the canvas interlining, lining and 18-line stay buttons. When buttons on fronts are located over slash welt pockets, stay button shall be sewn to button on front through outer ply of pockets. Stay button shall be omitted on second from top (bust) button on right front and top (lapel) buttons. Centers of the four lower buttons shall be 6 (± 1/8) inches from finished front edge and correspond with respective buttonholes. Center of top buttons shall be aligned with eyelet of corresponding buttonhole on lapel. NOTE: Lapel buttons shall provide a proper and smooth closure when convertible feature is used. Collar, when lapels are buttoned, shall not spread more than 2 inches. e. Mark location and sew a 45-line button to right facing to accomodate buttonhole eyelet on left front when overcoat is buttoned from the inside. Button shall be securely sewn and tacked through the facing and interlining only, not through the overcoat.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
40.	Mark and attach buttons (cont'd) f. Mark location and sew two 30-line buttons on each front sleeve through lining to correspond to buttonhole eyelet in sleeve tab with tab lying flat and smooth. Mark location and sew a second button for sleeve tab to top seam of sleeve through lining and in line with first button from bottom of sleeve. g. Mark location and sew one 24-line button to underarm seam of lining through lining and wigan 3 (± 1/4) inches up from bottom edge of sleeve (to accommodate sleeve button loop of liner). h. Mark location and sew one 24-line button on outside of right back vent and through lining to accommodate button loop on left back vent. i. Mark location and sew three 30-line buttons through undercollar and undercollar interlining as follows: Two centered on the right end of the undercollar 4 (± 1/4) inches and 7 1/2 (± 1/4) inches respectively from outer curved edge to correspond with buttonholes on collar tab and one centered on left end of undercollar 3 1/4 (± 1/4) inches from the outer curved edge.					
41.	Assemble belt Insert belt through belt loops attached to overcoat with the buckle on the right front of overcoat; insert belt through buckle and belt loop keeper.					
42.	Fasten tabs and vent a. Button collar tab under right undercollar.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table I - Construction of overcoat (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
42.	Fasten tabs and vent (cont'd) B. Button vent and sleeve tabs.					
43.	Slide fastener a. Position the slide fastener on the overcoat facings so that the ends of the fastener are equidistant from the bottom edge of the liner and the overcoat. The separating pin of the slide fastener shall be on the right side. b. Position the slide fastener on the underside of over coat facings with the front edge of the chain 3/8 to 1/2 inch from the bound edge. c. Turn in the ends of tape 1/2 to 3/4 inch and stitch the length of tape 1/4 to 5/16 inch from the back edge of the chain. NOTE: If the ends of the tape are prefinished, the ends do not need to be turned in.	301	SSa-1	10-14	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table II - Construction of the liner

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
1.	Cutting Whenever applicable, the cutting shall conform to the requirements specified in operation 1 of Table I. The fleece side shall be the back and side in the finished liner, the fleece shall be against the overcoat.					
2.	Replacement of damaged parts (see operation 2, Table I)					
3.	Shade marking (see operation 3, Table I)					
4.	Join side seams					
	a. Join, face to face, fronts to back at side seam 1/4 (± 1/16) inch from edge.	301 or 401	SSa-1	12-16	50 50	50 70
	b. Overedge stitch raw edges together.	503 504 or 602	SSa-1	8-10	70	70
	or					
	c. As an alternate, operation 4a and 4b may be performed in one operation simultaneously stitching and overedging.	515, 516 or 519	SSa-2	8-10	50 (chainstitching) 70 (overedge stitching)	70 70
5.	Make sleeve					
	a. Join, face to face, front to back sleeve 1/4 (± 1/16) inch from raw edge. Stitch both top and bottom sleeve seam.	301 or 401	SSa-1	12-16	50 50	50 70
	b. Overedge stitch raw edge of sleeve seams together.	503 or 504 or 602	SSa-1	8-10	70	70
	or					
	c. As an alternate, operation 5a and 5b may be performed in one operation by simultaneously stitching and overedging.	515, 516 or 519	SSa-2	8-10	50 (chainstitching) 70 (overedge stitching)	70 70

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table II - Construction of liner (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
6.	Join sleeves					
	a. Join sleeve to fronts and backs, face to face, 1/4 (± 1/16) inch from raw edge according to notches on patterns.	301 or 401	SSa-1	12-16	50 50	50 70
	b. Overedge stitch raw edges together. or	503,504 or 602	SSa-1	8-10	70	70
	c. As an alternate, operation 6a and 6b may be performed by simultaneously stitching and overedging in one operation.	515, 516 or 519	SSa-2	8-10	50 (chainstitching) 70 (overedge stitching)	70
7.	Binding					
	Finished appearance: The binding shall be uniformly stitched with no edges showing. The ends of the binding shall overlap not less than 1/2 inch with the binding turned over on itself and securely stitched or bartacked.	Bartack or 301		28 per bartack 8-10	50 50	50 50
	a. Bind underarm sleeve opening according to notch on pattern.	301 or 401	BSc-1	8-10	50 50	50 70
	b. Bind edges of bottom, fronts and neck, catching the top of size label under the binding at center of neck area.	301 or 401	BSc-1	8-10	50 50	50 70
	c. Bind bottom of sleeves, leaving sufficient binding to be run off to permit the forming of a loop to correspond to the inside sleeve button. Loop shall be be securely stitched or bartacked.	301 or 401 301 or bartack	BSc-1	8-10 8-10 28 per bartack	50 50 50 50	50 70 50 50

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table II - Construction of liner (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
8.	Tacking Tack base of armhole of sleeves at underarm seams to top edge of side seams with bound edges abutted.	Hand or bartack		4-6 per tack 28 per bartack	50 50	50
9.	Set slide fastener a. Position the slide fastener on the underside of liner with the back edge of the chain immediately adjacent to the bound edge of liner. b. Turn in the raw end of tape 1/2 to 3/4 inch and stitch 1/4 to 5/16 inch from back edge the length of tape, with the row of stitching superimposed on the binding stitch. NOTE: When ends of the slide fastener tape are prefinished, no turn-up is required.	301	SSa-1	8-10	50	50
10.	Cleaning (see operation 35, Table I, as applicable).					
11.	Pressing a. Press garment neatly throughout with heated pressing iron or machine. b. Remove all wrinkles, creases, gloss marks or pressing impressions.					
12.	Attach liner to raincoat Attach liner to raincoat by means of the slide fastener, checking the finished operation to insure free and easy manipulation of the slider. There should be no bulging or distortion of the raincoat or liner when fastener is engaged. The liner shall match the raincoat for size.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.8 Sizes and measurements The finished measurements of the overcoat and liner shall be as shown in Tables III and IV. Measurements shall be taken as indicated in figures 1 and 2. All measurements and tolerances in Tables III and IV are expressed in inches.

Table III - Sizes and measurements of overcoat

Size	(A) Bust	(B) Center back length			(C) Sleeve underarm seam length			(D) Belt Length
		Short	Regular	Long	Short	Regular	Long	
6	23 3/8	41 1/4	43 1/2	45 3/4	17	18	19	36
8	23 7/8	41 3/4	44	46 1/4	17	18	19	37
10	24 3/8	42 1/2	44 3/4	47	17 1/2	18 1/2	19 1/2	38
12	25 1/8	43 1/2	45 3/4	48	18	19	20	39 1/2
14	25 7/8	43 3/4	46	48 1/4	18	19	20	41
16	26 5/8	44	46 1/4	48 1/2	18	19	20	42 1/2
18	27 3/8	44 1/8	46 3/8	48 5/8	18	19	20	44
20	28 1/8	44 3/8	46 1/2	48 7/8	18	19	20	45 1/2
38	28 1/4	44 3/8	46 1/2	48 7/8	18	19	20	46
40	29 1/4	44 5/8	46 3/4	49 1/8	18	19	20	48
42	30 1/4	44 5/8	46 3/4	49 1/8	18	19	20	50
44	31 1/4	44 7/8	47	49 3/8	18	19	20	52
Tolerances	± 1	± 1/2	± 1/2	± 1/2	± 1/2	± 1/2	± 1/2	± 1

(A) Bust - Measurement shall be taken from right front edge of overcoat, at base of armhole, over right bust to center back seam line.

(B) Center back length - Measurement shall be taken from collar seam (neckline) down center back to bottom of overcoat. Vent shall be fully buttoned. Overcoat shall be fully buttoned, laid flat and smooth.

(C) Sleeve underarm seam length - Measurement shall be taken at base of armhole along underarm seam to bottom of sleeve. Sleeve shall be laid flat and smooth.

(D) Belt length - Measurement shall be taken from the point of belt to fold at buckle bar.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

Table IV - Sizes and measurements of liner

Size	(E) Back Length			(F) Sleeve underarm seam		
	Short	Regular	Long	Short	Regular	Long
6	36 1/2	38 1/4	41 1/4	13 1/4	14 1/4	14 3/4
8	37	38 3/4	41 3/4	13 1/2	14 1/2	15
10	37 1/2	39 1/2	42 1/2	13 3/4	14 3/4	15 3/4
12	38 3/4	40 1/2	43 1/2	14	15	16
14	39	40 3/4	43 3/4	14 1/4	15 1/4	16 1/4
16	39 1/4	41	44	14 1/4	15 1/4	16 1/4
18	39 3/8	41 1/8	44 1/8	14 1/4	15 1/4	16 1/4
20	39 1/2	41 1/4	44 1/4	14 1/4	15 1/4	16 1/4
38	39 5/8	41 3/8	44 3/8	14 1/4	15 1/4	16 1/4
40	39 3/4	41 1/2	44 1/2	14 1/4	15 1/4	16 1/4
42	39 7/8	41 5/8	44 5/8	14 1/4	15 1/4	16 1/4
44	40	41 3/4	44 3/4	14 1/4	15 1/4	16 1/4
Tolerances	± 3/4	± 3/4	± 3/4	± 1/2	± 1/2	± 1/2

(E) - Back length - Measurement shall be taken from top to bottom along center back of liner inclusive of binding.

(F) - Sleeve underarm seam - Measurement shall be taken along underarm seam of liner sleeve from armhole (opening) to bottom of sleeve inclusive of binding.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

3.9 Workmanship The finished overcoats shall conform to the quality of product established by this specification. As a final step in the contractor's production control plan before formation of a lot, each overcoat shall be examined after pressing and prior to folding for packaging, and a overcoat containing a selected defect shall not be included in the end item lot. Selected defects are those defects listed in MIL-STD-1392 indicated by an asterisk (*). The occurrence of defects shall not exceed the applicable acceptable point value or defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to the prescribed requirements.

4.1.1 Certificate of compliance Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.3).
2. Quality conformance inspection (see 4.4).

4.3 First article inspection The first article submitted in accordance with 3.2 shall be inspected as specified for compliance with design, construction, workmanship and dimensional requirements.

4.4 Quality conformance inspection Sampling for inspection shall be performed in accordance with MIL-STD-1392.

4.4.1 Component and material inspection In accordance with 4.1, components and materials shall be inspected and tested in accordance with all the requirements of referenced specifications, drawings and standards, unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. The contractor shall furnish a certificate of compliance that all components of the slide fastener are furnished by the same supplier (see 3.3.16) and web tape requirements of 3.3.9.2

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

4.4.2 End item examination Sampling and examination of the end item shall be performed in accordance with the provisions of MIL-STD-1392.

4.4.3 Packaging inspection Packaging inspection shall be in accordance with MIL-STD-1392.

5. PREPARATION FOR DELIVERY

5.1 Packaging Packaging shall be level A or C (see 6.2).

5.1.1 Level A Each fully buttoned overcoat shall be folded as follows: 1. Fold in thirds, lengthwise by bringing the left front over the right front, with the edge of the left front near the right seam. 2. Fold sleeves straight across the chest. 3. Fold the top of garment down approximately 1/3 of the length. 4. Bring bottom of garment up approximately 14 1/2 inches by 23 inches. Each folded overcoat shall be inserted in a snug-fitting clear polyethylene film bag of 0.0015 inch thickness (± 20% tolerance). All seams and closures shall be formed by heat sealing. A 1/4 inch diameter hole shall be made at one corner of the bag to allow excess air to escape. The bag shall be not less than 1 inch greater in length than the folded garment. As an alternate, the polyethylene bag may be of the tuck-in or reverse flap type where a heat seal closure and corner hole are not required.

5.1.2 Level C (commercial packaging) The overcoats shall be packaged to afford adequate protection against physical damage during shipment from the contractor to the first receiving activity. The package and the quantity per package shall be the same as that normally used by the contractor for retail distribution.

5.2 Packing Packing shall be level A, B, or C as specified (see 6.2).

5.2.1 Level A Five (5) overcoats, of one size only, packaged as specified in 5.1, shall be packed in a fiberboard shipping container assembled, closed, and reinforced conforming to type SF, class weather-resistant, grade V2s, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. Level A packages shall be packed flat, front up, alternated end for end five in depth within the shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract or when there are less than the required amount per shipping container of the same size, mixed sizes may be packed within the same shipping container.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

5.2.2 Level B Five (5) overcoats, of one size only, packaged as specified in 5.1, shall be packed in a fiberboard shipping container assembled and closed conforming to type CF, class domestic, grade 275, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class domestic, variety SW or DW, grade 200 of MIL-B-17757. Level A packages shall be packed flat, front up, alternated end for end five in depth within the shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract or when there are less than the required amount per contianer of the same size, mixed sizes may be packed within the same shipping container.

5.2.2.1 When specified (see 6.2), the shipping container shall be a grade V3c, V3s, or V4s fiberboard box fabricated in accordance with MIL-B-17757, and closed in accordance with the appendix of the container specification.

5.2.3 Level C (Commercial packing) Overcoats packaged as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. The quantity per shipping container shall be the same as that used by the contractor for retail distribution. Containers shall comply with the US Postal Service Manual, Uniform Freight Classification Rules or National Motor Freight Classification Rules, as applicable.

5.3 Marking In addition to any special marking required by the contract or order, shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Polyethylene bagged packages Polyethylene bagged packages shall have the required information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready indentification. The bag or label shall indicate the following information:

STOCK NUMBER
NOMENCLATURE
SIZE
QUANTITY

5.3.2 Labels, mixed sizes Each shipping container, packed with mixed sizes only, shall have securely attached to the end and side, directly under the printing or stenciling a white paper label 5 by 4 inches with the words "MIXED SIZES" plainly stamped or printed thereon and under these words shall be legibly stamped or printed the correct quantity and sizes contained therein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Intended use The overcoat covered by this specification is intended for use interchangeable as an overcoat or raincoat by enlisted women personnel in the Department of the Navy.

6.2 Ordering data Procurement documents should specify the following:

a. Title, number and date of this specification.
b. Size and length required (see 1.2).
c. When first article sample is required (see 3.2).
d. Levels of packaging and packing required (see 5.1 and 5.2).
e. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1).

6.3 Samples and pattern For access to sample and pattern, address the procuring activity issuing the invitation for bids.

*6.4 Changes from previous issue The margins of the specification are marked with an asterisk to indicate when changes (additions, modifications, corrections, deletions) form the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire context irrespective of the marginal notations and relationship to the last previous issue.

Custodian:
Navy - NU

Preparing activity:
Navy - NU

Review activity:
DLA-CT

Project No. 8410-N450.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.


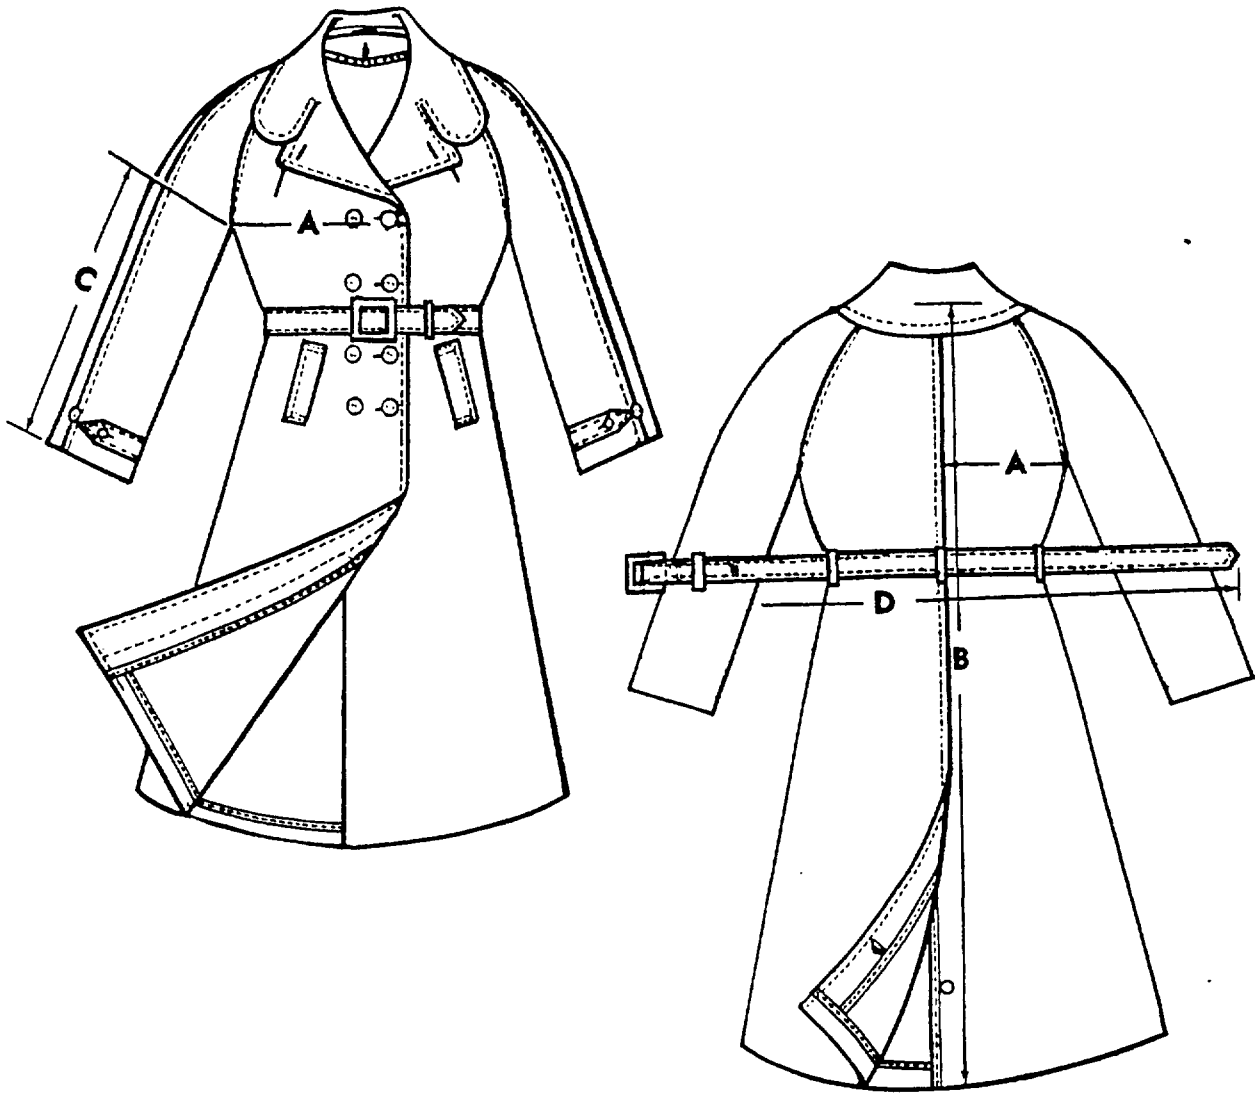


Figure 1 — OVERCOAT, WOMAN'S (WITH REMOVABLE LINER, ENLISTED)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

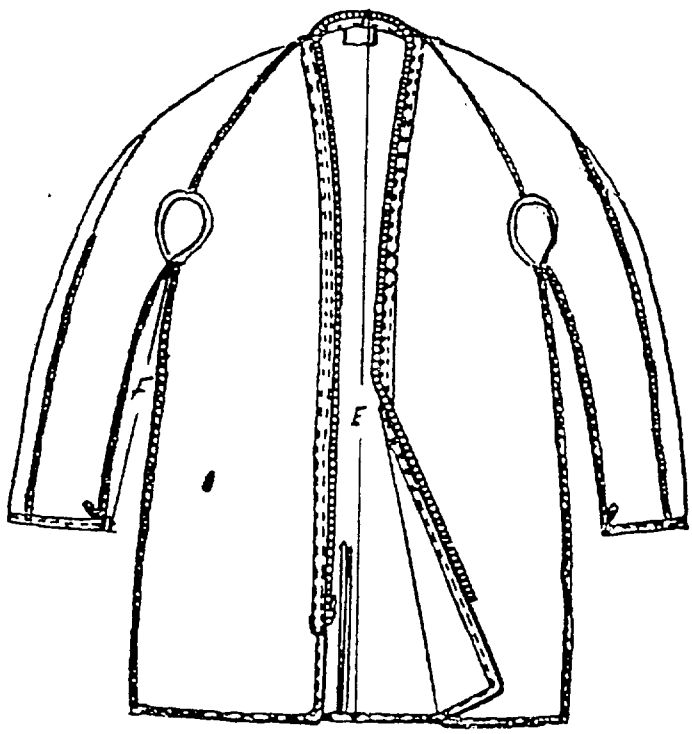

FRONT

FIGURE 2 OVERCOAT, WOMAN'S, W/REMOVABLE LINER (ENLISTED)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.
NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-O-16736E(NU) OVERCOAT, WOMAN'S (WITH REMOVABLE LINER, ENLISTED)

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1426 1 OCT 76

Replaces edition of 1 Jan 72 which may be used.

S/N 0102-LF-001-4260

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.

FOLD

OFFICER IN CHARGE
NAVY CLOTHING & TEXTILE RESEARCH FACILITY
21 STRATHMORE ROAD
NATICK, MA 01760

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DoD-316

U.S.MAIL

OFFICER IN CHARGE
NAVY CLOTHING & TEXTILE RESEARCH FACILITY
21 STRATHMORE ROAD
NATICK, MA 01760

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T09:20Z
Check the source to verify that this is the current version before use.