INCH-POUND
A-A-55092A
December 6, 2021
SUPERSEDING
A-A-55092
November 16, 1992

COMMERCIAL ITEM DESCRIPTION

BAG, CLOTHING, WATERPROOF

The General Services Administration has authorized the use of this commercial item description (CID) for all federal agencies.

1. SCOPE. This document covers a waterproof clothing bag.

2. CLASSIFICATION. This bag shall be of one (1) type and size in the following classes:

2.1 Classes.

Class 1 – Cloth, parachute, nylon
Class 2 – Cloth, plain weave, nylon

3. SALIENT CHARACTERISTICS.

3.1 Description. The bag shall conform to the design shown in Figure 1. The coated side of the cloth shall be on the inside of the bag. The bag shall be constructed from uncured coated cloth. All joining seams shall be cemented. The seam shall be single lapped a minimum of l-inch in width and rolled after cementing. Pleats due to working in of excess material in the seam joining the bottom to the body of the bag are permissible. After assembly, the bag shall be thoroughly cured. The hem shall be formed by turning the top of the bag 1/2-inch and firmly cementing. The finished hem shall measure 1/2 (± 1/4)-inch. The tie cord shall be made of braid, cotton or polyester. The ends of the cotton tie cord shall be tipped, or resin treated (see MIL-DTL-371 for standards). The ends of the polyester tie cord shall be evenly fused to prevent raveling.

Beneficial comments, recommendations, additions, deletions, clarifications, etc. and any data that may improve this document should be sent to: Attn: DLA Troop Support, 700 Robbins Avenue, Philadelphia, PA 19111-5096. Since contact information can change, verify the currency of the address information using Acquisition Streamlining and Standardization Information System (ASSIST) online database https://assist.dla.mil/.

FSC 8465

DISTRIBUTION STATEMENT A. Approved for public release. Distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

3.1.1 Figures. Figures 1 and 2 are furnished for informational purposes only. To the extent of any inconsistencies between the written document and the figure, the written document shall govern.

3.2 Materials.

3.2.1 Basic material. The base cloth (uncoated) shall be either of the following cloths:

a. Cloth, parachute, nylon shall conform to Type I of MIL-C- 7350, except that only weight and texture requirements shall apply.

b. Cloth, nylon, plain weave, semi-dull or bright filament nylon, 200 to 220 denier when tested in accordance with ASTM D6587, with a minimum 40-by-40 texture. The weight shall be 2.2 ± 0.2 ounces per square yard when tested in accordance with ASTM D3776/D3776M.

3.2.2 Color. The color shall be Camouflage Green 483 or as specified in the contract or purchase order. The finished cloth shall match the standard sample for shade and appearance and shall be equal to or better than the standard sample with respect to all characteristics for which the standard sample is referenced.

3.2.2.1 Visual shade matching. The color and appearance of the material shall match the standard sample when viewed using the AATCC EP9, Evaluation Procedure for Visual Assessment of Color Difference of Textiles, Option C (see 7.6), with sources simulating artificial daylight D_{75} illuminant with a color temperature of 7500 (± 200) K illumination of 100 (± 20) foot candles, and shall be a good match to the standard sample under incandescent lamplight at 2856 (± 200) K.

3.2.3 Coating compound. The compound for coating the base cloth shall be synthetic rubber. The use of the natural rubber is prohibited. The color of the coating compound shall be black.

3.2.3.1 Coated cloth. The coating compound shall be applied to only one side of the base cloth and shall be cured after assembly into the bag. The coated side of the cloth shall be dusted with the dusting material specified below to produce a uniform dull finish. The cured coated cloth shall show no softness or tackiness for the coating when tested for the state of cure as specified in this document.

3.2.3.2 Dusting material. The dusting material shall be whiting, talc, or other commercially finely divided mineral material which does not support mildew growth.

3.2.4 Cement and sealing compound. The cement and sealing compound shall be of synthetic rubber base. It shall be compounded to be heat cured and shall have the same curing characteristics as the coating compound specified above and shall meet the seam performance requirements below. The color of the cement, when dry, shall approximate that of the coated cloth or shall be clear.

3.3 Physical and chemical requirements. The finished coated cloth and bag shall conform to the requirements listed in Table I.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

TABLE I. Physical and chemical requirements for coated fabric and bag seams.

Characteristic	Requirement	Test method
Coated fabric:		
Weight, oz./sq. yd. (min.)	7.0 - 9.0	ASTM D3776/D3776M
Breaking Strength, lbs. (min.) Warp Filling	 125 125	 ASTM D5034 ASTM D5034
Yarns per inch, (min.) Warp Filling	 105 68	 ASTM D3775 ASTM D3775
Tearing Strength, grams (min.) Warp Filling	 1200 1200	 ASTM D1424 ASTM D1424
Stiffness, centimeters (warp only), (max.): At 70°F At 0° After heat treatment	 10 10 12	 See 3.3.9 See 3.3.9 See 3.3.9.1 and 3.3.9
Blocking, (max.)	No. 2	ASTM D751
Low temperature resistance - Pass/Fail	No cracking or flaking	See 3.3.1
Weather resistance – Pass/Fail	No stiffness, brittleness, softness or tackiness	See 3.3.2 and AATCC TM111, Option A
Strength of coating – Pass/Fail	No breaking or cracking of the coating	See 3.3.3
Hydrostatic resistance, psi (min.)	150	ASTM D751, Procedure A, 1/
Hydrostatic resistance after resistance to low temperature, psi (min.)	100	See 3.3.4
Hydrostatic resistance after weather resistance, psi (min.)	100	See 3.3.5
Hydrostatic resistance after strength of coating, psi (min.)	100	See 3.3.6
Hydrostatic resistance after solvent resistance, psi (min.)	100	See 3.3.7
Adhesion of coating, lbs, (min.) Width per 2-inch - dry Width per 2-inch - wet	 8.0 7.0	 See 3.3.8
Abrasion resistance – Pass/Fail	2/	ASTM D4157 and 3.3.10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

TABLE I. Physical and chemical requirements for coated fabric and bag seams. - Continued

Characteristic	Requirement	Test method
Bag seams:		
Hydrostatic resistance of sealed seams – Pass/Fail	3/	See 3.3.11
Seam adhesion, lbs/in. (min.)	4	See 3.3.12
Seam adhesion after water immersion, lbs/in. (min.)	3	See 3.3.12.1
Seam tape adhesion for alternate seam construction, lbs/in. (min.)	4	See 3.3.13.1
Seam tape adhesion after water immersion for alternate seam construction, lbs/in. (min.)	3	See 3.3.13.2
Seam blocking, rating (max.)	3	See 3.3.14

1/ The results shall be reported as the average of the highest four (4) specimens of the five (5) tested per sample unit. Water pressure shall be applied to the coated side of the fabric only. The results shall be reported to the nearest one (1) psi.
2/ The test specimens after abrading shall not show any visual loose fibers on the base fabric exposed in the center 1-inch of abraded portion. All specimens shall pass.
3/ The test specimen shall be considered a failure at the appearance of one (1) or more droplets of water in two (2) or more determination areas.

3.3.1 Low temperature resistance test. The test specimen of coated fabric shall be a 4-by-4 inch square with edges oriented parallel to the warp and filling directions of the coated fabric. The specimen shall be exposed at a temperature of -20 (±2)°F for five (5) hours and tested for resistance to cracking and flaking only. Without removal from the chamber, the specimen shall be creased 180° in the center in the warp and filling directions respectively by folding slightly while lying on a flat smooth surface and running the center of the steel roller over the fold a single time. The steel roller, approximately 5 1/2-inches in a diameter, 2-inches wide, and weighing ten (10) pounds, with a suitable handle guide shall be used. The specimen shall be opened between the two creasing operations. The pressure on the specimen shall be the weight of the roller. The temperature of the roller shall be the same as that of the specimen. The specimen shall be handled with gloves and care taken that its temperature remains uniform throughout the test. The specimen shall be so folded, in both warpwise and fillingwise directions, that the coating, in the case of single coated cloth, or the heavier coating, in the case of unbalanced double coated cloth, shall be on the outside of the fold. In the case of a true balance double coating, either side may be toward the outside of the fold. The specimen shall be removed from the chamber and visually examined for signs of coating cracking or flaking. Five (5) specimens from each sample of material shall be tested and there shall be one (1) determination per sample unit. Any cracking or flaking shall be considered a test failure. The results shall be reported as "Pass" or "Fail".

3.3.2 Weather resistance test. A test specimen of coated fabric measuring 4-by-4 inch shall be subjected to weathering in accordance with AATCC TM 111, option A. The coated side of the test specimen shall be exposed for a period of 100 hours. After exposure, the test specimen shall

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

be examined only to determine if the coating has become stiff, brittle, soft, or tacky. If the test specimen becomes stiff, brittle, soft, or tacky, it shall be considered a test failure. There shall be one (1) determination per sample unit. The results shall be reported as "Pass" or "Fail".

3.3.3 Strength of coating test. The test specimen shall be tested as follows, except that the test for loss in water resistance shall not apply.

The test specimen of coated fabric shall be a 6-by-6 inch square with diagonal dimensions oriented parallel to the warp and filling directions of the coated fabric. The testing machine shall conform to ASTM D5034 with the following modifications: The face of the clamps shall measure 1-by-2 inch with the long dimension perpendicular to the direction of application of the load. All machine attachments for determining maximum load shall be disengaged during the test. The test load applied to the test specimen during the test shall be capable of being maintained within a one (1) pound load tolerance for the required period of time. The distance between the clamps of the testing machine shall be set at four (4) inches. The test specimen shall be centered in the clamps of the testing machine with the edges of the specimen parallel to the edges of the clamps. The clamps shall be separated at a rate of 12-inches/minute until a load of 30 (±1)-lbf has been applied to the specimen. The load shall be held for 30 seconds and then released allowing the specimen to relax. The specimen shall be released from the clamps and the loading procedure repeated on the specimen with the load applied in the direction perpendicular to that of the first load. Five (5) specimens from each sample of material shall be tested and there shall be one (1) determination per sample unit. The test specimen shall be examined for any break or crack in the coating. Any break or crack in the coating shall be considered a test failure. it. The results shall be reported as "Pass" or "Fail".

3.3.4 Hydrostatic resistance after resistance to low temperature test. Five (5) test specimens that have been subjected to low temperature resistance testing (see 3.3.1) shall be tested for hydrostatic resistance in accordance with Table I. The results shall be reported to the nearest one (1) psi.

3.3.5 Hydrostatic resistance after weather resistance test. Five (5) test specimens that have been subjected to the weather resistance testing (see 3.3.2) shall be tested for hydrostatic resistance in accordance with Table I. The results shall be reported to the nearest one (1) psi.

3.3.6 Hydrostatic resistance after strength of coating test. Five (5) test specimens that have been subjected to strength of coating testing (see 3.3.3) shall be tested for hydrostatic resistance in accordance with Table I. The results shall be reported to the nearest one (1) psi.

3.3.7 Hydrostatic resistance after solvent resistance test. Five (5) 10-by-10 inches' test specimens shall be attached (with the coated side up) to the opening of five (5) 600 ml beakers with rubber bands in such a manner that a pocket capable of containing 100 ml is formed. One hundred milliliters of reagent grade naphtha shall be poured into each pocket, with the naphtha contacting the coated surface, and held in this position for 15 minutes. At the end of this time, the naphtha shall be poured off and the specimens shall be removed, and all owed to dry flat, at room temperature for five (5) minutes. Test for hydrostatic resistance shall be made as specified above. The results shall be reported to the nearest one (1) psi.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

3.3.8 Adhesion of coating (dry and wet) test. The adhesion of coating shall be in accordance with ASTM D751, except that a pulling clamp speed of 12 inches/minute shall be used. The original dry adhesion separation shall be stopped after a 3-inch separation. The specimens shall be immersed in distilled water at room temperature for 24 hours, blotted dry, and the wet adhesion shall be determined on the remainder of the specimen. Three (3) specimens from each sample of material shall be tested and there shall be three (3) determination per sample unit. The adhesion shall be the average of the five highest peaks of force. The results shall be reported to the nearest 0.1 lb. per 2-inch width. Cyanoacrylate adhesive shall be used.

3.3.9 Stiffness test. The stiffness testing shall be in accordance with the following procedure:

- Five (5) specimens from the warp direction only shall be cut measuring 1 1/4-inches by 6 to 12-inches with the longer dimension parallel to the direction of the yarns being tested. Testing shall be performed at 70°F, 0°F and after heat treatment (see 3.3.9.1) using a Clark Paper Softness-Stiffness tester.

- The measure of directional flex-stiffness shall be the length of the specimen remaining above the nip of the rolls which, when the test instrument is rotated clockwise and counter-clockwise through 90 (±2)°, just falls to the left and right of the line perpendicular to the nip of the rolls. It is this length of specimen which yields the flexibility criteria being measured. The specimen shall be considered to have fallen to the right or left when the specimen, during the course of clockwise and counter-clockwise rotation, passes across the line perpendicular to the nip of the rolls as indicated by the pointer fastened to the rotating framework.

The length of the specimen shall be determined as follows:

Initial adjustment of test instrument.

1. The apparatus shall be placed in the placed in the test position and leveled with the axis of the clamping surface (nip of the rolls) horizontal and the pointer, fastened to the rotating framework, in the vertical position.

2. One end of the specimen shall be inserted between the rolls with the lengthwise edges of the specimen perpendicular to the nip of the rolls.

3. The specimen shall be positioned and shall be of sufficient length to allow it to bend to the left of the line perpendicular to the nip of the rolls, which when the apparatus is rotated, with continuous uniform motion in the clockwise direction it will fall to the right of the perpendicular line.

4. At the point the specimen falls to the right, the instrument shall be stopped and the adjustable circular scale moved to make the zero position on the scale coincide with the pointer fastened to the rotating framework. The instrument shall then be rotated with continuous uniform motion (±2) degrees from this point in the counter-clockwise direction. The specimen should not fall to the left of the perpendicular line at this point.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

5. If the specimen falls to the left then the instrument shall be rotated in the clockwise direction until the pointer is vertical. The specimen shall be shortened and reset with a bend to the left and the above procedure in 4. shall be repeated.

Determination of flex-stiffness.

1. After initial adjustment the instrument is rotated until the pointer is vertical. The length of the specimen is shortened by a small increment, set with a bend to the left and the instrument is rotated with continuous uniform motion clockwise until the specimen falls to the right to the perpendicular line. The instrument is stopped and the zero position of the adjustable scale is made to coincide with the pointer. The instrument is rotated, with continuous uniform motion, in the counter-clockwise direction 90 (±2) degrees when the instrument is immediately reversed in the clockwise direction and rotated, with continuous uniform motion, to return the pointer to zero. The specimen shall have fallen immediately to the left of perpendicular at 90 (±2) degrees and shall fall immediately to the right of the perpendicular as the pointer reaches zero.

2. If the specimen does not fall to the left when it is rotated the required 90 (±2) degrees in the counter-clockwise direction the pointer is rotated to the vertical position, the specimen is shortened another small increment and the procedure in 1, shall be repeated.

3. When the specimen has reached the length such that it falls to the left and right of the line perpendicular to the nip of the rolls the instrument is stopped with the pointer in a vertical position.

4. Without tension the specimen above the rolls shall be extended and the length measured from the nip of the rolls to the end of the extended specimen, to the nearest mm.

5. The length of the extended specimen is recorded as the directional flex-stiffness of the specimen.

Report of results.

The directional flex-stiffness of the sample unit tested shall be reported as the average of the specimens tested in the warp direction. Individual values shall also be reported.

3.3.9.1 Stiffness after heat treatment test. Specimens that have been tested for stiffness at 70°F shall be placed in a well-ventilated oven at 220°F (± 5)°F for five (5) hours, then removed and conditioned at 70°F (± 5)°F and 65(± 5) percent relative humidity for five (5) hours and the stiffness tested, in only the warp direction, in accordance with 3.3.9. There shall be five (5) determinations per sample unit.

3.3.10 Abrasion resistance test. The abrasion resistance shall be in accordance with ASTM D4157 with the following exceptions:

a. The coated side of the fabric (only) shall be tested using fine emery cloth as the abradant.
b. Three (3) test specimens shall be subjected to 25 continuous cycles under a tension of six (6) pounds and a pressure of three (3) pounds.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

c. Breaking strength determinations shall not be made.
d. The test specimens shall be abraded in the warp direction only.

3.3.11 Hydrostatic resistance of sealed seams. The hydrostatic resistance of the taped seam areas of the waterproof clothing bag shall be determined in accordance with ASTM D751, Procedure B, Procedure 2 with rising hydrostatic head to 25-cm applied to the uncoated face side of the bag and then held for one (1) minute. The test specimen shall be considered a failure at the appearance of one (1) or more droplets of water in two (2) or more determination areas. The bag shall be tested without cutting and one test shall be on the side seam, one where the cord is attached to the bag, and two in the peripheral bottom seam. Prior to conducting the test for the hydrostatic resistance, the seam shall be flexed ten (10) times in the following manner: The bag shall be grasped using the thumb and fingers of each hand in such a manner that the thumbs are parallel to each other and approximately 1/2-inch beyond (outside the edges of the seam tape). With the seam held firmly in the above manner, the thumbs shall be brought together so the cloth and seam tape are in contact. The seam tape shall be flexed vigorously ten (10) times with the cloth and seam tape in contact with itself throughout the test. The flexing action shall be such that when fully flexed in either direction, there shall be a minimum of 2-inches between each thumb nail when the flexed area is fully extended with the test area in contact with itself at all times. The test area shall be visually examined for evidence of peeling or separation of the seam tape prior to conducting the hydrostatic test. There shall be four (4) determinations per sample unit. The results shall be reported as "Pass" or "Fail".

3.3.12 Seam adhesion test. The seam adhesion test shall be conducted in accordance with ASTM D751 with the following exceptions: The tests shall be made on a finished bag and three determinations shall be made on each bag. One determination shall be made on the side seam and two on the peripheral bottom seam. The test specimen shall be the full width of the seam prepared by separating 2-inches. The remainder of the test specimen shall then be separated by the testing machine in accordance with the procedure using a pulling clamp speed of 12 inches/per minute. The adhesion shall be the average of the three (3) highest peaks of force divided by the width of the seam. The results shall be reported to the nearest 0.1 lb. per inch.

3.3.12.1 Seam adhesion after water immersion test. The seam adhesion test shall be conducted in accordance with ASTM D751, except that the tests shall be made on a finished bag and three determinations shall be made on the bag. The seam shall be immersed in water at a temperature of 75 (± 5)°F for two (2) hours and then tested for adhesion while dripping wet. One determination shall be made on the side seam and two on the bottom seam. The results shall be reported to the nearest 0.1 lb. per inch.

3.3.13 Seam tape adhesion test for alternate seam construction. When the alternate seam construction method is used, the test shall be conducted as specified in 3.3.12, for the seam adhesion test except that the adhesion of the seam tape to the fabric/seam shall be determined. The seam tape shall be separated from the fabric/seam by hand sufficient to insert into the testing machine.

3.3.13.1 Seam tape adhesion after water immersion test for alternate seam construction. When the alternate seam construction method is used, the test shall be conducted as specified in 3.3.12.1 for the seam adhesion after water immersion test except that the adhesion of the seam

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

tape to the fabric/seam shall be determined. The seam tape shall be separated from the fabric/seam by hand sufficient to insert into the testing machine.

3.3.14 Seam blocking test. The bag shall be tested for resistance to blocking in accordance with ASTM D751, except that the test specimen shall be prepared by folding the bag so that the sealed seam surface is superimposed with the coated side of the fabric on the inside of the bag and with the seam positioned in the center of the glass plate. There shall be one (1) determination per sample unit. The results shall be reported to the nearest scale reading as follows:

1 - No Blocking. Cloth surfaces are free and separate without any evidence of cohesion or adhesion.
2 - Trace Blocking. Cloth surfaces show slight cohesion or adhesion.
3 - Slight Blocking. Cloth surfaces must be lightly peeled to separate.
4 - Blocking. Cloth surfaces separate with difficulty or coating is removed during separation.

3.3.15 State of cure testing. The sample unit for this test shall be one completed bag. The inspection level shall be as specified in the contract. The bag shall be spot tested on the coated side of the coated cloth with three drops of either toluene or naphtha (Type I, grade B of TT-N-97) and immediately rubbed with the index finger and examined. The examination shall show no evidence of softness or tackiness of the coating. Tests shall be performed at ten locations on the bag as follows:

a. Eight (8) locations on the side of the bag. The bag shall be laid flat on a table with the seam of the bag along one lengthwise fold. Spot tests shall then be conducted at each of four (4) locations approximately 8-inches and 22-inches from the hem of the bag and 6-inches from each fold. The flat bag shall then be turned over and spot tested on the reverse side at four (4) similar locations.

b. Two (2) separate locations on the w of the bag. The bottom of the bag shall be laid flat on a table. Spot tests shall be conducted at two (2) separate locations 4 (±1)-inches from the bottom seam and on a line through the center area of the bag bottom. If softness or tackiness is evident at any of the ten locations on the bag, the coated fabric shall be tested for hydrostatic resistance after solvent resistance as described in 3.3.7, except that only one specimen from an area immediately adjacent to any soft or tacky spot test shall be tested from any one bag, and any failure shall reject the lot.

3.4 Components

3.4.1 Thread. The thread used for bartacking shall conform to Type I or Type II, Class 1, Size B of A-A-59963. The color shall be Camouflage Green 483.

3.4.2 Braid, Cotton or Polyester. The braid for the tie cord shall be cotton conforming to Type III, Class 4 of MIL-B-371 except that the braid need not be water repellant treated. As an alternate, the braid may be made of polyester material, provided the ends are fused to prevent raveling and the braid meets the requirements of Type III, Class 4 of MIL-DTL-371 braid. The color shall be Camouflage Green 483.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

3.4.3 Identification and instruction label. Each bag shall have an identification and instruction marking located on the outside of the bag adjacent to the tie cord (see Figure 1). The markings shall conform to Type III or IV, Class 5 and Class 9 of MIL-DTL-32075. The instruction marking size and content shall conform to Figure 2. The instruction marking shall be printed below the identification marking.

3.4.3.1 Bar code label/tag. Each item shall be individually bar-coded with a paper tag, standard bleach sulfate with a basis weight of a 100 lbs. The bar code shall be a 13-digit National Stock Number (NSN). The bar code shall be used with a medium to high code density and shall be Human Readable Interpretation (HRI). The label/tag shall be located so that it is completely visible on the item when it is folded or packaged and specified and shall cause no damage to the item.

3.5 Alternate seam construction method. (Used only when authorized by the government). As an alternate (see 3.1), the side and bottom seams shall be sewn and then sealed using heat activated, seam sealing tape. The seam shall be superimposed using a lockstitch or chainstitch, provided stitching cannot ravel back. The seam shall be not less than 7/8-inch wide, shall have color approximating the color of the coating compound or be colorless/transparent and shall be sealed the full width of the tape to cover the seam entirely on the inside (side and bottom seams) of the bag. All seam allowances shall be 3/8-inch and 1/8-inch shall be trimmed away after stitching (taped seams only) to allow for accuracy in taping. The sealed seams shall be uniform and shall meet the seam performance requirements of this document.

3.6 Bag dimensions. The finished bag shall be 30 (± 1/2)-inches in height and 50 (±1)-inches in circumference.

3.7 Workmanship. The finished bag shall conform to the quality of the product established in this document. The bag shall be free from defects which would affect its serviceability, appearance, uniformity and quality assurance standards defined by the technical data in the bid package.

4. REGULATORY REQUIREMENTS. Unless otherwise specified, the offeror/contractor is encouraged to use recovered, recycled, bio based, and environmentally preferable materials to the maximum extent practicable, in accordance with paragraph 23.403, 23.404(b) of the Federal Acquisition Regulation FAR, or the sustainable acquisition of EO 13693; as applicable. (See 7.1.2).

5. PRODUCT CONFORMANCE PROVISIONS.

5.1 Product conformance. The bag shall meet the salient characteristics of this Commercial Item Description, conform to the producer's own drawings, specifications, standards, and quality assurance practices, and be the same product offered for sale in the commercial marketplace. The Government reserves the right to require proof of such conformance.

5.2 Market acceptability. The bag offered or generic equivalent, must have been sold to the government or commercial market.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

5.3 End item inspection procedures. Sampling for inspection shall be conducted in accordance with ASQ/ANSI Z1.4 – Sampling Procedures and Tables for Inspection of Attributes (see 7.2.2).

5.4 Visual examination. Each bag shall be examined for the defects listed in Table II as defined in ASTM D3990. The lot size shall be expressed in units of bags. The sample unit shall be one (1) bag.

TABLE II. Visual examination defects.

Material defects: Any hole, cut, tear, any spot or stain on outside, color not as specified, any outwardly visible shaded parts. Any peeled or blistered fabric. Any drill hole in the fabric. Any repair area showing evidence of separation, softness or tackiness when wetting with toluene or naphtha (Note: to determine whether the patched area is sufficiently cured, shall be wetted with toluene or naphtha and rubbed with the index finger. There shall be no evidence of separation, softening, or tackiness.). Coating is tacky; any visual area where coating has been scraped from base cloth..
Stitches, seams and stitching: Loose or tight stitching tension, broken or skipped stitches, any needle chew; mend or patch. Peeled or blistered area on any seam; any part of body adjacent to seam pleated or badly crease. Bartacks not waterproofed; stitching on bartacks loose, skipped or broken. Tie cord bartack not positioned vertically on seam. Any tie cord bartack missing. Cement extending more than 1-inch on either side of the seam. Improper width of side or bottom seam at any point. Any portion of side or bottom seam unsealed or not securely cemented (condition is permissible within bottom seam pleats provided it does not exceed 1/16-inch in diameter, has no visible opening through the coated side and at least 1/4-inch of cure overlap exists). Any unsealed area on cemented hem.
Workmanship: Any required component omitted or not as specified; coated side of fabric on outside of bag (made with more than one piece of cloth; measurement of item not as specified; design not as specified. Tie cord missing, cut, torn, frayed or spliced. Tie cord reinforcing patch missing. Ends of tied cord not tipped or resin coated. Polyester cord ends not smoothly fused to prevent raveling. Dusting powder omitted or improperly applied causing blocking; more than 12 defects repaired; any defect repair exceeding 3/4-inch in length or width. Any repair not dusted. Location of any component not as shown in Figure 2; objectionable odor. Failure to meet product conformance; serviceability, reliability and quality of materials as defined by this document.
Labels: Label(s) missing, incorrect, illegible, or misplaced; bar code or UCP code label omitted or not readable by scanner; human-readable interpretation (HRI) omitted or illegible; bar code not visible on folded packaged item, bar code label causes damage to the item.
Packaging: Not packaged in accordance with the contract or purchase order.

5.5 Dimensional examination. The finished bag shall be examined for the defects listed in Table III. Any dimension that is not within the established tolerance shall be classified as a defect. The sample unit shall be one (1) bag.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

TABLE III. Dimensional examination.

Examination	Defect
Height of bag	Less than 29-1/2 inches More than 30-1/2 inches
Circumference of bag 1/	Less than 49-1/2 inches More than 51-1/2 inches
Top edge of bag	Hem less than 1/4- inch or more than 3/4- inch in width
Tie cord	Less than 51-inches when measured as described in 2/ Ends uneven by more than three (3) inches Located less than four (4) inches or more than five (5) inches from top edge of bag

1/ The circumference of the bag shall be measured by laying the bag out smooth and flat on a table and then measuring the width of the bag. The measurement is one half the circumference. Multiply this measurement by two for the full circumference measurement.
2/ The tie cord shall be measured in the following manner: The bag shall be laid out smooth and flat on a clean table with the tie cords fully extended. A weighted clamp weighing approximately four (4) ounces shall be securely attached to one end of the tie cord. The tie cord shall be fully extended by grasping the other end of the tie cord with enough force to move the weighted clamp very slowly along the surface of the table. The tie cord shall be straight and parallel to the surface of the table while measuring when fully extended.

5.6 Acceptance criteria. Acceptance criteria shall be as specified in the contract or purchase order (see 7.5).

6. PACKAGING. The preservation, packing and marking shall be as specified in the contract or order (see 7.5).

7. NOTES.

7.1 Source of government documents.

7.1.1 Copies of Government documents are available online at https://quicksearch.dla.mil.

7.1.2 EPA and EO 13693 information are available online at https://www.epa.gov.

7.1.3 Federal Acquisition Regulations (FAR) are available online at https://acquisition.gov.

7.2 Sources for Non-Government documents.

7.2.1 AATCC Test Methods are available online at https://www.aatcc.org.

7.2.2 ASQ/ANSI Z1.4 – Sampling Procedures and Tables for Inspection of Attributes are available online at https://www. asq.org.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

7.2.3 ASTM Standards are available online at https://www.astm.org.

7.3 Intended use. This item is used as a carrying bag providing waterproof protection for rations, extra clothing, personal effects, and the intermediate cold and extreme cold sleeping bags. It is not constructed to withstand rough use or handling. Should the area of operation or assigned function involve rough handling and waterproofing is required, the waterproof bag should be placed inside a bag of more rugged construction such as the duffel bag to protect the waterproof bag from damage that would result in leakage.

7.4 Standard samples. For access to standard shade samples of cloth, address the contracting activity issuing the invitation for bids or request for proposal.

7.5 Ordering data. The contract or order should specify the following:

a. Title, number, and date of this commercial item description
b. Class and color required (see 3.2.2)
c. Product conformance provisions. (see 5.1)
d. Acceptance criteria (see 5.6)
e. Packaging requirements (see 6.1).

7.6 Visual shade matching. In 2017, Option A of AATCC Evaluation Procedure 9, Visual Assessment of Color Difference of Textiles was changed to Option C. NOTE: In case of confusion, the viewing geometry should be “The specimen plane and illumination source will be parallel to each other and aligned so that the light flux is incident at the center of the specimen plane, which is set at a 35 (± 5º) angle relative to the horizontal. The observer will view the specimens at a 90o angle, relative to the plane of the specimens.”

7.7 Key words.

Coating compound
Coated cloth
Cement and sealing compound

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

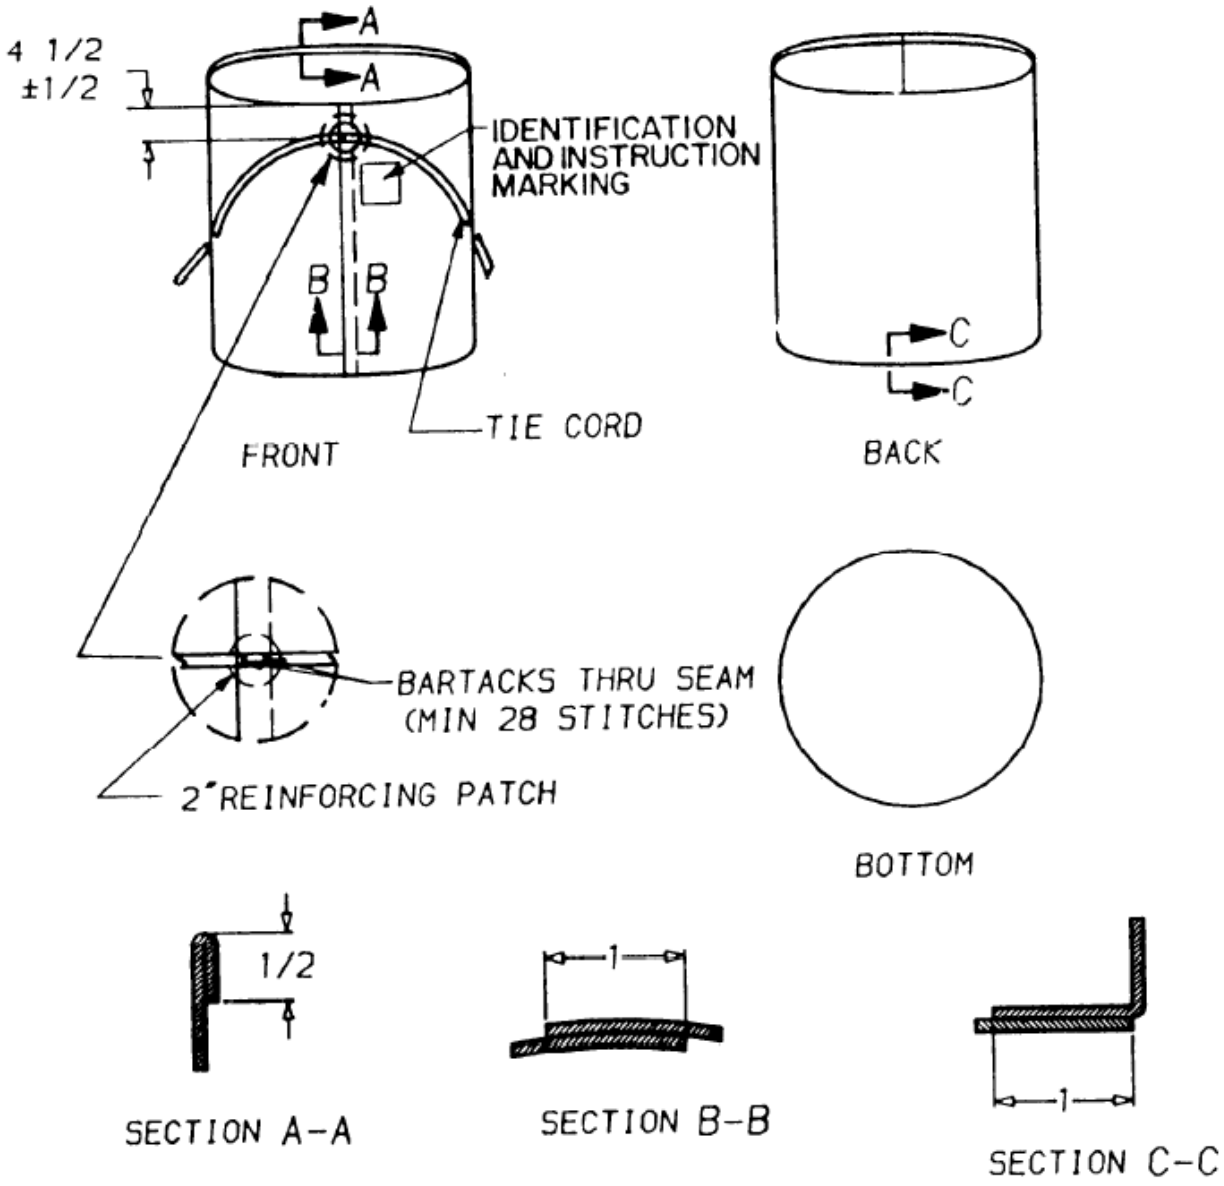


FIGURE 1. Bag dimensions and cross sections.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.

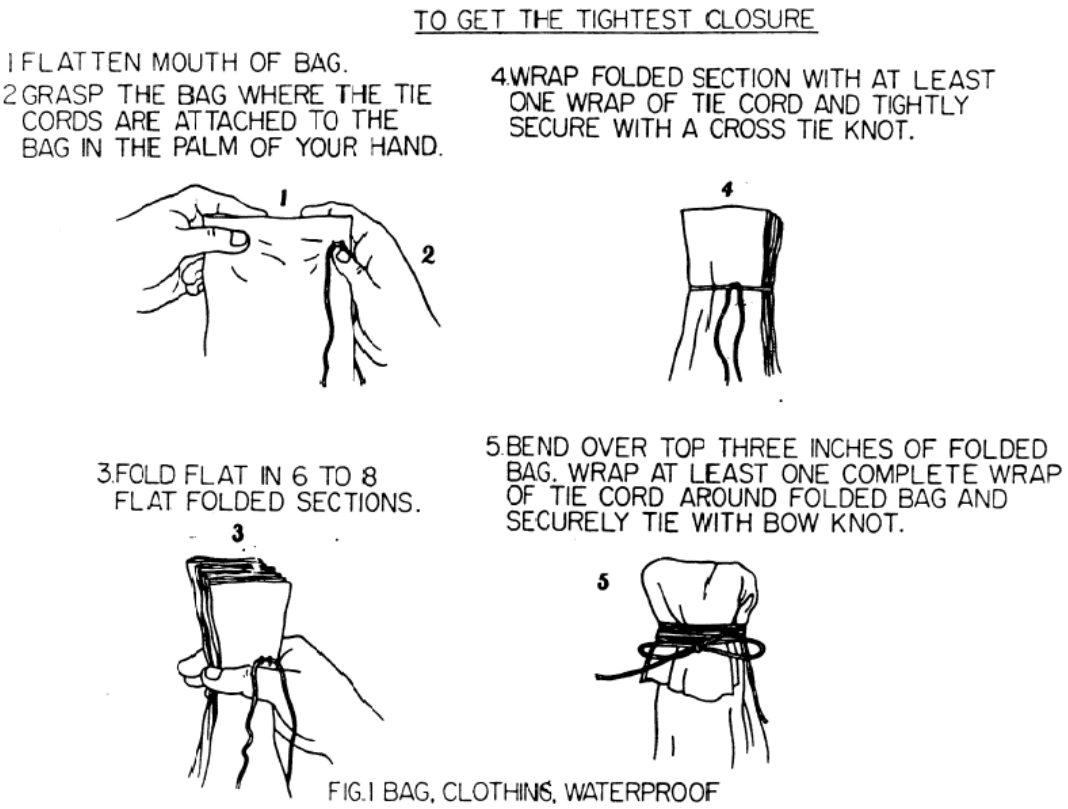


FIGURE 2. Tightest closure.

MILITARY INTERESTS:

Custodian:
Army – GL
Navy – NU
Air Force – 11

Review Activity:
Army - MD
Navy – MC

CIVIL AGENCY COORDINATING ACTIVITY:
GSA - FAS

Preparing Activity:
DLA – CT

(Project: 8465-2022-002)

Note: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, verify the currency of the information above using ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T09:42Z
Check the source to verify that this is the current version before use.