MIL-C-21085F(MC)
30 April 1982
SUPERSEDING
MIL-C-21085E(MC)
30 June 1981

MILITARY SPECIFICATION

COATS, WOMEN'S: WOOL; POLYESTER/WOOL

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for green wool serge, polyester/wool and blue wool elastique coats.

1.2 Classification. The coats shall be of one type in the following classes and sizes as specified (see 6.2):

Class 1 - Wool, Serge; Green 2207
Class 2 - Polyester/Wool; Green 2241
Class 3 - Wool, Elastique; Dark Blue 2309

Schedule of sizes

Short	Regular	Long
6	6	
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20
	22	22

2. APPLICABLE DOCUMENTS

2.1 Government documents.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMA-1), Headquarters, U. S. Marine Corps, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8410

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

2.1.1 Specifications, standards and handbooks. Unless otherwise specified, the following specifications, standards, and handbooks of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DODISS) specified in the solicitation form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton
V-T-280	- Thread, Gimp, Cotton, Buttonhole
V-T-295	- Thread, Nylon
V-T-301	- Thread, Silk
CCC-C-438	- Cloth, Buckram, Cotton
DDD-L-20	- Label; For Clothing, Equipage, and Tentage, (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-297	- Cloth, Interlining, Cotton Warp, and Spun Hair-Wool Filling
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-C-823	- Cloth, Serge, Wool, Wool and Nylon, Polyester and Wool
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-C-3738	- Cloth, Elastique, Wool
MIL-C-15062	- Cloth, Flannel, Wool, Undercollar Cloth
MIL-P-15064	- Pad, Shoulder and Sleeve-head
MIL-C-15065	- Coat Fronts
MIL-B-17757	- Box, Shipping, Fiberboard (Modular Sizes)
MIL-B-20289	- Button, Insignia, Plastic
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-C-43718	- Cloth, Twill, Polyester and Cotton, Polyester and Rayon

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams and Stitchings

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-1608 - Provisions for Evaluating Quality of Coats, Women's, Dress

(Copies of specifications and standards required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Application for copies of the manual should be addressed to the Superintendent of Documents, U.S. Government Printing Office, Washington, D. C. 20402.)

2.1.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. The issues of the documents which are indicated as DoD adopted shall be the issue listed in the current DoDISS and the supplement thereto, if applicable.

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association, Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D.C. 20026).

Department of Defense (DOD) Standard Color Card of Official Standardized Shades for Sewing Threads 1968

(Application for copies should be addressed to the Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Standard sample. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample units(s) for first article inspection and approval (see 4.4 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material for each class coat shall be as follows:

(a) Class 1. Cloth, wool, serge, green shade 2207 (see 6.3), 12 ounce conforming to type I, class 8 of MIL-C-823.

(b) Class 2. Cloth, tropical, polyester/wool, green shade 2241 (see 6.3), 10 ounce, conforming to type III, class 3, of MIL-C-21115.

(c) Class 3. Cloth, wool, elastique, dark blue shade 2309 (see 6.3), 16 ounce, conforming to type III of MIL-C-3738 or any other dark blue cloth of adopted standard.

3.3.2 Lining. The material for lining the coats shall be cloth, rayon, twill, 3.7 ounce, conforming to class 1 of MIL-C-368 in shades as follows:

(a) Classes 1 and 2. Green Shade 2208

(b) Class 3. Black shade 2604

3.3.3 Bias binding. The binding for the underarm shield shall be bias cut from the lining material specified in 3.3.2. The binding shall be cut 5/8 to 7/8 inch wide and shall have sized edges.

3.3.4 Undercollar material. The undercollar material shall be cloth, wool flannel conforming to MIL-C-15062. The material shall be dyed a shade approximating the shade of the basic materials specified in 3.3.1, and shall show good colorfastness to wet (dry) cleaning. The acidity (pH) requirement and colorfastness to perspiration and crocking requirements shall not apply.

3.3.5 Collar interlining material. The collar interlining material for each class shall be as follows:

(a) Classes 1 and 3. Cloth, cotton buckram, natural color conforming to type I, class 2 of CCC-C-438, except that the test for shrinkage shall be in accordance with Method 5580 of FED-STD-191.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

(b) Class 2. Cloth, interlining, cotton warp, and spun hair-wool filling, dyed black shade 341 conforming to type III, class 2 of MIL-C-297.

3.3.6 Polyester and cotton. The material for the stays for the simulated breast pocket, armhole seam and shoulder seam shall be cloth polyester and cotton twill, conforming to class 2 of MIL-C-43718, except the seam efficiency and colorfastness requirements for perspiration and crocking shall not apply. Cloth shall be bias cut for shoulder and armhole stays.

3.3.7 Tape. The cotton tape shall conform to type III, class 1 of DDD-T-86, 1/4 inch wide for reinforcing the folded edge of the simulated pocket welt and armholes for all classes of coats, 3/8 inch wide for the front edges of classes 1 and 3 coats. The bridle tape for the breakline shall be 3/8 inch wide for all classes of coats.

3.3.8 Coat fronts. The coat fronts for each class coat shall be as follows:

(a) Classes 1 and 3. Type XIII of MIL-C-15065

(b) Class 2. Type XV of MIL-C-15065, except that the cotton warp, hair-wool filling cloth shall conform to type III, class 2 of MIL-C-297 and the silesia stays shall be dyed black.

3.3.9 Shoulder pads. The shoulder pads shall conform to type III, class 2 of MIL-P-15064.

3.3.10 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.11 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid, 1/8 to 3/16 inch wide, having a breaking strength of not less than 50 pounds in the warp direction and shall conform to type IX, class 1 of MIL-B-371. The color for classes 1 and 2 shall closely match shade T-1, Cable No. 66023 and the color for class 3 coats shall be black.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and size F for buttonhole, needle and looper threads, respectively; and size O for machine felling. The thread for hand sewing shall be type III, class 3, size C, 2-ply of V-T-301.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

3.3.12.2 Cotton thread. The cotton thread shall conform to V-T-276; type IC2, mercerized finish, ticker No. A, 3-ply for all inside seaming and stitching, overedge stitching, and for belt and belt fastener buttonholes; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for basting shall be a good commercial grade.

3.3.12.3 Nylon thread. The nylon thread for padding lapels of class 2 coats shall conform to type III, size 000 of V-T-295.

3.3.12.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.12.5 Color and colorfastness. The thread for class 1 and 2 coats shall be dyed shade T-1, Cable No. 66023 and the thread for class 3 coats shall be black AA, Cable No. 66043 (see DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968). The cotton thread for basting and for machine tacking armholes may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or type II of V-T-280. The color of the gimp shall be shade T-1, Cable No. 66023 for class 1 and 2 and black AA Cable No. 66043 for class 3 coats. The gimp shall show good fastness to wet (dry) cleaning.

3.3.14 Buttons.

3.3.14.1 Class 1 and 2. The insignia buttons shall be plastic, black color, conforming to MIL-B-20289, type I, 40 line and type II, 27 line.

3.3.14.2 Class 3. The insignia buttons shall be metal, gold plated, 27-line and 40-line, regular shank conforming to type I, style 4, class A, subclass 1 of MIL-B-3461.

3.3.15 Labels. Each coat shall have an identification label and a size label as follows. The coats are intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.15.1 Identification label. The identification label shall conform to type VI, class 1 of DDD-L-20. The content and format shall be as follows:

Nomenclature (item description)
Contract number
Name of contractor
Wool Products Act Information

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

3.3.15.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, or L for Short, Regular and Long and the stock number as shown by the following example:

14R
Stock Number

The stock number may be incorporated in the identification label instead of in the size label.

3.4 Design. The coats shall be the U. S. Marine Corps design shown in Figures 1, 2, and 3, a four-button, single-breasted, semiformfitting fully lined coat having a panel type front, a four-piece back with center vent, simulated breast pocket with outside welt, shoulder straps to button, ornamental sleeve cuffs, rolled collar with worked eyelet in each end for branch of service insignia, and notched lapel.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working pattern. The contractor's working patterns shall be identical to the standard patterns. The standard patterns shall provide 3/16-inch allowance for seams at edges of lapels, front edges of coat and for shoulder straps, 3/4-inch allowance for side seams, 5/8-inch for center back seam and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size, seam allowance, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 List of pattern parts. The coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Item	Pattern nomenclature: Material: Cloth, wool, serge (class 1) Cloth, polyester/wool (class 2) Cloth, wool, elastique (class 3)	No. of cut parts
1.	Front	2
2.	Side front	2
3.	Center back	2
4.	Side back	2
5.	Front facing (right)	1
6.	Front facing (left)	1
7.	Top sleeve	2
8.	Under sleeve	2
9.	Top collar	1
10.	Armhole shields	2
11.	Pocket Welt	1
12.	Shoulder straps	4
13.	Cuff	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

Item	Material: Cloth, twill, rayon	No. of cut parts
14.	Front	2
15.	Center back	2
16.	Side back	2
17.	Top sleeve	2
18.	Under sleeve	2
	Material: Cloth, twill, cotton or polyester/cotton twill	
19.	Breast pocket stay	1
	Material: Cloth, cotton buckram	
20.	Undercollar	1 or 2
	Material: Cloth, wool flannel	
21.	Undercollar	1
	Shapers	
22.	Undercollar shaper	
23.	Lapel working shaper	
	Markers	
24.	Breast pocket marker	
25.	Collarstand marker	
26.	Sleeve cuff marker	
27.	Right front marker	

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted.

3.6.1.1 Tacking and backstitching. Ends of seams, and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

3.6.2 Shade marking. The component parts of each coat cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Sized parts cut from ends shall be identified for size. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

(c) Sew-on shade tickets.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting.					
	a. Cut coats in strict accordance with patterns furnished by the Government.					
	b. Cut material in the direction indicated by directional lines on pattern. The directional lines shall be placed in the warp direction of the cloth unless otherwise indicated on the pattern.					
	c. All wool parts of the coat shall be cut from one piece of basic material, except the underply of shoulder straps and armholes shields may be cut from ends. The welt piece for the simulated breast pocket shall be cut in accordance with the patterns furnished. When armhole shields are cut from ends, the shields shall match each other.					
	d. The fronts, side backs and center back lining shall be cut from one piece of rayon lining					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting. (cont'd)					
	material. All other rayon parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match.					
	e. The interlining for the stay for the simulated breast pocket shall be cut in accordance with the patterns furnished. Cut the cotton and polyester twill stays for armhole and shoulder seam on the bias, 3/4 inch wide and 4 to 4-1/2 inches long.					
	f. For class 1 and 3 coats, cut the cotton, buckram cloth for the undercollar interlining in accordance with the patterns furnished.					
	g. For class 2 coats, cut the cotton warp spun hair-wool filling cloth for the undercollar interlining in accordance with the pattern furnished.					
	h. Cut the undercollar from undercollar material in accordance with pattern furnished.					
	i. The right front shall be dressed in the front shaping operation only (see Oper. 36).					
	j. The use of drill holes is prohibited.					
2.	Replacement of damaged parts.					
	a. Replace, at time of cutting, any parts of the coat containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2.	Replacement of damaged parts. (cont'd) b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material.					
3.	Shade marking. a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled or ticketed to insure uniform shade and size throughout the garment. b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4.	Make shoulder straps. Finished appearance. The shoulder strap shall be uniformly stitched and shall finish smooth and flat, without twists, gathers or puckers. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole and the purling of the buttonhole shall be on the outside of the strap.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4.	Make shoulder straps. (cont'd)					
	a. The shoulder straps shall be made of two plies of basic material.					
	b. Seam the two plies together 3/16 inch from the edge of the front, back and collar end, evenly trimming all edges for proper turning.	301	SSe-2 (a)	10-14	A (silk)	A
	c. Turn the straps, working the seams out to the edges. Top stitch the strap uniformly 1/8 inch from the seamed edges.	301	SSe-2 (b)	10-14	A (silk)	A
	d. Press the strap smooth and flat with a heated pressing iron or pressing machine.					
	e. Make a horizontal, eyelet end, square bar type, cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges with the inside edge of the eyelet placed so that in the finished coat, the edge of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap.	But-ton hole		38 per buttonhole (minimum) (not including bartack)	A	A
	f. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.					
	g. Securely bartack the ends of the buttonholes and trim the ends of the thread and gimp.	Bar-tack		21 per bartack (minimum)	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5.	Make undercollar.					
	a. The undercollar assembly shall consist of one piece of undercollar cloth and a single piece of interlining material.					
	b. Pad the interlining to the undercollar with 6 to 7 rows of blindstitching. Press undercollar flat.	103	SSm-1 (each row)	4-6	A	
	c. Mark and trim undercollar in accordance with the shape of the pattern. Trim the interlining 1/8 inch back from the neck edge of the undercollar and collar ends.					
	d. Mark the breakline of the undercollar with the collarstand marker.					
	e. Stitch the breakline in accordance with the mark and stitch the undercollar to interlining 1/2 inch from outer and end edges.	301 or 401	SSa-1	10-14	A	A
6.	Assemble topcollar and undercollar.					
	Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges (outer and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The eyelets shall be well worked with the purling on either side of the collar and shall finish with a 1/8-inch diameter opening.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6.	Assemble topcollar and undercollar (cont'd)					
	a. Position topcollar between undercollar and interlining with the outer edge abutting the undercollar-interlining seam and with notches aligned. Join topcollar to interlining with a row of stitching 3/16 inch from the lapped edge of the topcollar.	301	LSa-1	6-8	A	A
	b. Join topcollar to undercollar at outer edge with zig-zag stitching, properly distributing the fullness between the notches. The zig-zag stitching shall extend to the end of the collar.	304	LSa-1	8-10	A	A
	c. Turn the topcollar to the inside, face to face with the undercollar, folding even with the top edge of the interlining. Stitch the ends of the undercollar to the top collar with a 1/8-inch seam. Trim the ends and the corner of the seam and turn assembly, forcing out the collar points.	301	SSa-1	8-10	A	A
	d. Baste the top edge and ends, forcing out the points of the outer corners of collar and baste along the breakline with the fullness placed between the two rows of basting stitches.	101 or Hopper				
	e. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat and uniformly even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6.	Assemble topcollar and undercollar. (cont'd)					
	f. Trim the neck edge of the topcollar to provide for proper seaming to the coat, and cut a guide notch in the lower edge of the topcollar at the center.					
	g. Make one eyelet at each end of the collar 1 inch from the end and outer edge, respectively. The eyelet shall be well worked, and shall finish with 1/8 inch diameter opening.	Eyelet		20 per eyelet minimum	A 0	A (silk) 0 (silk)
7.	Stitch point of cuff.					
	a. Fold the cuff lengthwise at the point, with wrong side out, and stitch the point 1/8 inch from the raw edges.	301	SSa-1	10-14	A	A
	b. Turn cuff, completely working out the point.					
	c. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the edge, or the upper edge may be basted instead of pressing.	101 or Hand				
8.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats, and shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8.	Seam sleeves at forearm. (cont't)					
	a. Position the top and under-sleeve with notches matching and join at the forearm with a 3/8-inch seam.	301 or 401	SSa-1	12-16	A	A
	b. Spread open the seam and press flat, holding seam short, with a heated pressing iron.					
9.	Join cuff to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be uniformly stitched to sleeves.					
	a. Mark the sleeve in accordance with the sleeve cuff marker for positioning the cuffs, with notch on the cuff pattern marker matching the forearm seam line and the lower edge of pattern in line with the botton raw edge of sleeve.					
	b. Position the cuff at the mark and seam to the body of the sleeve 1/8 inch from the upper edge. Trim the ends of the cuff even with the backarm edge of the top and under-sleeve, if necessary.	301	LSd-1	12-16	A (silk) or 0 (silk)	A 0
10.	Seam sleeves at backarm.					
	Finished appearance. The back-arm seam shall finish smooth and flat without twists, gathers, puckers or pleats, and shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10.	Seam sleeves at backarm. (cont'd)					
	a. Position the top and under-sleeve together at the backarm and stitch with a 3/8-inch seam. Continue the seam to the bottom of the cuff.	301 or 401	SSa-1	12-16	A	A
	b. Spread open the backarm and cuff seams and press flat with a heated pressing iron.					
11.	Tack cuff to sleeve.					
	Finished appearance. The bottom edge of the cuff shall finish smooth and flat without pleats, puckers, or bulges.					
	a. Turn the cuff outlet to the inside against the bottom end of the sleeves, in accordance with notches, and baste along the turned edge of cuff.	Hand or 101				
	b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching. The blindstitches shall not be exposed on the outside of sleeve cuff.	103	SSm-1	4-6	A	
	c. On the finished coat, the height of the cuff, when measured from folded bottom edge of cuff, shall be 2-3/4 ± 1/4 inches at the forearm and backarm seams, and 4-3/4 ± 1/4 inches at the point.					
12.	Seam sleeve lining.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12.	Seam sleeve lining. (cont'd)					
	stitched, and shall finish smooth and flat without twists, gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position the top and under sleeve lining in accordance with notches on pattern and join the forearm and backarm, respectively, with 3/8-inch seams.	301 or 401	SSa-1 or SSbd-1	10-14	A	A
13.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve lining shall be positioned and seamed, or tacked, to sleeve without twists, gathers, puckers, or pleats.					
	a. Position the under sleeve lining on the under sleeve with the top notch in the backarm of under sleeve lining aligned with top edge of under sleeve and the upper edge of sleeve lining extending 3/4 to 1 inch b[illegible]d the armhole edge of the s[illegible]e.					
	b. Seam or tack by hand the forearm and backarm sleeve lining seam allowance to the top sleeve backarm and forearm seam allowance, respectively, properly distributing the fullness in the lining. The stitching shall extend from approximately 5 inches above the finished bottom edge of the sleeve, up to approximately midway to the armhole edge of the underarm and backarm edge.	301 or Hand	SSa-1 1 to 2 inches in length	4-5	A	A Commercial

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13.	Assemble sleeve and sleeve lining. (cont'd)					
	c. Turn sleeve lining over the sleeve.					
14.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve linings shall not be short, tight or twisted.					
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished bottom edge of sleeve, and baste to turnup of sleeve.	101 or Hand				
	b. Fell the folded edge of sleeve lining to turnup of sleeve with blindstitching.	314 or Hand	SSm-1	6-8 8-10	0 (silk) C (silk)	0
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges, and press smooth and flat with a heated pressing machine.					
15.	Make welt.					
	Finished appearance. The welt shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges.					
	a. The welt for the simulated breast pocket shall be made of a single piece of basic material folded in accordance with notches and reinforced at the inside folded edge with 1/4-inch-wide cotton tape.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15.	Make welt. (cont'd)					
	b. Position the tape on the underside of the welt piece with one edge even with the fold notches and seam 1/16 inch from the edge of the tape next to the fold line.	301	LSbj-1	10-14	A	A
	c. Fold the welt at the fold notches with the tape on the outside and close the ends with a 1/4-inch seam.	301 or 401	SSa-1	10-14	A	A
	d. Turn the welt face side out, working out the edges and corners completely. Edgestitch welt 1/8-inch from seamed and folded edges. The welt shall finish with the cotton tape stitched to the inside of the welt.	301	SSe-2 (b) (sides) OSf-1 folded edge	12-16	A (silk) or 0 (silk)	A 0
	e. Press the welt smooth and flat with a heated pressing iron or pressing machine.					
16.	Make armhole shields.					
	Finished appearance. The armhole shields shall be made from one ply of basic material and shall finish without puckers, gathers, or raw edges.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only, and catching the turned under portion in the stitching 1/16 inch from folded edge.	301 or 401	BSb-1	10-14	A	A
17.	Stitch darts in front lining.					
	Finished appearance. The darts					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17.	Stitch darts in front lining. (cont'd) shall be tapered to a point at upper ends.					
	a. Sew the darts with a 3/8 inch seam, tapering the dart to a point at the upper ends and securely back tack.	301	OSf-1	10-14	A	A
18.	Seam front lining to facing and sew on label. Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the facing with notches matching and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top (shoulder) edge of facing to the bottom notch of facing approximately 1-1/4 inches from the bottom edge.	301 or 401	SSa-1	10-14	A	
	b. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned horizontally with the lower edge of label 3 inches above the bottom edge of the finished coat. The ends of the label stitching shall over-	301	SSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18.	Seam wool facing to front lining; sew on label. (cont'd) lap not less than three stitches.					
19.	Press front lining and waist darts. a. Press the facing joining seams and waist darts smooth and flat with a heated pressing iron or pressing machine. b. The facing lining joining seam shall be pressed with the raw edge of the seam allowance toward the back. The waist darts shall be pressed with the edge towards the front.					
20.	Join back lining parts. Finished appearance. Back linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					
	a. Position back linings with notches matching and join together at the center with a 3/8-inch seam, stopping at the top of the vent.	301	SSa-1	10-14	A	A
	b. Position left and right side back linings to the respective center back linings, matching notches and join with a 3/8-inch seam.	301	SSa-1	10-14	A	A
21.	Join back and front linings. Finished appearance. The					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21.	Join back and front linings.					
	linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					
	a. Position the back and front linings together and join at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A
22.	Press lining seams and darts.					
	a. Press the facing lining joining seams, side and back seams and the waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing lining joining seams, side seams and left and right back seams shall be pressed with the raw edges of the seam allowance toward the back. The lining shall be folded face to face along the center back seam and the seam pressed flat. The waist darts shall be pressed with the folded edge towards the side seam. Fold back and press flat the facing and lining seam allowance of the unstitched portion of the lining facing joining seam at the bottom edge.					
23.	Join backs.					
	Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in vertical line with the center					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23.	Join backs. (cont'd)					
	back seam. In the finished coat, the left center back shall overlap the right center back not less than 3 inches when measured at bottom edge of coat and the right vent shall be 2 ± 1/8 inches wide measured at the bottom edge.					
	a. Stitch the 1/4-inch-wide stay tape to the inside of left center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch diagonally across the top end of the vent.	301	SSa-1	10-14	A	A
	c. Turn the left vent to the inside of the left center back, in accordance with the notches, and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A	A
	d. Join the left and right side backs to the respective center backs with a 3/8-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24.	Press back seams.					
	a. The side and center back seams shall be pressed with a heated pressing iron or pressing machine.					
	b. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right center back to the lower end of the stitching for the center back seam.					
	c. Spread open the side and center back seams, respectively, and press flat.					
25.	Baste right side of vent.					
	Finished appearance. The folded edge of right side of vent shall extend beyond the center seam allowance of the left back part.					
	a. Turn the right side edge of vent 3/8 inch toward the inside coat and baste.	101 or Hand				
	b. Stitch and backstitch across the top end of vent from the back center seam to the edge of the vent.	301	SSa-1	10-14	A	A (silk)
26.	Join front and side front.					
	Finished appearance. Bust lines on both sides shall be alike. Fronts and side fronts shall be carefully joined without puckers and gathers.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26.	Join front and side front. (cont'd)					
	The seams shall start and finish evenly at the seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Sew the dart with a 3/8-inch seam, tapering to a point at the upper end and securely back tack.	301	OSf-1	10-14	A	A
	b. Position fronts and side fronts with notches matching and join together with 3/8-inch seams.	301 or 401	SSa-1	10-14	A	A
	c. Spread open the front seam and waist darts and press flat with a heated pressing iron, maintaining contour.					
27.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester and cotton twill reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide polyester and cotton twill stays to the underside of the fronts along the shoulder edge	301	SSaa	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27.	Seam reinforcement stay to armhole and shoulder. (cont'd)					
	and upper front edge of the armhole, respectively, 1/8-inch from the outer edges.					
28.	Assemble simulated breast pocket welt on left front.					
	Finished appearance. The simulated breast pocket shall be smooth and flat with the ends of the welt uniformly stitched and with no puckering.					
	a. Mark the left front in accordance with breast pocket marker for position of breast pocket welt. Mark welt seam line on the underside 1 inch from folded edge for proper seaming to front.					
	b. Position the polyester and cotton twill stay piece for the pocket on the underside of the front. Position the welt on the outside of the left front, with marks on welt and front matching and with folded edge of welt towards the bottom edge of coat. Seam top ply of welt to the front at the mark through the stay piece.	301	LSbj-1	10-14	A	A
	c. Turn back the raw edge of pocket welt seam allowance at the seam line, against the body of the welt. Fell the raw edge of the seam allowance to the body of the welt with a blindstitch. The stitching shall not be visible on the outside of the welt.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28.	Assemble simulated breast pocket welt on left front. (cont'd)					
	d. Turn the welt with the folded edge of the welt towards top of front. Topstitch both ends of welt to the front, 1/8 inch from the seamed edges of welt. The line of stitching shall extend from the lower seamed line of the welt up to the folded edge of welt.	301	SSe-2 (b) (both sides)	10-14	A	A (silk)
	e. On the outside of the finished coat, the welt for the simulated pocket shall measure 1 ± 1/16 inch in height, and the width for each size coat, measured along top edge of welt, shall be as follows:					
	Coat size / Width of Welt (inches): 6 through 14 — 3-1/2; 16 through 22 — 4					
29.	Join fronts and back at sides.					
	Finished appearance. The fronts and side backs shall be joined together without puckers or pleats. The seams shall start and finish evenly at seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Position side fronts to the side backs at the sides with notches matching and join with a 3/4-inch seams.	301 or 401	SSa-1	10-14	A	A
30.	Press side seam.					
	a. Spread open the side seams and press flat with a heated pressing iron.					
31.	Tape armholes.					
	a. Sew the 1/4-inch wide stay tape to the inside at the lower	301 or 401	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31.	Tape armholes. (cont'd)					
	edge of the armhole, starting from approximately 1 inch above the notch in the fronts and continuing to side seam. Cut the tape and continue stitching along bottom and back edge to lower notch.					
	b. From the lower back notch, continue stitching the tape, holding the tape taut along the back edge of armhole to 3/4 inch from the shoulder.	301	SSaa-1	10-14	A	A
	c. Press armhole tapes and shoulder blade smooth and flat with a heated pressing iron.					
32.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste along the front seams, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.					
	b. Baste the left front along the welt-joining seam line on the outside, with the front and interlining lying smooth and flat.	Hopper				
	c. Tack the front and back ends of the simulated pocket stay to the coat front interlining. The tacking shall be as close as possible to the corners of the pocket.	101 Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32.	Interline fronts. (cont'd)					
	d. Baste horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness on the front towards the armhole. Baste along the front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining to approximately 1-1/2 inches from bottom edge of front.	101 Hopper				
	e. Baste along the breakline of lapel, starting at the gorge, and continue basting along the front edge below the breakline to approximately 1-1/2 inches from the bottom edge of front.	101 Hopper				
	f. Baste along the top and front edge of lapel down to the lower end of lapel.	101 Hopper				
33.	Baste bridle tape to lapel.					
	a. Position the 3/8-inch-wide bridle tape on the interlining side of the fronts along the breakline of lapel, with the front edge of the tape in line with notch in the gorge.					
	b. Baste tape through the interlining and the front of coat along the breakline of lapel evenly and smoothly, holding the tape taut and properly distributing the fullness. The tape shall extend from the gorge notch to approximately 1-1/2 inches from the lower edge of lapel.	101 or Hand		6-8		

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34.	Pad lapels.					
	a. Pad the lapels with seven to eight rows of blindstitching, from approximately 3/4 inch from front edge to the breakline, properly distributing the fullness of the interlining between the rows of stitching to roll the lapels.	103 or 314	SSm-7 or 8	4-8	A or 000	A or 000
	b. Blindstitch both edges of bridle tape to interlining.	103 or 314	SSm-2	4-8	A or 000	A or 000
35.	Press chest and lapels.					
	a. Roll press the lapels, shrinking to eliminate the fullness from the interlining, on a suitable type heated pressing machine.					
	b. Press the fronts individually on a suitable type heated pressing machine to conform to the shape of the body and eliminate excess fullness in the breast.					
36.	Shape fronts.					
	a. Mark and shape the front edge of the coat. Mark and shape the lapels in accordance with the shaper furnished.					
	b. Mark the coat 1-1/4 inches from the bottom edge for the bottom turnup.					
	c. Trim the coat front interlining 1/4 inch back from the front edge of the fronts and top edge of the lapel. Trim bottom of interlining to approximately 1/4 inch above the mark for the bottom turnup.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36.	Shape fronts. (cont'd)					
	NOTE: In-process inspection of this operation shall take place at this point before going to the next operation.					
37.	Baste facing-lining assemblies to fronts.					
	a. Position the facing-lining assembly on outside of respective fronts and baste along the breakline, distributing the fullness in the breast area and continue to baste along the front and bottom edge. Baste front along top and front edges of lapel down to the lower end of lapel, working the fullness towards the center of lapel.	101 Hopper				
38.	Join facings and fronts with tape.					
	a. Join the facings and fronts together 3/16 inch from the top and front edges of lapel and front edges of coat, with the stay tape, 3/8 inch wide for classes 1 and 3, and 1/2 inch wide for class 2, positioned on the interlining side of fronts, with the edge of the tape 1/8 inch from the front edges and caught in the stitching. Continue stitching along the lower edge of coat 3/16 inch above the front cutout with the tape properly positioned and caught in the stitching.	301	SSab-1	10-14	A	A
	b. The tape shall extend from the lapel notch to 1-1/2 to 2 inches from the side seams at the bottom of coat, except the tape is not required along the step of the left front. The tape shall be sewn with normal tension along the top and front edges of lapel and with slight tension along front and bottom edges of coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39.	Fell tape to interlining.					
	a. Fell the back edge of the stay tape to the coat front interlining from the collar notch on top of lapel to the end of the tape at the bottom edge.	103	SSm-1	4-6	A	A
	b. Press the fronts and tape at the top and front edges of lapel, and front and bottom edges of coat, smooth and flat with a heated pressing iron or pressing machine.					
	c. Remove all basting stitches. Trim lower front corner and corner of lapels. Notch lapel for proper turning.					
	d. Spread open the front facing seam from lapel notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.					
40.	Baste fronts and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working the corners of lapels out completely. Turn up the bottom of coat, lapping the back edge of facing on the ends of the bottom turnup and working the front corners out completely.					
	b. Baste along the top and front edges of the lapel, including the step of the left front and finished bottom edges of the coat, working the seams to the edges of the coat.	101 or Hand		4-6		
41.	Baste facing (second time).					
	a. Baste facing to front approximately 1-1/4 inches from the top and front edges of	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41.	Baste facing (second time). (cont'd)					
	lapel and front and bottom edges of the coat, holding the lower corners of the coat in such a manner as to cause the lower front edge of front to roll inward.					
	b. Baste along the breakline of the lapel, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	c. Baste the lapel diagonally from the corners to the breakline, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	d. Baste the facings to the front as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend approximately 1-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edges of facings.	101 or Hand				
42.	Tack facings at back edge to interlining.					
	a. Raise the lining and tack the seam allowance at back edge of the facings to the coat front interlining with blindstitching, starting approximately 2 inches from the bottom edge of the coat and tacking to approximately 2-1/2 inches from the shoulder edge of the interlining. Tacking shall be through seam allowance of facing and lining.	103 or 314 or Hand	SSa-1 SSm-1	4-6 4-6 4-6	A A C (silk)	 A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43.	Fell bottom turnup and vent.					
	a. Fell the bottom turnup and vent.	103 or 306 or Hand	EFm-1	4-6 4-6 4-6	0 (silk) 0 (silk) 0 (silk)	 0
44.	Baste body lining to coat.					
	a. Fold the front lining at the shoulder in accordance with notches, forming a chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of armhole along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be toward the armhole.	101 or Hand				
	b. Left side of coat. From side seam of lining at waist, baste across back lining to center vent and down along left side of vent with lining folded approximately 1 inch in from edge. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	c. Right side of coat. From side seam of lining at waist, baste across back lining to top of vent forming the center pleat. Notch the lining and baste at an angle to the top of the vent continuing along the edge of the vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	d. Baste center pleat from top of vent forming a 3/4-inch pleat adding fullness to approximately	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44.	Baste body lining to coat. (cont'd)					
	2 inches from the neck. The folded edge of the pleat on the outside of lining shall be toward the left side.					
	e. Baste the back lining along the lower edge of armhole, approximately 2 inches from the edge, and continue up and across the shoulders and neckline down to the other armhole. Leave ample room with basting to permit insertion of the shoulder pads.	101 or Hand				
45.	Trim front lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the lining even with the back at the neck.					
46.	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and chest padding of coat front interlining, in line with the armhole edge, and securely tack the pad to the interlining and chest padding only.	101 or Hand				
47.	Seam shoulders.					
	Finished appearance. The shoulders shall be evenly joined with the front and back seam lines matching, working in the proper fullness on the backs in order that the shoulder may be properly shaped.					
	a. Join fronts and backs together at the shoulder with a 3/8-inch seam.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
47.	Seam shoulders. (Cont'd) b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short. Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished coat.					
48.	Baste lining at shoulders and neckline. a. Position shoulder interlining at neck. Baste upper part of each shoulder on the outside and turn the coat on the inside. Turn under and lap the shoulder edge of the lining on the front lining. Baste lining to coat along the folded edge with top end of chest pleat caught in the basting at the shoulders. Baste the lining to the back at the neck, from shoulder seam to shoulder seam.	Hand or 101 Hopper				
49.	Stitch hanger and label to coat. a. Stitch the ends of the hanger and upper edge of the size label to the neck of coat at the inside center back. b. The hanger opening, in the finished coat, shall be 1-1/2 ± 1/8 inches long when measured along the neck edge of the collar.	301	SSa-1	10-14	A	A
50.	Set collar. Finished appearance. The seam joining top collar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50.	Set collar. (cont'd)					
	a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam, 5/8 inch from the top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
	b. Join the top collar to the facing at the gorge, from the collar notch to a point not less than 1 inch in back of the lapel breakline.	301	SSa-1	12-16	A	A
	c. Clip the facing at the back end of joining seam.					
51.	Tack top collar to fronts at gorge.					
	a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge, from the collar notch to the back end of the seam, catching the top end of bridle tape in the tacking.	Hand or 301		2-4 12-16	C (silk) A	A
52.	Baste undercollar to coat.					
	Finished appearance. Fullness in the collar along the neck edge shall be properly placed over the shoulders so that the collar will not be tight along the outer edge over the shoulders.					
	a. Turn the collar to the outside with the lower edge of the undercollar lapped on the outside of the coat at the mark.					
	b. Securely tack the corners of the undercollar across the juncture point of the collar and the lapel.	Hand		8-10	C (silk)	
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52.	Baste undercollar to coat. (cont'd)					
	d. In the finished coat, the ends of the collar shall be 1 3/8 ± 1/8 inches for all sizes when measured from the juncture of the collar and lapel to the finished edge.					
53.	Tack coat to collar interlining.					
	a. Raise the lower (neck) edge of the top collar and tack the neck edge of coat to the undercollar interlining with overcast stitches, or blindstitching by machine, catching the back lining in the tacking from shoulder seam to shoulder seam.	Hand or 103	SSm-1	2-3 3-4	C (silk) A	
54.	Baste top collar to coat.					
	a. Turn under the lower edge of the top collar and baste from gorge seam to gorge seam.	Hand or 101		4-6		
	- or -					
	b. In lieu of operations 53.a, and 54.a, join lower edge of top collar from gorge seam to gorge seam.	301	SSa-1	10-14	A	A
55.	Fell collar to coat.					
	a. Fell the neck edge of the undercollar to the fronts and backs from collar notch to collar notch.	Hand or Machine (hand type felling or 306	LSa-1 LSa-1	8-12 8-12 8-12	C (silk) C (silk) 0 (silk)	 0

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55.	Fell collar to coat. (cont'd)					
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand		8-10	C (silk)	
56.	Edgestitch coat.					
	a. Edgestitch the coat 1/8 inch from the front edges of the coat, the front and top edges of the lapels, and the edges of the collar.	301	SSe-2 (Front edges of coat, front and top edge of lapels) (shows finished seam) SSb-1 (collar)	10-14	A	A
57.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniform in length and setting. In the finished coat, the straps shall be 2-1/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-5/8 ± 1/8 inches at the buttonhole eyelet end.					
	a. Position the shoulder straps with the rounded end of the strap even with the edge of the neck and with the notch at the back raw edge of shoulder strap aligned with the shoulder seam line at the armhole.					
	b. Stitch the shoulder straps to the coat 3/16 to 1/4 inch from the armhole edge. Trim the shoulder straps even with the armhole where necessary.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
58.	Set sleeves.					
	Finished appearance. The sleeves shall be properly and carefully set and shall be uniformly stitched without twists, gathers, pleats, puckers or raw edges.					
	a. Position the outside of the sleeves on the outside of the coat with notches matching and with the sleeve lining turned back from the armhole edge.					
	b. Join the sleeves to the coat with a 3/8-inch seam, evenly distributing the fullness between notches and catching the end of the shoulder strap in the stitching.	301 or 401	SSa-1	10-14	A	A
	c. Press the armhole smooth and flat with a heated pressing iron to remove the fullness. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole.					
59.	Baste armhole.					
	a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	101 or Hand				
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend the entire circumference of the armhole.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60.	Baste underarm shield to coat.					
	a. Position the underarm shield on the lining side of the coat at the base of armhole, and baste the shield to the coat along the armhole and outer (convex) edges.	101 or Hand				
61.	Tack armhole and stitch sleeve head pads.					
	a. Position the sleeve head pad on the sleeve, with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad from end to end to the sleeve through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings, shields at the base of armhole and shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away the excess material.	301	SSa-1	4-6	30/3	30/3
62.	Tack underarm shields to lining.					
	a. Tack bottom edge of underarm shields on the underside to lining.	Hand		4 per tack (minimum)	C (silk)	
	b. In the finished coat, the shields shall measure not less than 2 inches in length from the folded edge of sleeve lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, securing the top end of the shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	C (silk)	
64.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole, with the back and forearm seam of the sleeve and sleeve lining matching.					
	b. Turn under the top raw edge of the sleeve lining and lap 1/4 to 3/8 inch onto the armhole seam allowance over the front and back lining and underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining and distributing the fullness in accordance with good commercial practice. Backstitch 1/8 inch from the felled edge of sleeve lining along the lower armhole from approximately 1-1/2 inches above the forearm seam line in sleeve lining to the side seam line in the body lining.	Hand		8-10	C (silk)	
	- or -					
	c. Machine stitch lower edge of sleeve lining, at the armhole on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 64.b above.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64.	Fell sleeve lining at armhole. (cont'd)					
	d. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine simulated		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than hand felling.					
65.	Make buttonholes.					
	Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button. The stitching of the buttonholes shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside.					
	a. Mark the right front in accordance with the marks on the pattern for the locations of four buttonholes. The buttonholes shall be evenly spaced.					
	b. Make one horizontal eyelet-end, square-bar type buttonhole, 1-1/8 inches long at each of the marks. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat.	Buttonhole		50 per button (minimum) not including bartack	B (silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65.	Make buttonholes. (cont'd)					
	c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bartack	A (silk)	A
66.	Clean coat.					
	a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the coat. Remove all spots, stains and shade tickets and markings without injury to the material.					
67.	Press coat.					
	a. The coat shall be well pressed throughout with a heated iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					
	b. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat.					
	c. Press the armholes solid from the inside, creasing the sleeve lining at the edge of the armhole seam allowance in the front, back and armpit of the lower armhole. The armpit and the back of the armhole shall be held short while pressing.					
	d. Block the armholes on a pressing buck, shrinking in top sleeves. Sleeves shall not be creased.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67.	Press coat. (cont'd) e. Press the lapels smooth and flat, straightening the edges and working any fullness towards the center of the lapel and removing the fullness by shrinking. f. Press the lapels, uniformly creasing on the lapel breakline from the gorge seam to approximately 3 inches above the top buttonhole. Then roll press the lapel to the front edge of the coat. g. Press the collar on a collar machine, creasing on the breakline and shaping to obtain the proper contour while pressing. h. Press bottom edge of coat smooth and flat, exercising care that the lining is not exposed below the bottom edge. i. Press the sides, working the fullness towards the back. j. Press the back smooth and flat; removing all fullness. k. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67.	Press coat. (cont'd) l. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps. m. Press pleats in upper front lining and center back lining smooth and flat. n. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.					
68.	Mark for buttons. a. Mark the location for sewing four 40-line insignia buttons to the left front of the coat, 1-5/8 to 1-3/4 inch back from the finished edge, to properly engage buttonholes in the right front. b. Mark the location for sewing one 27-line insignia button to each shoulder to properly engage with the neck end of the buttonhole in the shoulder straps, in order that on the finished coat, the straps shall lie smooth and flat without twisting or bulging.					
69.	Sew on buttons. a. The buttons shall be securely sewn to the coat with the ends of the stitching securely tacked. See 3.3.14 for type of button required for each class of coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
69.	Sew on buttons. (cont'd)					
	b. Sew one 27-line insignia button at the mark on each shoulder.	Hand or 301 or 101		4-6 per button (double thread) 14-16	16/4	
	c. Sew one 40-line insignia button at each of the marks on the left front through all plies.	Hand or 301 or 101		4-6 button (double thread) 14-16	16/4	
	d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.					

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Finished measurement 1/

Size	1/2 Bust 2/ (Short, Regular, Long)	Back Length 3/			Sleeve Length 4/		
		Short	Regular	Long	Short	Regular	Long
	inches	inches	inches	inches	inches	inches	inches
6	17-1/4	24-1/8	25-3/8		16-3/4	17-3/4	
8	17-3/4	24-3/8	25-5/8	26-7/8	16-3/4	17-3/4	18-3/4
10	18-1/4	24-1/2	25-3/4	27	16-3/4	17-3/4	18-3/4
12	19	24-3/4	26	27-1/4	16-3/4	17-3/4	18-3/4
14	19-3/4	25	26-3/16	27-3/8	16-3/4	17-3/4	18-3/4
16	20-1/2	25-1/8	26-3/8	27-5/8	16-3/4	17-3/4	18-3/4
18	21-1/2	25-3/8	26-5/8	27-7/8	16-3/4	17-3/4	18-3/4
20	22-1/2	25-1/2	26-3/4	28	16-3/4	17-3/4	18-3/4
22	23-1/2		27	28-1/4		17-3/4	18-3/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

1/ Tolerance on all measurements: ± 3/8 inch. Tolerance is on 1/2 bust measurement.

2/ Bust measurement taken with coat buttoned from folded edge to folded edge in line with pit of armhole.

3/ Back length measurement taken along center back seam from lower edge of the undercollar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from the armhole seam line to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the applicable point value or defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be in accordance with the test conditions specified in MIL-STD-1608.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standard to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table III for characteristics noted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. deter. per sample Unit	Results Reported as
Cotton warp, hair wool filling cloth	Colorfastness to:				
	Wet(dry) cleaning	3.3.5	5622		
	Perspiration	3.3.5	5680		
	Steam pressing	3.3.5	5640		

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1608. If one or more sample units fail to meet any test requirements listed below, the lot represented shall not be acceptable.

Components	Lot size expressed as	Sample unit for testing
Cotton warp, hair wool filling cloth	yards	1/2 yard

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an Asterisk (*) and listed as selected defects in MIL-STD-1608. Any coat containing a selected defect shall not be included in the end item lot.

4.5.3.1 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1608 and as outlined in 3.7.

4.5.4 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1608. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1608.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Preservation-Packaging. Packaging shall be level A or commercial as specified (see 6.2).

5.1.1 Level A. Each coat shall be laid down and a bending or nonbending paperboard shoulder form conforming to Figure 4 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length so that sleeve ends rest over the pockets. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

5.1.2 Commercial. Coats shall be packaged to afford adequate protection against deterioration and physical damage during shipment from the supply source to the first receiving activity. The package and the quantity per package shall be the same as that normally used by the supplier for retail distribution.

5.2 Packing. Packing shall be level A or Commercial as specified (see 6.2).

5.2.1 Level A. Fifteen coats of one size and length only, packaged as specified in 5.1.1 shall be packed in a fiberboard shipping container assembled, closed and reinforced conforming to type SF, class weather resistant, grade V2s, size 2A of MIL-B-17757. The fiberboard used for fabricating the box liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. Level A folded coats shall be stacked flat, collars alternated, fifteen in depth within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract or when there are less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2 Commercial. Coats packaged as specified in 5.1.2, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transporation rate for such supplies. The quantity per shipping container shall be the same as that normally used by the supplier for retail distribution. Containers shall comply with the US Postal Service Manual, Uniform Freight Classification Rules, or National Motor Freight Classification Rules, as applicable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

5.3 Marking. In addition to any special marking required by the contract, shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Mixed sizes. Each shipping container that is packed with mixed sizes (see 5.2.1) shall have, securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 inches by 4 inches. The words "MIXED SIZES" shall be plainly stamped or printed on the label. The quantity and sizes of the coats contained in the shipping container shall be legibly stamped or printed under the words "MIXED SIZES" on the label.

6. NOTES

6.1 Intended use. The coats described herein are intended for wear by women personnel of the U. S. Marine Corps.

6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

6.2.1 Procurement requirements.

(a) Title, number and date of this specification.
(b) Class and size required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Levels of packaging and packing required (see 5.1 and 5.2).

6.2.2 Contract data requirements. Data conforming to Data Item Description DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.

6.3 Samples and shade samples. For information regarding the availability of sample of the coat and of standard shades specified, address inquiry to the procuring activity issuing the Invitation for Bids.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1, 2 and 3 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Marginal notations. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Preparing Activity

Navy-MC

Project No. 8410 - N528

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

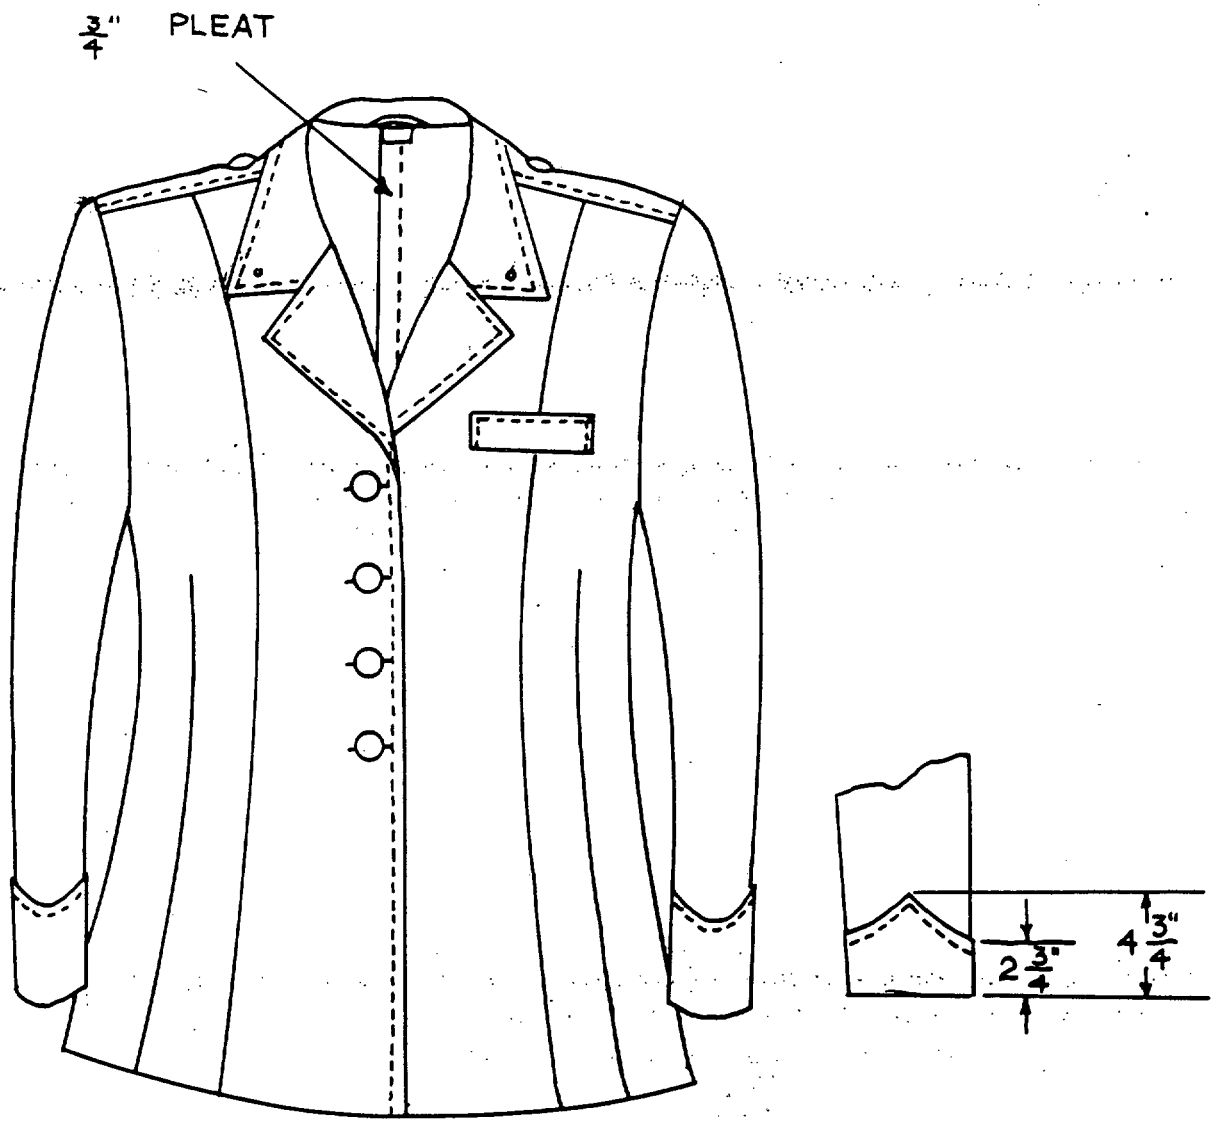


FIG 1: COAT, WOMEN'S: WOOL, POLYESTER/WOOL

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

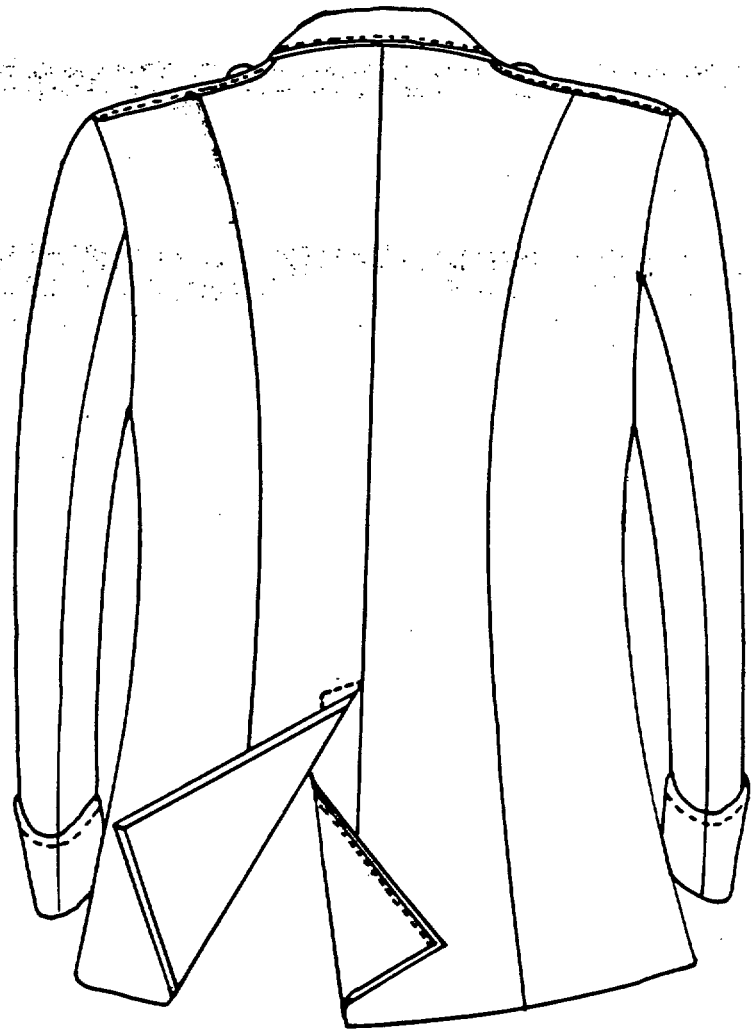


FIG. 2: COAT, WOMEN'S: WOOL, POLYESTER/WOOL

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.


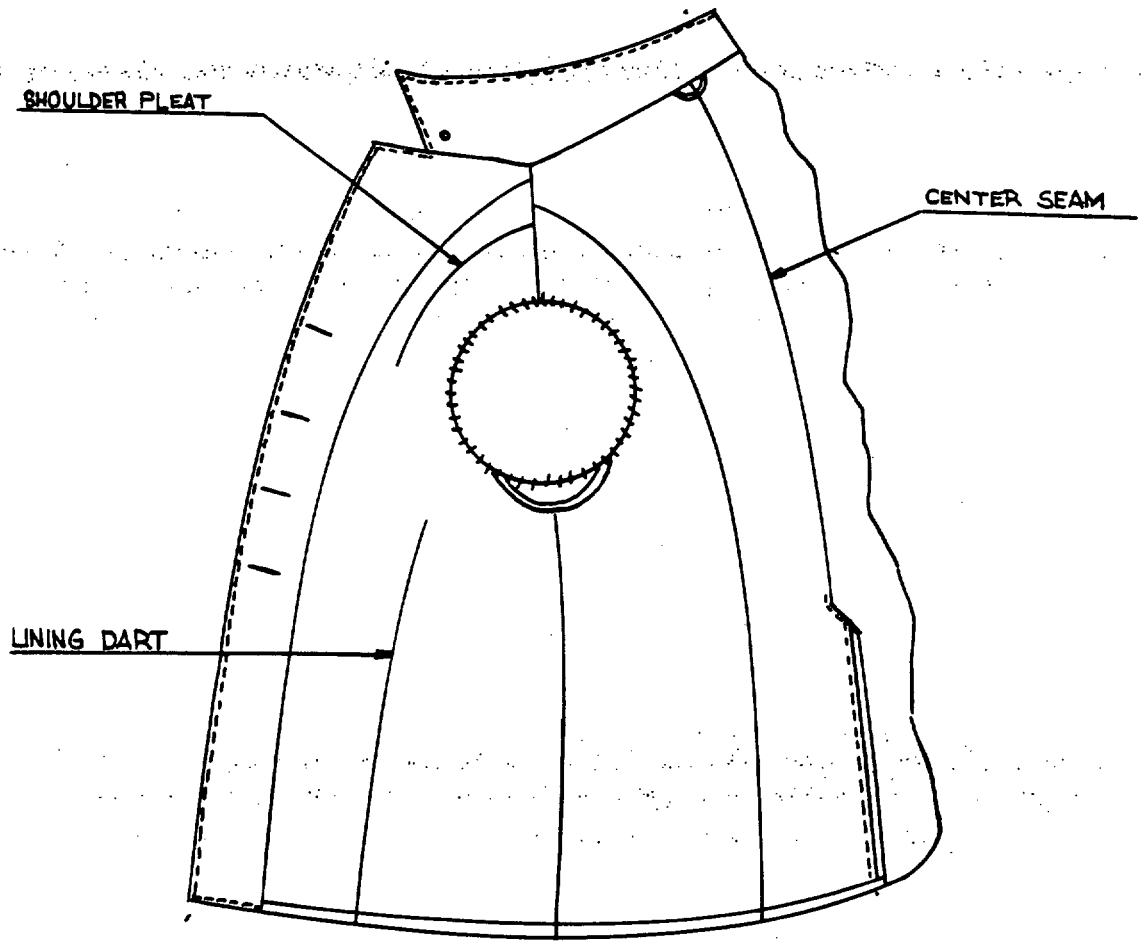


FIG. 3: COAT, WOMAN'S: WOOL, POLYESTER/WOOL

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

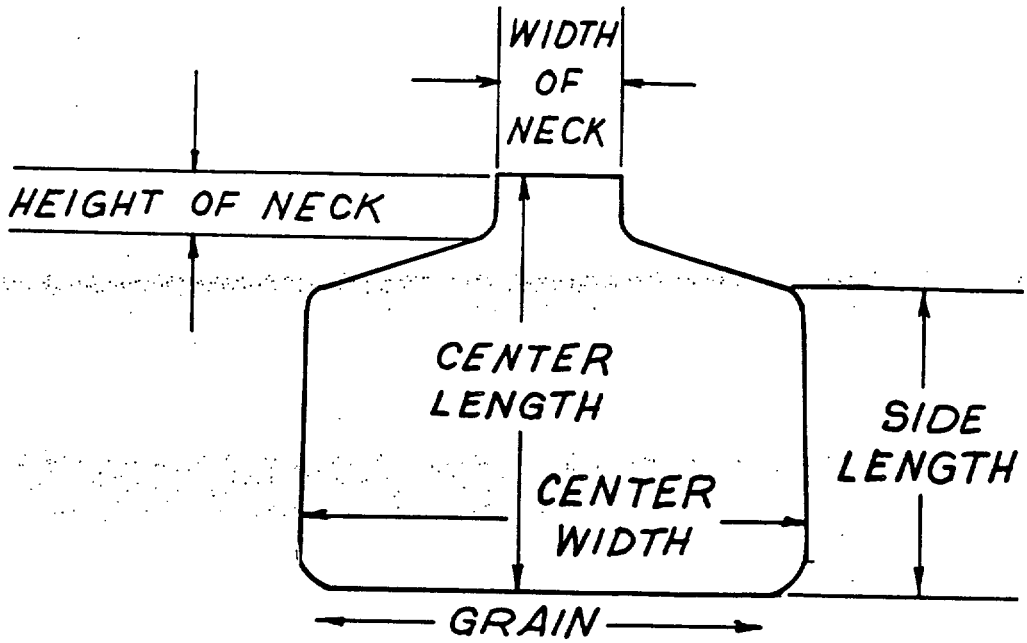

LEGEND

CENTER LENGTH	14-½ INCHES
CENTER WIDTH FOR SIZES:	
6 - 10	15 INCHES
12 - 16	18 INCHES
18 - 22	21 INCHES
SIDE LENGTH	10-½ INCHES
HEIGHT OF NECK	1-½ INCHES
WIDTH OF NECK	3-½ INCHES
PAPERBOARD	0.040 INCH THICK

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

FIG. 4 - SHOULDER FORM

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

MIL C-21085F(MC) COATS, WOMEN'S: WOOL: POLYESTER/WOOL

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-LF-014-1802

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE NAVY
Headquarters, U.S. Marine Corps
Washington, D.C. 20380

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DOD-317

U.S.MAIL

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDANT OF THE MARINE CORPS
HEADQUARTERS, U.S. MARINE CORPS
(CODE LMA-1)
WASHINGTON, D.C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:44Z
Check the source to verify that this is the current version before use.