MIL-F-48863C (AR)
1 July 1985
SUPERSEDING
MIL-F-48863B (AR)
24 January 1983

MILITARY SPECIFICATION

FUZE, GUIDED MISSILE, M934E6 PARTS ASSEMBLY, LOADING AND PACKING FOR

This specification is approved for use by the US Army Armament Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification contains the performance requirements and quality assurance provisions for the fabrication and acceptance of components, assemblies, loading and packaging for one type of fuze designated as Fuze, Guided Missile, M934E6.

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications and standards. Unless otherwise specified, the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-B-2427	- Boxes, Ammunition Packing; Wood, Nailed
MIL-S-8660	- Silicone Compound
MIL-S-45743	- Soldering, Manual Type, High Reliability, Electrical Connections, for Missile Systems, Procedures for

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Center, Attn: AMSMC-QA, Dover, New Jersey 07801-5001 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 1336

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

MIL-S-46860 - Soldering of Metallic Ribbon Lead Materials to Solder Coated Conductors, Process for Reflow
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specifications for
MIL-E-81111 - Explosive, Plastic-Bonded Molding Powder (PBXN-5)

STANDARDS

FEDERAL

FED-STD-209 - Clean Room and Work Station Requirements, Controlled Environment

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-331 - Fuze and Fuze Components, Environmental Performance Tests for
MIL-STD-794 - Parts and Equipment, Procedures for Packaging and Packing of
MIL-STD-810C - Environmental Test Methods (Revision C)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS

US ARMY ARMAMENT, RESEARCH AND DEVELOPMENT CENTER (ARDC)

9297066 - Fuze, Guided Missile, M934E6

(Copies of specifications, standards, handbooks, drawings, and publications required by manufactureres in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer)

2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids shall apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CODE OF FEDERAL REGULATIONS

49 CFR 170-189 - Department of Transportation Rules for Regulations for the Transportation of Explosive and Other Dangerous Articles.

(The Department of Transportation Regulations are now a part of the Code of Federal Regulations (1949 Edition and revisions) available from the Superintendent of Documents, Government Printing Office, Washington, D. C Orders for the above publication should cite "49 CFR 0-199 (latest revision)".)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Item definitions. The M934E6 fuze shall provide an explosive output to detonate the Stinger warhead, and electrical outputs to control missile flight motor ignition (FMI). The fuze circuitry shall sense proper missile launch through phases of launcher umbilical retract, launch acceleration and launch motor separation. Internal circuitry shall recognize inputs from the warhead target engagement sensor (the Hard Target Sensor (HTS)). Change of velocity resulting from impact shall be recognized by the internal Impact Switch (IS). The fuze shall provide timing for FMI, arming, self-destruct (SD) and detonator delay after IS closing.

3.2 Performance characteristics. Unless otherwise specified, all performance characteristics shall be demonstrated under the following ambient conditions:

a) Temperature range: +18° to +35°C (+65° to +95°F)
b) Relative humidity: 10 to 95 percent
c) Barometric pressure: Local average ± 2 inches of mercury

3.2.1 Electrical power. The fuze shall function as specified herein when connected to a source of electrical power conforming to the interface criteria of 3.2.13.1 and its subparagraphs.

3.2.2 Power interruption. The fuze, after arming, shall be capable of providing proper electrical and explosive functions for as long as four milliseconds after power source disconnect or shorting occurring simultaneous with, or after generation of, a signal by the HTS or IS.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.3 Isolation. An externally applied umbilical retract signal conforming to 3.2.13.3 and present 20 ± 15 milliseconds prior to initial launch switch closure shall be required in order to produce a proper FMI signal.

3.2.4 Launch switch closure (t_o). The major fuze functions shall be initiated by launch switch closure. The launch switch shall close when the fuze is subjected to an acceleration greater than 30 g in the N to M direction as specified in Figure 1. Switch closure shall not occur for acceleration less than 22 g. Launch switch closure of 75 microseconds or longer shall be recognized as initial closure. Normal fuze functions shall occur only when the launch switch is closed for a minimum of 20 milliseconds during the first 40 + 5 milliseconds after initial closure.

3.2.5 Interlock. An externally applied interlock signal conforming to 3.2.13.2 shall be required in order to produce proper FMI and arm signals. The interlock signal shall be present within 220 milliseconds after initial launch switch closure.

3.2.6 Flight motor ignition. The fuze shall provide FMI signals 260 ± 30 milliseconds after initial launch switch closure subject to sustained closure defined in 3.2.4 and proper interlock signal as defined in 3.2.5. The FMI pulse duration shall be 80 ± 50 milliseconds. The FMI signals shall conform to 3.2.13.7.

3.2.7 Arming. The fuze shall provide an electrical arm signal through a current limiting resistor to initiate the electro explosive arm actuator. The arm signal shall conform to 3.2.13.9. The rotor shall be free to rotate after occurrence of the arm signal. The rotor shall move to the arm position when the arm signal occurs during sustained longitudinal acceleration equal to or greater than 30 g applied in the N to M direction as specified in Figure 1. The rotation of the rotor into the arm position shall be indicated by an arm position signal 1000 ± 150 milliseconds after initial launch switch closure conforming to 3.2.13.10. The fuze shall not arm when the acceleration applied in the N to M direction is less than 22 g.

3.2.8 HTS interrogation. Coincident with the arm signal occurrence, the fuze shall interrogate and determine the signal state of the HTS signal per 3.2.13.4. Observance of an active HTS signal state during interrogation shall result in elimination of the HTS mode of fuze detonation. Indication of the quiescent signal state shall allow the HTS as a mode for subsequent fuze detonation.

3.2.9 Detonation. Coincident with the fuze arm signal occurrence (see 3.2.7) all modes of fuze detonation shall be enabled as specified in 3.2.9.1 through 3.2.9.3, within the constraints of 3.2.8. Any of these modes of fuze detonation shall generate a detonator firing signal conforming to 3.2.13.8 and shall initiate the explosive output of 3.2.10.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:57Z
Check the source to verify that this is the current version before use.

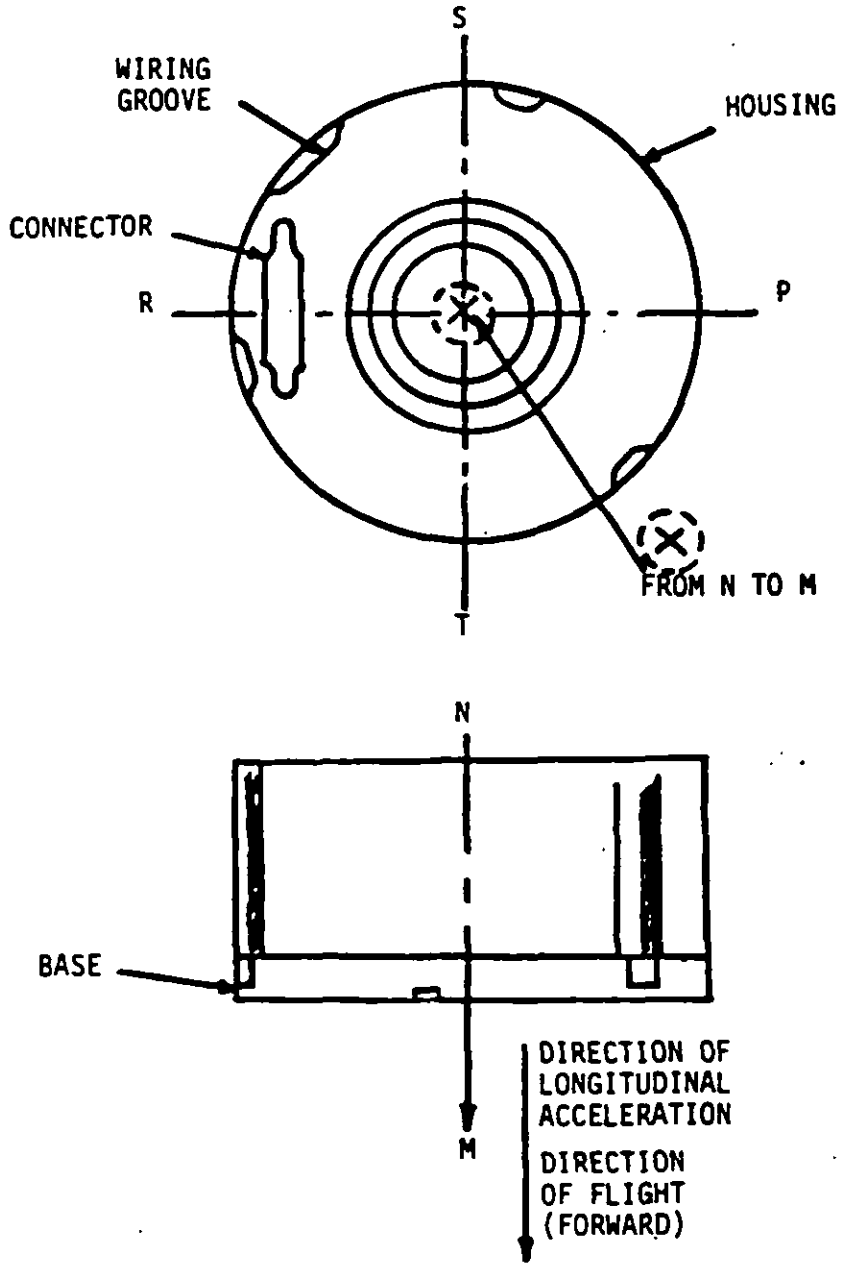


Figure 1. Fuze Reference Axes

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.9.1 Impact switch mode. The impact switch shall sense a decrease in velocity in the N to M direction of Figure 1. The impact switch contact shall close as a result of a velocity change of 22.0 inches per second minimum applied within 150 microseconds maximum. The impact switch closure shall cause generation of the detonator firing signal after a variable time delay which is a function of the time between launch switch closure and impact switch closure as specified in Figure 2. The variable delay time shall be measured from the leading edge of the impact switch monitoring signal pulse to the leading edge of the detonator firing signal. The impact switch shall not close as a result of a velocity change of less than 14 inches per second maximum, applied in 150 microseconds, maximum. After an initial closure of 30 microseconds, additional switch closures (contact bounce) are permissible.

3.2.9.2 HTS mode. An HTS signal change from quiescent to active in accordance with 3.2.13.4 shall cause generation of the detonator firing signal within 100 microseconds.

3.2.9.3 Self-destruct mode. The fuze shall generate the detonator firing signal 17 ± 2 seconds after initial launch switch closure.

3.2.10 Explosive output. The explosive output of the fuze shall cause a dent equal to or greater than 0.015 inch in depth in a steel witness block when measured and tested in accordance with MIL-STD-331, Test 301 except that the steel blocks shall be Rockwell B75 to B95 hardness.

3.2.11 Rotor position.

3.2.11.1 Arm. The fuze rotor shall be pinned into the in-line position with the explosive lead perpendicular to the base and the lead aperture opposite the detonator. The orange color on the rotor shall be visible through the view window of the fuze housing.

3.2.11.2 Safe. The fuze rotor shall be pinned into a position 75 +6, -4 degrees out-of-line from the arm position. The green color on the rotor shall be visible through the view window of the fuze housing.

3.2.11.3 Abort. The fuze rotor shall be pinned into a position 60 +12, -7 degrees out-of-line from the arm position when rotor movement from the safe position toward the arm position occurs while power is on and prior to generation of the electrical arming signal. The green color on the rotor shall be visible through the view window of the fuze housing.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.11.4 Abort-safe. The fuze rotor shall move to and be locked into a position 90 ± 5 degrees out-of-line from the arm position when the rotor is free to move from the safe position while being subjected to an acceleration of less than 6 g in the N to M direction. The green color on the rotor and the burnished tip on the arm lock pin shall be visible through the view window of the fuze housing.

3.2.12 Early motion detection. After power is applied to the fuze, movement of the rotor away from the safe position of 3.2.11.2 prior to the generation of the arm signal of 3.2.7 shall cause an electrical abort signal conforming to 3.2.13.12. The electrical abort signal shall initiate the electro explosive abort actuator.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

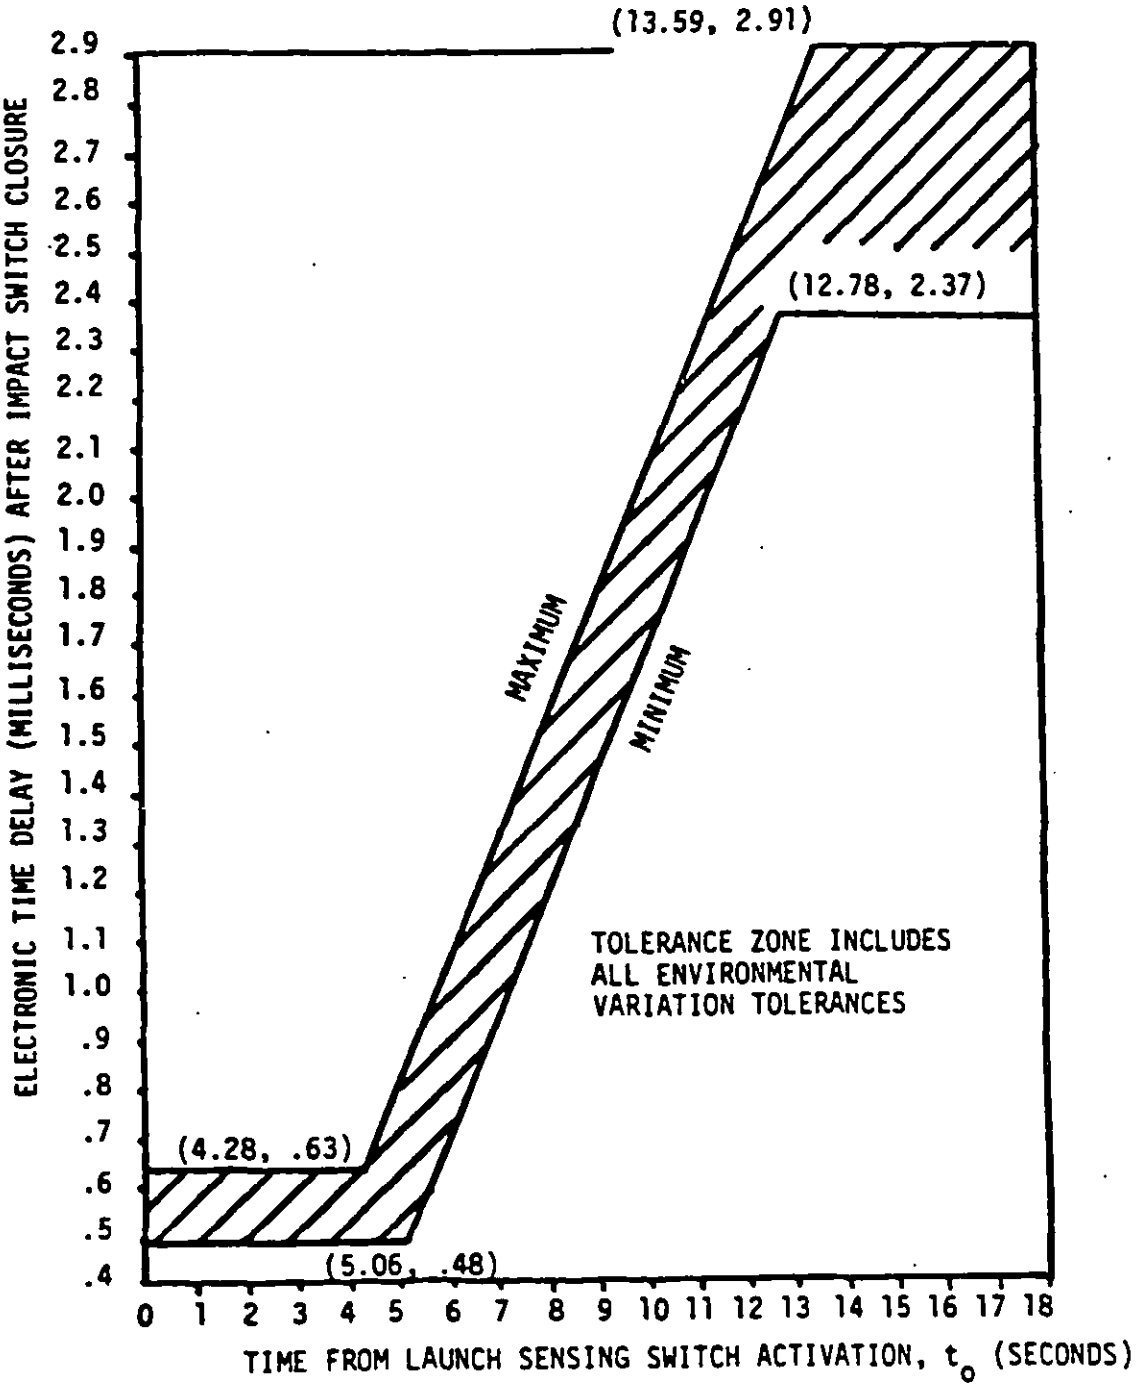


Figure 2. Impact Switch Detonation Mode, Variable Electronic Time Delay

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.13 Electrical interface. The electrical interface inputs to the fuze and outputs from the fuze are specified herein. All connector pin numbers cited refer to the fuze connector 9282672, designated J3. Unless otherwise specified, all voltage and impedance measurements are referenced to fuze power return, pin 15. The fuze shall produce the output signal requirements of 3.2.13.7 thru 3.2.13.12 with the power source application as defined in 3.2.13.1 (less b & c). The fuze internal impedances measured at J3 shall be as specified in Table 1.

TABLE I

Fuze internal impedances
ambient temperature limits

FROM PIN	TO PIN	TEST CURRENT*	RESISTANCE (OHMS)
15 (+)	21	1mA	$\leq$ 0.3
10 (+)	21	1mA	$\leq$ 0.3
11 (+)	21	1mA	$\leq$ 0.3
15 (+)	16	1mA	10.8 $\pm$ 2
15 (+)	12	1mA	4.0 $\pm$ 1.2
18 (+)	8	0.1mA	2.2K $\pm$ 0.2K
3 (+)	8	0.1mA	3.3K $\pm$ 0.3K
13 (+)	8	0.1mA	1.0K $\pm$ 0.1K
20 (+)	8	0.1mA	5.1K $\pm$ 0.5K
14 (+)	6	10uA	51K $\pm$ 5K
5 (+)	10	0.25uA	$\geq$ 1M
7 (+)	11	1ua	$\geq$ 30K **
6 (+)	8	0.25uA	$\geq$ 950K **
5 (+)	7	0.25uA	$\geq$ 1M
1 thru 21	Fuze Base (+)	0.25uA	$\geq$ 10M
1 thru 21 (+)	Fuze Base	0.25uA	$\geq$ 10M

* Test current to be no greater than 105% of current specified.
** Exhibits capacitor charge current when ohmmeter is connected.
(+) Positive terminal identification.
$\geq$ Greater than or equal to: $\leq$ Less than or equal to

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.13.1 Power source. The power source for the fuze is a dual polarity source capable of delivering both plus 20 +4.0, -1.7 volts direct current and minus 20 +2.0, -4.0 volts direct current, with the exceptions noted in 3.2.13.1.4, for a minimum of 15 seconds. From 15 to 19 seconds after activation, the magnitude of the negative voltage may decay to no less than 10 volts direct current and the positive voltage may decay to no less than plus 10 volts direct current. The internal impedance from the plus to minus power source terminals shall be a maximum of 1.0 ohms for direct current and for frequencies from 10 Hz to 5KHz. The time from power source application to the time the voltage achieves minus 18.5 $\pm$ 0.5 volts direct current shall be no more than 320 milliseconds at plus 140°F (+60C) and no more than 370 milliseconds at -40°F (-40°C). There is no specified voltage rise profile. The power source can achieve plus and minus 18.5 volts direct current at any time between 0 millisecond and the specified maximum rise time. The voltage unbalance between the plus and minus voltages shall be no greater than 2.0 volts. The voltage surce may be shorted or disconnected at first terminal impact of the missile. Fuze performance shall not be adversely affected by the simulated noise specified below. (See 4.4.2.38 and 4.5.1.1 thru 4.5.1.4, 4.5.4.1 thru 4.5.4.3, 4.5.19).

a. Random noise to the -20 volt supply at the fuze level shall consist of positive (+) going pulses on the negative power supply.

(1)	Pulse Amplitude	2.5 volts, peak
(2)	Pulse Rep. Rate	1000 Hz
(3)	Pulse Duration	200 microseconds

b. Simulated servo noise to the J1 connector at the guidance/warhead interface (simulated warhead section) shall consist of negative (-) going pulses on the positive power supply and positive (+) going pulses on the negative power supply.

(1)	Pulse Amplitude	4.0 volts, peak
(2)	Pulse Rep. Rate	400 to 1000 Hz
(3)	Pulse Duration	5 $\pm$ 2 microseconds

c. Simulated gyro spin noise to the J1 connector at the guidance/warhead interface (simulated warhead section).

(1)	Sinusoidal Signal Amp.	5.0 volts, peak to peak
(2)	Rep. Rate	250 Hz for 15 seconds max. after umbilical retract

3.2.13.1.1 Negative voltage stabilization. After the negative voltage reaches a value of (-) 7 volts, the negative voltage shall not become more positive than (-) 4 volts.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.13.1.2 Voltage loss. After power source activation, and before first terminal impact, the voltage source shall not be shorted, disconnected, or become equivalent to missile ground for periods greater than 100 microseconds and such conditions shall not occur at intervals more frequent than 1 millisecond, nor shall they exceed 5 occurrences per 100 milliseconds.

3.2.13.1.3 Negative voltage maintenance. After the time of power source activation, and before first terminal impact, the negative voltage supply to the fuze shall not become more positive than ground (except for the initial 50 milliseconds, a voltage of +5 volts maximum at a current of 50mA max. shall not impair fuze function). Before activation, a potential on the -20v fuze power line of -.70 to +1.05 VDC with a 6 milliamp current maximum shall not impair subsequent fuze functioning.

3.2.13.1.4 Voltage drop. During umbilical retract squib activation, a voltage drop on the negative power supply line to between -11V and -20V for 13 msec maximum shall not impair fuze functioning.

3.2.13.1.5 Flight motor ignition power connection. The fuze power return shall be connected to pin 15. The -20 volt electrical power for flight motor ignition shall be connected to pin 7 through a 2.43 ohm $\pm$ 1 percent current limiting resistor. +20 volt electrical power for flight motor ignition shall be connected to pin 5 through a second 2.43 ohm $\pm$ 1 percent current limiting resistor.

3.2.13.2 Interlock signal. The interlock indication supplied to the fuze to inhibit fuze functions prior to staging shall be a resistance of 150 ohms or less between pins 20 and 21. The interlock indication is activated by increasing the resistance to greater than 500 kilohms for a minimum of 10 milliseconds prior to flight motor ignition and lasting for a minimum of 5 milliseconds after flight motor ignition.

3.2.13.3 Umbilical retract signal. The umbilical retract indication to inhibit flight motor ignition shall be a resistance of 30 ohms or less between pins 18 and 15, external to the fuze. Increasing this resistance to greater than 30 kilohms for a minimum of 355 milliseconds shall enable the flight motor ignition.

3.2.13.4 HTS signal. The HTS indication in the quiescent condition as supplied to the fuze shall be a resistance of 50 ohms or less between pins 2 and 13. Increasing the resistance to an open circuit between pins 2 and 13, or creating a short circuit between pins 2 and 15, or between pins 13 and 15, will activate the HTS circuit.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.2.13.5 Simulated launch signal. The simulated launch signal shall be a voltage pulse of 10.0 ± 1.5 volts applied to pin 3 and referenced to the negative voltage source at pin 8. The impedance of the pulse source shall be 680 ± 200 ohms. The pulse shall have a duration of greater than 23 milliseconds to enable the fuze functions.

3.2.13.6 Substandard simulated launch signal. The substandard simulated launch signal shall be the same as 3.2.13.5 except that the pulse duration shall be less than 17 milliseconds. A greater than 50 microsecond pulse shall be used for test purposes. The pulse shall not enable the fuze functions.

3.2.13.7 Flight motor ignition signal. The fuze shall produce flight motor ignition signals during the flight motor dwell time in conformance with 3.2.6. When tested per 4.5.1.1, the flight motor ignition signals shall be $\geq$ +16.5 volts on pin 10 and $\leq$ -16.5 volts on pin 11, both referenced to pin 21. Before and after the dwell period, pins 10 and 11 shall be connected internally to the fuze power return, pin 15. The flight motor ignition circuitry shall be capable of switching 3.5 amperes for 80 ± 50 milliseconds as a single event.

3.2.13.8 Detonator firing signal. Evidence of the proper firing signal generation shall be a positive voltage transition at pin 14 or initiation of the detonator as applicable. After arming, a positive voltage transition of greater than 8 volts from within 1 volt of the - power source, indicates a detonation signal.

3.2.13.9 Arm signal. The fuze shall produce an arm signal, a negative polarity voltage pulse of at least 16 volts amplitude and 80 ± 50 milliseconds duration, on pin 16 with reference to pin 15, in conformance with 3.2.7.

3.2.13.10 Arm position signal. The fuze shall produce an arm position signal at pin 6 in conformance with 3.2.7. The arm position signal shall be a negative voltage transition of greater than 8 volts from between 0 and -5 volts.

3.2.13.11 Impact switch signal. The fuze shall produce an impact switch monitoring signal, one or more positive 11 ± 2 volt pulses of greater than 30 microseconds duration, at pin 17, referenced to pin 8, when the velocity change specified in 3.2.9.1 occurs. The leading edge of the first impact switch monitoring signal pulse is the timing reference point.

3.2.13.12 Abort signal. The fuze shall produce an abort signal, a negative polarity voltage pulse of at least 16 volts amplitude on pin 12 with reference to pin 15, in conformance with 3.2.12.

3.2.14 Static detonator safety. The assembled fuze shall be safe for personnel to handle when the detonator is fired with the rotor in an unarmed position, 3.2.11.2 through 3.2.11.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.3 Design and construction.

3.3.1 Production drawings. This fuze shall be fabricated and assembled in accordance with the drawings, parts lists and other documents listed on 9297066.

3.3.1.1 Mechanical characteristics. The fuze weight, center of gravity, dimensions and safety status shall be in accordance with the fuze assembly drawing 9297066.

3.3.1.2 Electrical characteristics. The fuze circuitry and electrical characteristics shall be in accordance with the schematic of the fuze assembly drawing 9297066.

3.3.1.3 Components and assemblies. The components and assemblies shall conform to the applicable drawings, specifications and standards.

3.3.1.3.1 Electroexplosive devices. An electroexplosive device shall not be installed in the fuze assembly when two years or more has elapsed subsequent to device manufacture.

3.3.2 Standards of manufacture. The fuze shall be assembled in an environmentally controlled room. The temperature of the room shall be maintained at 75° ± 10°F. Relative humidity shall be maintained at 40 ± 10 percent. A positive pressure differential of 0.05 inches of water shall be maintained. Input air tested at the point of air inlet to the area shall be Class 100,000 per Federal Standard 209B.

3.3.3 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples shall be as specified in the contract.

3.3.4 Workmanship. The fuze and its components shall be fabricated and finished in a thorough, workmanlike manner. It shall be free of surface defects, dirt, grease, rust, corrosion products and other foreign matter. The cleaning methods used shall not be injurious to any part, nor shall parts be contaminated by the cleaning agents. Solder joints shall be in accordance with the visual inspection standards of MIL-S-45743. Soldering of metallic ribbon leads to solder coated conductors by the reflow process shall be in accordance with the quality assurance standards of MIL-S-46860.

3.4 Service environment performance characteristics.

3.4.1 Resistance. Between the service environment temperature limits of -50°F and +140°F, the fuze internal impedances measured at J3 shall be as specified in Table II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

TABLE II

Fuze internal impedances
service environment temperature limits

FROM PIN	TO PIN	TEST CURRENT*	RESISTANCE (OHMS)
15 (+)	21	1mA	≤ 0.3
10 (+)	21	1mA	≤ 0.3
11 (+)	21	1mA	≤ 0 3
15 (+)	16	1mA	10.8 ± 3.2
15 (+)	12	1mA	4.0 ± 2.5
18 (+)	8	0.1mA	2.2K ± 0.3K
3 (+)	8	0.1mA	3.3K ± 0.4K
13 (+)	8	0.1mA	1.0K ± 0.15K
20 (+)	8	0.1mA	5.1K ± 0.7K
14 (+)	6	10uA	51K ± 7K
5 (+)	10	0.25uA	≥ 1M
7 (+)	11	1uA	≥ 10K**
6 (+)	8	0.25uA	≥ 900K**
5 (+)	7	0.25uA	≥ 1M
1 thru 21	Fuze Base (+)	0.25uA	≥ 10M
1 thru 21(+)	Fuze Base	0.25uA	≥ 10M

*Test current to be no greater than 105% of current specified.
**Exhibits capacitor charge current when ohmmeter is connected.
(+) Positive Terminal identification.
≥ Greater than or equal to: ≤ Less than or equal to

3.4.2 Thermal shock. The fuze shall exhibit the performance characteristics of 3.2 and its subparagraphs after being subjected to thermal shock.

3.4.3 Temperature. The fuze shall exhibit the performance characteristics of 3.2 and its subparagraphs with the exception of 3.2.13, while being subjected to temperature extremes between the service environment operating temperature limits of -50°F and +140°F. The electrical resistance between the temperature extremes shall be in conformance with 3.4.1.

Fuze storage temperature limits shall be -50°F and +160°F.

3.4.4 Transportation vibration. The fuze shall conform to 3.2 and its subparagraphs after being subjected to transportation vibration test.

3.4.5 Launch shock. The fuze shall conform to 3.2 and its subparagraphs after being subjected to launch shock test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

3.4.6 Flight vibration. The fuze shall conform to 3.2 and its subparagraphs after being subjected to flight vibration test.

3.4.7 Jolt. The fuze shall be subjected to the jolt test. After exposure, the fuze shall conform to the acceptance criteria of MIL-STD-331, Test 101. The assembly shall be safe to handle or dispose of.

3.4.8 Jumble. The fuze shall be subjected to the jumble test. After exposure, the fuze shall conform to the acceptance criteria of MIL-STD-331, Test 102. The assembly shall be safe to handle or dispose of.

4. QUALITY ASSURANCE PROVISIONS.

4.1 Responsibility for inspection and standard quality assurance program. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made part of this detailed specification.

4.2 Classification of inspection. In conformance with MIL-A-48078, the following types of inspection shall be conducted on this item:

a. First Article Inspection
b. Quality Conformance Inspection

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer. The first article sample shall consist of the following items in the quantities listed:

Part Number	Title	Quantity
- 9297031	Printed Cable, Flexible	5
- 9282619	Bracket, Arming Switch	5
- 9297053	Housing, Detonator	5
- 9282630	Screw, Adjusting - 22 G Lock	5
- 9282631	Weight, 22 G Lock	5
- 9282632	Pin, Shoulder Stop	5
- 9297022	Spring, Helical, Compression - 22 G Lock	5
- 9297048	Window	5
- 9282646	Cup, Lead	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

Part Number	Title	Quantity
- 9282648	Lead, Explosive PA 511	20
- 9282657	Housing - Arming Actuator	5
- 9297025	Rotor Assembly	5
- 9297030	Safing and Arming Assembly	5
- 9282660	Relay, Armature, FM Ignition	5
- 9282661	Relay, Armature, Interlock	5
- 9297064	Electronic Components Assembly - Fuze	5
- 9282672	Connector, Electrical	5
- 9297049	Housing, Fuze	5
- 9297065	Fuze Subassembly	5
- 9297047	Detonator Assembly	5
- 9297046	Housing Assembly - Fuze	5
- 9282694	Pin Lock - Primary	5
- 9282695	Pin Lock - Secondary	5
- 9297066	Fuze, Guided Missile, M934E6	30
- 9297023	Spring, Helical Compression - Arm Lock	5
- 9297024	Rotor	5
- 9297050	Base	5
- 9325805	Spring, Toggle - Rotor	5
- 9325806	Shim, Rotor	5
- 9297029	Support, Mounting	5
- 9297051	Bushing, Rotor	5
- 9297020	Electronic Abort Switch Assembly	5
- 9297017	Spacer	5
- 9297070	Transistor, Photo	5
- 9297071	Diode-Light Emitting	5

4.3.2 Inspections to be performed. Examination shall be in accordance with MIL-A-48078. The first article sample submitted in accordance with paragraph 4.3.1 shall be subjected by the Government to: the inspections specified in 4.4.2.1 through 4.4.2.35 as applicable, any or all the requirements of the applicable drawings, and to the inspections of 4.3.2.1 and its subparagraphs. All defects shall be classified major unless otherwise specified.

4.3.2.1 First article test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.3.2.1.1 Critical environment tests.

a. Twenty-four fuzes shall be subjected to the following test matrix:

	QUANTITY						TOTAL	REQ/METHOD PARAGRAPH
Group Number	I	II	III	IV	V	VI	-	
Samples per Group	3	3	3	3	6	6	24	
Test								
Mechanical Character.	3	3	3	3	6	6	24	3.3.1.1/ gage, visual
Workmanship	3	3	3	3	6	6	24	3.3.3/visual
Resistance (Ambient)	3	3	3	3	6	6	24	3.2.13/4.5.5
Thermal Shock (+160°F, -50°F)	-	-	-	-	6	6	12	3.4.2/4.5.6
Transportation Vibration -50°F	-	-	3	-	6	-	9	3.4.4/4.5.7 4.5.10.1
+160°F	-	-	-	3	-	6	9	
Launch Shock, -50°F	3	-	-	-	6	-	9	3.4.5/4.5.8, 4.5.10.1
+140°F	-	3	-	-	-	6	9	
Flight Vibration, -50°F	-	-	3	-	6	-	9	3.4.6/4.5.9, 4.5.10.1
+140°F	-	-	-	3	-	6	9	
Resistance, -50°F	3	-	3	-	6	-	12	3.4.1/4.5.5
+140°F	-	3	-	3	-	6	12	

WARNING: Fuze may be ARMED after exposure to shock or vibration testing. Personnel safety barricades are required for all electrical tests or visual examinations.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:57Z
Check the source to verify that this is the current version before use.

b. Two fuzes from group V and two from group VI of paragraph 4.3.2.1.1a shall be selected and tested in accordance with the following matrix:

	QUANTITY						TOTAL	REQ/METHOD PARAGRAPH
Group Number	I	II	III	IV	V	VI	-	
Samples per Group	0	0	0	0	2	2	4	(Note 1)
Test								
22g Lock and Abort Function, (20g)					2	2	4	3.2.7, 3.2.11.3/ 4.5.11, 4.5.10.1
*Visual (Abort) Note 2					2	2	4	3.2.11.3, 4.5.11.1 Visual/ 4.5.10.1
Static Detonator Safety (SD)					2	2	4	3.2.14, 3.2.9.3/ 4.5.12, 4.5.10.2

Note 1. Group V at -50°F, Group VI at +140°F

Note 2. Unit returned to ambient for rotor angle measurement and replacement of actuators before proceeding with test.

(20g) = 20 g simulated launch acceleration.

(30g) = 30 g simulated launch acceleration.

SD = Initiate detonator by self destruct mode.

* Critical Defect Classification

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

c. Ten of the 20 fuzes from paragraph 4.3.2.1.1a (those not subjected to the tests of 4.3.2.1.1b) shall be selected and tested in accordance with the following matrix.

		QUANTITY						TOTAL	REQ/METHOD PARAGRAPH
Group Number		I	II	III	IV	V	VI	-	
Samples per Group		1	2	2	1	2	2	10	
Test									
Arm, (30g)	-50°F	1	-	2	-	2	-	5	3.2.7/4.5.3, 4.5.3.2
	+140°F	-	2	-	1	-	2	5	
Dent (HTS)	-50°F	-	-	-	-	1	-	3	3.2.10,3.2.9, 3.2.9.2/
	+140°F	-	1	-	1	-	-		4.5.13, 4.5.4.2, 4.5.10.2
Dent (SD)	-50°F	-	-	1	-	-	-	2	3.2.10,3.2.9, 3.2.9.3/
	+140°F	-	-	-	-	-	1		4.5.13, 4.5.4.3, 4.5.10.2
Dent (IS)									
(4 sec)	-50°F	1	-	-	-	-	-	5	3.2.10,3.2.9,
(4 sec)	+140°F	-	-	-	-	-	1		3.2.9.1/
(8 sec)	-50°F	-	-	-	-	1	-		4.5.13,
(8 sec)	+140°F	-	1	-	-	-	-		4.5.4.4,
(12 sec)	-50°F	-	-	1	-	-	-		4.5.10.2

(30g) = 30g simulated launch acceleration
(HTS) = Initiate detonator by Hard Target Sensor (Simulated)
(IS) = Initiate detonator by Impact Switch
(SD) = Initiate detonator by Self Destruct Mode

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:57Z
Check the source to verify that this is the currentversion before use.

d. The remaining ten fuzes from paragraph 4.3.2.1.1a shall be selected and tested in accordance with the following matrix.

		QUANTITY						TOTAL	REQ/METHOD PARAGRAPH
Group Number		I	II	III	IV	V	VI	-	
Samples per Group		2	1	1	2	2	2	10	
Test									
Arm, (55g)	-50°F	2	-	1	-	2	-	5	3.2.7/4.5.3, 4.5.3.3
	+140°F	-	1	-	2	-	2	5	
Dent (HTS)	-50°F	1	-	-	-	-	-	2	3.2.10,3.2.9, 3.2.9.2/ 4.5.13, 4.5.4.2, 4.5.10.2
	+140°F	-	-	-	1	-	-		
Dent (IS)									
(4 sec)	-50°F	1	-	-	-	-	-	5	3.2.10,3.2.9, 3.2.9.1/ 4.5.13, 4.5.4.4, 4.5.10.2
(4 sec)	+140°F	-	-	-	-	-	1		
(8 sec)	-50°F	-	-	-	-	1	-		
(8 sec)	+140°F	-	-	-	1	-	-		
(12 sec)	+140°F	-	1	-	-	-	-		
Dent (SD)	-50°F	-	-	1	-	1	-	3	3.2.10,3.2.9, 3.2.9.3/ 4.5.13, 4.5.4.3, 4.5.10.2
	+140°F	-	-	-	-	-	1		

(55g) = 55g simulated launch acceleration
(HTS) = Initiate detonator by Hard Target Sensor (Simulated)
(IS) = Initiate detonator by Impact Switch
(SD) = Initiate detonator by Self Destruct Mode

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.3.2.1.2 Rough handling tests. Six fuzes, with groups VIII and IX modified for remote firing of the arm actuator 9282665, shall be tested as specified below as groups VII, VIII and IX.

	QUANTITY			TOTAL	REQ/METHOD PARAGRAPH
Group Number	VII	VIII	IX		
Samples per Group	2	2	2	6	
Test					
Mechanical Characteristics	2	2	2	6	3.3.1.1/ gage, visual
Workmanship	2	2	2	6	3.3.3/visual
Resistance	2	2	2	6	3.2.13/4.5.5
Abort Actuator Circuit Test (55g)	-	2	-	2	3.2.11.3/ 4.5.11.1
*Visual (Abort)	-	2	-	2	3.3.1.1/ visual, gage
Abort-Safe Function (6g)	-	-	2	2	3.2.11.4/ 4.5.14
*Visual (Abort-Safe)	-	-	2	2	3.3.1.1/ visual
Jolt (Note 1)	1	1	1	3	3.4.7/4.5.15, 4.5.10.2
Jumble (Note 1)	1	1	1	3	3.4.8/4.5.16, 4.5.10.2
*Visual (Not Arm)	2	2	2	6	3.3.1.1/ visual

*Critical Classification

Note 1. Precondition Group VII and VIII at -50°F, Group IX at +160°F.

(20g) = simulated 20 g launch
(55g) = simulated 55 g launch
(6g) = simulated 6 g launch

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.3.3 Rejection.

4.3.3.1 First article examination rejection. Rejection shall be in accordance with MIL-A-48078. In the event of rejection, the Government reserves the right to require the contractor to take corrective action and submit a new first article sample or portion thereof. Until a first article sample is accepted, the contractor is in no way authorized by the Government to initiate regular production (including procurement of material by the contractor) unless otherwise directed by the Contracting Officer.

4.3.3.2 First article test rejections. Rejection shall be in accordance with MIL-A-48078. When designated by the contracting officer, a detailed analysis shall be made of all failures. Results of the analysis and corrective action to prevent recurrence in production units shall be determined. On approval of the procuring activity, a new sample may be selected from the corrected units and the tests for the groups that failed shall be rerun.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lot formation shall be in accordance with MIL-A-48078. Changes to the process, specification or drawing not affecting safety, performance, interchangeability or storage, as determined by the Government, shall not be deemed to alter the homogeneity of an inspection lot.

4.4.2 Examination. Examination shall be in accordance with MIL-A-48078. Unless otherwise specified, sampling shall be in accordance with MIL-STD-105, Inspection Level II. AQL levels, number of sample units to be inspected for inspections requiring fixed samples, and requirements for 100 percent inspection are specified in 4.4.2 and subparagraphs, Quality Conformance Inspection.

Fuze subassembly inspection and fuze acceptance tests shall be facilitated by substituting a solenoid assembly, 9326440, for the arm actuator and a 680 ohm resistor for the detonator and by omitting the abort actuator, as applicable. This configuration shall be applicable in all tests of the following subassemblies:

Safe and Arm Assembly	9297030
Electronic Components Assembly	9297064
Fuze Subassembly	9297065

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:57Z
Check the source to verify that this is the current version before use.

a. Lot examination procedure. Inspection shall be performed on the components and subassemblies designated in 4.4.2.1 through 4.4.2.37 in accordance with 4.4.2.

b. Lot test procedure. Tests shall be performed on the assemblies designated in 4.4.2.38.

The electrical and mechanical functions of the fuze shall be checked without the electroexplosive devices (detonator, arm actuator, abort actuator) installed. A solenoid assembly, 9326440, shall be substituted for the arm actuator and a suitable resistor substituted for the detonator until the unit is accepted in accordance with 4.4.2.36. Once units pass the acceptance test, a lot is formed for submission to the inspector for lot test sample selection. The samples selected shall have the arm actuator installed to replace the solenoid. A resistance test shall be performed on the sample in accordance with 4.4.2.37, and the sample then subjected to the tests defined in 4.4.2.38. Upon completion of the lot sample tests, the balance of the lot shall have the explosive elements installed; after the fuze housing is installed, a final resistance test shall be performed in accordance with 4.4.2.37. The test samples shall have the expended arm actuator replaced and the remaining explosive elements installed and shipped as part of the lot if so directed by the Contracting Officer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297031
4.4.2.1	Printed Cable, Flexible				NEXT HIGHER ASSEMBLY 9297035
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Continuity of circuits	10%		3.3.1.3	Gage
102	Minimum spacing of conductor leads and pads		.40%	3.3.1.3	Gage
MINOR					
201	Hole pattern		.65%	3.3.1.3	Gage
202	Profile	10/lot		3.3.1.3	Visual
203	Minimum conductor width		.65%	3.3.1.3	Gage
204	Homogeneity of hot tin coating of exposed terminals and their intersecting holes		.65%	3.3.1.3 3.3.4	Visual
205	Holes (Details A, C, J, L, N, R, T, W, AE, AH, & AK)		.65%	3.3.1.3	Gage
206	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.2	Bracket, Arming Switch		9282619
			NEXT HIGHER ASSEMBLY 9297030

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Overall Length		.25%	3.3.1.3	Gage
102	Length of edge near three holes		.25%	3.3.1.3	Gage
103	Thickness		.25%	3.3.1.3	Gage
MINOR					
201	Overall width		.65%	3.3.1.3	Gage
202	Pitch diameter of threaded hole		.65%	3.3.1.3	Gage
203	Hole locations		.65%	3.3.1.3	Gage
204	Diameter of small smooth hole		.65%	3.3.1.3	Gage
205	Diameter of large smooth hole		.65%	3.3.1.3	Gage
206	Workmanship		.65%	3.3.4	Visual
207	Minor diameter max., of threaded hole		.65%	3.3.1.3	Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.3	Housing, Detonator 1/	1 OF 1	9297053
			NEXT HIGHER ASSEMBLY: 9297047

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Diameter of mouting holes		.25%	3.3.1.3	Gage
102	Location of mounting holes		.25%	3.3.1.3	Gage
103	Diameter of detonator cavity		.25%	3.3.1.3	Gage
104	Location of detonator cavity		.25%	3.3.1.3	Gage
MINOR					
201	Overall length		.65%	3.3.1.3	Gage
202	Material 2/	4/lot		3.3.1.3	Chemical Analysis
203	Workmanship		.65%	3.3.4	Visual

NOTES: 1/ If part is molded, check 5 units per mold cavity, minimum.
2/ Any failure is cause for rejection of the lot.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9282630
4.4.2.4	Screw, Adjusting - 22 G Lock				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Large head diameter		.25%	3.3.1.3	Gage
102	Length of large head diameter		.25%	3.3.1.3	Gage
103	Overall head length		.25%	3.3.1.3	Gage
MINOR					
201	Pitch diameter of thread		.65%	3.3.1.3	Gage
202	Workmanship		.65%	3.3.4	Visual
203	Thread major diameter, max.		.65%	3.3.1.3	Gage

NOTES:

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.5	Weight, 22 G Lock	1 OF 1	9282631
			NEXT HIGHER ASSEMBLY 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Overall length		.25%	3.3.1.3	Gage
103	Diameter of counterbore		.25%	3.3.1.3	Gage
104	Depth of counterbore		.25%	3.3.1.3	Gage
105	Distance from aft end to start of taper at nose end		.25%	3.3.1.3	Gage
106	Width of keyway slot		.25%	3.3.1.3	Gage
107	Depth of keyway slot		.25%	3.3.1.3	Gage
108	Length of keyway slot		.25%	3.3.1.3	Gage
109	Radial difference between outside diameters		.25%	3.3.1.3	Gage
MINOR					
201	Diameter of nose flat		.65%	3.3.1.3	Gage
202	Thread size		.65%	3.3.1.3	Gage
203	Smallest corner radius, 3 places		.65%	3.3.1.3	Gage
204	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9282632
4.4.2.6	Pin, Shoulder Stop				NEXT HIGHER ASSEMBLY 9297025
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Height of shoulder and pin section		.25%	3.3.1.3	Gage
102	Outside diameter of shoulder		.25%	3.3.1.3	Gage
103	Outside diameter of small end		.25%	3.3.1.3	Gage
104	Length of small outside diameter plus angled interface to counterbore		.25%	3.3.1.3	Gage
MINOR					
201	Length of large outside diameter		.65%	3.3.1.3	Gage
202	Large outside diameter		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET	DRAWING NUMBER
4.4.2.7	Spring, Helical, Compression - 22G Lock		1 OF 1	9297022
				NEXT HIGHER ASSEMBLY: 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Load of installed height		100%	3.3.1.3	4.5.17
103	Load at specified working range height		100%	3.3.1.3	4.5.17
MINOR					
201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297048
4.4.2.8	Window				NEXT HIGHER ASSEMBLY 9297046
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Material		.25%	3.3.1.3	Certificate of Compliance
MINOR					
201	Outside diameter		.65%	3.3.1.3	Gage
202	Thickness		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.9	Cup, Lead	1 OF 1	9282646
			NEXT HIGHER ASSEMBLY 9282648

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Inside diameter		.25%	3.3.1.3	Gage
103	Wall thickness of closed end		.25%	3.3.1.3	Gage
MINOR					
201	Overall length		.65%	3.3.1.3	Gage
202	Corner radii		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.10	Lead, Explosive PA 511	1 OF 1	9282648
			NEXT HIGHER ASSEMBLY: 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Presence of closure disc		.25%	3.3.3	Visual
103	Number and weight of pellets			3.3.1.3	Certificate of Compliance
104	Dent test 1/	5%,20		3.3.1.3	Certificate of Compliance
105	Density of explosive charge	2/,3/	.25%	3.3.1.3	MIL-E-81111
MINOR					
201	Overall length		.65%	3.3.1.3	Gage
202	Blue indicator disc not visible		.65%	3.3.1.3	Visual
203	Workmanship		.65%	3.3.4	Visual

NOTES:
1/ Test 5% of lot purchased or 20 units, whichever is less.
2/ Density test is required only if the alternative loading method is used.
3/ Sample per special inspection method S4, MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9282657
4.4.2.11	Housing - Arming Actuator				NEXT HIGHER ASSEMBLY 9297066
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Smaller outside diameter		.25%	3.3.1.3	Gage
103	Smaller inside diameter		.25%	3.3.1.3	Gage
104	True position of thread to outside diameter		.25%	3.3.1.3	Gage
105	True position of small inside diameter to thread		.25%	3.3.1.3	Gage
MINOR					
201	Length of smaller O.D.		.65%	3.3.1.3	Gage
202	Overall length		.65%	3.3.1.3	Gage
203	Length of full form thread		.65%	3.3.1.3	Gage
204	Form of threads (.164-36 UNF-28 Mod.)		.65%	3.3.1.3	Gage
205	Larger inside diameter		.65%	3.3.1.3	Gage
206	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9297025
4.4.2.12	Rotor Assembly*		NEXT HIGHER ASSEMBLY 9297030

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL					
1	Location and presence of orange indication		100%	3.3.1.3	Visual
2	Orientation of explosive lead		100%	3.3.1.3	Visual
MAJOR					
101	Location and presence of green indicator (2 pieces)		100%	3.3.1.3	Visual
MINOR					
201	Part missing		.65%	3.3.1.3	Visual
202	Workmanship		.65%	3.3.4	Visual

NOTES:
*WARNING: Explosive lead installed.
Personnel Safety Barricades are required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current revision before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297030
4.4.2.13	Safing and Arming Assembly				NEXT HIGHER ASSEMBLY 9297065
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Evidence of adhesive bond for arming switch bracket		100%	3.3.1.3	Visual
102	Parts missing		100%	3.3.1.3	Visual
103	Arm switch setting		100%	3.3.1.3	4.5.20.1
104	Centrifuge test 1/, 2/		100%	3.3.1.3	4.5.20.2 through 4.5.20.6
105	Electronic Abort Switch (9297020) rotor clearance		100%	3.3.1.3	Gage
MINOR					
201	Workmanship		.65%	3.3.4	Visual

NOTES:
1/ A Solenoid Assembly 9326440 shall be used in lieu of the Arm Actuator.
2/ Test prior to insertion of 9297015 and 9297020.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9282660
4.4.2.14	Relay Armature, FM Ignition				NEXT HIGHER ASSEMBLY 9297064
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Pick up voltage		100%	3.3.1.3	Test
102	Dropout voltage		100%	3.3.1.3	Test
MINOR					
201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9282661
4.4.2.15	Relay Armature, Interlock		NEXT HIGHER ASSEMBLY 9297064

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Coil resistance		100%	3.3.1.3	Test
102	Pick up voltage		100%	3.3.1.3	Test
MINOR					
201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.16	Electronic Components Assembly - Fuze		9297064
			NEXT HIGHER ASSEMBLY 9297065

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR	None defined				
MINOR					
201	Location of large capacitor		.65%	3.3.1.3	Gage
202	Height of soldered leads		.65%	3.3.1.3	Gage
203	Conformal coat		.65%	3.3.1.3	Gage
204	Soldering to MIL-S-45743		.65%	3.3.1.3	Visual
205	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2020-02-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.17	Connector, Electrical	1 OF 1	9282672
			NEXT HIGHER ASSEMBLY 9297035

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Configuration - (Pins 9 & 19 removed)		100%	3.3.1.3	Visual
MINOR					
201	Centerline of mounting holes		.65%	3.3.1.3	Gage
202	Width		.65%	3.3.1.3	Gage
203	Mounting tab thickness		.65%	3.3.1.3	Gage
204	Height above mounting tab surface		.65%	3.3.1.3	Gage
205	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9297049
4.4.2.18	Housing, Fuze		NEXT HIGHER ASSEMBLY 9297046

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	True position of mounting holes to outside diameter		.25%	3.3.1.3	Gage
102	Flatness of surface at open end		.25%	3.3.1.3	Gage
103	Diameter of center hole		.25%	3.3.1.3	Gage
104	Height of housing		.25%	3.3.1.3	Gage
105	Slope, diameter, and true position of window recess to outside diameter		.25%	3.3.1.3	Gage
106	Distance from open end to window recess		.25%	3.3.1.3	Gage
107	Pitch diameter of mounting holes		.25%	3.3.1.3	Gage
108	Minor diameter, max. of mounting holes		.25%	3.3.1.3	Gage
MINOR					
201	Outside diameter		.65%	3.3.1.3	Gage
202	Wall thickness		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297065
4.4.2.19	Fuze Subassembly				NEXT HIGHER ASSEMBLY 9297066
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Electronics component assembly shall not be in contact with base		100%	3.3.4	Visual
102	Proper application of epoxy/arm switch plate and housing		100%	3.3.4	Visual
MINOR					
201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.20	Detonator Assembly	1 OF 1	9297047
			NEXT HIGHER ASSEMBLY 9297066

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR 101	Distance from centerline of hole to end of detonator.		.25%	3.3.1.3	Gage
MINOR 201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297046
4.4.2.21	Housing Assembly - Fuze				NEXT HIGHER ASSEMBLY 9297066
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Distance from open end to surface of window housing		100%	3.3.1.3	Gage
MINOR					
201	Presence of rollover		.65%	3.3.1.3	Visual
202	No fingerprints on window		.65%	3.3.4	Visual
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 9282694
4.4.2.22	Pin, Lock- Primary		NEXT HIGHER ASSEMBLY 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.25%	3.3.1.3	Gage
102	Keyway width		.25%	3.3.1.3	Gage
103	Keyway true position		.25%	3.3.1.3	Gage
104	Pin head diameter and true position		.25%	3.3.1.3	Gage
105	Keyway depth		.25%	3.3.1.3	Gage
MINOR					
201	Large inside diameter		.65%	3.3.1.3	Gage
202	Depth of large inside diameter and true position		.65%	3.3.1.3	Gage
203	Smaller inside diameter		.65%	3.3.1.3	Gage
204	Depth of smaller inside diameter and true position		.65%	3.3.1.3	Gage
205	Pin head length		.65%	3.3.1.3	Gage
206	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9282695
4.4.2.23	Pin Lock - Secondary				NEXT HIGHER ASSEMBLY 9297025
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter of flange		.25%	3.3.1.3	Gage
102	Taper on end of pin and true position		.25%	3.3.1.3	Gage
103	Outside diameter of small pin (tapered end) and true position		.25%	3.3.1.3	Gage
104	Surface roughness		.25%	3.3.1.3	Gage
MINOR					
201	Outside diameter and true position of larger end		.65%	3.3.1.3	Gage
202	Outside diameter and true position of central body		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.24	Fuze, Guided Missile, M934E6	1 OF 1	9297066
			NEXT HIGHER ASSEMBLY: -

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL					
1	Visual safe indication in view window		100%	3.2.11.2	Visual
MAJOR					
101	Outside diameter		100%	3.3.1.3	Gage
102	Overall height		100%	3.3.1.3	Gage
103	Window diameter (interface dimension)		100%	3.3.1.3	Gage
104	Depth to window		100%	3.3.1.3	Gage
105	Weight		100%	3.3.1.3	Gage
106	Resistance test		100%	3.2.13	4.5.5
107	Screws on base-flush or below		100%	3.3.1.3	Gage
108	Center of gravity (interface dimension)		100%	3.3.1.3	Gage
109	Head of primary lock pin not visible		100%	3.3.1.3	Visual
110	Distance from base end to window recess, max.		100%	3.3.1.3	Gage
111	Arm switch actuator position (retained within bracket confines)		100%	3.3.1.3	Visual
MINOR					
201	Marking		.65%	3.3.1.3	Visual
202	Torque, housing retainer screws		.65%	3.3.1.3	4.5.21

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.25	Spring, Helical Compression - Arm Lock		9297023
			NEXT HIGHER ASSEMBLY 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Spring load test		.25%	3.3.1.3	4.5.17
102	Wire diameter		.25%	3.3.1.3	Gage
MINOR					
201	Outside diameter		.65%	3.3.1.3	Gage.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.26	Rotor	1 OF 3	9297024
			NEXT HIGHER ASSEMBLY 9297025

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Inside diameter and true position of large hole shown in Section B-B		.25%	3.3.1.3	Gage
102	Inside diameter and true position of small hole coaxial with 101		.25%	3.3.1.3	Gage
103	Inside diameter, countersink and true position of small hole perpendicular to 101		.25%	3.3.1.3	Gage
104	Inside diameter and true position of large hole shown in Section A-A		.25%	3.3.1.3	Gage
105	Inside diameter, countersink and true position of hole perpendicular to 104		.25%	3.3.1.3	Gage
106	Length of rotor less bearing journal lengths		.25%	3.3.1.3	Gage
107	Outside diameter of cylindrical bearing ends of rotor (2 places)		.25%	3.3.1.3	Gage
108	Finish on cylindrical bearing ends of rotor		.25%	3.3.1.3	Gage
109	Finish of large hole in Section B-B		.25%	3.3.1.3	Gage
110	Finish of large hole in Section A-A		.25%	3.3.1.3	Gage
111	Required surfaces free of protective finish		.25%	3.3.1.3	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER 9297024
4.4.2.26	Rotor				NEXT HIGHER ASSEMBLY 9297025
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
MINOR					
201	Angular distance only from centerline large recess on cylindrical end of rotor		.65%	3.3.1.3	Gage
202	Small slot and true position on cylindrical end of rotor		.65%	3.3.1.3	Gage
203	True position and diameter of the large hole, datum D, in the rectangular shaped boss		.65%	3.3.1.3	Gage
204	Distance of the top flat surface of the large rectangular shaped boss from the centerline of the bearings		.65%	3.3.1.3	Gage
205	Inside diameter and true position of hole which is perpendicular to and breaks in to 203		.65%	3.3.1.3	Gage
206	Size and true position of the radius that forms the end of the boss opposite the blade		.65%	3.3.1.3	Gage
207	Centerline to the bottom of the blade		.65%	3.3.1.3	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET		DRAWING NUMBER
4.4.2.26	Rotor		3 of 3		9297024
					NEXT HIGHER ASSEMBLY 9297025
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
208	Size and true position of the radius that forms end of the blade		.65%	3.3.1.3	Gage
209	Size and true position of the radius that forms intersection of the large boss and the blade		.65%	3.3.1.3	Gage
210	Centerline to the top of the blade		.65%	3.3.1.3	Gage
211	Size and location of the small hole thru the small raised boss on top		.65%	3.3.1.3	Gage
212	Radial size of the undercut in Detail D		.65%	3.3.1.3	Gage
213	Distance from surface A to the rectangular boss and width of the boss shown in center view, Sht 1		.65%	3.3.1.3	Gage
214	Workmanship		.65%	3.3.4	Visual
215	Protective finish missing or improper		.65%	3.3.1.3	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET 1 OF 3	DRAWING NUMBER
4.4.2.27	Base		9297050
			NEXT HIGHER ASSEMBLY 9297030

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Outside diameter		.40%	3.3.1.3	Gage
102	Width and true position of bearing slot		.40%	3.3.1.3	Gage
103	Depth of bearing slot		.40%	3.3.1.3	Gage
104	Distance from centerline of slots to datum K in Section P-P		.40%	3.3.1.3	Gage
105	Distance from centerline of slots to short boss shown in top view of sheet 1 and section P-P, Sht 3		.40%	3.3.1.3	Gage
106	Closest distance from base centerline to the tallest boss and boss with the left slot shown in the front view and top view, Sht 1		.40%	3.3.1.3	Gage
107	Closest distance from base centerline and the boss with the right slot, shown in top view, Sht 1		.40%	3.3.1.3	Gage
108	Distance from surface A to deepest recess shown in Section K-K, Sht 2		.40%	3.3.1.3	Gage

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.27	Base	2 OF 3	9297050
			NEXT HIGHER ASSEMBLY: 9297030

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
109	Thickness of base at outside diameter		.40 %	3.3.1.3	Gage
110	True position and size of four threaded holes located next to the slots shown in top view Sht 1		.40%	3.3.1.3	Gage
111	True position and diameter of large counterbore in Section P-P that is parallel with the bottom of base		.40 %	3.3.1.3	Gage
112	True position and diameter of smaller counter bore coaxial within Category 111		.40%	3.3.1.3	Gage
113	True position and diameter of snap ring above coaxial with Category 111		.40 %	3.3.1.3	Gage
114	Inside diameter and true position of small diameter through hole coaxial with 111		.40 %	3.3.1.3	Gage
115	Width and position of slot shown in sections P-P and R-R and S-S, Dwg. Sht. 3		.40 %	3.3.1.3	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER 9297050
4.4.2.27	Base				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
116	Large radius and true position shown in Section P-P		.40%	3.3.1.3	Gage
117	True position and size of small counter bore coaxial with angled large threaded hole, Datum H, shown in Section P-P		.40%	3.3.1.3	Gage
118	Flatness of Surface A		.40%	3.3.1.3	Gage
119	Flatness of top of rim		.40%	3.3.1.3	Gage
MINOR					
201	Three chambers and true position shown in View E-E and Section M-M		.65%	3.3.1.3	Gage
202	True position of the half circular diameter coaxial with Datum H shown in Section P-P		.65%	3.3.1.3	Gage
203	Depth of second deepest recess shown in Section K-K		.65%	3.3.1.3	Gage
204	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325805
4.4.2.28	Spring, Toggle - Rotor				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Spring load test		.25%	3.3.1.3	4.5.17
102	Bias spring test 1/	10/Lot		3.3.1.3	4.5.18
MINOR					
201	Spring arm length (2 places)		.65%	3.3.1.3	Gage
202	Spring diameter		.65%	3.3.1.3	Gage
203	Max. spring length		.65%	3.3.1.3	Gage

NOTES:
1/ Any failure is cause for rejection of the lot.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.29	Shim, Rotor	1 OF 1	9325806
			NEXT HIGHER ASSEMBLY 9297030

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR	None defined				
MINOR					
201	Inside diameter		.65%	3.3.1.3	Gage
202	Thickness		.65%	3.3.1.3	Gage
203	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297029
4.4.2.30	Support, Mounting				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Dimension and location of large radius in Section A-A		.25%	3.3.1.3	Gage
102	Diameter and location of the three holes at Location C-3 and hole at B-5		.25%	3.3.1.3	Gage
103	Diameter and location of tapped holes (2 places)		.25%	3.3.1.3	Gage
104	Location of perpendicular end-surfaces of large radius in Section A-A		.25%	3.3.1.3	Gage
MINOR					
201	Diameter and location of hole at location E-6		.65%	3.3.1.3	Gage
202	Location of slot at location E-4		.65%	3.3.1.3	Gage
203	Location of surface adjacent to tapped holes at location G-5		.65%	3.3.1.3	Gage
204	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026/0-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297051
4.4.2.31	Bushing, Rotor				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Inside diameter and true position		.25%	3.3.1.3	Gage
102	Outside diameter		.25%	3.3.1.3	Gage
103	Finish inside diameter		.25%	3.3.1.3	Gage
MINOR					
201	Outside bearing length		.65%	3.3.1.3	Gage
202	Flange thickness		.65%	3.3.1.3	Gage
203	Flange diameter		.65%	3.3.1.3	Gage
204	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297020
4.4.2.32	Electronic Abort Switch Assembly				NEXT HIGHER ASSEMBLY 9297030
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR 101	Electrical test (Note 3, sheet 2 of dwg)		100%	3.3.1.3	Detailed dwg.
MINOR 201	Workmanship		.65%	3.3.4	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2022640-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.33	Spacer - Electronic Abort Switch	1 OF 1	9297017
			NEXT HIGHER ASSEMBLY 9297020

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Diameter and true position of mounting hole		.25%	3.3.1.3	Gage
102	Diameter and true position of 4 pins		.25%	3.3.1.3	Gage
103	Radius and true position of slot		.25%	3.3.1.3	Gage
104	Width of alignment flange		.25%	3.3.1.3	Gage
105	Depth of alignment flange		.25%	3.3.1.3	Gage
106	Smaller dimension locating edge of long slot parallel with hole		.25%	3.3.1.3	Gage
107	Larger dimension locating edge of long slot parallel with hole		.25%	3.3.1.3	Gage
MINOR					
201	Width		.65%	3.3.1.3	Gage
202	Workmanship		.65%	3.3.4	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.34	Transistor, Photo	1 OF 1	9297070
			NEXT HIGHER ASSEMBLY 9297020

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Lens height		.25%	3.3.1.3	Gage
MINOR					
201	Tab thickness		.65%	3.3.1.3	Gage
202	Collector diameter		.65%	3.3.1.3	Gage
203	Overall length		.65%	3.3.1.3	Gage

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297071
4.4.2.35	Diode - Light Emitting				NEXT HIGHER ASSEMBLY 9297020
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Lens height		.25%	3.3.1.3	Gage
MINOR					
201	Tab thickness		.65%	3.3.1.3	Gage
202	Anode diameter		.65%	3.3.1.3	Gage
203	Overall length		.65%	3.3.1.3	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297066
4.4.2.36	Fuze, Guided Missile, M934E6				NEXT HIGHER ASSEMBLY -
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL	None defined				
MAJOR					
101	Interlock, flight motor ignition 1/		100%	3.2.5, 3.2.6	4.5.2
102	Launch switch closure 1/		100%	3.2.4	4.5.1.3
103	Isolation 1/		100%	3.2.3	4.5.1.4
104	Early motion detection 1/		100%	3.2.12	4.5.11.2
105	Fuze arming 1/, 2/, 4/		100%	3.2.7	4.5.3, 4.5.3.1, 4.5.3.2, 4.5.3.3
106	Detonation (electrical only) 1/, 3/, 4/		100%	3.2.9	4.5.4, 4.5.4.1(8 sec), 4.5.4.2, 4.5.4.3

NOTES:
1/ A resistor shall be installed in the place of the detonator. The abort actuator shall be omitted.
2/ A solenoid may be used in lieu of the arm actuator.
3/ Test 106 must be preceeded by test 105.
4/ Paragraph 3.2.13.1A applies.

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET		DRAWING NUMBER
4.4.2.37	Fuze. Guided Missile, M934E6		1 OF 1		9297066
					NEXT HIGHER ASSEMBLY: -
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
CRITICAL 1	Fuze armed		100%	3.2.11	Visual
MAJOR 101	Resistance 1/		100%	3.2.13	4.5.5

NOTES:
1/ All electro-explosive devices are installed. However, the sample selected for the lot acceptance testing specified in 4.4.2.38 shall initially be resistance checked with only the arm actuator installed, and after completing 4.4.2.38 testing and subsequent installation of all electro-explosive devices again submitted to the resistance check for acceptance.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-48863C (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.38	Fuze, Guided Missile, M934E6	1 OF 2	9297066
			NEXT HIGHER ASSEMBLY: -

CATEGORY	EXAMINATION OF TEST		SAMPLE QUANTITY				REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Lot Size		25-50	51-90	91-150	151-280		
	No. of Sample Units 1/		6	8	14	20		
	Test 3/	Temp.						
CRITICAL	None defined							
MAJOR								
101	Transportation	+160°F	3	4	7	10	3.4.4	4.5.7, 4.5.10.1
	vibration	-50°F	3	4	7	10		
102	Launch shock	+140°F	3	4	7	10	3.4.5	4.5.8, 4.5.10.1
		-50°F	3	4	7	10		
103	Flight vibration	+140°F	3	4	7	10	3.4.6	4.5.9, 4.5.10.1
		-50°F	3	4	7	10		
104	Resistance	+140°F	3	4	7	10	3.4.1	4.5.5
		-50°F	3	4	7	10		
105	Arm (30g) 2/	+140°F	3	4	7	10	3.2.7	4.5.3, 4.5.3.2,
		-50°F	3	4	7	10		4.5.10.1
106	Detonation signal	+140°F	1	1	2	2	3.2.9.3,	4.5.4.3, 4.5.10.2,
	(SD) 2/	-50°F	1	1	2	2		3.2.13.8

NOTES:

1/ Any failure is cause for rejection of the lot.

2/ Fuzes subjected to tests 106, 107 and 108 are subjected to test 105 as necessary preceeding test.

3/ Major 101 thru 105 shall be performed in sequence shown.

(30g) = 30g simulated launch acceleration.

(SD) = Initiate detonator by self destruct mode.

Source: https://assist.dla.mil -- Downloaded: 2026-01-26T03:57Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.38	Fuze, Guided Missile, M934E6	2 OF 2	9297066
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OF TEST	SAMPLE QUANTITY				REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Lot Size	25-50	51-90	91-150	151-280		
MAJOR	Test Temp.						
107	Detonation signal +140°F	1	1	2	3	3.2.9.2,	4.5.13,4.5.4.2,4.5.10.2
	(HTS) 4/ -50°F	1	1	2	3	3.2.13.8	
108	Detonation signal +140°F	1	2	3	5	3.2.9.1,	4.5.13,4.5.4.4,4.5.10.2
	(IS, 8 sec) 5/ -50°F	1	2	3	5	3.2.13.8	
109	Noise immunity amb.	6	8	14	20	3.2.13.1 (b) thru 3.2.13.1.5	4.5.19

NOTES:
4/ (HTS) = Initiate detonation signal by hard target sensor mode.
5/ (IS 8 sec) = Initiate detonation signal by impact switch, 8 sec. after t_o.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.4.3 Rejections. If an inspection lot (4.4.2a) is rejected, the supplier may screen out the defective units and resubmit for inspection. Resubmitted lots shall be inspected using tightened inspection in accordance with MIL-STD-105. Such lots shall be separate from new lots and shall be clearly identified as reinspected lots.

If a tested lot (4.4.2b) fails inspection, the supplier shall take corrective action to correct the deficiency and to prevent its recurrence. Acceptance of product shall be discontinued until corrective action suitable to the Government has been taken. At the option of the Government, a new sample may be selected from the corrected units and the inspections repeated.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed in this specification is identified, either directly or by reference, in the "Paragraph Reference/Inspection Method" column of the First Article or Quality Conformance Inspection Tables herein. The contractor shall submit inspection equipment designs to the Government for approval in accordance with the terms of the contract.

4.5 Methods of inspection.

WARNING: Personnel safety barricades are required for tactical fuzes.

4.5.1 Isolation test. Failure to pass any one of the tests described in the following four subparagraphs is cause for rejecting the fuze or fuze subassembly.

4.5.1.1 Flight motor ignition and arm test. Apply fuze power, the umbilical retract signal, the simulated launch signal and the interlock signal, as specified in 3.2.13.1, 3.2.13.3, 3.2.13.5 and 3.2.13.2 respectively. The simulated launch signal shall be applied within 15 ± 10 milliseconds after the umbilical retract signal. The interlock signal shall be applied within 200 milliseconds after the simulated launch signal. 1000 ±200 ohm resistance shall be connected between pins 10 and 21 and between pins 11 and 21. 680 ±100 ohms resistance shall be connected in place of the detonator. Verify the occurrence of the flight motor ignition signal and the arm signal as specified in 3.2.13.7 and 3.2.13.9 respectively.

4.5.1.2 Launch signal/no interlock test. Repeat 4.5.1.1, except omit the interlock signal. Verify that the flight motor ignition signal and the arm signal as specified in 3.2.13.7 and 3.2.13.9, respectively, do not occur.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.5.1.3 Launch switch interrogation circuit test. Repeat 4.5.1.1, except substitute the substandard simulated launch signal as specified in 3.2.13.6 for the simulated launch signal. Verify that the flight motor ignition signal and the arm signal as specified in 3.2.13.7 and 3.2.13.9, respectively, do not occur.

4.5.1.4 Launch signal/no umbilical retract test. Repeat 4.5.1.1, except omit the umbilical retract signal. Verify that the flight motor ignition signal as specified in 3.2.13.7 does not occur.

4.5.2 Interlock test. Operation of the interlock circuitry shall be verified by performing the tests specified in 4.5.1.1 and 4.5.1.2.

4.5.3 Fuze arming test. The fuze shall be mounted on a centrifuge in a suitable fixture such that the fuze can be rotated from a low g field to the full specified acceleration field along the N to M axis as specified in Figure 1. The radius arm of the centrifuge shall be measured to a point in the M to N direction from the fuze base as specified in Figure 3. Apply power as specified in 3.2.13.1. Remove power prior to 15 seconds after simulated launch signal.

WARNING: Failure to remove power from an explosive-loaded test fuze prior to 15 seconds after simulated launch signal will result in fuze detonation.

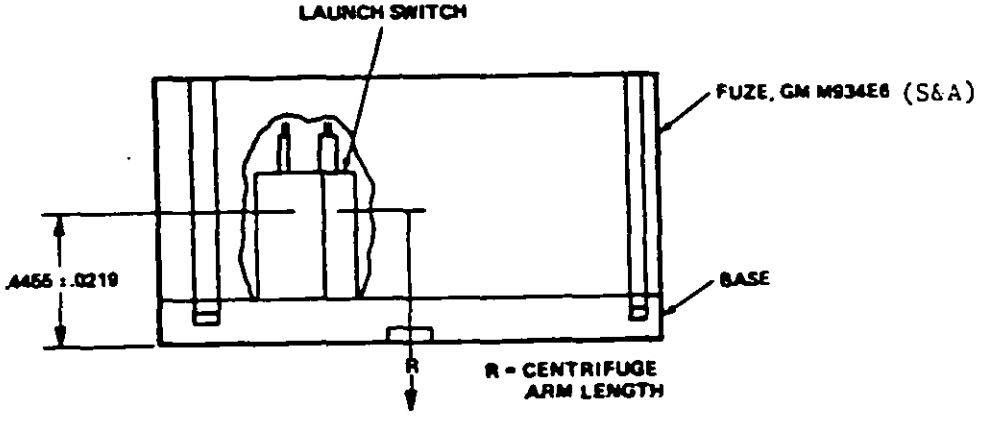


Figure 3. Centrifuge Arm Length Definition

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.5.3.1 22 g no arm test. Rotate the fuze into a 20 (-0, +2) g acceleration field. Supply the umbilical retract signal, the simulated launch signal, and the interlock signal, as specified in 3.2.13.3, 3.2.13.5, and 3.2.13.2 respectively. Measure resistance between pins 6 and 8 in accordance with 4.5.5. The resistance shall remain as specified in Table I, (3.2.13). Visually verify that the rotor is not in the arm position specified in 3.2.11.1.

4.5.3.2 30 g arm test. Test in accordance with 4.5.3.1 except rotate the fuze into a 30 (-0, +2) g acceleration field. At arm time, in accordance with 3.2.7 the resistance between pins 6 and 8 shall change to 1050 ohms or less at ambient, and 1100 ohms or less at +140°F when measured in accordance with 4.5.5. Visually verify that the rotor is in the armed position specified in 3.2.11.1.

4.5.3.3 55 g arm test. Test in accordance with 4.5.3.1 except do not supply the simulated launch signal of 3.2.13.5, but instead rotate the fuze into a 55 (-2, +0) g acceleration field. At arm time, in accordance with 3.2.7, the resistance between pins 6 and 8 shall change to 1050 ohms or less at ambient, and 1100 ohms or less at +140°F when measured in accordance with 4.5.5. Visually verify that the rotor is in the armed position specified in 3.2.11.1.

4.5.4 Detonator activation test. Each of three modes capable of initiating the fuze detonator shall be tested as specified in the following subparagraphs. Verify that the detonator firing signal as specified in 3.2.13.8 occurs at the proper time with respect to the initiating signal.

4.5.4.1 Impact switch mode test. The fuze or fuze subassembly 9297065 shall be armed per 3.2.7. The unit shall be mounted in a test fixture capable of imparting the velocity change specified in 3.2.9.1, except that the velocity change in lot acceptance testing shall be 22 to 24 inches per second.

Apply fuze power and the simulated launch signal, as specified in 3.2.13.1 and 3.2.13.5 respectively. Separate tests for flight times, as defined in 3.2.9.1, of 2, 4, 8 and 12 seconds shall be performed unless otherwise specified. Verify that the time differential between the start of the impact switch monitor signal and the detonator firing signal, specified in 3.2.13.11 and 3.2.13.8 respectively is as specified in Figure 2.

WARNING: Personnel safety barricades are required for explosive-loaded fuzes.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:57Z
Check the source to verify that this is the current version before use.

4.5.4.2 HTS mode test. The fuze or fuze subassembly 92 97065 shall be armed per 3.2.7. Apply fuze power, the simulated launch signal and the HTS signal as specified in 3.2.13.1, 3.2.13.5 and 3.2.13.4 respectively. The HTS signal change shall occur between 2 and 14 seconds after the simulated launch signal. Verify that the time between the start of the HTS signal and the detonator firing signal, specified in 3.2.13.4 and 3.2.13.8 respectively, is as specified in 3.2.9.2.

WARNING: Personnel safety barricades are required for explosive-loaded fuzes.

4.5.4.3 Self destruct mode test. The fuze or fuze subassembly 92 97065 shall be armed per 3.2.7. Apply fuze power and a simulated launch switch signal as specified in 3.2.13.1 and 3.2.13.5 respectively. Verify that the time between the start of the simulated launch switch signal and the detonator firing signal, specified in 3.2.13.5 and 3.2.13.8 respectively, is as specified in 3.2.9.3.

WARNING: Personnel safety barricades are required for explosive-loaded fuzes.

4.5.4.4 Impact switch mode (drop) test. The fuze shall be armed per 3.2.7. The unit shall be mounted in a test fixture and dropped on a drop tower so that the impact, in energy and direction, is equivalent to that specified in 4.5.4.1. Simulated flight time shall be 8 seconds. Verify that the time differential between the start of the impact switch monitor signal and the detonator firing signal, specified in 3.2.13.11 and 3.2.13.8 respectively is as specified in Figure 2.

WARNING: Personnel safety barricades are required for explosive-loaded fuzes.

4.5.5 Resistance test. The resistance test shall be performed in an explosive loading area or equivalent, with explosive handling procedures in effect. The resistance tester shall limit current to 1.0 milliampere and the voltage (under conditions of 1.0 milliampere current) to 1.0 volt.

The fuze shall be connected to a tester which engages connector J3. The electrical resistance shall be measured between all pairs of terminals specified in 3.2.13, Table I. The resistance values measured shall be as specified in 3.2.13, Table I ambient temperature measurements, and as specified in 3.4.1 for service environment limit temperatures. The fuze is defective if the measurement between any specified pair of terminations is not within the specified limits.

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:57Z
Check the source to verify that this is the currentversion before use.

4.5.6 Thermal shock test. The thermal shock test shall be performed in accordance with MIL-STD-331, Test 113, except that the low temperature shall be -50°F.

4.5.7 Transportation vibration test. The transportation vibration test shall be performed in accordance with MIL-STD-331, Test 119, Procedure 2. The vibration schedule shall be 0.4 inch peak to peak displacement from 10 to 15.7 Hz and 5.0 g peak acceleration from 15.7 to 500 Hz. The frequency shall be swept logarithmically from 10 to 500 to 10 Hz in 30 minutes. The fuze shall be vibrated two hours per major axis, as specified in Figure 1, for a total of six hours.

4.5.8 Launch shock test. The launch shock test shall be performed in accordance with MIL-STD-810C, Method 516.2, Procedure 1, except that the shock pulse shall be 150G peak acceleration, 10 milliseconds duration, half-sine as defined in Figure 516.2-2. There shall be one drop each, only in directions P, S&N along the major axes, as defined in Figure 1, for the fuzes subjected to the First Article Test Program as defined in 4.3.2.1. There shall be one drop only, in the N direction along the M-N axis, as defined in Figure 1, for the fuzes subjected to the Quality Conformance Test Program defined in 4.4.2. Fuze power in accordance with 3.2.13.1, shall be applied during the application of shock.

4.5.9 Flight vibration test. The flight vibration test shall be performed in accordance with MIL-STD-810C, Method 514.2, Procedure V, Part Number 2, curve AG, except that the duration shall be 5 minutes per axis (15 minutes total). Fuze power shall be applied in accordance with 3.2.13.1. Lot acceptance testing duration shall be one (1) minute per axis (3 minutes total).

4.5.10 Temperature test.

4.5.10.1 Maintained temperature. The fuze shall be preconditioned until stabilized at the specified temperature prior to test performance. The fuze shall be maintained at the specified temperature during and between the specified tests of the sequence.

4.5.10.2 Initial temperature. The fuze shall be preconditioned until stabilized at the specified temperature prior to test performance. Test performance shall commence within five minutes after removal of the fuze from the preconditioning chamber.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

4.5.11. 22 g lock and abort actuator function test. The fuze shall be prepared for test as in 4.5.3 and tested as in 4.5.3.1. Maintaining the specified acceleration field turn the fuze power off for 15 seconds, then on for 10 seconds, then off. Remove the fuze from the centrifuge. Verify that the abort piston actuator has extended and that the rotor is in abort position, as defined in 3.2.11.3.

4.5.11.1 Abort actuator circuit test. The fuze shall be prepared for test as in 4.5.3 except that the arm actuator shall be disconnected from the fuze circuits and pigtails extending external to the fuze shall be attached to the arm actuator terminals. The fuze shall be tested per 4.5.3.3 except that the arm actuator shall be initiated in less than 850 milliseconds after the simulated launch signal. Verify that the fuze rotor is pinned in the abort position, as defined in 3.2.11.3.

4.5.11.2 Early movement test. The fuze shall be prepared for test as in 4.5.3 and tested as in 4.5.3.2. The abort actuator shall be simulated by connecting a 680 ohm resistor from pin 12 to pin 15. Apply fuze power and verify the voltage at pin 12 is the same as the voltage at pin 15. Test fuze in accordance with 4.5.3.2 and while maintaining the specified acceleration field turn the fuze power off for 15 seconds, then reapply power and verify the presence of the abort signal, as specified in 3.2.13.12.

4.5.12 Static detonator safety test. The static detonator safety test shall be performed in accordance with MIL-STD-331, Test 115. The fuze shall be modified as required to permit direct firing of the detonator from external to the fuze.

4.5.13 Dent. The dent test shall be performed in accordance with MIL-STD-331, Test 301, except that the test shall be performed by placing the witness block in contact with the fuze base. A minimum quantity of Silicone Compound MIL-S-8660 shall be applied to the witness block surface next to the fuze base. The detonator shall be initiated by the specified mode, 4.5.4.1 through 4.5.4.4, and the explosive output shall be as specified in 3.2.10.

WARNING: Personnel safety barricades are required.

4.5.14 Abort-safe function test. The fuze shall be modified by disconnecting the arm actuator and attaching pigtails to the arm actuator leads for external firing. The fuze shall be prepared for test as in 4.5.3. The abort-safe function test shall be performed by applying the specified g load to the fuze,

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

applying the simulated launch signal as specified in 3.2.13.5, and firing the arm actuator in less than 850 milliseconds after the simulated launch signal. Verify that the fuze rotor is pinned in the abort-safe position as specified in 3.2.11.4.

4.5.15 Jolt test. The jolt test shall be performed in accordance with MIL-STD-331, Test 101.

4.5.16 Jumble test. The jumble test shall be performed in accordance with MIL-STD-331, Test 102.

4.5.17 Spring load test. The spring load test shall be performed by compressing the spring successively to the compressed lengths specified on the drawing and measuring the applicable load. The test shall be repeated for each load specified. The spring shall be classified defective if either applied load is not within the requirements of the applicable drawing.

4.5.18 Bias spring test. The bias spring test shall be performed by subjecting the spring to the maximum specified deflection, which is the minimum required deflection without permanent set. The spring shall be considered defective if it breaks, cracks, or demonstrates a permanent set.

4.5.19 Noise immunity test. Verification of the test requirements specified in 4.5.1.1 through 4.5.1.4, 4.5.4.2 and 4.5.4.3 shall be made in accordance with the following test conditions. This test shall include a simulated warhead body assembly electrical circuit between the noise source and the fuze under test. The noise source shall be in accordance with 3.2.13.1b through 3.2.13.1.5 and shall be applied to the J1 connector of the simulated warhead body assembly electrical circuit.

4.5.20 Safe and arm assembly tests

4.5.20.1 Arm switch setting test. The arm switch setting test shall be performed with the rotor in the fully armed position. Move the rotor back and forth through the full range of movements. Monitor the arm switch contacts with an ohmeter. Verify that the switch contacts do not transfer during rotor movement.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:57Z
Check the source to verify that this is the current version before use.

4.5.20.2 Centrifuge mounting position. The safing and arming assembly (S&A) shall be mounted on a centrifuge such that the S&A is subjected to the specified acceleration field along the N to M axis as specified in Figure 1. The radius arm of the centrifuge shall be measured to a point in the M to N direction from the S&A base as specified in Figure 3.

4.5.20.3 Substandard acceleration. Subject the S&A to a 20 (-0, +2) g acceleration field. Release the rotor from the safe position specified in 3.2.11.2. The rotor position shall be as specified in 3.2.11.2, or 3.2.11.4.

4.5.20.4 Arm position, 30g. Subject the S&A to a 30 (-0, +2) g acceleration field. Release the rotor from the safe position specified in 3.2.11.2. The rotor shall move to the arm position as specified in 3.2.11.1.

4.5.20.5 Arm position, 55g. Subject the S&A to a 55 (-2, +0) g acceleration field. Release the rotor from the safe position specified in 3.2.11.2. The rotor shall move to the arm position as specified in 3.2.11.1.

4.5.20.6 Abort-safe position. Subject the S&A to a 7 (-1, +0) g acceleration field. Release the rotor from the safe position specified in 3.2.11.2. The rotor shall move to the abort-safe position as specified in 3.2.11.4.

4.5.21 Backout torque test. The backout torque test is performed by applying a backout torque equal to the maximum installation torque specified on the applicable assembly drawing for all screws retained in place by adhesives.

5. PACKAGING

5.1 Preservation, packaging and packing. Preservation, packaging and packing and identification shall be in accordance with 49CFR171-190 to afford protection from damage during shipment.

5.1.1 Level C. The level of protection shall be Level C in accordance with MIL-STD-794. The fuzes shall be packed in fiberboard cartons with fiberboard partitions.

5.1.2 Packing. Overpack the fiberboard cartons into a wooden box in accordance with MIL-B-2427, Type I, Class I, Grade C. Boxes will be closed and strapped per instructions contained in the Appendix of MIL-B-2427.

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T03:57Z
Check the source to verify that this is the current version before use.

5.1.3 Marking. Marking for shipment and storage shall be in accordance with MIL-STD-129.

6. NOTES

6.1 Intended use. The fuze covered by this specification is intended for use in the M258E6 warhead section of the Stinger missile.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of equipment designs for approval. See MIL-A-48078. Submit equipment designs, as required, to US Army Armament, Munitions and Chemical Command, ATTN: AMSMC-QAR-I, Dover, NJ 07801.

6.4 Drawings Drawings listed in Section 2 of this specification under the heading US Armament Research and Development Center (ARDC) may also include drawings prepared by, and identified as, US Army Armament Research and Development Command (ARRADCOM) or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDC.

6.5 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Custodian:
Army-AR

Preparing Activity:
Army-AR

(Project 1336-A508)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-F-48863C	FUZE, GUIDED MISSILE, M934E6 PARTS ASSEMBLY, LOADING AND PACKIN

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION (Mark one)
	☐ VENDOR ☐ USER ☐ MANUFACTURER ☐ OTHER (Specify): _____
b. ADDRESS (Street, City, State, ZIP Code)	

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER (Last, First, MI) – Optional	b. WORK TELEPHONE NUMBER (Include Area Code) – Optional
c. MAILING ADDRESS (Street, City, State, ZIP Code) – Optional	8. DATE OF SUBMISSION (YYMMDD)

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:57Z
Check the source to verify that this is the current version before use.