MIL-C-14939A (AR)
14 October 1977
SUPERSEDING
MIL-C-14939 (MU)
29 July 1968

MILITARY SPECIFICATION
CHARGE PROPELLING, 155MM, M119A1
LOADING, ASSEMBLING, AND PACKING

This specification is approved for use by US Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the loading, assembling and packing for one type of propelling charge designated as Charge, Propelling, 155MM, M119A1. (White Bag Charge 8)

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposals form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-B-45451 - Benite, Strands
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

DRAWINGS

ARRADCOM

PRODUCT AND PACKAGE DRAWINGS

FSC: 1320

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

9325852 - Charge, Propelling, 155MM, M119A1 (White Bag Charge 8)
9234356 - Packing and Marking for Container, Ammo, Metal: PA37A1 for Charge, Propelling 155MM, M119A1 for Howitzer.

3. REQUIREMENTS

3.1 Materials.-Materials shall be in accordance with applicable drawings and specifications.

3.2 Propelling Charge.-The propelling charge shall comply with all requirements specified in applicable specifications.

3.3 Moisture Content of Benite Strands.-The moisture content of the benite strands at the loading station at the time of loading shall not exceed the amount specified in MIL-B-45451.

3.4 Weights

3.4.1 Propellant Weight.-The propellant weight shall comply with the weight specified in the loading authorization within plus or minus 0.20 ounce.

3.4.2 Charge, Propelling Assembly Weight.-The charge, propelling assembly weight shall not differ by more than 1.0 ounce from the total of the amount specified in the loading authorization plus the actual weight of the ignition assembly and the actual or average weight of the flash reducer assembly, body assembly and lacing cord (see 6.8).

3.4.3 Ignition Assembly Weight.-(See 6.8).

3.4.3.1 Using Actual Weight of Tube.-The complete igniter assembly weight shall not differ by more than 0.15 ounce from the nominal CBI and benite weight plus the actual weight of the tube and cap, plus the actual or average weight of the base igniter assembly and the lacing jacket.

3.4.3.2 Using Average Weight of Tube.-The complete igniter assembly weight shall not differ by more than 0.30 ounce from the nominal CBI and benite weight plus the average tube and cap weight plus the actual or average weight of the base igniter assembly and the lacing jacket.

3.4.4 Flash Reducer Assembly Weight.-The flash reducer assembly weight shall not differ by more than 0.55 ounce from the nominal black powder and potassium sulfate weights plus the average weight of the flash reducer body assembly.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

3.5 Dimensional Gage

3.5.1 Maximum Length and Diameter.-The completed charge shall freely enter the prescribed gage. The gage shall be designed to inspect the maximum diameter and length. If the diameter feature is separate from the length feature, the diameter feature must extend approximately the full length of the charge.

3.6 Workmanship.-All components shall be free of dirt, grease and other foreign material. There shall be no discoloration or deterioration of cloth and no evidence of rips, tears, or other cloth defects. All work performed shall be performed in a thorough workmanlike manner.

3.7 Proving Ground (See 6.13).-The muzzle velocity, pressure, and velocity standard deviation shall be as specified in Table I.

TABLE I

Zone	Proj	Temp	Velocity (feet per second) Minimum	Velocity (feet per second) Maximum	Velocity Standard Deviation FPS	Individual Maximum Pressure PSI
Chg 8	M107	70°F	2220	2270	10.0	37,000
Chg 8	M107	145°F	(Differential Pressure)		-	41,000

3.8 Assembly Torque.-The test plug shall be assembled to withstand subsequent reapplication of the minimum assembly torque specified on the applicable drawing, without moving. (See 6.15)

3.9 Igniter Tubes.-All tubes shall be free of cracks, dents, creases, tears, flat areas and softness greater than 0.25 inch.

3.10 First Article Inspection.-This specification contains technical provisions for the first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.11 Ignition Assembly Alignment.-An approved method of centering the ignition assembly in the loaded body assembly will be utilized for all charges.

4. QUALITY ASSURANCE PROVISIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions.-Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of Inspections.-The following types of inspection shall be conducted on this item:

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First Article Inspection (See 6.11)

4.3.1 Submission.-The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with the provisions of 4.3.2. This sample shall consist of the following:

Part Description	Drawing	Quantity
Cap	9326128	5
Central Igniter Assembly	9325996	5
Jacket, Lacing	9326134	5
End, Base Igniter	9326132	5
Base Igniter Assembly	9326131	5
Base Igniter Loading Assembly	9326130	5
Base Igniter and Jacket Assembly	9326129	5
Ignition Assembly	9325995	5
Body	9326078	5
Body Assembly	9236077	5
Flash Reducer Assembly	9325977	5
Charge Loading Assembly	9325994	5
Charge Propelling, M119A1 (White Bag Chg 8) in Sealed Containers	9325852/ 9234356	10
Containerized Charge	9234356	10

4.3.2 Inspections to be Performed.-The First Article parts submitted in accordance with paragraph 4.3.1 will be subjected by the Government to any or all the requirements of the applicable drawings and specifications and to the inspections of Table II. All inspections listed in Table II shall be classified Major unless otherwise specified in referenced paragraphs and specifications.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTIONS

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 3	DRAWING NUMBER
	Propelling Charge Components and Assemblies		NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cap (Dwg. 9326128) Examination for Defects	5		3.2	4.4.2.1
	Central Igniter Assembly (Dwg. 9325996) Examination for Defects	5		3.2	4.4.2.2
	Jacket, Lacing (Dwg. 9326134) Examination for Defects	5		3.2	4.4.2.3
	End, Base Igniter (Dwg. 9326132) Examination for Defects	5		3.2	4.4.2.4
	Base Igniter Assembly (Dwg. 9326131) Examination for Defects	5		3.2	4.4.2.5
	Base Igniter Loading Assembly (Dwg. 9326130) Examination for Defects	5		3.2	4.4.2.6

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTIONS

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER
	CONTINUATION SHEET				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Base Igniter and Jacket Assembly (Dwg. 9326129) Examination for Defects	5		3.2	4.4.2.7
	Ignition Assembly (Dwg. 9325995) Examination for Defects	5		3.2	4.4.2.8
	Body (Dwg. 9326078) Examination for Defects	5		3.2	4.4.2.9
	Body Assembly (Dwg. 9326077) Examination for Defects	5		3.2	4.4.2.13
	Flash Reducer Assembly (Dwg. 9325977) Examination for Defects	5		3.2	4.4.2.16
	Charge Loading Assembly (Dwg. 9325994) Examination for Defects	5		3.2	4.4.2.17

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTIONS

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER
	CONTINUATION SHEET				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Charge Propelling, M119A1 (White Bag Chg 8) (Dwg. 9325852)				
	Examination for Defects (Note a)	(Note b)		3.2	4.4.2.19
	Sealed Container (Dwg. 9234356)				
	Examination for Defects	(Note b)		3.2	4.4.2.20/4.4.2.21/4.4.2.22
	Containerized Charge (Dwg. 9234356)				
	Examination for Defects	10		3.2	4.4.2.23

NOTES:
a. All defects except critical 2 and major defects 110 and 111.
b. Same ten samples for Sealed Container and Charge, Propelling, M119A1 (White Bag Chg 8)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

4.3.3 Rejection.- See MIL-A-48078.

4.4 Quality Conformance Inspection

4.4.1 Inspection Lot Formation.-Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of propelling charge assemblies shall contain:

a. Propellant from not more than one lot number from one manufacturer.

b. CBI from not more than one interfix number from one manufacturer.

c. Tubes from not more than one interfix number from one manufacturer.

d. Benite strands from not more than one interfix number from one manufacturer.

4.4.2 Examination.-See MIL-A-48078.

a. Sampling Plans.-Unless otherwise specified in the Classification of Defects and Tests Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. (See 6.4)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.1	Cap		9326128
			NEXT HIGHER ASSEMBLY
			9325996

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Thickness		0.65%	3.2	Gage
202	Width		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.2	Central Igniter Assembly		9325996
			NEXT HIGHER ASSEMBLY 9325994

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Tying strap missing, insecurely tied or improperly located		0.40%	3.2	Visual
102	Moisture content of Benite	(a)		3.3	4.5.3
103	Weight of Benite			3.2	4.5.1
104	Location of Benite		100%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES: (a) See paragraph 4.4.3.2

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.3	Jacket, Lacing		9326134
			NEXT HIGHER ASSEMBLY 9326129

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
102	Lacing cord missing or improperly assembled (2 locations)		0.40%	3.2	Visual-Manual
Minor					
201	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.6	Visual
203	Any seam improper or incompletely stitched		0.65%	3.2	Visual-Manual
204	Distance between rows		0.65%	3.2	Gage

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

11

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	End, Base Igniter				9326132
					NEXT HIGHER ASSEMBLY
					9326131 or 9326133
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
102	Diameter of base igniter end		0.40%	3.2	Gage
Minor					
201	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Base Igniter Assembly				9326131
					NEXT HIGHER ASSEMBLY
					9326130
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter of seam circle		0.40%	3.2	Scale
102	Location of tape (including location of seam)		100%	3.2	Gage
103	Concentricity of base igniter end to base igniter end and tape assembly		100%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326130
4.4.2.6	Base Igniter Loading Assembly				NEXT HIGHER ASSEMBLY 9326129
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly incorrect or damaged to the extent that CBI can escape (including any seams or openings incompletely stitched or broken threads)		100%	3.2	Visual-Manual
Major					
101	Weight of CBI		100%	3.2	4.5.1
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326129
4.4.2.7	Base Igniter and Jacket Assembly				NEXT HIGHER ASSEMBLY 9325995
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any seam incompletely stitched		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.8	Ignition Assembly				9325995
					NEXT HIGHER ASSEMBLY
					9325994
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly incorrect or damaged to the extent that CBI can escape (including any seams or openings incompletely stitched or broken stitches)		100%	3.2	Visual
Major					
101	Base igniter and jacket assembly improperly tied to tube; i.e., tape missing, loose, or incorrect (excluding length of tape after tying) (See Figure 1)		100%	3.2	Visual-Manual
102	Ignition assembly weight		100%	3.4.3	4.5.9
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.9	Body				9326078
					NEXT HIGHER ASSEMBLY
					9326077
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
102	Laminated Rayon cloth improper, improperly assembled, missing or improperly located		0.40%	3.2	Visual-Scale
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.10	Laminated Rayon Cloth				9326079
					NEXT HIGHER ASSEMBLY 9326078
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Established length		0.40%	3.2	Gage
102	Established width		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.11	End		9326081
			NEXT HIGHER ASSEMBLY 9326080

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Established length		0.65%	3.2	Scale
202	Established width of straight section		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326080
4.4.2.12	End Assembly				NEXT HIGHER ASSEMBLY 9326077
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Seam improper		0.40%	3.2	Visual-Manual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326077
4.4.2.13	Body Assembly				NEXT HIGHER ASSEMBLY 9325994
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	End assembly improperly assembled to body and liner assembly		0.40%	3.2	Visual
102	Any seam incompletely stitched		0.40%	3.2	Visual-Manual
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Flash Reducer Body				9325979
					NEXT HIGHER ASSEMBLY 9325978
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Outer diameter		0.65%	3.2	Gage
202	Inner diameter		0.65%	3.2	Gage
203	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.15	Flash Reducer Body Assembly		9325978
			NEXT HIGHER ASSEMBLY 9325977

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any seam incompletely stitched		0.40%	3.2	Visual
102	Location of seams, minimum		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

23

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
44.2.16	Flash Reducer Assembly	1 OF 1	9325977
			NEXT HIGHER ASSEMBLY 9325852

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any assembly damaged or improper to the extent black powder or potassium sulfate can escape.		100%	3.2	Visual-Manual
102	Flash reducer assembly weight		0.40%	3.4.4	4.5.12
103	Presence of black powder and potassium sulfate in flash reducer assembly.	(Note a)		3.2	Visual
104	Any seam incompletely sittched		0.40%	3.2	Visual
Minor					
201	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES: a. One sample per hour's production.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325994
4.4.2.17	Charge Loading Assembly				NEXT HIGHER ASSEMBLY 9325852
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Ignition assembly improperly tacked to body and end assembly		100%	3.2	Visual-Manual
102	Ignition assembly improper or damaged (including condition of tube immediately prior to insertion into body and end assembly)		100%	3.2/3.9	Visual-Manual
103	Propellant weight			3.4.1	4.5.2
104	Ignition assembly alignment			3.11	4.5.10
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.18	Strap		9325976
			NEXT HIGHER ASSEMBLY 9325852

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Length		0.65%	3.2	Scale
202	Width		0.65%	3.2	Scale
203	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 3		DRAWING NUMBER
4.4.2.19	Charge, Propelling, M119A1 (White Bag Chg 8)				9325852
					NEXT HIGHER ASSEMBLY –
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly damaged or improper to the extent that CBI can escape		100%	3.2	Visual-Manual
	Proving Ground				
2	Pressure	(a)		3.7	4.5.6
Major					
101	Base pad not in true position with respect to outer diameter of charge (to be determined after charge is laced)		100%	3.2	Gage
102	Dimensional gage failure (maximum length and diameter)		100%	3.5.1	Gage
103	Lacing missing, improper or insecure		100%	3.2	Visual-Manual
104	Igniter protector cap and strap missing or improperly assembled		0.40%	3.2	Visual
105	Propelling Charge assembly weight		100%	3.4.2	4.5.8

NOTES: (a) Pressure sampling will consist of monitoring pressure on differential pressure and muzzle velocity and muzzle velocity standard deviation samples.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER
44.2.19	CONTINUATION SHEET				9325852
					NEXT HIGHER ASSEMBLY –
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
106	Assembly damaged to the extent that propellant or potassium sulfate or black powder can escape (includes any seams or openings incompletely stitched and broken threads)		100%	3.2	Visual
107	Location of tube		100%	3.2	Gage (Note b)
108	Any component missing or improperly assembled (including flash reducer)		100%	3.2	Visual
109	Flash reducer tape loose, broken or insecurely tied or improperly located		0.40%	3.2	Visual-Manual

NOTES: b. During Teardown Inspection this inspection will be Visual for tube protruding from charge.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 3 OF 3	DRAWING NUMBER
4.4.2.19	CONTINUATION SHEET		9325852
			NEXT HIGHER ASSEMBLY
			-

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Proving Ground				
110	Muzzle velocity and muzzle velocity standard deviation	15		3.7	4.5.6
111	Differential Pressure (INFO)	10		3.7	4.5.6
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual
202	Location of lacing jacket		0.65%	3.2	Gage
203	Location of tube		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
44.2.20	Container, Prior to insertion of charge	1 OF 1	9234356
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Foreign matter or rust in container		100%	3.2	Visual
102	Bottom cushion missing		100%	3.2	Visual
103	Charge not tightly wrapped immediately prior to insertion into container (i.e., all charge full diameter points should be in contact with the wrapper).		0.40%	3.2	Visual
Minor					
201	Damaged container (to include dents protruding greater than 1/4" into container)		0.65%	3.2	Visual-Gage (see 6.4)

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE	SHEET 1 OF 2	DRAWING NUMBER
4.4.2.21	Container, Prior to Sealing		9234356
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Wrapper or long filler above top of charge (to be inspected with charge in container, except for one allowable torn long filler)		100%	3.2	Visual
102	Charge diametrically loose to the extent that a long filler may be inserted		100%	3.2	Manual
103	Any component missing or improper		100%	3.2	Visual
104	Dimension "X".		100%	3.2	Gage
105	Filler inserted in container prior to inserting top cushion		0.40%	3.2	Visual
106	More than five long fillers present		0.40%	3.2	Visual
107	Overlap of one long filler with another		0.40%	3.2	Visual
108	Charge cannot be removed by hand	(a)		3.2	4.5.11

NOTES: (a) One sample from eight (8) hours production.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 9234356
4.4.2.21	CONTINUATION SHEET				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
109 Minor	Top cushion incorrect type; i.e., cushion does not have hole None defined		0.40%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.22	Container, Sealed				9234356
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Test plug missing		100%	3.2	Visual
102	DOD symbol missing, misleading or unidentifiable (if applicable)		0.40%	3.2	Visual
103	Test plug assembly torque		0.40%	3.8	Test
104	Air pressure test		100%	3.2	4.5.4
Minor					
201	Test plug not greased (to be checked after air pressure test and prior to reassembly)		0.65%	3.2	Visual
202	Metallic seal missing or incorrectly applied		0.65%	3.2	Visual
203	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
204	Cover incompletely engaged		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-14939A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9234356
4.4.2.23	Containerized Charge				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Note (a)	Tear down Inspection	(b)		(c)	4.5.7

NOTES:

(a) Category is critical or major dependent upon the category of the defect inspected.
(b) See paragraph 4.4.3.1
(c) Requirement paragraph is dependent upon inspection performed.

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Teardown Inspection

4.4.3.1.1 Initial Lot Sampling.-In addition to 4.4.3.1.2, three completely assembled charges shall be randomly selected from each days production of the first production lot until three consecutive days production is found acceptable.

4.4.3.1.2 Subsequent lot sampling.-Thirty assembled charges shall be randomly selected from each lot. If there is a lapse in production in excess of ninety (90) days, sampling will return to initial lot sampling.

4.4.3.2 Moisture Content of Benite.-At least one sample of benite from each eight hours loading of central igniter assemblies will be tested for moisture content.

4.4.4 Inspection Equipment.-The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and paragraph 6.3 of this specification.

4.5 Test Methods and Procedures

4.5.1 CBI and Benite Weight

4.5.1.1 Weight of CBI in Base Igniter Loading Assembly.-The inspections below are to be conducted by inspection personnel using equipment designated for inspection purposes and shall be clearly distinguished from production operations. The weight of the CBI will be inspected 100 percent. The weight of the CBI in the basepad will be determined by subtracting an average weight of the empty assembly or the actual weight as marked on the individual assembly from the loaded assembly weight.

4.5.1.2 Weight of Benite Strands.-The inspections below are to be conducted using equipment designated for inspection purposes and shall be clearly distinguished from production operations. The weight of the benite strands will be inspected 100 percent prior to assembly to tube by subtracting the average weight of the tapes.

4.5.2 Propellant Weight (see 3.4) - The inspections below are to be conducted by inspection personnel using equipment designated for inspection purposes and shall be clearly distinguished from production operations. Any increment which fails

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

to comply with the applicable requirement shall be classed defective and removed from the lot. Inspection equipment shall be in accordance with 4.4.4.

4.5.2.1 Method 1 - The charge loading assemblies (without the ignition assembly) will be inspected 100 percent. The weight of the propellant will be determined by subtracting an average weight of the body assembly or the actual weight as marked on the individual body assembly from the loaded increment weight.

4.5.2.2 Method 2 - The weight of the propellant will be inspected 100 percent prior to loading the body assembly on a different balance. In addition, the propellant weight of the charge loading assemblies (without ignition assembly) will be inspected using a sampling plan from MIL-STD-105 or MIL-STD-1235 with an AQL of 0.40 percent. The weight of the propellant will be determined by subtracting an average weight of the body assembly or the actual weight as marked on the individual body assembly from the loaded increment weight.

4.5.3 Moisture Content of Benite Strands.-The moisture content of the benite will be determined in accordance with MIL-B-45451. If any sample fails to meet the specified requirement, the eight hours production represented by the sample shall be rejected.

4.5.4 Air Pressure Test.-Each container shall be tested as specified on the appropriate drawing. A pressure drop equivalent to 3 inches of water or greater shall be cause for rejection and removal from the lot.

4.5.5 Cloth.-At the time cloth is introduced to the sewing and/or cutting operation, an identification will be made for each roll to verify that proper material is used. Any cloth failing to be identified as proper material in accordance with applicable drawings and specifications shall be rejected from the lot.

4.5.6 Proving Ground (See 3.7).-This test shall be conducted at a Government Proving Ground in accordance with the applicable acceptance test procedure using M107, projectiles inert loaded within 0.1 pound of an as fired weight of 95.0 pounds using Primer, M82 and fired in cannon M199 or M185 with 95 percent (minimum) remaining life. Firing shall be conducted with a spindle to charge base stand-off of 1 inch (plus or minus 1/4 inch). Prior to firing, all charges shall be temperature conditioned at the required temperature (±2°F) for a minimum of 24 hours and assurance will be made that, when fired,

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

the charges are at the conditioning temperature. Copper crusher gages (2) shall be used to measure the maximum chamber pressure of each charge. Velocity coils will be used to measure the muzzle velocity of each charge. (see 6.6)

4.5.6.1 Muzzle Velocity and Muzzle Velocity Standard Deviation.-Determination of acceptance will be in accordance with MIL-STD-414, Section B, Table B3, AQL of 0.65%. All muzzle velocity and muzzle velocity standard deviation samples will be ballistic tested at 70°F. Fifteen (15) charges will be fired for muzzle velocity and muzzle velocity standard deviation. If the sample is determined unacceptable the lot will be rejected. In addition, if the velocity standard deviation of the sample multiplied by the factor 0.76 exceeds the applicable lot requirement, the lot shall be rejected. Fifteen (15) calibration charges will be fired alternately with the test samples and the muzzle velocity and pressure of all test charges will be corrected to standard conditions.

4.5.6.2 Differential Pressure.-Two pressure-time gages at different locations (one in the spindle and one at the projectile base) will be used to record pressure-time traces. Differential pressure traces will be obtained by subtracting the projectile gage output from the spindle gage output. The maximum differential pressure of any charge will be defined as the maximum amplitude of the first negative wave of the differential pressure trace. Any trace which contains no amplitude in the negative direction will be considered to have a maximum differential pressure of zero. Ignition delay will be recorded for information on all differential pressure firings. Ten (10) charges will be conditioned to 145°F for differential pressure firings. Five (5) calibration charges will be fired intermixed with the test samples and the muzzle velocity and pressure of all test charges shall be corrected to standard conditions.

4.5.6.3 Pressure.-If any propelling charge individual corrected maximum pressure exceeds the applicable requirement the lot shall be rejected.

4.5.7 Teardown Inspection.-Each container and propelling charge will be subjected to each of the critical (except critical defect 2., paragraph 4.4.2.18) and 100 percent major except major defects 102, 103 and 104, paragraph 4.4.2.2; major 102 and 103, paragraph 4.4.2.5; major defect 101, paragraph 4.4.2.6; major defect 101 and 102, paragraph 4.4.2.8; major defect 103, paragraph 4.4.2.17; major defects 101 and 105, paragraph 4.4.2.19; major defect 102 and 104, paragraph 4.4.2.21) inspections defined in 4.4.2 of this specification. Samples may be accumulated for one week's production, if

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

desired, prior to the actual inspection. Samples may be accumulated or inspected upon selection providing the selection remains random and represents the lot. The inspections will be performed by the contractor and witnessed by the Government. The detection of any one of the above defects shall be cause for rejection of the lot represented by the sample. (See 6.7)

4.5.8 Charge, Propelling, Assembly Weight.-The actual weights as marked on the individual ignition assembly and body assembly plus the average or actual weight of the flash reducer plus weight of the lacing cord together with the nominal propellant weight as specified in the loading authorization shall be subtracted from the assembled charge, propelling, assembly weight. If the resulting weight deviation is greater than the requirement, the propelling charge will be classified defective and removed from the lot. (See 6.9)

4.5.9 Ignition Assembly Weight

4.5.9.1 Method 1 - The actual weight of the tube and average weight of the cap along with the average weight of the base igniter assembly or the actual weight as marked on the individual base igniter assembly plus the average weight of the lacing jacket or the actual weight of the lacing jacket shall be recorded for each ignition assembly. These weights along with the nominal weights of CBI and benite shall be subtracted from the ignition assembly weight. If the resulting weight deviation is greater than the requirement, the ignition assembly will be classified defective and removed from the lot. (See 6.10.1)

4.5.9.2 Method 2 - The average weight of the base igniter assembly or the actual weight as marked on the individual base igniter assembly plus the average weight of the lacing jacket or the actual weight of the lacing jacket shall be recorded for each ignition assembly. These weights along with the nominal weights of CBI and benite shall be subtracted from the ignition assembly weight. If the resulting weight deviation is greater than the requirement, the ignition assembly will be classified defective and removed from the lot. (See 6.10.2)

4.5.10 Ignition Assembly Alignment.-Each ignition assembly shall be assembled to the loaded body assembly utilizing an approved method of assuring alignment between the igniter tube and the outer diameter of the increment assembly. The method to be used during production is to be established by the contractor and approved by the government. (See 6.12)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

4.5.11 Charge Removal from Container.-Each sample shall be tested for removal of the propelling charge from the container by hand. The charge may be pulled out by the tying straps or the container may be inverted and the charge either pulled out or slid out. Each charge tested shall be checked for damage to the tying straps (looseness, tears, etc.) and the charge will be repaired (retie the tying straps if necessary). Each charge tested shall be rewrapped (may use the same wrapper if the wrapper is not badly damaged) and re-packed in accordance with this specification and the applicable drawings. Any charge that cannot be removed from the container using the above method shall be cause for rejection of the production represented by the sample.

4.5.12 Flash Reducer Assembly Weight.-The inspection below is to be conducted by inspection personnel using equipment designated for inspection purposes and shall be clearly distinguished from production operations. The weight deviation will be determined by subtracting the average flash reducer body assembly weight plus the nominal black powder and potassium sulfate weights from the flash reducer assembly weight.

5. PREPARATION FOR DELIVERY

5.1 Packing and Marking.-The propelling charges shall be packed, sealed, tested, and marked in accordance with the specified requirements of drawing 9234356.

6. NOTES

6.1 Intended Use.-The propelling charges covered by this specification are intended for use in the 155MM Howitzers, M198 and M109A1.

6.2 Ordering Data.-See MIL-A-48078.

6.3 Submission of Designs for Approval.-See 6.2.3 of MIL-A 48078. Submit equipment designs, as required, to Commander, US Army Armament Research and Development Command, Attn: DRDAR-QAR-I, Dover, New Jersey 07801.

6.4 Visual Examination Qualification.-When compliance with the applicable requirement is in doubt as a result of visual examination the characteristic may be measured or gaged to determine acceptability.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

6.5 Inspection Lot Size.-It is noted that the size of inspection lots of components, assemblies, or items of delivery may differ from the actual quantities contractually scheduled for delivery. However, in order to facilitate scheduling of tests or deliveries, inspection lots of items of delivery may be equivalent to such contract quantities provided all of the lot formation criteria and sampling provisions of this specification are maintained.

6.6 Proving Ground.-A copy of all proving ground data should be submitted to Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-Q and DRDAR-LCU-EP, Dover, New Jersey 07801.

6.7 Teardown Inspection.-A list of all defects found during teardown inspection shall be submitted to Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-Q, Dover, New Jersey 07801.

6.8 Charge, Propelling Assembly Weight and Ignition Assembly Weight.-This requirement applies to the load plant at the time of loading only. Due to subsequent change in weight of the components because of variation in material and moisture content, this test cannot be repeated after initial manufacture to the degree of accuracy required.

6.9 Charge, Propelling, Assembly Weight.-

Weights To Be Determined		Assembly Drawing Number
Actual Weight of Ignition Assembly	-	9325995
Average/Actual Weight of Flash Reducer Assembly	-	9325977
Average/Actual Weight of Body Assembly	-	9326077
Average Weight of Lacing Cord	-	9325852
Nominal Propellant Weight	-	Loading Authorization
Component weight (sum of above weights)		

The propelling charge assembly weight minus the component weight equals the "weight deviation".

6.10 Ignition Assembly Weight

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

6.10.1 Method 1.-

Weights To Be Determined		Assembly Drawing Number
Actual Weight of Tube	-	9?25882
Average/Actual Weight of Base Igniter Assembly	-	9326131
Average/Actual Weight of Lacing Jacket	-	9326134
Average Weight of Cap	-	9326128
Nominal Weight of CBI	-	9326130
Nominal Weight of Benite	-	9325996
Component Weight (sum of above weights)		

The ignition assembly weight minus the component weight equals the "weight deviation".

6.10.2 Method 2.-

Weights To Be Determined		Assembly Drawing Number
Nominal Weight of Tube	-	See MIL-I-48252
Average/Actual Weight of Base Igniter Assembly	-	9326131
Average/Actual Weight of Lacing Jacket Assembly	-	9326134
Average Weight of Cap	-	9386128
Nominal Weights of CBI	-	9326130
Nominal Weight of Benite	-	9325996
Component Weight (sum of above weights)		

The ignition assembly weight minus the component weight equals the "weight deviation".

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

6.11 First Article Inspection Procedure.-Sample propelling charges shall be submitted to: Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAM, Dover, New Jersey 07801, upon implementation of this military specification for those items procured for the U.S. Army.

6.12 Method of Assuring Alignment Submission.-The method for assuring alignment of the ignition assembly shall be submitted to Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-Q, Dover, New Jersey 07801, for approval.

6.13 Proving Ground Summary (see 4.5.6).-

Temp	Sample Size	Number of Ref Rounds	Velocity	Maximum Individual Pressure	Differential Pressure
70°F	15	15	*	37,000	NA
145°F	10	5	INFO	41,000	INFO

* See 4.5.6.1 and 3.7.

6.14 Data Cards.-A copy of all data cards should be submitted to Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-Q, Dover, New Jersey 07801.


6.15 Assembly Torque.-The assembly torque of the test plug will apply at time of loading only due to the relaxation of the gasket material.

Custodian:
Army-AR

Preparing Activity:
Army-AR

Project Number: 1320-A-389

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.

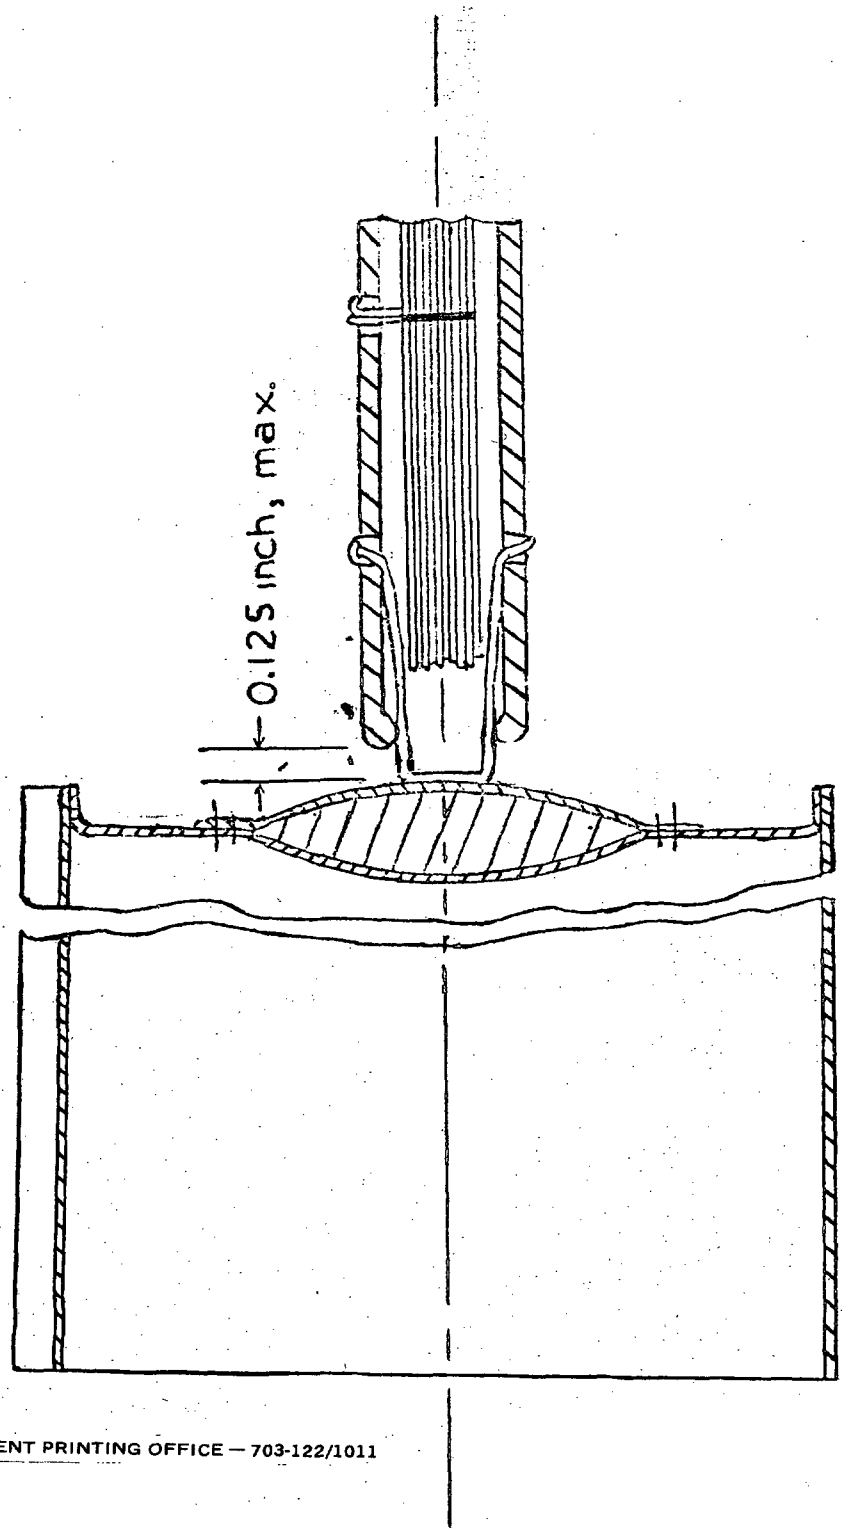

IGNITION ASSEMBLY

★U.S. GOVERNMENT PRINTING OFFICE — 703-122/1011

FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:09Z
Check the source to verify that this is the current version before use.