INCH-POUND

MIL-B-43154K
AMENDMENT 1
15 September 1989

MILITARY SPECIFICATION

BOOTS, HOT WEATHER

This amendment forms a part of Military Specification MIL-B-43154K, dated 16 May 1988, and is approved for use by all Departments and Agencies of the Department of Defense.

PAGE 2

2.1.1, under "SPECIFICATIONS MILITARY": Add "MIL-C-43734 - Cloth, Duck, Textured Nylon"

Delete "MIL-A-8625 - Anodic Coatings, for Aluminum and Aluminum Alloys"

PAGE 3

2.1.2, lines 9 to 11: Delete and add the following:

"2-1-1635 - Speed Lace Assembly

(Copies of drawings are available from the U.S. Army Natick Research, Development, and Engineering Center, ATTN: STRNC-EMSS, Natick, MA 01760-5014.)"

PAGE 5

3.3.2.1: Delete and substitute:

3.3.2.1 Nylon duck. The cloth for the quarters and gussets shall be nylon duck conforming to class 1 of MIL-C-43734, except that the color shall be Black 375 and the air permeability requirement shall not apply. The nylon duck cloth may be treated with a non-fray, non-stiffening finish to facilitate cutting and handling."

3.3.2.2: Delete and substitute:

"3.3.2.2 Backseam tape. The tape shall conform to type 1, class 3, 1/2 or 17/32 inch wide of DDD-T-86. The color shall be Black 375."

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:48Z
Check the source to verify that this is the current version before use.

PAGE 5 (cont'd)

3.3.2.3 Delete and substitute:

"3.3.2.3 Box toes. The box toe material shall be a laminate of 0.020 ± 0.002 inch virgin ionomer resin (Surlyn) sandwiched between two layers of non-woven polyester saturated with polystyrene. The total thickness shall be 0.056 ± 0.005 inch. The box toes shall be cut to the patterns provided and shall be skived 3/8 ± 1/8 inch wide at breast. Testing shall be as specified in 4.4.1."

PAGE 6

3.3.2.5, line 3: Delete "Olive Green 106" and substitute "Black 375".

3.3.2.6, line 5: Delete "Olive Green 106" and substitute "Black 375".

3.3.3.1, under "Steel shank": Delete the second sentence and substitute "The width of the shank shall be 1 ± 1/32 inch, or as an alternate for boot sizes 3 - 6-1/2 all widths, the shank width may be 5/8 ± 1/32 inch."

PAGE 7

3.3.3.3: Delete and substitute:

"3.3.3.3 Eyelets. The eyelets shall be gloss finish nylon coated brass conforming to commercial size AA."

3.3.3.3.1: Delete.

PAGE 8

Add the following new paragraphs:

"3.3.3.4.2.2 Finish of drainage eyelets. The drainage eyelets shall have a black oxide finish."

3.3.3.6 Speed lace assembly. The speed lace assembly shall be of two-piece construction consisting of gloss finish nylon coated brass speed lacer and nylon coated alternate full tubular rivet in accordance with Drawing 2-1-1635."

PAGE 9

3.3.5.1, line 4: Add "and 308" after "301".

3.3.6.1, Table IV, Opposite "Thickness", under columns "A" through "D": Delete "9/16" and substitute "19/32".

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:48Z
Check the source to verify that this is the current version before use.

PAGE 10

3.3.6.3, line 2: Add "and figure 4" to end of sentence.

3.3.6.4: Delete and substitute:

"3.3.6.4 Laces. The laces shall conform to type III, class 3 of V-L-61. The color of the laces shall be black. The length of the laces shall be a minimum of 66 inches for all sizes.

3.3.6.5, line 2: Delete "type II" and substitute "type I".

3.4: Delete and substitute:

"3.4 Design. The design shall be for a partial speed lace closure, blucher pattern boot with integral steel sole plate and removable ventilating insole. The leather areas on the outside of the boot shall have the grain surface exposed. The boot shall have a nylon cloth quarter with nylon webbing for backstay, top stay, and ankle reinforcements. The vamp shall be plain with a surlyn box toe. The outersole design shall be bars and cleats."

PAGES 10 and 11

3.5: Delete the fifth sentence.

PAGE 11

Table V: after "Vamp," under "Component parts", Delete: "full toe with nicks for box toe replacement".

PAGE 12

3.7.1.2: Delete and substitute:

"3.7.1.2 Cutting nylon duck uppers. The nylon duck quarters shall be cut in the warp direction as indicated in figure 2. The nylon duck gusset may be cut in the warp, filling, or bias direction. The nylon duck cloth may be treated with a non-fray, non-stiffening finish to facilitate cutting and handling."

Add the following new paragraph:

"3.7.2.1 Finishing leather parts. All exposed leather raw edges shall be stained black using materials specified in 3.3.6.6.3."

Source: https://assist.dla.mil -- Downloaded: 202610-21T20:48Z
Check the source to verify that this is the currentversion before use.

3.7.5.1: Delete sentences 7 & 8 and substitute: "The nylon duck quarters shall be closed at the back from top to bottom using seam type FSa-1 with a 3/8 ± 1/16 inch wide zig-zag stitch type 308, with 9 to 11 stitches per inch. This seam shall be rubbed down and reinforced with stitched tape on the inside of the quarters covering the zig-zag stitching."

3.7.5.2, lines 1 and 2: Delete "and cotton".

3.7.6: Delete and substitute:

"3.7.6 Vamping and barring. Vamping shall be done with two rows of stitching (single or double needle) close on the edge of the front edge stay, plus two rows spaced approximately 3/16 inch between inside rows. There shall be two single or double bar rows 5/8 ± 1/16 inch in length at each blucher ear. The bar row shall be placed outside and above vamping by 1/16 to 1/8 inch and parallel to the vamping row at blucher point. This barring may be done by the automatic method with tying or locking ends."

Add the following new paragraphs:

"3.7.6.1 Inserting drainage outlets. Two drainage eyelets, as specified in 3.3.3.4.1, shall be inserted through the vamp lining on the inside shank of each boot and shall be located just above the insole on the finished boot. Two washers, as specified in 3.3.3.4.2 shall be used to clinch each drainage eyelet. The drainage eyelet shall be inserted with the flat side (perforated) on the grain side of the leather and the cup side innermost. The hole in the vamp through which the drainage eyelet is inserted shall be no more than 7/32 inch in diameter. As an alternative, two drainage washers, as specified in 3.3.3.4.2.1, shall be inserted through the vamp lining on the inside of each boot and shall be located just above the insole on the finished boot. One drainage eyelet, as specified in 3.3.3.4.1.1, shall be used to clinch each drainage washer. The drainage washer shall be inserted in the innermost side of the vamp and the drainage eyelet (perforated) on the grain side of the leather. The hole in the vamp through which the drainage washer is inserted shall be not more than 9/32 inch in diameter.

3.7.6.2 Attaching speed lace assembly and eyeletting. On each quarter, there shall be two nylon coated double A eyelets for all sizes spaced evenly from blucher nose to the first speed lace loop. The edge of each eyelet shall be 3/16 to 5/16 inch from the edge of the quarter. For sizes 3 through 6-1/2, there shall be four speed lace loops equally spaced on each quarter above the eyelets, five speed lace loops for sizes 7 through 11-1/2, and six speed lace loops for sizes 12 through 14. The speed lace loops shall be placed perpendicular to the edge of the quarters and parallel to each other, and shall be securely riveted 1/4 ± 1/32 inch from the center of the rivet to the edge of the quarter."

Source: https://assist.dla.mil -- Downloaded: 202640-21T20:48Z
Check the source to verify that this is the current version before use.

PAGE 16

3.7.7: Delete and substitute:

"3.7.7 Lacing for lasting. The machine lacing shall provide for an opening after lasting of 3/4 ± 1/8 inch. The quarter shall be laced in the two lower pairs of eyelets."

PAGE 17

3.7.9, line 20: Delete "pyroxylin or polystyrene type".

3.7.10, Add: "As an alternate, the use of a heat setting machine may be used to thoroughly dry the counters and uppers. (The heat setting time shall be approved by the contracting officer.)"

PAGE 20

3.7.22: Delete and substitute:

"3.7.22 Instruction tags. Instruction tags to be tied to the finished boots shall be printed using the data specified on figures 1 and 4."

PAGE 26

Table VIII: Opposite "Eyelets": Delete the following characteristics and all information related thereto:

"Outside diameter of flange and barrel",
"Diameter of hole",
"Overall length",
"Thickness".

PAGE 28

Table VIII: Add the following in their respective columns:

"Speed lace loops	Material identification"	3.3.3.6	1/	- - - - - -

PAGE 34

Table XII, under "Examine" column for "Upper leather", Opposite "Defect" for "Fat wrinkles, flanky leather, or veins", Delete: "Major" classification and substitute "*".

PAGE 35

Table XII, under "Examine": Delete "Nylon and cotton quarter and gusset" and substitute "Nylon quarter and gusset".

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:48Z
Check the source to verify that this is the current version before use.

PAGE 36

Table XII, under "Examine" column foir "Vamp stitching at outersole junction", Opposite "Defect" for "More than the specified maximum number of stitches", Delete: "Major" classification and substitute "*".

PAGE 39

Table XII: Add the following to the indicated columns:

Examine	Defect	Classification Major	Minor
Speed laces	Number of speed lace loops not as specified but each row has the same number.		X
	Not the same number of loops in each row.	X	
	Loops not properly spaced within the row or misaligned between the rows to an extent interfering with proper lacing.	*	
	Loops not perpendicular to edge of quarters or parallel to each other.		X
	Any loop not securely riveted.	X	
	Distance from center of rivet to edge of quarter less than 7/32 or more than 9/32 inch.	*	
	Four splits in rivet clinch roll.		X
	Five or more splits in rivet clinch roll.	X	
Color and finish	Any raw edges not stained to match upper leather.		X

PAGE 48

Figure 1: 2. Sizes., line 2: Delete "3R and 3 1/2" and substitute "3R and 3-1/2R".

Instruction 3: Delete and substitute:

"3. Pull on boots, seating heel firmly into place, then lace. Boots should fit snugly but not tightly. There should be approximately 1/2 inch additional length at toe."

PAGE 51

Add new figure 4.

Source: https://assist.dla.mil -- Downloaded: 202640-21T20:48Z
Check the source to verify that this is the current version before use.

Custodians:
Army - GL
Navy - NU
Air Force - 99

Review activities:
Army - MD
Navy - MC
Air Force - 82
DLA - CT


User activity:
Air Force - 45

Preparing activity:
Army - GL

(Project 8430-0388)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:48Z
Check the source to verify that this is the current version before use.


THE FOLLOWING ARE LACING
INSTRUCTIONS FOR SPEED LACES

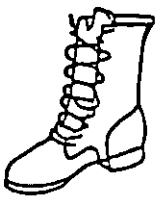


STEP 1
After first lacing through all loops and securing the end of each lace with a hard knot, loosen up lace for easy step-in of foot.



STEP 2
With thumbs on either edge remove all pleats and wrinkles by pushing gusset securely around leg.

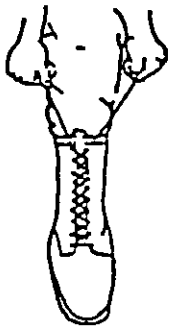

STEP 3
Hold lace ends from pre-tied knots, pull up lace to desired tightness

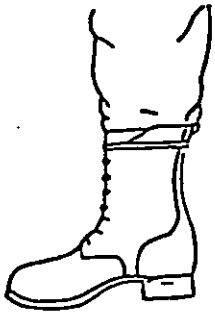

STEP 4
Wrap extra lace length around collar and secure

FIGURE 4

Source: https://assist.dla.mil -- Downloaded: 202610-21T20:48Z
Check the source to verify that this is the current version before use.