MIL-L-60004A (MU)
13 June 1966
SUPERSEDING
MIL-L-60004 (MU)
13 November 1963

MILITARY SPECIFICATION

LAUNCHER FOR ROCKET, HE, 66MM, ANTI-TANK, M72 ASSEMBLY AND PACKING

1. SCOPE

1.1 This specification covers special requirements not normally required by the drawings and provides the quality assurance provisions for the fabrication of parts, assembly and packing of one type of rocket launcher designated as Launcher, Rocket, 66MM, AT, M72 for use in Rocket, HE, 66MM, Anti-Tank, M72 and Rocket, Practice, 66MM, Anti-Tank, M--.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids form a part of this specification to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-A-2550	- Ammunition and Special Weapons; General Specification for.
MIL-D-45608	- Designs and Drawings, Ordnance Inspection Equipment.
MIL-I-45607	- Inspection Equipment, Supply and Maintenance of.
MIL-P-10025	- Packaging, Packing, and Marking for Interplant Shipment of Inert Ammunition Components; General Specification for.

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-109	- Quality Assurance Terms and Definitions
MIL-STD-1167	- Ammunition Data Cards.

FSC: 1340

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

MIL-STD-1168 - Lot Numbering of Ammunition.
MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes.

DRAWINGS

ORDNANCE CORPS

10048501 - Launcher, Rocket, 66MM, AT, M72.

PUBLICATIONS

ORDNANCE CORPS

IEL-10048501 - Index of Inspection Equipment Lists.

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with applicable drawings and specifications.

3.2 Launcher. - The launcher shall comply with all requirements specified on Drawing (dwg.) 10048501 and with all requirements specified in applicable specifications.

3.3 Spring embrittlement. - Springs used in the launcher assembly shall be free from hydrogen embrittlement as evidenced by not breaking when extended to the point of minimum permanent distortion.

3.4 Operability of launcher. - The complete launcher assembly shall extend fully and the detent shall lock the inner tube in place when a force of 35 pounds maximum is used to extend the launcher. With the launcher fully extended the sights shall be fully erect and no part shall be missing, loose or damaged.

3.5 Trigger action

3.5.1 Safe position (non-functioning). - With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle in the "SAFE" position, the trigger mechanism shall not release the firing pin when a force of 15 pounds, minimum is applied to the trigger as specified in 4.4.6.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

3.5.2 Release position (non-functioning). - With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle extended to the "RELEASE" position, the trigger mechanism shall not release the firing pin when a force of 3 pounds, minimum, is applied to the trigger as specified in 4.4.6.2.

3.5.3 Functioning of the trigger mechanism. - With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle extended to the "RELEASE" position, the trigger mechanism shall release the firing pin when a force of 15 pounds, maximum, is applied to the trigger as specified in 4.4.6.3.

3.6 Functioning of the firing pin assembly.

3.6.1 Safety pin non-withdrawal (launcher extended position) With the launcher in the extended position and the trigger mechanism cocked, the safety pin shall not be withdrawn when a withdrawal force of 1.25 pounds minimum is applied as specified in 4.4.7.1.

3.6.2 Primer impact. - The firing pin shall impact within the inscribed circle of the test slug (see Figure I) when tested as specified in 4.4.7.2.

3.6.3 Firing pin recovery. - With the launcher in the fully closed and vertical, rearward end up position, the firing pin shall be under sufficient spring load to return to a position that will provide an interference fit with the inserted safety pin, when the firing pin spring is compressed and released. This position is evidenced by the firing pin point returning to a position of 0.817 inches maximum from the firing pin housing cover seating surface.

3.6.4 Safety pin insertion. - The safety pin when fully inserted in the launcher shall obstruct the entry of the firing pin point into the igniter cavity. The safety pin shall be fully inserted as is evidenced by a dimension of 0.263 inches maximum between the surface of the firing pin housing and the top of the safety pin immediately prior to the performance of the safety pin non-withdrawal test.

3.6.5 Safety pin non-withdrawal (launcher closed position). - The safety pin shall be incapable of being withdrawn when the launcher is positioned in a vertical, forward end down position and a withdrawal force of 25 pounds minimum, is applied without impact, in a direction parallel to the longitudinal axis of the pin as specified in 4.4.7.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

3.7 Waterproofness. - The firing pin housing and the trigger housing in the closed launcher, less sling, shall be waterproof as evidenced by a maximum increase in pressure of 0.67 pounds per square inch when a pressure of 13.375 pounds per square inch absolute, maximum is applied to the firing pin housing and isolated for 5 seconds, minimum.

3.8 Workmanship. - All parts, subassemblies and assemblies, shall be fabricated and finished in a thorough, workmanlike manner. They shall be free of burrs, chips, sharp edges, cracks, unblended radii, surface defects, dirt, grease, rust, corrosion products and other foreign matter that may impair proper functioning of the launcher or that may cause premature functioning or deterioration in storage. The cleaning method shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agent used. Painted or coated surfaces shall be restored when these surfaces have been marred or scratched. All required markings shall be neat, clean, and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 General quality assurance provisions.-Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, the supplier may utilize his own facilities or any commercial laboratory acceptable to the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to Standard MIL-STD-109 in order to define terms used herein. The provisions of Specification MIL-A-2550 shall apply.

4.1.1 Submission of product.-At the time the completed lot of product is submitted to the Government for acceptance the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the qualit assurance provisions specified within this specification.

b. Number of units of product inspected.

c. Results obtained, by defect code, for all inspections performed.

d. Drawing, specification number and date, together with an identification and date of changes.

e. Certificates of conformance on all material purchased by the contractor when such material is controlled by Government or commercial specifications referenced in any of the contractual documents.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

f. Number of items in the lot.
g. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.1.2 Government verification.-Using the contractor's written quality assurance procedure, this detailed specification, the applicable drawings and other contractual documents as a guide, the Government inspector shall verify at unscheduled intervals all quality assurance operations performed by the contractor. Verification will be performed to the extent necessary to assure compliance with the contractual requirements. Severity of Government inspection of individual characteristics will be directly related to the seriousness of the classification assigned. In no instance will a characteristic classified "critical" be accepted solely on the basis of the contractor's records.

4.2 Initial production inspection.

4.2.1 Submission. - Prior to the start of regular production, the contractor shall submit an initial production sample to a Government approved facility as designated by the Contracting Officer (see 6.4) for evaluation in accordance with the provisions of 4.2.2 and testing in accordance with 4.3.3. The initial production sample shall consist of ten (10) complete launchers, ten (10) complete sets of parts (i.e. 10 each of every component and every subassembly) which have been produced by the contractor or furnished by a supplier and which have been manufactured using the same production processes, procedures and equipment which will be used in fulfilling the contract. All parts and materials including packaging and packing, shall be obtained from the same source of supply as will be used in regular production. The sample shall be accompanied by certificates of conformance for materials. An initial production sample, or portion thereof, as directed by the Contracting Officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days, or whenever a change occurs in manufacturing process, material used, drawing, specification, or source of supply as to significantly affect product uniformity as determined by the Government. Prior to submission, the contractor shall inspect the sample to the degree necessary to assure that it conforms to the requirements of the contract and submit a record of his inspection with the sample. A sample containing known defects will not be submitted unless specifically authorized by the Contracting Officer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.2.2 Inspections to be performed. - Every component subassembly and assembly shall be inspected by the Government for every applicable drawing dimension and requirement and for all examinations specified in 4.3.2 and tested as required in 4.3.3. Destructive test specified in 4.3.3.3.2 shall be performed only after the outer tubes have been inspected and examined for all other characteristics.

4.2.3 Rejection of initial production sample. - The initial production sample shall be rejected if any subassembly or assembly fails to conform to the applicable requirements. The Government reserves the right to terminate its inspection upon observing any non-conformance of the sample to the specified requirements. In the event of rejection, the Government reserves the right to require the contractor to take corrective action and submit a new initial production sample or portion thereof. Until an initial production sample is accepted, the contractor is in no way authorized by the Government to initiate regular production (including procurement of materials by the contractor) unless otherwise directed by the Contracting Officer.

4.3 Inspection provisions.

4.3.1 Lot formation. - The term "lot" as used throughout this specification refers to an inspection lot, which is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance of the lot with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the lot has been produced by one manufacturer, in one unchanged process, in accordance with the same drawing, specification, or revision thereof. Changes to either the process, specification, or drawing not affecting safety, performance, interchangeability, or storage, as determined by the Government inspector, shall not be deemed to alter the homogeneity of the lot. Inspection lots shall comply with MIL-STD-105 and shall be numbered in accordance with MIL-STD-1168.

Unless otherwise approved by the contracting officer, the inspection lot size of major assemblies or end items deliverable under the contract shall be not less than the smallest weekly estimate of quantities contractually scheduled for production during the contract period nor more than the largest quantity contractually scheduled for delivery during any month of the contract period. Inspection lots for components or sub-assemblies, other than the items of delivery, shall be homogeneous and of a size convenient to the contractor.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2 Examination. - Sampling plans and procedures for the following classifications of defects shall be in accordance with Standard MIL-STD-105 except that inspection for critical defects, when listed, shall be 100 percent. Continuous sampling plans in accordance with Standard MIL-STD-1235 may be used if approved by the procuring activity. Also, at the option of the procuring activity, AQL's and sampling plans may be applied to the individual characteristics listed using an AQL of 0.40 percent for each major defect and an AQL of 0.65 percent for each minor defect. Once agreement has been reached as to which method will be used (group or individual) that method will be used for all of the CD's listed in this specification. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.3.4.

4.3.2.1 Spring, detent (see dwg. 10048752 covering a detail of dwg. 10048686).

Categories	Defects	Method of Inspection	Code No. (see 6.2)
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Load at compressed lengths	Gage	01001
102.	Protective finish incomplete or inadequate	Visual	01002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	01003

4.3.2.2 Detent (see dwg. 10048695 covering a detail of dwg. 10048692).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Length to shoulder, minimum (min.)	Gage	02001
102.	Protective finish incomplete or inadequate	Visual	02002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	02003

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.3 Detent lever assembly (see dwg. 10048692 covering a detail of dwg. 10048686).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Component missing or insecure	Visual/Manual	03001
102.	Protective finish incomplete or inadequate	Visual	03002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	03003

4.3.2.4 Pin, pull (see dwg. 10048758 covering a detail of dwg. 10048757).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Diameter of wire	Gage	04001
102.	Protective finish incomplete or inadequate	Visual	04002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	04003

4.3.2.5 Pin, safety (see dwg. 10048573 covering a detail of dwg. 10048609).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Profile of "O" ring flange	Gage	05001
102.	Protective finish incomplete or inadequate	Visual	05002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	05003

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.6 Cover, housing, pin, firing (see dwg. 10048769 covering a detail of dwg. 10048774).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Diameter of screw holes	Gage	06001
102.	Location of screw holes	Gage	06002
103.	Diameter of pull pin hole	Gage	06003
104.	Location of pull pin hole	Gage	06004
105.	Protective finish incomplete or inadequate	Visual	06005
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	06006

4.3.2.7 Rear cover firing pin housing (see dwg. 10048774 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Assembly incomplete or incorrect	Visual	07001
102.	Protective finish incomplete or inadequate	Visual	07002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	07003

4.3.2.8 Bracket, fulcrum, sight, rear (see dwg. 10048558 covering a detail of dwg. 10048716).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Diameter of fulcrum holes, maximum (max)	Gage	08001

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the currentversion before use.

Categories	Defects	Method of Inspection	Code No.
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	08002

4.3.2.9 Bracket, sight, rear (see dwg. 10048553 covering a detail of dwg. 10048699).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Diameter of fulcrum holes, max.....	Gage	09001
102.	Marking incorrect, incomplete or illegible.....	Visual	09002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	09003

4.3.2.10 Plate, adjustment, sight, rear (see dwg. 10048551 covering a detail of dwg. 10048699).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Diameter of peep holes, max...	Gage	10001
102.	Distance between peep holes...	Gage	10002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	10003

4.3.2.11 Spring, sight, rear (see dwg. 10048739 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Major:	AQL 0.65 percent		
101.	Torque test failure	Gage	11001
102.	Diameter of wire	Gage	11002
103.	Inside diameter of coil, min.	Gage	11003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	11004

4.3.2.12 Front sight and ears assembly (see dwg. 10048655 covering a detail of dwg. 10048608).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Perpendicularity of sight with holes in ears	Gage	12002
102.	Rivets loose	Manual	12003
103.	Component damaged	Visual	12004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	12005

4.3.2.13 Spring, sight, front (see dwg. 10048653 covering a detail of dwg. 10048608).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Torque test failure	Test	13001
102.	Diameter of wire	Gage	13002
103.	Total number of coils	Visual	13003
104.	Protective finish incomplete or inadequate	Visual	13004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	13005

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.14 Bracket, sight, front (see dwg. 10048678 covering a detail of dwg. 10048651).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Diameter of pivot pin holes, max.	Gage	14001
102.	Diameter of rivet holes, max.	Gage	14002
103.	Protective finish incomplete or inadequate	Visual	14003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)		14004

4.3.2.15 Clamp, sight, front (see dwg. 10048650 covering a detail of dwg. 10048651).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Diameter of rivet holes, max.	Gage	15001
102.	Protective finish incomplete or inadequate	Visual	15002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8),	Visual	15003

4.3.2.16 Front sight clamp assembly (see dwg. 10048651 covering a detail of dwg. 10048608).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Rivets loose	Manual	16001
102.	Rivets above flush with inside surface	Visual	16002

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	16003

4.3.2.17 Front sight assembly (see dwg. 10048608 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Pivot pin loose.....	Manual	17001
102.	Component damaged.....	Visual	17002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	17003

4.3.2.18 Stop, idler (see dwg. 10048561 covering a detail of dwg. 10048754).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Profile of angle on forward edge.....	Gage	19001
102.	Protective finish incomplete or inadequate.....	Visual	19002
103.	Cracked or distorted.....	Visual	19003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	19004

4.3.2.19 Spring, stop, idler (see dwg. 10048700 covering a detail of dwg. 10048716).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the currentversion before use.

Categories	Defects	Method of Inspection	Code No
Major:	AQL 0.65 percent		
101.	Profile	Gage	20001
102.	Thickness, min	Gage	20002
103.	Protective finish incomplete or inadequate	Visual	20003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	20004

4.3.2.20 Safety, trigger (see dwg. 10048732 covering a detail of dwg. 10048713)

Categories	Defects	Method of Inspection	Code No
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Height to upper surface at handle end, max	Gage	21001
102.	Height of end opposite to handle end	Gage	21002
103.	Total length, min	Gage	21003
104.	Profile of cutout	Gage	21004
105.	Protective finish incomplete or inadequate	Visual	21005
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	21006

4.3.2.21 Trigger safety assembly (see dwg. 10048713 covering a detail of dwg. 10048716).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Component loose	Visual	22001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	22002

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the currentversion before use.

4.3.2.22 Pin, spring, latch, recocking (see dwg. 10048720 covering a detail of dwg. 10048698).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.65 percent		
101.	Diameter, min	Gage	23001
102.	Length	Gage	23002
103.	Protective finish incomplete or inadequate	Visual	23004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	23005

4.3.2.23 Spring, latch, recocking (see dwg. 10048721 covering a detail of dwg. 10048698).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Load at test height	Test	24001
102.	Protective finish incomplete or inadequate	Visual	24003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	24004

4.3.2.24 Recocking latch assembly (see dwg. 10048714 covering a detail of dwg. 10048698).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Spring pin loose	Manual	25001
102.	Protective finish damaged	Visual	25002

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	25003

4.3.2.25 Spring, cable, pulley (see dwg. 10048554 covering a detail of dwg. 10048741).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Temper improper	Test	26001
102.	Profile of loop	Gage	26002
103.	Thickness	Gage	26003
104.	Width	Gage	26004
105.	Rust preventive compound missing	Visual	26005
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	26006

4.3.2.26 Cable (see dwg. 10048729 covering a detail of dwg. 10048712).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Incorrect number of strands	Visual	27001
102.	Kinks, frayed or spliced along length	Visual	27002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	27003

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.27 Housing, spring, pulley (see dwg. 10048555 covering a detail of dwgs. 10048603 and 10048738).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.65 percent		
101.	Diameter of hole, min.....	Gage	28001
102.	Inside diameter, min.....	Gage	28002
103.	Sharp edges or burrs inside of cable cut-out.....	Visual	28003
104.	Protective finish incomplete or inadequate.....	Visual	28004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	28005

4.3.2.28 Shaft, pulley, cable (see dwg. 10048722 covering a detail of dwg. 10048698).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.65 percent		
101.	Large outside diameter, min...	Gage	29001
102.	Protective finish incomplete or inadequate.....	Visual	29002
103.	Bent or distorted.....	Visual	29003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	29004

4.3.2.29 Pulley assembly (see dwg. 10048712 covering a detail of dwg. 10048698).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.65 percent		
101.	Length pulley pin protrudes...	Gage	30001

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
102.	Cable improperly wrapped around pulley	Visual	30002
103.	Pin insecure	Manual	30003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	30004

4.3.2.30 Housing, trigger (see dwg. 10048702 covering a detail of dwg. 10048716).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
101.	Alignment of holes and slots on side A with corresponding holes and slots on side B	Gage	31001
102.	Housing distorted or cracked	Visual	31002
103.	Protective finish incomplete or inadequate	Visual	31003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	31004

4.3.2.31 Trigger mechanism assembly (see dwg. 10048698 covering a detail of dwg. 10048677).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Lubricant missing (where required)	Visual	32001
102.	Crimp of recocking handle inadequate	Visual	32002
103.	Moving parts do not move freely	Manual	32003

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No
104.	Component missing, damaged or improperly assembled	Visual	32004
105.	Foreign matter	Visual	32005
106.	Plating damaged (where required)	Visual	32006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	32007

4.3.2.32 Trigger assembly (see dwg. 10048677 covering a detail of dwg. 10048607).

Categories	Defects	Method of Inspection	Code No
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Adhesive incomplete or inadequate (where required)	Visual	33001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	33002

4.3.2.33 Tube, outer (see dwg. 10048687 covering a detail of dwg. 10048676).

Categories	Defects	Method of Inspection	Code No
Critical:			
1.	Hydrostatic test stamp missing	Visual	34001
Major:	AQL 0.40 percent		
101.	Inside diameter	Gage	34002
102.	Wall thickness	Gage	34003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	34004

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.34 Outer tube assembly (see dwg. 10048607 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	"O" ring missing, damaged or improperly seated	Visual	35001
102.	Protective finish incomplete or inadequate	Visual	35002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	35003

4.3.2.35 Spring, firing pin (see dwg. 10048628 covering a detail of dwg. 10048619).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 1.00 percent		
101.	Load at compressed lengths	Gage	36001
102.	Solid length, max	Gage	36002
103.	Diameter of wire	Gage	36003
104.	Ends not squared and ground	Visual	36004
105.	Protective finish incomplete or inadequate	Visual	36005
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	36006

4.3.2.36 Pin, firing (see dwg. 10048632 covering a detail of dwg. 10048626).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Major:	AQL 1.00 percent		
101.	Profile of point	Gage	37001
102.	Concentricity of tip with large diameter	Gage	37002
103.	Large diameter	Gage	37003
104.	Diameter of pin hole for firing pin spring, max	Gage	37004
105.	Location of pin hole for firing pin spring	Gage	37005
Minor:	AQL 1.00 percent		
201.	Total length	Gage	37007
202.	Evidence of poor workmanship (see 3.8)	Visual	37008

4.3.2.37 Housing, pin, firing (see dwg. 10048629 covering a detail of dwg. 10048619).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Large diameter of safety pin hole, max	Gage	38001
102.	Diameter of firing pin guide hole, max	Gage	38002
103.	Width of retainer ring groove	Gage	38003
104.	Pitch diameter of screw threads	Gage	38004
105.	Depth of threads, min	Gage	38005
106.	Diameter of igniter cavity	Gage	38006
107.	Depth of igniter cavity	Gage	38007
108.	Protective finish incomplete or inadequate	Visual	38008
Minor:	AQL 1.50 percent		
201.	Width of igniter tube slot, min	Gage	38009
202.	Depth from igniter tube slot to igniter cavity bottom, max	Gage	38010

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
	203. Evidence of poor workmanship (see 3.8).....	Visual	38011

4.3.2.38 Firing pin housing assembly (see dwg. 10048619 covering a detail of dwg. 10048605).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined			
Major:	AQL 0.40 percent		
101.	Component missing or loose....	Visual/Manual	39001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.9).....	Visual	39002

4.3.2.39 Tube, inner, after hydrotest (see dwg. 10048618 covering a detail of dwg. 10048605).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Hydrostatic test stamp missing.....	Visual	40001
Major:	AQL 0.65 percent		
101.	Plug gage fails to pass thru entire length of tube.....	Gage	40002
102.	Location of holes on aft end.....	Gage	40003
103.	Depth of detent cavity, min...	Gage	40004
104.	Depth of longitudinal groove..	Gage	40005
105.	Chamber gage failure.....	Gage	40006
106.	Protective finish incomplete or inadequate.....	Visual	40007
Minor:	AQL 1.50 percent		
201.	Width of igniter tube slot, min.....	Gage	40008
202.	Depth to end of igniter tube slot, min.....	Gage	40009

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
	203. Evidence of poor workmanship (see 3.9).....	Visual	40010

4.3.2.40 Inner tube assembly (see dwg. 10048605 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.65 percent		
	101. Waterproofing compound missing or inadequate around open slot and heads of rivets.....	Visual	41001
	102. Component missing or loose....	Visual/Manual	41002
	103. Protective finish incomplete, inadequate or of incorrect type on inner and outer surfaces.....	Visual	41003
Minor:	AQL 0.65 percent		
	201. Evidence of poor workmanship (see 3.8).....	Visual	41004

4.3.2.41 Spring, strap, sling (see dwg. 10048638 covering a detail of dwg. 10048606).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
	101. Load at test height.....	Gage	42001
	102. Protective finish incomplete or inadequate.....	Visual	42002
Minor:	AQL 0.65 percent		
	201. Evidence of poor workmanship (see 3.8).....	Visual	42003

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.2.42 Webbing and buckle assembly (see dwg. 10048642 covering a detail of dwg. 10048606).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Stitching inadequate	Visual	43001
• 102.	Type of stitching improper	Visual	43002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	43003

4.3.2.43 Sling assembly (see dwg. 10048606 covering a detail of dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 0.40 percent		
101.	Components missing, loose or improperly assembled	Visual	44001
102.	Component damaged	Visual	44002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8)	Visual	44003

4.3.2.44 Launcher assembly, extended position (see dwg. 10048501).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Inner tube free to rotate	Manual	45004
102.	Crimp of clamp inadequate	Visual	45005
103.	Connectors improperly crimped on pull pin	Visual	45006
104.	Components missing or loose	Visual/Manual	45007
105.	Protective finish incomplete or inadequate except minor scoring of inner tube grooves	Visual	45008

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
106.	Temperature adjusting slide lacks positive positioning....	Manual	45009
107.	Cable frayed or kinked.....	Visual	45010
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.8).....	Visual	45011

4.3.2.45 Launcher assembly, closed position (see dwg. 10048501 and paragraph 3.7).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 percent		
101.	Adhesive missing on detent housing cover and boot.....	Visual	46002
102.	Cable not completely rewound..	Visual	46003
103.	Protective coating incomplete or inadequate.....	Visual	46004
104.	Rubber boot damaged.....	Visual	46005
105.	Adhesive excessive.....	Visual	46006
106.	Waterproofness stamp missing..	Visual	46007
107.	Component, including screws missing or loose.....	Visual/Manual	46008
Minor:	AQL 1.00 percent		
201.	Marking incorrect, incomplete or illegible.....	Visual	46009
202.	Evidence of poor workmanship (see 3.8).....	Visual	46010

4.3.3 Testing

4.3.3.1 Spring embrittlement (see 3.3 and 4.4.1) Major defect - Code No. 47001. - A sample of 15 springs shall be selected from each heat treatment batch. A heat treatment batch may consist of only one type of spring (piecemark) or all types of springs used in the assembly. A heat treatment batch shall be restricted to those springs that are heat treated for removal of hydrogen embrittlement at the same time in accordance with identical requirements specified on the applicable drawings. The sample shall be tested as specified in 4.4.1 and the heat treatment batch shall be rejected if one or more springs fail to comply with the specified requirement.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.3.2 Hydrostatic test of inner tube (see dwg. 10048618) Critical defect - Code No. 40011. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.2, using test equipment specified in 4.3.4. Any assembly which fails to comply with the specified drawing requirement shall be classed defective and removed from the lot.

4.3.3.3 Internal hydrostatic test of outer tube.

4.3.3.3.1 Non-destructive (see dwg. 10048687) Critical defect - Code No. 34005. - This test shall be performed 100 percent The test shall be performed as specified in 4.4.3.1, using test equipment specified in 4.3.4. Any tube which fails to comply with the specified drawing requirement shall be classed defective and removed from the lot.

4.3.3.3.2 Destructive (see dwg. 10048687) Critical defect - Code No. 34006. - A sample of 15 outer tubes shall be selected from each lot for this test. The test shall be performed as specified in 4.4.3.2, using test equipment specified in 4.3.4. If any tube fails to comply with the specified drawing requirement, the lot shall be rejected.

4.3.3.4 Cable strength of pulley assembly (see dwg. 10048712) Major defect - Code No. 30006. - A sample of 100 pulley assemblies shall be selected from each lot for this test. The test shall be performed as specified in 4.4.4, using test equipment specified in 4.3.4. If two or more assemblies fail to comply with the specified drawing requirement, the lot shall be rejected. If only one defective is found, a second sample of 200 pulley assemblies shall be selected and tested. The lot shall be rejected and acceptance testing discontinued for the Government if a total of two or more pulley assemblies are found defective in the combined first and second sample.

4.3.3.5 Sight alignment (see dwg. 10048501) Major defect - Code No. 45003. - This test may be performed with the launcher in the closed position prior to the performance of the operability of launcher test. Sight alignment shall be gaged 100 percent using test equipment specified in 4.3.4. Any launcher with sights which fail to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.6 Operability of launcher (see 3.4) Major defect - Code No. 48001. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.5. Any launcher assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.3.7 Trigger action.

4.3.3.7.1 Safe position, non-functioning (see 3.5.1) Critical defect - Code No. 45013. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.6.1. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.7.2 Release position, non-functioning (see 3.5.2) Critical defect - Code No. 45014. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.6.2. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.7.3 Functioning of the trigger mechanism (see 3.5.3) Major defect - Code No. 45015. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.6.3. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.8 Functioning of the firing pin assembly.

4.3.3.8.1 Firing pin extension (see dwg. 10048501) Major defect - Code No. 45002. - With the launcher in the extended and locked position and the trigger mechanism cocked, this dimension shall be gaged 100 percent using test equipment specified in 4.3.4. Any launcher containing a firing pin which does not extend to the proper length shall be classed defective and removed from the lot.

4.3.3.8.2 Safety pin non-withdrawal; launcher extended position (see 3.6.1) Critical defect - Code No. 45016. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.7.1 using the test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.8.3 Primer impact (see 3.6.2) Major defect - Code No. 45017. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.7.2, using the test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.8.4 Firing pin recovery (see 3.6.3) Critical defect - Code No. 45019. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.7.3 using the test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.3.3.8.5 Safety pin insertion (see 3.6.4) Critical defect - Code No. 46001. - This test shall be performed 100 percent. The test shall be performed using the test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.8.6 Safety pin non-withdrawal; launcher closed position (see 3.6.5) Critical defect - Code No. 46011. - This test shall be performed 100 percent. The test shall be performed as specified in 4.4.7.4 using test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.9 Waterproofness (see 3.7) - Major defect - Code No. 46013. This test shall be performed 100 percent following completion of all other tests. After completing this test, the launcher shall not be opened. The test shall be performed as specified in 4.4.8 using test equipment specified in 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.4 Inspection equipment. - Index of Inspection Equipment Number IEL-10048501 identifies the inspection equipment required to perform the examinations and tests prescribed in this section. The contractor shall design inspection equipment in accordance with the instructions in paragraph 6.3.

4.3.4.1 Government rights to documentation. - Inspection equipment drawings and lists provided and revised in accordance with the requirements of the IEL may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

4.3.4.2 Supply and maintenance. - Supply and maintenance of the equipment listed on the IEL shall be in accordance with Specification MIL-I-45607.

4.3.4.3 Government use of contractor's inspection and test equipment. - The contractor shall make available to the Government all inspection and test equipment necessary for determining conformance with contract requirements. Personnel for operating the equipment, and verification of its accuracy, shall be supplied by the contractor for the performance of examination or test by the Government.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.4 Test methods and procedures.

4.4.1 Spring embrittlement. - The spring shall be extended in a manner representative of actual functioning (i.e. bending, twisting, tension) until the spring no longer returns to its original condition. The spring shall be classed defective if it breaks prior to this point.

4.4.2 Hydrostatic test of inner tube. - The inner tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The non-destructive internal hydrostatic pressure specified on the applicable drawing shall be applied and maintained for the required period of time. Any tube which deforms in excess of the drawing dimensions shall be classed defective. This test may be performed prior to or after drilling holes.

4.4.3 Internal hydrostatic test of outer tube.

4.4.3.1 Non-destructive. - The outer tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The non-destructive internal hydrostatic pressure specified on the applicable drawing shall be applied and maintained for the required period of time. Any tube which deforms in excess of the drawing dimensions shall be classed defective.

4.4.3.2 Destructive. - Prior to machining of slots, the outer tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The internal hydrostatic pressure shall be applied and gradually increased until a pressure is reached where the tube bursts or cracks. Any tube which bursts or cracks below the specified burst pressure shall be classed defective.

4.4.4 Cable strength of pulley assembly. - The assembly shall be placed in the specified test fixture in a manner that will secure the assembly but will not restrict its circular movement. The specified tension load shall be applied to the cable in the direction shown on the applicable drawing. Any assembly which fails to support the tension load or shows evidence of slippage in the area of the crimp shall be classed defective. Care shall be taken in performing this test to assure that the cable is not damaged by the method used to attach the tension load.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.4.5 Operability of launcher. - The complete assembly in the closed position less sling assembly, shall be operated in the following manner:

Fold the front sight down until the sight is approximately parallel to the open end of the launcher. Observation shall be made to determine that the sight fits freely into the cut-out provided in the end of the outer tube, and that after releasing the sight, the ears of the front sight are resting on the tube assembly. The rear sight shall be positioned in the rear sight cover, a gradual force shall be applied to the bail handle and observation made of the force required to completely extend and lock the inner tube in the extended position. Observation shall be made to determine that the rear sight has assumed a fully erect position as indicated by the rear sight resting against the fulcrum bracket sight stop. Observation shall be made for missing or loose components and for operation of the detent lever. The launcher shall be classed defective if it fails to comply with any of the requirements specified herein.

4.4.6 Trigger action. - The launcher shall be fully extended with the trigger mechanism in the cocked position, and the following test sequence performed:

4.4.6.1 Safe position (non-functioning) - With the trigger safety handle in the "SAFE" position, the specified load shall be applied to the trigger in a direction perpendicular to the top surface of the trigger housing. The assembly shall be classed defective if the firing pin is released.

4.4.6.2 Release position (non-functioning). - With the trigger safety handle in the "RELEASE" position, the specified non-functioning load shall be applied to the trigger in a direction perpendicular to the top surface of the trigger housing. If the firing pin is released, the assembly shall be classed defective.

4.4.6.3 Functioning of the trigger mechanism. - With the trigger safety handle in the "RELEASE" position, the specified functioning load shall be applied to the trigger in a direction perpendicular to the top surface of the trigger housing. If the firing pin is not released, the assembly shall be classed defective.

4.4.7 Functioning of firing pin assembly.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.4.7.1 Safety pin non-withdrawal (launcher extended position). - With the launcher in the extended and locked position and the trigger mechanism cocked, the minimum specified withdrawal force shall be applied to the safety pin in a direction parallel to the length of the pin. The assembly shall be classed defective if the safety pin withdraws below the minimum specified force.

4.4.7.2 Primer impact. - The recocking latch assembly shall be operated to assure that the trigger mechanism is in the cocked position. The launcher shall be fully extended. The test slug shall be inserted in the igniter cavity and shall be held firmly against the firing pin hole in the firing pin housing. No attempt to center the slug in the cavity shall be permitted. The safety pin shall be removed from the launcher the trigger safety handle moved to the "RELEASE" position, and the launcher "fired". The test slug shall be examined and the launcher classed defective if upon the initial release of the trigger mechanism the test slug shows no evidence of indentation by the firing pin or if the indentation is not within the inscribed circle.

4.4.7.3 Firing pin recovery. - With the launcher closed and positioned as specified, a load shall be placed upon the firing pin sufficient to compress the firing pin spring 1/4 inch minimum. The load shall be slowly removed without jarring the launcher and the position of the firing pin point shall be gaged. Launchers containing firing pins with points located in excess of the specified maximum distance from the firing pin housing, shall be classed defective and removed from the lot.

4.4.7.4 Safety pin non-withdrawal (launcher closed position). - This test shall be performed following the completion of the safety pin insertion test. The launcher shall be placed in the applicable test fixture in a fully closed and vertical, rearward end up position. A steady increasing force shall be applied to the safety pin, without impact, in the direction of withdrawal and parallel to the length of the pin. The assembly shall be classed defective if the safety pin withdraws below the minimum specified force.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

4.4.8 Waterproofness. - The complete launcher assembly in the closed position, less sling assembly and rear firing pin housing cover, shall be attached to the specified test fixture with a maximum force of 10 pounds applied longitudinally. The specified pressure shall be applied and isolated and the pressure sensing element shall be neutralized. The pressure shall be maintained for the required period of time and a pressure reading taken on the isolated area. Any launcher which shows a pressure measurement increase in the firing mechanism, above the specified maximum shall be classed defective.

5. PREPARATION FOR DELIVERY

5.1 The launcher components, as specified below, shall be packaged, packed and marked in accordance with Specification MIL-P-10025 and the following details:

5.1.1 Launcher, partially assembled. - The launcher, without sling assembly and rear cover firing pin housing, shall be prepared for packing by taping down the front sight with a suitable pressure sensitive, easily removable tape. The rear cover shall be left loose. Sixteen launchers, so prepared, shall be arranged 4 by 4 in a 200 pound test corrugated fiberboard box. The box shall have individual cells formed by half-slotted partitions. A full corrugated fiberboard liner shall be used around all sides of the box. The fiberboard liner shall be the same as that used for the box.

5.1.2 Sling Assembly (dwg. 10048606) - Not more than 100 sling assemblies shall be packed per shipping container.

5.1.3 Rear Cover Firing Pin Housing (dwg. 10048774) - Not more than 500 Housings shall be packed per carton and not more than 10 cartons shall be packed per shipping container.

5.1.4 Screw, MS35239-50. - Not more than 1,000 screws shall be packed in a suitable bag or box. Packages shall be overpacked in accordance with Specification MIL-P-10025 for shipment. Alternatively packaged screws may be combined with packaged housings (see 5.1.3) for shipment.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Ordering data.-Procurement documents shall specify the llowing:

a. Title, number and date of this specification.

b. Ammunition data cards shall be prepared for each lot accordance with MIL-STD-1167.

6.2 Inspection code numbers.-The five digit code numbers signed to the inspections herein are to facilitate future data llection and analysis by the Government.

6.3 Inspection equipment.-The contractor shall design inspection uipment as required by the referenced Inspection Equipment Lists EL) in accordance with the instructions of paragraphs 6.3.1 through 3.7.

6.3.1 Inspection equipment lists.-Inspection equipment lists dicate the availability of inspection equipment designs by showing the "number" column of the list of inspection equipment (OO Form 42-3) the numbers of drawings of existing equipment designs or des as indicated in paragraph 6.3.2. Design action required of e contractor with respect to the different types of drawings that y be listed is described in paragraphs 6.3.3 and 6.3.4. Action quired by the contractor with respect to commercial inspection uipment is described in 6.3.5. The contractor will be required prepare detailed drawings in accordance with 6.3.6 for all the uipment coded as "Contractor Design" in the number column. These ntractor designs must be approved by the Government prior to fabri- tion or procuring of the equipment. Designs shall be submitted r approval as specified in 6.3.7.

6.3.2 Inspection equipment list codes.-The inspection equipment defined in 6.3.3, 6.3.4, 6.3.5, and 6.3.6 will be designated in e IEL by the following codes:

CDAF - Contractor's design responsibility on Army format in accordance with MIL-D-45608.
CDCF - Contractor's design responsibility on contractor format.
AD - Army design.
ADMU - Army design, mandatory for use.
CE - Commercial equipment.
SCD - Specification control drawing.

6.3.3 Army designs.-Army designs are reflected on detailed awings which completely depict all the information necessary for e fabrication of the item of inspection equipment. The contractor

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

need provide no design when an Army design is listed for an item of inspection equipment. Army designs fall into two basic classifications, mandatory and non-mandatory. When an inspection equipment list references mandatory Army designs, the contractor shall comply with, and use these designs accordingly. The contractor may, however, in connection with non-mandatory designs and with the approval of the Government, design alternate inspectio equipment or use comparable commercial equipment to facilitate his operations. Such contractor prepared designs (see 6.3.6) or commercial equipment selections (see 6.3.5) must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.7.

6.3.4 Specification control drawing.-Specification control drawings depict the minimum equipment requirements in outline, descriptive, diagrammatic or pictorial form only and specify the required performance or other characteristics. Contractors must prepare detailed drawings (see 6.3.6) of their designs in support of specification control drawings. These contractor prepared designs must be approved by the Government prior to the fabrication or procuring of the equipment. Commercial equipment meeting the requirements of specification control drawings must be described in sufficient detail to permit identification and evaluation by the Government (see 6.3.5). Designs shall be submitted for approval as specified in 6.3.7.

6.3.5 Commercial equipment.-Commercial equipment is inspectio equipment that has universal application for a specific function. It is comprised of items commonly used by industry and Government. Contractors normally are not required to furnish drawings of commer inspection equipment, but a list of such equipment must be approved by the Government. When commercial inspection equipment requires t use of special fixturing, the design of this fixturing shall be considered as part of the total design, and 6.3.6 shall apply. In the latter case, only those portions of the commercial equipment ne be detailed in the designs as are necessary to completely fabricate calibrate, and operate the total item of inspection. Lists and fixturing designs shall be submitted for approval as specified in 6.3.7.

6.3.6 Contractor designs.-Contractor designs are designs of inspection equipment for which the Government has assigned design responsibility to the contractor. Contractor designs shall be supported by detailed drawings which depict all information necessa to completely fabricate, calibrate and operate an item of inspectio equipment. This requires that the necessary views, dimensions,


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

aterials, finish, notes, operating and calibration instructions be roperly depicted in accordance with approved practices to the extent hat further calculation or clarification will not be required. ontractor designs identified as CDCF may be developed on the format ne contractor normally employs in his equipment design procedure rovided such format reflects the detail and information specified oove. Contractor designs identified as CDAF shall comply with ne format and requirements of MIL-D-45608, and in addition, ontain the detail and information specified above. Final approved ontractor designs identified as CDCF shall be suitable for micro-ilming. They must be non-reproducible diazo or electrostatic rints of top quality full size with black lines on white background id shall provide a legible print produced via the 35MM microfilm rocess. Contractors shall submit one copy of the final design as rolled set or flat set. Designs shall be submitted for approval s specified in 6.3.7.

6.3.7 Submission of contractor designs.-Unless otherwise pecified on the Inspection Equipment List, all designs of equip-ent for inspection of defects classified as critical and major nall be submitted for approval to the Commanding Officer, icatinny Arsenal, ATTN: SMUPA-ND. All other designs of inspec-ion equipment shall be approved by the inspection element of the gency administering the contract; submission shall be as directed / the Contracting Officer. Partial submission of inspection quipment designs is permissible and encouraged. However, the rsenal completion date for design review will be based on the ate of the final submission of designs. Picatinny Arsenal esign review will be accomplished normally within one month fter receipt.

6.4 Submission of initial production sample. - Instructions, s to the location for the evaluation of the initial production mple, shall be obtained from the contracting officer. Upon eceipt of such request, the contracting officer shall advise .catinny Arsenal and instructions will be issued accordingly. .l inquiries should be forwarded to: Commanding Officer, .catinny Arsenal, ATTN: SMUPA-NI.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

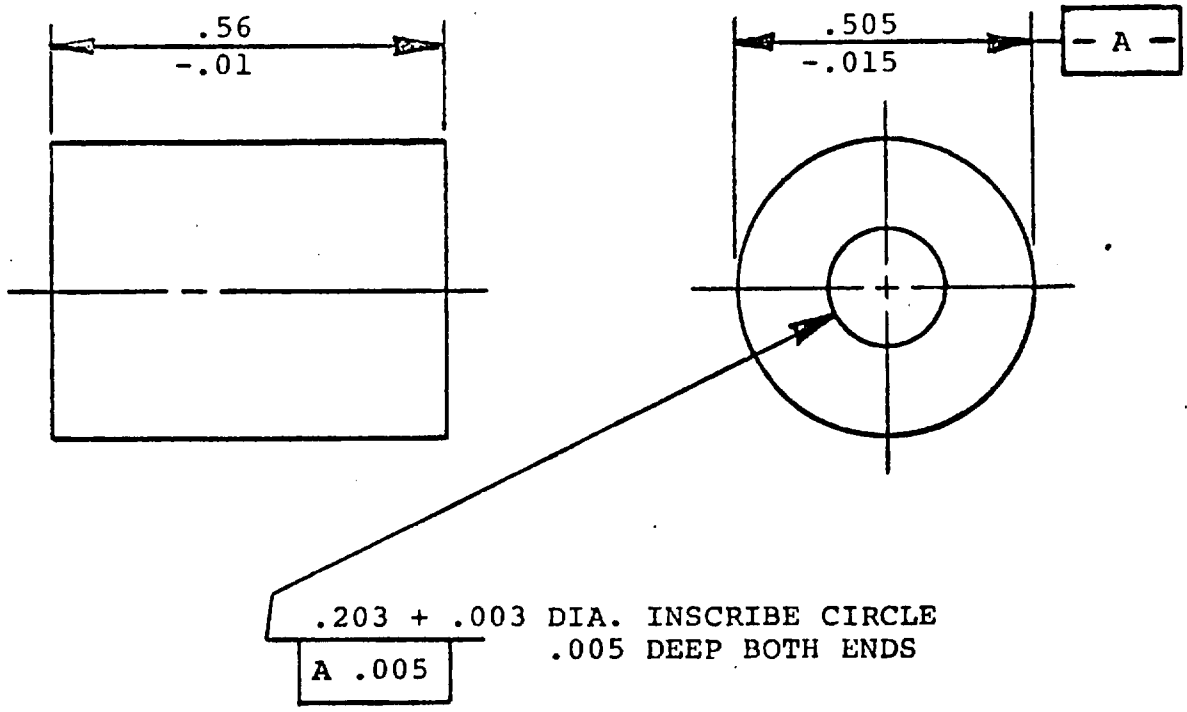

MATERIAL-LEAD, GRADE B, C OR D
SEE SPECIFICATION QQ-L-201.

FIGURE I

Notice. - When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Custodian:
Army-MU

Preparing activity:
Army-MU

Project No. 1340-A215

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET

Form Approved
Budget Bureau No. 119-R004

INSTRUCTIONS

...is to be filled out by personnel either Government or contractor, involved in the use of the specification in procurement of products for ultimate use by the Department of Defense. This sheet is provided for obtaining information on ... of this specification which will insure that suitable products can be procured with a minimum amount of delay and least cost. Comments and the return of this form will be appreciated. Fold on lines on reverse side, staple in ... and send to preparing activity.

...ICATION

...ZATION | CITY AND STATE

...ACT NO. | QUANTITY OF ITEMS PROCURED | DOLLAR AMOUNT $

...AL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

...ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCURE-...SE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

...MENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

...E SPECIFICATION RESTRICTIVE?

☐ ...ES ☐ NO IF "YES", IN WHAT WAY?

...ARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional ... attach to form and place both in an envelope addressed to preparing activity)*

...TED BY *(Printed or typed name and activity)* | DATE

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY
PICATINNY ARSENAL
DOVER, NEW JERSEY 07801

OFFICIAL BUSINESS

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY

COMMANDING OFFICER
United States Army
Picatinny Arsenal
ATTN: SMUPA-ND
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.