MIL-L-63246B(AR)
9 January 1981
SUPERSEDING
MIL-L-63246A(AR)
20 December 1978

MILITARY SPECIFICATION

LEADS, EXPLOSIVE, PA509, PA512, PA513, PA514, PA516, PA517 AND PA521; PARTS FOR, AND LOADING, ASSEMBLING AND PACKING

This specification is approved for use by the US Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification contains requirements not covered by the drawings, and provides quality assurance provisions for the fabrication of parts, and loading, assembling and packing for seven types of explosive leads designated as Leads, Explosive, PA509, PA512, PA513, PA514, PA516, PA517 and PA521.

2. APPLICABLE DOCUMENTS

2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-116	-	Preservation-Packaging, Methods of
MIL-A-48078	-	Ammunition, Standard Quality Assurance Provisions, General Specification For
MIL-P-48395	-	Pellets, Explosive Compositions (For Use In Ammunition) (Applies to PA509, PA516, PA517 and PA521)

FSC: 1375

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:28Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-105	-	Sampling Procedures and Tables For Inspection By Attributes
MIL-STD-331	-	Fuze And Fuze Components, Environmental and Performance Tests For
MIL-STD-1188	-	Commercial Packaging Of Supplies And Equipment

DRAWINGS (Sec 6.6)

US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND

7548103	-	Box, Set-up, Packing, Ammunition, Outer
7548104	-	Box, Set-up, Packing, Ammunition, Inner
8841278	-	Pin (applies to PA509 only)
9202649	-	Holder, Firing Pin (applies to PA509 only)
9277795	-	Lead, Explosive, PA514 (main)
9277801	-	Lead, Explosive, PA512 (transfer)
9278002	-	Lead, Explosive, PA513 (center)
9292601	-	Lead, Explosive, PA509
9328696	-	Lead, Explosive, PA517 (main)
9328722	-	Lead, Explosive, PA516 (transfer)
9328748	-	Lead, Explosive, PA521 (transfer)
9329780	-	Packing and Marking for Box, Wood, for Lead, Explosive, PA509
9329783	-	Packing and Marking for Box, Wood, for Lead, Explosive, PA512, PA516 or PA521
9329786	-	Packing and Marking for Box, Wood, for Lead, Explosive, PA513
9329789	-	Packing and Marking for Box, Wood, for Lead, Explosive, PA514 or PA517

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on the date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 202640-23T02:28Z
Check the source to verify that this is the currenversion before use.

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM A 108 - Steel Bars, Carbon, Cold Finished, Standard Quality

(Application for copies should be addressed to: American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103).

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with applicable drawings and specifications.

3.2 Lead assemblies. The lead assemblies shall comply with all requirements specified in Drawings 9277795, 9277801, 9278002, 9292601, 9328696, 9328722, 9328748, as applicable, all associated drawings, and with all requirements specified in applicable specifications and standards.

3.3 Functioning

3.3.1 Sensitivity and output. The lead assemblies shall function on the first attempt and shall indent the specified test plate for not less than the depth specified in Table I when tested as specified in 4.5.2, 4.5.3 and 4.5.4, as applicable.

TABLE I

EXPLOSIVE LEAD	DEPTH OF DEPRESSION
PA509	0.030 inch
PA512	0.022 inch
PA513	0.034 inch
PA514	0.020 inch
PA516	0.030 inch
PA517	0.020 inch
PA521	0.030 inch

3.4 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.5 Workmanship. All parts and assemblies shall be fabricated and loaded in a thorough, workmanlike manner. They shall be free of burrs, chips, sharp edges, cracks, surface defects, dirt, grease, rust, corrosion products, and other foreign matter. The cleaning

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agents. All required markings ahall be neat and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The following types of inspection shall be conducted on this item.

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated:

	Part Description	Drawing	Quantity
PA509	Cup, Lead	9292602	25
	Disc, Closure	9292603	25
	Lead, Explosive: PA509	9292601	315
PA512	Cover, Transfer Lead	9277803	25
	Cup, Transfer Lead	9277802	25
	Lead, Explosive: PA512	9277801	315
PA513	Cover, Center Lead	9277800	25
	Cup, Center Lead	9277799	25
	Lead, Explosive: PA513	9278002	315
PA514	Cover, Main Lead	9277797	25
	Cup, Main lead	9277796	25
	Lead, Explosive: PA514	9277795	315
PA516	Disc, Closing	9328736	25
	Cup, Lead, Explosive	9328735	25
	Lead, Explosive: PA516	9328722	315

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:28Z
Check the source to verify that this is the currentversion before use.

PA517	Disc, Closing	9328698	25
	Cup, Lead Explosive	9328697	25
	Lead, Explosive: PA517	9328696	315
PA521	Disc, Closing	9328736	25
	Cup, Lead Explosive	9328749	25
	Lead, Explosive: PA521	9328748	315

4.3.2 Inspections to be performed. See MIL-A-48078 and Table II specified herein.

4.3.3 Rejection. See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE			SHEET 1 OF 1	MIL-L-63246B(AR) DRAWING NUMBER
	Lead, Explosive, PA509				See below
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY PARAGRAPH REFERENCE /INSPECTION METHOD
	Lead Cup				----------
	(Dwg. 9292602)				
	Examination for defects	25	-	3.2	4.4.2.2
	Lead, Explosive, PA509				
	(Dwg. 9292601)				
	Examination for defects	(a)	-	3.2	4.4.2.14
	Sensitivity and output	315	-	3.3	4.5.2
	Disc, Closure				
	(Dwg. 9292603)				
	Examination for defects	25	-	3.2	4.4.2.8

NOTES: (a) The sample shall consist of the 315 explosive leads to be functioned per 4.5.2.

DRDAR-[illegible] Form 160 Jul 77 R places SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
	Lead, Explosive, PA512		See below
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Transfer Lead (Dwg. 9277802)				
	Examination for defects	25	-	3.2	4.4.2.3
	Cover, Transfer Lead (Dwg. 9277803)				
	Examination for defects	25	-	3.2	4.4.2.9
	Lead, Explosive, PA512 (Dwg. 9277801)				
	Examination for defects	(a)	-	3.2	4.4.2.15
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.3

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.3.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE			SHEET 1 OF 1	MIL-L-63246B(AR) DRAWING NUMBER
	Lead, Explosive, PA513				See below
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY ------- / PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Center Lead (Dwg. 9277799)				
	Examination for defects	25	-	3.2	4.4.2.4
	Cover, Center Lead (Dwg. 9277800)				
	Examination for defects	25	-	3.2	4.4.2.10
	Lead, Explosive, PA513 (Dwg. 9278002)				
	Examination for defects	(a)	-	3.2	4.4.2.16
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.3

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
	Lead, Explosive, PA514				See below
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Main Lead (Dwg. 9277796)				
	Examination for defects	25	-	3.2	4.4.2.5
	Cover, Main Lead (Dwg. 9277797)				
	Examination for defects	25	-	3.2	4.4.2.11
	Lead, Explosive, PA514 (Dwg. 9277795)				
	Examination for defects	(a)	-	3.2	4.4.2.17
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.3

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.3.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE			SHEET 1 OF 1	DRAWING NUMBER
	Lead. Explosive, PA516				See below
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Lead, Explosive (Dwg. 9328735)				
	Examination for defects	25	-	3.2	4.4.2.6
	Disc, Closing (Dwg. 9328736)				
	Examination for defects	25	-	3.2	4.4.2.12
	Lead, Explosive, PA516 (Dwg. 9328722)				
	Examination for defects	(a)	-	3.2	4.4.2.18
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.4

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
	Lead, Explosive, PA517				See below
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Lead, Explosive (Dwg. 9328697)				
	Examination for defects	25	-	3.2	4.4.2.7
	Disc, Closing (Dwg. 9328698)				
	Examination for defects	25	-	3.2	4.4.2.13
	Lead, Explosive, PA517 (Dwg. 9328696)				
	Examination for defects	(a)	-	3.2	4.4.2.19
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.4

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

TABLE II - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
	Lead. Explosive, PA521				See below
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Lead, Explosive (Dwg. 9328749)				
	Examination for defects	25	-	3.2	4.4.2.6
	Disc, Closing (Dwg. 9328736)				
	Examination for defects	25	-	3.2	4.4.2.12
	Lead, Explosive, PA521 (Dwg. 9328748)				
	Examination for defects	(a)	-	3.2	4.4.2.18
	Functioning - Sensitivity and output	315	-	3.3.1	4.5.4

NOTES: (a) The sample shall consist of the 315 lead assemblies to be functioned per 4.5.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of explosive leads shal contain:

a. Parts bearing the same lot interfix number from one manufacturer.

b. PBXN-5 from not more than one lot from one manufacturer. (Applicable when loading with loose PBXN-5).

c. Pellets being the same lot interfix number and complying with MIL-P-48395. (Applicable when loading with pellets).

4.4.2 Examination. See MIL-A-48078.

a. Sampling plans Unless otherwise specified in the Classification of Decfects and Test Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 2020-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.1	Pellet (Applicable when loading with pellets)				9292601, 9328696, or 9328722, as applicable
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY ------- / PARAGRAPH REFERENCE / INSPECTION METHOD
Critical	None defined				
Major					
101	Weight		0.40%	3.2	Balance
102	Diameter		0.40%	3.2	Gage
103	Pellet damaged (chipped edge, cracked, etc.)		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil - Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9292602
4.4.2.2	Cup, Lead (PA509)				NEXT HIGHER ASSEMBLY 9292601-
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom in noted area		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-02-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.3	Cup, Transfer Lead (PA512)		9277802
			NEXT HIGHER ASSEMBLY
			9277801

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-[illegible] Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Wh[illegible]is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Cup, Center Lead (PA513)				9277799
					NEXT HIGHER ASSEMBLY
					9278002
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9277796
4.4.2.5	Cup, Main Lead (PA514)				NEXT HIGHER ASSEMBLY 9277795
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE			SHEET 1 OF 1	DRAWING NUMBER
4.4.2.6	Cup, Lead, Explosive (PA516)				9328735
					NEXT HIGHER ASSEMBLY
					9328722
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.7	Cup, Lead, Explosive (PA517)				9328697
					NEXT HIGHER ASSEMBLY
					9328696
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length		0.40%	3.2	Gage
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.8	Disc. Closure (PA509)				9292603
					NEXT HIGHER ASSEMBLY 9292601
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.9	Cover, Transfer Lead (PA512)		9277803
			NEXT HIGHER ASSEMBLY 9277801

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.10	Cover, Center Lead (PA513)				9277800
					NEXT HIGHER ASSEMBLY
					9278002
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.11	Cover, Main Lead (PA514)		9277797
			NEXT HIGHER ASSEMBLY
			9277795

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which Is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.12	Disc, Closing (PA516 and PA521)				9328736
					NEXT HIGHER ASSEMBLY
					9328722 and 9328748
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2020610-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.13	Disc, Closing (PA517)				9328698
					NEXT HIGHER ASSEMBLY
					9328696
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter		0.40%	3.2	Gage
102	Thickness		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Lead, Explosive, PA509				9292601
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	NEXT HIGHER ASSEMBLY: - / PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Disc/end coating missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning:				
106	Sensitivity and Output	200	-	3.3.1	4.5.2
	Density of explosive (where applicable)	4.5.1	-	3.2	4.5.1
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Closure disc folded or bulged excessively		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.15	Lead, Explosive, PA512				9277801
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Crimp seal missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.3
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which Is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.16	Lead, Explosive, PA513				9278002
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Crimp seal missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.3
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.17	Lead, Explosive, PA514		9277795
			NEXT HIGHER ASSEMBLY
			-

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Crimp seal missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.3
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which Is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.18	Lead, Explosive, PA516				9328722
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Disc/end coating missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.4
106	Density of explosive (where applicable)	4.5.1	-	3.2	4.5.1
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.19	Lead, Explosive, PA517		9328696
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100.0%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Disc/end coating missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.4
106	Density of explosive (where applicable)	4.5.1	-	3.2	4.5.1
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which Is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.20	Cup, Lead, Explosive, PA521		9328749
			NEXT HIGHER ASSEMBLY
			9328748

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length				
102	Outside diameter		0.40%	3.2	Gage
103	Inside diameter		0.40%	3.2	Gage
104	Thickness through bottom		0.40%	3.2	Gage
			0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.21	Lead, Explosive, PA521		9328748
			NEXT HIGHER ASSEMBLY: ---

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Cover or cup cracked, split or punctured		100%	3.2	Visual
Major					
101	Total length		0.40%	3.2	Gage
102	Outside diameter, max.		0.40%	3.2	Gage
103	Disc/end coating missing, improper, color incorrect, or on prohibited area		0.40%	3.2	Visual
104	Assembly distorted or damaged to extent that functioning may be impaired		0.40%	3.2	Visual
105	Functioning: Sensitivity and Output	200	-	3.3.1	4.5.4
106	Density of explosive (where applicable)	4.5.1	-	3.2	4.5.1
107	Angle and radius		0.40%	3.2	Gage
Minor					
201	Crimp not full 360 degrees		0.65%	3.2	Visual
202	Cover folded or wrinkled		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.22	Box, Set-up, Packing, Ammunition, Inner		7548104
			NEXT HIGHER ASSEMBLY
			7548103

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Box damaged exposing contents		0.40%	3.2	Visual
102	Label missing or incomplete		0.40%	3.2	Visual
103	Leads not positioned securely in spacer		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-02-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.23	Box, Set-up, Packing, Ammunition, Outer		7548103
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Box damaged to extent that inner box will not fit properly		0.40%	3.2	Visual
102	Fillers missing		0.40%	3.2	Visual
103	Sealing strip insecure or improperly applied		0.40%	3.2	Visual
104	Box corners not blunted prior to insertion into barrier bag		0.40%	3.2	Visual
105	Label not securely applied to box		0.40%	3.2	Visual
106	Marking illegible, incorrect or missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-02-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.24	Bag, Barrier (Sealed)				7548103
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR /100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Heat seal test of sealed bag	(a)	(a)	3.2	(a)
102	Waterproofness of bag destroyed (Separation of heat seal, or rip, tear or puncture)		0.40%	3.2	Visual
103	Sealed bag will not permit two additional seals		0.40%	3.2	Visual
104	All excess air not exhausted from bag prior to sealing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES: (a) In accordance with MIL-P-116

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-L-63246B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.25	Box, Packing, Ammunition	1 OF 1	See 5.3.1 and 5.3
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Box damaged		0.40%	3.2	Visual
102	Nailing inadequate		0.40%	3.2	Visual
103	Strapping missing or loose		0.40%	3.2	Visual
104	Marking, incomplete, misleading or unidentifiable		0.40%	3.2	Visual
105	Cushioning missing or improper thickness		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with Paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and 6.2 herein.

4.5 Test methods and procedures

4.5.1 Density of explosive in lead cup (applicable to PA509, PA515, PA517 and PA521 when using alternate method of loading. A minimum of five (5) assemblies, representative of the explosive leads being processed, shall be loaded and the densitites determined to qualify each press prior to its use in production. In addition, a sample of five (5) leads shall be processed during the last portion of each four (4) hour's production from each press and density determined as a control of each press during production.

If any defective lead is found when inspection is performed for control of a press, the press producing the defective leads shall be removed from production. Further, that portion of production since the last control check shall be returned to the contractor for corrective action.

All presses removed from production because of some fault, may, after corrective action, be returned to production providing they pass the qualification test above.

The samples shall be selected prior to crimping and the following procedure used to determine the density of the explosive charge.

1. Measure and record height (h) from base of cup to top of explosive column to .001 inch.

2. Weigh and record weight of loaded cup to 0.001 gram.

3. Remove explosive from cup.

4. Weigh empty cup to 0.001 gram.

5. Measure inside diameter (d) of empty cup to .001 inch.

6. Measure end thickness of empty cup to .001 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

7. Calculate weight of explosive by subtracting the value obtained in (4) above from the value obtained in (2) above.

8. Calculate the explosive column height by subtracting the cup thickness measured in (6) above from the total height (h) measured in (1) above.

9. Calculate the explosive volume using the formula $V=r^2$ (h) (h is the value obtained in (8) above.) Convert this volume to cubic centimeters by multiplying by 16.387.

10. Calculate the density by dividing the weight obtained in (7) above by the volume obtained in (9) above.

If the density of any explosive lead falls outside the density limits specified on the applicable drawing, the lead shall be classed defective. The contractor may use another method for determining density provided approval of the method has been obtained from the Contracting Officer.

4.5.2 Sensitivity and output (applicable to PA509 only) (see 6.4). The sensitivity and output functioning tests shall be performed in accordance with the following procedures. The explosive lead lot shall be rejected if two (2) or more PA509 explosive leads fail to fire on the first attempt and/or fail to produce a depression in the steel test plate to the required depth specified in 3.3.1.

The set-up for this procedure shall be in accordance with Fig. 1.

The PA509 explosive leads shall be temperature-conditioned at 70 ± 10 degrees Fahrenheit (F) for two (2) hours, minimum, prior to performing this test. The tests shall be performed as specified in MIL-STD-331 Test, 301.1, except that the steel dent test plate shall be cut from C1018 or C1020 steel, cold-finished bar stock conforming to ASTM A 108. The steel test plate shall be a square, 1.625 ± .030 inch, and with a min. thickness of 0.625 inch, with a Rockwell hardness of B80 to B95.

The PA509 explosive lead shall be assembled into the specified holding sleeve and positioned so that the crimped (colored) end of the lead will be flush with the bottom of the sleeve and be positioned directly above the approximate geometric center of the plate. The sleeve shall be delrin, or other approved plastic material. The cavity to hold the PA509 lead shall be 0.243 + .005 inch in diameter. A standoff sleeve and Explosive Lead: PA517 (Dwg. 9328696) shall rest on top of PA509 as shown in Fig. 1. The

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

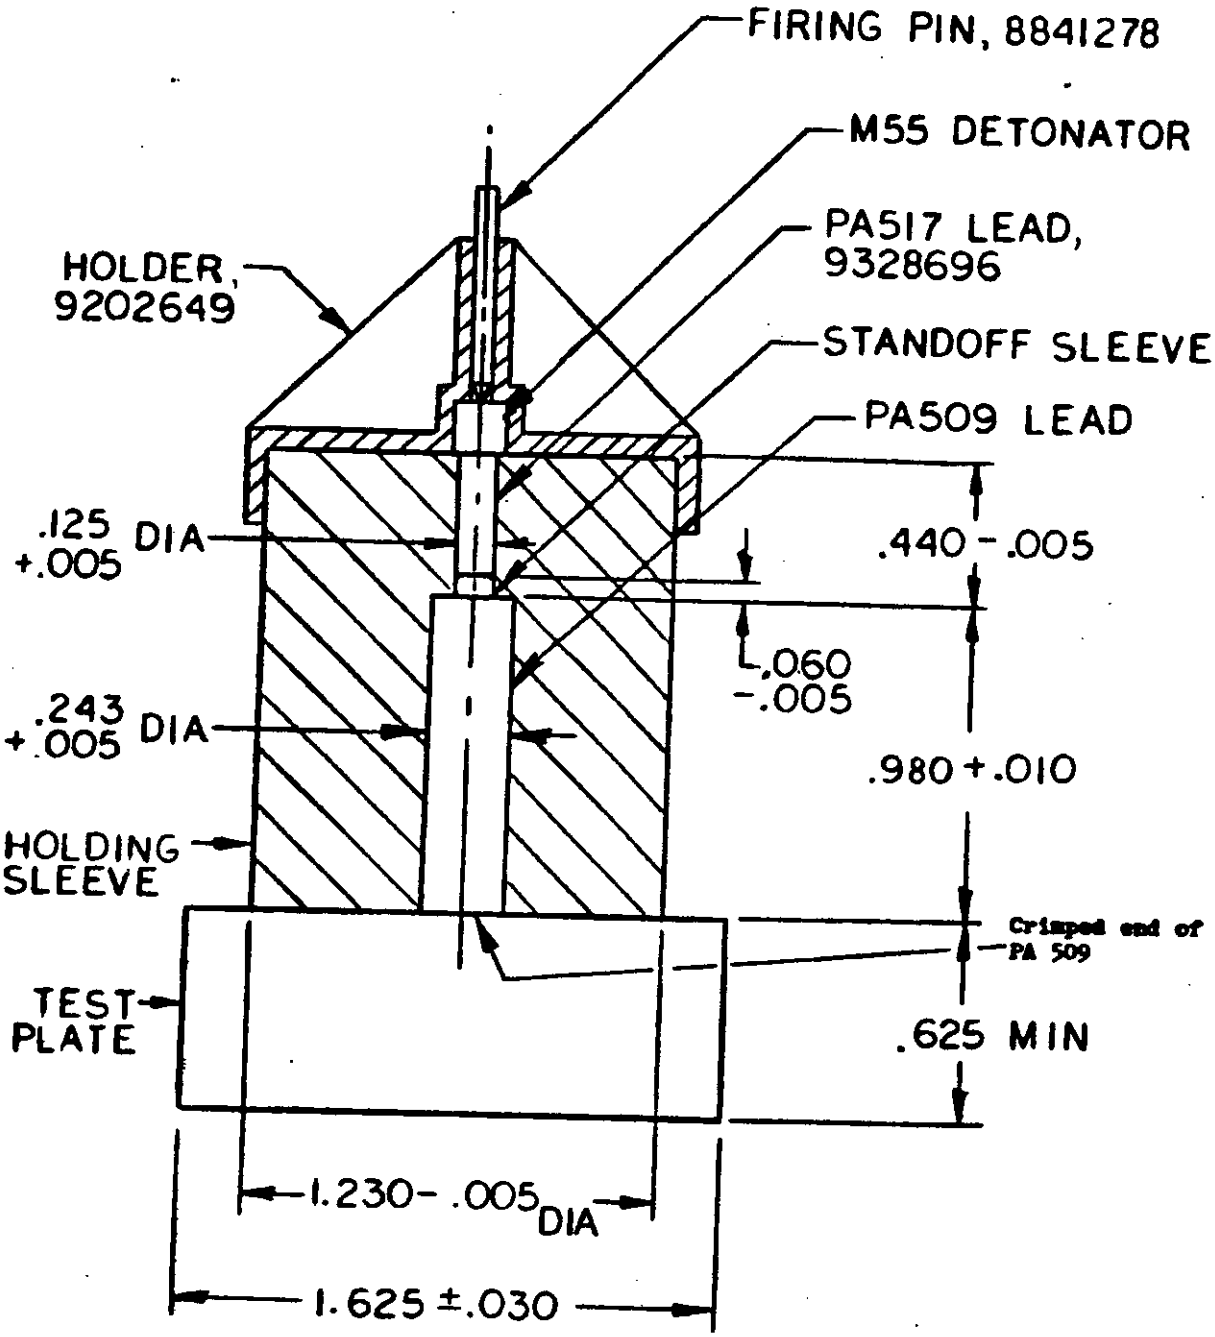


FIG 1 - SET UP FOR SENSITIVITY AND OUTPUT TEST.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

crimped end of the PA517 shall face the PA509. The standoff sleeve shall be used to provide a gap between the PA509 and the PA517, the latter directly initiating the PA509 under test. The standoff sleeve shall be a metal washer with an outside diameter of 0.124 - .005 inch, inside diameter 0.109 + .003 inch, thickness 0.060 - .005 inch. A holder (Dwg. 9202649) shall be fitted over the holding sleeve as shown in Fig 1 to hold M55 detonator, or approved equal, which will initiate the PA517 explosive lead below it by dropping a max weight of 1.98 ounces from a max height of 4 inches onto the firing pin. After functioning the PA509 explosive lead, the depression produced in the steel test plate shall be measured to determine compliance with 3.3.1. The probe used to measure the depth of the depression shall be as specified in MIL-STD-331, Test 301.1. Depth measurements shall be recorded and forwarded as specified in 6.4. Any change in the test procedures or equipment shall have prior Government approval. Note - If any detonator or PA517 explosive lead fails to function, it shall be considered "No Test".

4.5.3 Sensitivity and output (applicable to PA512, PA513 and PA514. The sensitivity and output functioning tests shall be performed in accordance with the following procedures. The lead assembly lot shall be rejected if two (2) or more lead assemblies fail to fire on the first attempt and/or fail to produce a depression on the steel test plate to the required depth specified in 3.3.1.

The lead assemblies shall be temperature-conditioned at 70 ± 10 degrees Fahrenheit (^{o}F) for two (2) hours, mninimum, prior to performing the functioning tests. The tests shall be performed as specified in MIL-STD-331, Test 301.1. The steel dent test plate shall be as specified in the test method except that the Rockwell hardness shall be B80 to B95. The outside diameter of the confinement sleeve shall be .780 - 0.020 inch. Inside diameter and length of sleeve shall be as specified in Table III. Material shall be steel in accordance with MIL-STD-331, Test 301.1, Paragraph 4.2.

TABLE III

Lead	Ins. Dia of Sleeve	Length of Sleeve
PA512	.139 + .002	.590 - .005
PA513	.201 + .002	.688 - .005
PA514	.126 + .002	.688 - .005
PA521	.123 + .002	.316 - .005

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:28Z
Check the source to verify that this is the current version before use.

The lead assembly shall be assembled into the confinement sleeve and positioned so that the bottom of the lead assembly will be flush with the bottom of the sleeve and be positioned directly above the approximate geometric center of the test plate.

The PA512 lead shall be positioned in the sleeve with the green (crimped) end facing the detonator. The PA513 and PA514 shall have the green (crimped) end facing the test plate.

The lead assembly shall be initiated by an M100 detonator, or approved equal, positioned in line and on top of the explosive lead under test. A half-hard brass grounding strip shall be inserted into the sleeve between the M100 detonator and the sleeve and come out the top of the sleeve. The positive lead from the energy source shall be attached to the pin of the M100 detonator and the ground lead shall be attached to the grounding strip. The detonator shall be fired by applying the energy from a 100 (one-hundred) microfarad, max. capacitor charged to 1.6 volts max. The depression produced in the steel test plate shall be measured to determine compliance with 3.3.1. The probe used to measure the depth of the depression shall be as specifed in test procedure 301.1. Depth measurements shall be recorded and forwarded as specified in 6.4. Any change in the test procedures or equipment shall have prior Government approval. Note - If any detonator fails to function, it shall be considered "No Test."

4.5.4 Sensitivity and output (applicable to PA516, PA517 and PA521. The procedures and instructions specified in 4.5.3 shall apply, except that the tests shall be performed as specified in MIL-STD-331 Test No. 303. The rejection criteria specified in 4.5.3 shall apply. The dimensions of the confinement sleeve of the PA516 and PA521 shall be the same as those of the PA512 (Table III) and for the PA517 shall be the same as those for the PA514 (Table III), except that the confining sleeve shall be delrin or other approved plastic. The dent test block shall be of 2024 T351 Aluminum alloy. The colored (crimped) end of the PA516 lead shall be toward the detonator. The bottom (non-colored end) of the PA517 shall be toward the detonator. The angle (58° + 3°) end of the PA521 shall be toward the detonator.

5. PACKAGING

5.1 Preservation and packaging

5.1.1 Level C (explosive leads). The explosive leads shall be preserved and packaged in accordance with Dwgs. 7548103 and 7548104.

5.1.2 Level C (metal parts). Metal parts shall be preserved and packaged in accordance with MIL-STD-1188.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

5.2 Packing

5.2.1 Level C (explosive leads). The explosive leads, preserved and packaged as specified in 5.1.1, shall be packed in accordance with Dwg. 9329780 (PA509), 9329783 (PA512, PA516 and PA521), 9329786 (PA513), and 9329789 (PA514 and PA517) as applicable.

5.2.2 Level C (metal parts). Metal parts, preserved and packaged as specified in 5.1.2, shall be packed in accordance with MIL-STD-1188.

5.3 Marking. Marking of packaging and packing of explosive leads shall be in accordance with Dwgs 7548103, 7548104, and 9329780 (PA509), 9329783 (PA512, PA516 and PA521), 9329786 (PA513), and 9329789 (PA514 and PA517), as applicable. Metal parts shall be marked in accordance with MIL-STD-1188.

5.4 Shipping. When components from more than one lot are shipped at one time, each lot shall be kept separate, and the division between lots clearly indicated to prevent mixing of the lots in transit.

6. NOTES

6.1 Ordering data. See MIL-A-48078.

6.2 Submission of inspection equipment designs for approval. (See MIL-A-48078). Equipment designs, as required, shall be forwarded to: Commander: USA, ARRADCOM, ATTN: DRDAR-QAA-I, Dover, NJ 07801.

6.3 Check test for possible deterioration. The following test is designed to prevent explosive leads that have deteriorated from being assembled into major ammunition items. The test shall be performed on explosive leads from each lot which have been stored under normal conditions for more than two (2) years or under adverse conditions for any period of time. If the specification for the ammunition item into which leads are assembled does not require that the check test be performed, the Contracting Officer should insert in the contract a provision for the performance of the check test. The Contracting Officer will arrange for the contraccor to be reimbursed for expenses incurred in his performance of the check tests for possible deterioration. Explosive leads shall be selected from each lot and tested as per 6.3.1.

6.3.1 Sensitivity and output. Two hundred (200) explosive leads shall be selected from each lot and subjected to the functioning tests as specified in 4.5.2, 4.5.3, or 4.5.4, as

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

applicable. The explosive lead lot shall be rejected if two (2) or more explosive leads fail to fire on the first attempt (dud), or if three (3) or more explosive leads fail to produce a depression in the test plate to the depth specified in 3.3.1. Test equipment shall be specified in 4.4.4 and 4.5.2, 4.5.3, and 4.5.4, as applicable.

6.4 Data submission. Results of all tests performed by the contractor shall be submitted in accordance with Data Item DI-R-1721 on the DD Form 1423 for the Contract. Distribution shall include the following: Commander, ARRADCOM, ATTN: DRDAR-QAA-Q, Dover, NJ 07801.

6.5 Data cards. (See MIL-A-48078). Distribution of data cards shall include the address specified in 6.4.

6.6 Drawings. Drawings listed in Section 2 of this specification under the heading "U.S. Army Armament Research and Development Command" (ARRADCOM) may also include drawings prepared by and identified as, Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, or Picatinny Arsenal drawings. Technical data originally prepared by these activities are now under the cognizance of ARRADCOM.

Custodian:
Army-AR

Preparing Activity:
Army-AR

Project No.: 1375-A-171

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:28Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

BUSINESS REPLY CARD

FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
US Army Armament R&D Command
ATTN: DRDAR-QAA
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 202640-23T02:28Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-L-63246B Leads, Explosive, PA509, PA512, PA513, PA514, PA516, PA517 and PA521

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:28Z
Check the source to verify that this is the current version before use.