MILITARY SPECIFICATION

CLOTH, COTTON, WATER REPELLANT

1. SCOPE

1.1 Scope.-This specification covers two classes of cotton cloth, chemically treated to be water repellant and resistant to oxides of nitrogen. (see 6.1)

1.2 Classification .-The cotton cloth shall be of two classes as specified in 3.4.

Class 1 - 2.6 ounce maximum
Class 2 - 3.9 ounce maximum

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids form a part of this specification to the extent specified herein.

SPECIFICATION

FEDERAL

CCC-T-191 - Textiles; Test Methods.
UU-P-271 - Paper, Wrapping, Waterproofed Kraft.
PPP-B-585 - Boxes, Wood, Wirebound.
PPP-B-601 - Boxes, Wood, Cleated Plywood.
PPP-B-621 - Boxes, Wood, Nailed and Lock-corner.

MILITARY

MIL-L-10547 - Liners, Case, Waterproof.
MIL-B-13239 - Barrier Material, Waterproofed Flexible, all Temperature.
MIL-C-20313 - Cloth, Cotton, Cartridge.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-109 - Inspection Terms and Definitions.
MIL-STD-129 - Marking for Shipment and Storage.

FSC 8305

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

PUBLICATIONS

ORDNANCE CORPS

ORD-M608-11 - Procedures and Tables for Continuous Sampling by Attributes.

(Copies of specifications, standards, drawings and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer).

2.2 Other publications.-The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids shall apply.

Consolidated Classification Committee

(Application for copies of these freight classification rules should be addressed to the Secretary of Operating Transportation Division, 59 VanBuren Street, Chicago, Ill.)

National Motor Freight Classification No.A-2, Naming Uniform Rating Rules and Regulations.

(Copies may be obtained from the Issuing Officer, 1424-16th Street N.W., Washington 6, D.C.)

3. REQUIREMENTS

3.1 Material.-The Class 1 cloth shall be in accordance with Grade C, and the Class 2 cloth shall be in accordance with Grade B of Specification MIL-C-20313, except that the cloth of each class shall be free of sizing composition, and shall not be bleached.

3.2 Finish.-The cloth shall be finished with a urea formaldehyde resin (paste type) plus a durable water repellant (melamine resin base) as evidenced by a purple color after test dyeing, as specified in 4.3.1.1 (see 6.3).

3.3 Width.-The width of the finished cloth shall be as specified in the contract or purchase order when determined as specified in 4.3.1.2.

3.4 Physical requirements.-The finished cloth shall comply with the requirements in Table I when tested as specified in the applicable paragraph in 4.3.

Table I

	Class 1	Class 2
Weight, ounces per square yard, maximum (max.)	2.6	3.9
Breaking strength, pounds per inch, minimum (min.)		
Warp	22	24
Fill	18	22
Standard spray test rating, min.	70	70

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

3.5 Chemical requirements.-The finished cloth shall comply with the following requirements wh tested in accordance with the applicable paragraph in 4.3.

3.5.1 Ash.-The ash content shall be 1.0 percent, max., when tested as specified in 4.3.1.6.

3.5.2 pH of water extract.-The pH of water extract shall be 5.5 min. and 8.5 max., when tested as specified in 4.3.1.7.

3.5.3 Acidity or alkalinity.-The acidity or the alkalinity shall not be greater than 0.10 percent when determined as specified in 4.3.1.8.

3.6 Breaking strength loss.-The loss in breaking strength of the finished fabric after conditioning in dinitrogen tetroxide shall be not more than 25 percent when tested as specified in 4.3.1.9. (see 6.6)

3.7 Color.-Unless otherwise specified in purchase order or contract the color shall be natural. When a color is specified, the dye or tint shall be fugitive (see 6.5), when tested as specified in 4.3.1.10.

3.8 Workmanship.-The finished cloth shall be uniformly and closely woven, shall be dry, and shall be free of bare spots, lumps, streaks, or ridges.

4. QUALITY ASSURANCE PROVISIONS

4.1 Contractor inspection.-The supplier is responsible for the performance of all inspection requirements specified herein. Except as otherwise specified, the supplier may utilize his own or any other inspection facilities and services acceptable to the Government. Inspection records of the examination and tests shall be kept complete and available to the Government as specified in the contract or order. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure that supplies and services conform to prescribed requirements. Reference shall be made to Standard MIL-STD-109 in order to define the terms used herein. Inspection shall be performed in accordance with this specification and other specifications referenced in any of the contractual documents.

4.1.1 Contractor quality assurance system.-If the contractor desires to utilize a quality assurance system, which is at variance with the quality assurance provisions of 4.2 and 4.3 and other documents referenced herein, he shall submit a written description of the system to the contracting officer for approval prior to initiation of production. It shall include a description covering controls for lot formation and identification, inspections to be performed, inspection stations, sampling procedures, methods of inspection (measuring and testing equipment), and provisions for control and disposition of non-conforming material The written description will be considered acceptable when, as a minimum, it provides the quality assurance provisions required by the provisions of 4.2 and 4.3 and the other documents referenced herein. The contractor shall not be restricted to the inspection station or the method of inspection listed in this specification provided that an equivalent control is included in the approved quality assurance procedure. In cases of dispute as to whether certain procedures of the contractor's system provide equal assurance, the comparable procedure of this specification shall apply. The contractor shall notify the Government of, and obtain approval for, any changes to the written description that affects the degree of assurance required by this specification or other documents referenced herein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

4.1.2 Submission of product.-At the time the completed lot of product is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all quality assurance provisions of the approved current written description of the system.
b. Quantity of product inspected.
c. Results obtained for all inspection performed.
d. Specification number and date, together with an identification and date of changes.
e. Certificates of analysis on all material procured directly by the contractor, when such material is covered by referenced Government specifications.
f. Quantity of product in the lot.
g. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agents authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.1.3 Government verification.-Using the contractor's written quality assurance procedure (see 4.1.1), this detail specification, and other contractual documents as a guide, the Government inspector shall verify all quality assurance operations performed by the contractor. Verification shall be in accordance with a or b as applicable, the decision being the responsibility of the procuring activity. In either case, the inspector shall also ascertain, prior to acceptance, that all quality assurance provisions of other specifications referenced in any of the contractual documents have been complied with. Deviations from prescribed or agreed upon procedures discovered by the Government inspector shall be brought to the attention of the supplier. Disposition of the product and remedial action shall be as directed by the Government inspector and, depending on the nature of the deviation, may consist of lot rejection, screening, re-sampling, re-instruction of the supplier's employees, or other appropriate action:

a. Verification at the point of manufacture shall be accomplished at unscheduled intervals in accordance with 4.1.3.1 and 4.1.3.2.
b. Verification at the point of delivery shall be in accordance with 4.1.3.2.

4.1.3.1 Surveillance.-Surveillance shall include, but is not limited to:

a. Observation of procedures concerning lot formation and identification.
b. Observation of sampling procedures and application of acceptance criteria.
c. Determination that all required examinations and tests are performed in accordance with the prescribed procedures of this specification, or approved equivalents thereto.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

d. Review of procedures for control and disposition of non-conforming material.

4.1.3.2 Product inspection.-Product inspection shall consist of Government inspection of product which has been previously inspected by the contractor and found to meet the quality assurance provisions of this specification. The inspection by the Government shall be performed in order to determine that the product is of the quality required by this specification and that the contractor's records are reliable.

4.2 Inspection provisions.

4.2.1 Lot formation.-A lot shall consist of cloth from one manufacturer, that has been subjected to the same finishing process and conditions, and submitted for inspection at the same time.

4.2.2. Examination.-Sampling plans and procedures for the following classifications of defects shall be in accordance with Standard MIL-STD-105 except that inspection for critical defects, when listed, shall be 100 percent. Continuous sampling plans in accordance with Handbook ORD-M608-11 may be used if approved by the procuring activity. Also, at the option of the procuring activity, AQL's and sampling plans may be applied to the individual characteristics listed using an AQL of 0.25 percent for each major defect and an AQL of 0.40 percent for each minor defect.

4.2.2.1 Cotton cloth, prior to finishing (see 3.1)

Cagegories	Defects	Method of inspection
Critical: None defined		
Major:	AQL 0.25 percent	
	101. Evidence that cloth has been bleached	Visual
Minor: None defined		

4.2.2.2 Cloth in bolts prior to packing.

Categories	Defects	Method of inspection
Critical: None defined		
Major: None defined		
Minor:	AQL 1.50 percent	
	201. Weave improper	Visual
	202. Holes, tears, dropped or loose threads	Visual
	203. Evidence of poor workmanship (see 3.8)	Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

4.2.2.3 Box or container, prior to sealing (see 5.2).

Categories	Defects	Method of inspection
Critical: None defined.		
Major:	AQL 0.65 percent	
101.	Bolts not individually wrapped	Visual
102.	Box liner material improper	Visual
103.	Wax paper wrapper torn or incomplete	Visual
104.	Liner not sealed	Visual
105.	Liner torn or pierced	Visual
Minor: None defined.		

4.2.2.4 Sealed box or container (see 5.2 and 5.3)

Categories	Defects	Method of inspection
Critical: None defined.		
Major:	AQL 0.40 percent	
101.	Gross weight, max.	Scale
102.	Marking misleading or unidentifiable	Visual
103.	Boxes improperly closed	Visual
104.	Strapping missing, broken, or loose	Visual-Manual
Minor: None defined.		

4.2.3 Testing.

4.2.3.1 Sampling for tests.-A sample two (2) yards long shall be selected from each of the five (5) bolts randomly selected, but none of the samples shall be taken from the first five (5) yards on each bolt. If any sample fails to conform with any requirement, the lot shall be rejected.

4.3 Test methods and procedures.

4.3.1 Tests.-The following tests shall be performed on each sample.

4.3.1.1 Finish.-A finish sample of undyed cloth, approximately 6 inches by 6 inches shall be dyed in a bath containing a disperse dye (Eastman Brilliant Pink 3B-GLF or equal) and a direct dye (Chlorantine Fast Green 5GLL or equal) in the ratio of 2:1: The dyeing conditions are as follows: (see 3.7)

6 grams (gms) per liter Eastman Brilliant Pink 3B-GLF
4 gms per liter Chlorantine Fast Green 5GLL
Dyeing time: 3 minutes.
Dyeing temperature: 68° ± 2°degrees Centigrade (C.)

If the color of the sample after dyeing is all purple, the finish is satisfactory. If the color is all green of if some of the yarns are green, the finish of the sample is not satisfactory.

4.3.1.2 Width.-The width of the cloth shall be determined in accordance with Specification CCC-T-191, Method 5026, to determine compliance with 3.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

4.3.1.3 Weight.-The weight of the cloth shall be determined in accordance with Specification CCC-T-191, Method 5040, to determine compliance with 3.4.

4.3.1.4 Breaking strength.-The breaking strength of the cloth shall be determined as specified in Specification CCC-T-191, Method 5100, to determine compliance with 3.4.

4.3.1.5 Standard spray test rating.-The standard spray test rating of the cloth shall be determined in accordance with Specification CCC-T-191, Method 5526 to determine compliance with 3.4.

4.3.1.6 Ash.-Parts from each of the pieces comprising the sample shall be cut, so as to obtain a total of approximately 2 gm., transferred to a tared porcelain crucible, and moistened with concentrated nitric acid. The crucible shall be heated on a steam bath for 1 hour and then heated carefully over a flame so as to avoid any mechanical loss. When the contents of the crucible have been charred, it shall be heated to dull redness until all carbonaceous matter has been burned off. The crucible shall be cooled in a desiccator, and weighed. The percent of ash in the sample shall be calculated to determine compliance with 3.5.1 as follows:

$$\text{Percent ash} = \frac{100\ (A-B)}{W}$$

where:

A = weight of crucible and ignited residue.
B = weight of crucible empty.
W = weight of sample.

4.3.1.7 pH of water extract.-The pH of the water extraction from the cloth shall be determined as specified in Specification CCC-T-191, Method 2811, to determine compliance with 3.5.2.

4.3.1.8 Acidity or alkalinity.-The solution used in the pH water extraction (see 4.3.1.7) shall be filtered. If the pH of the solution is between 7.0 and 8.5, the solution shall be titrated with 0.1 Normal (N) hydrochloric acid solution using methyl red as the indicator. If the pH of the solution is between 5.5 and 7.0, titrate with 0.1 N sodium hydroxide solution using phenolphthalein as the indicator. Any acidity shall be calculated to percent acetic acid and any alkalinity shall be calculated as percent sodium carbonate.

4.3.1.9 Determination of breaking strength loss.-Air is drawn through the apparatus shown in Figure 1 in the direction indicated on the diagram by an aspirator. A series of two drying towers containing magnesium perchlorate with a small amount of indicating Drierite serves as the air intake. In the diagram, the two drying towers are shown with separate outlets to the humidifier and the mixing bulb on the left. In practice, the towers are arranged in series with a glass "T" connecting them to the humidifier and mixing bulb. Dry air passes from one arm of a "T" tube attached to the second tower, to the humidifier containing a saturated salt solution selected to give the desired relative humidity. Dry air from the other arm of the "T" is admitted to a mixing bulb where it is mixed with dinitrogen tetroxide from the cylinder, shown in the upper left on the diagram. A portion of the resulting mixture is admitted to a second mixing bulb where it is mixed with air coming from the humidifier. Two needle valves control the flow of gases into each of the mixing bulbs; two flowmeters indicate the flow. The excess mixture from the first mixing bulb passes through two towers packed with pellets or flakes of solid sodium hydroxide to remove the dinitrogen tetroxide, and on out to the aspirator. The gas from the second mixing bulb, which consists of air

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

whose temperature is determined by the temperature of the room or enclosure in which the equipment is placed, and which has the desired dinitrogen tetroxide content, and relative humidity, flows over the specimens suspended in the exposure chamber. It then passes through the sodium hydroxide towers, and on to the aspirator. The pressure in the system is governed by the adjustment of the aspirator, and by the head of ethylene glycol above the lower end of the open tube in the regulator in the lower right of the diagram. The exposure chamber is a 13-liter pyrex jar equipped with a ground glass cover. The specimens are supported by a stainless steel rack which is rotated at a rate of approximately one (1) revolution per minute by a gear train and motor mounted on the cover. A wooden support holds the cover and attached specimen rack when not in position on the exposure chamber. A plain glass cover is used to close the chamber when sweeping out the exposure train with air before, and after exposures. The two sampling ports shown in Figure 1 provide for the removal of samples of air for chemical analysis from the exposure chamber, and from the stream of air entering the chamber. The humidifier consists of a plexiglass box 2 inches deep, 9 inches wide, and 12 inches long, filled to a depth of approximately 1 inch with a saturated salt solution. The box is equipped with baffles so that the air passing through it flows over a layer of solution one inch wide, and 9 feet long. A stoppered opening in the top of the box near the outlet provides for the insertion of the sensitive element of an electric hygrometer, if desired. The four flowmeters are of the ball-float type and, as shown in the diagram from left to right have maximum capacities of 42, 410, 116, and 960 milliliters per minute of air 70 degrees Fahrenheit (^{o}F). at one atmosphere. The float of the meter used to measure dry air is of stainless steel; those of the other three meters are of sapphire.

a. Tensile testing machine.-The tensile testing machine shall be as specified in Specification CCC-T-191, Method 5100.

b. Apparatus for conditioning.-Provision for conditioning the specimens, and measuring their breaking strengths in air at specified temperature and relative humidity shall be in accordance with Specification CCC-T-191, Textile Test Methods, Part 1, Section 4 - Atmospheric Conditions for Testing.

c. Cylinder of dinitrogen tetroxide (98 percent pure).

d. Saturated magnesium nitrate solution for humidifier.

e. Sodium hydroxide flakes or pellets for neutralizer.

f. Ethylene glycol for pressure regulator.

g. Magnesium perchlorate and indicating Drierite for drying tower.

4.3.1.9.1 Preparation of specimen.-The specimens shall be prepared from each sample as follows: Cut two strips of cloth 28 inches long and 1 1/2 inches wide at random from the fabric parallel to the warp yarns. Cut two similar strips parallel to the filling yarns. Ravel each strip to a width of one inch by taking approximately the same number of yarns from each side. Mark the strips into four 7 inch specimens, labeling each specimen for identification. Cut the two end specimens from each strip and retain for controls. The 14 inch strips are to be used for exposure to dinitrogen tetroxide and are not to be cut into 7 inch strips until after exposure.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

4.3.1.9.2 Procedure.-The specimens (see 4.3.1.9.1) shall be tested as follows: Condition specimens at 21 ± 2°C. and 65 percent relative humidity for at least 48 hours prior to exposure. Only two 14 inch strips (1 warp and 1 filling) of any one fabric are to be exposed to dinitrogen tetroxide at the same time. Strips of different fabrics may be exposed together (see 6.3). With the plain cover on the exposure chamber, and the needle valve between the dinitrogen tetroxide cylinder and flowmeter 1, shown on the left in Figure 1, closed, turn on the aspirator. Adjust the needle valves at flowmeters 2, 3 and 4 to give a stream of air having a relative humidity of 45 ± 3 percent at 27 ± 2°C. and rate of flow sufficient to change the atmosphere in the chamber four (4) times an hour. Suspend the strips of fabric from one end of the specimen rack. After the aspirator has been running thirty (30) minutes, replace the plain cover on the exposure chamber with the ground glass cover with attached rack, and strips of fabric. Start the specimen rack rotating. One hour after the introduction of the specimens into the exposure chamber, open the needle valve on flowmeter 1 halfway. Slowly open the outlet valve on the dinitrogen tetroxide cylinder until the reading on flowmeter 1 is approximately that required to give a concentration of 0.2 percent dinitrogen tetroxide by volume to the stream of air entering the exposure chamber. Make the fine adjustment atflowmeter 1 with the needle valves. Make any necessary adjustments of the needle valves at flowmeters 2, 3 and 4 to maintain the relative humidity, and rate of flow. At the end of 2 hours from the time the flow of dinitrogen tetroxide was started, close the outlet valve on the cylinder, open the stopcocks on the two sampling ports, and remove the cover, and attached 14 inch strips. Immediately cover the exposure chamber with the plain glass cover, close the sampling ports, and continue to draw air through the apparatus for at least an hour to sweep the dinitrogen tetroxide from the mixing and exposure chamber, and attached tubes. Cut the 14 inch strips into 7 inch specimens. Condition the exposed specimens, and the corresponding control specimens by exposure for 20 hours to air at 21 ± 2°C. and relative humidity at 65 percent. Determine the breaking strength of the exposed and control specimens as specified in Specification CCC-T-191, Method 5100. Calculate the strength loss in percent for each of the exposed specimens from the following formula:

$$\text{Breaking Strength loss , percent} = 100 - \frac{(E \times 100)}{C}$$

where:

E = breaking strength of exposed specimen.

C = breaking strength of control specimen that was adjacent to the exposed specimen in the original 20 inch strip of fabric.

Repeat the above procedure until all specimens of the fabric have been tested.

4.3.1.10 Color.-The dyed or tinted fabric shall be scoured or stripped, to remove color only, in accordance with a recommended commercial procedure for the particular color. The dye or tint shall be considered fugitive if all the color is removed from the fabric (see 6.5).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging (see 6.2)

5.1.1 Level A.-The bolts of cloth shall be packaged by wrapping in waxed paper.

5.1.2 Level C.-The cloth shall be packaged in accordance with suppliers commercial practice. Protection shall be such as to prevent deterioration during shipment and subsequent interval preliminary to use.

5.2 Packing (see 6.2)

5.2.1 Level A.-The packages containing the cotton cloth shall be packed in cleated plywood boxes, nailed wood boxes, or wirebound wood boxes conforming to the requirements of Specification PPP-B-601, PPP-B-621 or PPP-B-585 respectively. Shipping containers shall have a sealed waterproof case liner complying with Specification MIL-L-10547. Barrier materials shall comply with Grade A or B, Type B-1 or CW-1 of Specification MIL-G-13239 or Type H-1, H-2, H-3, H-4, H-5 of Specification UU-B-271. Containers shall be strapped in accordance with the strapping requirements of the appendix of the applicable box specification. The gross weight shall not exceed 200 pounds.

5.2.2 Level C.-The cloth shall be packed for shipment in conformance with Consolidated Freight Classification rules and container specifications for rail shipments, or with National Motor Freight Classification rules and container specifications for truck shipment.

5.3 Marking.-Interior packages, and exterior containers, shall be marked in accordance with Standard MIL-STD-129.

6. NOTES

6.1 Intended use.-This specification covers cloth, cotton water repellant intended for use as Cartridge Cloth in ammunition.

6.2 Ordering data.-Procurement documents should specify:

a. Title, number and date of this specification.
b. Width of material required, including manufacturing tolerance (see 3.3)
c. Color of material required (see 3.7)
d. Levels of protection (see 5.1 and 5.2)
e. Type and quantity required.

6.3 One finish that has been found to be satisfactory is the Permel Plus finish - American Cyanamid Co. This finish deposits on the desized cloth, dry basis, 12 to 14 percent solids urea formaldehyde resin (Aerotex cream 450) and 6-8 percent solids melamine resin base (Permel B).

6.3.1 The processing conditions that give the above finish are as follows:

Impregnating Bath Composition	Percent
Aerotex Cream 450	25
Permel Resin B	15
Aerotex Resin 159	6
Aerotex Buffer DCY	0.54
Aerotex Accelerater	1.00

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

Impregnation:

Immersion:	2 dips 2 nips
Pressure:	2.9 tons
Expression	100 percent

Dry and Cure:
Dry at 225°F
Cure at 300°F for 3 to 4 minutes.

6.4 Crowding of the exposure chamber has been found to give poor reproducibility and high values for dinitrogen tetroxide resistance. It is recommended therefore, that not more than 6 different fabrics be exposed together and that one of these be a cotton fabric whose dinitrogen tetroxide resistance has been determined previously. Failure of the value obtained for the dinitrogen tetroxide resistance of this fabric to agree with the values previously obtained, would indicate either that a change has been made in the conditions of the test, or that one of the fabrics present is in some way interfering with the test. As a check on the latter point, the fabrics should be exposed separately (see 4.3.1.9.2).

6.5 The object of the fugitive color is to preclude the masking of results under the stain test (see 3.7).

6.6 Equipment required to conduct this test is available at Picatinny Arsenal, Dover, New Jersey, ATTN: ORDBB-NI.


6.7 Eastman Brilliant Pink 3B-GLF and Chlorantine Fast Green 5G-GLL are Products of Eastman Chemical Products Inc. Kingsport, Tennessee.

Notice.-When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Custodian:
Army-Ordnance Corps

Preparing Activity:
Army-Ordnance Corps

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

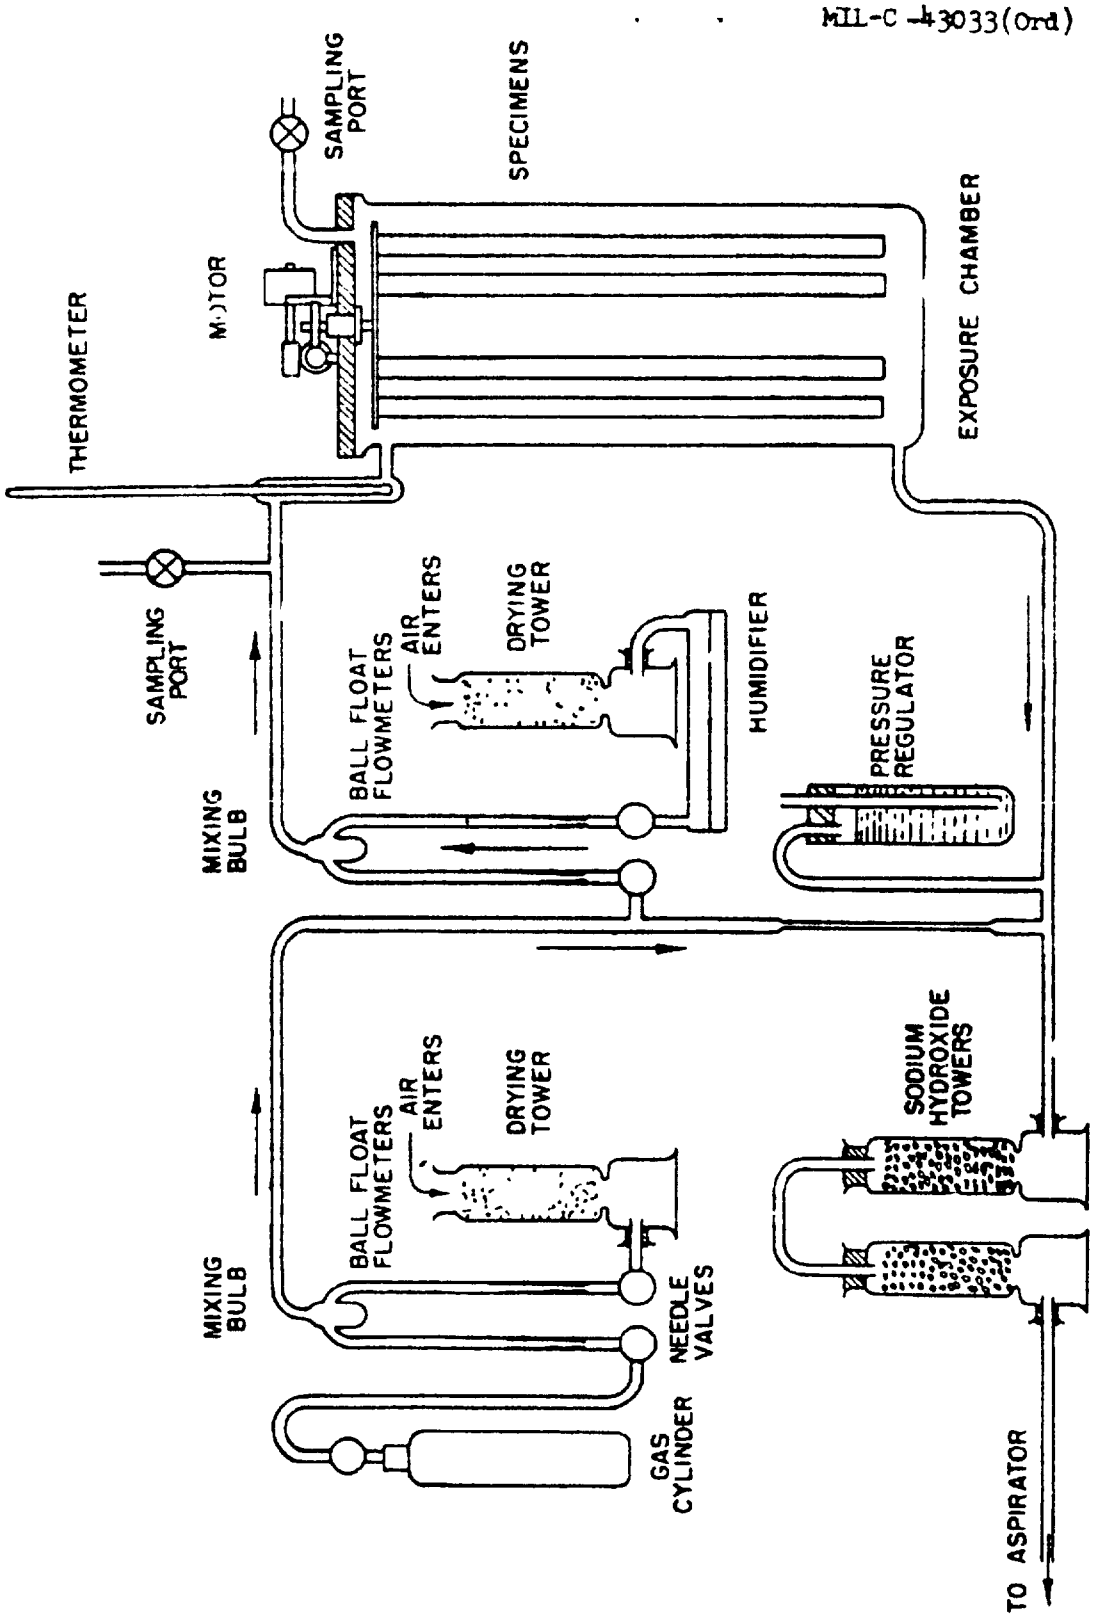

APPARATUS FOR EXPOSING FABRIC SPECIMENS TO DINITROGEN TETROXIDE
FIGURE I

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET

Form Approved
Budget Bureau No. 119-R004

INSTRUCTIONS

This sheet is to be filled out by personnel either Government or contractor involved in the use of the specification in procurement of products for ultimate use by the Department of Defense. This sheet is provided for obtaining information on the use of this specification which will insure that suitable products can be procured with a minimum amount of delay and at the least cost. Comments and the return of this form will be appreciated. Fold on lines on reverse side, staple in corner, and send to preparing activity *(as indicated on reverse hereof)*.

SPECIFICATION

ORGANIZATION *(Of submitter)*

CITY AND STATE

CONTRACT NO

QUANTITY OF ITEMS PROCURED

DOLLAR AMOUNT
$

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1 HAS ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A GIVE PARAGRAPH NUMBER AND WORDING

B RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2 COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

3 IS THE SPECIFICATION RESTRICTIVE?

☐ YES ☐ NO IF 'YES', IN WHAT WAY?

4 REMARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity)*

SUBMITTED BY *(Printed or typed name and activity)*

DATE

DD FORM 1 APR 63 1426 REPLACES NAVSHIPS FORM 4863 WHICH IS OBSOLETE C-8270

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE NAVY

POSTAGE AND FEES PAID
NAVY DEPARTMENT

OFFICIAL BUSINESS

Commander
Picatinny Arsenal
Attn: SARPA-AD-E-C-3
Dover, NJ 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:25Z
Check the source to verify that this is the current version before use.