MIL-S-14992A (PA)
8 AUGUST 1974
SUPERSEDING
MIL-S-14992 (MU)
3 MAY 1971

MILITARY SPECIFICATION

SAFETY AND ARMING DEVICE, GUIDED MISSILE: M118 LOADING, ASSEMBLING AND PACKING

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification contains requirements not normally covered by the drawings and provides quality assurance provisions for the fabrication of components, loading, assembling and packing of one type of Safety and Arming Device, Guided Missile: M118.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposals form a part of this specification to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-B-7883	- Brazing of Steels, Copper, Copper Alloys, Nickel Alloys, Aluminum and Aluminum Alloys
MIL-C-45662	- Calibration System Requirements
MIL-S-45743	- Soldering, Manual Type, High Reliability, Electrical Connections for Missile Systems, Procedures for

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-331	- Fuze and Fuze Components, Environmental and Performance Tests for

FSC: 1336

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

MIL-STD-810 - Environment Test Methods
MIL-STD-1168 - Lot Numbering of Ammunition

DRAWINGS

PICATINNY ARSENAL

9220961 - Safety and Arming Device Assembly
9233182 - Carton, Packing, Ammunition for Safety and Arming Device, GM: M118
9233183 - Box, Packing, Ammunition for Safety and Arming Device, GM: M118

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer.)

3. REQUIREMENTS

3.1 First Article Inspection. - This specification makes provisions for first article (pilot lot) inspection. Requirements for the submission of first article (pilot) lot samples by the contractor shall be as specified in the contract and herein (see 4.2).

3.2 Material. - All materials shall be in accordance with applicable drawings and specifications.

3.3 Components and Assemblies. - The Safety and Arming (S&A) Device component parts and assemblies shall comply with all requirements specified on Drawing (dwg.) 9220961 and associated drawings and with all requirements of applicable standards and specifications.

3.4 Spring Embrittlement. - Springs used in the fabrication of the S&A Device shall be free from hydrogen embrittlement as evidenced by not breaking when tested as specified in 4.4.1.

3.5 Electrical Continuity and Resistance

3.5.1 The S&A mechanism assembly (9220959) shall exhibit the following resistance measurements when tested as specified in 4.4.2.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

ultimate strength requirement, higher hardness values

3.5.1.1 Unarmed Condition. - The electrical resistance between the rotor electrical contact (9220914) and the threaded electrical contact (9233189) in the base shall be less than 0.4 ohms when the S&A mechanism assembly is in the unarmed position and the test is performed as specified in 4.4.2.1.1.

3.5.1.2 Armed Condition. - The electrical resistance between the electrical contact - No. 2 in the base (9220897) and the threaded electrical contact (9233189) in the base shall be no more than 4.3 ohms and no less than 1.3 ohms when the S&A mechanism assembly is in the armed condition and the test is performed as specified in 4.4.2.1.2.

3.5.2 The Safety and Arming Device, GM: M118 (9220961) in the unarmed condition with warning indicator showing green (open circuit) shall exhibit the following resistance measurements when tested as specified in 4.4.2.2.

3.5.2.1 Insulation Resistance Between Internal S&A Ground and the Nose-Crush (Missile) Ground. - The open-circuit electrical resistance between the contact receptacle (9233186) of the connector and the electrical contact - No. 2 of (9220901-2) (Nose crush ground to missile structure) shall be no less than 100 megohms when tested as specified in 4.4.2.2.1.

3.5.2.2 Insulation Resistance Between Internal S&A Ground and High Side of Missile Battery (B-). - The open circuit electrical resistance between the contact receptacle (9233186) of the connector and the electrical receptacle connector plug (9220901-1) which provides the insulated lead to the piston actuator and the electrical stud contact shall be no less than 100 megohms when tested as specified in 4.4.2.2.2.

3.5.2.3 Piston Actuator Continuity

3.5.2.3.1 Before Actuation. - The electrical bridge resistance of the piston actuator, before actuation, shall be no more than 2.6 ohms and no less than 1.4 ohms when tested as a piston actuator (9220954) and shall be no more than 2.6 ohms and no less than 1.1 ohms when tested in the S&A Device (9220961). Testing shall be as specified in 4.4.2.3.

3.5.2.3.2 After Actuation. - The electrical bridge resistance of the piston actuator, after actuation, shall be no less than 200 ohms when tested as specified in 4.4.2.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

3.6 Bias Mass Escapement

3.6.1 S&A Mechanism. - When the S&A mechanism assembly (9220959) is tested as specified in 4.4.3, the bias mass shall move from the fully latched position to the fully unlatched position (rotor assembly free to rotate) within the times specified below, corresponding to inertial loads as shown:

@ 200 g	23 to 15 Milliseconds
@ 500 g	12 to 8 Milliseconds

3.6.2 Safety and Arming Device (dwg. 9220961)

3.6.2.1 High Temperature (+145°F). - The bias mass of the Safety and Arming Device shall move from the fully latched position to the fully unlatched position in not less than 10 milliseconds and not moretthan 16 milliseconds when subjected to an inertial load of 300g's and tested as specified in 4.4.19.2.

3.6.2.2 Low Temperature (-40°F). - The bias mass of the Safety and Arming Device shall move from the fully latched position to the fully unlatched position in not less than 10 milliseconds and not more than 16 milliseconds when subjected to an inertial load of 300g's and tested as specified in 4.4.19.2.

3.7 Rotor Delay Time

3.7.1 S&A Mechanism Assembly (9220959). - The rotor assembly in the S&A mechanism assembly shall turn from the unarmed to the fully armed position in no less than 437.0 milliseconds and no more than 537.0 milliseconds when tested as specified in 4.4.4.1.

3.7.2 Safety and Arming Device (dwg. 9220961)

3.7.2.1 High Temperature (+145°F). - The Safety and Arming Device shall arm in no less than 407.0 milliseconds and no more than 537.0 milliseconds when tested as specified in 4.4.19.2.

3.7.2.2 Low Temperature (-40°F). - The Safety and Arming Device shall arm in no less than 437.0 milliseconds and no more than 655.0 milliseconds when tested as specified in 4.4.19.2.

3.8 Switch Chatter. - The Safety and Arming Device (dwg. 9220961), less lead charge, with rotor in the armed position, shall be subjected to the missile vibration test as specified in 4.4.5. During the test, the detonator circuit shall not be discontinuous for a duration in excess of 40 microseconds.

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

3.9 Dielectric Strength

3.9.1 Rotor Assembly - Terminal (dwg. 9220917). - There shall be no breakdown of the insulation between the rotor terminal board and contact assembly and the rotor body when the short is removed and an alternating current potential of 220 ± 20 volts, root mean square (RMS), is impressed between these points as specified in 4.4.6.

3.9.2 Cover Assembly (dwg. 9220980). - There shall be no breakdown of the insulation between the plug connector (9220901-1) and the access cover when an alternating current potential of 220 ± 20 volts RMS is applied between these points as specified in 4.4.6.

3.10 Environmental Functioning and Destructive Testing. - The Safety and Arming Device (dwg. 9220961) shall be subjected to and must withstand each of the environmental functioning and destructive tests outlined in 3.10.1 through 3.10.3 in accordance with the indicated test in MIL-STD-331.

3.10.1 Transportation Vibration - Test 104 - Procedure II

3.10.2 Temperature-Humidity - Test 105, 12 Days only

3.10.3 Five Foot Drop - Test 111 (see 4.4.12.3)

3.11 Safety Testing. - The Safety and Arming Device (dwg. 9220961) shall be subjected to and must withstand each of the destructive tests in 3.11.1 and 3.11.2 in accordance with the indicated test in MIL-STD-331.

3.11.1 Jolt - Test 101

3.11.2 Jumble - Test 102

3.12 Electrical Functioning. - The S&A Device in the "armed" position shall function the explosive elements high order when tested as specified in 4.4.9.

3.13 Workmanship. - All parts and assemblies shall be fabricated in a thorough, workmanlike manner. The parts shall be free of burrs, sharp edges, cracks, flash, tool marks, blisters, porosity, chipped edges, warpage, dirt, rust, corrosion and other foreign matter. The cleaning method used shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agents. Surface coatings shall be continuous except for superficial scratches not exposing base metal.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

3.14 T20E1 Detonator. - The T20E1 detonator shall comply with Specification MIL-D-46253. In addition, the detonator shall meet the following requirements.

3.14.1 Temperature-Humidity. - The detonators shall be subjected to and must withstand a temperature humidity test in accordance with MIL-STD-331, Test Method 105, except that units shall be cycled for 12 days only and the minus 80 degree soak shall not apply. The detonator shall comply with the resistance requirements specified on dwg. 8826740 (see 4.4.17.1).

3.14.2 Duds

3.14.2.1 Minus 40°F. - The detonator shall function high order on the first attempt when tested as specified in 4.4.17.2.1.

3.14.2.2 Plus 145°F. - The detonator shall function high order on the first attempt when tested as specified in 4.4.17.2.2.

3.15 Explosive Harness Assembly Output (Lead Charge)

3.15.1 Ambient. - The lead charge shall produce a dent a minimum of 0.018 inch in depth when tested as specified in 4.4.14.

3.15.2 Minus 40°F and Plus 140°F. - The lead charge shall produce a dent a minimum of 0.013 inch in depth when tested as specified in 4.4.9.

3.16 Piston Actuator Environmental Tests. - The piston actuator shall be subjected to and must withstand the following environments.

3.16.1 Temperature-Humidity. - The piston actuator shall be subjected to a temperature-humidity test in accordance with MIL-STD-331, Test 105, except that the units shall be cycled for 12 days only and the minus 80 degree soak shall not apply.

3.16.2 Transportation Vibration, Test 104, Procedure II

3.16.3 Five Foot Drop, Test 111

3.17 Non-Arming. - The fully assembled S&A Device shall not arm when subjected to an inertial load equivalent to 300g's as specified in 4.4.18.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection. - Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Submission of Product. - At the time each completed lot of items deliverable under the contract is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the quality assurance provisions specified in this specification.
b. Drawing and specification number and date, together with identification and date of changes thereto.
c. A statement that all material purchased by the contractor meets requirements, when such material is controlled by Government or commercial specifications referenced in any of the contractual documents, and that certificates of conformance are on file and available for review.
d. Number of items in the lot.
e. Date submitted.

Copies of all test data and inspection results which substantiate the statements being attested shall accompany the certificate. The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.2 First Article Inspection

4.2.1 Submission. - The contractor shall submit a first article (pilot lot) sample to a Government approved facility

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

as designated by the Contracting Officer (see 6.3) for evaluation in accordance with the provisions of 4.2.2. The first article (pilot lot) sample shall consist of 60 Safety and Arming Devices, 10 each of every component and every subassembly and the following additional quantities.

Part No.	Description	Quantity
9220961*	Safety and Arming Device (Shorted Detonator)	20

* These assemblies shall contain simulated (inert) lead charges and shall be color coded for identification.

All items included in the first article (pilot lot) sample shall have been produced by the contractor or furnished by a supplier and shall have been manufactured using the same production procedures and equipment which will be used in fulfilling the contract. All parts and materials, including packaging and packing, shall be obtained from the same sources of supply as will be used in regular production. Prior to submission, the contractor shall inspect the sample to the degree necessary to assure that it conforms to the requirements of the contract and shall submit a record of this inspection with the sample, including statements of findings of tests and examinations and certificates of conformance for materials (see 4.1.1.c.). A sample containing known defects will not be submitted unless specifically authorized by the Contracting Officer. A first article sample, or portion thereof as directed by the Contracting Officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days, or whenever a change occurs in manufacturing process, material used, drawing, specification or source of supply such as to significantly affect product uniformity as determined by the Government.

4.2.2 Inspections to be Performed. - Assemblies and components will be subjected by the Government to any or all of the examinations or tests specified in 4.3.2 and 4.3.3 of this specification and to any or all requirements of the applicable drawings.

4.2.3 Rejection. - If any component or subassembly fails to comply with the applicable requirements, the first article (pilot lot) sample shall be rejected. The Government reserves the right to terminate its inspection upon any failure of a component, subassembly or assembly in the sample to comply with any of the stated requirements. In the event of rejection, the Government reserves the right to require the contractor to take corrective

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

action and submit a new first article (pilot lot) sample or portion thereof. Until a first article (pilot lot) sample is accepted, the contractor is in no way authorized by the Government to initiate regular production unless otherwise directed by the Contracting Officer.

4.3 Inspection Provisions

4.3.1 Lot Formation. - The term "inspection lot" as used in this specification is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the inspection lot has been produced by one manufacturer, in one unchanged process, in accordance with the same drawing, same drawing revision, same specification and same specification revision and complies with the provisions for submission of product as specified in MIL-STD-105. Changes to the process, specification or drawing not affecting safety, performance, interchangeability or storage, as determined by the Government, shall not be deemed to alter the homogeneity of an inspection lot. All material submitted for inspection in accordance with this specification shall comply with the homogeneity criteria specified herein regardless of the type of sampling procedure which is being applied to determine conformance with requirements. Lot numbering, as required, shall be in accordance with MIL-STD-1168. Each inspection lot of Safety and Arming Devices shall contain:

a. Piston actuators from not more than one inspection lot number from one manufacturer.
b. Electric detonators from not more than one inspection lot number from one manufacturer.
c. Lead charges from not more than one inspection lot number from one manufacturer.
d. Metal parts from not more than one interfix number from one manufacturer.

4.3.2 Examination. - The examinations listed in the following subparagraphs shall be performed on inspection lots (see 4.3.1) of the components or assemblies designated in the applicable paragraph headings using a group AQL. Inspection for Critical Defects

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

(and Major Defects when so specified) shall be 100 percent. Sampling plans for Major and Minor Defects shall be in accordance with MIL-STD-105, using General Inspection Level II, unless otherwise specified.

4.3.2.1 Spacer, Sleeve (see dwg. 9220879-1 covering a detail of dwg. 9241387).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Length of spacer collar	Vernier Calipers	01001
102.	Outside diameter, staking end	Gage, Ring, Go/No-Go	01002
103.	Outside diameter, threaded end	Gage, Ring, Go/No-Go	01003
104.	Runout of staking end to threaded end	Gage, Height & Indicator, Harding Chuck	01004
Minor:	AQL 1.50 Percent		
201.	Distance roll-over end to shoulder	Vernier Calipers	01005
202.	Max. radius at intersection of shoulders and small outside diameter	Optical Comparator	01006
203.	Thread size	Gage, Thread Plug 0-80UNF-2A	01007
204.	Evidence of poor workmanship (see 3.13)	Visual	01008

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.2 Pinion, Spur - No. 1 (see dwg. 9220880 covering a detail of dwg. 9220905).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Rear support shoulder diameter	Gage, Ring, Go/No-Go	02001
102.	Spur Gear No. 2 shoulder diameter	Gage, Ring, Go/No-Go	02002
103.	AGMA gear conformance and quality	Gear Check Machine	02003
104.	Runout of support shoulder to Datum A	V-Block, Height Gage & Dial Indicator	02004
105.	Runout of Spur Gear No. 2 shoulder to Datum A	V-Block, Height Gage & Dial Indicator	02005
106.	Runout of support shoulder to Datum A	V-Block, Height Gage & Dial Indicator	02006
Minor:	AQL 1.50 Percent		
201.	Small shaft diameter (Datum A)	Gage, Ring, Go/No-Go	02007
202.	Protective finish	Visual	02008
203.	Evidence of poor workmanship (see 3.13)	Visual	02009

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.3 Gear, Spur - No. 2 (see dwg. 9220881 covering a detail of dwg. 9220905).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Flatness	Gage, Height & Dial Indicator	03001
102.	AGMA gear conformance and quality	Gear Check Machine	03002
Minor:	AQL 1.50 Percent		
201.	Surface finish of teeth	Reference Blocks	03003
202.	Protective finish	Visual	03004
203.	Evidence of poor workmanship (see 3.13)	Visual	03005

4.3.2.4 Support, Rear (see dwg. 9220898 covering a detail of dwg. 9241387).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 Percent		
101.	Thread size, Hole B	Gage, Thread, No. 2 - 64 UNF-2B	04001
102.	Hole A location	Fixture	04002
103.	Hole A diameter	Gage, Plug, Go/No-Go	04003
104.	Hole B location	Fixture	04004
105.	Hole B minor diameter	Gage, Plug, Go/No-Go	04005
106.	Hole C location	Fixture	04006
107.	Hole C diameter	Gage, Plug, Go/No-Go	04007
108.	Hole D location	Fixture	04008
109.	Hole D diameter	Gage, Plug, Go/No-Go	04009
110.	Hole E location	Fixture	04010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

111.	Hole E diameter	Gage, Plug, Go/No-Go	04011
112.	Hole F location	Fixture	04012
113.	Hole F diameter	Gage, Plug, Go/No-Go	04013
114.	Burrs and surface defects ..	Test (4.4.16)	04014
115.	Length of tab arm	Vernier Calipers	04015
116.	Flatness	Gage, Height, Dial Indicator	04016
Minor:	AQL 4.00 Percent		
201.	Symmetry of width between prongs to Hole D diameter ..	Fixture	04017
202.	Inside width between flanges	Vernier Calipers	04018
203.	Surface finish, Hole A	Reference Blocks	04019
204.	Surface finish, Hole D	Reference Blocks	04020
205.	Surface finish, Hole E	Reference Blocks	04021
206.	Length from base end to insulator seating surface	Vernier Calipers	04022
207.	Evidence of poor workmanship (see 3.13)	Visual	04023

4.3.2.5 Escapement Assembly - Gear (see dwg. 9220905 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Perpendicularity of spur gear to shaft	Hardinge Chuck, Height Gage, Dial Indicator	05001

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

102.	Staking of Spur Gear No. 2 insecure	Visual/Manual (4.4.15.2)	05002
103.	Escapement does not rotate freely	Manual	05003
Minor:	AQL 0.65 Percent		
201.	Parts improperly assembled .	Visual	05004

4.3.2.6 Starwheel (see dwg. 9220884 covering a detail of dwg. 9220885).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Large outside diameter	Optical Comparator	06001
102.	True position of outside diameter to splined hole diameter	Optical Comparator	06002
103.	Contour of starwheel teeth .	Optical Comparator	06003
104.	Location of starwheel teeth to Datum A	Optical Comparator	06004
105.	Flatness	Gage, Height & Dial Indicator	06005
106.	Burrs and surface defects ..	Test (4.4.16)	06006
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	06007

4.3.2.7 Pinion, Spur - No. 2 (see dwg. 9220882 covering a detail of dwg. 9220885).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Major:	AQL 1.00 Percent		
101.	Major diameter of starwheel shaft	Gage, Ring, Go/No-Go	07001
102.	Runout of starwheel shaft diameter to Datum A and B ..	Hardinge, Chuck, Height, Gage, Indicator	07002
103.	Runout of gear face to Datum A and B	Hardinge, Chuck, Height, Gage, Indicator	07003
104.	Length of starwheel shaft ..	Optical Comparator & Template	07004
105.	Datum shaft diameter, starwheel end	Gage, Ring, Go/No-Go	07005
106.	Datum shaft diameter, gear end	Gage, Ring, Go/No-Go	07006
107.	Maximum radius from datum diameter shoulders at both ends to adjacent faces	Optical Comparator & Template	07007
108.	AGMA gear conformance and quality	Gage Check Machine	07008
109.	Overall length of pinion splined shaft and shoulder	Optical Comparator & Template	07009
Minor:	AQL 1.00 Percent		
201.	Length of datum diameter shaft at gear end	Optical Comparator & Template	07010
202.	Evidence of poor workmanship (see 3.13)	Visual	07011

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.8 Starwheel & Pinion Assembly (see dwg. 9220885 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Runout of starwheel to Datum A and B	V-Blocks, Height, Gage, Dial Indicator	08001
102.	Staking insecure	Visual/Manual (4.4.15.2)	08002
103.	Solid film lubricant missing or applied excessively in gear teeth	Visual	08003
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	08004

4.3.2.9 Shaft, Shouldered - Rotor (see dwg. 9220886 covering a detail of dwg. 9220904).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of spur gear shaft	Gage, Ring, Go/No-Go	09001
102.	Runout of spur gear shaft with Datum A	Hardinge, Chuck, Height Gage, Dial Indicator	09002
103.	Runout of rotor shaft hole with Datum A	Hardinge, Chuck, Height Gage, Dial Indicator	09003
104.	Runout of rear support bearing surface with Datum A	Hardinge, Chuck, Height Gage, Dial Indicator	09004

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

105.	Diameter of rear support bearing surface	Gage, Ring, Go/No-Go	09005
106.	Burrs and surface defects ..	Test (4.4.16)	09006
Minor:	AQL 2.50 Percent		
201.	Length of spur gear shaft ..	Micrometer, Depth	09007
202.	Datum A diameter	Gage, Ring, Go/No-Go	09008
203.	Diameter of rotor shaft hole	Gage, Plug, Go/No-Go	09009
204.	Protective finish	Visual	09010
205.	Pallet shaft finish	Reference Blocks	09011
206.	Evidence of poor workmanship (see 3.13)	Visual	09012

4.3.2.10 Gear, Spur - Rotor (see dwg. 9220903 covering a detail of dwg. 9220904).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Hole diameter, Datum A	Gage, Plug, Go/No-Go	10001
102.	Slot location	Fixture	10002
103.	Thickness of gear	Micrometer	10003
104.	AGMA gear conformance and quality	Gear Check Machine	10004
105.	Countersink not on same side as die pull down	Visual	10005
Minor:	AQL 2.50 Percent		
201.	Flat of gear missing	Visual	10006
202.	Flatness of gear	Gage, Height & Indicator	10007
203.	Protective finish	Visual	10008
204.	Finish on teeth	Reference Blocks	10009
205.	Evidence of poor workmanship (see 3.13)	Visual	10010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.11 Gear and Shaft Assembly (see dwg. 9220904 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Major:	AQL 0.40 Percent		
101.	Runout of spur gear to Datum A	Hardinge, Chuck, Height Gage, Dial Indicator	11001
102.	Parts improperly assembled	Visual	11002
Minor:	AQL 0.65 Percent		
201.	Gear insecure	Visual/Manual (4.4.15.5)	11003

4.3.2.12 Pallet, Escapement (see dwg. 9220908 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Radius of starwheel contacts	Optical Comparator	12001
102.	Width of slot, maximum (max.)	Vernier Calipers or Template	12002
103.	Width of slot, minimum (min.)	Vernier Calipers or Template	12003
104.	Location of slot	Fixture	12004
105.	Diameter of hole	Gage, Plug, Go/No-Go	12005
106.	Location of hole	Fixture	12006
107.	Burrs and surface defects	Test (4.4.16)	12007

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Minor:	AQL 2.50 Percent		
201.	Surface finish	Visual	12008
202.	Protective finish	Visual	12009
203.	Thickness of pallet	Micrometer	12010
204.	Length of pallet	Vernier Calipers	12011
205.	Width of pallet	Vernier Calipers	12012
206.	Evidence of poor workmanship (see 3.13)	Visual	12013

4.3.2.13 Plate, Escapement (see dwg. 9220883 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of rotor shaft hole (Datum A)	Gage, Plug, Go/No-Go	13001
102.	Diameter of starwheel and pinion hole	Gage, Plug, Go/No-Go	13002
103.	Location of starwheel and pinion hole	Fixture	13003
104.	Diameter of spur gear hole	Gage, Plug, Go/No-Go	13004
105.	Location of spur gear hole .	Fixture	13005
106.	Diameter of spacer holes ...	Gage, Plug, Go/No-Go	13006
107.	Location of spacer holes ...	Fixture	13007
108.	Burrs and surface defects ..	Test (4.4.16)	13008
Minor:	AQL 2.50 Percent		
201.	Flatness	Gage, Height & Dial Indicator	13009
202.	Surface finish, rotor shaft hole	Reference Blocks	13010
203.	Surface finish, starwheel hole	Reference Blocks	13011

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

204.	Surface finish, spur gear hole	Reference Blocks	13012
205.	Protective finish	Visual	13013
206.	Evidence of poor workmanship (see 3.13)	Visual	13014

4.3.2.14 Screw, Machine, Pan Head (see dwg. 9220878 covering a detail of dwg. 9220906).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Self locking element missing	Visual	14001
Minor:	AQL 1.50 Percent		
201.	Thread size	Gage, Thread, Ring, 0-80 UNF-2A	14002
202.	Distance from last thread to base of head	Optical Comparator	14003
203.	Evidence of poor workmanship (see 3.13)	Visual	14004

4.3.2.15 Escapement Assembly (see dwg. 9220906 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Gear train and pallet do not operate freely	Manual	15001
102.	Parts improperly assembled .	Visual	15002
Minor:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.16 Contact, Electrical, Grounding (see dwg. 9220911 covering a detail of dwg. 9220916).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Location of holes	Gage, Spanner	16001
102.	Length from hole centerline to flat end	Fixture	16002
103.	Gap excessive	Gage, Feeler	16003
104.	Flatness	Gage, Height & Dial Indicator	16004
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	16005
202.	Evidence of poor workmanship (see 3.13)	Visual	16006

4.3.2.17 Terminal Board and Contact Assembly - Rotor (see dwg. 9220916 covering a detail of dwg. 9220917).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Parts improperly assembled .	Visual	17001
102.	Perpendicularity of electrical grounding contact to side of terminal board	Height Gage, Dial Indicator, Holding Fixture	17002
103.	Rivet insecure or not fully rolled over	Visual/Manual (4.4.15.1)	17003
Minor:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.18 Rotor (see dwg. 9220895 covering a detail of dwg. 9220902).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 Percent		
101.	Location of terminal board slot	Fixture	18001
102.	Location of rotor grooved pin hole	Fixture	18002
103.	Diameter of rotor grooved pin hole	Gage, Plug, Go/No-Go	18003
104.	Location of detonator cavity	Fixture	18004
105.	Concentricity of small rotor shaft with Datum C	V-Block, Dial Indicator & Support	18005
106.	Location of straight pin hole	Fixture	18006
107.	Concentricity of slotted shaft with Datum A	V-Block, Dial Indicator & Holding Fixture	18007
108.	Outside diameter of rotor body	Gage, Ring, Go/No-Go	18008
109.	Depth of terminal board slot	Gage, Depth	18009
110.	Diameter of straight pin hole	Gage, Plug, Go/No-Go	18010
111.	Depth of detonator cavity	Gage, Depth	18011
112.	Perpendicularity of slotted shaft shoulder to Datum A	Optical Comparator	18012
113.	Burrs and surface defects	Test (4.4.16)	18013

Source: https://assist.dla.mil -- Downloaded: 202640-18T05:19Z
Check the source to verify that this is the current version before use.

Minor:	AQL 2.50 Percent		
201.	Diameter of slotted shaft ..	Gage, Ring, Go/No-Go	18014
202.	Diameter of small rotor shaft	Gage, Ring, Go/No-Go	18015
203.	Length from face at small shaft end to face of slotted shaft shoulder	Vernier Calipers	18016
204.	Protective finish	Visual	18017
205.	Evidence of poor workmanship (see 3.13)	Visual	18018

4.3.2.19 Rotor Assembly - Pins (see dwg. 9220902 covering a detail of dwg. 9220917).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Exposed length of headless, grooved pin	Gage, Height or Template	19001
102.	Burrs and surface defects ..	Test (4.4.16)	19002
Minor:	AQL 1.00 Percent		
201.	Exposed length of headless, straight pin	Gage, Height or Template	19003
202.	Parts improperly assembled .	Visual	19004

4.3.2.20 Rotor Assembly - Terminal (see dwg. 9220917 covering a detail of dwg. 9220918).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Staking insecure	Visual/Manual (4.4.15.2)	20001

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

102.	Parts missing or improperly assembled	Visual	20002
103.	Distance from contact to side of rotor	Template	20003

Minor: None defined.

4.3.2.21 Rotor Assembly (see dwg. 9220918 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Parts missing or improperly assembled	Visual	21001
102.	Detonator leads not properly or securely connected	Visual/Manual	21002
103.	Insulation tubing improper .	Visual	21003
104.	Staking improper	Visual	21004
105.	Burrs and surface defects ..	Test (4.4.16)	21005
106.	Cracks in set screw	20X Glass	21006
107.	Insulated wire not between rotor ribs	Visual	21007
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	21008

4.3.2.22 Spacer, Sleeve (see dwg. 9220879-2 covering a detail of dwg. 9241388).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Length of spacer collar	Template	22001
102.	Outside diameter, staking end	Gage, Ring, Go/No-Go	22002

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Outside diameter, threaded end	Gage, Ring, Go/No-Go	22003
104.	Runout of staking end to threaded end	Hardinge Chuck, Height Gage & Indicator	22004
Minor:	AQL 2.50 Percent		
201.	Distance roll-over end to shoulder	Gage, Snap or Template	22005
202.	Max. radius at intersection of shoulders and small outside diameter	Optical Comparator	22006
203.	Thread size	Gage,dThread, Plug, 0-80 UNF-2B	22007
204.	Evidence of poor workmanship (see 3.13)	Visual	22008

4.3.2.23 Plate, Latching (see dwg. 9220936 covering a detail of dwg. 9220957).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of pivot hole	Gage, Plug, Go/No-Go	23001
102.	Location of latching toe relative to pivot hole	Fixture & Calipers	23002
103.	Height of toe	Template	23003
104.	Finish of inside surface of pivot hole	Reference Blocks	23004
105.	Finish of rotor pin contact surface	Reference Blocks	23005
106.	Finish of heel surface	Reference Blocks	23006
107.	Burrs and surface defects ..	Test (4.4.16)	23007

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Minor:	AQL 1.50 Percent		
201.	Location of pivot hole	Fixture & Calipers	23008
202.	Protective finish	Visual	23009
203.	Evidence of poor workmanship (see 3.13)	Visual	23010

4.3.2.24 Shaft, Shouldered (Rotor Detent Latching Plate) - (see dwg. 9220930-2 covering a detail of dwg. 9220957).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Diameter of bias mass escapement pivot hole	Gage, Plug, Go/No-Go	24001
102.	Runout of pivot hole with datum diameter	Hardinge Dividing Head, Indicator	24002
103.	Length of latching plate shoulder	Optical Comparator, Template	24003
104.	Burrs and surface defects ..	Test (4.4.16)	24004
Minor:	AQL 2.50 Percent		
201.	Diameter of support shaft (Datum A)	Gage, Ring, Go/No-Go	24005
202.	Diameter of latching plate shoulder	Gage, Ring, Go/No-Go	24006
203.	True position of latching plate shoulder	Fixture	24007
204.	Evidence of poor workmanship (see 3.13)	Visual	24008
205.	Radii at fillets (2 places) max.	Optical Comparator	24009

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.25 Shaft, Shouldered (Bias Mass Retaining Plate) - (see dwg. 9220930-1 covering a detail of dwg. 9220957).

Categories		Defects	Method of Inspection	Code No.
Critical:	None defined.			
Major:	None defined.			
Minor:		AQL 2.50 Percent		
	201.	Diameter of support shaft (Datum A)	Gage, Ring, Go/No-Go	25001
	202.	Diameter of retaining plate shoulder	Gage, Ring, Go/No-Go	25002
	203.	True position, retaining plate shoulder	Fixture	25003
	204.	Length of retaining plate shoulder	Optical Comparator & Template	25004
	205.	Burrs and surface defects ..	Test (4.4.16)	25005
	206.	Evidence of poor workmanship (see 3.13)	Visual	25006
	207.	Radii at fillets (2 places) max.	Optical Comparator	25007

4.3.2.26 Support, Front (see dwg. 9220938 covering a detail of dwg. 9241388).

Categories		Defects	Method of Inspection	Code No.
Critical:	None defined.			
Major:		AQL 1.50 Percent		
	101.	Diameter of latching plate mounting hole	Gage, Plug, Go/No-Go	26001
	102.	Location of latching plate mounting hole	Fixture	26002
	103.	Diameter of sleeve spacer mounting holes	Gage, Plug	26003
	104.	Location of sleeve spacer mounting holes	Gage, Plug, Go/No-Go	26004

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the currentversion before use.

105.	Diameter of bias mass pivot hole	Gage, Plug, Go/No-Go	26005
106.	Location of bias mass pivot hole	Fixture	26006
107.	Diameter of rear support mounting hole	Gage, Plug, Go/No-Go	26007
108.	Location of rear support mounting hole	Fixture	26008
109.	Distortion of rear support mounting hole	Optical Comparator	26009
110.	Diameter of rotor mounting hole	Gage, Plug, Go/No-Go	26010
111.	Location of rotor mounting hole	Fixture	26011
112.	Location of plate insulator mounting tabs	Fixture	26012
113.	Location of detent latch slot	Vernier Calipers	26013
114.	Length of detent latch slot.	Vernier Calipers	26014
115.	Width of detent latch slot..	Vernier Calipers	26015
116.	Burrs and surface defects ..	Test (4.4.16)	26016
117.	Flatness	Gage, Height, Dial Indicator	26017

Minor: AQL 4.00 Percent

201.	Diameter of detent latch mounting hole	Gage, Plug, Go/No-Go	26018
202.	Location of detent latch mounting hole	Fixture	26019
203.	Diameter of base mounting holes	Gage, Plug, Go/No-Go	26020
204.	Location of base mounting holes	Fixture	26021
205.	Width between flanges, burr side	Vernier Calipers	26022
206.	Diameter of retaining plate mounting hole	Gage, Plug, Go/No-Go	26023

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

207.	Location of retaining plate mounting hole	Fixture	26024
208.	Radius from center of rotor pivot hole to top end of rotor pin slot	Vernier Calipers	26025
209.	Evidence of poor workmanship (see 3.13)	Visual	26026

4.3.2.27 Bias Mass Assembly - Support (see dwg. 9220957 covering a detail of dwg. 9220958).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Part missing or improperly assembled	Visual	27001
102.	Retaining plate does not move freely	Manual	27002
103.	Latching plate does not move freely	Manual	27003
104.	Burrs and surface defects ..	Test (4.4.16)	27004
105.	Roll-over insecure	Visual/Manual (4.4.15.5)	27005
Minor:	None defined.		

4.3.2.28 Leaf, "G" Sensing (see dwg. 9220937 covering a detail of dwg. 9241376).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	AQL 1.00 Percent		
101.	Diameter of No. 1 spur gear collar	Gage, Ring, Go/No-Go	28001
102.	Runout of spur gear collar .	Hardinge Chuck, Height Gage, Dial Indicator	28002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Runout of support pivot	Hardinge Chuck, Height Gage, Dial Indicator	28003
104.	Diameter of support pivot ..	Gage, Ring, Go/No-Go	28004
105.	Diameter of helical spring support shaft (Datum A)	Gage, Ring, Go/No-Go	28005
106.	Diameter of pin hole	Gage, Plug, Go/No-Go	28006
107.	Location of pin hole	Fixture	28007
108.	Orientation of slot in shaft	Visual	28008
109.	Burrs and surface defects ..	Test (4.4.16)	28009
110.	Minimum perfect thread in front support pivot	Gage, Thread	28010
111.	Thread size	Gage, Thread, Plug 0-80 UNF-2B	28011
Minor:	AQL 1.50 Percent		
201.	Thickness of bias mass	Vernier Calipers	28012
202.	Configuration of bias mass arm	Fixture	28013
203.	Evidence of poor workmanship (see 3.13)	Visual	28014

4.3.2.29 Gear, Spur - No. 1 (see dwg. 9220928 covering a detail of dwg. 9241376).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Location of leaf notch	Fixture	29001
102.	AGMA gear conformance and quality	Gear Check Machine	29002
103.	Diameter of hole	Gage, Plug, Go/No-Go	29003

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Minor:	AQL 1.00 Percent		
201.	Flatness	Height Gage & Dial Indicator	29004
202.	Evidence of poor workmanship (see 3.13)	Visual	29005

4.3.2.30 Leaf and Pin Assembly (see dwg. 9220956 covering a detail of dwg. 9220958).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Shouldered pin clearance ...	Template, Go/No-Go	30001
102.	Parts missing or improperly assembled	Visual	30002
103.	Burrs and surface defects ..	Test (4.4.16)	30003
Minor:	None defined.		

4.3.2.31 Spacer, Sleeve - Pallet (see dwg. 9220929 covering a detail of dwg. 9220955).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Outside diameter of support plate end	Gage, Ring, Go/No-Go	31001
102.	Runout of support plate end to pallet shaft	Hardinge Chuck, Height Gage, Dial Indicator	31002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Outside diameter of pallet shaft (Datum A)	Gage, Ring, Go/No-Go	31003
104.	Length of collar	Gage, Optical Comparator & Templates	31004
105.	Length of pallet shaft	Gage, Optical Comparator & Templates	31005
106.	Burrs and surface defects ..	Test (4.4.16)	31006
Minor:	AQL 1.00 Percent		
201.	Thread size improper	Gage, Thread	31007
202.	Evidence of poor workmanship (see 3.13)	Visual	31008

4.3.2.32 Plate, Support (see dwg. 9220932 covering a detail of dwg. 9220955).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of bias mass pivot hole	Gage, Plug, Go/No-Go	32001
102.	Location of bias mass pivot hole	Fixture	32002
103.	Diameter of plate mounting holes	Gage, Plug, Go/No-Go	32003
104.	Location of plate mounting holes	Fixture	32004
105.	Diameter of pallet spacer mounting hole	Gage, Plug, Go/No-Go	32005
106.	Location of pallet spacer mounting hole	Fixture	32006
107.	Diameter of starwheel pivot hole	Gage, Plug, Go/No-Go	32007
108.	Location of starwheel pivot hole	Fixture	32008
109.	Burrs and surface defects ..	Test (4.4.16)	32009

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

Minor:	AQL 2.50 Percent		
201.	Finish inside pivot holes ..	Reference Blocks	32010
202.	Location of "G" sensing spring detent	Vernier Caliper	32011
203.	Minimum height of "G" sensing spring detent	Vernier Caliper	32012
204.	Flatness of inside surface .	Gage, Height & Dial Indicator	32013
205.	Evidence of poor workmanship (see 3.13)	Visual	32014

4.3.2.33 Plate and Spacer Assembly (see dwg. 9220955 covering a detail of dwg. 9220958).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Parts improperly assembled .	Visual	33001
102.	Roll-over insecure	Visual/Manual (4.4.15.5)	33002
Minor:	AQL 0.65 Percent		
201.	Protective finish	Visual	33003

4.3.2.34 Pallet (see dwg. 9220933 covering a detail of dwg. 9220958).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Radius of starwheel contacts	Optical Comparator	34001
102.	Location of pivot hole	Optical Comparator	34002

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the currentversion before use.

103.	Diameter of pivot hole	Gage, Plug, Go/No-Go	34003
104.	Location of notch	Optical Comparator & Templates	34004
105.	Width of notch, max.	Optical Comparator & Templates	34005
106.	Width of notch, min.	Optical Comparator & Templates	34006
107.	Thickness of pallet	Micrometer	34007
108.	Burrs and surface defects ..	Test (4.4.16)	34008
Minor:	AQL 1.50 Percent		
201.	Surface finish inside pivot hole	Reference Blocks	34009
202.	Surface finish on gear contacts	Reference Blocks	34010
203.	Protective finish	Visual	34011
204.	Outside length	Optical Comparator & Templates	34012
205.	Outside width	Optical Comparator & Templates	34013
206.	Evidence of poor workmanship (see 3.13)	Visual	34014

4.3.2.35 Latch, Detent (see dwg. 9220931 covering a detail of dwg. 9241395).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Pivot hole diameter (Datum A)	Gage, Plug, Go/No-Go	35001
102.	Location of pivot hole	Optical Comparator & Templates	35002

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Length pivot hole to retaining arm	Optical Comparator & Templates	35003
104.	Angular configuration improper	Optical Comparator & Templates	35004
105.	Length of retaining arm	Optical Comparator & Templates	35005
106.	Burrs and surface defects ..	Test (4.4.16)	35006
107.	Cracks at 90 degree bend ...	Visual	35007
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	35008
202.	Evidence of poor workmanship (see 3.13)	Visual	35009

4.3.2.36 Bias Mass Assembly (see dwg. 9220958 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Parts missing or improperly assembled	Visual	36001
102.	Starwheel does not operate freely	Manual	36002
103.	Pallet does not operate freely	Manual	36003
104.	Burrs and surface defects ..	Test (4.4.16)	36004
105.	Crimping of helical torsion spring shaft inadequate	Visual	36005
106.	Bias mass assembly does not operate freely		
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	36007

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.37 Spring, Helical, Compression - Detent (see dwg. 9220934 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 1.50 Percent		
201.	Load at assembled height ...	Gage & Fixture	37001
202.	Protective finish	Visual	37002
203.	Evidence of poor workmanship (see 3.13)	Visual	37003

4.3.2.38 Spring, Helical Torsion - "G" Sensing (see dwg. 9220967 covering a detail of dwg. 9220958).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Length of free end inadequate	Optical Comparator	38001
102.	Protective finish	Visual	38002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	38003

4.3.2.39 Base, Safety and Arming Device (see dwg. 9241448 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Location of piston actuator hole (Hole F)	Fixture	39001

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

be mounted so that the fluted segments are in a vertical position. The

102.	Location of rotor contact stud hole (Hole C)	Fixture	39002
103.	Burrs and surface defects ..	Test (4.4.16)	39003
104.	Flatness	Gage, Height, Dial Indicator	39004
105.	Distance between support mounting surfaces	Vernier Calipers	39005
106.	Distance from base to rear support mounting surface ...	Optical Comparator	39006
107.	Radius at rear support mounting surface, max.	Optical Comparator	39007
Minor:	AQL 2.5 Percent		
201.	Front support base mounting hole thread size	Gage Thread	39008
202.	Location of front support base mounting hole	Fixture	39009
203.	Rear support base mounting hole thread size	Gage Thread	39010
204.	Location of rear support base mounting hole	Fixture	39011
205.	Evidence of poor workmanship (see 3.13)	Visual	39012

4.3.2.40 Spring, Helical, Torsion - Rotor (see dwg. 9220909 covering a detail of dwg. 9220951).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 1.50 Percent		
201.	Length of free end	Optical Comparator	40001
202.	Spring diameter, max.	Vernier Calipers	40002
203.	Protective finish inadequate	Visual	40003
204.	Evidence of poor workmanship (see 3.13)	Visual	40004

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the currentversion before use.

4.3.2.41 Arming Delay Time Mechanism Assembly (see dwg. 9220951 covering a detail of dwg. 9220959).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Parts missing or improperly assembled	Visual	41001
102.	Rotor spring improperly assembled	Visual	41002
103.	Front support plate not fully seated on base	Visual	41003
104.	Rear support plate not fully seated on base	Visual	41004
Minor:	None defined.		

4.3.2.42 Contact, Electrical, Stud (see dwg. 9220912 covering a detail of dwg. 9220965).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Length from terminal post to collar	Template, Go/No-Go	42001
102.	Length from collar to spherical end	Snap Gage or Optical Comparator	42002
Minor:	AQL 1.00 Percent		
201.	Diameter of terminal post, rivet end	Micrometer	42003
202.	Protective finish	Visual	42004

4.3.2.43 Terminal Board - Base (see dwg. 9220926 covering a detail of dwg. 9220965).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Major:	AQL 1.00 Percent		
101.	Diameter of electrical contact No. 1 through hole	Gage, Plug, Go/No-Go	43001
102.	Location of electrical contact No. 1 hole	Fixture	43002
103.	Diameter of electrical contact No. 2 through hole	Gage, Plug, Go/No-Go	43003
104.	Location of electrical contact No. 2 hole	Fixture	43004
105.	Location of stud electrical contact boss	Fixture	43005
106.	Location of internal grounding post hole	Fixture	43006
Minor:	AQL 4.00 Percent		
201.	Outside diameter of stud contact boss	Gage, Ring, Go/No-Go	43007
202.	Location of cover mounting holes	Fixture	43008
203.	Outside diameter of actuator boss	Gage, Ring, Go/No-Go	43009
204.	Location of actuator boss ..	Fixture	43010
205.	Length of stud electrical contact cavity	Gage, Depth	43011
206.	Datum A diameter (base mating diameter)	Vernier Calipers	43012
207.	Inside diameter of stud contact cavity	Gage, Plug, Go/No-Go	43013
208.	Evidence of poor workmanship (see 3.13)	Visual	43014

4.3.2.44 Terminal Board and Contact Assembly (see dwg. 9220965 covering a detail of dwg. 9220962).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Parts improperly assembled or missing	Visual	44001
Minor:	AQL 0.65 Percent		
201.	Riveting improper or inadequate	Visual/Manual (4.4.15.1)	44002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.45 Actuator, Piston, Miniature (see dwg. 9220954 covering a detail of dwg. 9220962).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 0.65 Percent		
201.	Outside diameter of case, plug end	Gage, Ring, Go/No-Go	45001

4.3.2.46 Terminal Board Assembly, Electrical - Base (see dwg. 9220962 covering a detail of dwg. 9220959).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 1.50 Percent		
201.	Soldering inadequate	Test (4.4.15.4)	46001
202.	Actuator sealant inadequate.	Visual	46002
203.	Parts improperly assembled .	Visual	46003
204.	Piston actuator wires in contact	Visual	46004

4.3.2.47 Contact, Electrical, Threaded (see dwg. 9233189 covering a detail of dwg. 9225959)!

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Overall length	Vernier Calipers	47001

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

102.	Thread size, major diameter	Snap, Adjustable, Go/No-Go	47002
103.	Thread size, pitch diameter	Gage, Thread, Ring No. 3-56 UNF-2A	47003
104.	Length of thread, min.	Optical Comparator & Template	47004
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	47005
202.	Evidence of poor workmanship (see 3.13)	Visual	47006

4.3.2.48 Indicator, Warning (see dwg. 9220979 covering a detail of dwg. 9220959).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Location of color of painted areas	Visual	48001
Major:	AQL 0.40 Percent		
101.	Location of mounting slots .	Fixture	48002
Minor:	AQL 1.50 Percent		
201.	Diameter of slot circle (Datum A)	Optical Comparator	48003
202.	Width between slots (mounting width)	Flat Plug	48004
203.	Thickness of painted shelf .	Micrometer	48005
204.	Evidence of poor workmanship (see 3.13)	Visual	48006
205.	Sides of slot not free of paint	Visual	48007

4.3.2.49 Insulator, Plate (see dwg. 9220921 covering a detail of dwg. 9220959).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the currentversion before use.

Major:	AQL 1.00 Percent		
101.	Diameter of hole below countersink	Gage, Plug, Go/No-Go	49001
102.	Location of hole relative to notches	Fixture	49002
103.	Length between notches	Vernier Calipers	49003
104.	Width between notches	Vernier Calipers	49004
105.	Overall height	Vernier Calipers	49005
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	49006

4.3.2.50 Spacer, Non-Metallic - Detonator (see dwg. 9241375 covering a detail of dwg. 9220918).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Length, max.	Vernier Calipers	50001
Minor:	AQL 1.50 Percent		
201.	Outside diameter, max.	Gage, Ring, Go	50002
202.	Inside diameter, min.	Gage, Plug, Go	50003
203.	Evidence of poor workmanship (see 3.13)	Visual	50004

4.3.2.51 Safety and Arming Mechanism Assembly (see dwg. 9220959 covering a detail of dwg. 9220961).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Parts improperly installed or missing	Visual	51001

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

102.	Rotor pin does not touch top of support slot (armed position)	Visual	51002

Minor: None defined.

4.3.2.52 Cover, Access (see dwg. 9220981 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Location of electrical receptacle connector-cover mounting hole	Fixture	52001
102.	Location of electrical receptacle connector-plug (-1) mounting hole	Fixture	52002
103.	Diameter of electrical receptacle connector-plug (-1) mounting hole	Gage, Plug, Go/No-Go	52003
104.	Location of electrical receptacle connector-plug (-2) mounting hole	Fixture	52004
105.	Diameter of electrical connector-plug (-2) mounting hole	Gage, Plug, Go/No-Go	52005
106.	Terminal board-base mating diameter	Gage, Ring, Go/No-Go	52006
Minor:	AQL 1.50 Percent		
201.	Center ground (cover) hole thread size	Gage, Thread	52007
202.	Depth of center ground tapped hole	Gage, Thread Plug w/Step	52008
203.	Protective finish	Visual	52009
204.	Evidence of poor workmanship (see 3.13)	Visual	52010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.53 Cover Assembly (see dwg. 9220980 covering a detail of dwg. 9220961).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Parts improperly assembled or missing	Visual	53001
102.	Dimension between pins	Location Gage	53002
Minor:	AQL 1.50 Percent		
201.	Soldering inadequate or incomplete	Test (4.4.15.4)	53003
202.	Riveting insecure	Visual/Manual (4.4.15.1)	53004
203.	Evidence of poor workmanship (see 3.13)	Visual	53005
204.	Roll-over incomplete	Visual	53006

4.3.2.54 Housing (see dwg. 9241446 covering a detail of dwg. 9257615).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of lead charge cavity	Gage, Plug, Go/No-Go	54001
102.	Outside diameter forward of flange (lead charge end)	Gage, Ring, Go/No-Go	54002
103.	Concentricity of outside diameter forward of flange with lead charge cavity	Fixture, Dial Indicator	54003
104.	Thickness of base of lead charge cavity	Indicator Thickness	54004

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

105.	Outside diameter of lead charge boss	Special Ring Gage, Go/No-Go	54005
106.	True position of lead charge boss with lead charge cavity	Fixture	54006
107.	Location of mounting holes .	Fixture	54007
108.	Distance base of lead charge cavity to bottom of housing	Dial Depth Gage	54008
109.	Diameter of flange, max. ...	Vernier Caliper	54009
110.	Distance end surface to flange	Depth Micrometer	54010
Minor:	AQL 2.5 Percent		
201.	Perpendicularity of end surfaces with outside diameter	V-Block Dial Indicator Holding Fixture	54011
202.	Distance open end surface to bottom of mechanism cavity	Dial Depth Gage	54012
203.	Thread size improper	Gage, Thread Plug	54013
204.	Evidence of poor workmanship (see 3.13)	Visual	54014

4.3.2.55 Spacer, Sleeve - Latch (see dwg. 9220970 covering a detail of dwg. 9241388).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Length of spacer collar	Vernier Calipers	55001
102.	Outside diameter staking end	Gage, Ring, Go/No-Go	55002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Outside diameter threaded end	Gage, Ring, Go/No-Go	55003
104.	Concentricity of staking end to threaded end	Concentricity Gage	55004
105.	Distance threaded end to shoulder	Depth, Micrometer	55005
106.	Radii at intersection of shoulder and small outside diameter	Optical Comparator	55006
Minor:	AQL 1.50 Percent		
201.	Distance roll-over end to shoulder	Vernier Calipers	55007
202.	Outside diameter of spacer	Gage, Ring, Go/No-Go	55008
203.	Thread size	Gage, Thread, Plug, 0-80 UNF-2A	55009
204.	Evidence of poor workmanship (see 3.13)	Visual	55010

4.3.2.56 Housing Assembly (see dwg. 9257615 covering a detail of dwg. 9241447).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Window insecure	Manual	56001
102.	Evidence of voids, holes or incomplete seal between window and housing	Visual	56002
103.	Ring gage fails to pass over window	Ring, Gage, Go	56003
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	56004

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.57 Screw, Machine, Pan Head - No. 4 (see dwg. 9220927 covering a detail of dwg. 9220961).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 1.00 Percent		
201.	"O" ring missing	Visual	57001
202.	Screw thread size improper .	Gage, Thread Ring	57002

4.3.2.58 Housing, Explosive Harness Assembly (see dwg. 9241447).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Lead charge missing or improperly assembled - green showing	Visual	58001
102.	Housing or base of lead charge cavity damaged from staking operation	Visual	58002
Minor:	None defined.		

4.3.2.59 Explosive Harness Assembly, Guided Missile Warhead (see dwg. 9220893 covering a detail of dwg. 9241447).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Overall length	Holder, Dial Indicator	59001
102.	Outside diameter	Holder, Dial Indicator	59002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Coating colors improper	Visual	59003
Minor:	AQL 1.00 Percent		
201.	Lacquer coating improper or inadequate	Visual	59004
202.	Lead cup not rolled securely	Visual	59005

4.3.2.60 Safety and Arming Device (see dwg. 9220961).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Warning indicator shows red color (unit armed)	Visual	60001
2.	Warning indicator not visible	Visual	60002
3.	Shorting clip missing or loose	Visual/Manual	60003
Major:	AQL 0.65 Percent		
101.	Parts missing or improperly assembled	Visual	60004
102.	Parts loose	Manual	60005
103.	Bias mass not locked by retaining plate	Visual	60006
Minor:	AQL 0.65 Percent		
201.	Overall length, max.	Vernier Calipers	60007

4.3.2.61 Contact, Electrical - No. 1 (see dwg. 9220896 covering a detail of dwg. 9220965).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.65 Percent		
101.	Shaft diameter of rivet end.	Optical Comparator	61001
102.	Shaft diameter of contact end	Optical Comparator	61002

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

103.	Collar diameters	Gage, Ring, Go/No-Go	61003
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	61004
202.	Evidence of poor workmanship (see 3.13)	Visual	61005

4.3.2.62 Contact, Electrical (see dwg. 9233186 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Overall length	Vernier Calipers	62001
102.	Shaft diameter, small end ..	Gage, Ring, Go/No-Go	62002
103.	Shaft diameter, large slotted end	Gage, Ring, Go/No-Go	62003
104.	Location of slot	Fixture Symmetry	62004
105.	Length of large slotted end	Vernier Calipers	62005
106.	Hole diameter, slotted end .	Gage, Plug, Go/No-Go	62006
107.	Hole diameter, small end ...	Gage, Plug, Go/No-Go	62007
108.	Countersink, small end, missing	Visual	62008
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	62009
202.	Evidence of poor workmanship (see 3.13)	Visual	62010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.63 Insulator, Bushing (see dwg. 9233187 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Overall length	Vernier Calipers	63001
102.	Hole diameter, small end ...	Gage, Plug, Go/No-Go	63002
103.	Hole diameter, large end ...	Gage, Plug, Go/No-Go	63003
104.	Depth of large hole	Depth Micrometer	63004
105.	Large outside diameter	Gage, Ring, Go/No-Go	63005
106.	Length of large collar	Vernier Calipers	63006
107.	Small outside diameter	Gage, Ring, Go/No-Go	63007
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	63008

4.3.2.64 Housing, Electrical - Connector (see dwg. 9233188 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Overall length	Vernier Calipers	64001
102.	Hole diameter, small end ...	Gage, Plug, Go/No-Go	64002
103.	Hole diameter, large end ...	Gage, Plug, Go/No-Go	64003
104.	Depth of large hole	Depth Micrometer	64004

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

105.	Distance from large end to threaded end face of collar	Vernier Calipers	64005
106.	Thread size	Gage, Thread, Ring No. 5-44 UNF-2A	64006
107.	True location, large inside diameter to Datum A	Fixture	64007
108.	Outside diameter, large collar	Gage, Ring, Go/No-Go	64008
109.	Length of thread, min.	Thread, Ring w/Step	64009
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	64010
202.	Evidence of poor workmanship (see 3.13)	Visual	64011

4.3.2.65 Pin, Grooved, Headless (see dwg. 9220894 covering a detail of dwg. 9220902).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Outside diameter, grooved end	Gage, Ring, Go/No-Go	65001
102.	Outside diameter, rounded head end	Gage, Ring, Go/No-Go	65002
103.	Surface finish, rounded head to grooves	Profilometer	65003
Minor:	AQL 1.00 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	65004
202.	Protective finish missing or improper	Visual	65005

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the currentversion before use.

4.3.2.66 Nut, Plain, Hex (see dwg. 9233192 covering a detail of dwg. 9220801).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Thread size	Gage, Thread, Plug No. 5-44 UNF-2B	66001
Minor:	AQL 0.65 Percent		
201.	Protective finish	Visual	66002

4.3.2.67 Leaf and Gear Assembly (see dwg. 9241376 covering a detail of dwg. 9220956).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Runout of spur gear to shaft	Hardinge Chuck, Height Gage, Dial Indicator	67001
102.	Staking insecure	Visual/Manual (4.4.15.2)	67002
103.	Parts improperly assembled .	Visual	67003
Minor:	AQL 0.65 Percent		
201.	Protective finish	Visual	67004

4.3.2.68 Rear Support and Spacer Assembly (see dwg. 9241387 covering a detail of dwg. 9220905).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

Major:	AQL 0.40 Percent		
101.	Spacers insecure	Visual/Manual (4.4.15.5)	68001
102.	Parts improperly assembled .	Visual	68002
Minor:	AQL 1.00 Percent		
201.	Roll-over protrudes beyond indicated surface	Visual	68003
202.	Protective finish	Visual	68004

4.3.2.69 Front Support and Spacer Assembly (see dwg. 9241388 covering a detail of dwg. 9220957).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Parts improperly assembled .	Visual	69001
102.	Spacer insecure	Visual/Manual (4.4.15.5)	69002
Minor:	AQL 0.65 Percent		
201.	Protective finish	Visual	69003

4.3.2.70 Connector, Receptacle, Electrical - Plug (see dwg. 9220901-1 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Diameter of small end shaft,	Gage, Ring, Go/No-Go	70001
102.	Diameter of "O" ring seating surface	Gage, Ring, Go/No-Go	70002
103.	Protective finish	Visual	70003
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	70004

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.71 Connector, Receptacle, Electrical - Plug (see dwg. 9220901-2 covering a detail of dwg. 9220980).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Diameter of small end shaft.	Gage, Ring, Go/No-Go	71001
102.	Protective finish	Visual	71002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (3.13)	Visual	71003

4.3.2.72 Plate, Retaining (see dwg. 9220935 covering a detail of dwg. 9220957).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Diameter of pivot hole	Gage, Plug, Go/No-Go	72001
102.	Location of pivot hole	Optical Comparator & Template	72002
103.	Finish inside pivot hole ...	Reference Blocks	72003
104.	Finish of bias mass contact surface	Reference Blocks	72004
105.	Thickness of plate	Micrometer	72005
106.	Location of detent retaining notch	Optical Comparator & Template	72006
107.	Configuration of bias mass contact surface	Optical Comparator & Template	72007

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

108.	Burrs or surface defects ...	Test (4.4.16)	72008
Minor:	AQL 1.00 Percent		
201.	Protective finish	Visual	72009
202.	Evidence of poor workmanship (see 3.13)	Visual	72010

4.3.2.73 Carton, Packing, Ammunition for Fuze, GM: M118 (see dwg. 9233182).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Components missing or loose	Visual/Manual	73001
102.	Carton damaged	Visual	73002
Minor:	AQL 1.00 Percent		
201.	Marking improper or missing.	Visual	73003
202.	Evidence of poor workmanship (see 3.13)	Visual	73004

4.3.2.74 Box, Packing, Ammunition for Fuze, GM: M118 (see dwg. 9233183).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 Percent		
101.	Cartons loose	Visual/Manual	74001
102.	Straps loose	Visual	74002
103.	Box damaged	Visual	74003
Minor:	AQL 1.00 Percent		
201.	Marking missing or incorrect	Visual	74004
202.	Evidence of poor workmanship (see 3.13)	Visual	74005

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.75 Contact, Electrical - No. 2 (see dwg. 9220897 covering a detail of dwg. 9220965).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.65 Percent		
101.	Length from collar to chamfered end	Length, Gage	75001
102.	Length from collar to roll-over end	Length, Gage	75002
103.	Diameter of pin chamfered end	Gage, Ring, Go/No-Go	75003
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	75004

4.3.2.76 Clip, Electrical Shorting (see dwg. 9241396 covering a detail of dwg. 9220961).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 Percent		
101.	Total length	Vernier Caliper	76001
102.	Width of loops (pin bearing surfaces)	Gage, Plug, Go/No-Go	76002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	76003

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.2.77 Inspection of detail parts of Assembly 9220961 not otherwise listed above.


The following parts shall be inspected for drawing dimensions (see 3.4) and workmanship (see 3.13) according to MIL-STD-105, Special Inspection Level S-4 at a 1.5% AQL. The contractor shall supply a certificate that the material and protective finish complies with the drawing requirements. All inspections for the following components shall be classed as Minor Defects.

Drawing Number	Nomenclature
9220910	Rivet, Tubular - Rotor Contact
9220913	Terminal Board - Rotor
9220914	Contact, Electrical - Rotor
9220915	Insulator, Plate - Rotor
9220952	Setscrew, Hexagon Socket
9220968	Bushing, Sleeve
9220973	Insulation, Sleeving, Electrical
9220987	Washer, Non-Metallic - Cover
9233175	Pin, Straight, Headless
9233191	Washer, Lock, Flat, Internal Tooth
9220984	Terminal, Lug
9220985	Terminal, Lug - Ground
9241392	Cup, Lead
9241393	Disc, Closing

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

FIGURE 1

FIRST ARTICLE SEQUENTIAL ENVIRONMENTAL TESTS

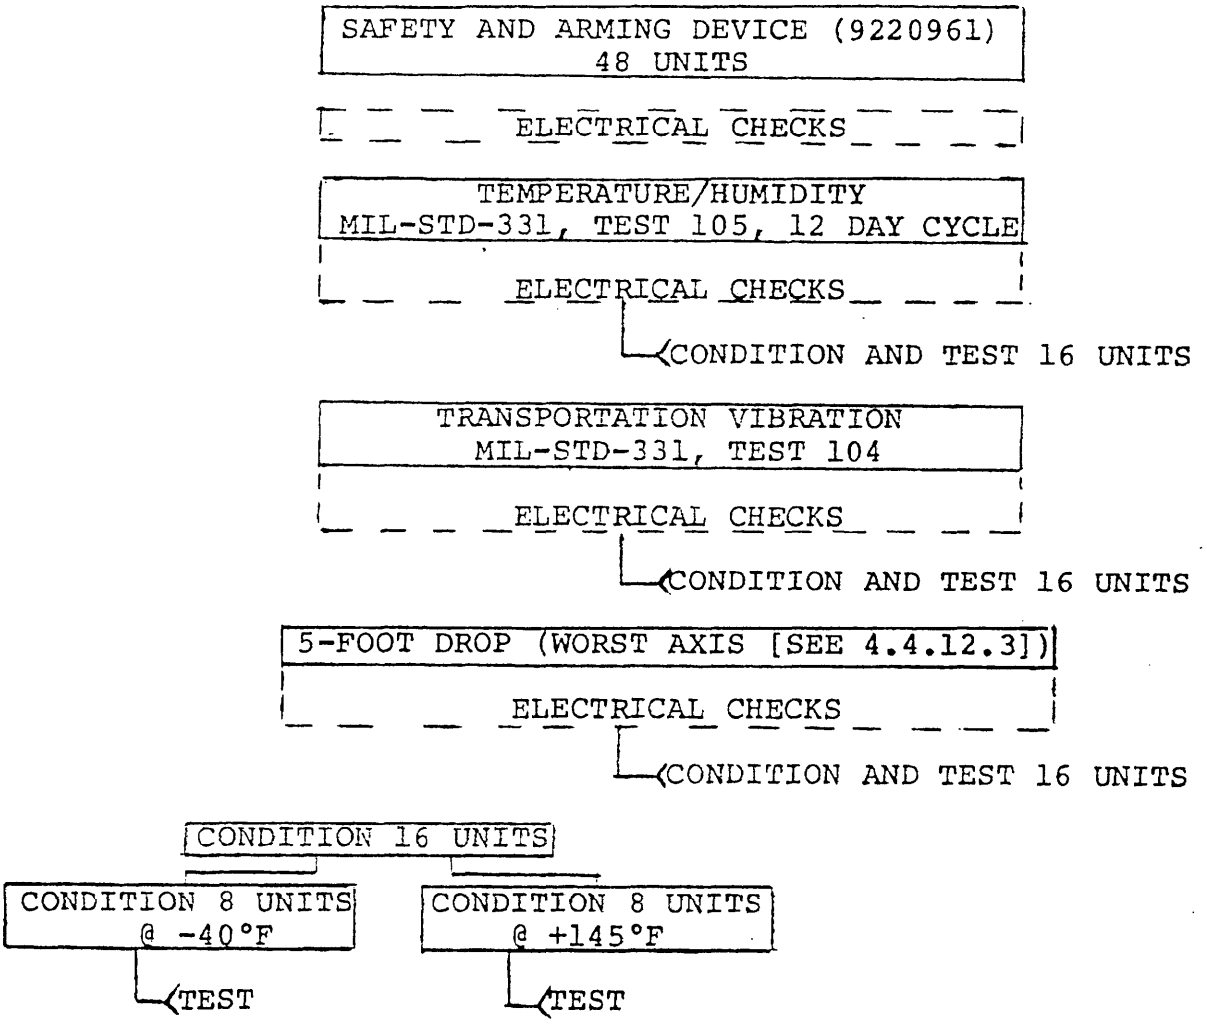

TEST - Bias Mass and Rotor Delay Time/Arming Test at conditioned temperature plus Electrical Functioning for Explosive Output per MIL-STD-331, Test 301.1 (see 4.4.12).

Source: https://assist.dla.mil -- Downloaded: 202640-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.3 Testing

4.3.3.1 First Article (see 3.1 and 4.2.1). - The assemblies and components submitted as the first article (pilot lot) samples shall be inspected and tested as specified in Table I and Figure I after having been examined for requirements as specified in 4.2.2. Rejection and re-submission shall be in accordance with 4.2.3. Equipment used shall be as specified in the applicable paragraphs, Table I and in accordance with the requirements of 4.3.4. Test results shall be recorded and forwarded in accordance with 6.6. All defects listed in Table I shall be considered as Major unless otherwise specified.

4.3.3.2 Production. - Testing for production lot acceptance shall be performed in accordance with Table II and Figure 2 after the assemblies and components have been inspected as specified in 4.3.1 and 4.3.2. All defects listed in Table II shall be considered as Major unless otherwise specified. When 100 percent inspection is specified for a given defect, all defective units of product shall be removed from the lot. Equipment used for all tests and examinations shall be as specified in the applicable paragraphs, in Table II and in accordance with the requirements of 4.3.4.

4.3.3.2.1 Molded Components. - At the start of production from a new mold, or repair to a mold or cavity, consecutively produced units from each mold or cavity shall be dimensionally examined until four (4) consecutive units meet all applicable drawing requirements. After adjustment or repair, those dimensions affected by the adjustment or repair shall be examined. During production, the molding procedures shall be monitored for uniformity of molding practices. Suspected deviations in mold product shall be examined to determine if corrective action or mold repair is required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE I

FIRST ARTICLE TESTING

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
Spring Embrittlement:						
Helical Comp-Detent	37004	3.4	4.4.1	20	9220934	Pull Test Fixture
Helical Torsion-Rotor	40005	3.4	4.4.1	20	9220909	Pull Test Fixture
Helical Torsion "g" Leaf	38004	3.4	4.4.1	20	9220967	Pull Test Fixture
Electrical Resistance:						
Unarmed	51003	3.5.1.1	4.4.2.1.1	10	9220959	Milliohmeter
Armed	51004	3.5.1.2	4.4.2.1.2		9220959	Current Limited
Insulation Resistance:						
To Nose Crush Switch	60008	3.5.2.1	4.4.2.2.1	100%	9220961	Megohmeter
To Battery	60009	3.5.2.2	4.4.2.2.2		9220961	Current Limited
In S&A Device:						
Piston Actuator Resistance	60010	3.5.2.3.1	4.4.2.3.4	100%	9220961	Milliohmeter Current Limited
S&A Assembly Bias Mass Functioning						Centrifuge Holding Fixture Release Mechanism Pulse
Time @ 200g's	51005	3.6.1	4.4.3.1		9220959	Generator, 10KH2 Electrical
Time @ 500g's	51006	3.6.1	4.4.3.1	10		Counter Associated Electrical Switching Circuits
Rotor Delay Time		3.7				
S&A Mechanism Assembly		3.7.1	4.4.4.1	10	9220959	Holding Fixture, Pulse Generator 10KH2 Electrical
Less Than Min.	51007					Counter Associated Electrical Switching Circuits
More Than Max.	51008					

Source: https://assist.dla.mil -- Downloaded: 202640-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE I - CONTINUED

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
S&A Device @ -40°F:			4.4.10			
Piston Actuator Resistance	60011	3.5.2.3.1	4.4.2.3.4	24	9220961	Centrifuge, Timer, Holding Fixture with Safety Enclosure Power Supply, Electronic Counter, Current Limited Milliohmeter
Arming Test	60012		4.4.19.1	24		
Rotor Delay Time				12		
Less Than Min.*	60013	3.7.2.2	4.4.19.2			
Avg. -2 Sigma Less Than Min.	60014					
Avg. +2 Sigma More Than Max.	60015					
Bias Mass Functioning Time @ 300g's	60016	3.6.2.2	4.4.19.2	12		
S&A Device @ +145°F:			4.4.10			
Piston Actuator Resistance	60017	3.5.2.3.1	4.4.2.3.4	24		Centrifuge, Timer, Holding Fixture with Safety Enclosures Power Supply, Electronic Counter, Current Limited Milliohmeter
Arming Test	60018		4.4.19.1	24		
Rotor Delay Time				12		
Less Than Min.*	60019	3.7.2.1	4.4.19.2			
Avg. -2 Sigma Less Than Min.	60020					
Avg. +2 Sigma More Than Max.	60021					
Bias Mass Functioning Time @ 300g's	60022	3.6.2.1	4.19.2	12		
Switch Chatter	60033	3.8	4.4.5	20	9220961 (Dummy Lead Charge)	Fixture Simulating Warhead, Vibration Machine Power Supply, Oscilloscope
Dielectric Strength		3.9	4.4.6			
Rotor Assembly	20004	3.9.1		10	9220917	Power Supply (0-300) (VRMS) AC Micrometer
Cover Assembly	53007	3.9.2		10	9220980	
Rotor Grooved-Pin Push Test	19005	9220902	4.4.7	10	9220902	Test Fixture with 2 Lb. Static Load
Material Hardness:			4.4.8			Rockwell Hardness Test Machine
Ground Contact	16007	9220911		10	9220911	
Detent Latch	35010	9220931		10	9220931	

Source: https://assist.dla.mil -- Downloaded: 2026/0-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE I - CONTINUED

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
Environmental and Sequential Tests:					9220961	
Temperature/Humidity	60023	3.10.2	4.4.12.1	48 (See Figure 1)		Per MIL-STD-331, Test 105, 12 Day Cycle
Transportation Vibration	60024	3.10.1	4.4.12.2	32 (See Figure 1)		Per MIL-STD-331, Test 105, Procedure II
5-Foot Drop	60025	3.10.3	4.4.12.3	16 (See Figure 1)		Per MIL-STD-331, Test 111
Safety Tests:					9220961	
Jolt	60026	3.11.1	4.4.13.1	6		Per MIL-STD-331, Test 101
Jumble	60027	3.11.2	4.4.13.2	6		Per MIL-STD-331, Test 102
Destructive Functioning:					9220961	0-40 VDC Power Supply, 0.4 Ohm Non-Inductive Resistor Push Button Switch
Electrical Function:	60028	3.12	4.4.9	48		Block per MIL-STD-331, Test 301.1, Centrifuge Holding Fixture with Explosion Proof Enclosure, Milliohmeter Current Limited
Detonator Resistance	60029	3.5.1.2	4.4.19.1	48		
S&A Safe:						
Non-Arming Test*	60030	3.17	4.18	100%	9220961	Centrifuge, Fixture
Visually Unarmed*	60031		4.4.11	100%	9220961	Visual Inspection
Shorting Clip Improper*	60032		4.4.11	100%	9220961	Visual Inspection

*Critical Defect

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE II

PRODUCTION LOT ACCEPTANCE TESTING

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
Spring Embrittlement:						
Helical Comp-Detent	37004	3.4	4.4.1	20	9220934	Pull Test Fixture
Helical Torsion-Rotor	40005	3.4	4.4.1	20	9220909	Pull Test Fixture
Helical Torsion-"g" Sensing	38004	3.4	4.4.1	20	9220967	Pull Test Fixture
Electrical Resistance:						
Unarmed	51003	3.5.1.1	4.4.2.1.1	100%	9220959	Milliohmeter
Armed	51004	3.5.1.2	4.4.2.1.2	100%	9220959	Current Limited
Insulation Resistance:						
To Nose Crush Switch	60008	3.5.2.1	4.4.2.2.1	100%	9220961	Megohmeter, Voltage Supply and Current Limiting Resistance
To Battery Connector	60009	3.5.2.2	4.4.2.2.2	100%	9220961	
Piston Actuator @-40°F:						
Motion of Piston	45002	9220954	4.4.2.3.1.2	(b)	9220954	Test Fixture, Oscilloscope, Pulse Generator, Microammeter, Microvoltmeter, Power Supply, Current Limiting Resistance
Resistance Before Firing	45003	3.5.2.3.1	4.4.2.3.1.1		9220954	
Resistance After Firing	45004	3.5.2.3.2	4.4.2.3.1.2		9220954	
Functioning Time	45005	9220954	4.4.2.3.1.2			
Piston Actuator @ +145°F:						
Motion of Piston	45006	9220954	4.4.2.3.2	(b)	9220954	
Resistance Before Firing	45007	3.5.2.3.1	4.4.2.3.2		9220954	
Resistance After Firing	45008	3.5.2.3.2	4.4.2.3.2		9220954	
Functioning Time	45009	9220954	4.4.2.3.2			
In S&A Device:						
Piston Actuator Resistance	60010	3.5.2.3.1	4.4.2.3.4	100%	9220961	Milliohmeter, Current Limited
Piston Actuator Environmental Tests:						
Temperature Humidity	45010	3.16.1	4.4.2.3.5	48	9220954	MIL-STD-331, Test 105, 12 Days
Transportation Vibration	45011	3.16.2	4.4.2.3.5	32	9220954	MIL-STD-331, Test 104.
5-Foot Drop	45012	3.16.3	4.4.2.3.5	16	9220954	MIL-STD-331, Test 111.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE II - CONTINUED

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
Function Test:						
@ -40°F	45013	9220954	4.4.2.3.1.1 4.4.2.3.1.2	24	9220954	Test Fixture, Power Supply, Oscilloscope, Pulse Generator, Microammeter, Microvoltmeter, Current Limiting Resistance
@ +145°F	45014	9220954	4.4.2.3.1.1 4.4.2.3.1.2	24	9220954	
Bias Mass Functioning: S&A Mech. Assembly		3.6	4.4.3	100%	9220959	Centrifuge Holding Fixture, Release Mechanism Pulse Generator, 10KH2, Electrical Counter Associated Electrical Switching Circuits
Time @ 200g's	51005	3.6.1	4.4.3.1			
Time @ 500g's	51006	3.6.1	4.4.3.1			
Rotor Delay Time: S&A Mech. Assembly		3.7 3.7.1	4.4.4.1	100%	9220959	Holding Fixture Pulse Generator, 10KH2 Electrical Counter Associated Electrical Switching Circuits
Less Than Min.*	51007					
More Than Max.	51008					
Dielectric Strength		3.9	4.4.6			Power Supply (0-300 VRMS) and AC Microammeter
Rotor Assembly	20004	3.9.1		100%	9220917	
Cover Assembly	53007	3.9.2		100%	9220980	
Rotor Grooved Pin Push Test	19005	9220902	4.4.7	100%	9220902	Test Fixture with 2 Lb. Static Load
Material Hardness			4.4.8			Rockwell Hardness Test Machine
Ground Contact	16007	9220911		4.4.8	9220911	
Detent Latch	35010	9220931		4.4.8	9220931	
Explosive Hardness Assembly: Explosive Output	59006	3.15.1	4.4.14	(b)	9220893	Per MIL-STD-331, Test 301.1

Source: https://assist.dla.mil -- Downloaded: 20260-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE II - CONTINUED

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
S&A Safe:		4.4.11	4.4.11		9220961	
Visually Unarmed*	60031			100%		Visual Inspection
Shorting Clip Proper*	60032			100%		Visual Manual
Non-Arming Test*	60030	3.17	4.4.18	100%	9220961	Centrifuge, Fixture
Environmental Testing:						
S&A Device		Figure 2		Table III+	9220961	
Jolt	60026	3.11.1	4.4.13.1	& Figure 2		Per MIL-STD-331, Test 101
Jumble	60027	3.11.2	4.4.13.2			Per MIL-STD-331, Test 102
Transportation						
Vibration	60024	3.10.1	4.4.12.2			Per MIL-STD-331, Test 104
5-Foot Drop	60025	3.10.3	4.4.12.3			Per MIL-STD-331, Test 111
S&A Device @ -40°F:			4.4.10			
Piston Actuator Resistance	60011	3.5.2.3.1	4.4.2.3.4	Table III+		
Arming Test	60012		4.4.19.1	& Figure 2	9220961	Centrifuge Mounting Temperature Chamber Holding Nest with Release Mechanism, Electrical Counter, Oscilloscope, Associated Electrical Switching Circuits, Current Limiting Milliohmeter
Rotor Delay Time						
Less Than Min.*	60013	3.7.2.2	4.4.19.2			
Avg. -2 Sigma Less Than Min.	60014	3.7.2.2				
Avg. +2 Sigma More Than Max.	60015	3.7.2.2				
Bias Mass Function Time @ 300g's	60016	3.6.2.2	4.4.19.2			
S&A Device @ +145°F:			4.4.10			
Piston Actuator Resistance	60017	3.5.2.3.1	4.4.2.3.4	Table III+		
Arming Test	60018		4.4.19.1	& Figure 2	9220961	Centrifuge Mounting Temperature Chamber Holding Nest with Release Mechanism, Electrical Counter, Oscilloscope, Associated Electrical Switching Circuits, Current Limiting Milliohmeter
Rotor Delay Time						
Less Than Min.*	60019	3.7.2.1	4.4.19.2			
Avg. -2 Sigma Less Than Min.	60020	3.7.2.1				
Avg. +2 Sigma More Than Max.	60021	3.7.2.1				
Bias Mass Function Time @ 300g's	60022	3.7.2.1	4.4.19.2			
Destructive Functioning:						
Electrical Functioning	60028	3.12	4.4.9	Table III+ & Figure 2	9220961	Centrifuge Mounted in Explosive Proof Housing, Holding Nest, Power Supply 0-40 VDC, 0.4 Ohm Resistor, Dent Block per MIL-STD-331, Test 301.1
Detonator Resistance	60029	3.5.1.2	4.4.19.1			Current Limiting Milliohmmeter

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE II - CONTINUED

TEST OR EXAMINATION	DEFECT CODE NO.	REQUIREMENT	TEST METHOD PARAGRAPH	NO. OF SAMPLES	APPLICABLE DRAWING	INSPECTION EQUIPMENT REQUIREMENT
T20E1 Detonator						
Temperature Humidity	78001	3.14.1	4.4.17.1	(a)	8826840	MIL-STD-331, Test 105, 12 Day Cycle, 0-40 VDC Power Supply, 0.4 Ohm Non-Inductive Resistor, Push Button Switch
Function @ -40°F	78002	3.14.2.1	4.4.17.2.1			
Function @ +145°F	78003	3.14.2.2	4.4.17.2.2			

\+ Any defective in sample shall reject lot.

* Critical Defect


(a) MIL-STD-105, General Inspection Level II, Single Sampling Plan, AQL = 0.15 Percent

(b) MIL-STD-105, General Inspection Level II, Single Sampling Plan, AQL = 0.40 Percent

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

FIGURE 2

PRODUCTION LOT ACCEPTANCE TEST

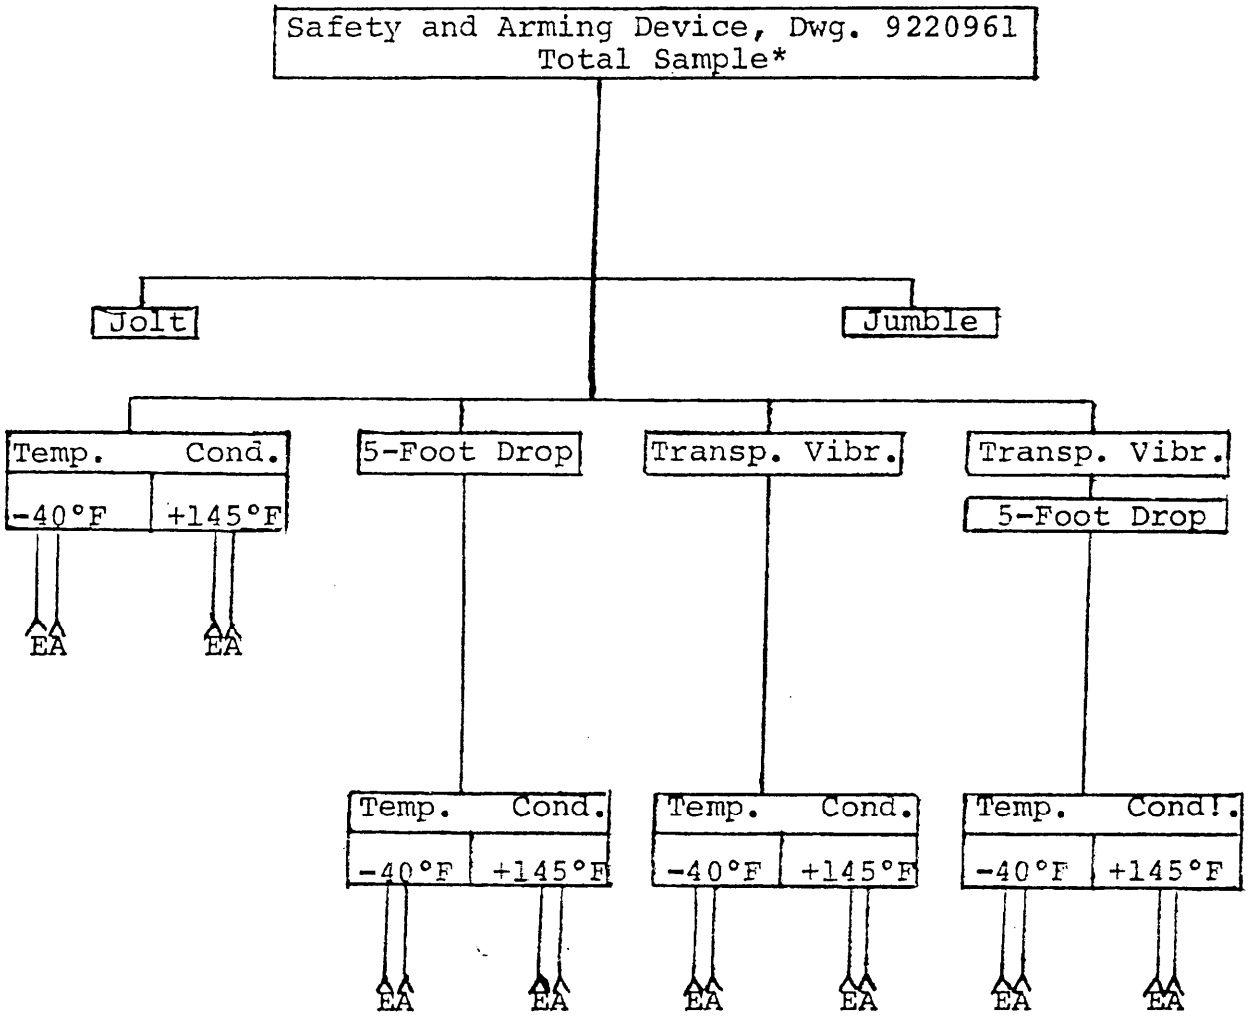

* NOTE: See Table III for sample quantities.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

TABLE III

DISTRIBUTION OF LOT ACCEPTANCE SAMPLES

(Used in Figure 2 Tests)

PRODUCTION LOT SIZE / TEST CATEGORIES	NUMBER OF S&A DEVICES					
	0-500		501-1200		1201-3000	
	EACH	TOTAL	EACH	TOTAL	EACH	TOTAL
4E's @ - 40°F	3	12	4	16	5	20
4A's @ - 40°F	1	4	2	8	3	12
4E's @ +145°F	3	12	4	16	5	20
4A's @ +145°F	1	4	2	8	3	12
Jolt		2		2		2
Jumble		2		2		2
Total Sample		36		52		68

NOTE: E = Bias Mass and Rotor Delay Time Test followed by Arming Test and Electrical Functioning.

A = Arming Test as specified in 4.4.19.1 followed by Electrical Functioning.

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

4.3.4 Inspection Equipment. - The inspection equipment required to perform the examinations and tests prescribed in this section is identified under the "Method of Inspection" column in the tables of Paragraphs 4.3.2 and 4.3.3. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract (see 6.2.1).

4.3.4.1 Inspection Equipment Capability and Accuracy. - All inspection equipment and facilities shall be of adequate quality and quantity to perform properly and accurately all the required inspections, measurements and tests. The inspection equipment shall be maintained in satisfactory condition for the continued proper performance of these functions and shall be calibrated in accordance with the provisions of MIL-C-45662.

4.3.4.2 Government Rights to Documentation. - Inspection equipment drawings and lists provided and revised in accordance with the requirements herein may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

4.4 Test Methods and Procedures

4.4.1 Spring Embrittlement. - Sample springs of each spring component shall be selected from each embrittlement relief batch (a batch of the same spring after undergoing embrittlement relief treatment). The spring shall be gripped at its ends in an appropriate pull test fixture. By application and release of gradually increasing degrees of tension, the spring shall be alternately extended and released and re-extended to greater lengths and released until elongated to a point from which it will not return to its original unextended length and contour (point of minimum deformation). Any spring breaking before being extended to that point of minimum deformation shall be classed defective. Failure of one or more units of the sample to meet the requirement shall reject the batch represented by that sample.

4.4.2 Electrical Continuity and Resistance Measurements

4.4.2.1 Electrical Resistance of the S&A Mechanism Assembly (9220959)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.4.2.1.1 Unarmed Condition. - Using an electrical test, meter limiting current to one (1) milliampere maximum, connect the meter across the rotor electrical contact (9220914) and the threaded electrical contact (9233189) in the base. If the test does not reveal a continuous circuit by a meter reading of less than 0.4 ohms, as required by 3.5.1.1, the assembly shall be classed defective.

4.4.2.1.2 Armed Condition. - With the rotor in the "armed" position and using an electrical test meter, limiting current to one (1) milliampere maximum, connect the meter across the electrical contact - No. 2 (9220897) and the threaded electrical contact (9233189) in the base and note the reading. The assembly shall be classed defective if the resistance indicated by this test does not comply with the requirement of 3.5.1.2.

4.4.2.2 Electrical Resistance of the Safety and Arming Device (9220961)

4.4.2.2.1 Insulation Resistance Between the Internal S&A Ground and the Nose-Crush Switch (Missile) Ground. - Using a megohmmeter and limiting the test current to a maximum of one (1) milliampere, connect the meter across the center conductor of the connector (internal S&A ground connection [9233186]) and the electrical receptacle connector plug (cover/shield ground to missile structure [9220901-2]) and note the reading.

4.4.2.2.2 Insulation Resistance Between the Internal S&A Ground and the High Side of the Missile Battery. - Using a megohmmeter and limiting the test current to a maximum of one (1) milliampere, connect the meter across the center conductor of the connector (internal S&A ground connection [9233186]) and the electrical receptacle connector plug [9220901-1]) and note the reading.

4.4.2.2.3 The Safety and Arming Device (9220961) shall be classed defective if the insulation resistance as determined in 4.4.2.2.1 and 4.4.2.2.2 is in either test less than 100 megohms as required in 3.5.2.1 and 3.5.2.2.

WARNING: These tests are conducted on assemblies which contain explosive devices; and because of the potential danger, they should be performed behind a suitable barricade and in a space provided with electro-static shielding.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.4.2.3 Piston Actuator Tests (see dwg. 9220954)

4.4.2.3.1 Minus 40 Degrees F (-40°F). - One half of the sample selected for the piston actuator test shall be conditioned at -40°F ± 5°F for a minimum of two (2) hours.

4.4.2.3.1.1 Pre-Fire Bridge Resistance. - The pre-fire bridge resistance of the temperature conditioned piston actuator shall be measured across the piston actuator leads using an appropriate current limiting test meter.

4.4.2.3.1.2 Functioning. - After testing for pre-fire resistance and with the piston actuator mounted in the required test fixture, the unit shall be functioned according to the following method or equivalent. With the required load (10 pounds) applied to the piston end of the actuator and the proper series resistance (10 ohms) in the firing circuit, the required voltage (18 volts) shall be applied for the specified pulse duration (4 milliseconds). The force gage shall be capable of measuring the initial load as well as the maximum peak reaction (100 pounds) and the test equipment shall be capable of measuring the minimum required piston travel (0.12 inch). The piston actuator shall be functioned and piston motion, post fire resistance and functioning time measured. The post fire resistance shall be measured within 25 milliseconds after application of current using approved test equipment. Functioning time shall be measured to the nearest one tenth of a millisecond. Functioning time is defined as the interval between application of the required voltage to completion of the required minimum distance of travel (0.12 inch).

4.4.2.3.2 Plus 140 Degrees F (+140°F). - One half of the sample selected for the piston actuator test shall be conducted as specified in 4.4.2.3.1 except the conditioning temperature shall be +140°F + 5°F. In the event of unequal samples, the larger half shall be tested at -40°F.

4.4.2.3.3 Rejection. - The piston actuator shall be classed defective if:

a. The pre-fire resistance does not comply with 3.5.2.3.1.

b. The piston actuator fails to function.

c. The piston actuator fails to move the required distance against the specified load.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

d. The peak reaction exceeds the specified limit.

e. The post-fire resistance is less than minimum within 25 milliseconds after application of current (see 3.5.2.3.2).

f. The piston actuator fails to function within ten (10) milliseconds (functioning time).

The lot shall be rejected if the total defectives from hot and cold tests combined exceeds those allowed by the AQL.

4.4.2.3.4 Safety and Arming Device (see dwg. 9220961), 3.5.2.3.1, Table I and Table II). - Using a meter limiting the current to one (1) milliampere maximum, connect the meter across the connector receptacle, electrical plug (9220901-1) and connector, receptacle, electrical, plug (9220901-2) and note the reading. If any Safety and Arming Device fails to meet the resistance requirement of 3.5.2.3.1, the assembly shall be classed defective and removed from the lot. Immediately following the test, the shorting clip shall be assembled onto the piston actuator pins.

4.4.2.3.5 Sequential Environmental Tests. - Forty-eight (48) piston actuators shall be subjected to a temperature humidity test in accordance with MIL-STD-331, Test 105, except that the unit shall be cycled for 12 days only and the minus 80 degree weekend soak shall not apply. At the conclusion of the test, 16 units shall be set aside and the remaining 32 units subjected to a transportation test per MIL-STD-331, Test 104, Procedure II. At the conclusion of the test, 16 units shall be set aside and the remaining 16 units subjected to a five foot drop test per MIL-STD-331, Test 111. Three (3) units shall be dropped in each of the five (5) planes and the sixteenth unit dropped piston end down. Eight (8) of the units set aside after each environment shall be tested at -40°F + 5°F and the remaining eight tested at +145°F + 5°F. These units shall be tested for functioning as specified in 4.4.2.3.1.2. Defective units shall be as defined in 4.4.2.3.3. Any unit classed as defective shall be cause for rejection of the lot.

4.4.3 Bias Mass Escapement Functioning on Safety and Arming Mechanism Assembly (see dwg. 9220959)

4.4.3.1 Functional Evaluation. - The S&A Mechanism shall be placed in a fixture which simulates the minimum conditions of the housing assembly, i.e., the conditions most likely to cause interference of the S&A mechanism with the housing. The centrifuge shall be run up to the RPM level corresponding to 200g's of acceleration at the c.g. of the bias mass. Bias mass functioning

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

time from release of the bias mass to the completion of bias mass movement releasing rotor detent shall be recorded. After bringing the centrifuge to rest, the rotor shall be returned to the "unarmed" position and the bias mass returned to its original non-functioning position. The test shall then be repeated at a centrifuge RPM speed corresponding to an acceleration level of 500g's. Bias mass functioning time in milliseconds shall be read and recorded as described above. Any assembly which fails to arm or which fails to function within the time intervals specified in requirement 3.6 shall be classed defective.

WARNING: These tests are conducted on assemblies which contain explosive devices; and because of the potential danger, they should be performed behind a suitable barricade and in a space provided with electrostatic shielding.

4.4.4 Rotor Delay Time

4.4.4.1 Safety and Arming Mechanism Assembly (see dwg. 9220959). - After the S&A Mechanism Assembly has passed the bias mass escapement functioning test in 4.4.3, the assembly shall be mounted in a test fixture such that a compressive load is applied to the mechanism and similar to that encouttered in the completed S&A Device. The test shall be performed at ambient temperature at 70°F ± 10°F. The rotor in the assembly shall be tripped permitting its rotation into the armed position. Readout in milliseconds to the nearest millisecond shall be recorded. Any assembly in which the rotor fails to function within the time limits prescribed in requirement 3.7.1 shall be classed defective.

4.4.5 Switch Chatter. - The S&A Device shall be armed manually and assembled to a fixture simulating a warhead section. The fixture shall be mounted on the vibration equipment in a flight attitude. At the warhead mounting ring, apply in each of three mutually perpendicular axes, one being the longitudinal axis passing through the warhead center of gravity, one parallel of the rotor shaft and one perpendicular to the rotor shaft, a missile vibration as follows:

A random vibration per MIL-STD-810B, Procedure V, Part 2, Curve AE of Figure 514-4 and a sinusoidal vibration per MIL-STD-810B, Procedure V, Part 1, Curve P of Figure 514-3 except that in each part the test shall be performed for a period of not

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

less than one (1) minute in each of the three (3) mutually perpendicular axes. During each test, the electric detonator circuit shall be monitored for continuity. If any assembly exhibits a switch chatter pulse in excess of 40 microseconds, the assembly shall be classed defective.

4.4.6 Dielectric Strength. - The specified electrical potential shall be applied between the points to be tested using an AC power supply (0-300 Volts RMS) and an AC microammeter. Breakdown shall be defined as a leakage current in excess of two (2) microamperes for the rotor assembly test and four (4) microamperes for the cover assembly test under the requirement conditions specified in 3.9.1 and 3.9.2 respectively.

4.4.7 Grooved-Pin Test. - The Rotor Assembly - Pin (see dwg. 9220902) shall be assembled to the test fixture as specified. A force of two (2) pounds shall be applied to the grooved, headless pin in the direction shown. Any pin which moves in the direction of the applied force during application shall be classed defective.

4.4.8 Material Hardness. - Twenty (20) samples from each heat treatment batch shall be subjected to a standard Rockwell hardness test using standard test equipment. The hardness scale used shall comply with that specified by the referenced drawing. This is a destructive test and units shall not be returned to the lot.

4.4.9 Electrical Functioning. - The "armed" Safety and Arming Device (dwg. 9220961) shall be assembled to a steel block which complies with MIL-STD-331, Ttst 301.1 with the lead charge placed against the block. An electrical current generated by a low impedance supplying 15-17 volt DC power generator shall be introduced into the detonator circuit. The electric circuit from the power supply to the detonator shall simulate a 0.4 Ohm internal battery impedance. The circuit and equipment shall be specified in Figure 4. High order functioning of the S&A Device shall be evidenced by a minimum plate indentation of 0.013 inches. Any assembly which fails detonator resistance, fails to function or fails the minimum plate indentation shall be classed defective. Depth of indentation shall be in accordance with MIL-STD-331, Test 301.1.

WARNING: This test is dangerous and should be performed behind a suitable barricade.

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

4.4.10 Temperature Conditioning. - The samples shall be conditioned at the required temperature plus or minus 5°F for a two (2) hour period minimum.

4.4.11 Inspection of S&A Device (see dwg. 9220961). - The safe (unarmed) condition of the S&A Device shall be confirmed by visually observing the orientation of the rotor shaft as revealed by the warning indicator. The green half of the warning indicator shall be clearly visible in the viewing window. Any assembly in which the red half of the indicator is visible, either partially or fully, shall be classed defective. The proper assembly of the shorting clip (see dwg. 9220961) shall be visually confirmed and any assembly having an improperly assembled or missing shorting clip shall be classed defective.

4.4.12 Sequential Tests. - Unless otherwise specified, the temperature at which tests are to be performed shall be 70°F ± 10. Prior to being subjected to any of the sequential environments, the S&A Devices shall be checked for electrical continuity and resistance as required by 3.5.2.1 and 3.5.2.2 and a visually safe condition shall be confirmed according to the method of 4.4.11. Following each environmental treatment, the S&A Devices shall be re-examined according to the above tests as part of the success criteria associated with the treatment and as a prerequisite for subsequent destructive functioning. The 16 devices removed from the first article sequence (Figure 1) shall be conditioned to the sequence temperature according to 4.4.10 and then tested as follows: Four (4) of the eight (8) samples at each temperature shall be subjected to the bias mass and rotor delay time test according to 4.4.19.2 and all eight (8) of the samples shall be subjected to the arming test according to 4.4.19.1. The test shall then be completed by subjecting each to destructive electrical functioning according to 4.4.9. The sequence conditioning tempera ture is required during electrical functioning.

4.4.12.1 Temperature/Humidity Treatment. - S&A Devices shall be subjected to the Temperature/Humidity environment as indicated in Figure 1 in accordance with MIL-STD-331, Test 105, 12 days only. Acceptance criteria shall be as specified in MIL-STD-331.

4.4.12.2 Transportation Vibration. - S&A Devices shall be subjected to the Transportation Vibration environment in accordance with MIL-STD-331, Test 104. Acceptance criteria shall be as specified in MIL-STD-331.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.4.12.3 Five Foot Drop Treatment. - S&A Devices shall be subjected to the Five Foot Drop environment in accordance with MIL-STD-331, Test 111 except as follows: Each unit shall be dropped bare and only once. The unit shall be dropped with the longitudinal axis 45° from the vertical, nose down. Acceptance criteria shall be as specified in accordance with MIL-STD-331.

4.4.13 Safety Tests

4.4.13.1 Jolt. - A separate sample of S&A Devices shall be subjected to the Jolt test in accordance with the procedures in MIL-STD-331, Test 101. The units are not required to be operable after this test. The acceptance criteria shall be as specified in MIL-STD-331.

4.4.13.2 Jumble. - A separate sample of S&A Devices shall be subjected to the Jumble test in accordance with procedures in MIL-STD-331, Test 102. The units are not required to be operable after this test. The acceptance criteria shall be as specified in MIL-STD-331.

4.4.14 Explosive Output of Lead Charge. - During production, explosive harness assemblies (lead charge) shall be tested for explosive output in accordance with the procedures in MIL-STD-331, Test 301.1 using an aluminum sleeve with a 0.75 inch nominal outside diameter. An M55 stab detonator and lead charge shall be placed in the sleeve with the detonator in intimate contact with the lead charge. The tolerances specified in Test 301.1 for the inside diameter shall apply to both the detonator and lead charge. The height of the sleeve shall be the combined height of the detonator and lead charge. The detonator shall be initiated and the depth of indentation recorded. Any lead charge which does not satisfy the indentation requirements of 3.15.1 given normal detonator functioning shall be classed defective.

4.4.15.3 Brazing. - Brazing adequacy shall be determined by the qualification methods specified in MIL-B-7883. Any brazed component which fails to meet the qualification standard shall be classed defective.

4.4.15.4 Soldering. - Soldering adequacy shall be determined by the standards of quality specified in MIL-S-45743. Any soldered assembly which fails to meet the acceptance criteria in the referenced specification shall be classed defective.

4.4.15.5 Roll Over/Spin Over. - Roll over or spin over adequacy shall be inspected for loose or deformed parts. Any assembly which exhibits loosening or deformation of the secured parts, i.e., parts secured by "roll over" or "spin over" method, shall be classed defective.

4.4.16 Inspection for Burrs and Surface Defects. - The absence of burrs and other raised surface defects on the parts specified shall be confirmed by optical examination using 5X to 7X magnification. Any part or subassembly which exhibits an observable burr or protruding surface defect which could adversely affect the functioning of the S&A Device Assembly shall be classed defective

4.4.17 Detonator Tests

4.4.17.1 Temperature-Humidity. - The sample detonators selected for this test shall be measured for electrical resistance. Any unit which fails to meet the electrical resistance requirement shall be replaced with an acceptable detonator. The sample shall be subjected to a 12 day only temperature humidity test in accordance with Method 105 of MIL-STD-331. Upon completion of the test, the same units shall be measured for electrical resistance. Any unit which fails the electrical resistance requirement shall be classed defective.

4.4.17.2 Duds

4.4.17.2.1 Minus 40°F (-40°F). - One half the units subjected to 4.4.17.1 above shall be conditioned to -40°F for two (2) hours and fired at this temperature using the electrical circuit specified in 4.4.9 (see Figure 4).

4.4.17.2.2 Plus 145°F (+145°F). - One half the units subjected to 4.4.17.1 above shall be conditioned at 145°F ± 5°F for two (2) hours and fired at this temperature using the electrical circuit specified in 4.4.9 (see Figure 4). In the event of unequal sample sizes, the larger half shall be fired at -40°F.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

4.4.17.2.3 Rejection. - Any unit which fails to detonate on the first attempt shall be classed defective. The lot shall be rejected if the defectives for the -40°F test, the +145°F test and the electrical resistance test, when added together, exceed those allowed by the AQL.

4.4.18 S&A Device Non-Arming Test. - The completely assembled S&A Device shall be mounted in a test fixture with the lead charge end of the housing directed toward the center of rotation. The S&A Device shall be accelerated to a level of 300g's minimum for the duration required to unlatch the bias mass. Any unit which has armed shall be rejected and removed from the lot.

4.4.19 Safety and Arming Device Functioning Tests (see dwg. 9220961)

4.4.19.1 Arming Test. - After environmental conditioning and testing, selected S&A Devices shall be subjected to an arming test. The device shall be mounted so that the direction of acceleration simulates missile flight, i.e., top of lead charge and directed towards the center of rotation using test equipment as specified. The piston actuator resistance shall be measured as specified in 4.4.2.3.4 and the actuator fired utilizing the firing circuit specified in 4.4.2.3.1.2. The S&A Device shall be accelerated to a level corresponding to 300g's. The centrifuge shall then be stopped causing the rotor to arm. If any unit fails the piston actuator resistance tests or fails to arm as determined by electrical resistance test of the detonator circuit, the lot shall be rejected. The detonator resistance shall be measured by connecting the limited current meter between the insulated terminal and the center conductor of the co-axial cable connector. The device shall then be subjected to electrical functioning.

4.4.19.2 Bias Mass Time and Rotor Delay Time Test. - After environmental conditioning and testing, selected S&A Devices shall be subjected to a bias mass time and rotor delay time test. The S&A Device to be tested shall have its housing assembly (dwg. 9241447) removed. The device shall then be placed in a suitable test fixture and conditioned to the appropriate test temperature (± 5°F). The device shall be mounted in the centrifuge so that the top end is directed towards the center of rotation. The centrifuge shall be run up to an RPM corresponding to an acceleration level of 300g's at the center of gravity and the bias mass. With the acceleration level stabilized, the bias mass retaining lever shall

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

be mechanically tripped, permitting the bias mass to move and release the rotor for arming. The time interval for bias mass functioning shall be read on a counter to the nearest tenth of a millisecond. If any unit fails to meet the bias mass time of 3.6 or if the rotor fails to turn to the armed position, the S&A Device shall be classed defective. After recording bias mass functioning time, the centrifuge shall be stopped. With the centrifuge at rest, the rotor shall be reset, the rotor released and the rotor delay time measured and recorded. At least once each working shift, the counter readouts shall be corroborated by comparison with the pulse width observed on an oscilloscope. Any device failing to arm within the required time limits specified in 3.7.2 shall be classed defective. At the conclusion of the rotor delay time test, the S&A Device shall be manually restored to the unarmed (safe) condition, the bias mass locked and the housing assembly reassembled to the unarmed S&A Device so it can be tested further (to arming test according to 4.19.1 and electrical functioning according to 4.4.9). (See Tables I and II.) The lot shall be rejected if any individual rotor delay time fails the minimum requirement or if the average delay time plus or minus two (2) sigma at any one temperature fails the requirement.

WARNING: These tests are dangerous and should be performed behind a suitable barricade and in a space provided with electrostatic shielding.

NOTE: The following symbols are defined.

$$\bar{x} = \frac{\Sigma \text{ Delay Times}}{n}$$

Where:
- $\bar{x}$ = Average delay time at one temperature
- Σ = Sum
- n = Number of delay times at one temperature


$$\text{Sigma} = \sqrt{\frac{\Sigma (x - \bar{x})^2}{n - 1}}$$

Where:
- Sigma = Sample Standard Deviation
- Σ = Sum
- x = Individual delay time from one temperature
- n = Number of delay times at one temperature

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

FIGURE 3

SCHEMATIC FOR S&A ELECTRICAL FUNCTIONING TEST
AND DETONATOR TEST

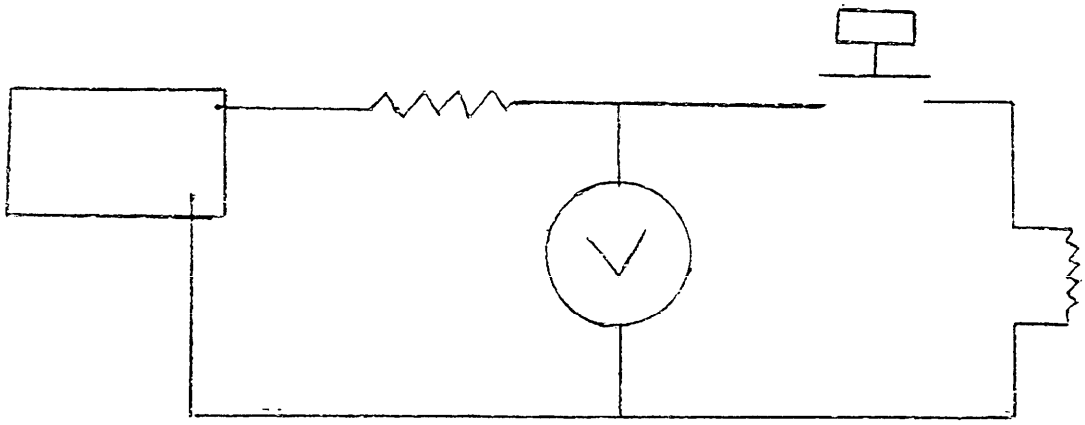

Equipment:

a. Power Supply 0-40V, 20 Ampere, regulated or equivalent Sorenson Model #DRC 40-20A.

b. Resistor, Non-Inductive 0.4 Ohm, 100 Watt.

c. Volt Meter, 0-40 Volt (Simpson 260 or equivalent).

d. Push Button Switch (normally open) rated 10 Amperes.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and Packing

5.1.1 Level C. - The Safety and Arming Device shall be preserved and packaged in accordance with dwg. 9233182.

5.2 Packing

5.2.1 Level C. - The Safety and Arming Device shall be packed in accordance with dwg. 9233183.

5.3 Marking. - Marking of the wood packing box shall be in accordance with dwg. 9233183. The carton shall be marked in accordance with dwg. 9233182.

6. NOTES

6.1 Intended Use. - The Safety and Arming Device covered by this specification is a major component of the Fuze: M815 which is intended for use on the Dragon Warhead Section, Guided Missile, HE, M225.

6.2 Ordering Data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Data cards. - Data cards shall be prepared for each lot in accordance with the information specified in MIL-STD-1167.
c. Quantity required and delivery schedules.
d. Serialization requirements, if applicable!-
e. Production lot acceptance (quality conformance) if other than specified in Section 4.
f. First article (pilot lot) sample requirements, if other than specified in Section 4 (see 3.1, 4.2.1 and 6.3).
g. Packaging requirements, if other than specified in Section 5.
h. Inspection equipment design requirements (see 4.3.4 and 6.2.1).

6.2.1 Inspection Equipment Designs

6.2.1.1 The contractor shall prepare designs for all inspections required by Section 4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

6.2.1.2 Contractor designs shall include, as applicable, operating instructions, calibration procedures and maintenance procedures.

6.2.1.3 Commercial equipment shall be fully described by means of catalog sheets or the like. This information will include illustrations and engineering data adequate for evaluation. Designs shall be prepared of any special fixture required to be used with commercial equipment.

6.2.1.4 The applicable five-digit defect code number from Section 4 of this specification shall be referenced on each contractor design.

6.2.1.5 Designs shall be prepared to the category and form (per MIL-D-1000) specified in the Contract Data Requirements List (DD Form 1423). The contractor is referred to MIL-HDBK-204, "Inspection Equipment Design" for guidance.

6.2.1.6 Submission for Approval. - Contractor designs shall be approved by the Government prior to fabricating or procuring the equipment. Designs shall be submitted for approval within the time frame and distribution specified in the Contract Data Requirements List (DD Form 1423). Partial submission of inspection equipment designs is permissible and encouraged. However, the completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will be accomplished normally within one month after receipt.

6.3 Submission of First Article Sample. - Instructions as to the submission and location for testing and evaluation of the first article sample shall be obtained from the Contracting Officer. Upon receipt of such request, the Contracting Officer shall advise Picatinny Arsenal and instructions will be issued accordingly. All inquiries should be forwarded to: Commander, Picatinny Arsenal, ATTN: SARPA-QA-I, Dover, New Jersey 07801.

6.5 Definitions

6.5.1 Contractor Designs. - These are:

a. Designs of inspection equipment for which the Government has assigned design responsibility to the contractor, or

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

b. Commercial equipment which the contractor proposes to use for purpose a. above. This is defined as unmodified inspection equipment which is cataloged and available for purchase by the general public.

Custodian:
Army-PA

Preparing Activity:
Army-PA

Project Number: 1336-A-227

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426

REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 202610-18T05:19Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDER
Picatinny Arsenal
ATTN: SARPA-QA-A
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T05:19Z
Check the source to verify that this is the current version before use.