MILITARY SPECIFICATION

CONTROL, GUNNER'S, COMPUTER: 11732500

This specification is approved for use by the US Army Armament Research and Development Command (ARRADCOM) and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification establishes the requirements and quality assurance provisions for the Control, Gunner's, Computer: 11732500 which is a unit of the M21 Ballistic Computer System, 11732979.

2. APPLICABLE DOCUMENTS

2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

BB-N-411	Nitrogen, Technical

MILITARY

MIL-F-13926	Fire Control Materiel; General Specificataion Governing the Manufacture and Inspection of
MIL-I-45607	Inspection Equipment, Acquisition, maintenance and Disposition of
MIL-STD-45662	Calibration System Requirements

FSC 1220

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the currentversion before use.

STANDARDS

MILITARY

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-810	Environmental Test Methods

DRAWINGS

ARRADCOM

11732500	Control, Gunner's, Computer

Inspection Equipment

11750207	Test Set - Gunner's Control Unit
11821206	Switch Lock, Gunner's Control
11821414	Fixture - Gunner's Control Mounting
11821457	Fixture Shock - Vertical and Horizontal Plane
11821458	Shock Adapter Plate Vib Horz/Vert Plane - Shock Z
11821748	Test Set - Immersion Leak, Purge and Fill
11823179	Unit Fixture, Gunner's Control

Packaging Data Sheet

P11732500	Packaging of Control, Gunner's Computer: 11732500

(Copies of specifications, standards, drawings and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 *Fabrication.* The computer gunner's control, herein referred to as the assembly, shall be manufactured in accordance with Drawing 11732500 and drawings pertaining thereto and, when assembled, shall meet the requirements of this specification. (See 4.5.1)

3.1.1 Function. The assembly shall provide the following functions:

	Designation
a.	Panel lighting
b.	Crosswind switch
c.	Boresight switch
d.	Crosswind potentiometer
e.	Manual range potentiometer
f.	Air temperature potentiometer
g.	Altitude potentiometer
h.	Remaining tube life potentiometer
i.	AS output
j.	Elevation common zero output
k.	Azimuth common zero output
l.	Elevation zeroing output
m.	Azimuth zeroing output
n.	Self test

3.1.2 General specifications. The following provisions of MIL-F-13926 apply: (See 4.5.1)

a. Order of precedence
b. Dimensions and tolerances
c. Inorganic protective surface finishes
d. Part identification and marking
e. Workmanship

3.1.3 Ambient conditions. Standard ambient conditions shall be as follows:

a.	Temperature	73° ± 18°F
b.	Relative humidity	50 percent + 30 percent −3.0
c.	Atmospheric pressure	28.5 + 2.0 in. Hg.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample units for first article inspection and approval (see 4.4 and 6.2).

Source: https://assist.dla.mil -- Downloaded: 202640-22T19:27Z
Check the source to verify that this is the currentversion before use.

3.3 Performance. Unless otherwise specified, the assembly shall meet the performance requirements specified herein under standard ambient conditions of 3.1.3.

3.3.1 Continuity. (See 4.6.2.1)

3.3.2 Panel lighting. With the power (table I, item 2.1) applied, with the SELF TEST switch set to NORMAL, and:

a. with the LIGHT control in the fully counterclockwise (CCW) position, the POWER lamp and panel lamps shall be illuminated.

b. as the LIGHT control is rotated clockwise (CW), the POWER lamp and panel shall increase in brightness. (See 4.6.2.2)

3.3.3 Self test lamps. With the power of table I, item 2.1 applied and with the SELF TEST switch set to NORMAL, establishment in any item number order of the table III items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.3)

3.3.4 Main power switch. With the load, item 1.8 and power, item 2.2, of table I applied, with the POWER switch set to ON, and with the table I, item 1.8, load adjusted to a current of 20 +2 amp, the POWER switch shall trip to OFF in 40 seconds or less. (See 4.6.2.4)

3.3.5 Crosswind switch. With signals of table I, items 3.1 and 3.2 applied, establishment in any item number order of the table IV items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.5)

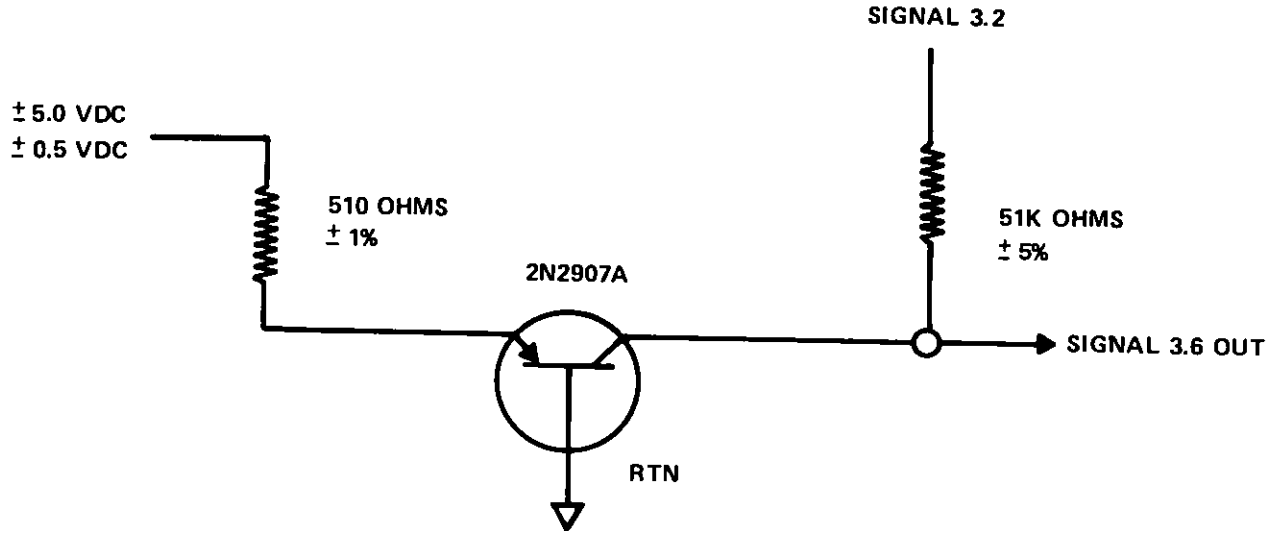


FIGURE 1. AS input signal.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE I. Loads, power and signals.

Item	Conditions	Characteristics	Connections
1.0	Loads		Connected between:
1.1	Resistor	100 K ohm ±1%, 1/4 Watt (W)	2J1-45 and 2J1-59
1.2	Resistors	100 ohm ±5%, 1/8 W in series with 1 M ohm ±5%, 1/8 W	2J1-44 and 2J1-59
1.3	Resistor	510 K ohm ±5%, 1/8 W	2J-33 and 2J1-58
1.4	Resistor	247 K ohm ±0.5%, 1/8 W	2J1-20 and 2J1-50
1.5	Resistor	100 K ohm ±0.5%, 1/8 W	2J1-19 and 2J1-50
1.6	Resistor	230 K ohm ±0.5%, 1/8 W	2J1-22 and 2J1-50
1.7	Resistor	100 K ohm ±0.5%, 1/8 W	2J1-21 and 2J1-50
1.8	Variable Resistor	0 to 5 ohm ±10%, 500 W	2J1-1, 2 and 2J1-5, 6
1.9	Resistor	200 K ohm ±0.5%, 1/8 W	2J1-18 and 2J1-50
1.10	Resistor	100K ohm ±0.05%, 1/10 W	2J1-66 and 2J1-50
1.11	Resistor	200 K ohm ±0.5%, 1/10 W	2J1-46 and 2J1-50
1.12	Resistor	200 K ohm ±0.5%, 1/10 W	2J1-47 and 2J1-50
1.13	Resistor	200 K ohm ±0.5%, 1/10 W	2J1-15 and 2J1-50
1.14	Resistor	200 K ohm ±0.5%, 1/10 W	2J1-16 and 2J1-50
1.15	Resistor	510 K ohm ±5%, 1/8 W	2J1-28 to 2J1-59
1.16	Resistor	510 K ohm ±5%, 1/8 W	2J1-29 to 2J1-59
2.0	Power		Connected between:
2.1	24 vdc	Tolerance: ±2 vdc Ripple: less than 200 mv p-p Current: 1.5 amps	2J1-60 (+) and 2J1-61 (-)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE I. Loads, power and signals. - Continued

Item	Conditions	Characteristics	Connections
2.2	24 vdc	Tolerance: ± 2 vdc Ripple: 200 mv p-p Current: 10 amps	2J2-A (+) and 2J1-B, -C (-)
3.0	Signals		Connected between:
3.1	15 vdc	Tolerance: ±0.300 vdc Ripple: 20 mv p-p	2J1-48, -49 and 2J1-59 unit chassis (Rtn)
3.2	-15 vdc	Tolerance: ±0.300 vdc Ripple: 20 mv p-p	2J1-56, -57 and 2J1-59 unit chassis (Rtn)
3.3	4.5 vrms, 400 Hz	Tolerance: ±0.030 vrms ±4 Hz Phase: phase 1 (In-phase ±2.5° with Item 3.4)	2J1-17 and 2J1-50 unit chassis (Rtn)
3.4	5 vrms, 400 Hz (AC Ref 1)	Tolerance: ±0.030 vrms ±4 Hz	2J1-52 and 2J1-50 unit chassis (Rtn)
3.5	5 vrms, 400 Hz (AC Ref 2)	Tolerance: ±0.030 vrms ±4 Hz Phase: phase 2 (180.0° ±2.5° out-of-phase with Item 3.4)	2J1-54 and 2J1-50 unit chassis (Rtn)
3.6	Figure 1	Tolerance: 0.00 ± 1.50 vdc	2J1-23, -24 and 2J1-59 (Rtn), depending upon test

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE II. Continuity.

Item	Switch	Switch Position	Connections		Resistance (ohms)
			From	To	
1	-	-	2J1-52	2J1-53	2.0
2	-	-	2J1-48	2J1-49	2.0
3	-	-	2J1-54	2J1-55	2.0
4	-	-	2J1-84	2J1-85	2.0
5	-	-	2J1-57	2J1-56	2.0
6	-	-	2J1-5	2J1-67	2.0
7	-	-	2J1-5	2J2-B	2.0
8	-	-	2J1-6	2J1-68	2.0
9	-	-	2J1-6	2J2-C	2.0
10	-	-	2J1-2	2J1-3	2.0
11	-	-	2J1-2	2J1-4	2.0
12	SELF TEST	LAMP	2J1-81	2J1-50	2.0
13	SELF TEST	NORMAL	2J1-81	2J1-50	2.0
14	SELF TEST	LAMP or NORMAL	2J1-80	2J1-52	2.0
15	SELF TEST and RANGEFINDER	LAMP or RANGEFINDER	2J1-72	2J1-44	2.0
16	SELF TEST and RANGEFINDER	SYSTEM RANGEFINDER	2J1-72	2J1-44	1.338K ±0.2%

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE II. Continuity. - Continued

Item	Switch	Switch Position	Connections		Resistance (ohms)
			From	To	
17	SELF TEST	SYSTEM	2J1-80	2J1-81	2.0 max
18	RANGEFINDER SELF TEST	RANGEFINDER SYSTEM	2J1-44	2J1-50	100K ±0.05%
19	RANGEFINDER	MANUAL	2J1-69	2J1-58	2.0 max
20	RANGEFINDER	RANGEFINDER	2J1-69	2J1-70	5.1K ±5%

TABLE III. Self test lamps.

Item	Input Conditions		Output Conditions
	RANGEFINDER Switch Position 1/	Pin Interconnected with 2J1-61 (GND)	Lamp Illuminated
1	N/A	2J1-7	System OK
2	N/A	2J1-8	Comp
3	N/A	2J1-11	OU
4	N/A	2J1-10	RP
5	N/A	2J1-12	Cant
6	N/A	2J1-14	Wind
7	Rangefinder	2J1-9	RF
8	Manual	2J1-9, 63	GC

1/ N/A indicates a not applicable condition.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE IV. Crosswind switch characteristics.

Item	Input Condition	Output Conditions at Pins 1/	
	Crosswind Switch Position	2J1-40	2J1-41
1	Auto	-15.0 ±0.3 vdc	14.3 ±0.5 vdc
2	Manual	14.3 ±0.5 vdc	-15.0 ±0.3 vdc

1/ Referenced to 2J1-59.

3.3.6 Boresight switch. With signals table I, items 3.1 and 3.2 applied, establishment, in any item number order, of the table V items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.6)

3.3.7 Crosswind potentiometer. With the load item 1.1 and signals items 3.1 and 3.2 of table I applied, establishment, in any item number order, of the table VI items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.7)

3.3.8 Manual range potentiometer. With the load item 1.2 and signal item 3.4 of table I applied, with the RANGE switch set to MANUAL, and:

a. with the SELF TEST switch set to NORMAL, establishment, for items 1 through 9, in any item number order, of the table VII input conditions shall result in the corresponding output conditions specified.

b. with the SELF TEST switch set to SYSTEM, establishment, for item 10, of the table VII input conditions shall result in the corresponding output conditions specified. (See 4.6.2.8)

3.3.9 Air temperature potentiometer. With the loads items 1.4 and 1.5 and signal item 3.3 of table I applied, and with the SELF TEST switch set to NORMAL, establishment, in any item number order, of the table VIII input conditions shall result in the corresponding output conditions specified. (See 4.6.2.9)

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE V. Boresight switch.

Item	Input Condition	Output Conditions at Pins 1/	
	Boresight Switch Position	2J1-42	2J1-43
1	Boresight	13.5 ±0.5 vdc	-15.0 ±0.3 vdc
2	Normal	-15.0 ±0.3 vdc	13.5 ±0.3 vdc

1/ Referenced to 2J1-59.

TABLE VI. Crosswind potentiometer.

Item	Input Condition 4/		Output Condition at Pin 2J1-45 (vdc) 2/
	Crosswind Dial Setting (mph) 3/		
1	Left	40	-7.849 ±0.502
2	Left	30	-5.888 ±0.488
3	Left	20	-3.931 ±0.467
4	Left	10	-1.971 ±0.438
5 1/		0	0.000 ±0.151
6	Right	10	1.971 ±0.438
7	Right	20	3.931 ±0.467
8	Right	30	5.888 ±0.488
9	Right	40	7.849 ±0.502

1/ Alignment position.
2/ Referenced to 2J1-59.
3/ Wiper action of potentiometer shall be continuous for full range of knob markings.
4/ Knob in locked position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE VII. Manual range potentiometer.

Item	Input Condition 4/	Output Condition at Pin 2J1-44 2/ 5/ (vrms)
	Manual Range Dial Setting (Meters x 100)	
1	4	0.426 ± 0.025
2	8	0.851 ± 0.037
3	10	1.064 ± 0.042
4	15	1.596 ± 0.052
5 1/	20	2.128 ± 0.060
6	25	2.660 ± 0.063
7	30	3.191 ± 0.063
8	40	4.255 ± 0.063
9	46	4.893 ± 0.073
10	3/	1.941 ± 0.035

1/ Alignment position.
2/ Referenced to 2J1-59.
3/ Turn dial full range of travel.
4/ Wiper action of potentiometer shall be continuous for full range of knob markings.
5/ Phase 1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE VIII. Air temperature potentiometer.

Item	Input Condition 4/	Output Condition at Pin 2J1-20 2/ 5/ (vrms)
	Air Temperature Dial Setting 3/	
1	-60	2.303 ±0.115
2	-40	1.913 ±0.113
3	-20	1.525 ±0.110
4	0	1.137 ±0.107
5	20	0.752 ±0.105
6	40	0.366 ±0.102
7 1/	S	0.019 ±0.015
8	80	0.401 ±0.098
9	100	0.783 ±0.097
10	120	1.163 ±0.095

1/ Alignment position.
2/ Referenced to 2J1-19.
3/ Knob in Locked Position.
4/ Wiper action of potentiometer shall be continuous for full range of knob markings.
5/ Items 1 through 6 are phase 1. Items 8 through 10 are phase 2.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

3.3.10 Altitude potentiometer. With the loads items 1.6 and 1.7 and signal item 3.3 of table I applied, and with the SELF TEST switch set to NORMAL, establishment, in any item number order, of the table IX input conditions shall result in the corresponding output conditions specified. (See 4.6.2.10)

3.3.11 Remaining tube life potentiometer. With the load item 1.9 and signal item 3.3 of table I applied, establishment, in any item number order, of the table X items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.11)

TABLE IX. Altitude potentiometer.

Item	Input Condition 4/	Output Condition at Pin 2J1-22 2/ 5/ (vrms)
	Altitude Dial Setting (Meters X 100) 3/	
1	-2	0.286 ±0.093
2 1/	0	0.000 ±0.015
3	5	0.676 ±0.100
4	10	1.312 ±0.098
5	15	1.917 ±0.096
6	20	2.488 ±0.095
7	25	3.034 ±0.091
8	30	3.543 ±0.090

1/ Alignment position.
2/ Referenced to 2J1-21.
3/ Wiper action of potentiometer shall be continuous for full range of knob markings.
4/ Knob in locked position.
5/ Items 3 through 8 are phase 2. Item 1 is phase 1.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE X. Remaining tube life potentiometer.

Item	Input Condition 4/	Output Condition at Pin 2J1-18 2/ 5/ (vrms)
	Remaining Tube Life % Dial Setting 3/	
1 1/	NEW	0.000 ±0.058
2	90%	0.513 ±0.104
3	80%	0.965 ±0.100
4	70%	1.371 ±0.098
5	60%	1.742 ±0.094
6	50%	2.086 ±0.092
7	40%	2.412 ±0.089
8	30%	2.726 ±0.090
9	20%	3.033 ± 0.087
10	10%	3.339 ±0.088
11	0%	3.651 ±0.090

1/ Alignment position.
2/ Referenced to 2J1-50.
3/ Wiper action of potentiometer shall be continuous for full range of knob markings.
4/ Knob in locked position.
5/ Items 2 through 11 are phase 1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

3.3.12 AS outputs. With the loads items 1.3, 1.15 and 1.16 and signals items 3.1, 3.2, and 3.6 of table I applied, establishment, in any item number order, of the table XI items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.12)

3.3.13 Elevation common zero ($-Z_E$) output. With the load item 1.11 and signals items 3.4 and 3.5 of table I applied, and with the SELF TEST switch set to NORMAL, establishment, in any item number order, of the table XII items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.13)

TABLE XI. AS output.

Item	Input Condition 4/		Output Condition at Pins (vdc)		
	Switch Position				
	AMMO APDS	AMMO HEAT	2J1-33 1/	2J1-28 2/	2J1-29 2/
1	M728		-15.00 ±0.30		
2	M392		0.00 ±0.15		
3		M456		0.00 ±1.50	-15.00 ±0.30
4		Spare		-15.00 ±0.30	0.00 ±1.50

1/ Referenced to 2J1-58.
2/ Referenced to 2J1-59.
4/ Knob in locked position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XII. Elevation common zero ($-Z_E$) output.

Item	Input Condition: Elevation Common Zero Dial Setting 3/	Output Condition at Pin 2J1-46 2/ 4/ (vrms)
1	-3	0.612 ±0.048
2	-2	0.408 ±0.040
3	-1	0.204 ±0.036
4 1/	0	0.000 ±0.015
5	1	0.204 ±0.036
6	2	0.408 ±0.040
7	3	0.612 ±0.048

1/ Alignment position.
2/ Referenced to 2J1-50.
3/ Wiper action at potentiometer shall be continuous for full range of knob markings.
4/ Items 1 through 3 are phase 1. Items 5 through 7 are phase 2.

3.3.14 Azimuth common zero ($+Z_D$) output. With the load item 1.12 and signals items 3.4 and 3.5 of table I applied, and with the SELF TEST switch set to NORMAL, establishment, in any item number order, of the table XIII items input conditions shall result in the corresponding output conditions specified. (See 4.6.2.14)

3.3.15 Elevation zeroing ($-J_E$) output. With the load item 1.13 and signals items 3.2, 3.4, and 3.5 of table I, and

a. with 2J1-23 interconnected with 2J1-59, with 2J1-24, 2J1-34 and 2J1-35 interconnected with 2J1-56 and with the APDS elevation zeroing dial set to the positions shown in table XIV, the corresponding output condition shall be as specified.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XIII. Azimuth common zero ($+Z_D$) output.

Item	Input Condition 4/	Output Condition at Pin 2J1-47 2/ 5/ (vrms)
	Azimuth Common Zero Dial Setting 3/	
1	-3	0.612 ±0.048
2	-2	0.408 ±0.040
3	-1	0.204 ±0.036
4 1/	0	0.000 ±0.015
5	1	0.204 ±0.036
6	2	0.408 ±0.040
7	3	0.612 ±0.048

1/ Alignment position.
2/ Referenced to 2J1-50.
3/ Wiper action of potentiometer shall be continuous for full range of knob markings.
4/ Knob in locked position.
5/ Item 1, 2 and 3 are phase 2. Items 5, 6 and 7 are phase 1.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XIV. Elevation zeroing ($-J_E$) output.

Item	Input Condition 5/	Output Condition at Pin 2J1-15 3/ 6/ (vrms)
	Elevation Zeroing Dial 2/ Setting 4/	
1	-3	0.612 ±0.048
2	-2	0.408 ±0.040
3	-1	0.204 ±0.036
4 1/	0	0.000 ±0.015
5	1	0.204 ±0.036
6	2	0.408 ±0.040
7	3	0.612 ±0.048

1/ Alignment position.
2/ For requirement 3.2.1.15a, use APDS elevation zeroing dial; for requirement 3.2.1.15b, use HEP/WP elevation zeroing dial; for requirement 3.2.1.15c, use HEAT elevation zeroing dial; for requirement 3.2.1.15d, use BHIV elevation zeroing dial.
3/ Referenced to 2J1-50.
4/ Wiper action of potentiometer shall be continuous for full range of knob markings.
5/ Knob in locked position.
6/ Items 1, 2 and 3 are phase 1. Items 5, 6 and 7 are phase 2.

b. with 2J1-34 interconnected with 2J1-59, with 2J1-23, 2J1-24 and 2J1-35 interconnected with 2J1-56 and with the HEP/WP elevation zeroing dial set to the positions shown in table XIV, the corresponding output condition shall be as specified.

c. with 2J1-24 interconnected with 2J1-59, with 2J1-23, 2J1-34 and 2J1-35 interconnected with 2J1-56 and with the HEAT elevation zeroing dial set to the positions shown in table XIV, the corresponding output condition shall be as specified.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

d. with 2J1-35 interconnected with 2J1-59, with 2J1-23, 2J1-24 and 2J1-34 interconnected with 2J1-56 and with the BHIV elevation zeroing dial set to the positions shown in table XIV, the corresponding output condition shall be as specified. (See 4.6.2.15)

3.3.16 Azimuth zeroing ($+J_D$) output. With the load item 1.14 and signals items 3.2, 3.4 and 3.5 of table I, and

a. with 2J1-23 interconnected with 2J1-59, with 2J1-24, 2J1-34 and 2J1-35 interconnected with 2J1-56 and with the APDS azimuth zeroing dial set to the positions shown in table XV, the corresponding output condition shall be as specified.

TABLE XV. Azimuth zeroing ($+J_D$) output.

Item	Input Condition 5/ Azimuth Zeroing Dial 2/ Setting 4/	Output Condition at Pin 2J1-16 3/ 6/ (vrms)
1	-3	0.612 ±0.048
2	-2	0.408 ±0.040
3	-1	0.204 ±0.036
4 1/	0	0.000 ±0.015
5	1	0.204 ±0.036
6	2	0.408 ±0.040
7	3	0.612 ±0.048

1/ Alignment position.
2/ For requirement 3.2.1.16a, use APDS azimuth zeroing dial; for requirement 3.2.1.16b, use HEP/WP azimuth zeroing dial; for requirement 3.2.1.16c, use HEAT azimuth zeroing dial; for requirement 3.2.1.16d, use BHIV azimuth zeroing dial.
3/ Referenced to 2J1-50.
4/ Wiper action of potentiometer shall be continuous for full range of knob markings.
5/ Knob in locked position.
6/ Items 1, 2 and 3 are phase 2. Items 5, 6 and 7 are phase 1.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

b. with 2J1-34 interconnected with 2J1-59, with 2J1-23, 2J1-24 and 2J1-35 interconnected with 2J1-56 and with the HEP/WP azimuth zeroing dial set to the positions shown in table XV, the corresponding output condition shall be as specified.

c. with 2J1-24 interconnected with 2J1-59, with 2J1-23, 2J1-34 and 2J1-35 interconnected with 2J1-56 and with the HEAT azimuth zeroing dial set to the positions shown in table XV, the corresponding output condition shall be as specified.

d. with 2J1-35 interconnected with 2J1-59, with 2J1-23, 2J1-24 and 2J1-34 interconnected with 2J1-56 and with the BHIV azimuth zeroing dial set to the positions shown in table XV, the corresponding output condition shall be as specified. (See 4.6.2.16)

3.3.17 Self test. With the load item 1.10 and signals items 3.2, 3.3, 3.4 and 3.5 of table I applied, with 2J1-24, 2J1-34 and 2J1-35 interconnected with 2J1-56, with 2J1-23 interconnected with 2J1-50, with AMMO APDS switch in M728 position, with the elevation zero dials and azimuth zero dials set to zero and with the SELF TEST set to SYSTEM, the voltage at 2J1-66 referenced to 2J1-50 shall be 0.125 ±0.030 Vrms, phase 1. (See 4.6.2.17)

3.3.18 BIT output. With the signals table I, items 3.1 and 3.2 applied and with the SELF TEST switch set to SYSTEM, the voltage at 2J1-39 shall be 13.5 ±0.5 vdc and the voltage at 2J1-62 shall be -15.0 ±0.3 vdc. (See 4.6.2.18)

3.3.19 BIT output. With the signals table I, items 3.1 and 3.2 applied and with the SELF TEST switch set to LAMP or NORMAL, the voltage at 2J1-62 shall be 13.5 ±0.5 vdc and the voltage at 2J1-39 shall be -15.0 ±0.3 vdc. (See 4.6.2.19)

3.3.20 Lamp test. With the power table I, item 2.1 applied and with the SELF TEST switch set to LAMP, the system OK, comp, ON, RP, cant, wind, RF, and GC lamps shall illuminate. (See 4.6.2.20)

3.4 Sealing. With an internal nitrogen pressure of 5.0 ± 0.1 psig, the assembly shall exhibit a pressure drop not greater than 0.2 pounds per square inch gauge (psig) for a period of not less than 2 hours. The sealing of the assembly shall meet this criteria with all manual controls exercised. The pressurized assembly shall be purged with dry nitrogen in accordance with BB-N-411, type I, grade B, class 1 with a dewpoint not greater than -25°F. The final internal nitrogen pressure shall be 0.0 + 0.2 - 0.0 psig. (See 4.6.4)

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

3.5 Environmental.

3.5.1 Shock. The assembly shall be capable of operating as specified herein after exposure under the conditions of 3.1.3 to three half sine wave shock pulses of 40 ± 4 gravity unit (g) for a duration of 18 ± 3 milliseconds (msec) applied in each direction along three mutually perpendicular axes. In addition, the assembly shall be capable of withstanding three half sine wave shock pulses of 100.0 ± 10.0 g for a duration of 1.5 ± 0.2 msec applied in each direction along three mutually perpendicular axes. (See 4.6.3.1)

3.5.2 Vibration. The assembly shall be capable of operating as specified herein after exposure under the conditions of 3.1.3 to the vibration profile of figure 2. Duration of exposure shall be not less than 80 minutes in each of three mutually perpendicular axes. (See 4.6.3.2)

3.5.3 Operating temperature. The assembly shall be capable of operating as specified herein over the operating temperature range of -25°F to +125°F. (See 4.6.3.3, 4.6.3.4 and 4.6.3.5)

3.5.4 Storage temperature. The assembly shall be capable of operating as specified herein after exposure to storage temperatures ranging from -65°F to 160°F. (See 4.6.3.3, 4.6.3.4 and 4.6.3.5)

3.5.5 Humidity. The assembly shall operate as specified herein at up to 100 percent relative humidity. (See 4.6.3.6)

3.5.6 Altitude. The assembly shall operate as specified herein under the following conditions:

a. during exposure to an atmospheric pressure equivalent to 10000 feet above sea level.

b. after exposure to an atmospheric pressure equivalent to 40000 feet above sea level for not less than 1 hour. (See 4.6.3.7)

3.5.7 Dust. The assembly shall operate as specified herein after exposure to moving dust for not less than 12 hours at velocities up to 1750 feet per minute. (See 4.6.3.8)

3.5.8 Salt fog. The assembly shall operate as specified herein after exposure to a 5 percent sodium chloride atomized spray for not less than 48 hours. (See 4.6.3.9)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

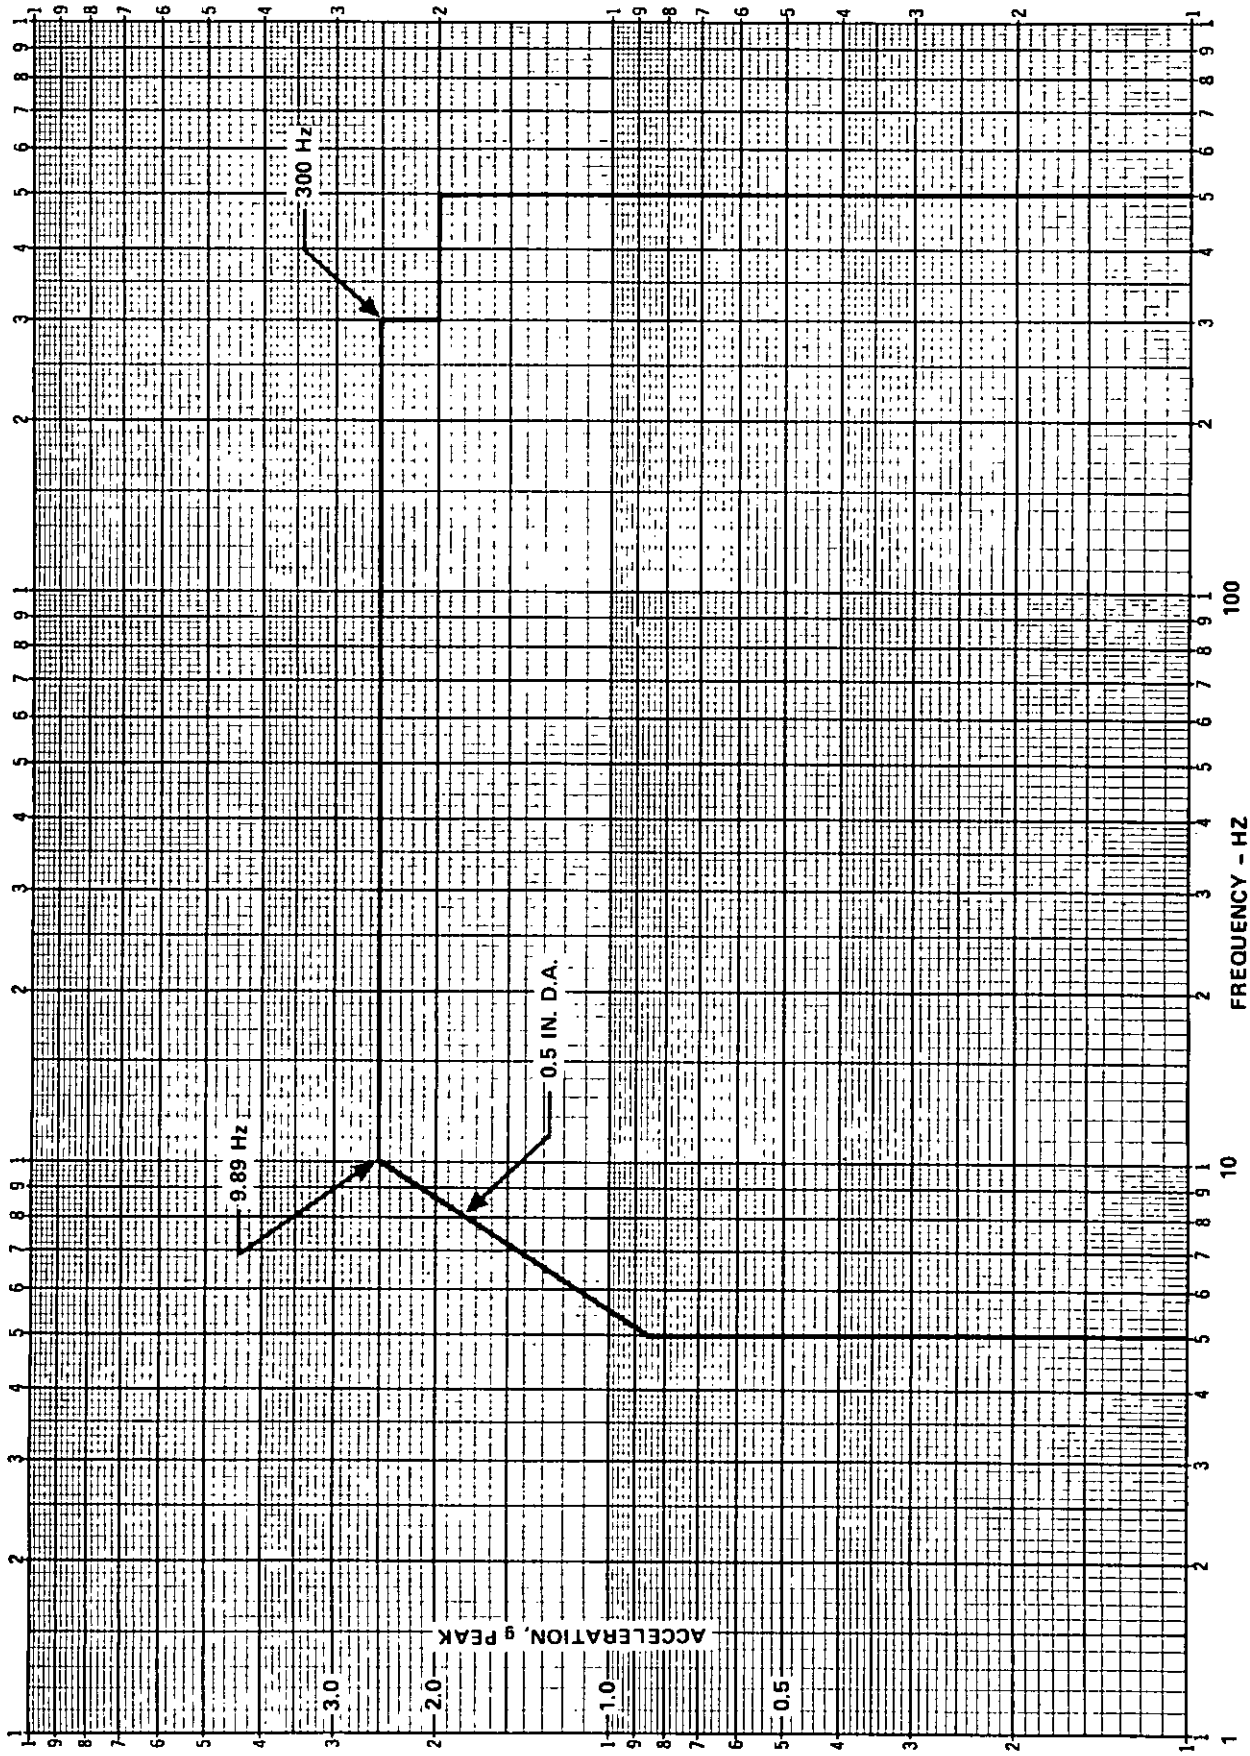


FIGURE 2. Vibration profile.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

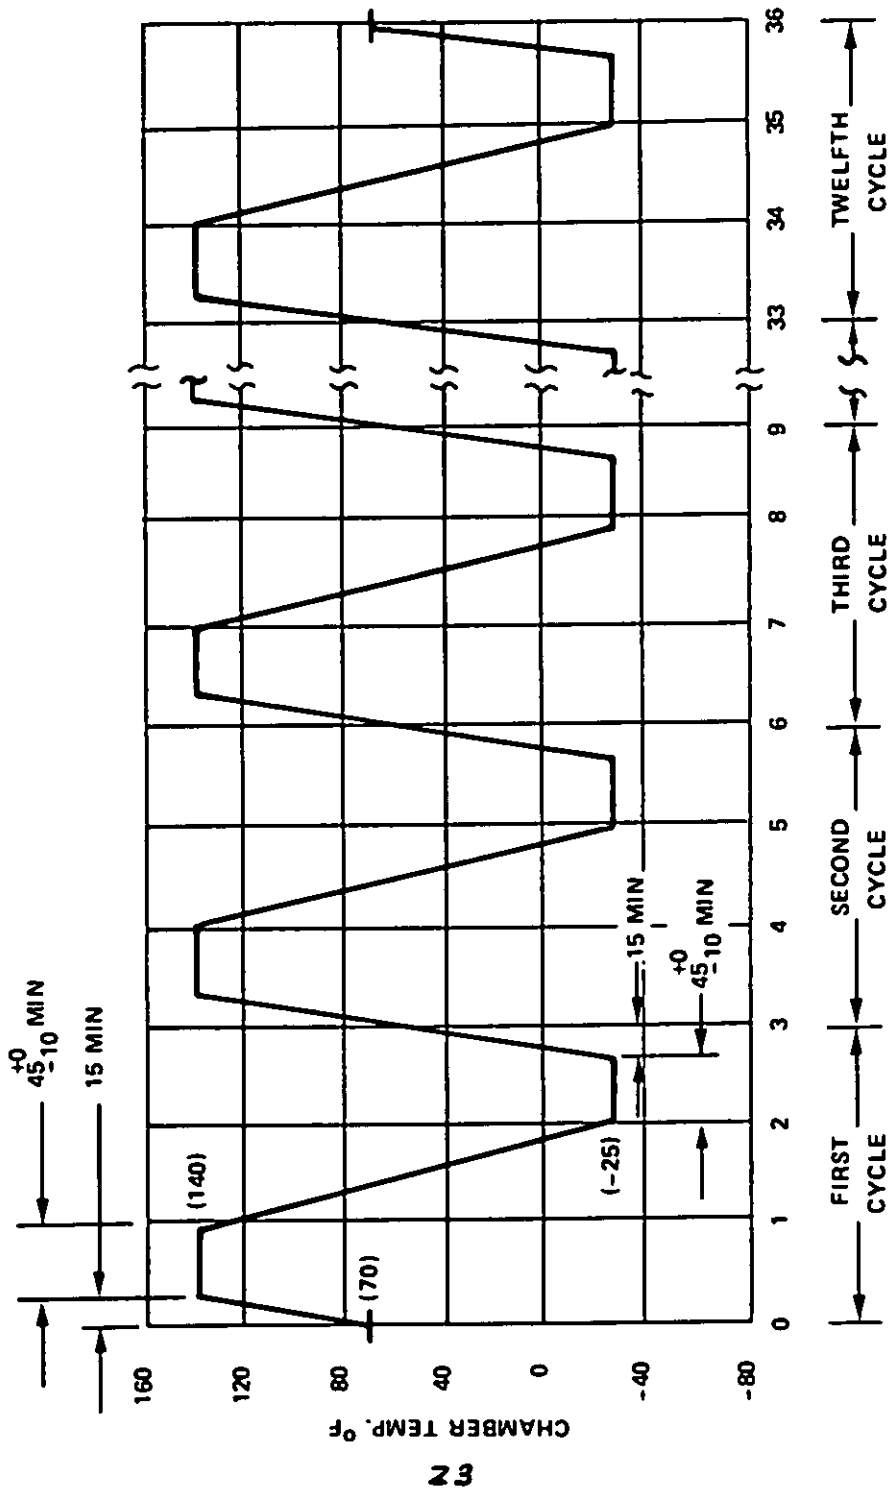


FIGURE 3. Temperature cycling.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

1. First article inspection (See 4.4).
2. Quality conformance inspection (See 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the quality assurance provisions of MIL-F-13926 and the conditions of 3.1.3.

4.4 First article. The requirement for first article approval and the designation of responsibility for first article inspection to either the Government or the contractor shall be specified in the contract.

4.4.1 Sample. The first article sample shall be three assemblies selected at random by the Government representative from the first fifteen production assemblies.

4.4.2 Inspection. The sample shall be subjected to all the inspections specified in table XVI.

4.4.3 Failure. Failure of any assembly to meet any requirement shall be cause for refusal to grant first article approval. The Government reserves the right to terminate first article inspection upon any failure of any assembly to comply with any stated requirement.

4.4.4 Responsibility. The contractor, whether or not responsible, shall inspect the sample for conformance to all contractual requirements and shall submit a record of this inspection with the sample and certificates of conformance for materials. The Government reserves the right to witness inspections performed by the contractor.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XVI. First article tests.

Item	Characteristic	Requirement	Test Procedure
1	Continuity	3.3.1	4.6.2.1
2	Panel lighting	3.3.2	4.6.2.2
3	Self test lamps	3.3.3	4.6.2.3
4	Main power switch	3.3.4	4.6.2.4
5	Crosswind switch	3.3.5	4.6.2.5
6	Boresight switch	3.3.6	4.6.2.6
7	Crosswind potentiometer	3.3.7	4.6.2.7
8	Manual range potentiometer	3.3.8	4.6.2.8
9	Air temperature potentiometer	3.3.9	4.6.2.9
10	Altitude potentiometer	3.3.10	4.6.2.10
11	Remaining tube life potentiometer	3.3.11	4.6.2.11
12	AS output	3.3.12	4.6.2.12
13	Elevation common zero ($-Z_E$) output	3.3.13	4.6.2.13
14	Azimuth common zero ($+Z_D$) output	3.3.14	4.6.2.14
15	Elevation zeroing ($-J_E$) output	3.3.15	4.6.2.15
16	Azimuth zeroing ($+J_D$) output	3.3.16	4.6.2.16
17	Self test	3.3.17	4.6.2.17
18	BIT output	3.3.18	4.6.2.18
19	$\overline{\text{BIT}}$ output	3.3.19	4.6.2.19
20	Lamp test	3.3.20	4.6.2.20
21	Fabrication	3.1	Applicable drawings - visual
22	General specification	3.1.2	MIL-F-13926- visual
23	Sealing A and B	3.4	4.6.4
24	High temperature	3.5.3 and 3.5.4	4.6.3.3
25	Low temperature	3.5.3 and 3.5.4	4.6.3.4
26	Vibration A	3.5.2	4.6.3.2
27	Humidity	3.5.5	4.6.3.6
28	Altitude	3.5.6	4.6.3.7
29	Shock	3.5.1	4.6.3.1
30	Dust	3.5.7	4.6.3.8
31	Salt fog	3.5.8	4.6.3.9
32	Temperature cycling	3.5.3 and 3.5.4	4.6.3.5

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Procurement conditions. The following inspection plans shall apply where the assembly is procured for use as a:

	Use	Plan
a.	Logistics spare assembly apart from the next higher assembly	A and C
b.	Component assembly of the next higher assembly	B and C

4.5.2 Inspection plan A.

4.5.2.1 General sample and tests. One assembly, as a control sample, shall be selected at random by the Government representative from each 100 assemblies produced and shall be subjected to all the tests in table XVIII.

4.5.2.2 Environmental sample and tests. Three assemblies, as a control sample, shall be selected at random by the Government representative from each 50 assemblies produced or from each month's production, whichever occurs first. All the tests in table XIX shall be applied separately to each assembly in the sample.

4.5.2.3 Acceptance. Where any one assembly of either sample fails to meet any specified requirement, the lot shall be rejected. Rejected lots shall be subject to the provisions of MIL-STD-105.

4.5.3 Inspection plan B.

4.5.3.1 Sample and tests. The sample shall be selected by the Government representative in accordance with the provisions of MIL-STD-105. All the tests in table XVIII and only the test of item 307 in table XIX shall be applied.

4.5.3.2 Acceptance. Acceptance and rejection shall be in accordance with MIL-STD-105.

4.5.4 Inspection plan C.

4.5.4.1 Sample and tests. Each assembly in every lot shall be subjected to all the tests in table XVII and shall be examined visually for completeness, improper assembly and evidence of poor workmanship.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

4.5.4.2 Acceptance. Where any one assembly fails to meet any specified requirement, the defective assembly shall be removed from the lot and resubmitted only after all defects have been corrected.

4.5.5 Inspection equipment. Unless otherwise specified in the contract, the contractor shall supply, maintain and calibrate inspection equipment in accordance with the provisions of MIL-I-45607 and MIL-STD-45662.

4.5.6 Packaging inspection. The sampling and inspection of the preservation - packaging, packing and container marking shall be in accordance with the provisions of packaging data sheet P117,32500.

TABLE XVII. Performance tests.

Item	Characteristic	Requirement	Test Procedure
101	Continuity	3.3.1	4.6.2.1
102	Panel lighting	3.3.2	4.6.2.2
103	Self test lamps	3.3.3	4.6.2.3
104	Main power switch	3.3.4	4.6.2.4
105	Crosswind switch	3.3.5	4.6.2.5
106	Boresight switch	3.3.6	4.6.2.6
107	Crosswind potentiometer	3.3.7	4.6.2.7
108	Manual range potentiometer	3.3.8	4.6.2.8
109	Air temperature potentiometer	3.3.9	4.6.2.9
110	Altitude potentiometer	3.3.10	4.6.2.10
111	Remaining tube life potentiometer	3.3.11	4.6.2.11
112	AS output	3.3.12	4.6.2.12
113	Elevation common zero ($-Z_E$) output	3.3.13	4.6.2.13
114	Azimuth common zero ($+Z_D$) output	3.3.14	4.6.2.14
115	Elevation zeroing ($-J_E$) output	3.3.15	4.6.2.15
116	Azimuth zeroing ($+J_D$) output	3.3.16	4.6.2.16
117	Self test	3.3.17	4.6.2.17
118	BIT output	3.3.18	4.6.2.18
119	$\overline{\text{BIT}}$ output	3.3.19	4.6.2.19
120	Lamp test	3.3.20	4.6.2.20
121	Sealing A	3.4	4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XVIII. General tests.

Item	Characteristic	Requirement	Test Procedure
301	Fabrication	3.3.1	Applicable drawings - Visual
302	General Specifications	3.1.2	MIL-F-13926 - Visual

TABLE XIX. Environmental tests.

Item	Characteristic	Requirement	Test Procedure
303	Shock	3.5.1	4.6.3.1
304	Vibration B	3.5.2	4.6.3.2
305	High Temperature	3.5.3 and 3.5.4	4.6.3.3
306	Low Temperature	3.5.3 and 3.5.4	4.6.3.4
307	Temperature cycling	3.5.3 and 3.5.4	4.6.3.5
308	Sealing B	3.4	4.6.4

4.6 Methods of inspection.

4.6.1 Test equipment. The test equipment in table XX shall be used where specified to perform the required test.

Source: https://assist.dla.mil -- Downloaded: 202640-22T19:27Z
Check the source to verify that this is the current version before use.

TABLE XX. Test equipment.

Item	Part Number	Nomenclature
1	11750207	Test Set - Gunner's Control Unit
2	11821748	Test Set - Immersion Leak, Purge and Fill
3	11821414	Fixture - Gunner's Control Mounting
4	11823179	Unit Fixture, Gunner's Control
5	11821206	Switch Lock, Gunner's Control
6	11821457	Fixture Shock - Vertical and Horizontal Plane
7	11821458	Shock Adapter Plate Vib Horiz/Vert Plane - Shock Z

4.6.2 Performance tests.

4.6.2.1 Continuity. Use item 1 of table XX to verify compliance with the requirements of 3.3.1.

4.6.2.2 Panel lighting. Use item 1 of table XX to verify compliance with the requirements of 3.3.2.

4.6.2.3 Self test lamps. Use item 1 of table XX to verify compliance with the requirements of 3.3.3.

4.6.2.4 Main power switch. Use item 1 of table XX to verify compliance with the requirements of 3.3.4.

4.6.2.5 Crosswind switch. Use item 1 of table XX to verify compliance with the requirements of 3.3.5.

4.6.2.6 Boresight switch. Use item 1 of table XX to verify compliance with the requirements of 3.3.6.

4.6.2.7 Crosswind potentiometer. Use item 1 of table XX to verify compliance with the requirements of 3.3.7.

4.6.2.8 Manual range potentiometer. Use item 1 of table XX to verify compliance with the requirements of 3.3.8.

4.6.2.9 Air temperature potentiometer. Use item 1 of table XX to verify compliance with the requirements of 3.3.9.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

4.5.6.10 Altitude potentiometer. Use item 1 of table XX to verify compliance with the requirements of 3.3.10.

4.6.2.11 Remaining tube life potentiometer. Use item 1 of table XX to verify compliance with the requirements of 3.3.11.

4.6.2.12 AS output. Use item 1 of table XX to verify compliance with the requirements of 3.3.12.

4.6.2.13 Elevation common zero ($-Z_E$) output. Use item 1 of table XX to verify compliance with the requirements of 3.3.13.

4.6.2.14 Azimuth common zero ($+Z_D$) output. Use item 1 of table XX to verify compliance with the requirements of 3.3.14.

4.6.2.15 Elevation zeroing ($-J_E$) output. Use item 1 of table XX to verify compliance with the requirements of 3.3.15.

4.6.2.16 Azimuth zeroing ($+J_D$) output. Use item 1 of table XX to verify compliance with the requirements of 3.3.16.

4.6.2.17 Self test. Use item 1 of table XX to verify compliance with the requirements of 3.3.17.

4.6.2.18 BIT output. Use item 1 of table XX to verify compliance with the requirements of 3.3.18.

4.6.2.19 $\overline{\text{BIT}}$ output. Use item 1 of table XX to verify compliance with the requirements of 3.3.19.

4.6.2.20 Lamp test. Use item 1 of table XX to verify compliance with the requirements of 3.3.20.

4.6.3 Environmental tests.

4.6.3.1 Shock.

4.6.3.1.1 Basic design. Use items 4, 5, 6 and 7 of table XX and subject the assembly to the shock test specified in MIL-STD-810, method 516.2, procedure I, figure 516.2-2. Apply three half sine wave shock pulses in each direction along the three axes. Peak amplitude shall be 40 $\pm$4 g with a time duration of 18 $\pm$3 msec measured at the 10 percent amplitude points. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

4.6.3.1.2 High intensity. Use items 4, 5, 6 and 7 of table XX and subject the assembly to the shock test specified in MIL-STD-810, method 516.2, procedure IV, figure 516.2-2. Apply three half sine wave shock pulses in each direction along the three axes. Peak amplitude shall be 100.0 ±10.0 g with a time duration of 1.5 ±0.2 msec measured at the 10 percent amplitude points. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

4.6.3.2 Vibration. Application of Vibration A and Vibration B shall be as determined by the procurement conditions of 4.5.1 and the first article conditions of 4.4.

4.6.3.2.1 Vibration A. Use item 4, 5, 6 and 7 of table XX and subject the assembly to the vibration test specified in MIL-STD-810, method 514.2 procedure VIII, except that the test level shall be the vibration curve shown in figure 2 and duration of exposure shall be not less than 80 minutes per axis. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

4.6.3.2.2 Vibration B. This test shall be conducted as in 4.6.3.2.1 except that the period of vibration shall be not less than 15 minutes in each axis.,

4.6.3.3 High temperature. Use item 3 of table XX and subject the assembly to the high temperature test specified in MIL-STD-810, method 501.1, procedure I. The highest operating temperature shall be 140°F. The performance tests of 4.6.2 shall be applied.

4.6.3.4 Low temperature. Use item 3 of table XX and subject the assembly to the low temperature test specified in MIL-STD-810, method 502.1, procedure I. The storage temperature shall be -65°F. The lowest operating temperature shall be -25°F. The performance tests of 4.6.2 shall be applied.

4.6.3.5 Temperature cycling. With power and loads of table I applied, subject the assembly to the temperature profile specified in figure 3. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

4.6.3.6 Humidity. Place the assembly in a humidity chamber and subject it to the humidity tests specified in MIL-STD-810, method 507.1, procedure IV. During steps 4, 6 and 8 of procedure IV, subject the assembly to the performance tests of 4.6.2. After exposure, subject the assembly to the performance tests of 4.6.2.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

4.6.3.7 Altitude. Use item 5 of table XX and subject the assembly to the altitude test specified in MIL-STD-810, method 500.1, procedure I, except that:

a. First, the assembly in a non-operating condition, shall be exposed to an atmospheric pressure equivalent to 40000 feet above sea level for a period of not less than 1 hour.

b. Second, with the chamber pressure increased to an atmospheric equivalent to 10000 feet above sea level, subject the assembly to the performance tests of 4.6.2.

4.6.3.8 Dust. Subject the assembly to the dust test specified in MIL-STD-810, method 510.1, procedure I. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

4.6.3.9 Salt fog. Subject the assembly to the corrosion test specified in MIL-STD-810, method 509.1, procedure I. At the conclusion of this test, subject the assembly to the performance tests of 4.6.2.

4.6.4 Sealing. Pressurize the assembly with nitrogen to 5.0 ± 0.1 psig and perform either Sealing A or Sealing B leakage tests. After determination of compliance with the sealing requirement, purge the assembly with dry nitrogen at 1 psig for not less than 5 minutes and lower the pressure to 0.0 + 0.2 - 0.0 psig. Nitrogen shall BB-N-411, type I, class 1, grade B with a dewpoint not greater than -25°F.

4.6.4.1 Test selection. Application of Sealing A and Sealing B shall be as determined by the procurement conditions of 4.5.1 and the first article conditions of 4.4.

4.6.4.2 Sealing A. Use item 2 of table XX and subject the assembly to the leakage (immersion) test specified in MIL-STD-810, method 512.1, procedure IV. The immersion period shall be not less than 5 minutes.

4.6.4.3 Sealing B. Use item 2 of table XX, place the assembly in the following environment for not less than 2 hours and verify that the pressure drop is not greater than 0.2 psig.

a.	Temperature	73° ± 2.5°F
b.	Relative humidity	50 percent ± 5 percent
c.	Atmospheric pressure	28.5 + 2.0 − 3.0 in. Hg.

Source: https://assist.dla.mil -- Downloaded: 202610-22T19:27Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Packaging, packing and marking. Packaging, packing and marking shall be in accordance with packaging data sheet P11732500. The level of protection shall be as specified in the procurement document. (See 4.5.6)

6. NOTES

6.1 Intended use. The assembly is part of the M21 Ballistic Computer System.

6.2 Ordering data. Procurement documents should specify the following:

a. Title, number and date of this specification.

b. Special tests and examinations required, the type of inspections required, and the activity responsible for testing and its facility.

c. Applicable packaging data sheet number (see 5.1).

d. Selection of applicable levels of preservation, packaging and packing.

e. Applicable stock number.

f. First article inspection requirements.

6.3 Previous revisions of MIL-C-48457B was for the US Army Armament Research and Development Command's internal use only, and were not forwarded to the Naval Publications and Form Center for publication.

Custodian:
Army-AR

Preparing Activity:
Army-AR
Project No. 1220-A284

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-C-48457B CONTROL, GUNNER'S, COMPUTER; 11732500

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:27Z
Check the source to verify that this is the current version before use.