INCH-POUND


MIL-DTL-15665/108A
13 March 2017
SUPERSEDING
MIL-DTL-15665/108
15 May 2012

DETAIL SPECIFICATION SHEET


INSIGNIA, COLLAR, OFFICER, ELECTRONIC WARFARE, U.S. ARMY

This specification is approved for use by all
Departments and Agencies of the Department of Defense.


The requirements for acquiring the product described herein shall consist of this specification sheet and the latest issue of MIL-DTL-15665.

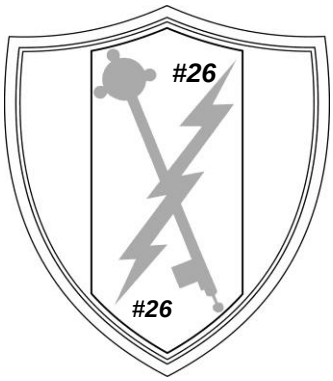

BASE w/PAD

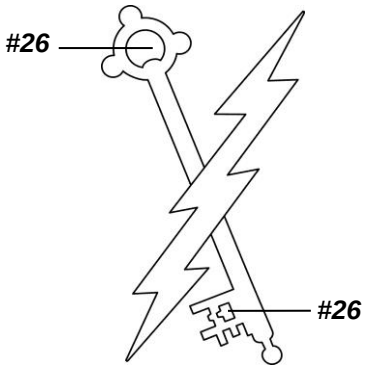

DEVICE

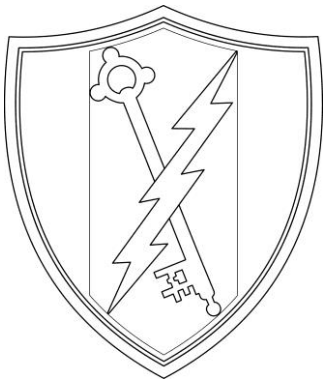

ASSEMBLED

DASH NUMBERS:
-1 Officer Insignia, Base
-2 Officer Insignia, Device
-3 Officer Insignia, Assembled

MATERIAL (-1, -2 and -3): Red Brass 85/15 (UNS Alloy No. C-230).

FINISH (-1, -2 and -3): 24K Gold Plated, Mirror-like Polished, and shall match The Institute of Heraldry (TIOH) Metal Finish Chip Number 6.

AMSC N/A FSC 8455

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T07:05Z
Check the source to verify that this is the current version before use.

DIMENSIONS:
HEIGHT:
-1, -3: 1 inch (REF)
-2: 23/32 inch (REF)
THICKNESS:
-1 (at center of shield): 0.076 inch ± 0.005 inch
-2 (at center of lightning bolt): 0.067 inch ± 0.005 inch
-3 (at center of lightning bolt): 0.143 inch ± 0.010 inch

ATTACHING DEVICES: For -3, the device shall be swaged and glued to the base for assembly. The attaching device shall be prong and clutch type, with two prongs located on the vertical center line of the insignia 7/8 inch ± 1/32 inch apart from each other.

EPOXY (-1 and -2): Epoxy enamel shall be applied as indicated above and as specified in the table below, and shall match the TIOH Hard Enamel Color Chip Number listed. Hard cloisonné enamel may be used in lieu of epoxy enamel. If hard Cloisonné enamel is used, the required base material for -1 and -2 shall be Gilding Metal 95/5 (UNS Alloy C-210):

TIOH HARD ENAMEL COLOR CHIP NUMBER	ITEM	LOCATION
BLACK #26	-1	Central panel of shield
	-2	Interior circle at top of key and interior nook at bottom of key

NOTES:
1. The term (REF) refers to the measurements taken from the Government furnished hub or die.

2. For -1 and -2, the manufacturer may deviate from MIL-DTL-15665 by using nickel undercoating prior to applying the requisite 24K gold plating.

CHANGES FROM PREVIOUS ISSUE: Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extent of the changes.

Custodian:
Army - IH

Preparing activity:
Army - IH

Review activity:
DLA - CT

(Project No. 8455-2017-158)

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T07:05Z
Check the source to verify that this is the current version before use.