JJ-G-451F
AMENDMENT-1
March 29, 1974

FEDERAL SPECIFICATION

GLOVES, CLOTH, LEATHER PALM

This amendment which forms a part of Federal Specification JJ-G-451F, dated March 22, 1973, was approved by the Commissioner, Federal Supply Service, General Services Administration, for the use of all Federal agencies.

PAGE 5

3.6.1.1 Delete last two sentences.

3.6.1.3 Delete and substitute:

"3.6.1.3 Type 301 stitching. On all stitching, thread breaks and two or more consecutive skipped stitches or run-offs shall be overstitched not less than 1/2 inch back of the break. Ends of stitching shall be backstitched or backtacked not less than 1/2 inch except where ends are caught in other seams and stitching."

Add the following paragraphs:

"3.6.1.3.1 Repairs of type 301 stitching. Repairs of type 301 stitching shall be as follows:

a. When thread breaks or bobbin run-outs occur during sewing, the stitching shall be repaired by restarting the stitching a minimum of 1/2 inch back of the end of the stitching.

b. Thread breaks, or two or more consecutive skipped stitches or run-offs noted during inspection of the item (in-process or end item) shall be repaired by overstitching. The stitching shall start a minimum of 1/2 inch back of the defective area, continue over the defective area and continue a minimum of 1/2 inch beyond the defective area onto the existing stitching. Loose or tight stitching shall be repaired by removing the defective stitching without damaging the material and restitching in the required manner. 1/

1/ When making the above repairs, the ends of stitching are not required to be backstitched."

"3.6.1.4 Type 401, 504 and 505 stitching. Thread tension shall be maintained so that there will be no loose stitching. Where stitch type 401 is used, the looper thread shall be on the inside of the gloves. Both ends of all seams or stitching produced with 401 stitch type, when not caught in other seams or stitching shall have a 1/2 to 3/4 inch chain extending beyond each end. All repairs shall be in accordance with 3.6.1.3.1 a. and 3.6.1.3.1 b."

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T11:56Z
Check the source to verify that this is the current version before use.

PAGE 7

Table I, operation 3. Delete second sentence and substitute the following:

"The flannel shall be securely caught in the cuff joining seams, the closing side seam starting at the cuff joing seam and continuing for a distance of 1-1/4 to 1-1/2 inches from the cuff joining seams, the palm joining seam from cuff joining to within 1/2 to 3/4 inch of the crotch of thumb. The lining shall be securely sewn to the entire curvature of the finger tips and to the entire curvature of the tip of the back of the thumb. The lining on the front of the thumb shall be caught in the seam joining the front and back of the thumb to within 1/4 to 1/2 inch of the thumb crotch."

PAGE 8

Table I, in heading for operation 9. after "Type I". Delete ", Styles A and B".

Delete subparagraph (a) and substitute:

"(a) The bottom edge (edge attached to wrist) of gauntlet shall be overedge stitched with 3/16 - 1/4 inch gage stitch.

Stitch type	Seam & Stitching type	Stitches per inch	Thread	
			Needle	Bobbin or Looper
504 or 505	EFd-1	6 - 8	30-4	30-4"

PAGE 9

Table I, in heading for operation 9. after "Type I". Delete ", Styles A and B".

Delete subparagraph (b) and substitute:

"(b) The gauntlet, made of laminated cotton fabrics, shall be attached to top of hand at wrist by a double row of stitches, 1/8 to 3/16 inch gage.

Stitch type	Seam & Stitching type	Stitches per inch	Thread	
			Needle	Bobbin or Looper
301 or 401	LSa-2	8 - 10	20-4	30-4"

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T11:56Z
Check the source to verify that this is the current version before use.

PAGE 15

Table IV Add the following defect for "Flannel fabric":

	Major	Minor
"Flannel lining not caught in specified seam:		
Seriously affecting serviceability	X	
Affecting serviceability, but not seriously		X"

PAGE 18

Table V, line 3. Delete "or damaged" and substitute "damaged or not as specified."

5.1 Delete "A or C" and substitute "A, B or C".

PAGE 20

Figure 1 Delete and substitute revised Figure 1.

Custodian:

Army - GL

Review activity:

Army - MD

User activities:

Navy - MC, YD

Preparing activity:

Army - GL

CIVIL AGENCY COORDINATING ACTIVITIES:

JUSTICE - FPI
USDA - AFS
GSA-FSS

Project No. 8415-0816

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T11:56Z
Check the source to verify that this is the current version before use.

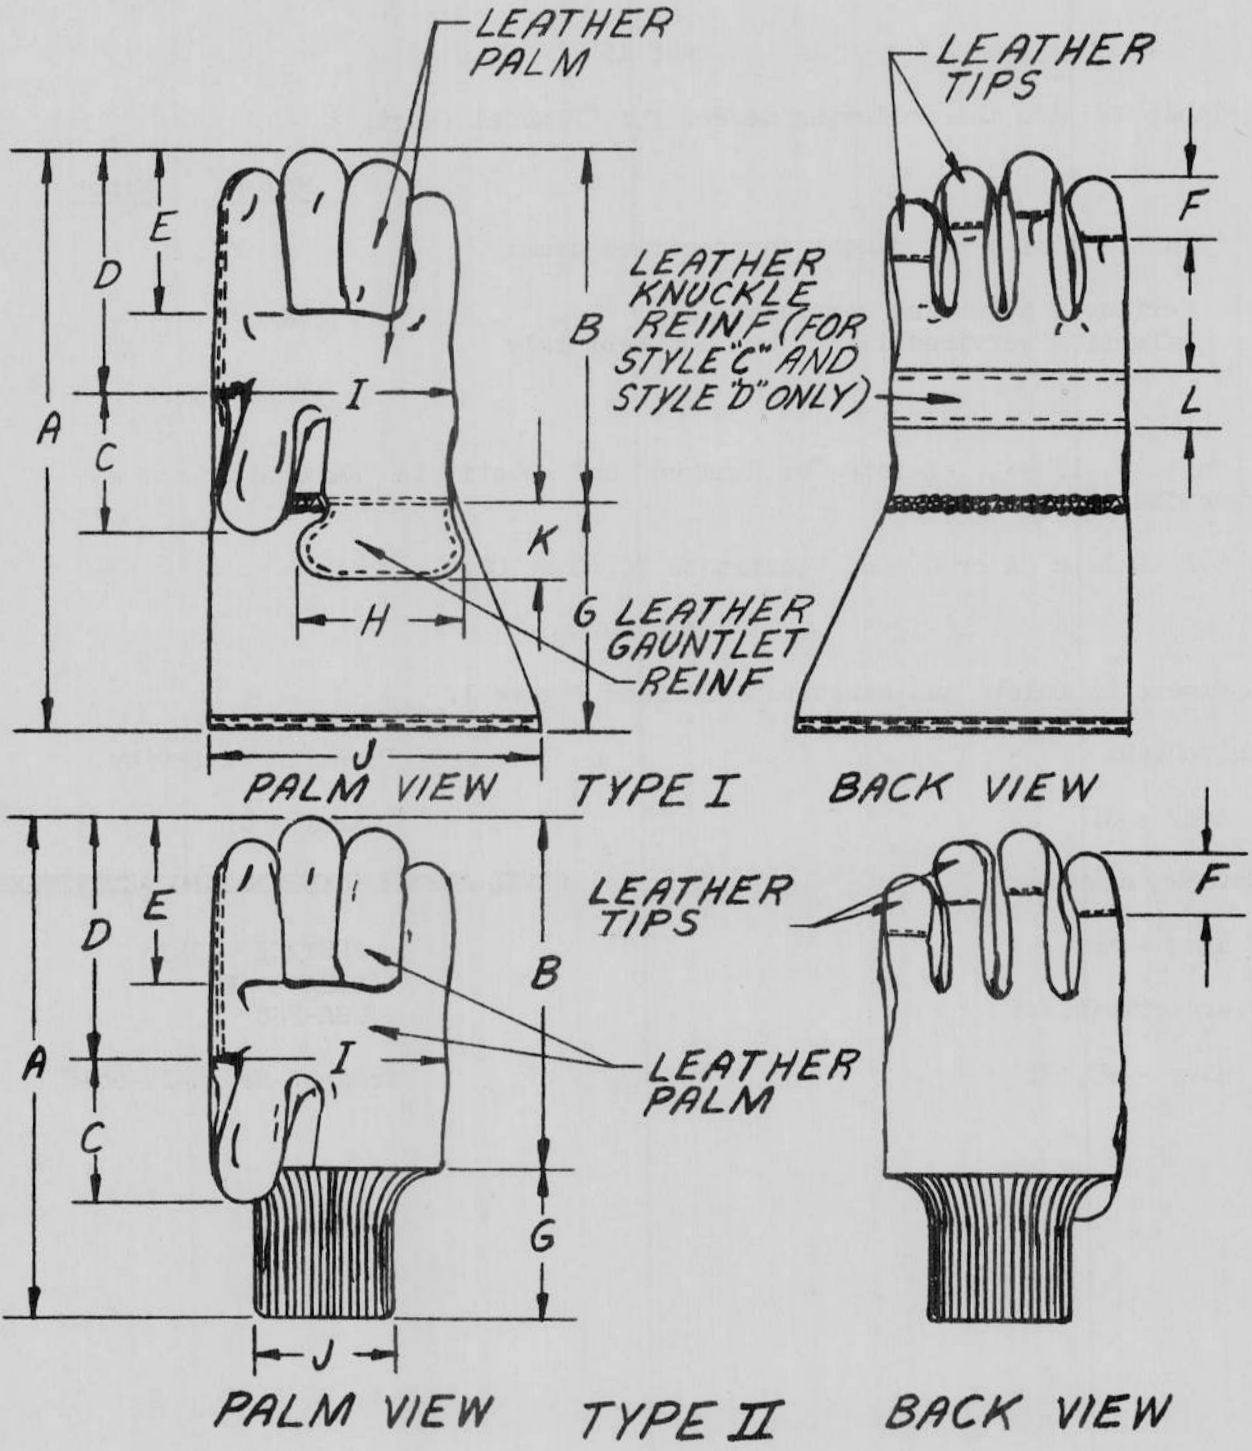


FIGURE 1 GLOVE, CLOTH, LEATHER PALM

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T11:56Z
Check the source to verify that this is the current version before use.