MIL-W-48856B (AR)
7 August 1985
SUPERSEDING
MIL-W-48856A (AR)
24 March 1983

MILITARY SPECIFICATION

WARHEAD SECTIONS, GUIDED MISSILE, H.E. M258E6 LOADING, ASSEMBLING AND PACKING

This specification is approved for use by US Army Armament, Munitions and Chemical Command, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification contains the quality assurance provisions for the loading, assembling, and packing of Warhead Sections, Guided Missile, H.E., M258E6.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified, the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-E-46495 - Explosive Composition, HTA-3
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification for
MIL-F-48863 - Fuze, Guided Missile, M934E6 Parts Assembly, Loading and Packing for
MIL-P-50977 - Pellets (PBX)

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Center, Attn: AMSMC-QA, Dover, New Jersey 07801-5001 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC: 1336

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil - Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures & Tables for Inspection by Attributes
MIL-STD-453 - Inspection, Radiographic

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS

US ARMY ARMAMENT RESEARCH AND DEVELOPMENT CENTER (ARDC)

9378271 - Warhead Section, Guided Missile, H.E., M258E6

9297066 - Fuze, Guided Missile: M934E6

9322206 - Packing and Marking for Shipping Container for Box, Ammo, M2A1 for Warhead Section, GM, H.E., or Inert, M258 Series

(Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.1.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids shall apply.

CODE OF FEDERAL REGULATIONS

49 CFR 170-189 - Department of Transportation Rules for Regulations for the Transportation of Explosive and Other Dangerous Articles.

(The Department of Transportation Regulations are now a part of the Code of Federal Regulations (1949 Edition and revisions) available from the Superintendent of Documents, Government Printing Office, Washington, D. C. Orders for the above publications should cite "49 CFR 0-199 (latest revision)").

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Material. Materials shall be in accordance with applicable drawings and specifications.

3.1.1 PBX pellets. PBX pellets shall comply with the requirements of MIL-P-50977 and drawing (dwg. 9210109).

3.1.2 Explosive. The explosive shall comply with specification MIL-E-46495, Type II.

3.2 Components and assemblies. The components and assemblies shall comply with all requirements specified on Dwg 9378271 and associated drawings and with all requirements specified in applicable specifications and standards.

3.3 Radiographic examination. Warheads shall be radiographically examined in accordance with MIL-STD-453 and shall not exceed the "maximum allowable cast defects" noted hereunder. The minimum optical density of each radiograph in the area being inspected shall not be less than 1.25 and shall be within a density range that will permit proper identification of gap or separation defects.

Maximum Allowable Cast Defects

	Segment A and Surface 1
Total projected area (sq. in.) of all cavities in the plane of observation	1/16 sq. in.
Maximum projected length (in.) of any cavity in the plane of observation	1/4 in.
Maximum projected length (in.) of any crack in the plane of observation	1/4 in.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

Maximum projected area (sq. in.) of any crack in the plane of observation	zero sq. in.
Piping cavities, maximum number allowed in the plane of observation	zero
Annular rings, maximum number allowed in the plane of observation	zero

Surface 2

Maximum depth (in.) of cavities	1/8 in.
Maximum width (in.) of cavities	1/16 in.
Maximum length (in.) of cavities	1/2 in.

Note. Cavities having a maximum projected dimension in any direction of 1/32 inch or less and cracks having a maximum dimension of 1/4 inch or less shall be disregarded provided that they are separated by 1/2 inch of solid explosive. Cavities having a maximum projected dimension of 1/32 inch or less not separated by 1/2 inch of solid explosive shall be included in the computation of total area. See Figure I for definition of surfaces and segments.

3.4 Warhead Body Loading Assembly continuity requirements (dwg 9378270). The warhead cable and connector shall meet the following continuity requirements after machining of explosives: (see dwg 9344462 for PIN # identification).

P3 - PIN #	P3 - PIN #	J1 - PIN #	RESISTANCE (OHMS)
4 to		3	$\leq$ .5
6 to		4	$\leq$ .5
7 to		5	$\leq$ .5
10 to		1	$\leq$ .5
13 to		2	$\leq$ .5
9 to	2		$\leq$ 50
Each P3 Pin to the Warhead Case			$\geq$ 10 MEG
Each P3 Pin to all other P3 Pins shorted together. (Pin 9 to 2 of P3 connector and vice versa not included.)			$\geq$ 10 MEG

NOTE: $\leq$ means "less than or equal to"
$\geq$ means "more than or equal to"

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3.5 Fuze, Guided Missile, M934E6, dwg. 9297066, prior to assembly into warhead section. The fuze shall meet the following requirements:

3.5.1 Fuze safe condition. The fuze shall be in a safe and operable condition. (Appearance of only a green surface through the fuze window indicates the unit is safe. Appearance of the entire tip of the rotor primary lock pin, which is shiny and silver in color, indicates that the fuze will not arm. Appearance of an orange and green surface through the window indicates that the unit is in the abort condition. Appearance of an orange surface through the window indicates that the unit is armed. The viewing angle should be perpendicular to the fuze window.)

3.5.2 Isolation resistance (detonation). The isolation resistance between J3 pins 6 and 8 shall be greater than or equal to 950K OHMS. (The Detonator should be considered electrically armed if this test measurement is incorrect. Test current to be limited to 0.25uA.)

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

NOTE: THE POSITIVE TERMINAL OF MEASUREMENT INSTRUMENT SHALL BE IN PIN 6. THE MEASUREMENT MAY EXHIBIT A CAPACITOR CHARGING CHARACTERISTICS WHEN OHMMETER IS CONNECTED.

3.5.3 Fuze configuration number. The fuze configuration number, 9297066, shall be clearly marked.

3.5.4 Fuze condition. The fuze shall not be damaged nor show evidence of corrosion or foreign material.

3.5.5 Fuze isolation resistance. The isolation resistance between the fuze connector and the fuze base shall be:

Resistance Between J3 Pins & Fuze Base

1 thru 21 to Fuze Base (+ terminal)	$\geq$ 10 MEG OHMS
1 thru 21 (+ terminal) to Fuze Base	$\geq$ 10 MEG OHMS

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

3.5.6 Electrical continuity. The continuity between pins shall be as follows:

J3 PIN #	J3 PIN #	TEST CURRENT* (mA)	RESISTANCE (OHMS)
15 (+)	21	1	≤ 0.3
10 (+)	21	1	≤ 0.3
11 (+)	21	1	≤ 0.3
15 (+)	16	1	10.8 ± 2.0
15 (+)	12	1	4.0 ± 1.2
18 (+)	8	0.1	2.2K ± 0.2K
3 (+)	8	0.1	3.3K ± 0.3K
13 (+)	8	0.1	1.0K ± 0.1K
20 (+)	8	0.1	5.1K ± 0.5K
14 (+)	6	10uA	51K ± 5K
5 (+)	10	0.25uA	≥ 1M
7 (+)	11	1uA	≥ 30K**
5 (+)	7	0.25uA	≥ 1M

NOTE: *Test current not to exceed 105% of current specified.
**Exhibits capacitor charge current when test set is first connected.

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

3.6 Warhead Section, Guided Missile, M258E6 (dwg. 9378271) after connection of P3 to J3.

3.6.1 The continuity between pins shall be as follows:

POSITIVE TERMINAL		RESISTANCE (OHMS)
J1-1	J3-21	≤ .8
J3-10	J1-1	≤ .8

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

J3-11	J1-1	$\leq$ .8
J1-3	J3-10	$\geq$ 1M
J1-4	J3-11	$\geq$ 30K
J1-2	J1-5	2.2K $\pm$ 0.2K
J3-20	J1-5	5.1K $\pm$ 0.5K

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

3.6.2 Warhead isolation resistance. The isolation resistance between all J1 pins and warhead case, and between all accessible J3 pins and the warhead case, shall be as follows:

RESISTANCE BETWEEN ALL PINS AND WARHEAD CASE	RESISTANCE (OHMS)
All pins + DC	= 10 MEG OHMS
All pins - DC	= 10 MEG OHMS

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

3.7 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.7.1 Tests per MIL-F-48863C. The warhead section shall be subjected to the Thermal Shock, Transportation Vibration, and Flight Vibration Test environments in accordance with MIL-F-48863C, paragraphs 4.5.6, 4.5.7, and 4.5.9 respectively.

3.7.2 Sequential testing. After sequential testing the fuze shall be removed from the warhead sections; they shall be 30g arm tested, and dent tested by the self-destruct method in accordance with MIL-F-48863C. Acceptance shall be based upon compliance with the requirements of MIL-F-48863C for internal impedances, flight motor ignition time, flight motor dwell time, arm time, self-destruct time and dent. Warhead acceptance shall be based upon high order detonation.

3.8 Workmanship. All warheads shall be loaded in a thorough manner. Warhead assemblies, kettles and related pouring apparatus shall be free of dirt, grease, rust, corrosion products or other foreign material. Care shall be taken during loading or subsequent heat probing of the explosive cast that the electrical filter and wiring harness within the loading cavity are not damaged. All exterior warhead surfaces and electrical connectors shall be free of explosive, and contamination caused by

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

chemicals, foreign matter or dirt. Attentive care shall be taken in mating the fuze and warhead connectors so as not to damage the connector pins or damage wiring. Broken or cracked connectors, damaged electrical wiring harnesses or damaged fuzes shall not be used for assembly into warhead sections. Required markings shall be neat and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The following types of inspection shall be conducted on this item:

a. First article inspection.

b. Quality conformance inspection.

4.3 First article inspection

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated.

Part Description	Drawings	Quantity
Pellets, PBX	9210109	6
Warhead, Body, Loading Assembly	9378270	6
*Warhead Section, GM, H.E., M258E6	9378271	6

*Fuze & loaded warhead should be supplied unassembled to each other.

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.4 Quality conformance inspection.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

4.4.1 Inspection lot formation. Inspection lots shall comply with lot formation provisions of MIL-A-48078. In addition, inspection lots shall contain:

a. PBX pellets from not more than one lot interfix from one manufacturer.

b. HTA-3 from not more than one lot interfix of one manufacturer.

4.4.2 Examination. See MIL-A-48078.

a. Sampling Plans. Unless otherwise specified in the Classification of Defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48856B (AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
	Warhead Section, GM, H.E., M258E6				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	PBX Pellet (Dwg. 9210109) Examination for defects	6		3.1, 3.1.1	4.4.2.1
	Warhead Body Loading Assembly (Dwg. 9378270) Examination for defects	6		3.1, 3.1.2	4.4.2.2
	Warhead Section, GM, H.E., M258E6 (Prior to assembly of fuze to warhead) (Dwg. 9378271) Examination of defects	6 1/		3.2	4.4.2.3
	Fuze, Guided Missile, M934E6 (Prior to assembly of fuze to warhead section (Dwg. 9297066) Examination for defects	6 1/		3.2	4.4.2.4

NOTES:

1/ These components will be assembled to form the warhead sections (Dwg. 9378271) for the sequential examination first article test (see sheet 2 of Table I).

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48856B (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
	Warhead Section, GM, H.E., M258E6				9378271
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Sequential Examination	6		3.2	
	Warhead Section, GM, H.E., M258E6				
	Examination for defects	6		3.2	4.4.2.5
	Thermal shock 2/	6		3.7.1	MIL-F-48863C(4.5.6)
	Transportation vibration -50°F	3		3.7.1	MIL-F-48863C(4.5.7)
	Transportation vibration +160°F	3		3.7.1	MIL-F-48863C(4.5.7)
	Flight vibration -50°F	3		3.7.1	MIL-F-48863C(4.5.9) 4/
	Flight vibration +140°F	3		3.7.1	MIL-F-48863C(4.5.9) 4/
	Five foot drop -50°F				MIL-STD-331
	a. Forward end down	1			Test III 5/
	b. Scribe line down	1			
	c. Scribe line 90° from b.	1			
	Five foot drop +140°F				MIL-STD-331
	a. Forward end down	1			Test III 5/
	b. Scribe line down	1			
	c. Scribe line 90° from b.	1			
	Evaluate warhead section	6		3.2	4.4.2.5
	Evaluate fuze 3/	6		3.7.2	MIL-F-48863C
	Evaluate warheads 3/	6		3.7.2	4.5.7

NOTES: 2/ After the test, condition 3 units hot & 3 units cold, then maintain temperatures in subsequent tests. 3/ For information only. 4/ Fuze power shall not be applied under any circumstances. 5/ Criteria B of MIL-STD-331,Test 111 shall apply with thread damage acceptable.

Source: https://assist.dla.mil - Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9210109
4.4.2.1	PBX, Pellet				NEXT HIGHER ASSEMBLY 9378271
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Pellet diameter		0.40%	3.1.1	Gage
102	Pellet height		0.40%	3.1.1	Gage
103	Pellet density		0.40%	3.1.1	Gage
Minor					
201	Presence of cracks or laminations		0.65%	3.1.1	Visual
202	Evidence of poor workmanship		0.65%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48856B (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.2	Warhead Body Loading Assembly	1 OF 1	9378270
			NEXT HIGHER ASSEMBLY: 9378271

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Explosive on threads		100%	3.2	Visual
2	Explosive on fuze mounting shelf & cavity		100%	3.2	Visual
Major					
101	Continuity does not conform to requirements		100%	3.4	4.5.3/4.5.5/Gage
102	Radiographic examination		100%	3.3	4.5.2/Visual
103	Explosive composition	3	by pour	3.1.2	4.5.1/Gage
104	Density of explosive	3	by pour	3.1.2	4.5.1/Gage
105	Moisture content of explosive	3	by pour	3.1.2	4.5.1/Gage
106	Explosive weight		100%	3.2	4.5.6/Gage
107	Warhead weight		100%	3.2	Gage
108	Distance from explosive to fuze mounting shoulder		0.40%	3.2	Gage
109	J1 connector damaged or not secure 1/		100%	3.2	Visual/Manual
110	P3 connector damaged		100%	3.2	Visual/Manual
Minor					
201	Diameter of pellet cavity		0.65%	3.2	Gage
202	True position of pellet cavity with large inside diameter		0.65%	3.2	Gage
203	Loose explosive material in pellet cavity		0.65%	3.2	Visual
204	Evidence of poor workmanship		100%	3.8	Visual

NOTES:
1/ No perceptible angular movement due to finger pressure.

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9378271
4.4.2.3	Warhead Section, GM, M258E6 (Prior to Assembly of Fuze to Warhead)				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Max. height of pellet above explosive (prior to pad mounting)		0.40%	3.2	Gage
Minor					
201	Felt pad missing, loose or misaligned		0.65%	3.2	Visual/Manual
202	Evidence of poor workmanship		100%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48856B (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.4	Fuze, Guided Missile M934E6 (Prior to Assembly of Fuze to Warhead Section)		9297066
			NEXT HIGHER ASSEMBLY 9378271

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Orange flag visible through window		100%	3.5.1	Visual
2	Green flag not visible through window		100%	3.5.1	Visual
3	Continuity between J3 pins 6 to 8		100%	3.5.2	4.5.4/4.5.5/Gage
Major					
101	Isolation resistance does not conform to requirements		100%	3.5.5	4.5.4/4.5.5/Gage
102	Continuity does not conform to requirements		100%	3.5.6	4.5.4/4.5.5/Gage
103	Evidence of corrosion, foreign material or damaged parts		100%	3.5.4	Visual
104	Head of primary pin lock totally visible		100%	3.5.1	Visual
Minor					
201	Marking omitted, misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		100%	3.8	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48856B (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9378271
4.4.2.5	Warhead Section, GM, H.E., M258E6				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Continuity (connectors P3 & J3 not assembled to each other)		100%	3.4	4.5.4/4.5.5/Gage
102	Continuity (connectors P3 & J3 assembled to each other)		100%	3.6.1	4.5.4/4.5.5/Gage
103	Isolation resistance (connectors P3 & J3 assembled to each other)		100%	3.6.2	4.5.4/4.5.5/Gage
104	Distance from aft end of warhead to fuze window, (min.)		100%	3.2	Gage
105	Distance from aft end of warhead to top of fuze, (min.)		100%	3.2	Gage
106	Distance from aft end of warhead to P3 connector, (min.)		100%	3.2	Gage
107	Torque of warhead set screws		0.40%	3.2	Gage
108	Presence of J3 connector fastener		0.40%	3.2	Visual
109	Center of gravity		100%	3.2	Gage
110	Roll unbalance 1/		100%	3.2	Gage
111	Functional check for thread engagement		100%	3.2	Gage
112	Location and orientation of J3 connector		100%	3.2	Gage
113	J1 connector keyway orientation		100%	3.2	Gage
114	J1 connector loose or damaged		100%	3.2	Gage
Minor					
201	Markings missing or improper		0.65%	3.2	Visual
202	Evidence of poor workmanship		100%	3.8	Visual

NOTES:

1/ Roll unbalance can be calculated from the weight and location of the center of gravity.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and 6.3 herein.

4.5 Test methods and procedures.

4.5.1 Composition, density and moisture content of explosive charge. The charge sample and the wafers shall be analyzed and tested as detailed in Specification MIL-E-46495. Failure to meet one or more of the requirements shall class the batch defective. Water may be used as a substitute for mercury in the determination of density of the explosive as specified in MIL-E-46495. The three (3) wafers shall be poured from each batch for this test. (One near start of pour, one near the middle and one near end of pour.) Note: Pour shall be sufficient for 100 units max.

4.5.2 Radiographic examination. Radiographic examination shall be in accordance with MIL-STD-453. The explosive charge shall be radiographically examined by directing the beam normal to the longitudinal axis of the unit. A second exposure shall be made after rotating the unit 90 degrees on its longitudinal axis.

4.5.3 All warhead cable electrical measurements shall be made with a current of less than 1 milliampere and voltage of less than 20 volts.

4.5.4 All fuze and warhead section electrical measurements shall be made with a current of less than 1 milliampere and voltage of less than 3.5 volts.

4.5.5 Circuit continuity test. The assembly being tested shall be connected to the approved continuity tester. This test shall be conducted in an explosive area with explosive handling safety procedure in effect.

WARNING: ALL ELECTRICAL MEASUREMENTS SHALL BE PERFORMED BEHIND A SAFETY APPROVED BARRICADE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

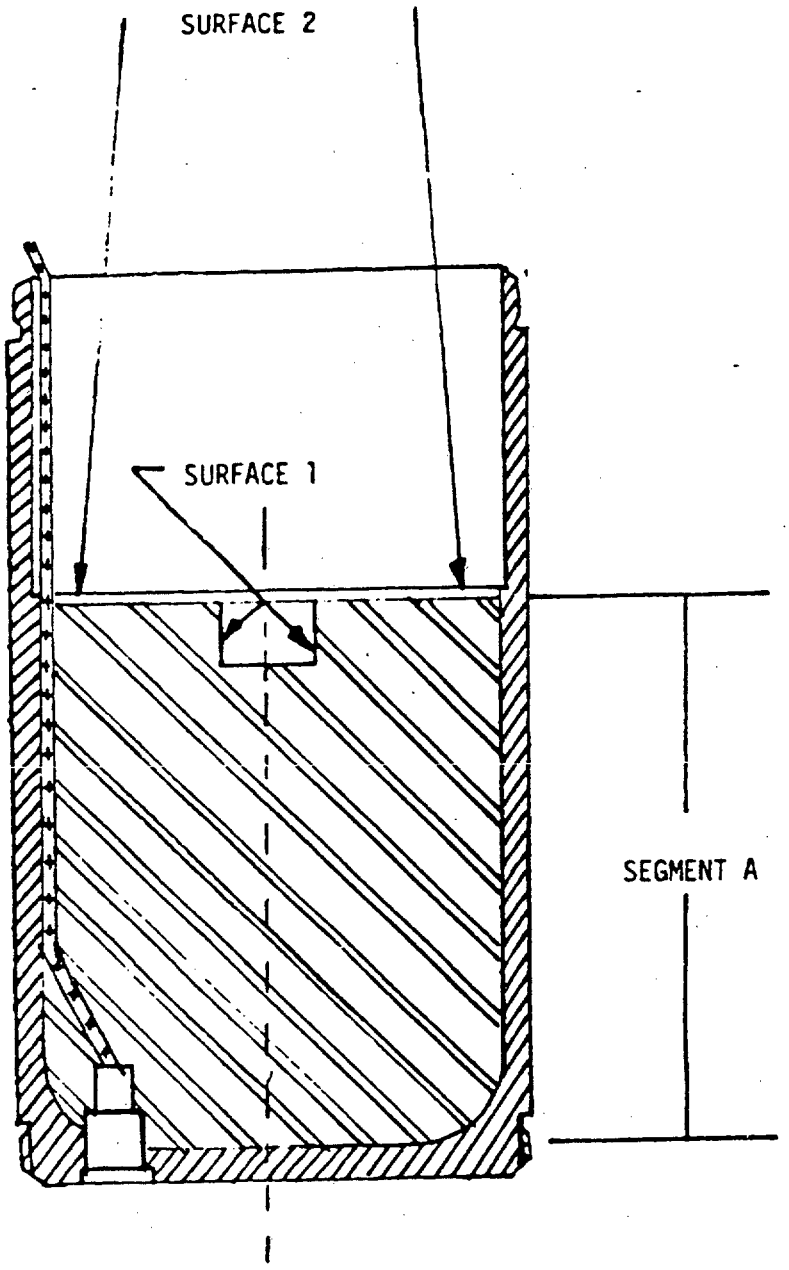


FIGURE 1 - Radiographic Surfaces and Segments

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

4.5.6 Explosive weight. The warhead is to be serialized, and weighed immediately prior to loading and again after explosive machining. The difference in weights will be considered the explosive weight.

4.5.7 Warhead evaluation. The warheads shall be detonated utilizing the detonator and lead simulating the fuze explosive train configuration.

5. PACKAGING

5.1 Packaging Requirements. Packaging shall be as specified on drawing 9322206.

5.2 Packing and marking. Packing and marking shall be as specified on drawing 9322206.

5.3 Transportation regulations. 49 CFR 100-199, Interstate Commerce Commission Rules and Regulations for Transportation of Explosive and Other Dangerous Articles shall be complied with.

6. NOTES

6.1 Intended use. The warhead sections covered by this specification are intended for use on the Stinger Guided Missile.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of inspection equipment designs for approval - see MIL-A-48078. Submit equipment designs, as required, to Commander, US Army Armament, Munitions and Chemical Command, ATTN: AMSMC-QAR-I, Dover, New Jersey 07801-5001.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1336-A509)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-W-48856B	

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR ☐ USER ☐ MANUFACTURER ☐ OTHER *(Specify)*: _____
b. ADDRESS *(Street, City, State, ZIP Code)*	

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:42Z
Check the source to verify that this is the current version before use.