MIL-STD-299
17 January 1957

SUPERSEDES
ORD-SIP-S321
1 October 1945

MILITARY STANDARD

VISUAL INSPECTION STANDARDS FOR NAILED WOOD BOXES AND WIREBOUND WOOD BOXES USED IN SMALL ARMS AMMUNITION PACKING

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

OFFICE OF THE ASSISTANT SECRETARY OF DEFENSE
WASHINGTON 25, D. C.

Supply and Logistics

Visual Inspection Standards
for Nailed Wood Boxes and
Wirebound Wood Boxes Used in
Small Arms Ammunition Packing
MIL–STD–299

17 JANUARY 1957

1. This Standard has been approved by the Department of Defense and is mandatory for use by the Departments of the Army, the Navy, and the Air Force, effective 1 March 1957.

2. In accordance with established procedure the Standardization Division has designated the Ordnance Corps, Department of the Army as custodian of this Standard.

3. Recommended corrections, additions, or deletions should be addressed to the Standardization Division, Office of the Assistant Secretary of Defense (Supply and Logistics), Washington 25, D. C.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

FOREWORD

This standard was prepared under the direction of the Office, Chief of Ordnance, to be used to supplement specifications for nailed wood boxes and wirebound wood boxes used in the packing of small arms ammunition. It replaces the following publications on the same subject: ORD–SIP–S321, 1 October 1945 and ORD–SIP–S321, Amendment 1, March 1954.

This publication serves to create a military standard which evaluates and illustrates a practical majority of defects and was assembled as a result of extensive surveys covering wood box and small arms ammunition manufacturing facilities.

The format used retains most of the features of the formats of the publications it replaces because experience has proved that the numbering of illustrations to conform to the numbering of visual defects in the applicable detailed specifications, special treatment of indexes and specialized grouping have served to facilitate inspection, training and general use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

CONTENTS

1. SCOPE AND PURPOSE
1.1 SCOPE
1.2 PURPOSE
2. REFERENCED DOCUMENTS
2.1 STANDARDS
3. DEFINITIONS
3.1 GENERAL
3.2 SPECIFIC
3.2.1 Permissible Defect
4. GENERAL REQUIREMENTS
4.1 GENERAL
5. DETAIL REQUIREMENTS
5.1 DEFECT GROUPING

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

1. SCOPE AND PURPOSE

1.1 Scope. This standard provides illustrations and procedures for determining and evaluating defects normally found in nailed *wood packing boxes and wirebound packing* boxes used as shipping and storage containers for small arms ammunition and the standard shall be used as a supplement to pertinent specifications.

1.2 *Purpose.* *The purpose of this standard* is to:

(a) Provide a standard basis for the inspection of small arms ammunition nailed wood and wirebound packing boxes.

(b) Serve as an instruction manual for use in training personnel engaged in packing or in inspection of small arms ammunition boxes.

(c) Provide visual defect standards for use in connection with acceptance inspection of packed ammunition.

(d) Promote the standardization of manufacturing and inspection of small arms ammunition boxes.

2. REFERENCED DOCUMENTS

2.1 Standards.

MIL-STD-105—Sampling Procedures and Tables for Inspection by Attributes.

3. DEFINITIONS

3.1 General. Definitions of Standard MIL-STD-105 are applicable.

3.2 Specific. For the purpose of this standard the following definition applies:

3.2.1 *Permissible defect.* A condition which, though not desirable from an appearance standpoint, may be permitted for reasons of economy.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

4. GENERAL REQUIREMENTS

4.1 General. The descriptions and definitions of defects established in this standard are those commonly occurring. Any other defects not listed, present in the lot, shall be reported. If, in the opinion of the Government inspector, the other defects be serious, complete information, recommendations and request for disposition shall be submitted through proper channels.

5. DETAIL REQUIREMENTS

5.1 Defect grouping. For convenience in referencing, the defect lists and defect photographs are grouped as follows:

	Pages
Nailed Wood Boxes:	
List of Defects	3, 4
Defect Photographs	5–44
Wirebound Wood Boxes:	
List of Defects	45, 46
Defect Photographs	47–79

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

LIST OF DEFECTS


NAILED WOOD BOXES

No.	Defect	Pages
	MATERIAL	
	Knots:	
1.	Single knot or cluster larger than ¼ width of part or cleat	5–10
2.	Aggregate diameter greater than ½ width of part or cleat	11–14
3.	Loose or encased knot or knot hole larger than ½" diameter	15, 16
4.	Decay	17–19
5.	Worm holes over ⅛" diameter and over ½" in length (not illustrated).	
6.	Surface too rough for legible marking (not illustrated).	
7.	Cross grain having slope greater than 1 in 8	20, 21
	Splits:	
8.	Forming a sliver at the outside edge of a board	22
9.	Full length—more than one unrepaired in a part	22, 23
10.	Full length—more than two repaired in a part	24
11.	Partial—more than two unrepaired in a part	25
12.	Partial or full length unrepaired in a cover	26, 27
13.	Shake exposing sharp edge or sliver	28, 29
14.	(Not illustrated.)	
	Hardware:	
15.	Damaged, including corrosion	30, 31
16.	Untreated	32
17.	Strapping not according to specifications (not illustrated).	
	WORKMANSHIP AND ASSEMBLY	
	Nailing:	
18.	Heads of more than 10% of all the nails in the box protruding	33
19.	Protruding nail point or corrugated fastener	33
20.	More than 10% of all the nails in the box overdriven over 1/32"	34
21.	More than one missing nail per end	35
22.	More than one nail per end bent or driven through, or into a knot, split or crack (unless replaced by correctly driven nail)	35, 36

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.


No.	Defect	Pages
23.	Insufficient clinch (more than one nail per end or cover having less than ⅛″ clinch)	37
24.	Combination of any two of defects 21, 22 or 23	38
	Strapping:	
25.	Missing strap	39
26.	Ends of strap not lapped	39
27.	Nail missing from lapped ends	39
28.	Strapping misaligned so as to affect utility of the box	40
	Hardware:	
29.	Missing nut	41
30.	Insufficient or improper U bolt threads, or short bolt	41
31.	Long bolt (extending above top surface of cover cleat)	42
32.	Missing reinforcement	42
	Wood parts:	
33.	Side extending beyond end cleat more than ⅛″	42
34.	Bottom or top entending beyond side more than ⅛″	42, 43
35.	Top more than ¼″ inside cleat	43
36.	Bottom or top more than ¼″ inside side	43
37.	Cleat end extending beyond bottom more than ⅛″	44
38.	Vertical cleat more than ¼″ from bottom surface	44
39.	Gap larger than ⅛″ between vertical cleat and side	44
40.	Gap larger than ¼″ between horizontal and vertical cleat	44

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

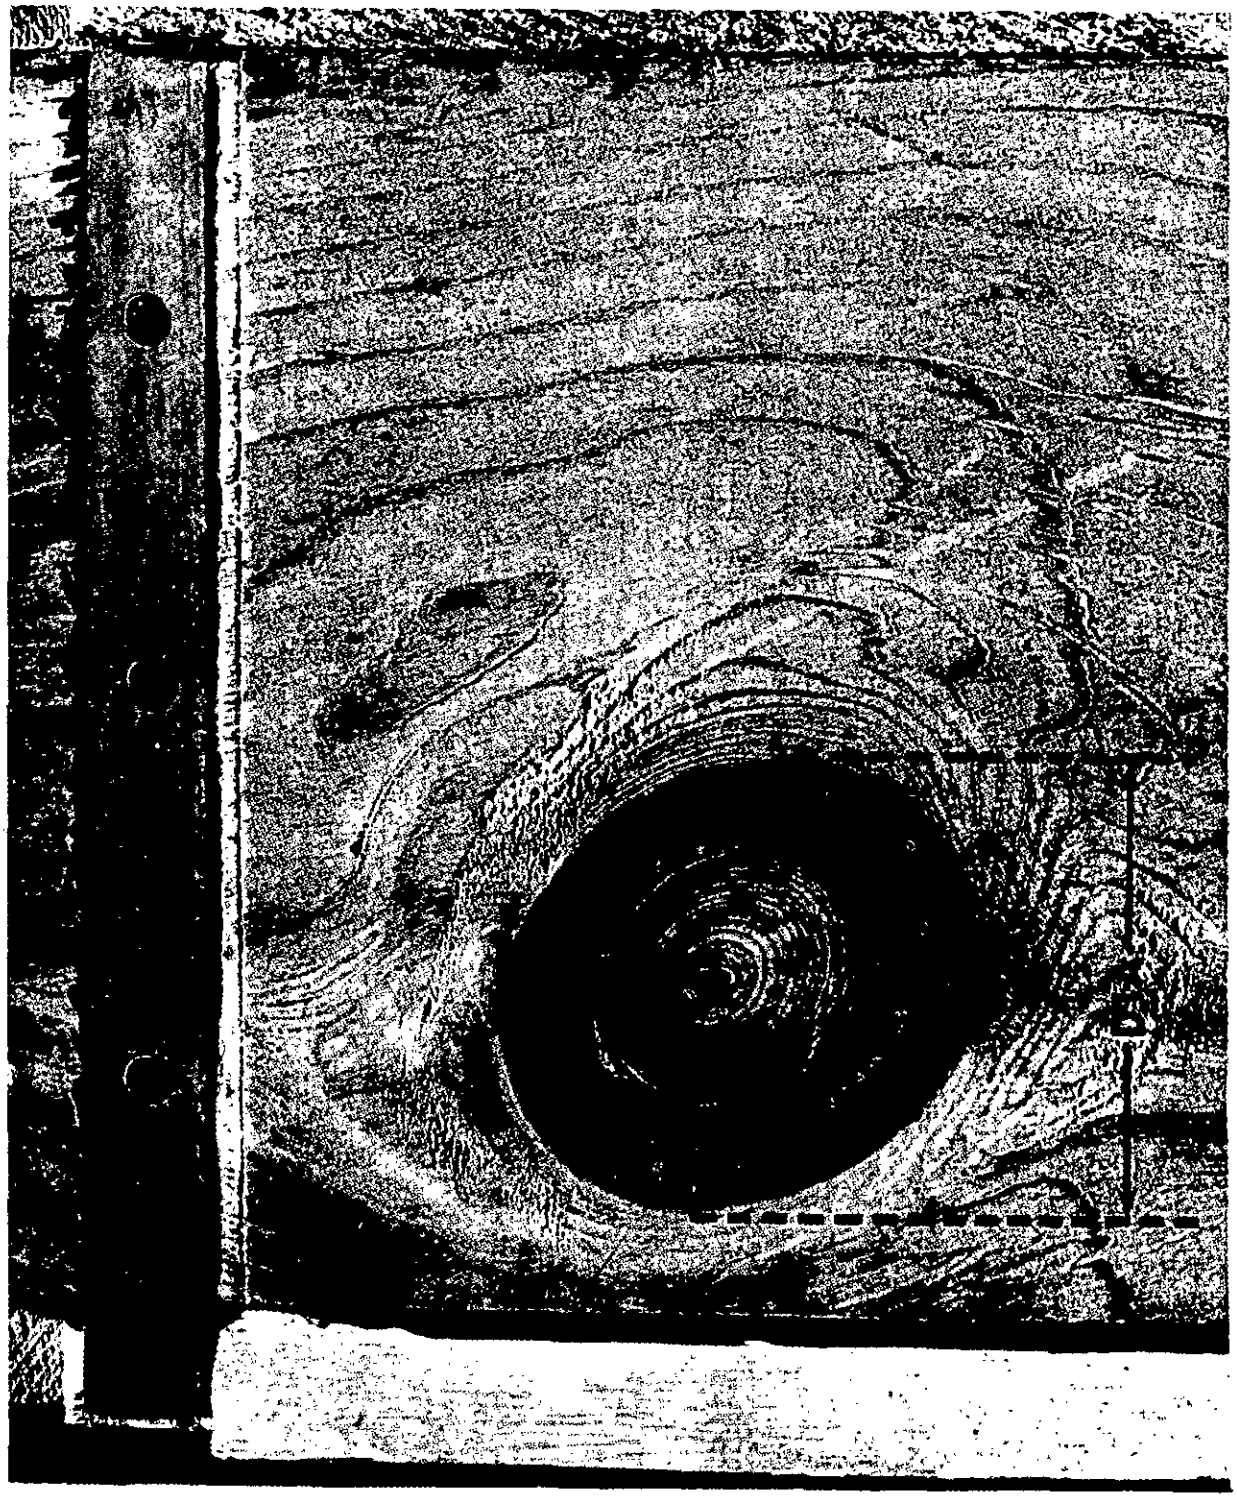


No. 1—TIGHT KNOT. Minor. (Diameter greater than ⅛ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

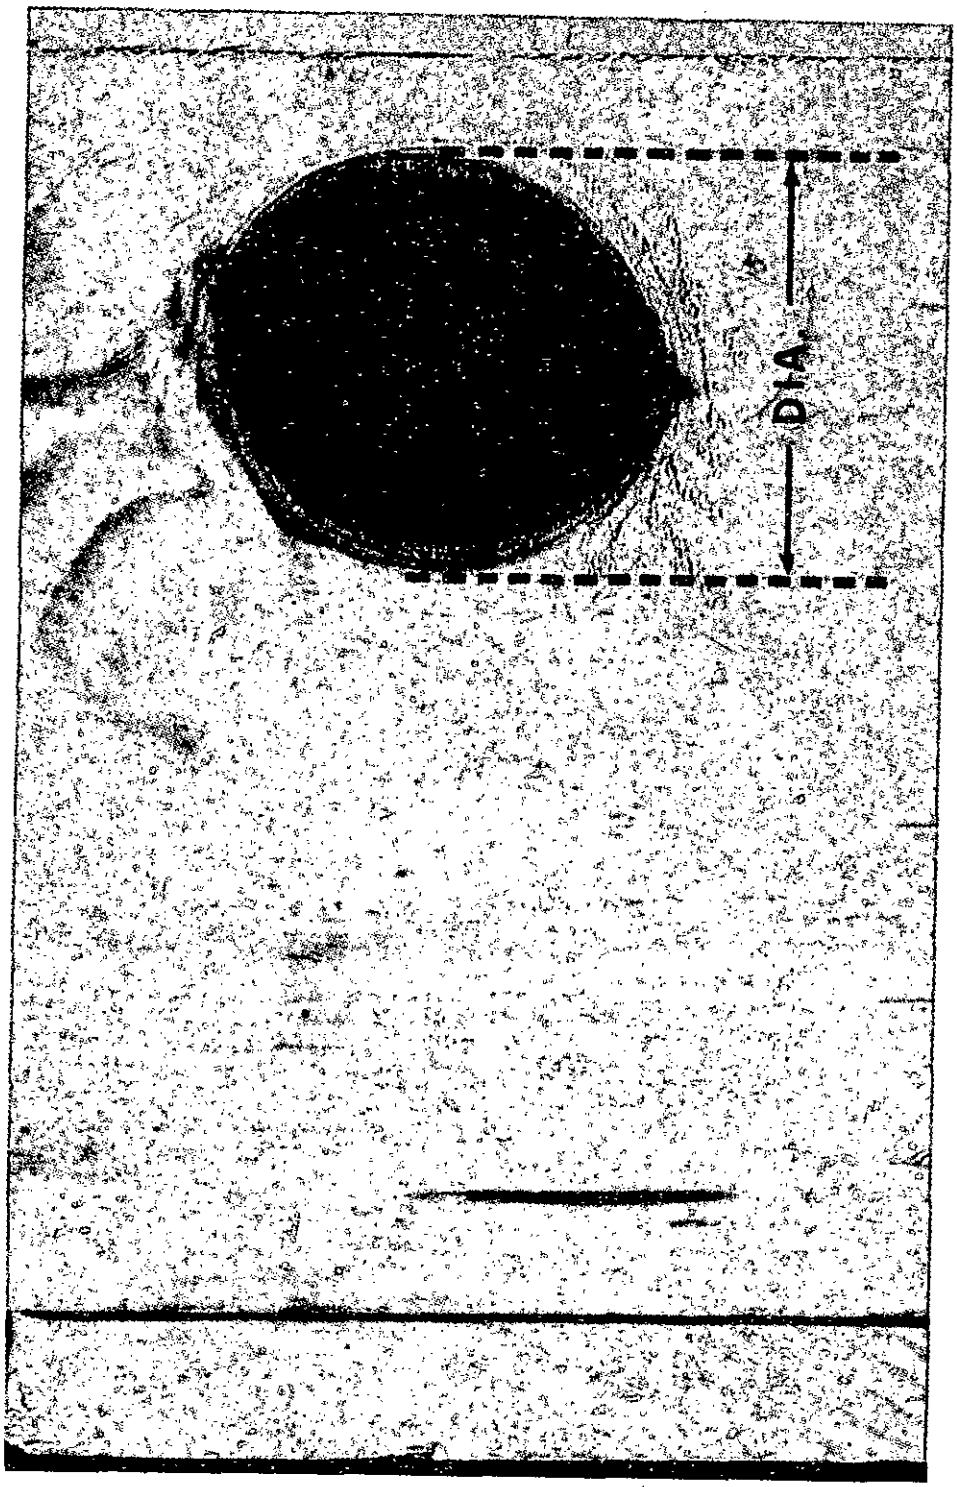


No. 1—TIGHT KNOT. Permissible. (Diameter less than ⅓ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

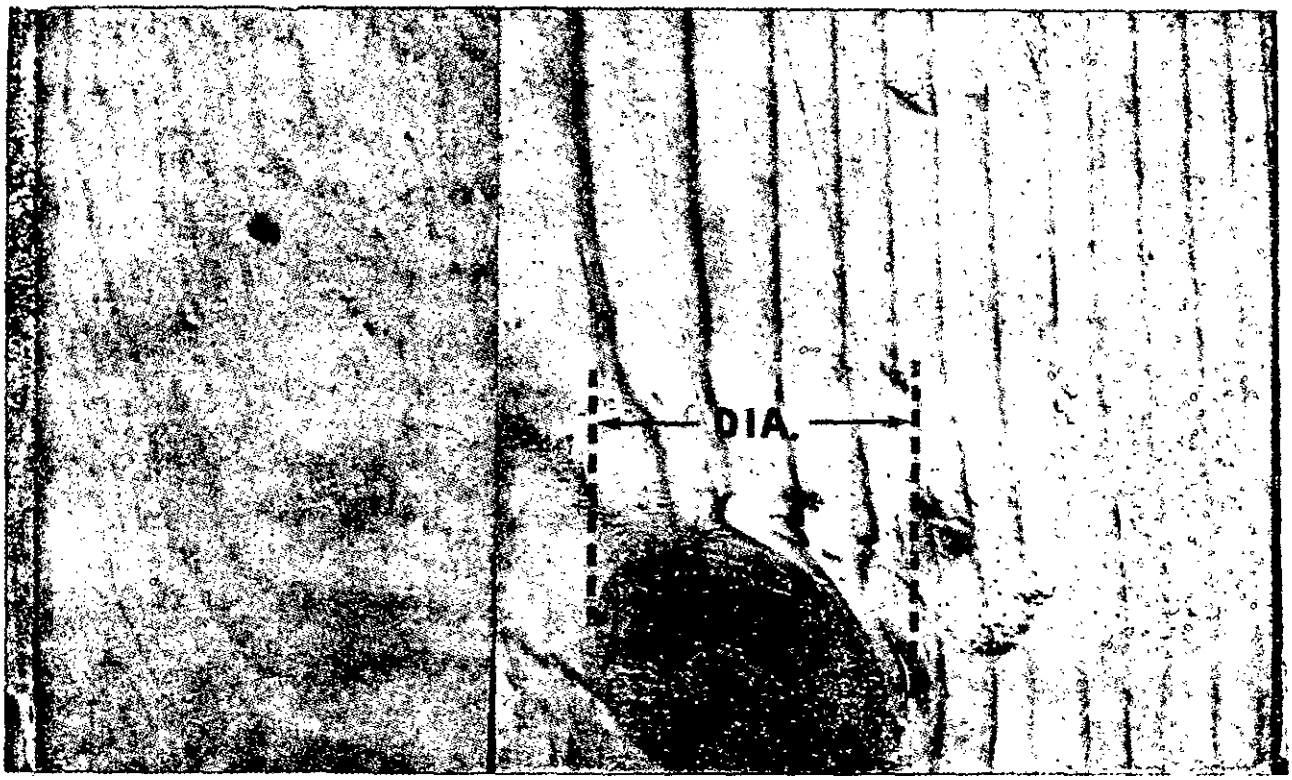


No. 1—TIGHT KNOT. Minor. (Diameter greater than ⅓ width of part.)

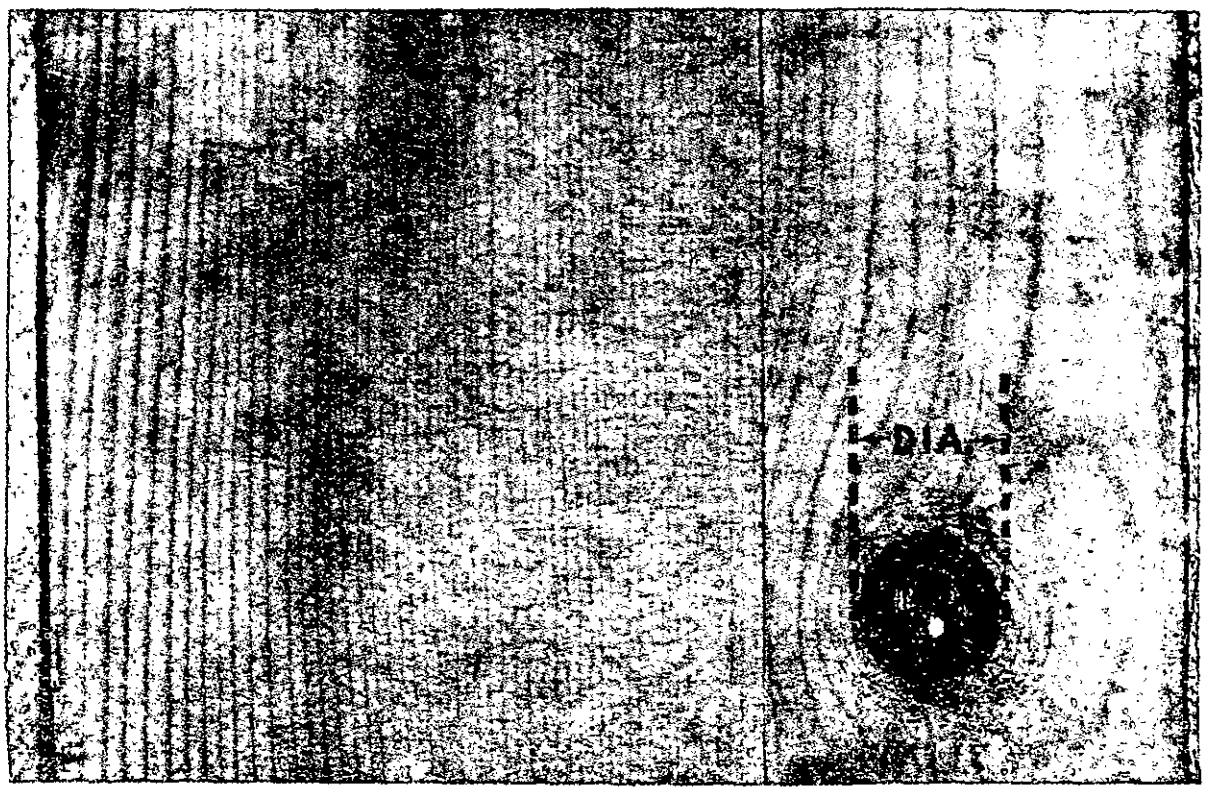


No. 1—TIGHT KNOT. Permis ible. (Diameter less than ⅓ width of part.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

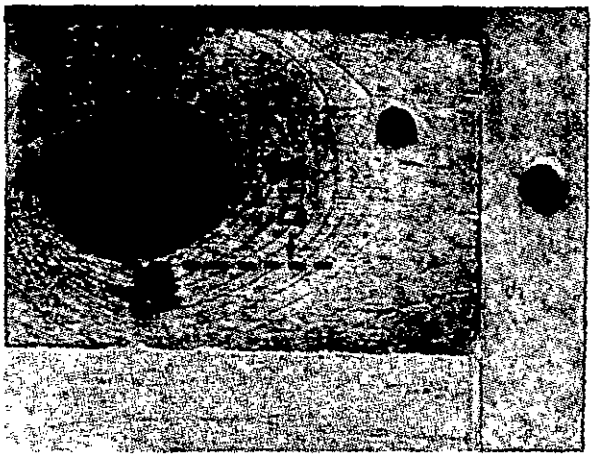

No. 1—TIGHT KNOT. Minor. (Diameter greater than ⅓ width of cleat.)

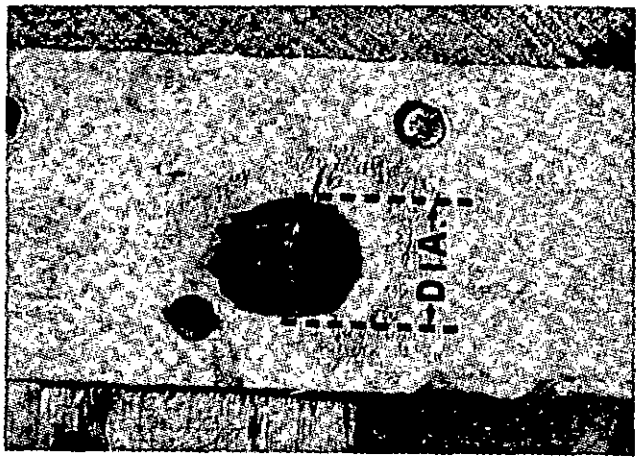


No. 1—TIGHT KNOT. Permissible. (Diameter less than ⅓ width of cleat.)

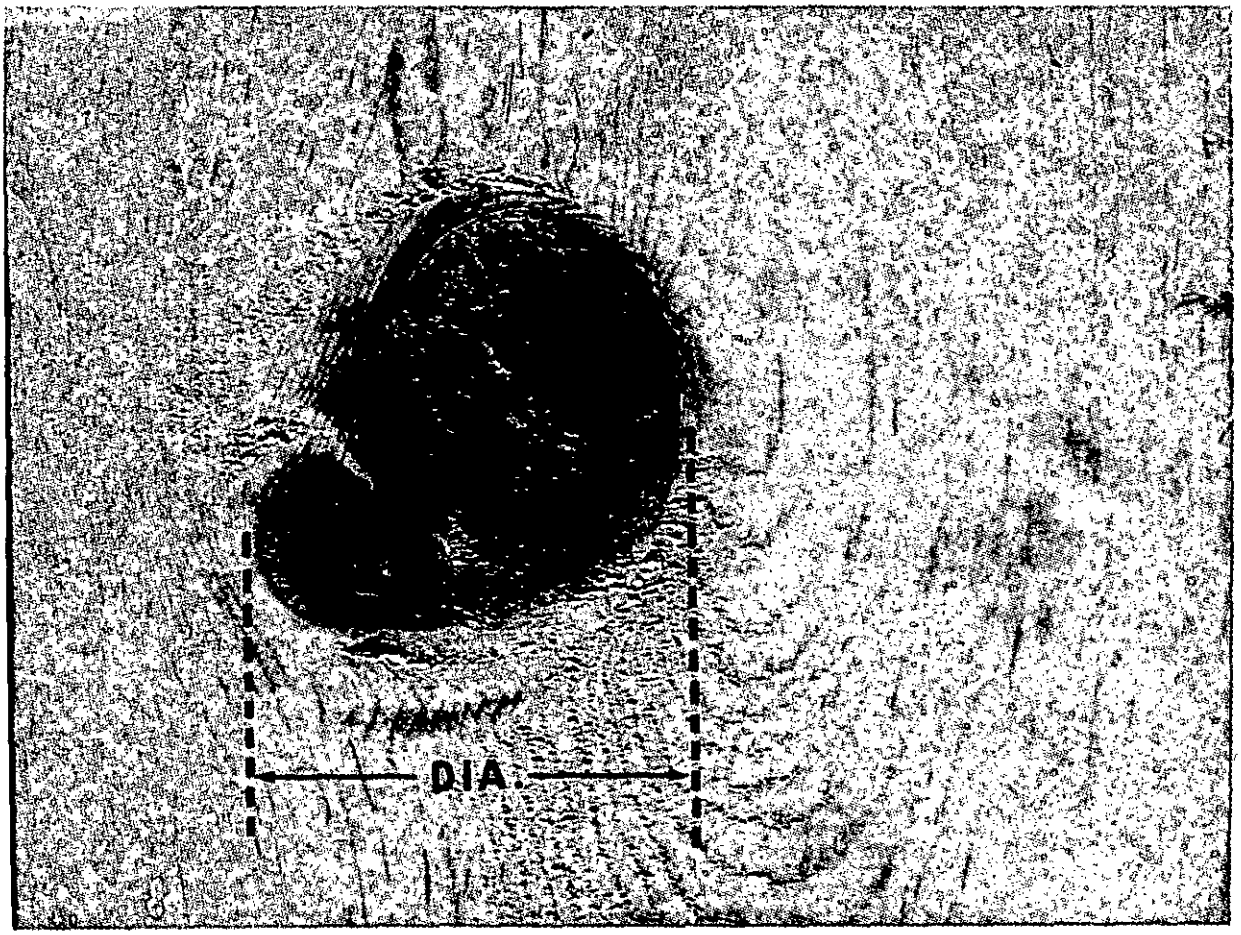


No. 1—KNOT CLUSTER. Minor. (Diameter greater than ⅓ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

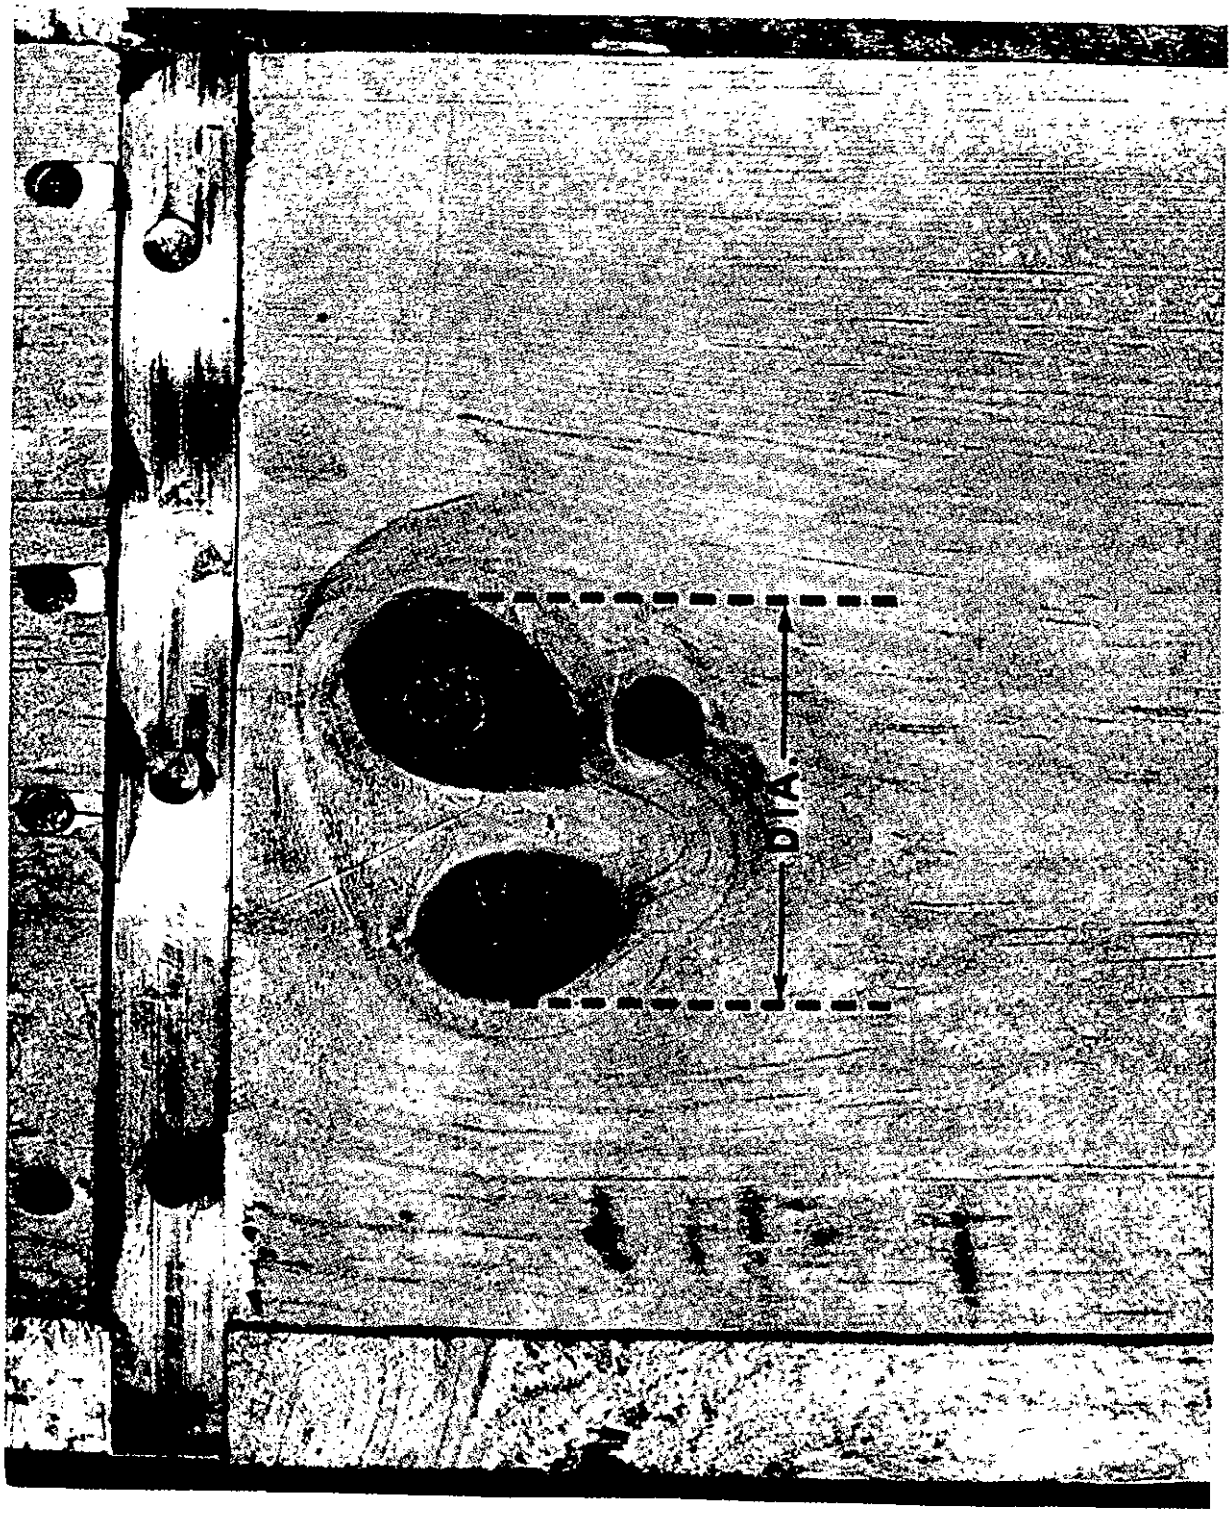


No. 1—KNOT CLUSTER. Permissible. (Diameter less than ⅓ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

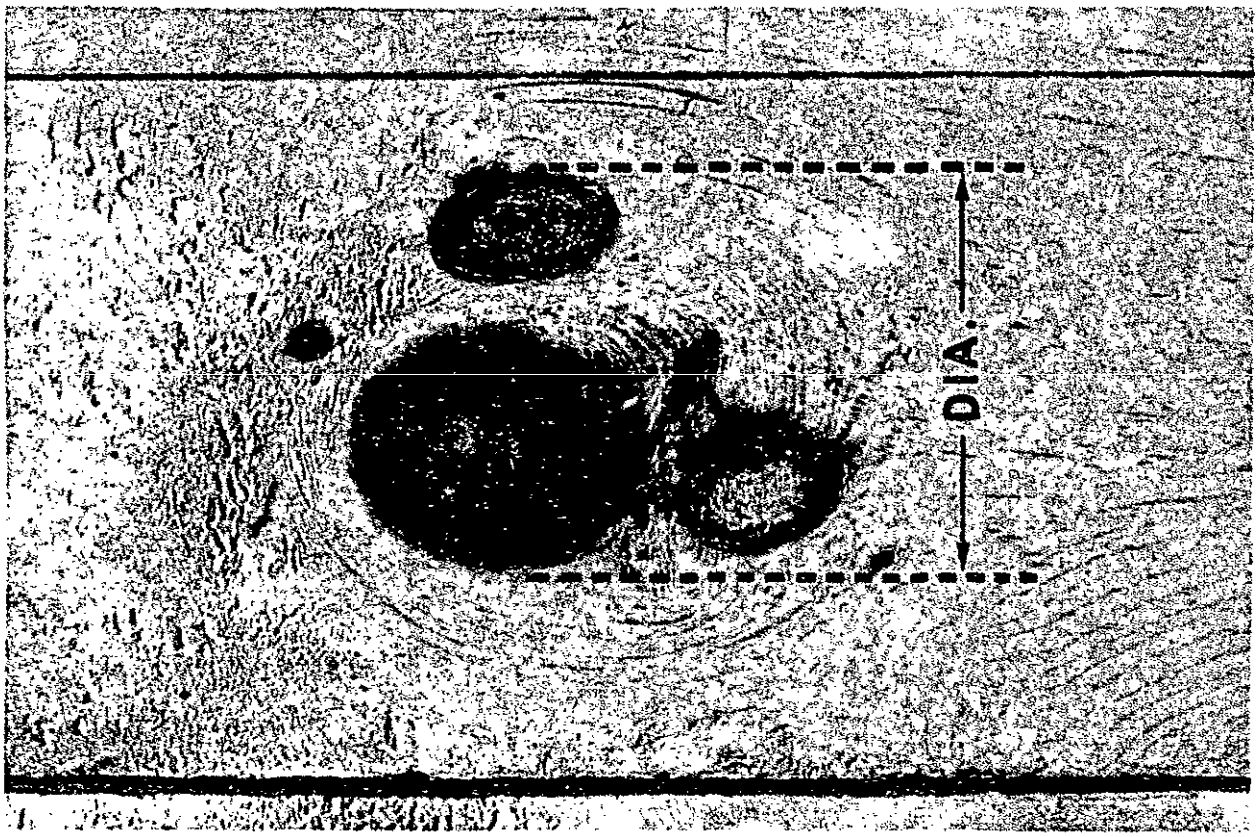


No. 1—KNOT CLUSTER. Minor. (Diameter greater than ⅛ width of part.)

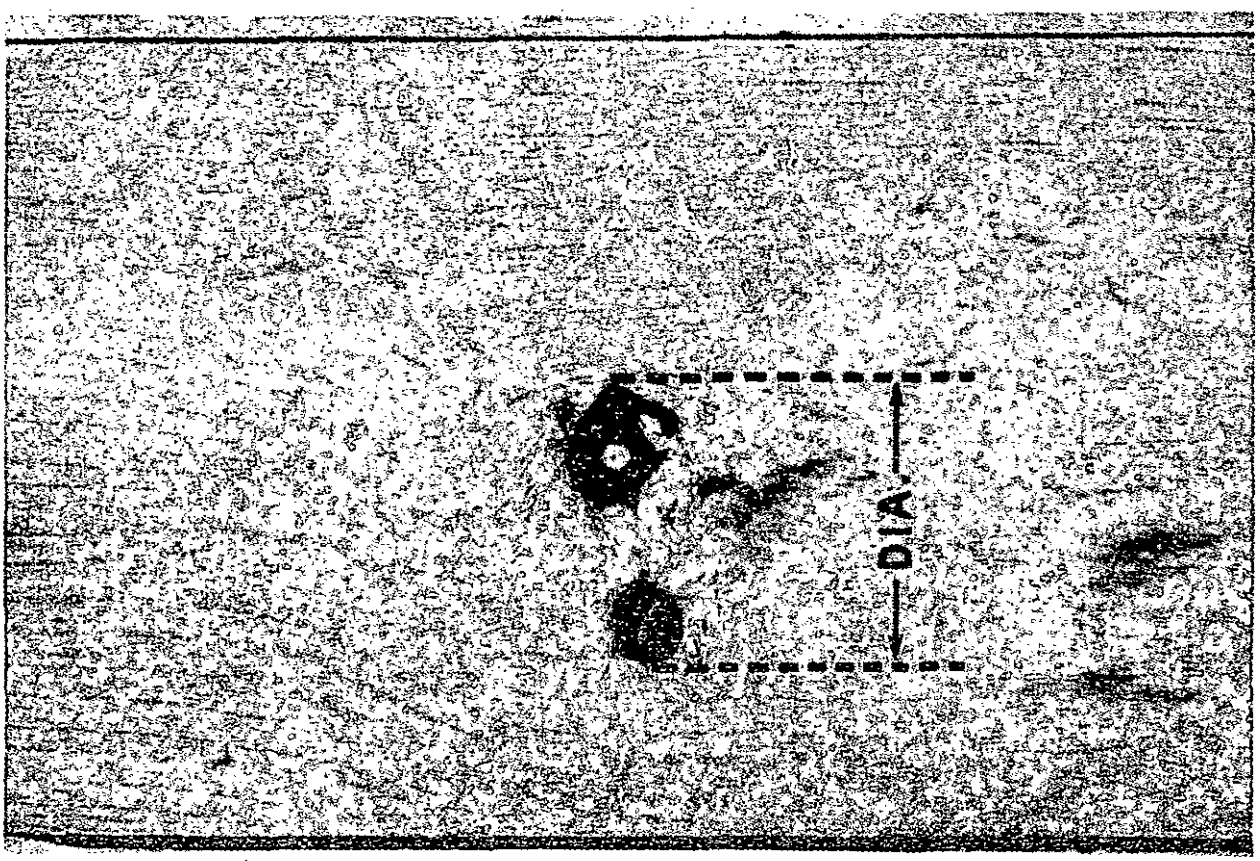


No. 1—KNOT CLUSTER. Permissible. (Diameter less than ⅛ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

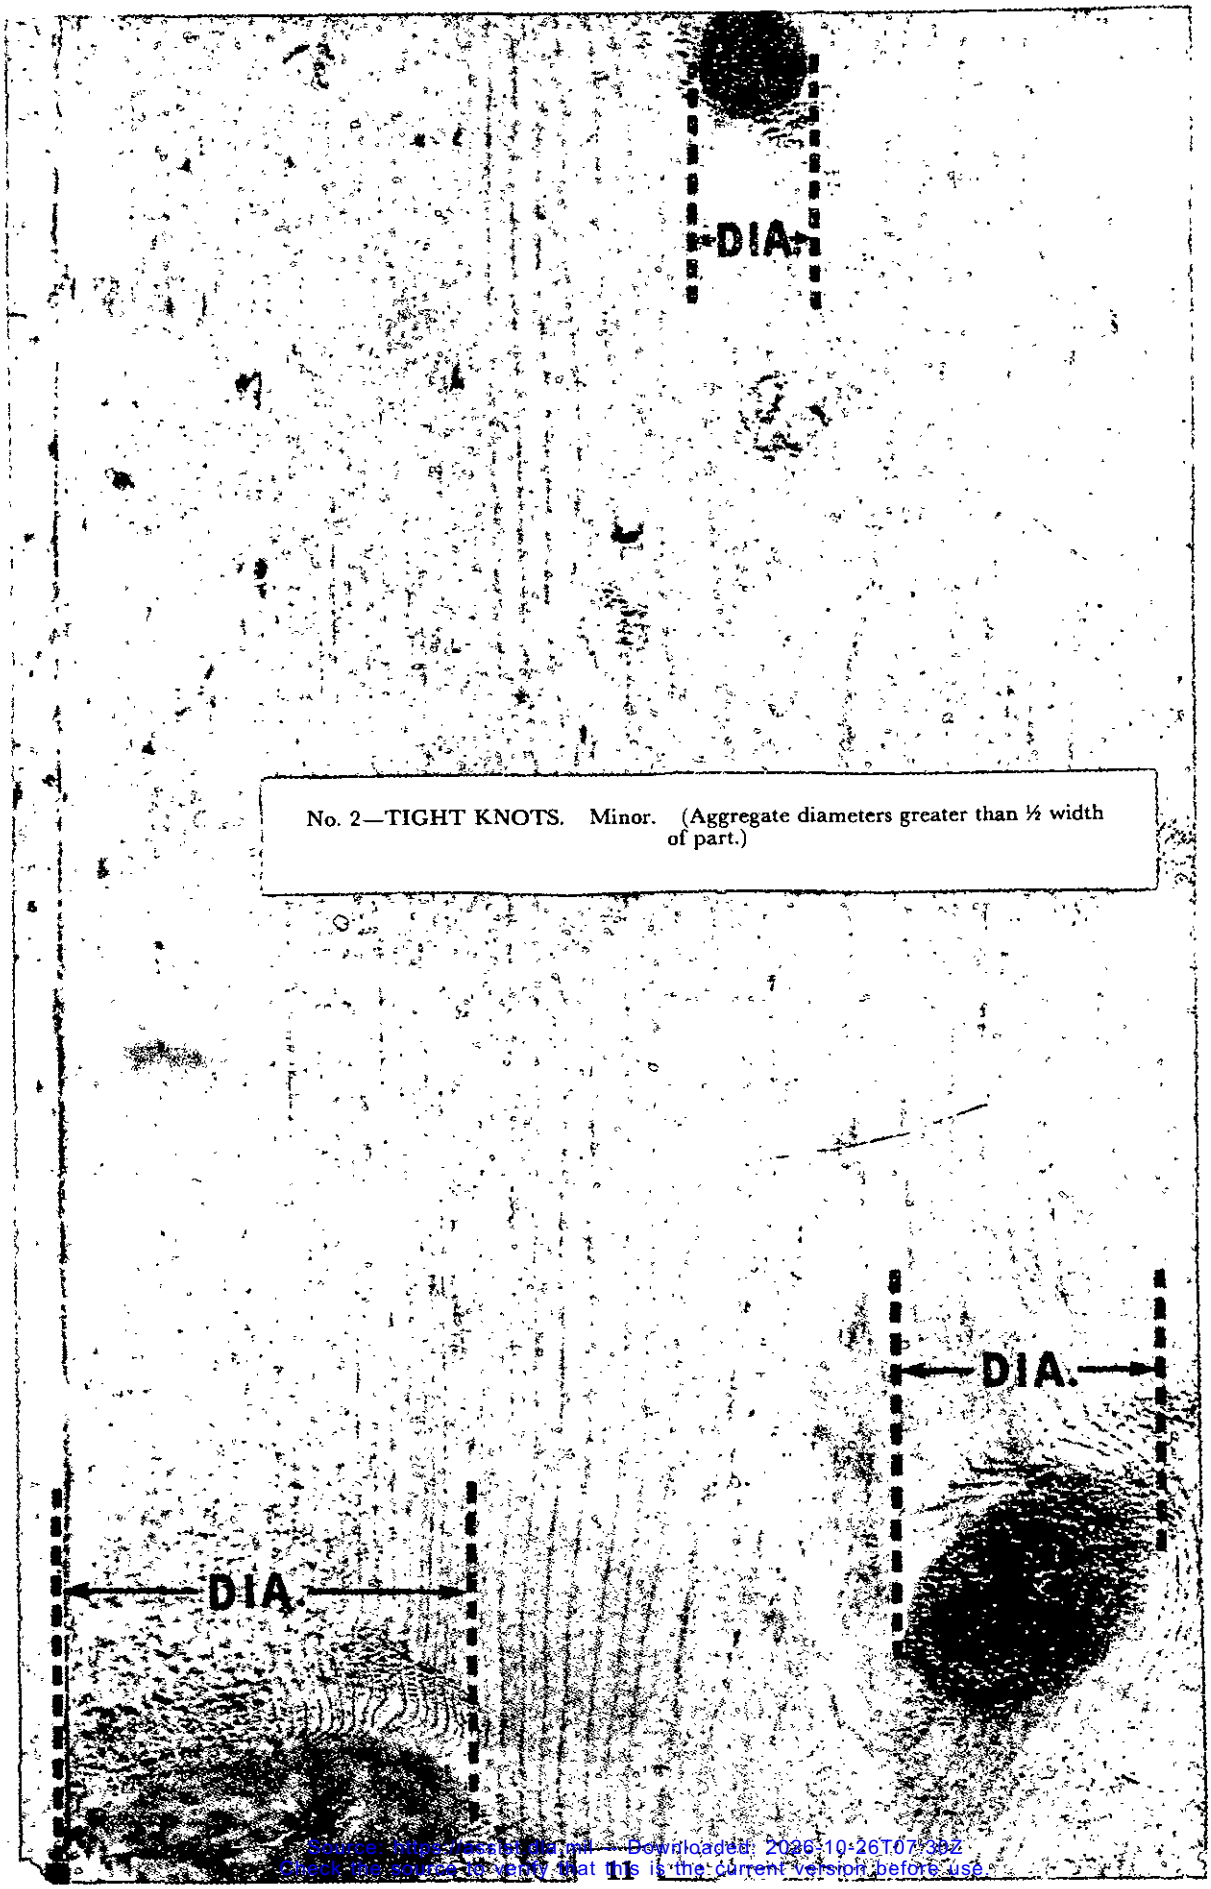


No. 2—TIGHT KNOTS. Minor. (Aggregate diameters greater than ½ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

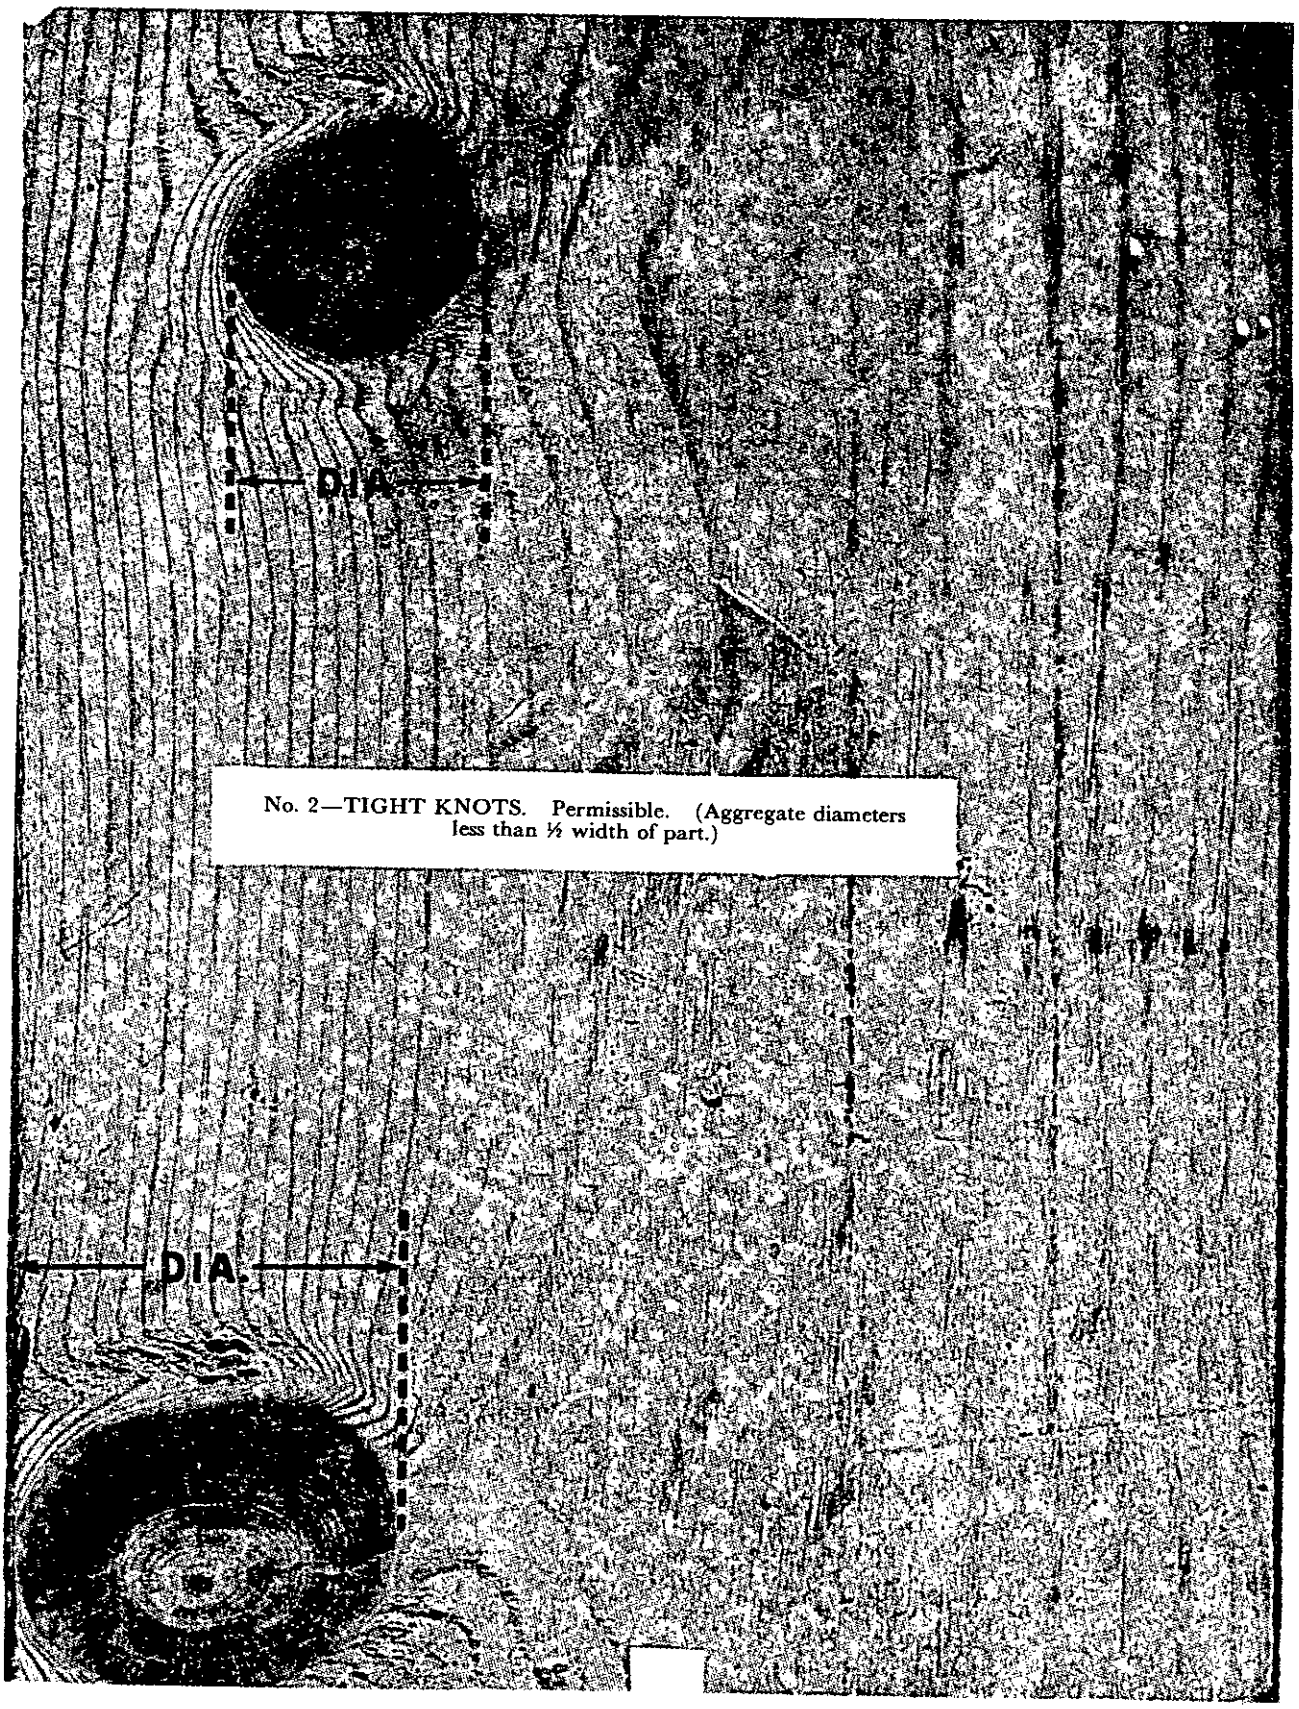


No. 2—TIGHT KNOTS. Permissible. (Aggregate diameters less than ½ width of part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

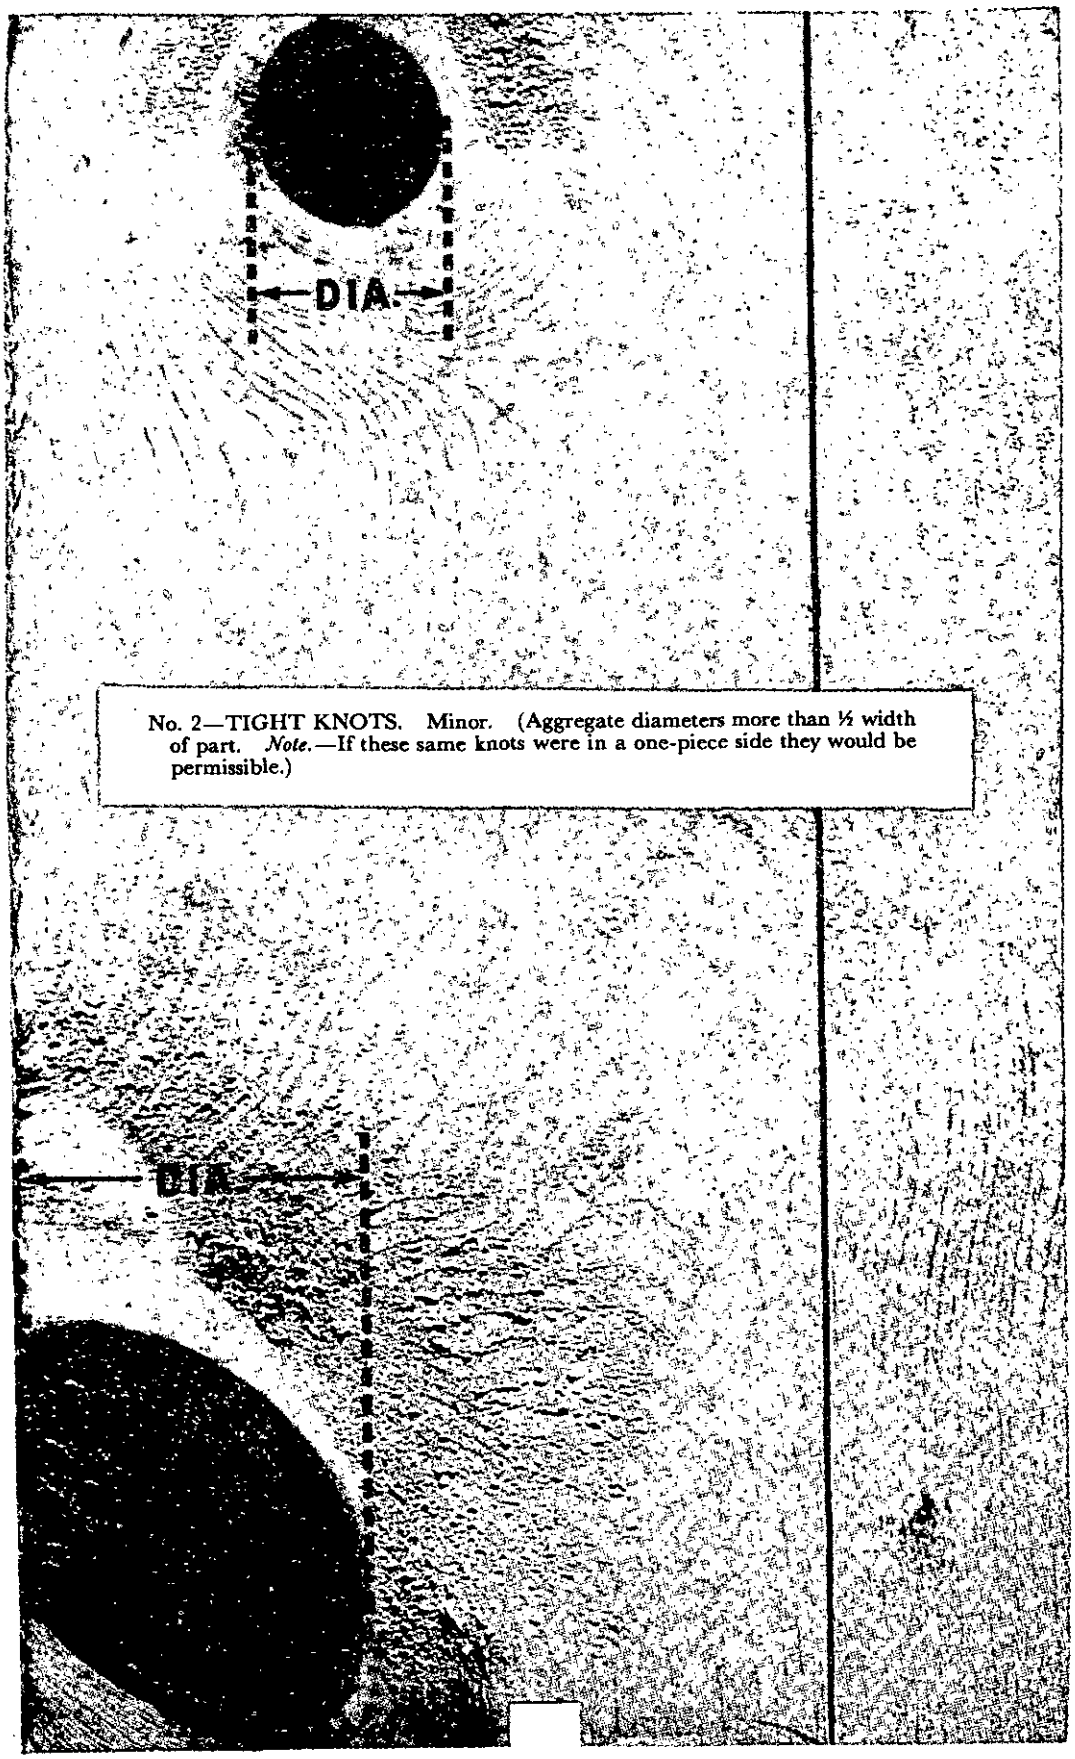


No. 2—TIGHT KNOTS. Minor. (Aggregate diameters more than ½ width of part. *Note.*—If these same knots were in a one-piece side they would be permissible.)

Source: https://assist.dla.mil Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

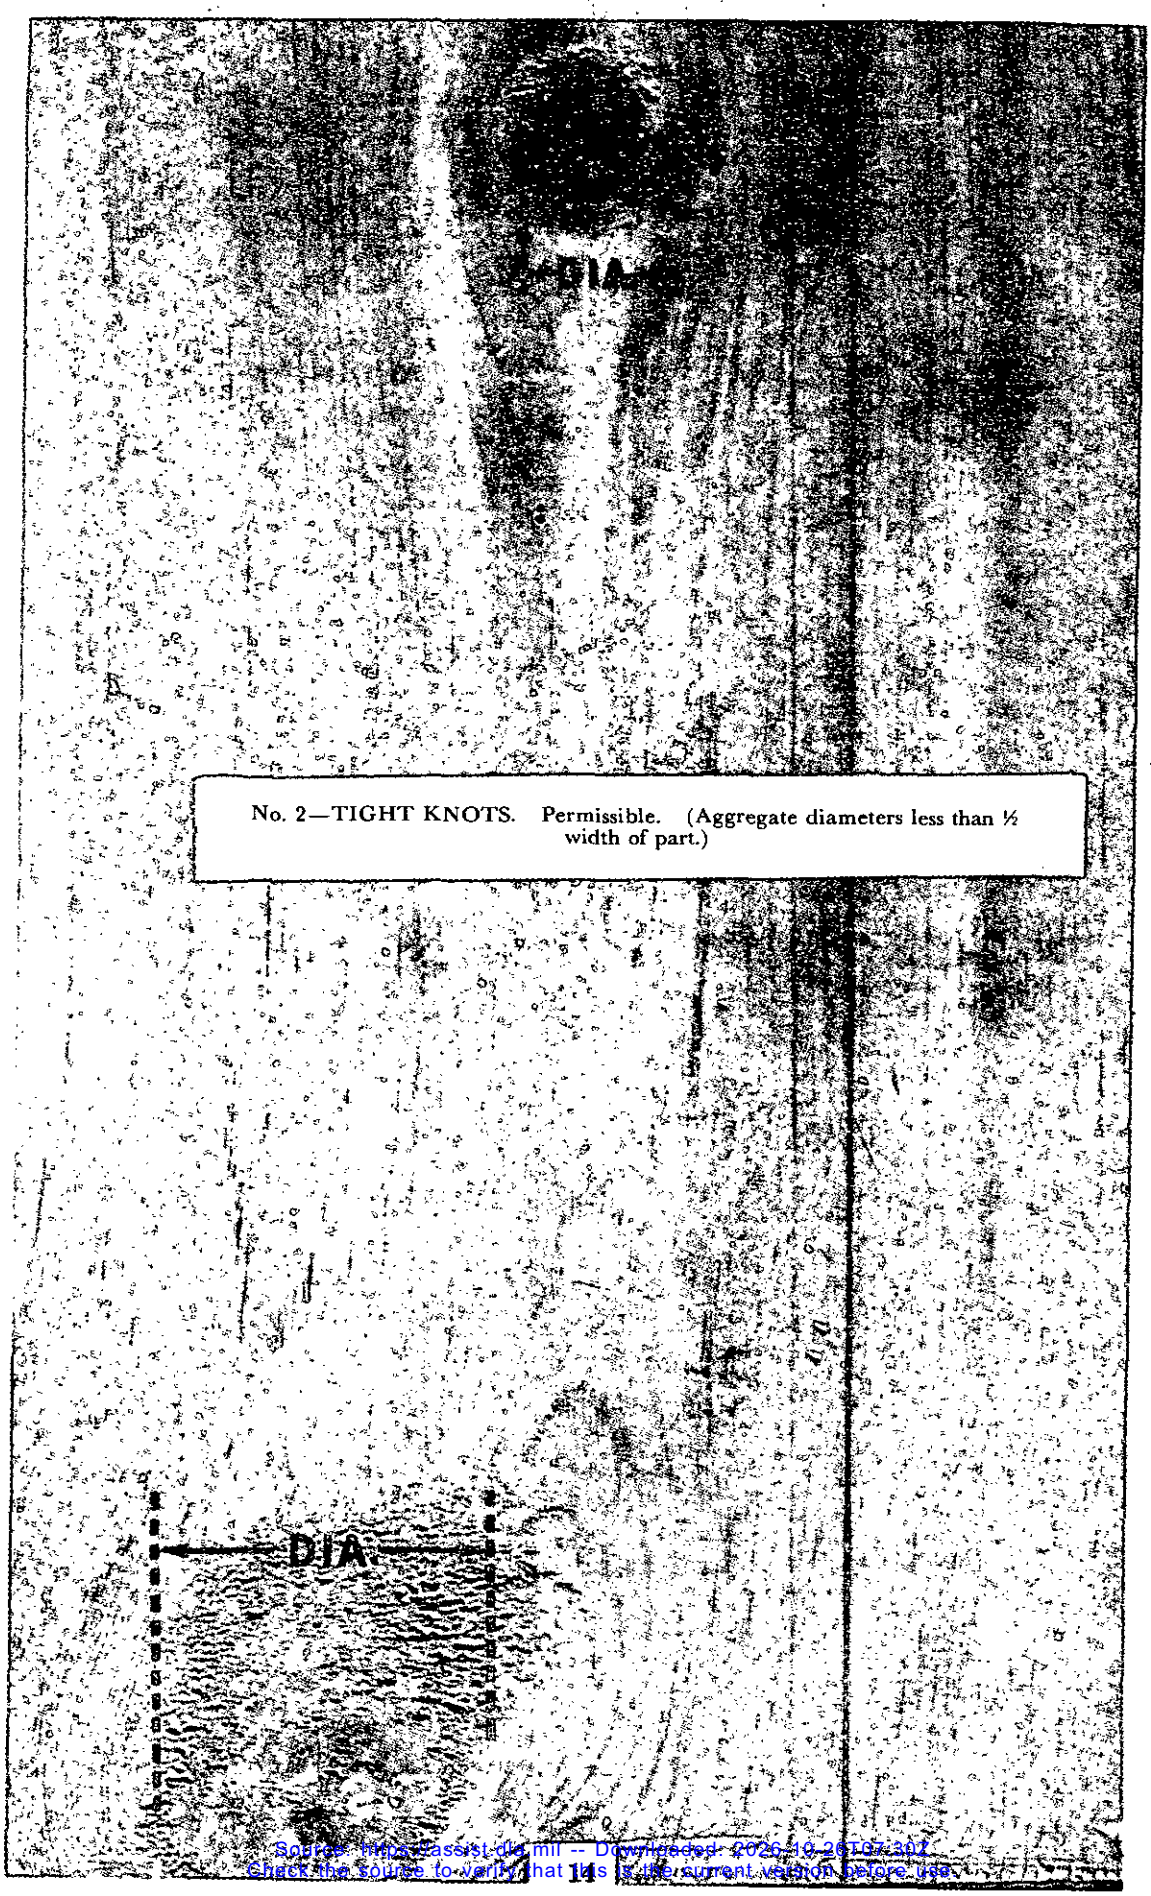

No. 2—TIGHT KNOTS. Permissible. (Aggregate diameters less than ½ width of part.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

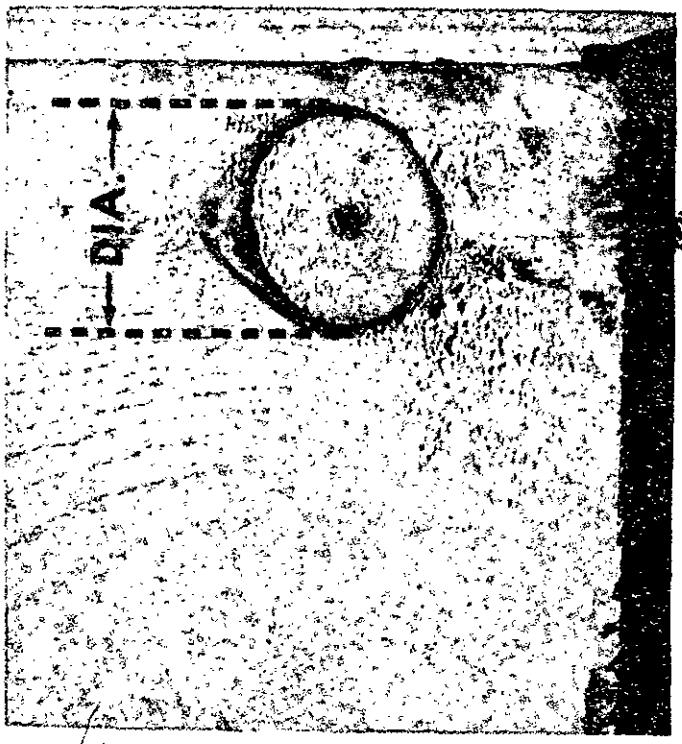


No. 3—LOOSE KNOT. Minor. (Larger than ½" diameter.)



No. 3—LOOSE KNOT. Permissible. (Smaller than ½" diameter.)

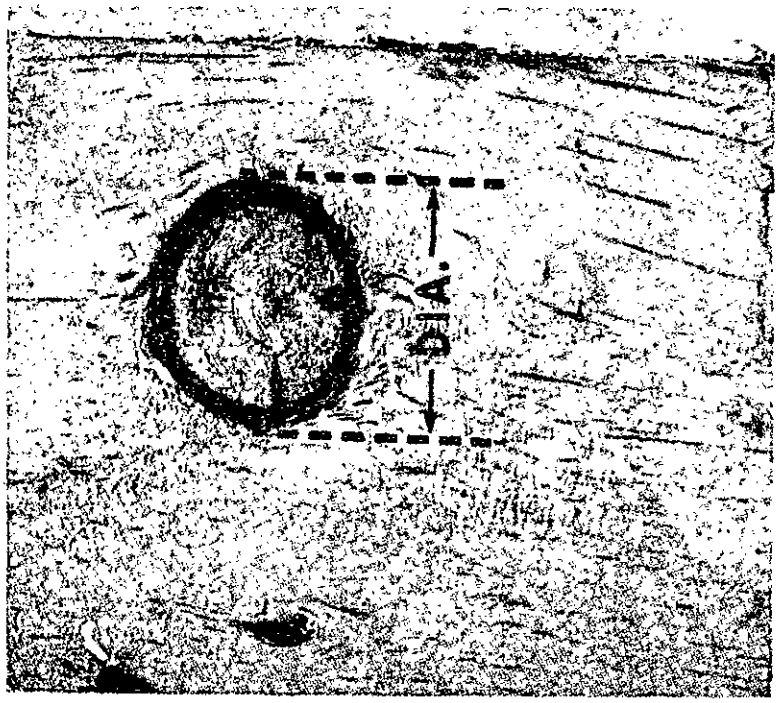

No. 3—ENCASED KNOT. Minor. (Larger than ½" diameter.)

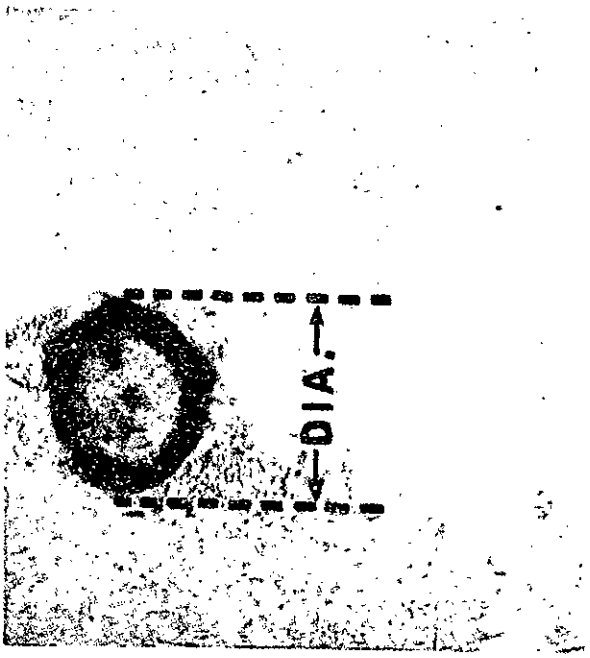

No. 3—ENCASED KNOT. Permissible. (Smaller than ½" diameter.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 3—KNOT HOLE. Minor. (Larger than ½'' diameter.)




No. 3—KNOT HOLE. Permissible. (Smaller than ½'' diameter.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

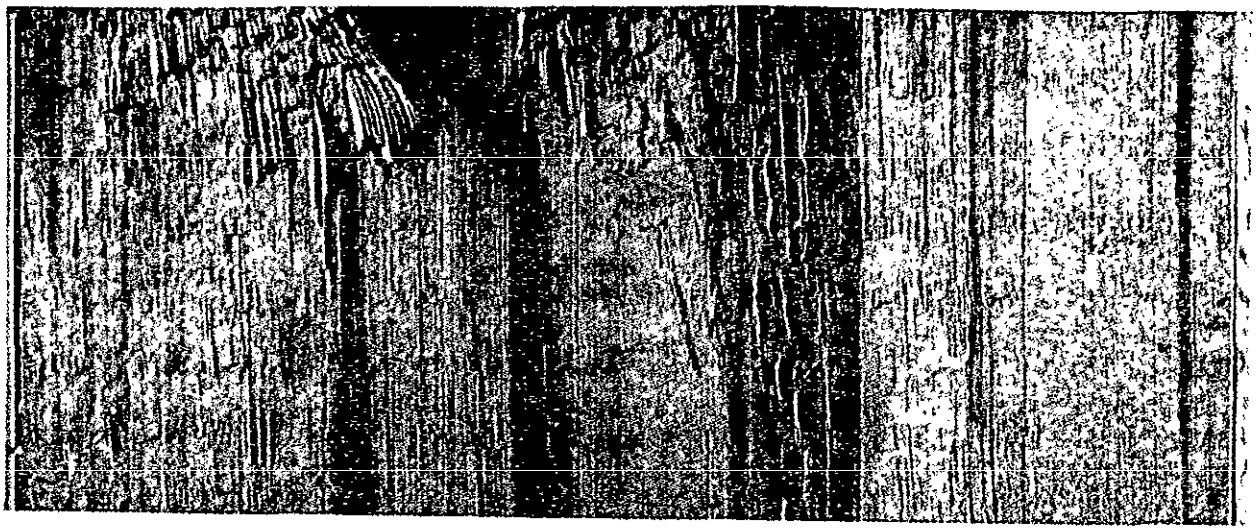

No. 4—DECAY. Major.

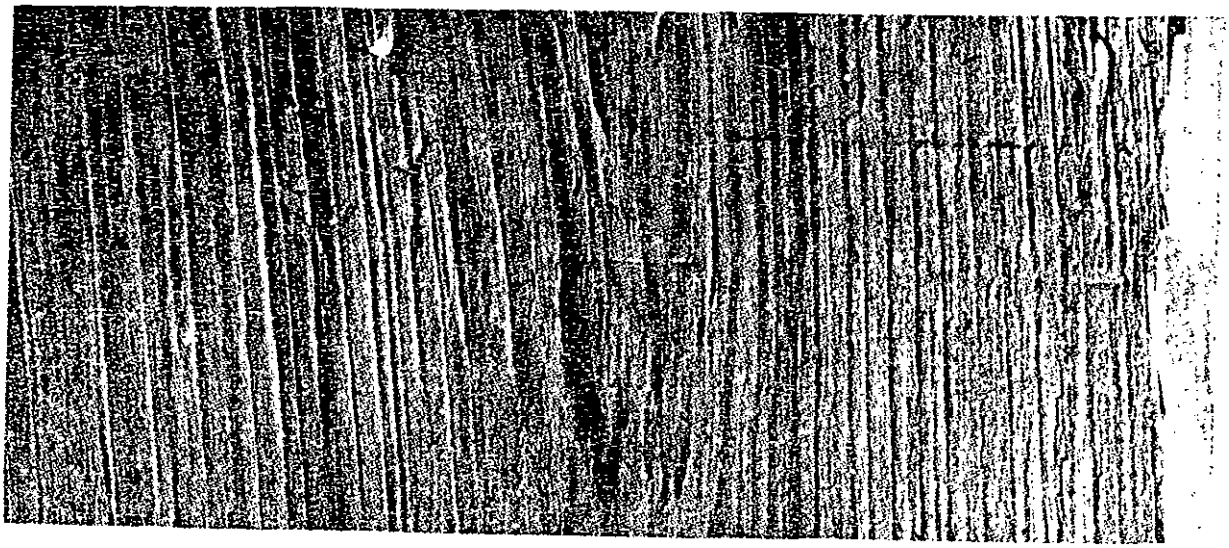

No. 4—DECAY. Major.

Source: https://assist.dla.mil Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 4—DECAY. Major.




No. 4—DECAY. Major.

Source: https://assist.dla.mil --Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

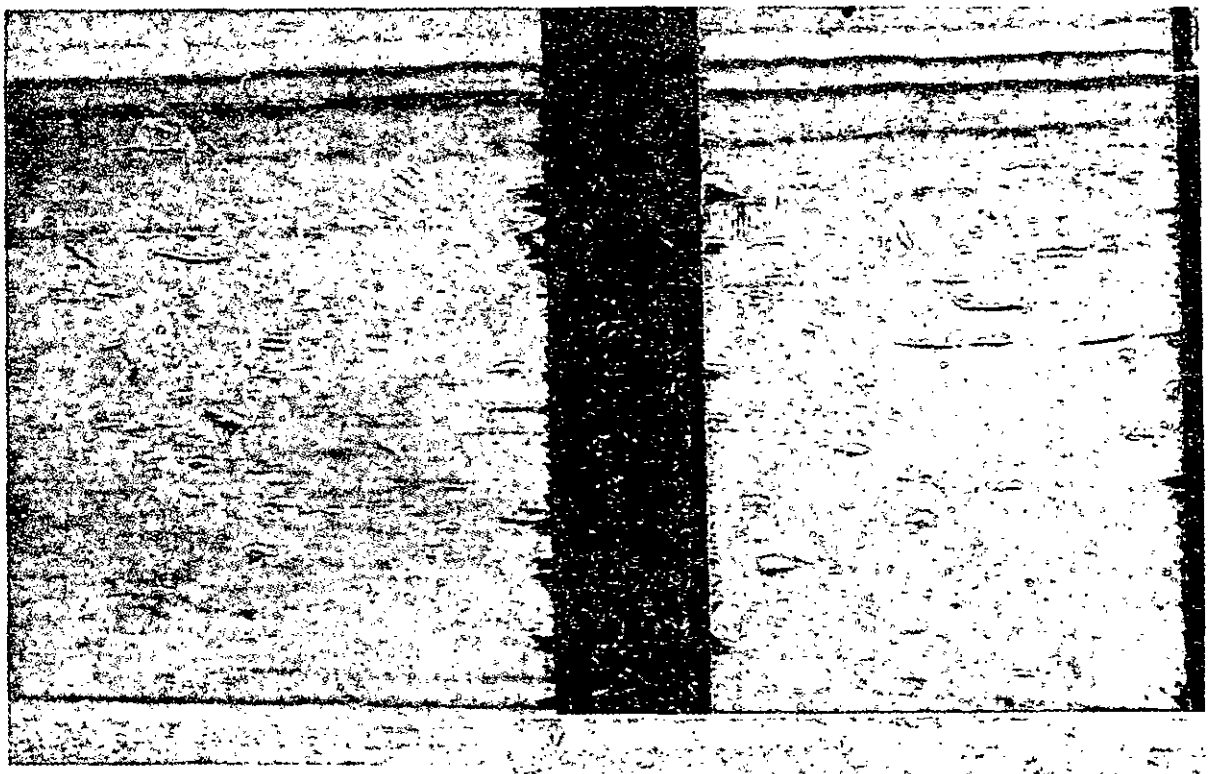


No. 4—DECAY. Major.

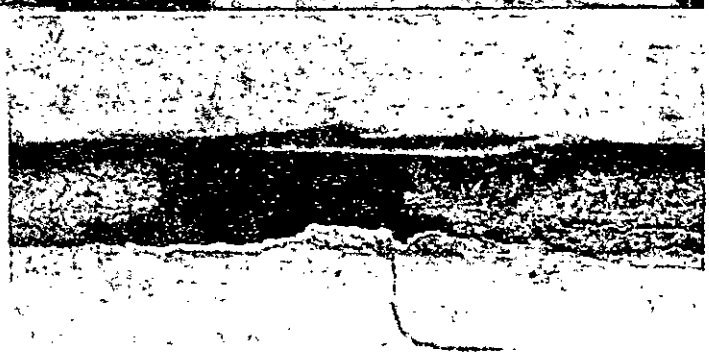

No. 4—DECAY. Major.

No. 4—SAP STAIN. Permissible.

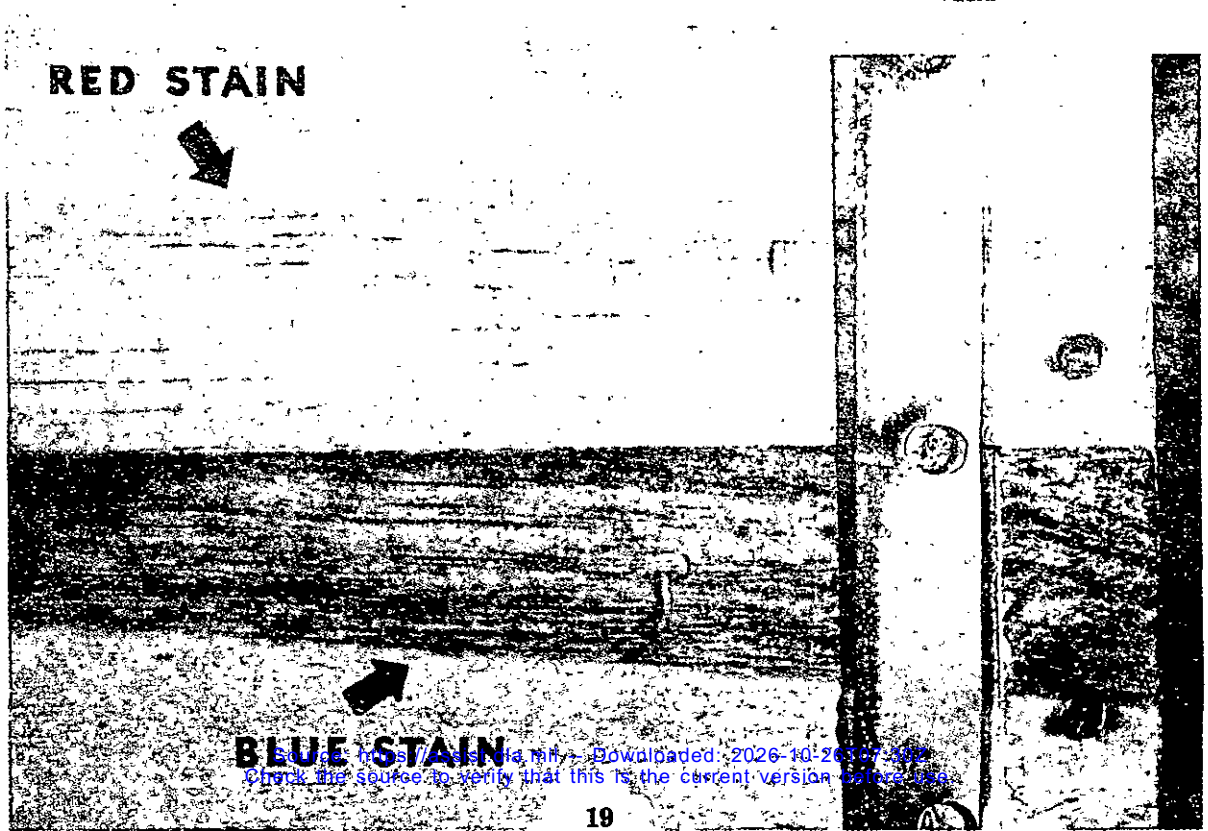


Source: https://assist.dla.mil/ - Downloaded: 2026-10-26T07:38Z
Check the source to verify that this is the current version before use.



No. 7—CROSS GRAIN. Minor.



No. 7—CROSS GRAIN. Minor. (Slope greater than 1 in 8.)

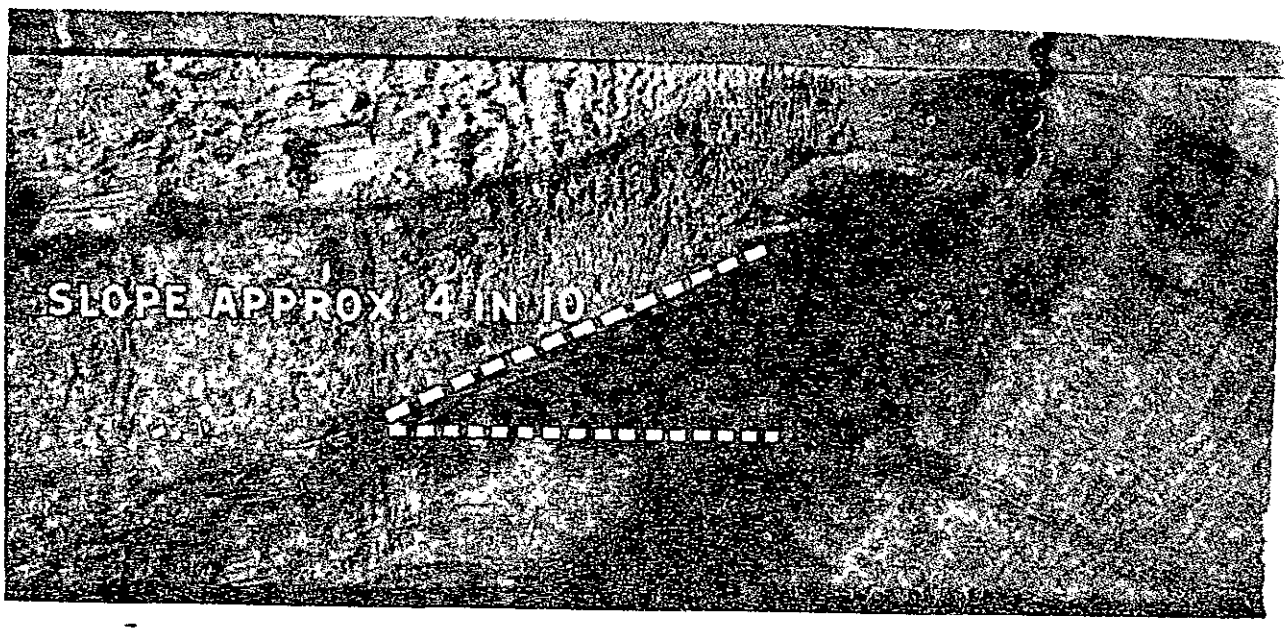


No. 7—CROSS GRAIN. Minor. (Slope greater than 1 in 8.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.



No. 7—CROSS GRAIN. Minor. (Slope greater than 1 in 8.)

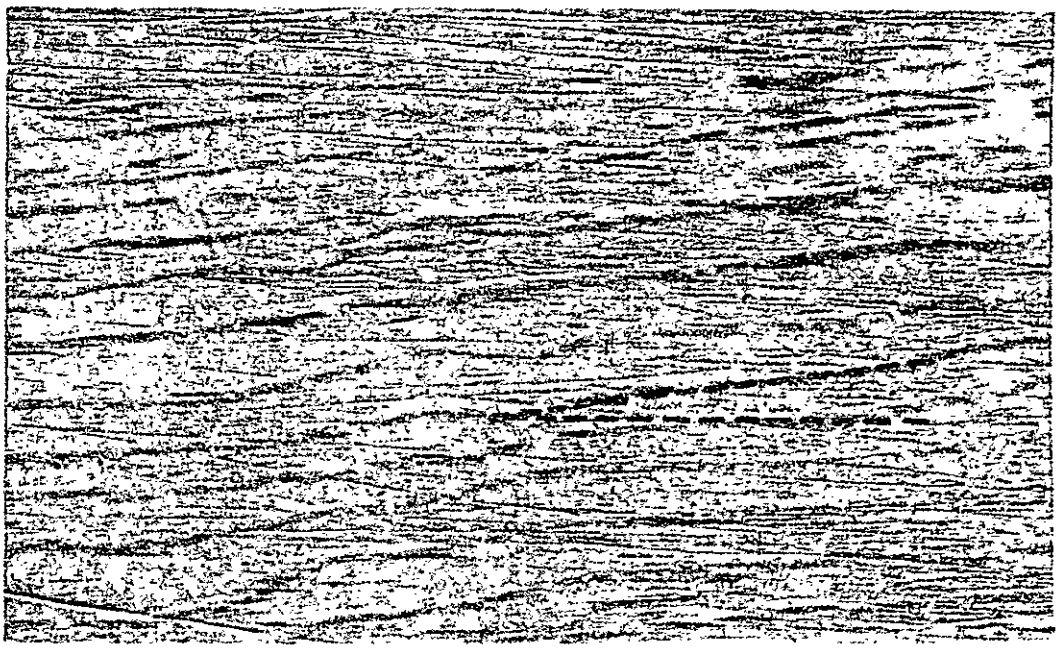


No. 7—CROSS GRAIN. Permissible. (Slope 1 in 8 or less.) Slope illustrated approximately 1 in 8.

Source: https://assist.dla.mil Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 8—SPLIT. Major. (Forms sliver at outside edge.)

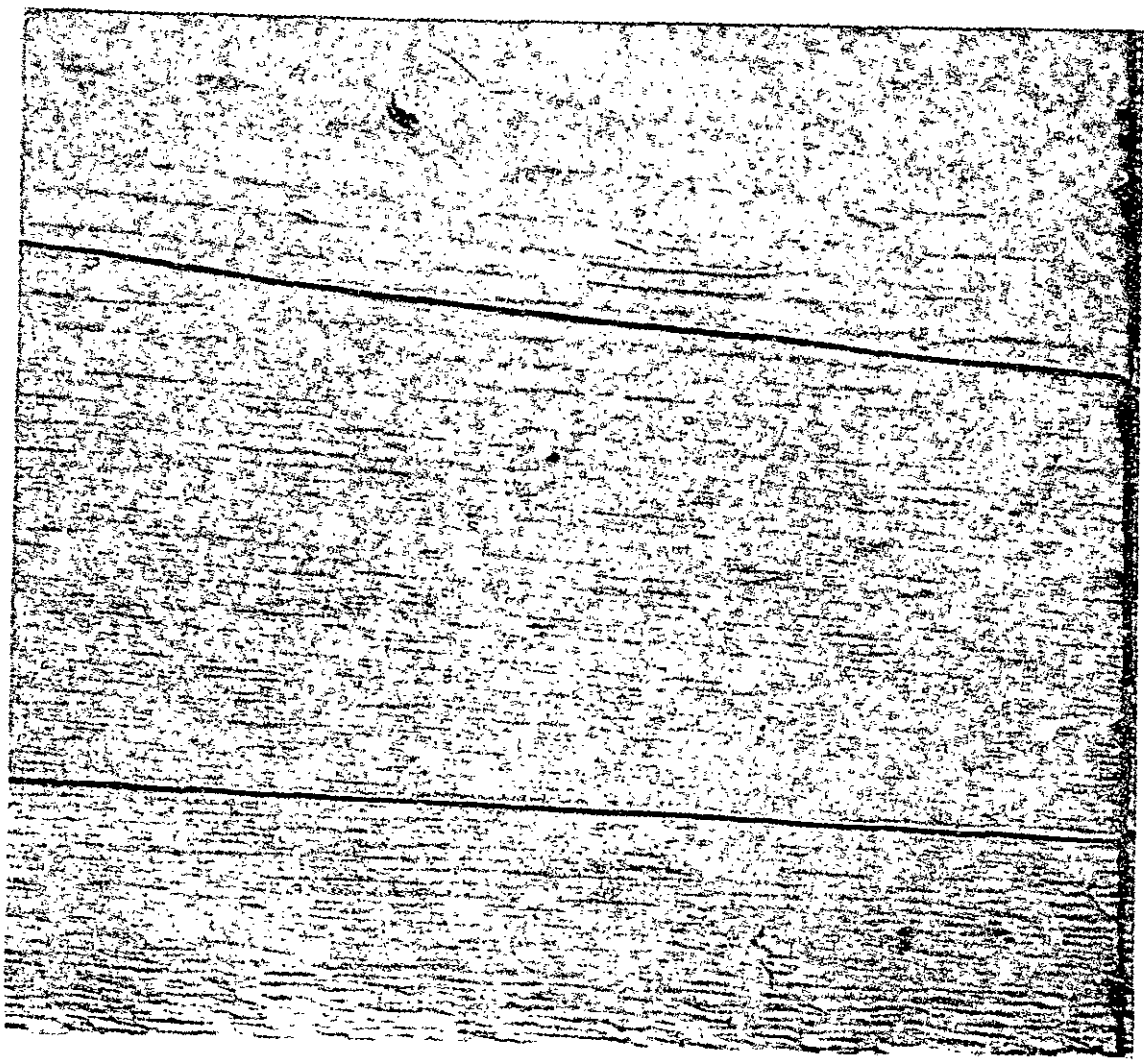


No. 9—FULL LENGTH SPLITS. Minor. (More than one unrepaired in a part. *Note.*—This would be permissible if one or both of the splits were repaired with corrugated fasteners.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

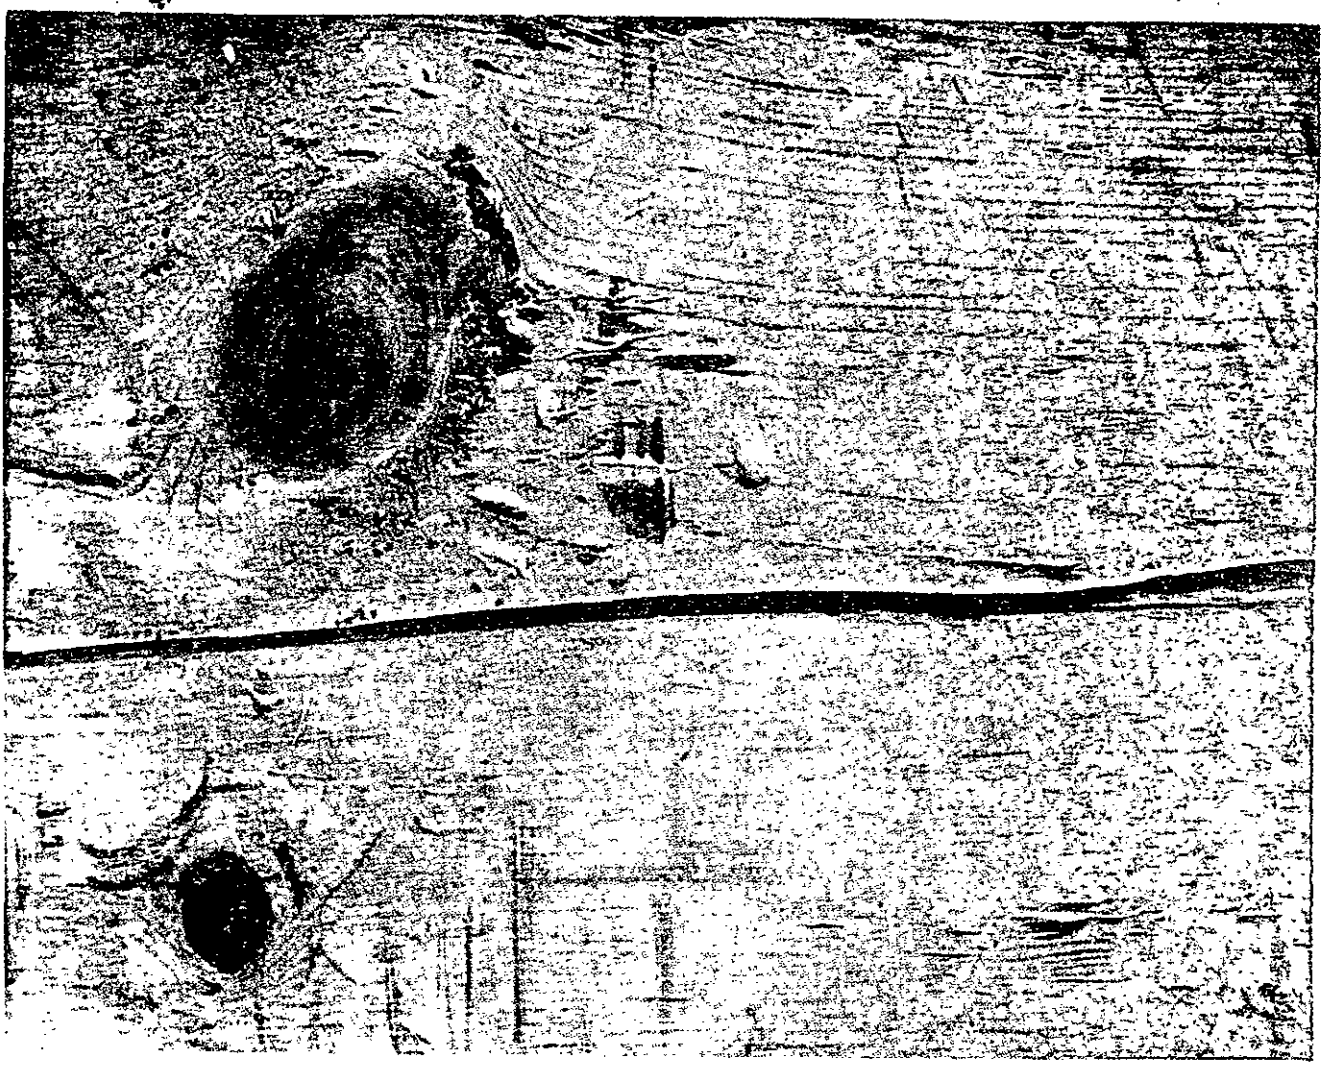


No. 9—FULL LENGTH SPLIT. Permissible. (Not more than one, unrepaired, in a part.)

Source: https://assist.dla.mil/ -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

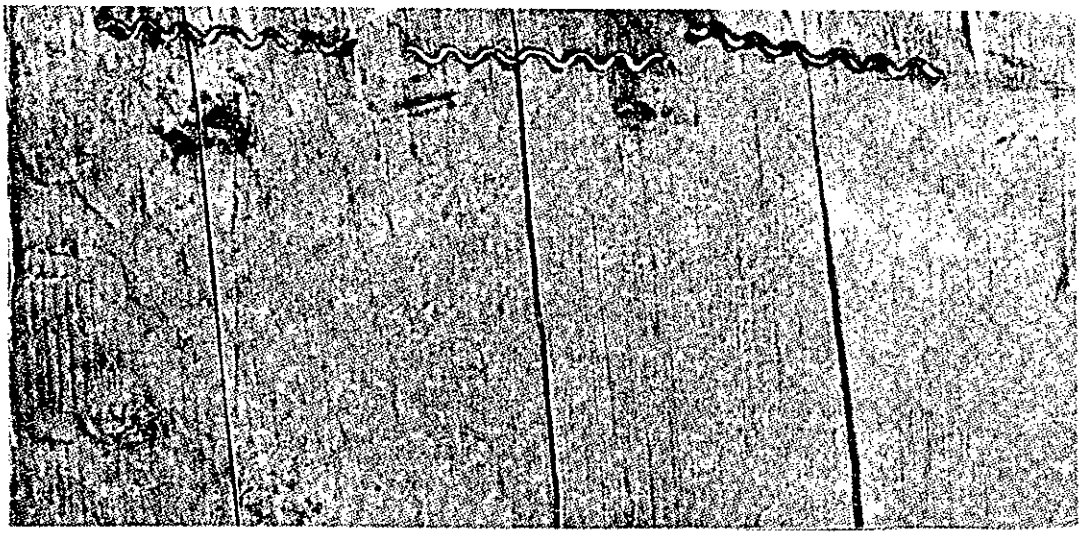


No. 10—FULL LENGTH SPLITS. Minor. (More than two, repaired, in a part.)

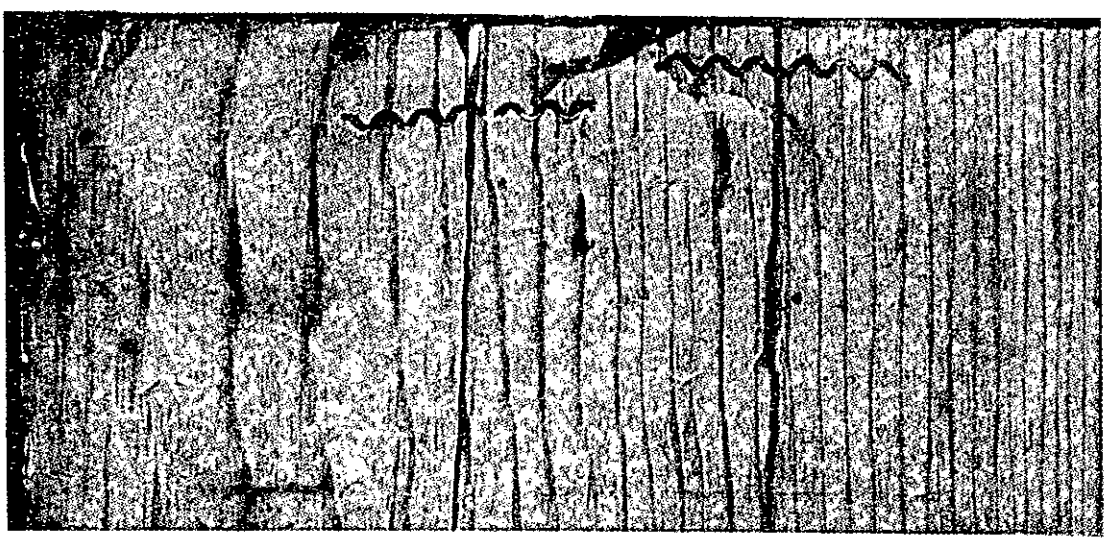


No. 10—FULL LENGTH SPLITS. Permissible. (Not more than two, repaired, in a part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

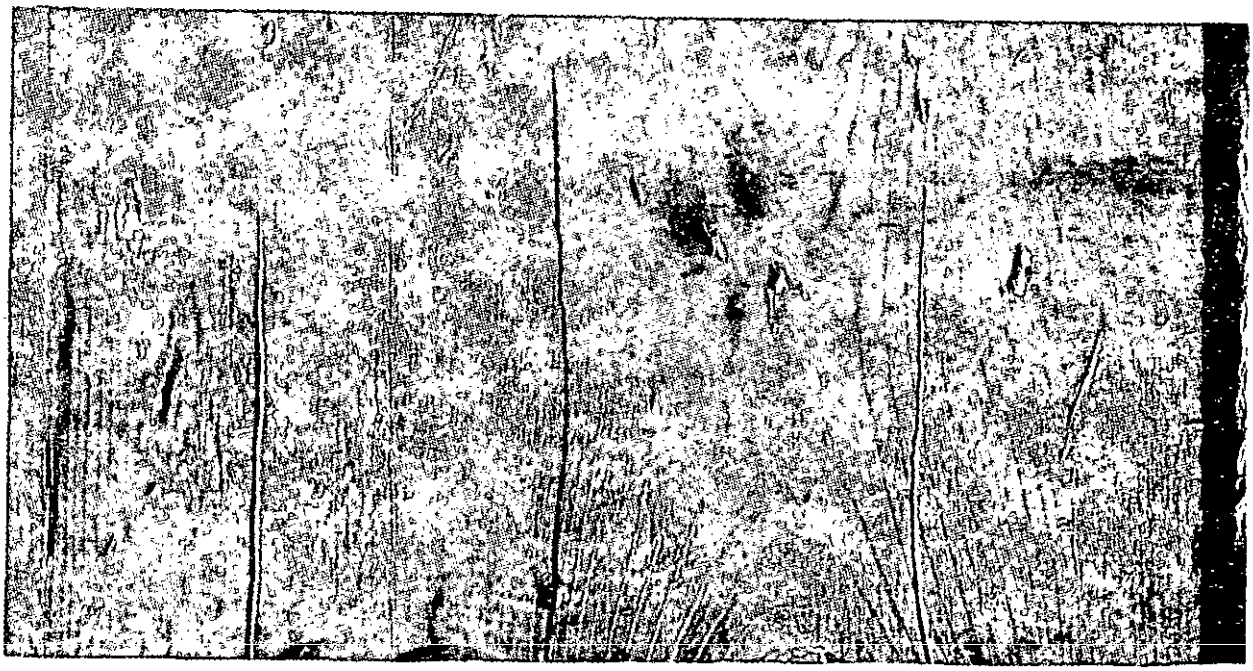


No. 11—PARTIAL SPLITS. Minor. (More than two, unrepaired, in a part. *Note.*—This would be permissible if one or more of the splits were repaired with corrugated fasteners.)

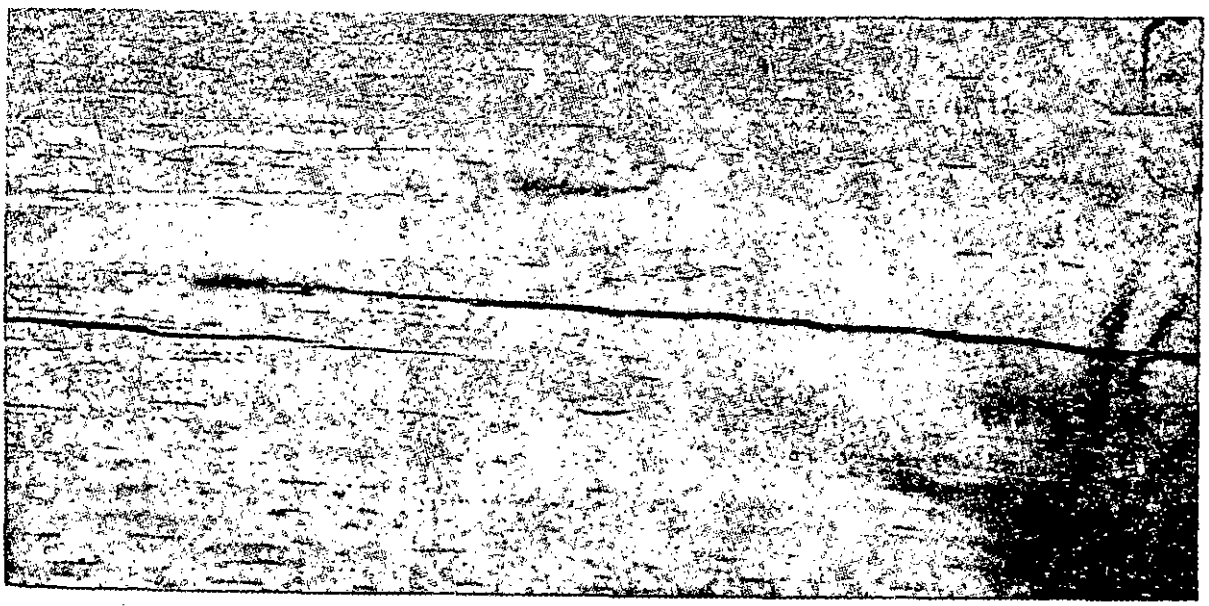


No. 11—PARTIAL SPLITS. Permissible. (Not more than two, unrepaired, in a part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

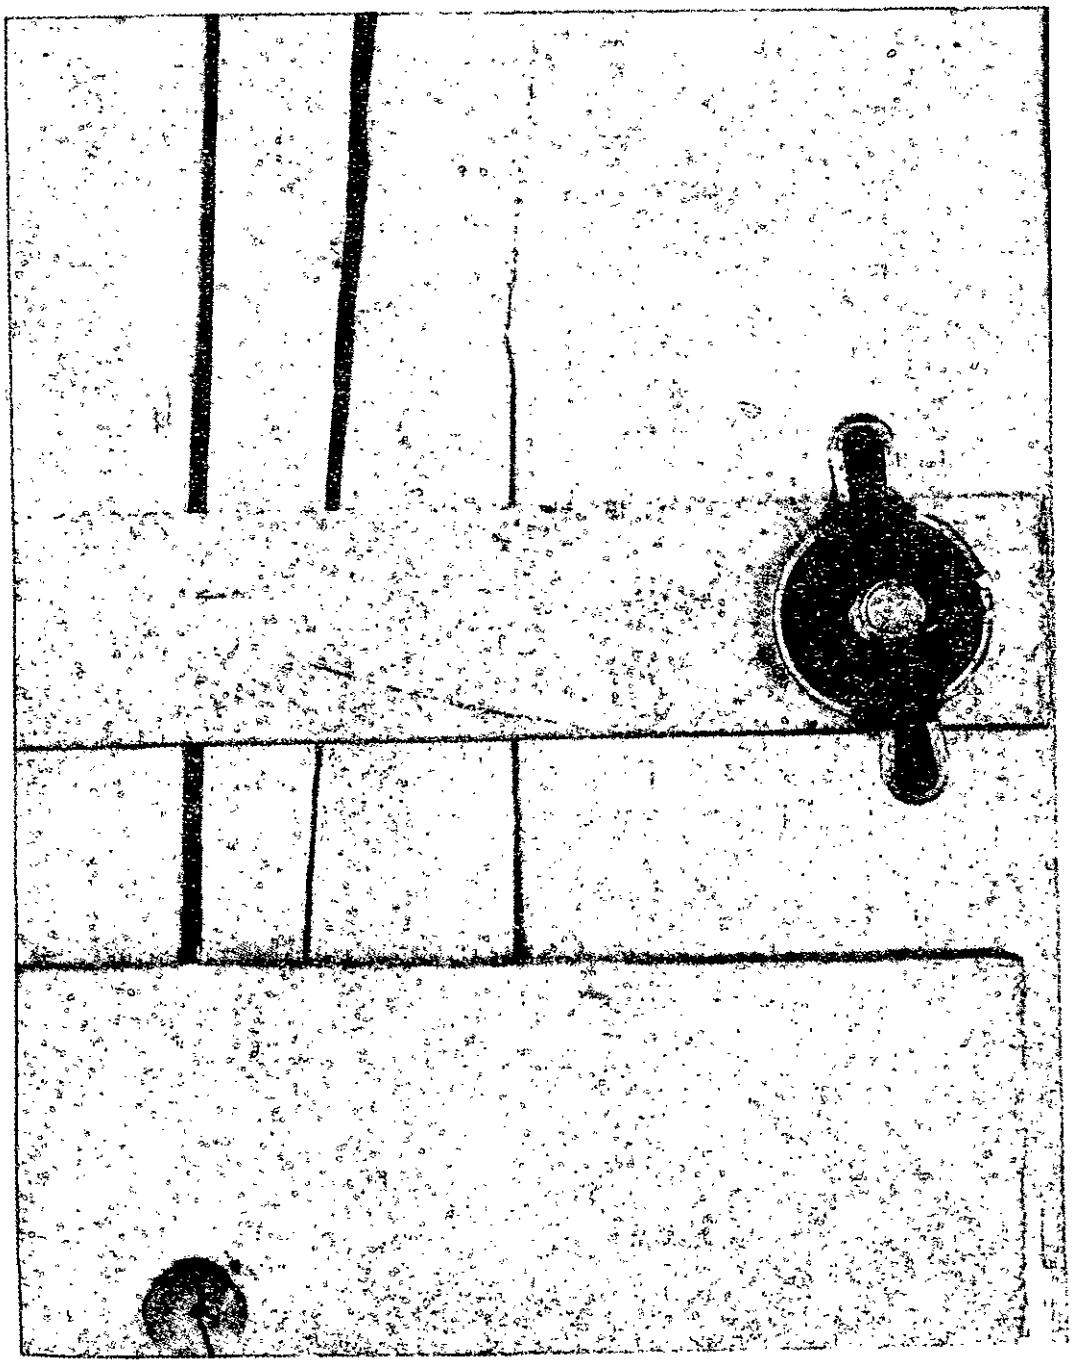

No. 12—SPLIT. Minor. (Either partial or full length in a cover.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

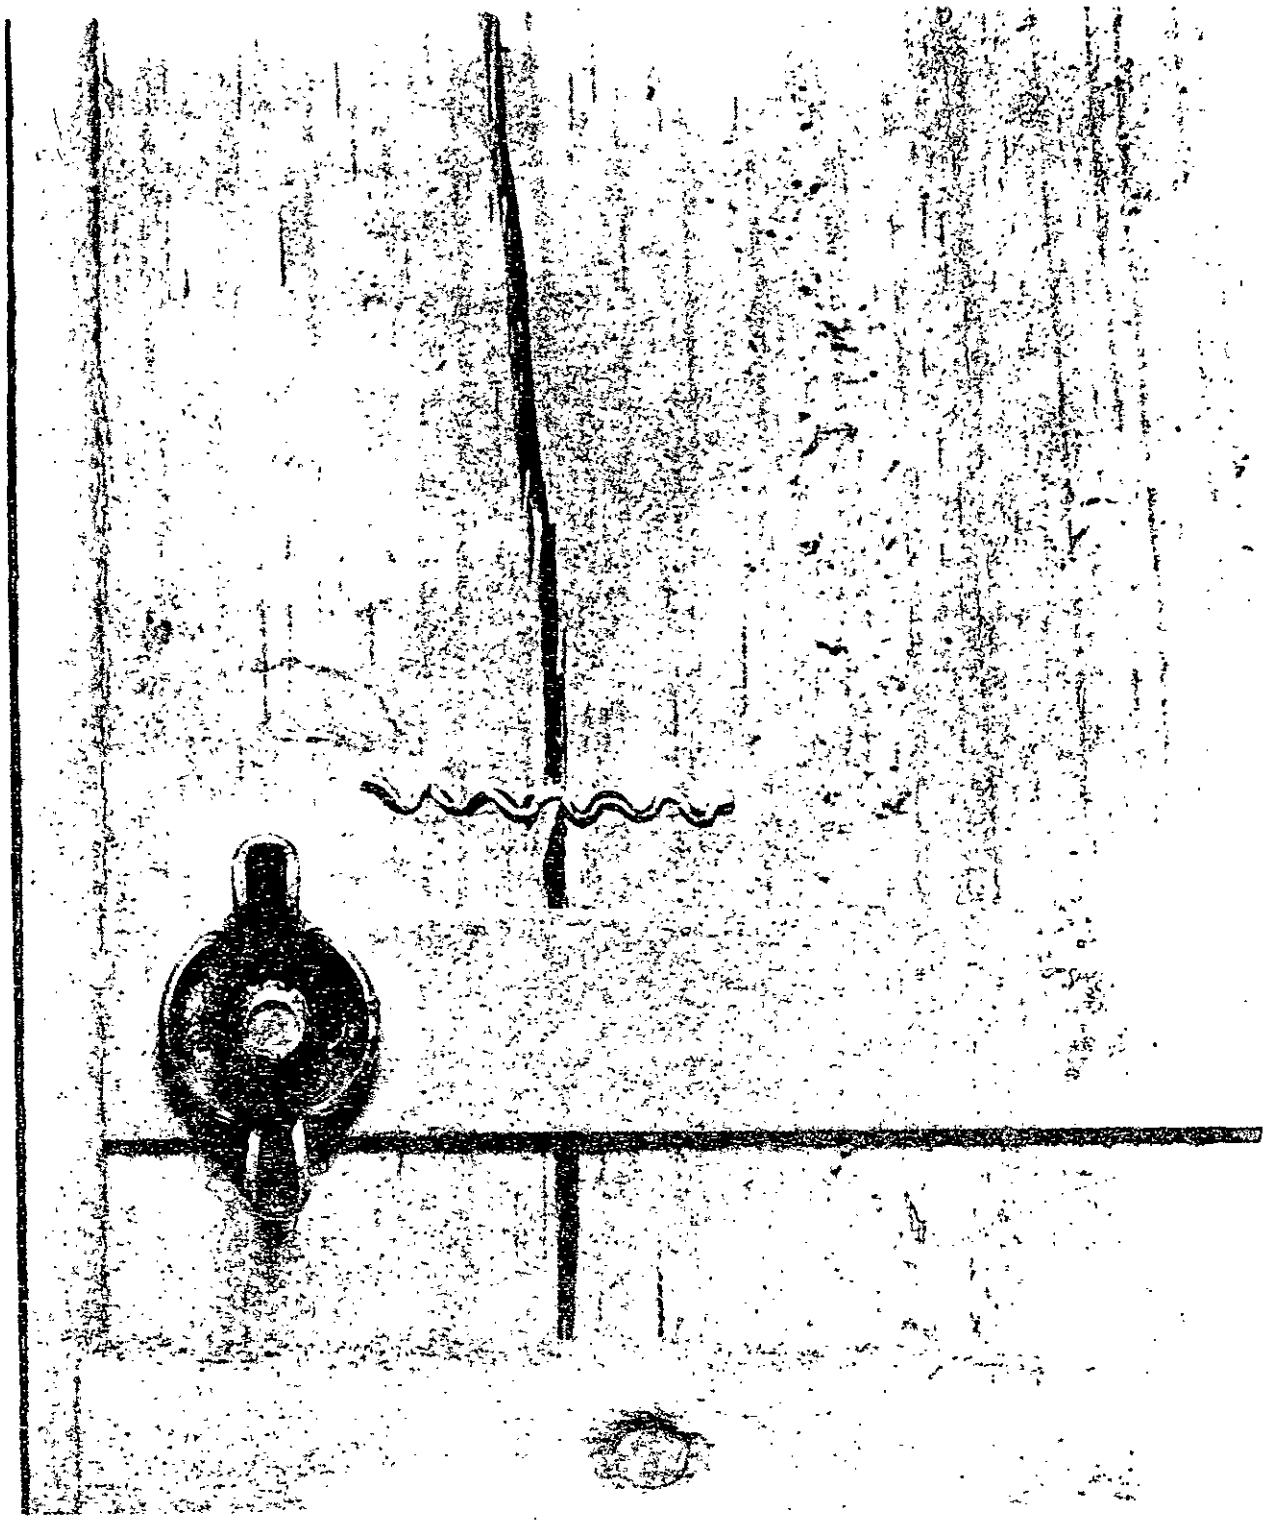


No. 12—SPLIT. Permissible. (In a cover, repaired.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.



No. 13—SHAKE. Major.

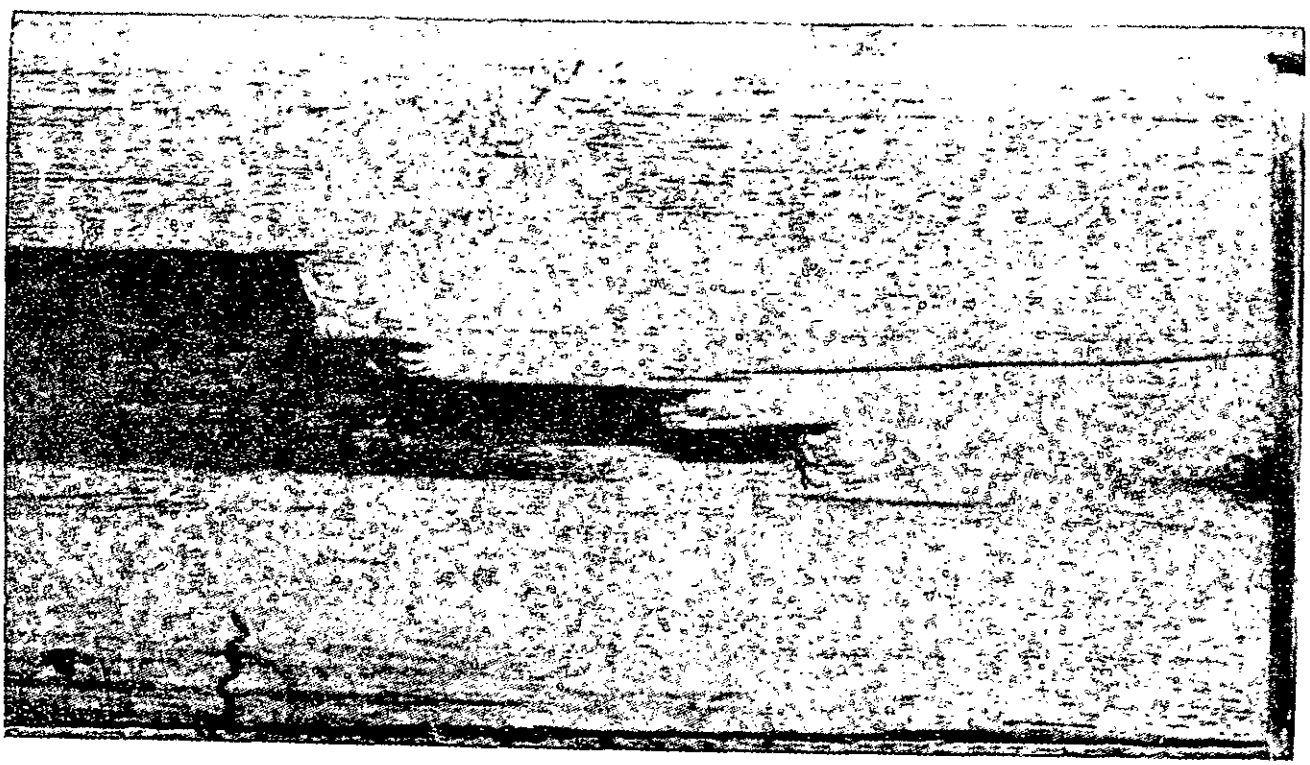


No. 13—SHAKE. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 13—SHAKE. Major.

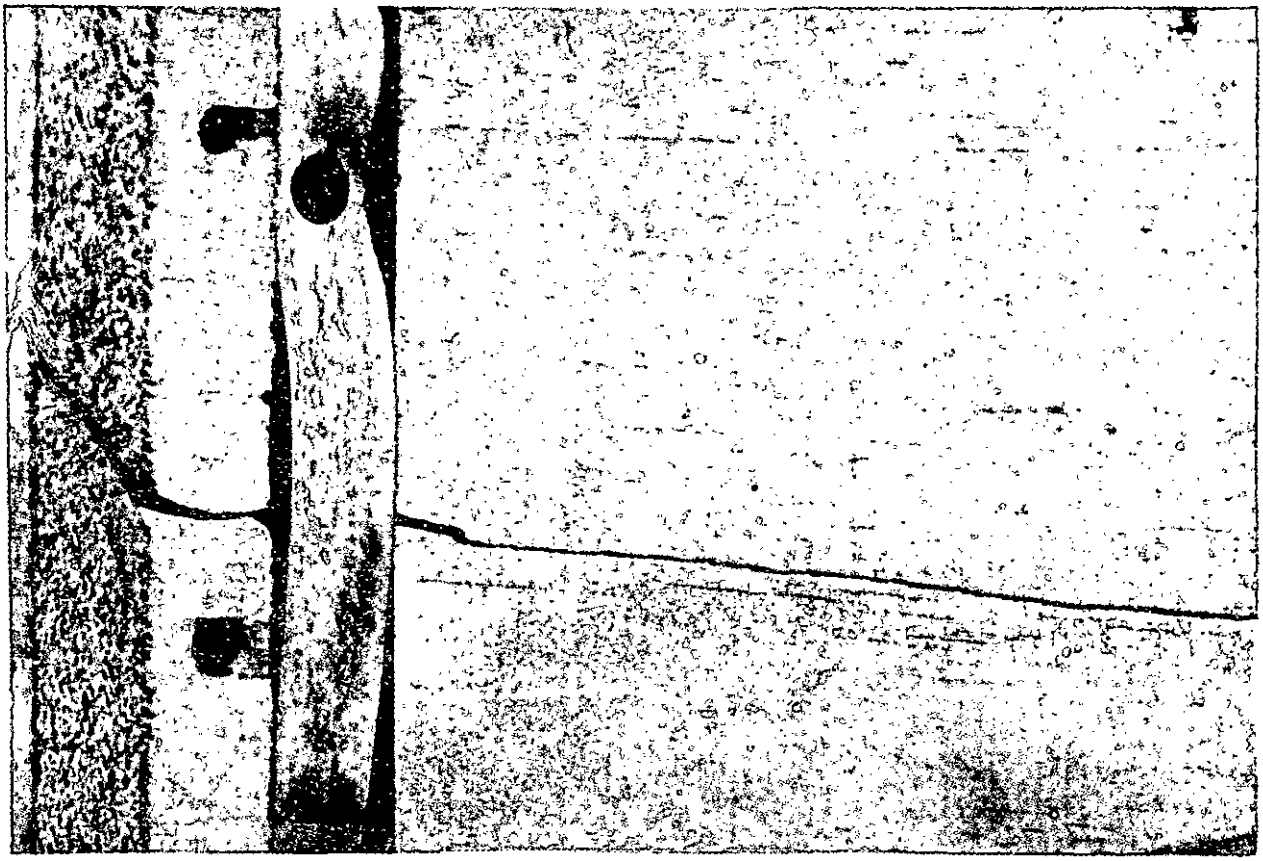


No. 13—SHAKE. Permissible.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

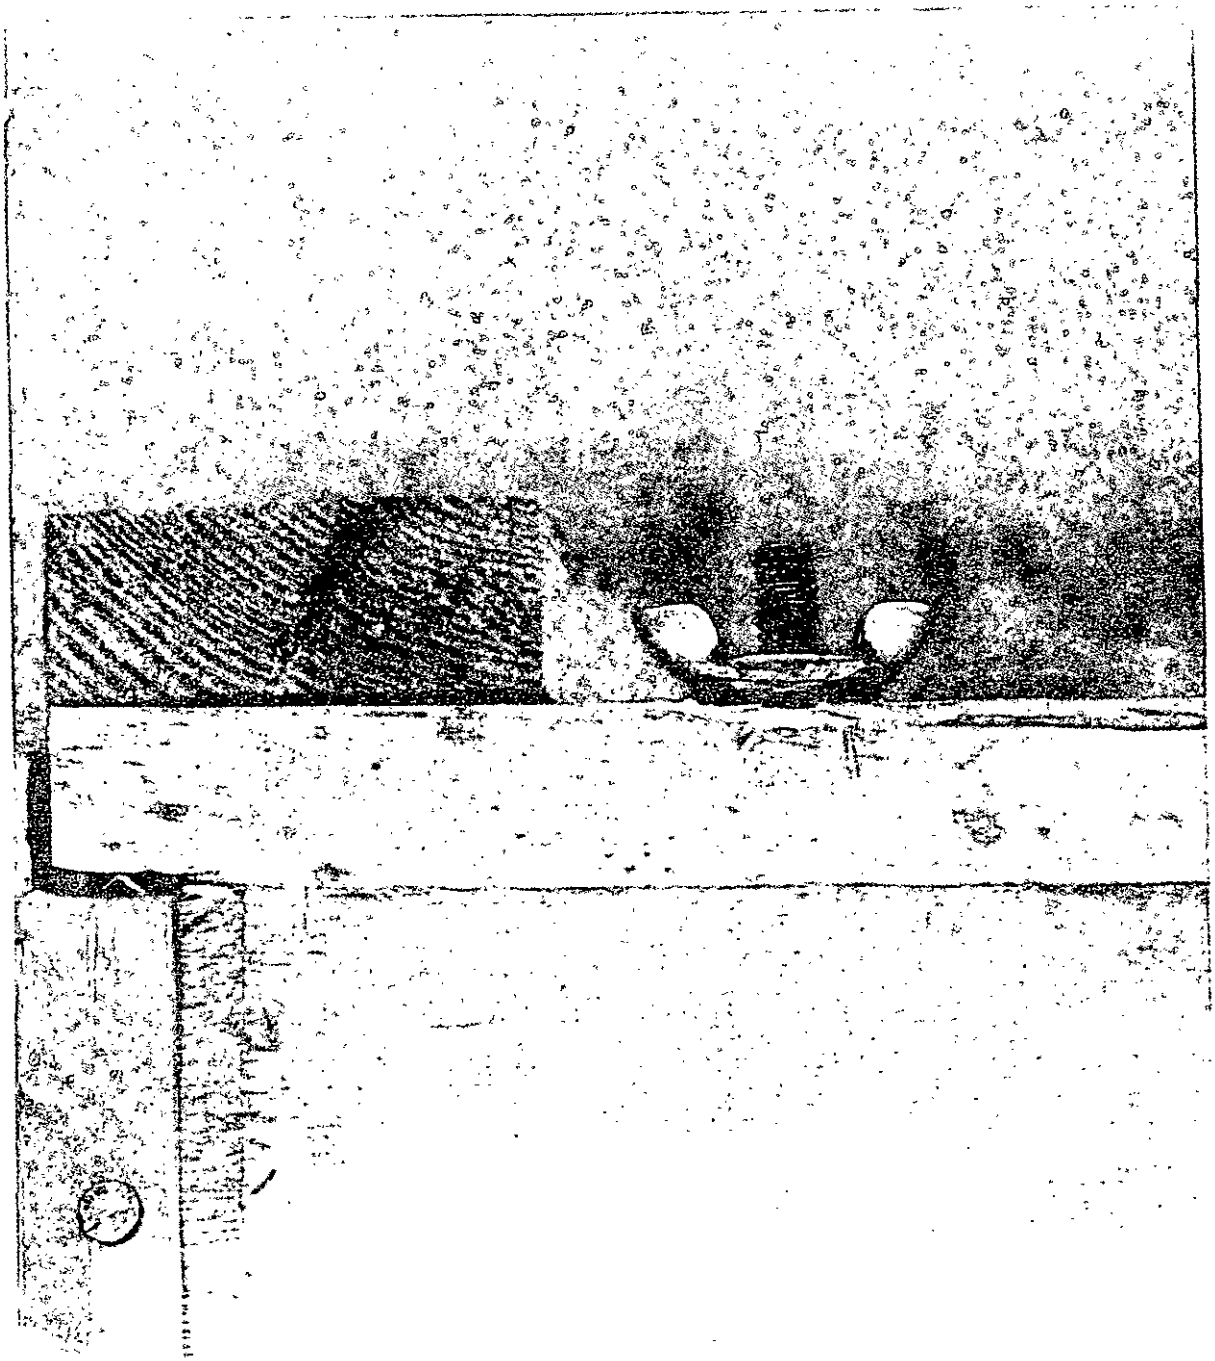


No. 15—DAMAGED HARDWARE. Minor. (Reinforcement burred.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

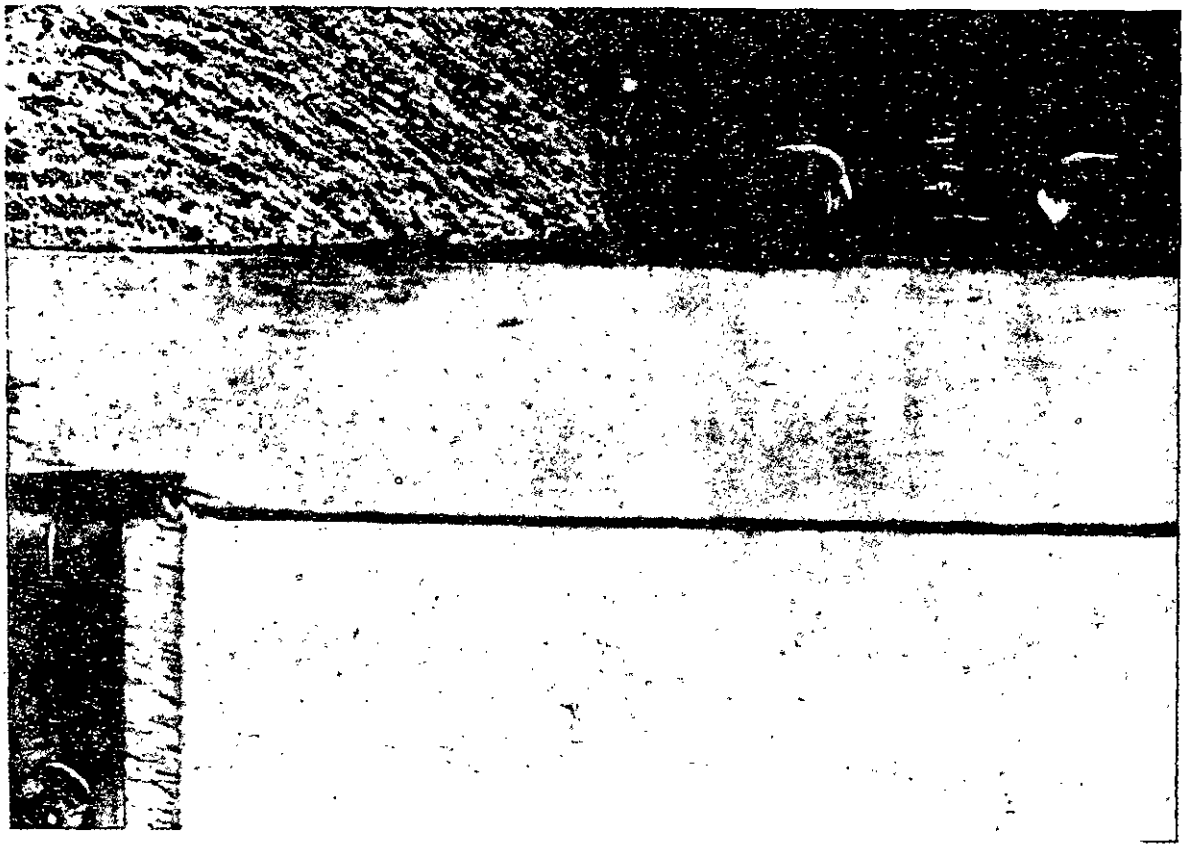


No. 15—DAMAGED HARDWARE. Minor. (Screw threads burred.)

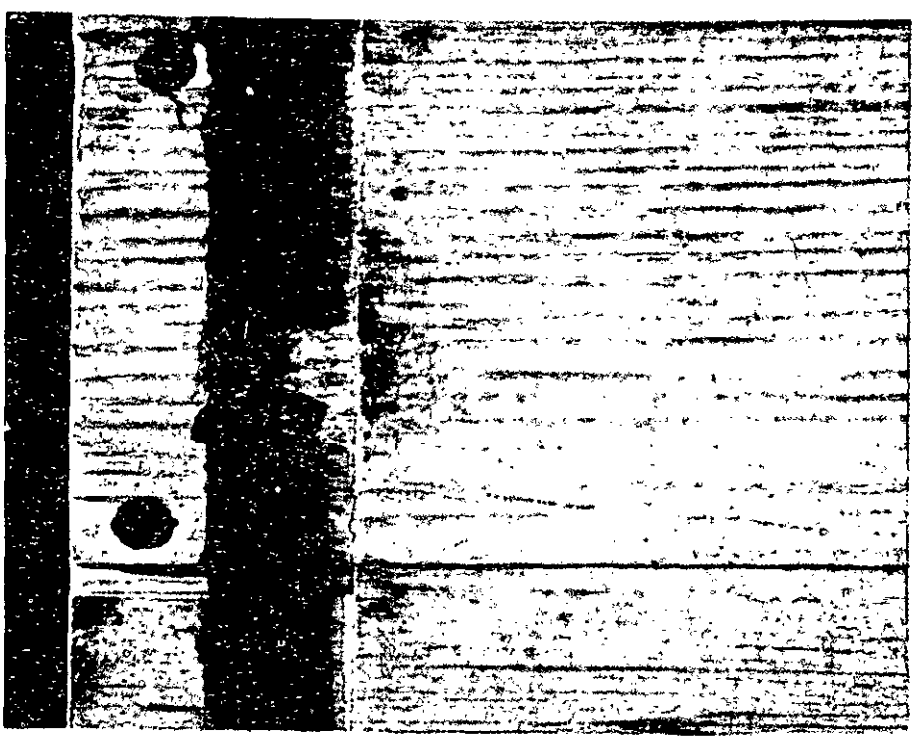


No. 15—DAMAGED HARDWARE. Minor. (Torn strap.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

No. 16—UNTREATED HARDWARE. Minor. (Reinforcements, wing-nuts, U-bolts, handles, ferrules and nails not illustrated. Treatment shall be in accordance with applicable drawings.)

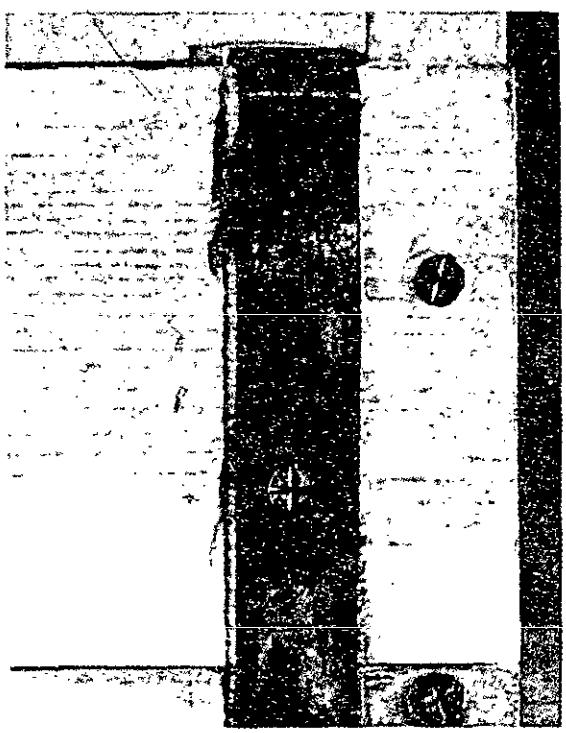


No. 16—UNTREATED HARDWARE. Minor. (Strapping.)

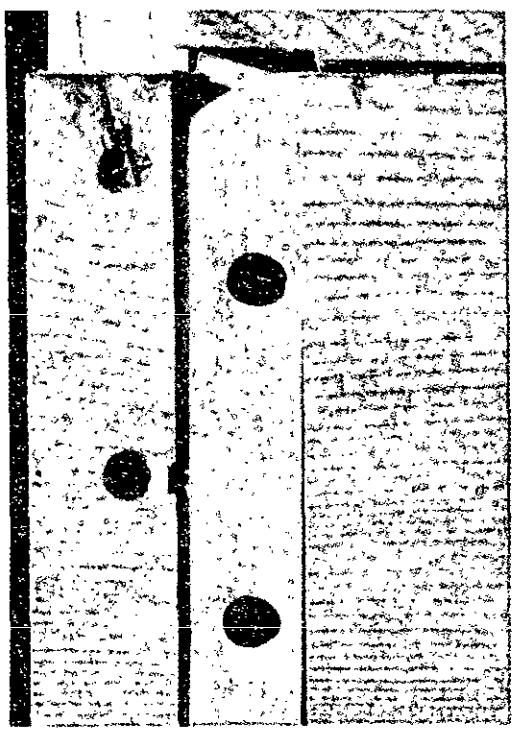


No. 16—TREATED HARDWARE. (Strapping. Galvanizing required.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

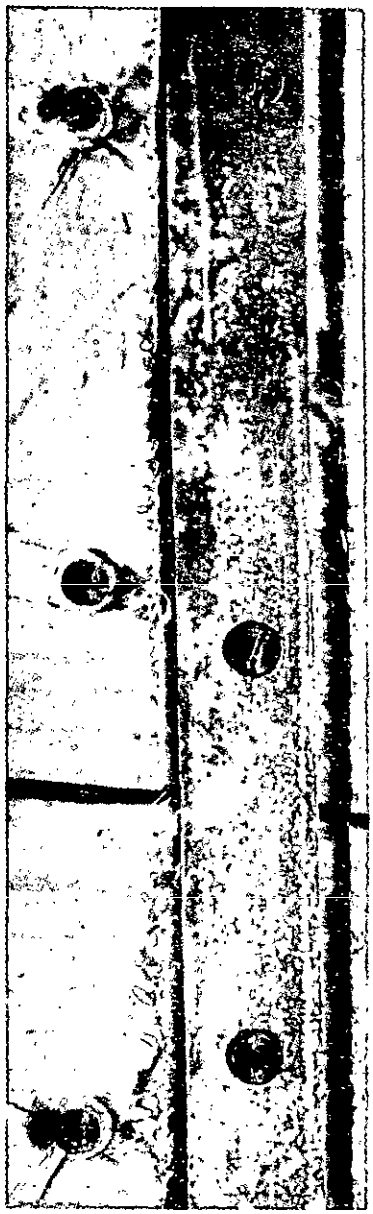


No. 18—PROTRUDING NAIL HEADS. Minor if more than 10% protrude. Permissible if 10% or less protrude.

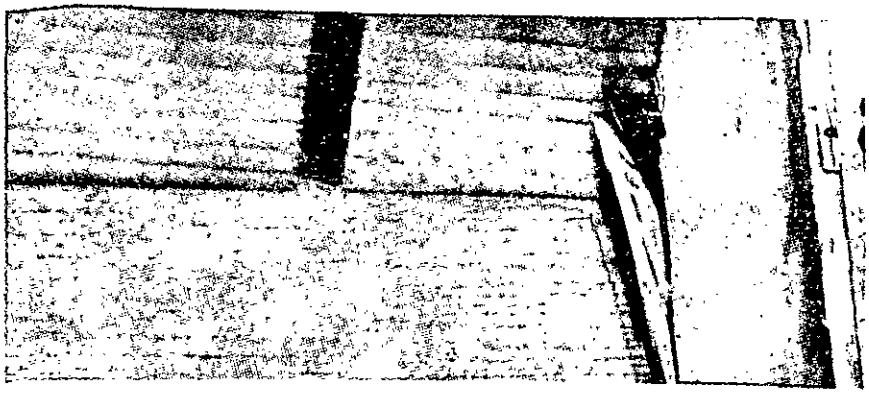

No. 19—PROTRUDING NAIL POINT. Major.




No. 19—PROTRUDING CORRUGATED FASTENER. Major.

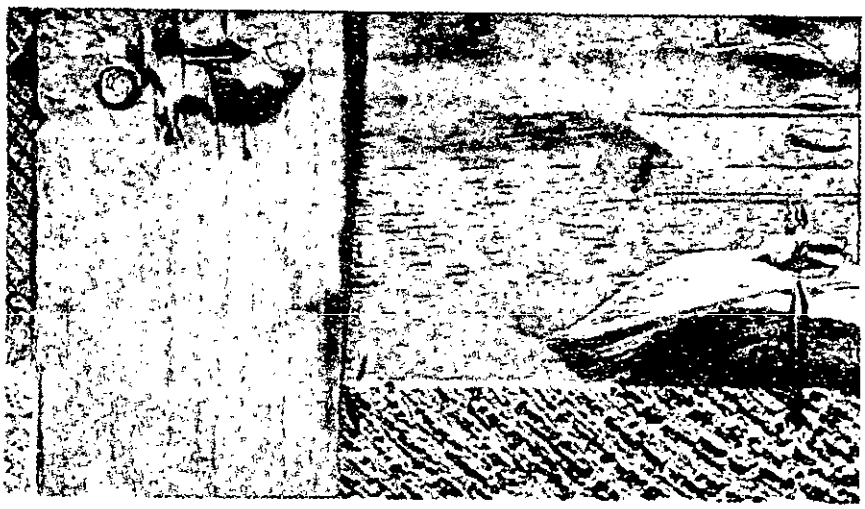


No. 19—PROTRUDING NAIL POINTS. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

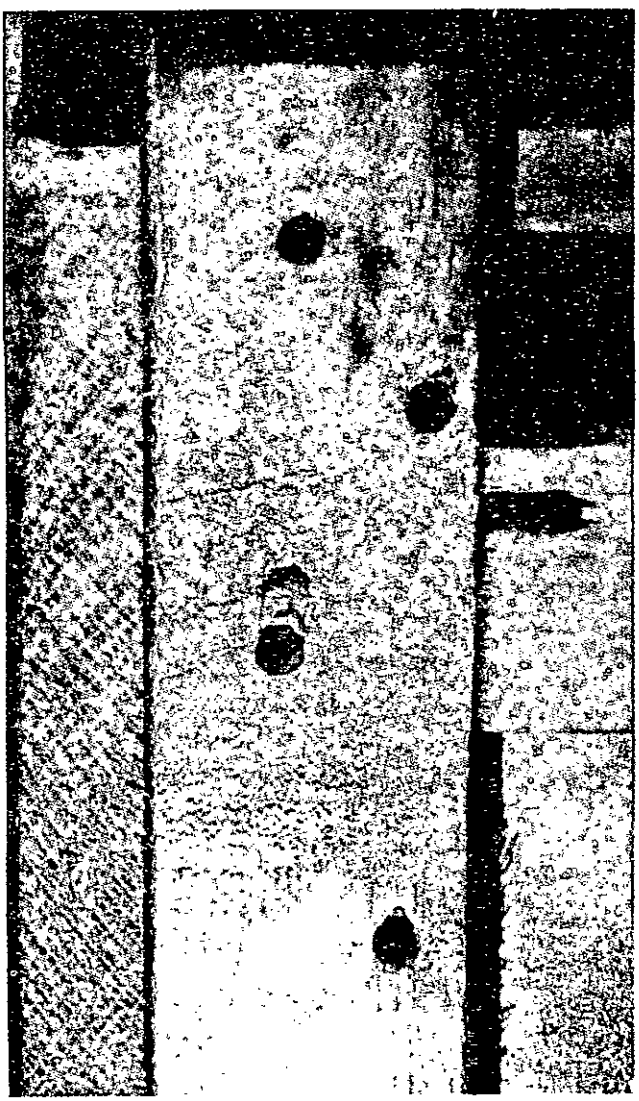

No. 20—OVERDRIVEN NAILS. (Driven more than 1/32" below surface.) Minor if more than 10% are overdriven. Permissible if less than 10% are overdriven.

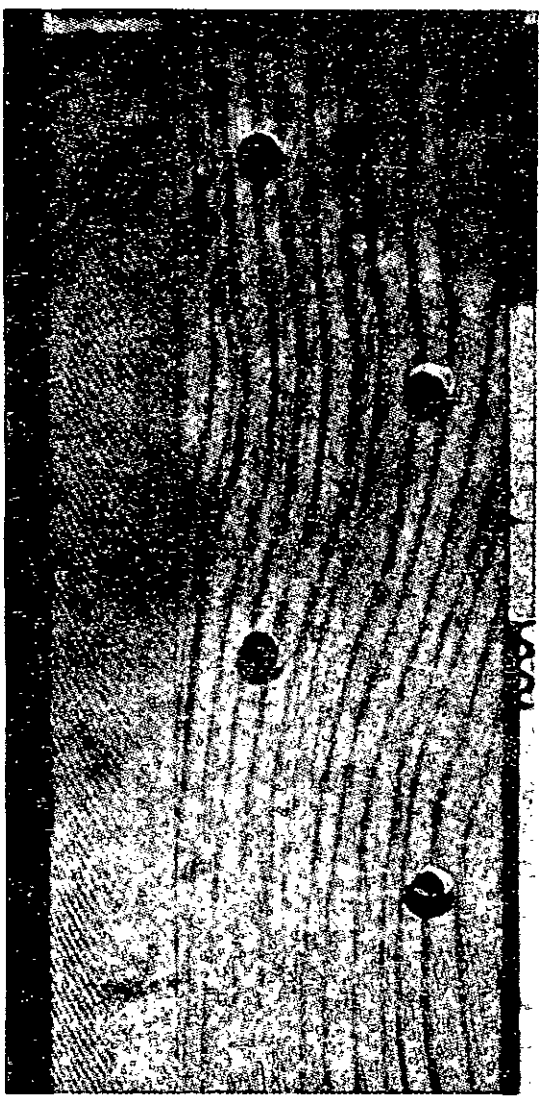


No. 20—OVERDRIVEN NAILS. Permissible. (Driven 1/32" or less below surface.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

No. 21—MISSING NAIL. Minor if more than one is missing per end. Permissible if only one is missing per end.



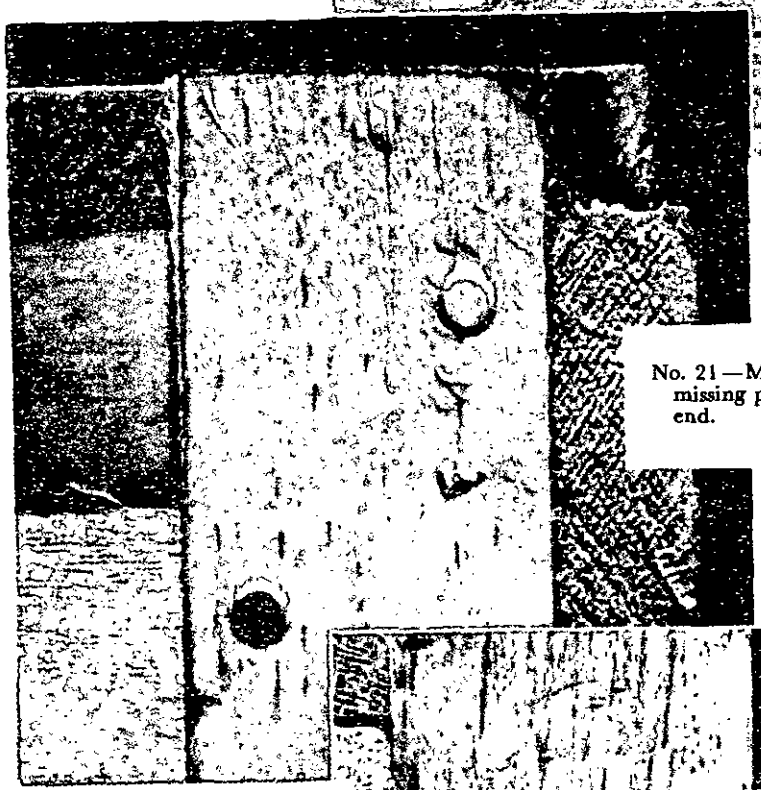


No. 21—MISSING NAIL. Minor if more than one is missing per end. Permissible if only one is missing per end.

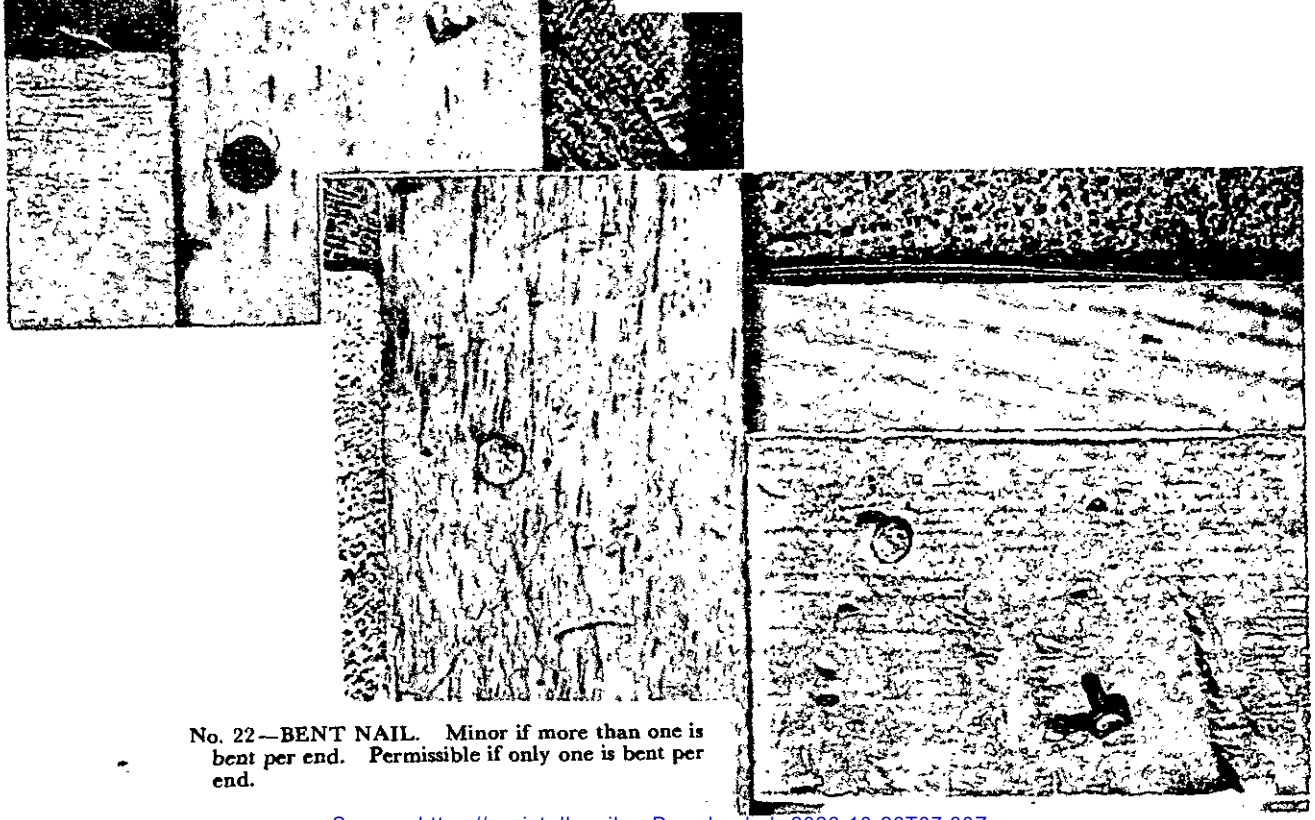


No. 22—BENT NAIL. Minor if more than one is bent per end. Permissible if only one is bent per end.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

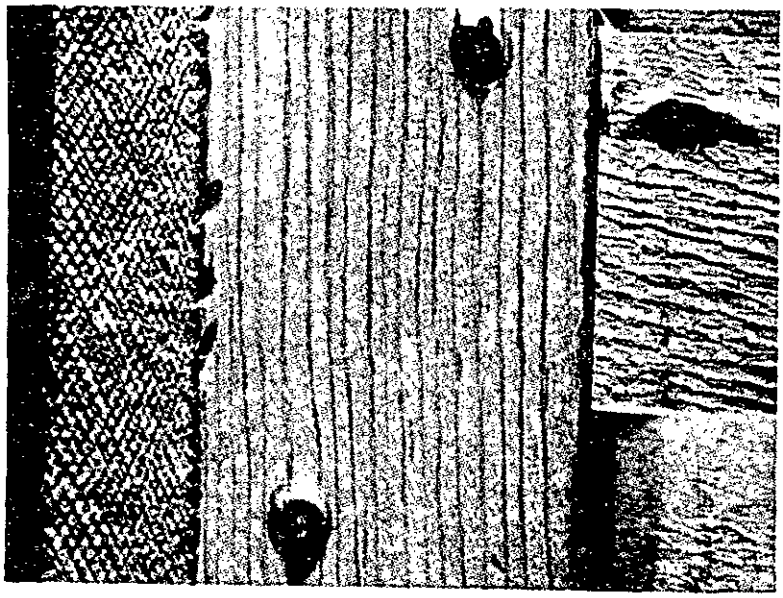

No. 22—BENT NAIL. Minor if more than one is bent per end. Permissible if only one is bent per end.

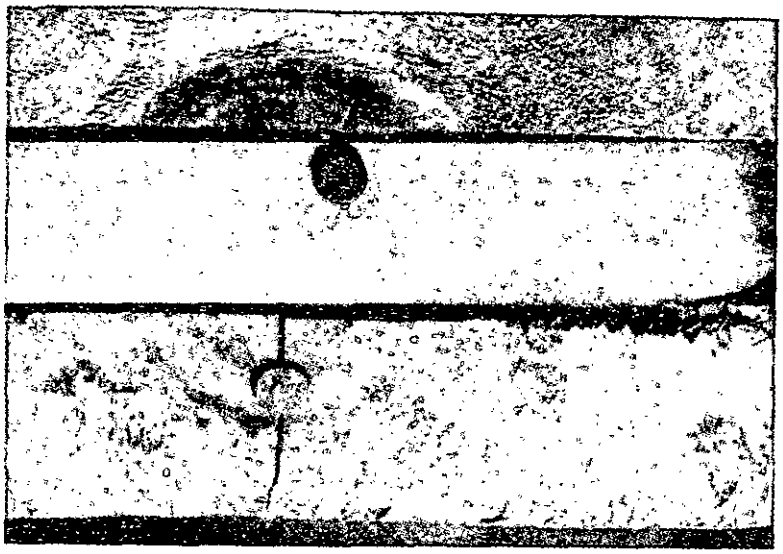


No. 22—NAILS DRIVEN THROUGH KNOT. Minor. Permissible if only one per end is driven through knot.

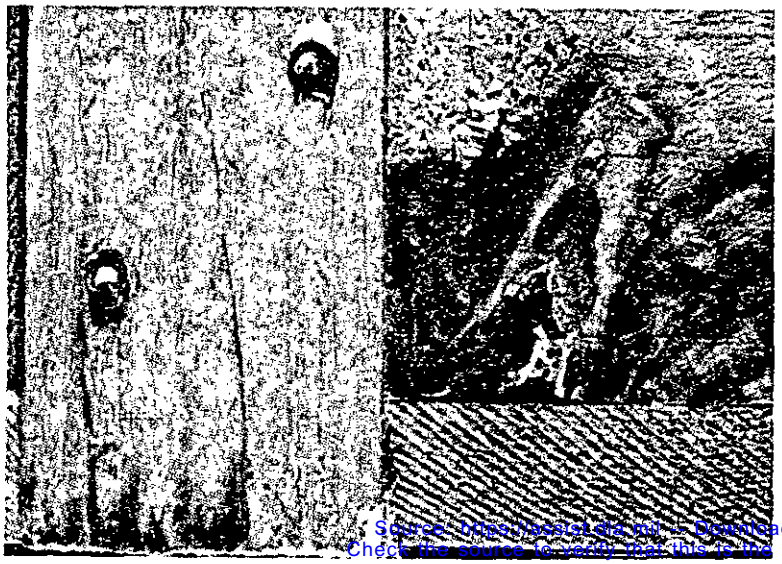


No. 22—NAILS DRIVEN INTO KNOT. Minor. Permissible if only one per end is driven into knot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

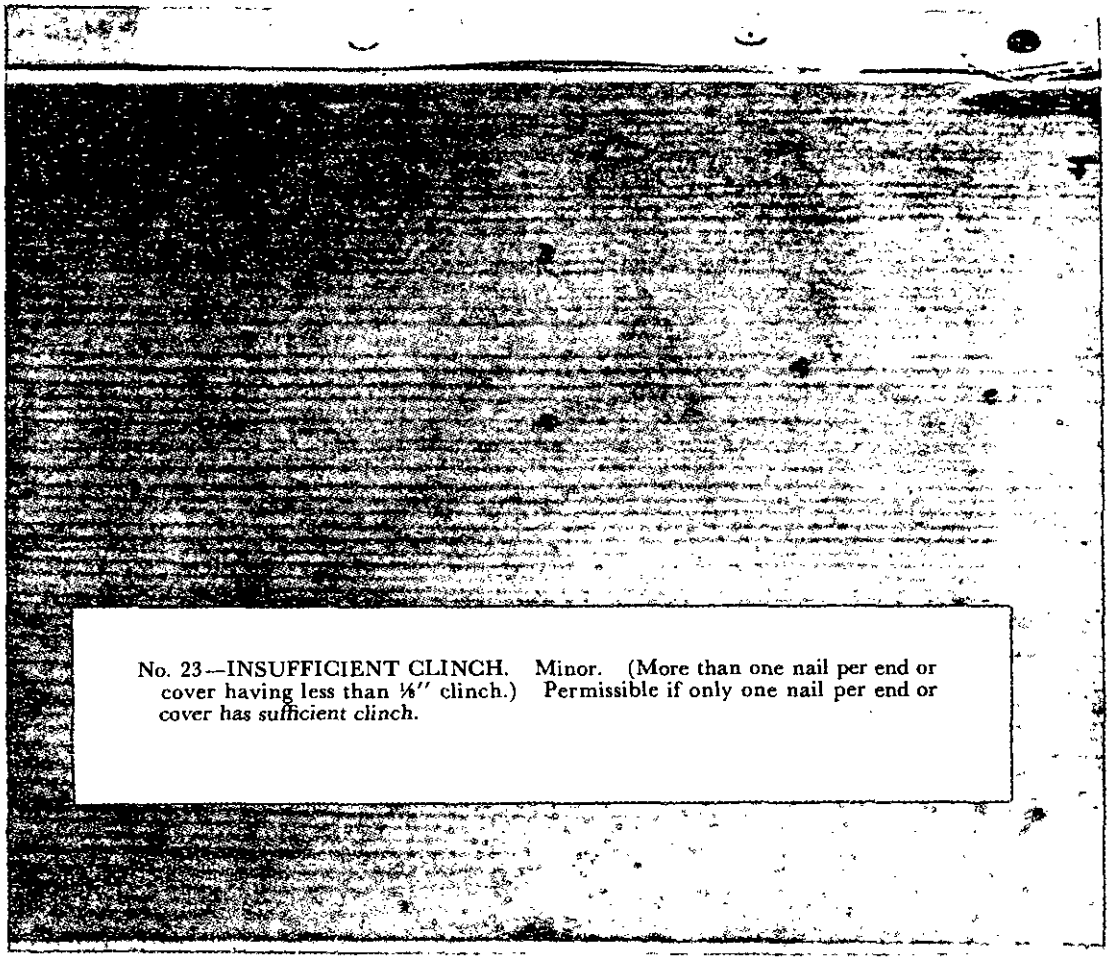


No. 23—INSUFFICIENT CLINCH. Minor. (More than one nail per end or cover having less than ⅛" clinch.) Permissible if only one nail per end or cover has sufficient clinch.

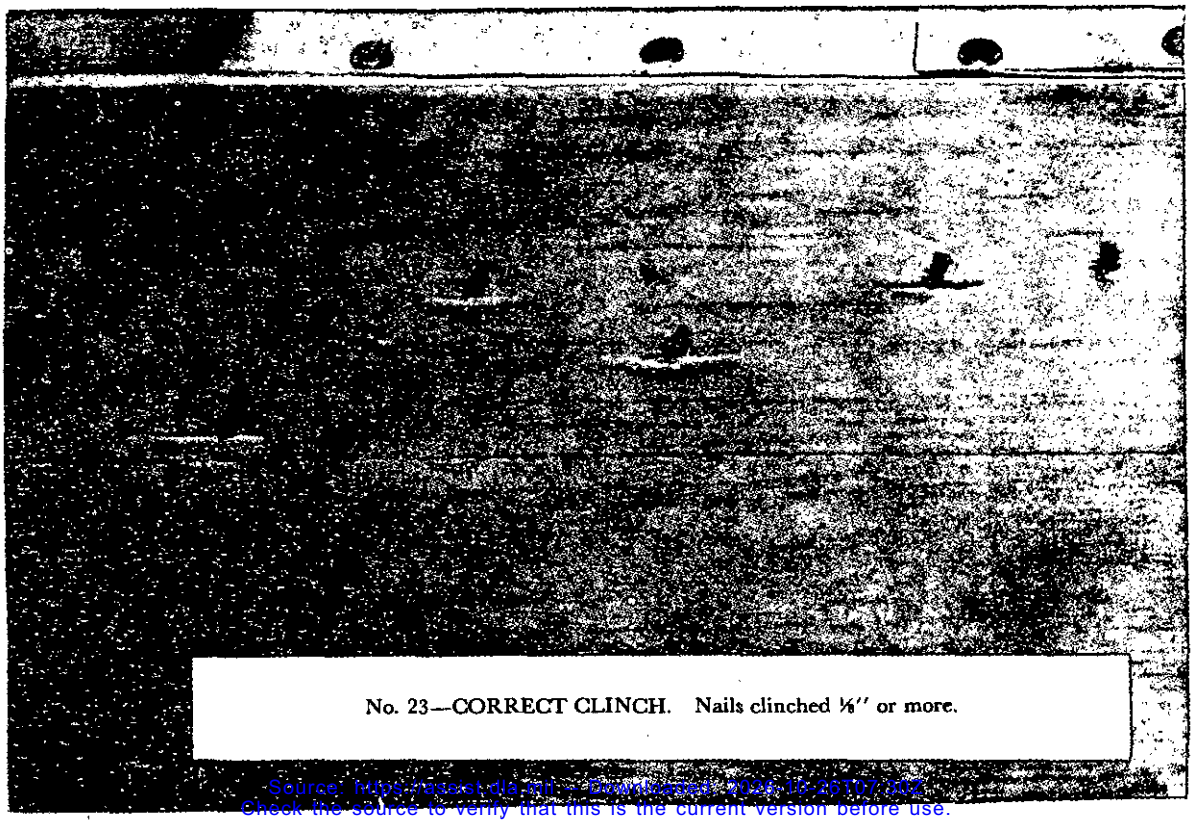


No. 23—CORRECT CLINCH. Nails clinched ⅛" or more.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:00Z
Check the source to verify that this is the current version before use.

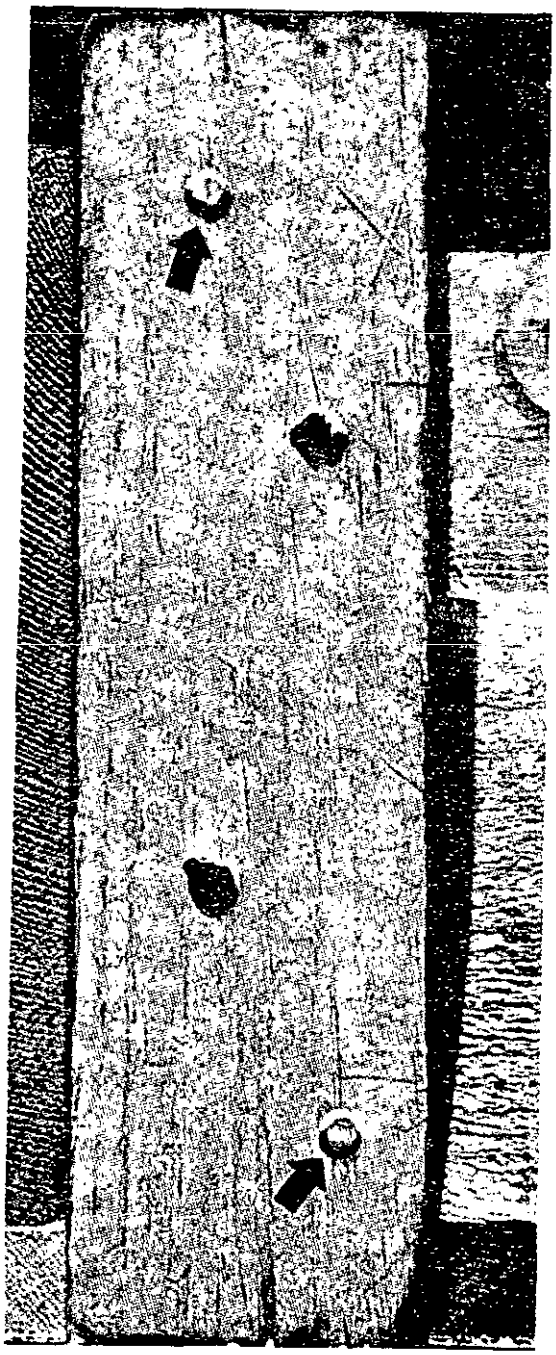


No. 24—COMBINED NAILING DEFECTS. Major. (Two missing and two bent nails in one cleat. *Note.*—Any other combination of defects 21, 22 and 23 also major.)

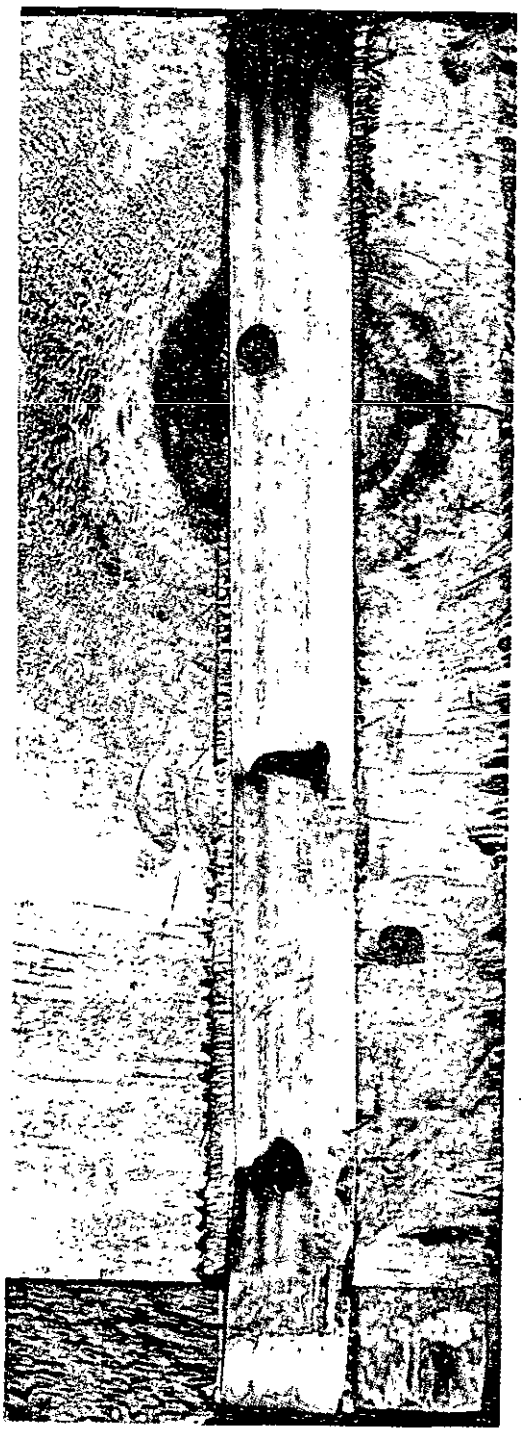


No. 24—COMBINED NAILING DEFECTS. Major. (Two bent nails and two nails driven through knot in same end of side.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

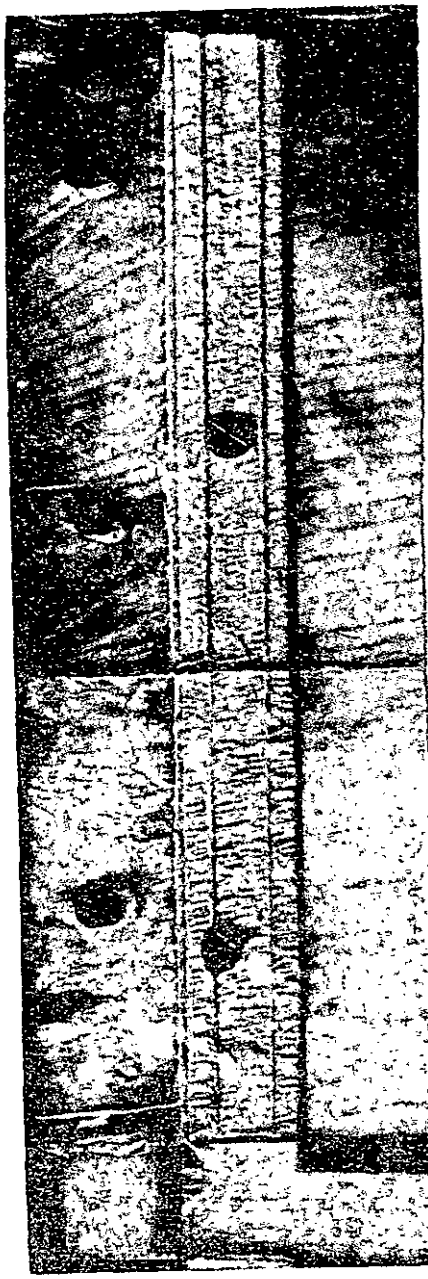

No. 25—MISSING STRAP. Major.

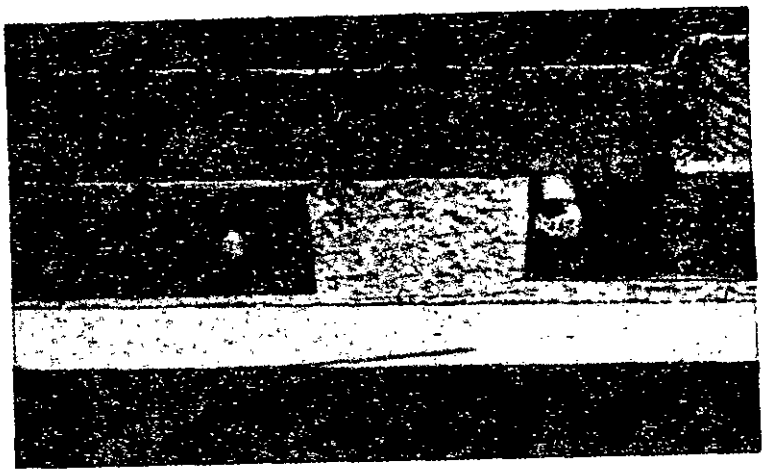


No. 26.—SHORT STRAP. Minor. (Ends not lapped.)

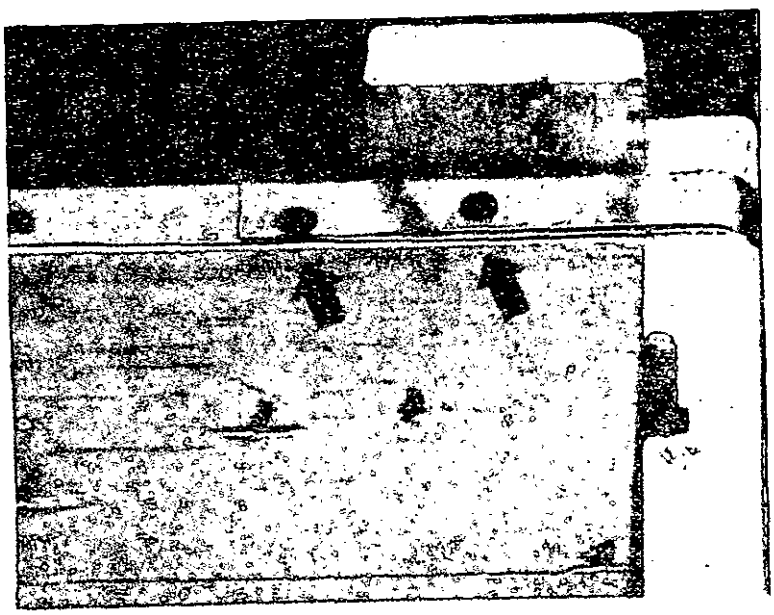


No. 27—LAPPED ENDS OF STRAP. Minor if one or both nails are missing from lapped ends. (*Note*—Both nails must pass through both ends of strap.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

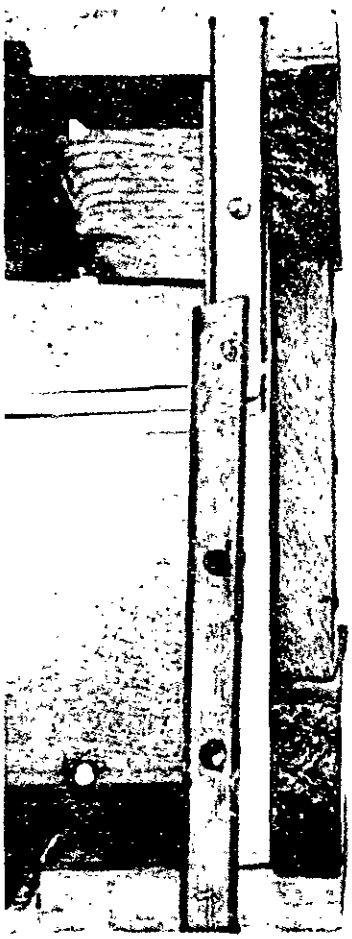

No. 28—STRAPPING MISALIGNED. Minor. (Edge of strap protruding beyond inside surface of box.) *Note*.—U-bolt removed from subject illustrated.

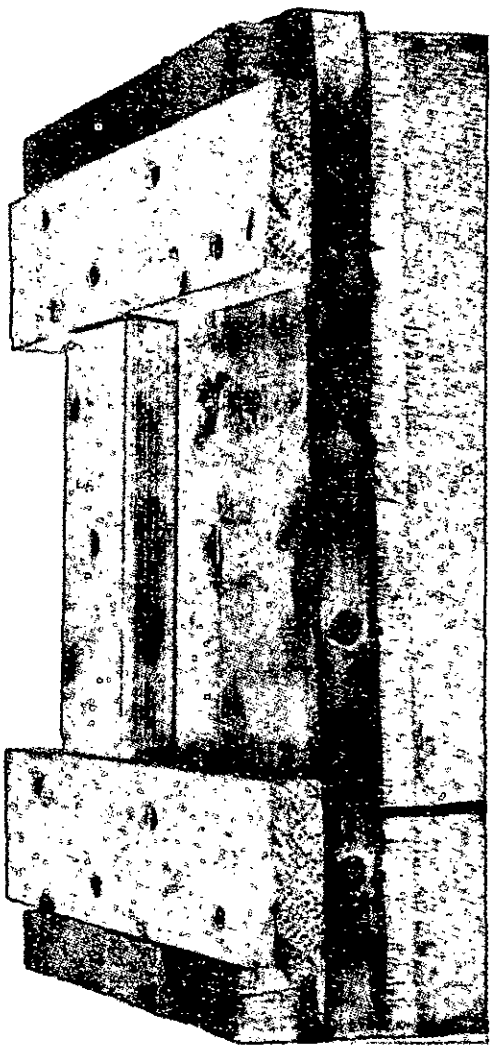


No. 28—STRAPPING MISALIGNED. Minor. (Strap out of rabbet, affecting strength of box.)

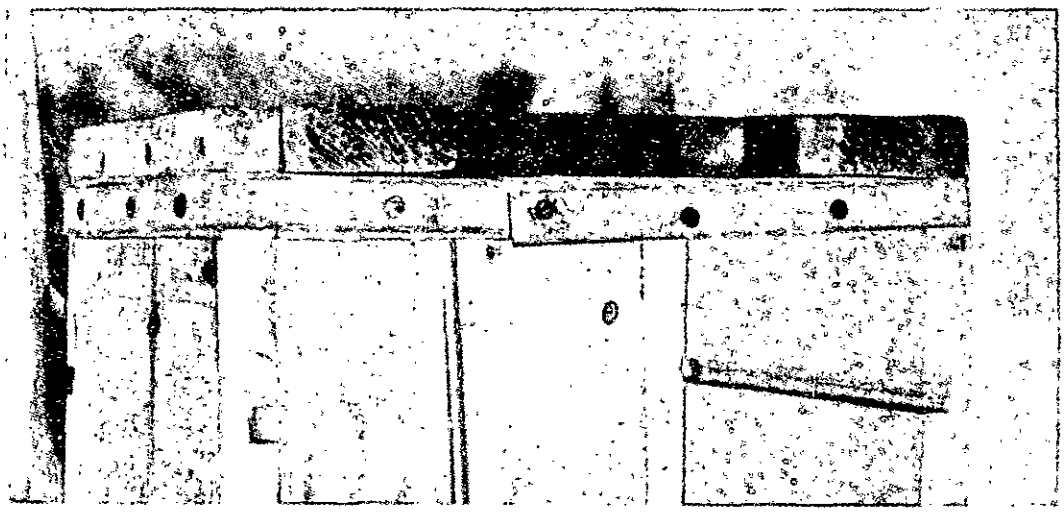


No. 28—STRAPPING MISALIGNED. Minor. (Point of strap protruding beyond inside surface of box.) *Note*.—U-bolt removed from subject illustrated.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

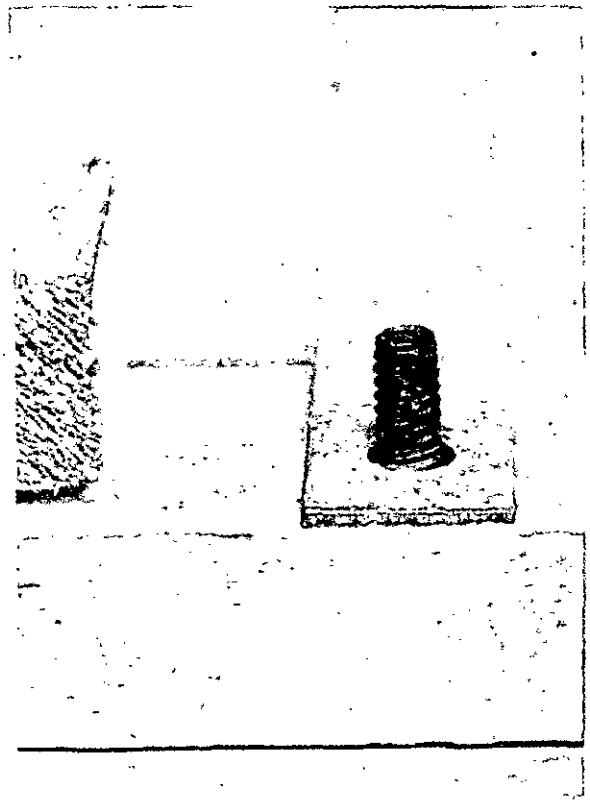


No. 29—MISSING NUT. Minor for box inspection. Major for packed ammunition inspection.

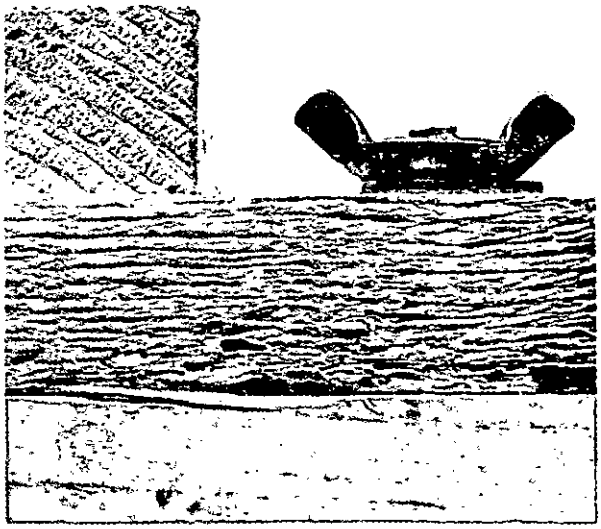

No. 30—SHORT BOLT. Permissible. (Bolt protrudes above threaded portion of wing nut.)

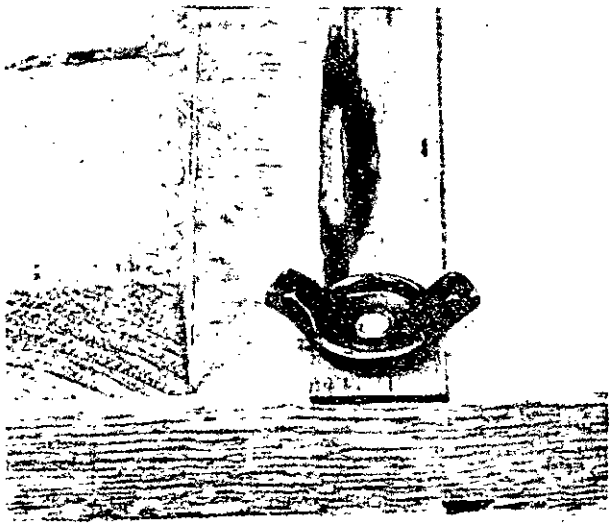


No. 30—SHORT BOLT. Major. (Bolt does not protrude above threaded portion of wing nut.)

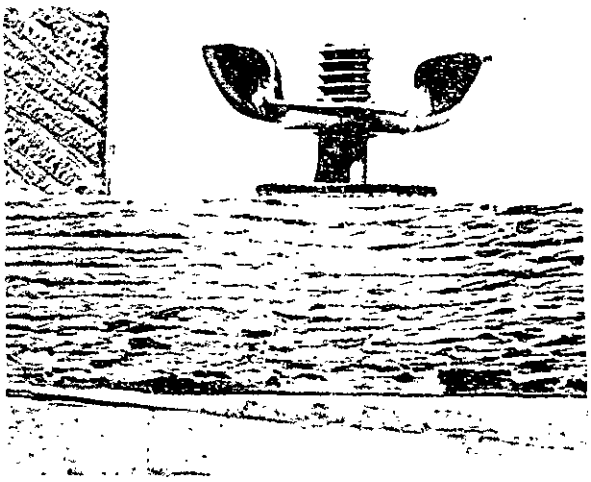


No. 30—*INSUFFICIENT U-BOLT THREADS. Major.*


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

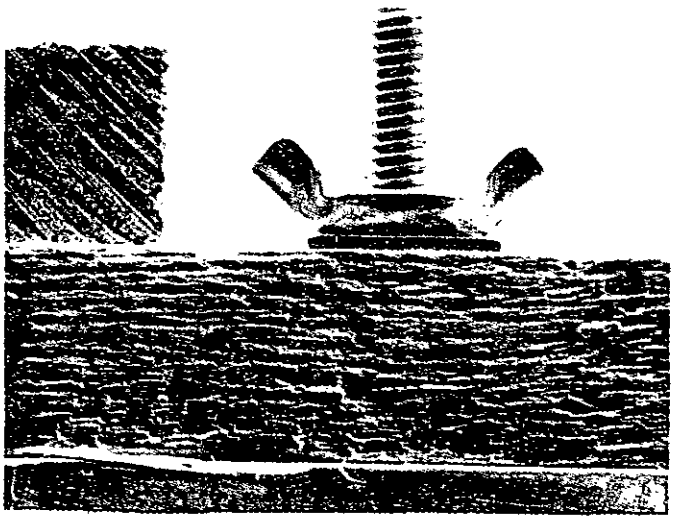


No. 31—LONG BOLT (Extending above top surface of cover cleat.) Minor.

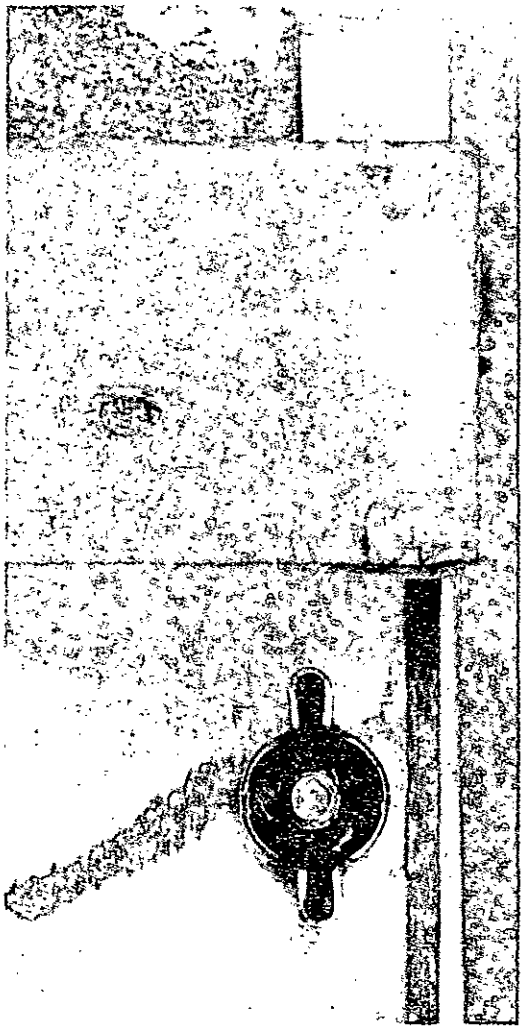

No. 32—MISSING REINFORCEMENT. Minor for box inspection. Major for packed ammunition inspection.

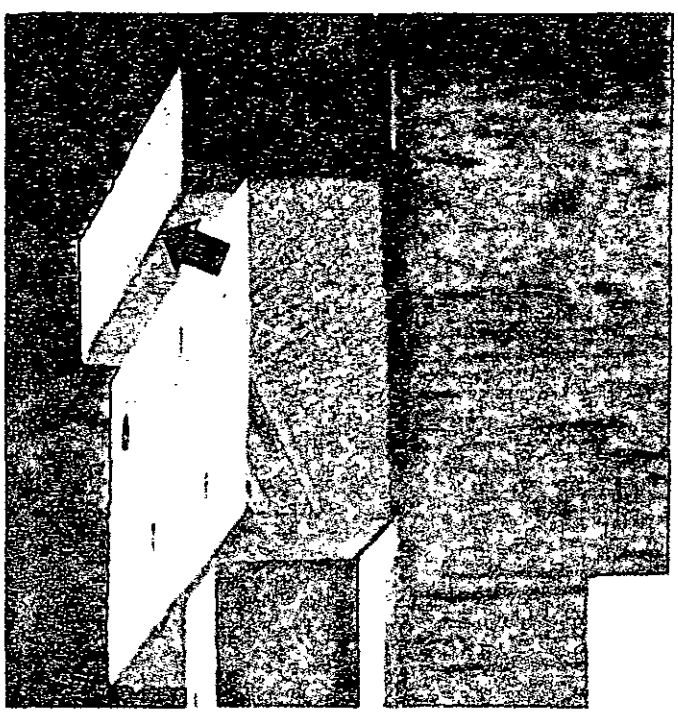


No. 33—LONG SIDE. Minor. (Extending beyond end cleat more than ⅛″.)

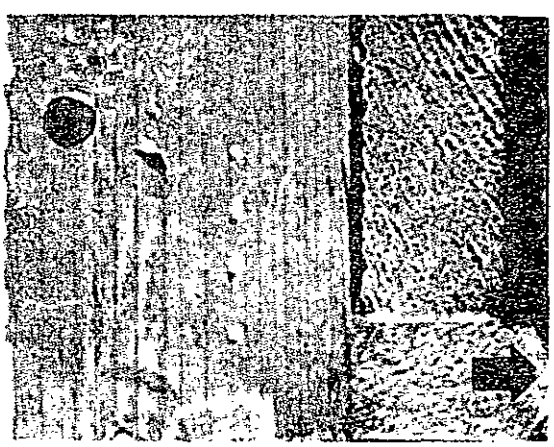

No. 34—WIDE BOTTOM. Minor. (Extending beyond side more than ⅛″.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

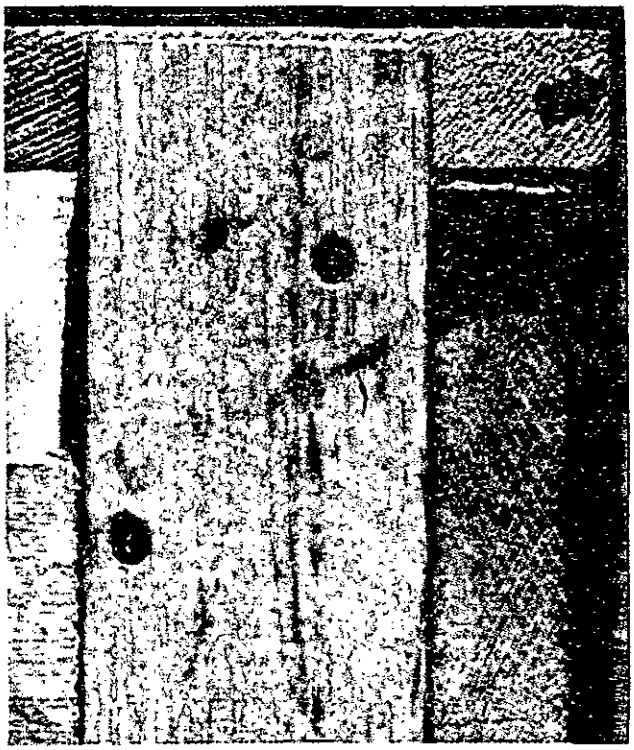


No. 34—WIDE TOP. Minor. (Extending beyond side more than ⅛".)



No. 35—SHORT TOP. Minor. (Extending more than ¼" inside cleat at both ends.)




No. 36—NARROW TOP. Minor. (Extending more than ¼" inside side at both sides. Note protruding end of reinforcement.)

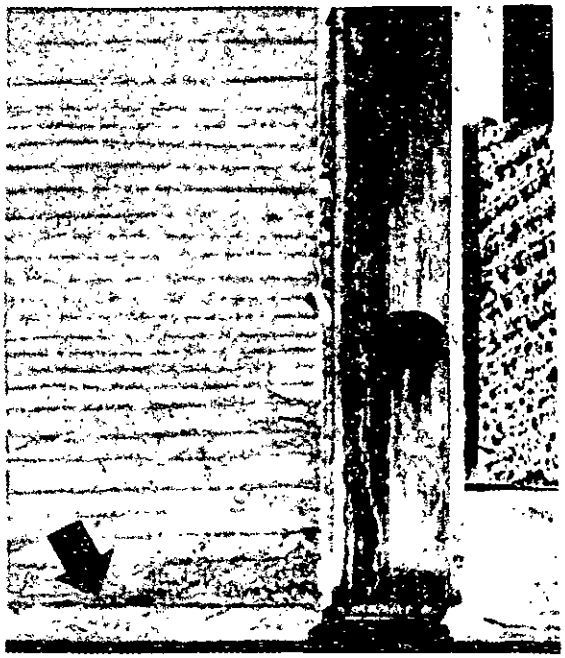

No. 36—NARROW BOTTOM. Minor. (Extending more than ¼" inside side.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

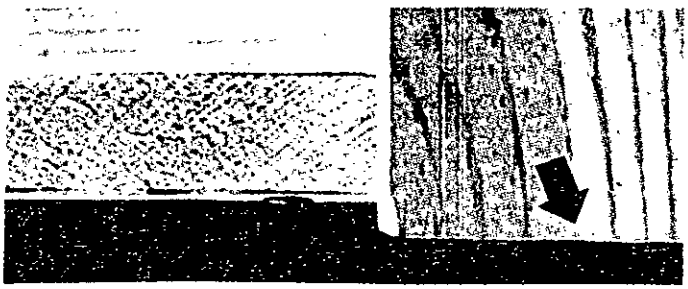


No. 37—LONG VERTICAL CLEAT. Minor. (Extending beyond bottom more than ⅛″.)

No. 38—SHORT VERTICAL CLEAT Minor. (Extending more than ¼″ inside bottom surface.)



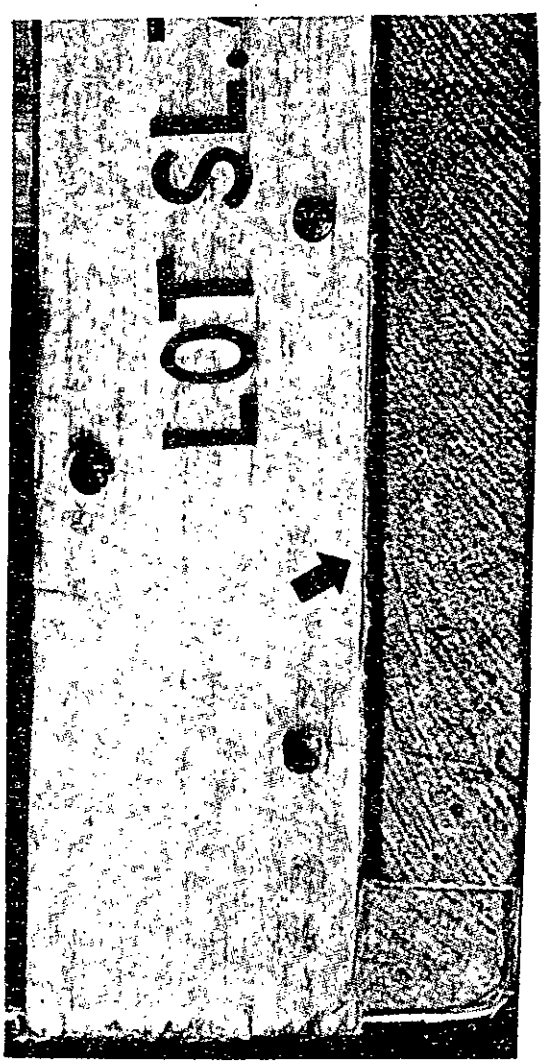

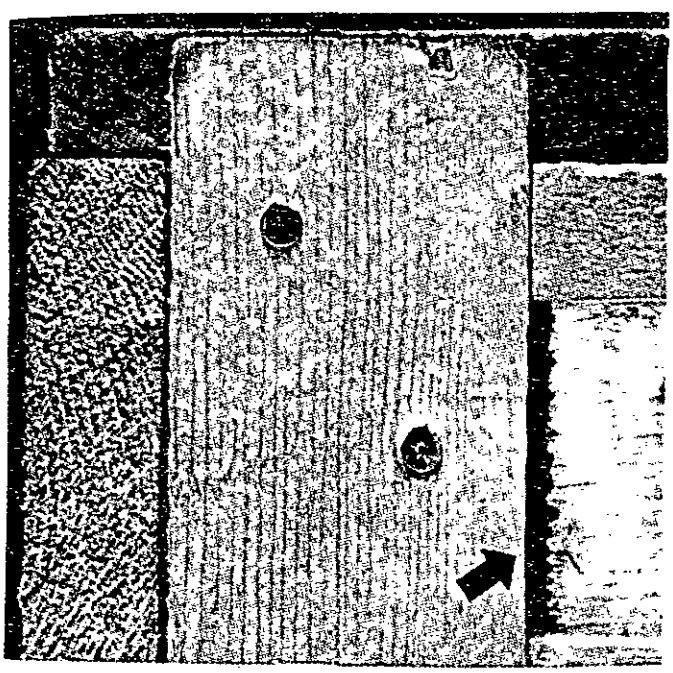

No. 40—GAP. Minor. (Space between horizontal and vertical cleat larger than ¼″.)

No. 39—GAP. Minor. (Space between side and vertical cleat larger than ⅛″.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

LIST OF DEFECTS

WIREBOUND WOOD BOXES

MATERIAL

No.	Defect	Pages
	Knots:	
1.	Tight knot larger than ⅓ width of board or 2½″ diameter, whichever is lesser	47–49
2.	Tight knot larger than ½ width of cleat or batten	49, 50
3.	Loose knot or knot hole larger than 1″ diameter in board	50, 51
4.	Loose knot or knot hole in cleat or batten	52
5.	Decay	53, 54
6.	(Not illustrated.)	
	Cross grain:	
7.	In face boards having slope greater than 1 in 6 (except grain structure surrounding knots)	55
8.	In cleats and battens having slope greater than 1 in 8 (except grain structure surrounding knots)	56
	Splits:	
9.	Forming a sliver at the outside edge of a board	57
10.	Forming a cross break at the outside edge of a board	57
11.	Full length—more than one per narrow piece (4″ wide or less)	57
12.	Full length—more than two in a part	58, 59
13.	Partial—over ⅓ length but less than full length—more than three in a part	60
14.	Full length in cleat or batten	61
15.	Shake or soft spots	62
	Broken board:	
16.	Broken or split off for full length or width of piece	63
17.	Broken or split off more than ⅓ length or width of piece but less than full length or width	63
	Wire:	
18.	Untreated binding or stapling	64
19.	Prong of loop fastener not driven through board and clinched	64
20.	Any broken, missing or unsatisfactorily spliced	65, 66
21.	Loose at corner of box	66
22.	Short loop preventing closing of box	66

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.


WORKMANSHIP AND ASSEMBLY

No.	Defect	Pages
	Stapling or nailing:	
23.	Protruding point	67, 68
24.	More than two binding wire staples missing, broken or poorly driven (one leg of staple not driven into board) per wire	69
25.	More than one batten staple missing or head protruding (per batten)	70
26.	More than one batten nail missing or head protruding (per batten)	71
	Wood parts:	
27.	Missing cleat or batten	72
28.	Overlapping boards	73

DEFECTS APPLICABLE TO PACKED AMMUNITION ONLY


29.	Unfastened outside binding wire	74
30.	Unfastened inside binding wire	74
31.	Missing end	74
32.	Side, top or bottom extending beyond end cleat more than ⅛"	75
33.	End cleat extending beyond side, top or bottom more than ⅛"	75
34.	Gap larger than ¼" between end of batten and cleat	76
35.	Gap larger than ¼" between side of batten and cleat	76
36.	Gap larger than ¼" between diagonal ends of more than one pair of cleats per box	77
37.	Reversed or inverted end	78
38.	Missing seal	78
39.	Incorrectly attached seal	78

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

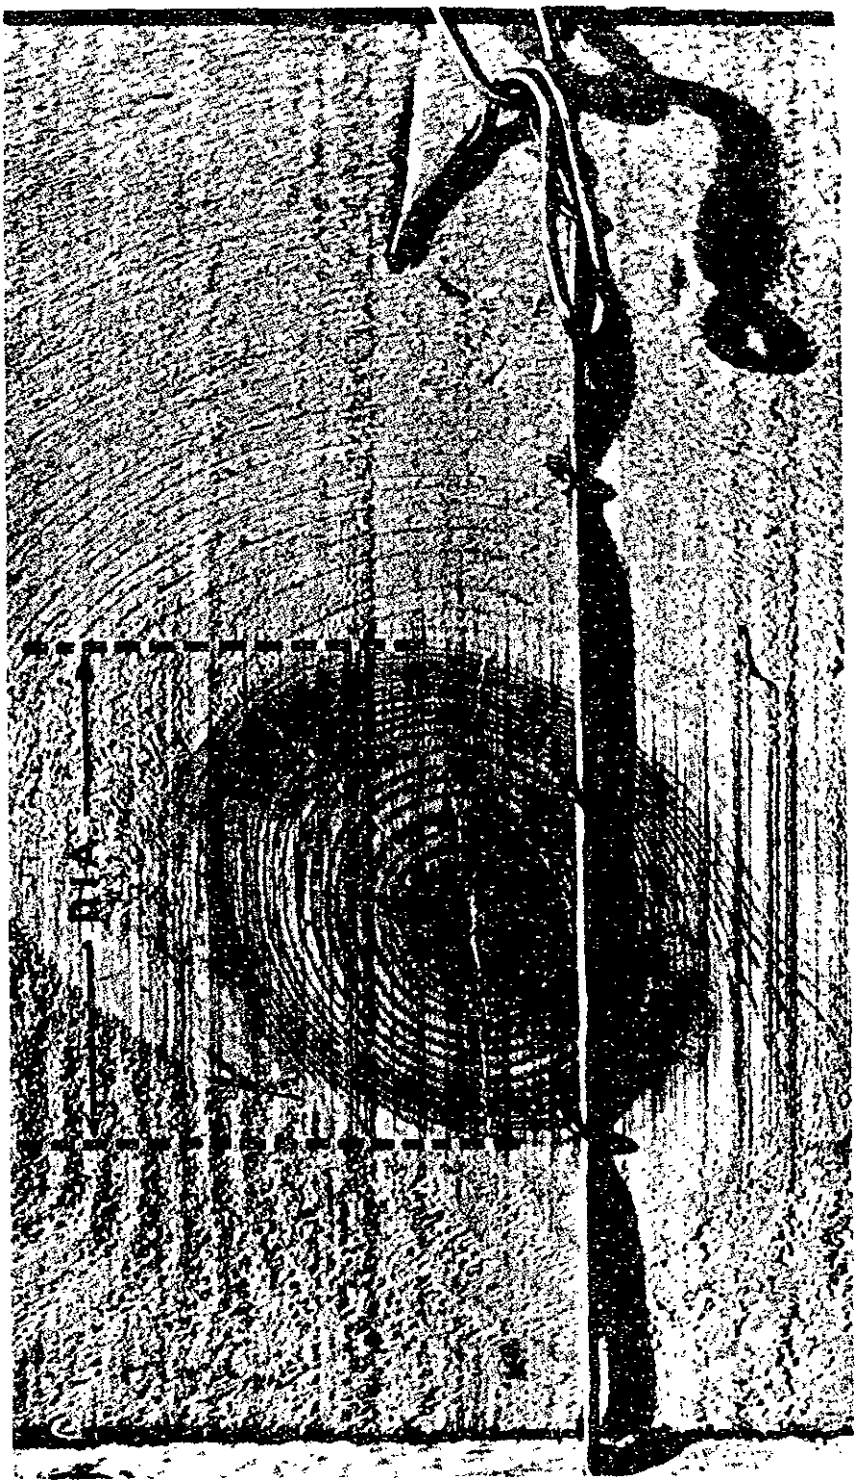


No. 1—TIGHT KNOT. Minor. (Greater than ⅓ width of board or 2½" diameter, whichever is lesser.)

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

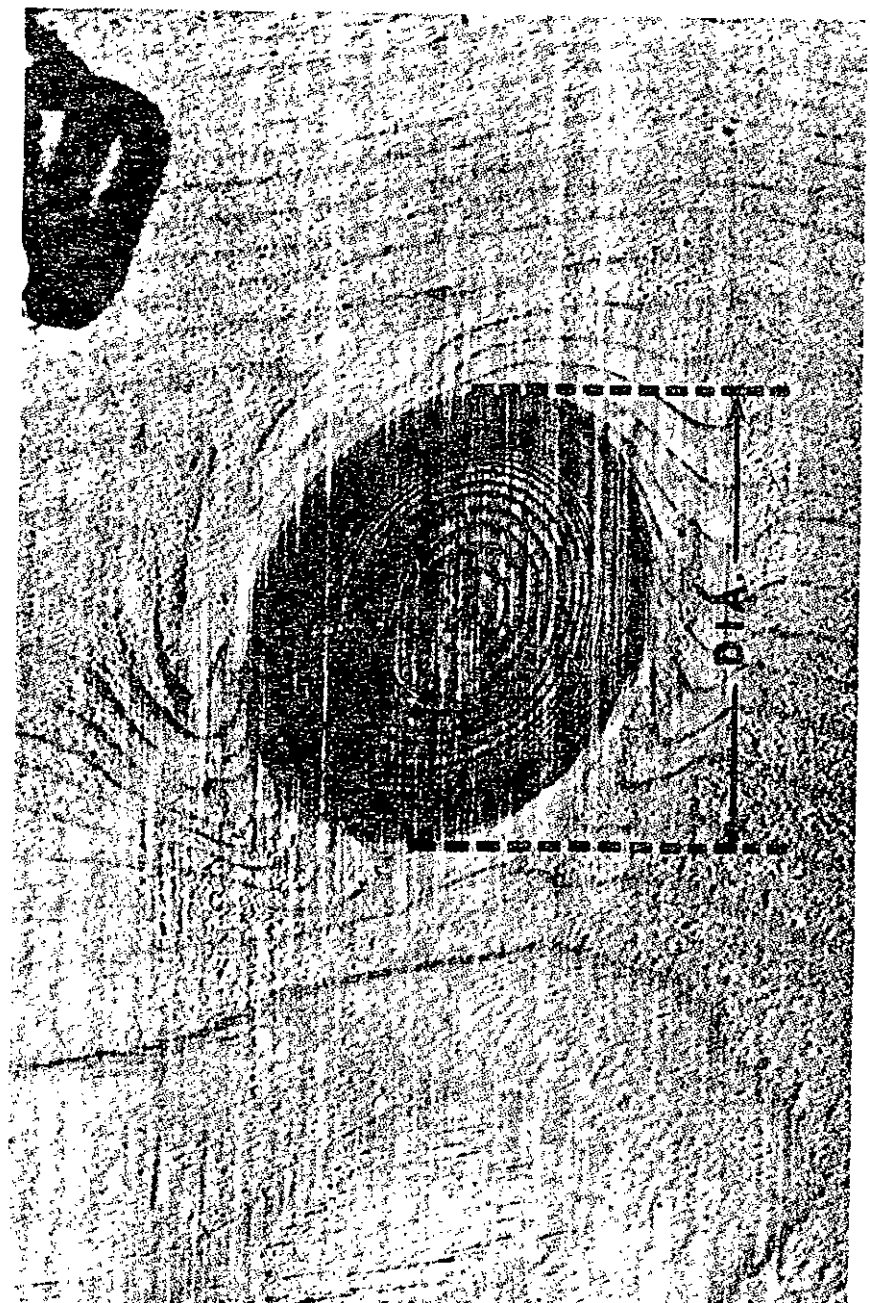


No. 1—TIGHT KNOT. Permissible. (Equal to or less than ⅓ width of board or 2½" diameter, whichever is applicable.)

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

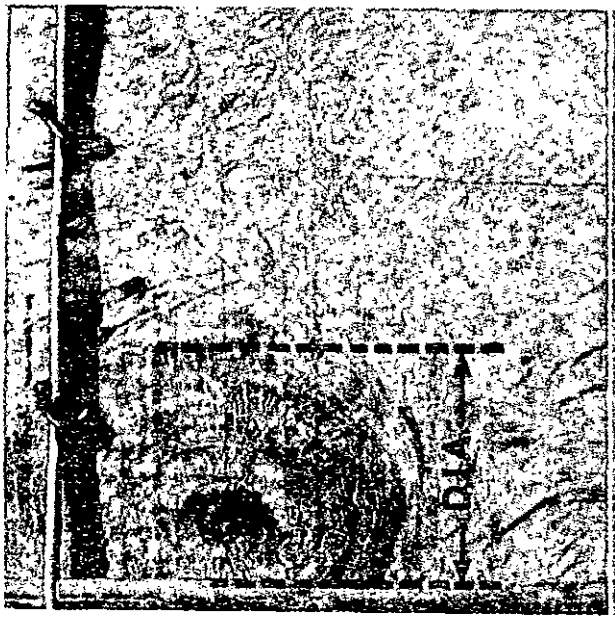


No. 1—TIGHT KNOT. Minor. (Greater than ⅓ width of board or 2½" diameter, whichever is lesser.)

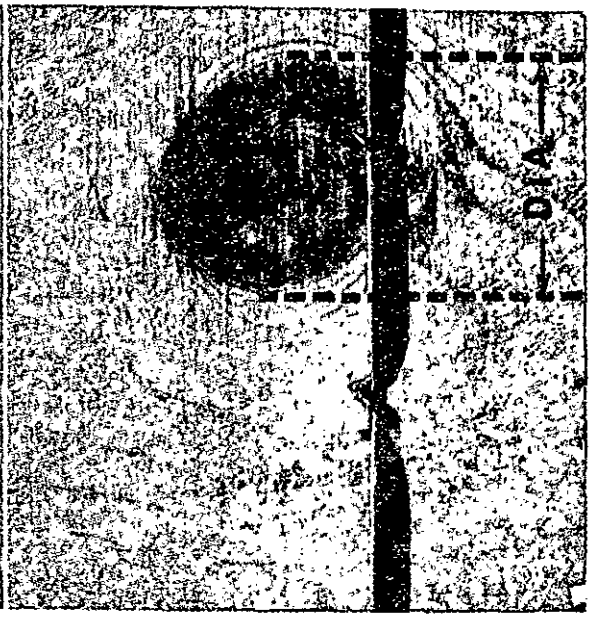

No. 1—TIGHT KNOT. Permissible. (Equal to or less than ⅓ width of board or 2½" diameter, whichever is applicable.)



No. 2—TIGHT KNOT. Major. (Diameter greater than ½ width of cleat.)

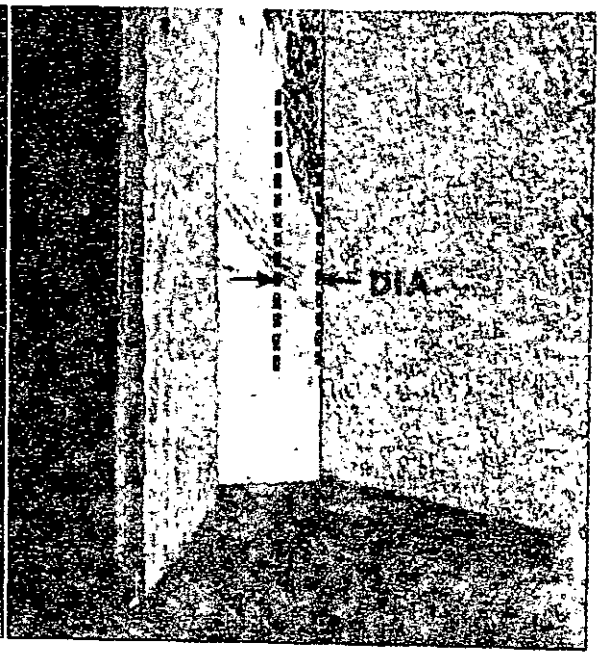


No. 2—TIGHT KNOT. Permissible. (Diameter less than ½ width of cleat.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 2—TIGHT KNOT. Major. (Diameter greater than ½ width of batten.)

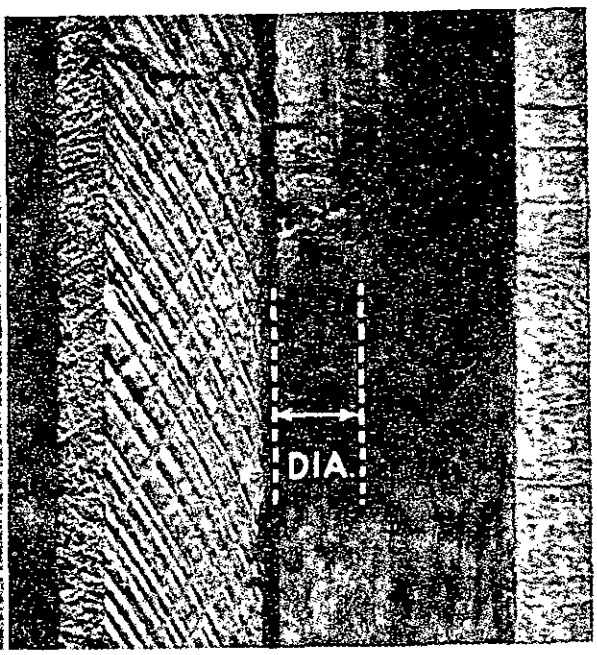

No. 2—TIGHT KNOT. Permissible. (Diameter less than ½ width of batten.)

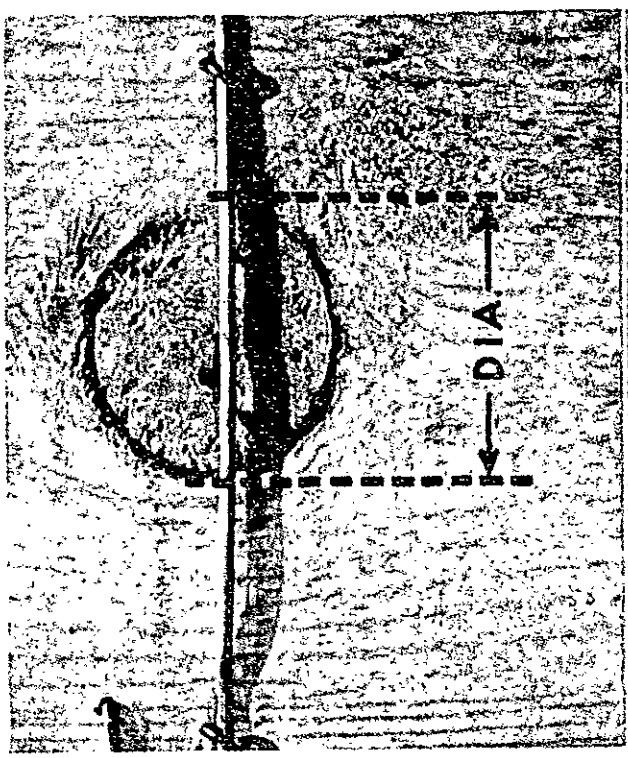


No. 3—LOOSE KNOT. Minor. (Larger than 1" diameter in board.)

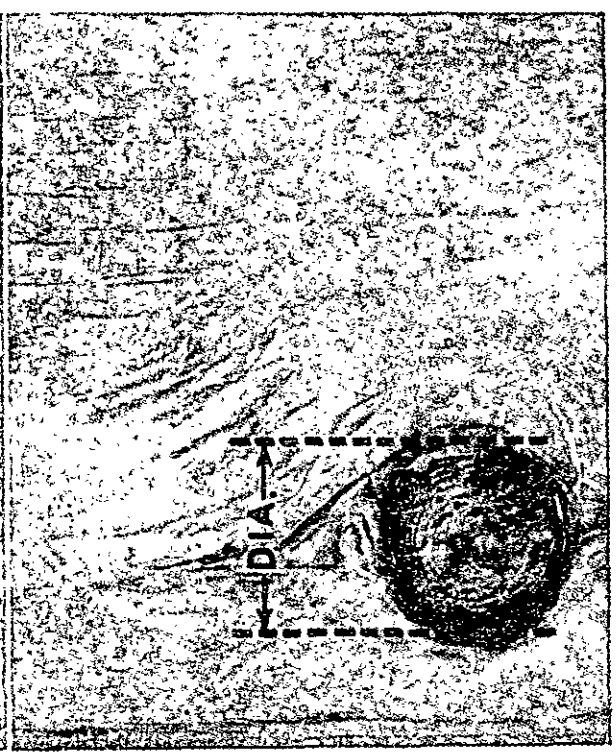


No. 3—LOOSE KNOT. Permissible. (Smaller than 1" diameter in board.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

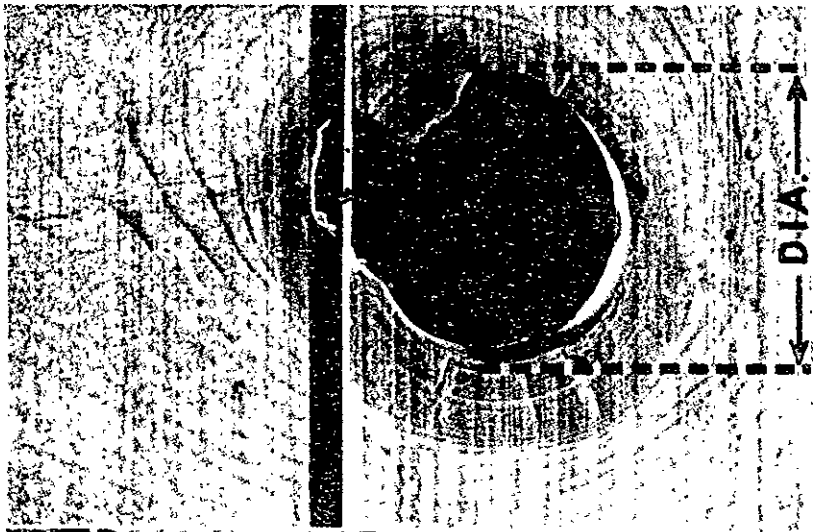

No. 3—KNOT HOLE. Minor. (Larger than 1" diameter in board.)

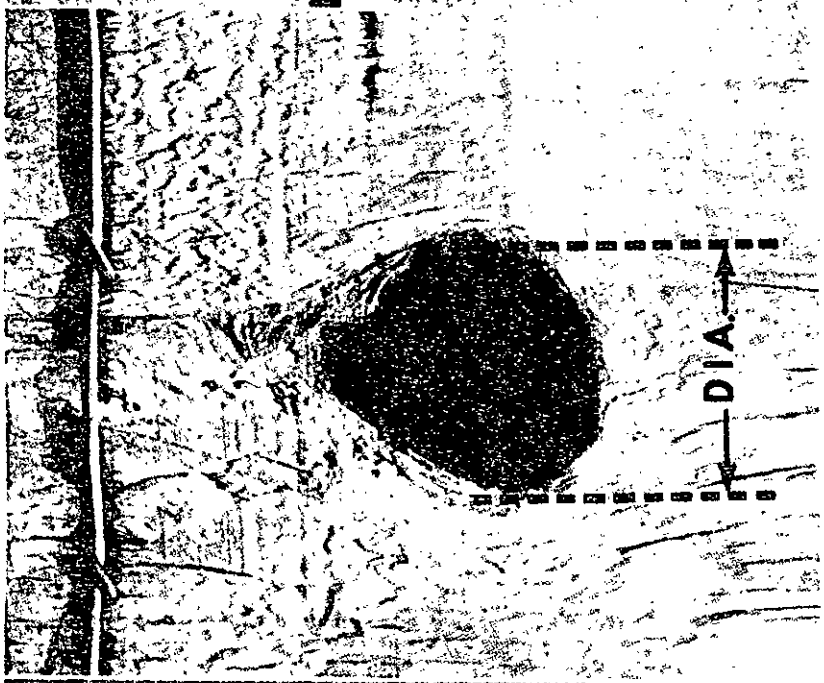


No. 3—KNOT HOLE. Minor. (Larger than 1" diameter in board.)

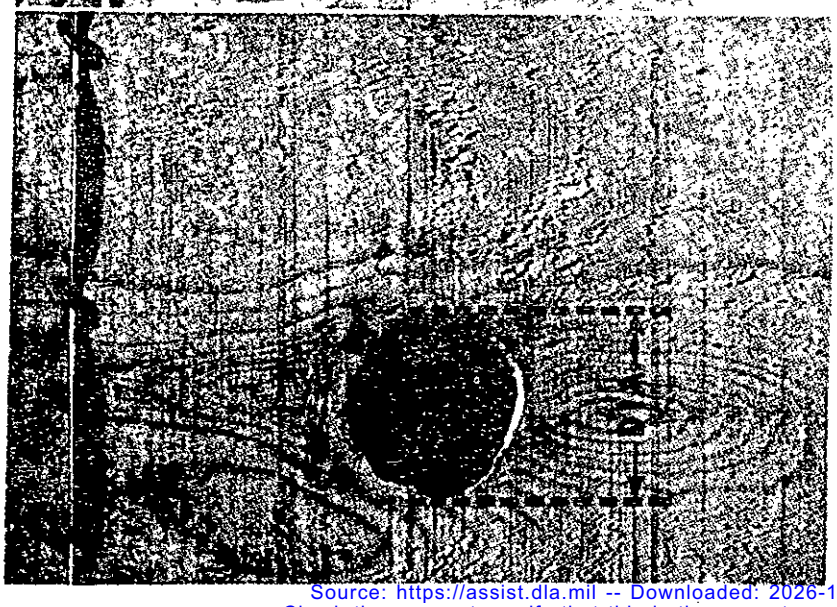


No. 3—KNOT HOLE. Permissible. (Smaller than 1" diameter in board.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

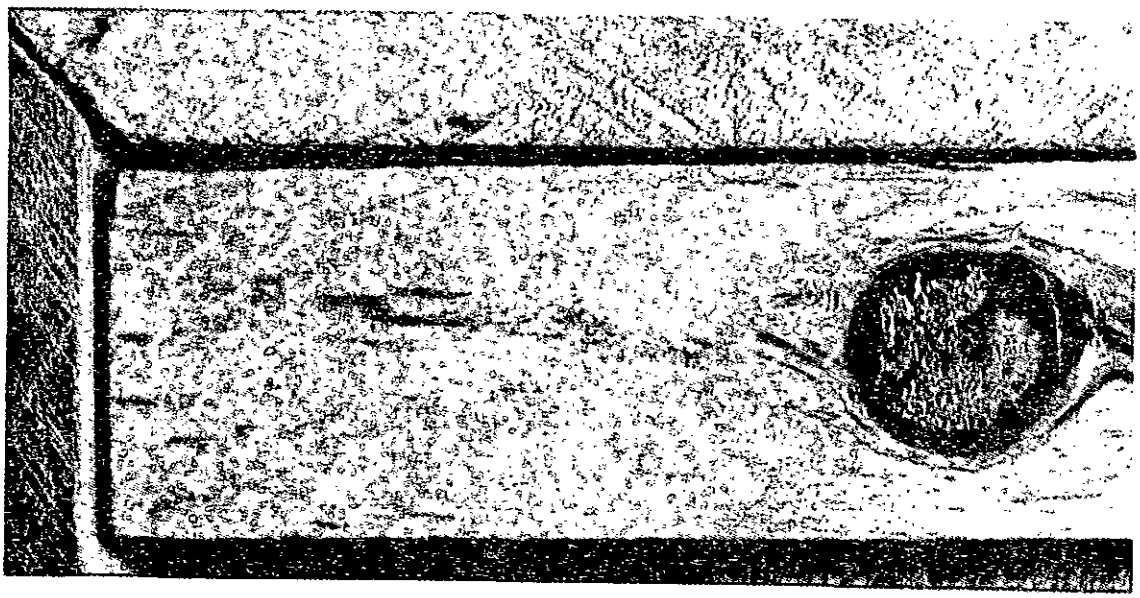


No. 4—LOOSE KNOT IN CLEAT OR BATTEN. Major.

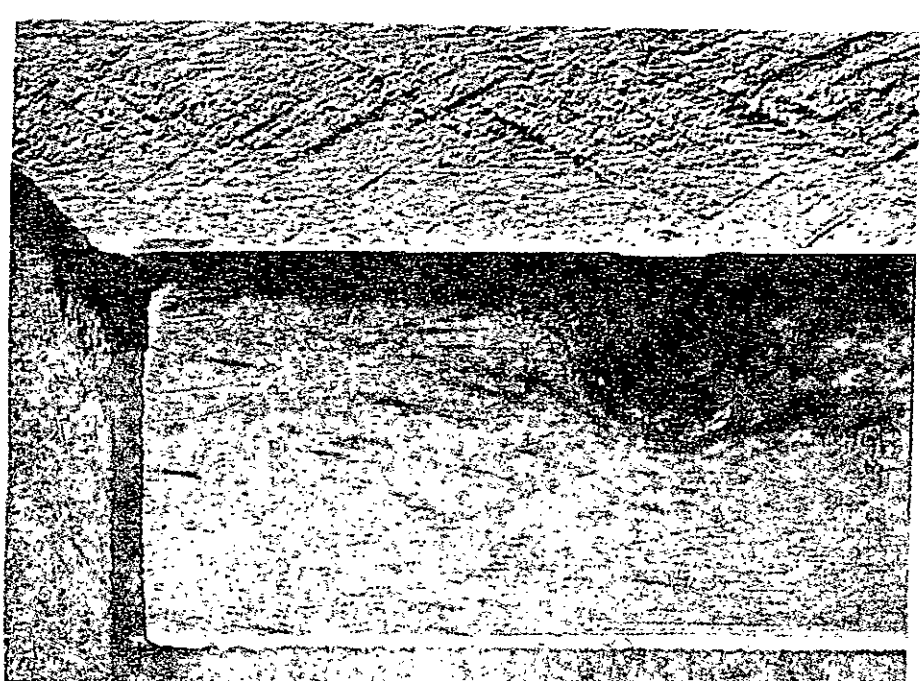


No. 4—KNOT HOLE IN CLEAT OR BATTEN. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

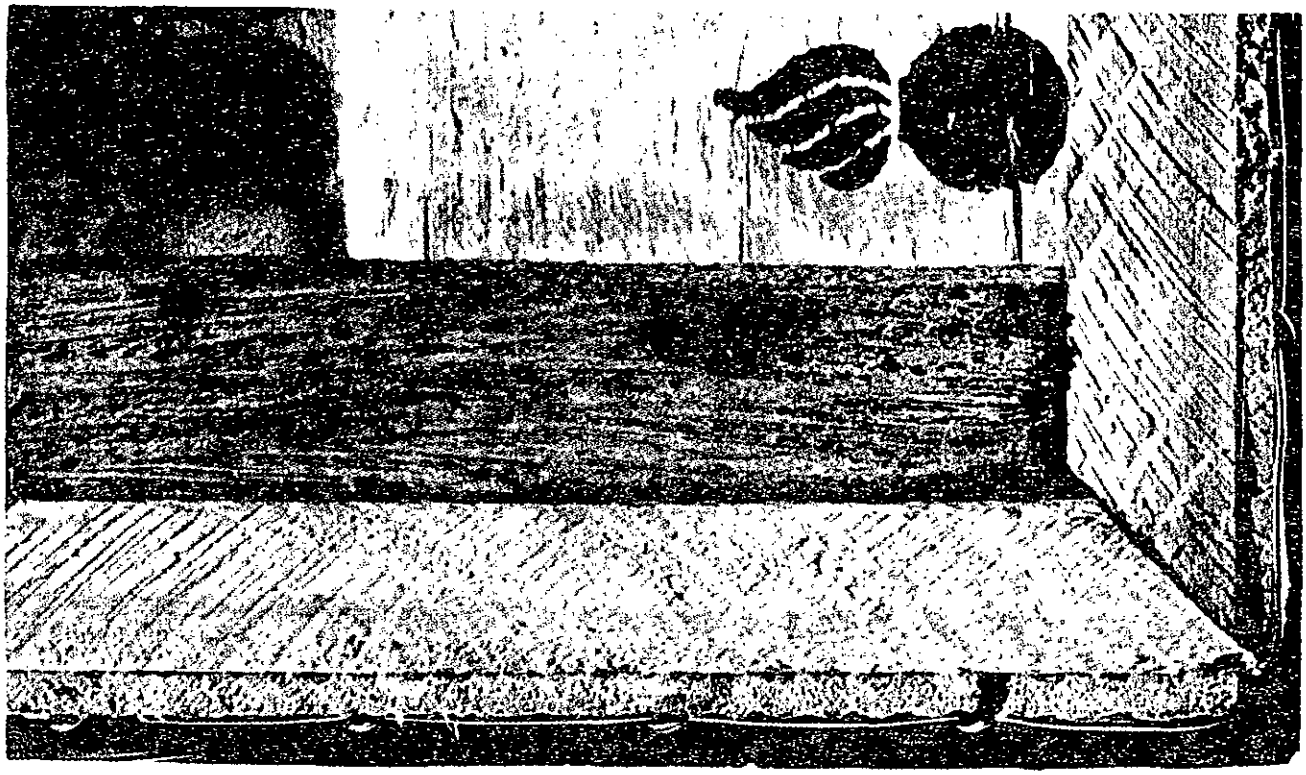


No. 5—DECAY. Major.

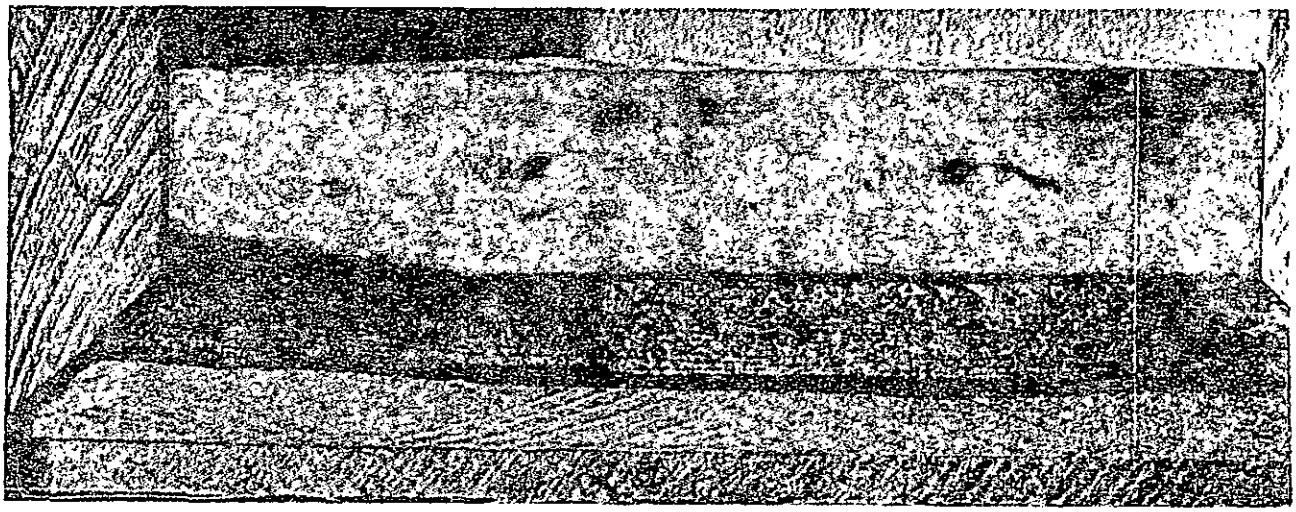


No. 5—DECAY. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

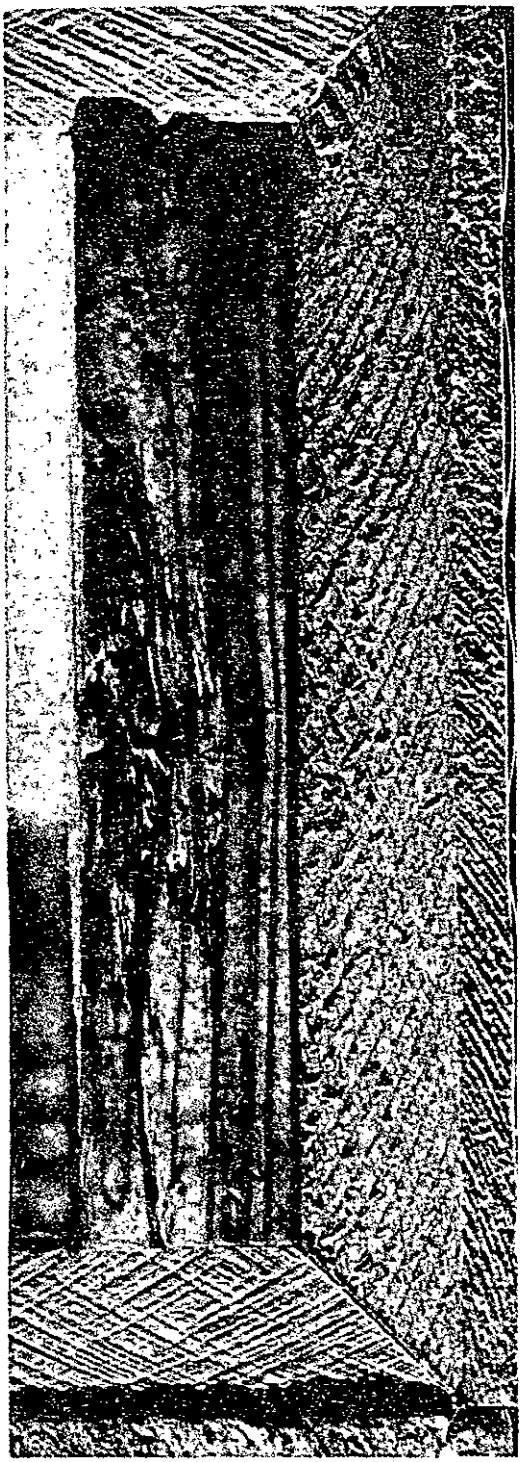


No. 5—DECAY. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

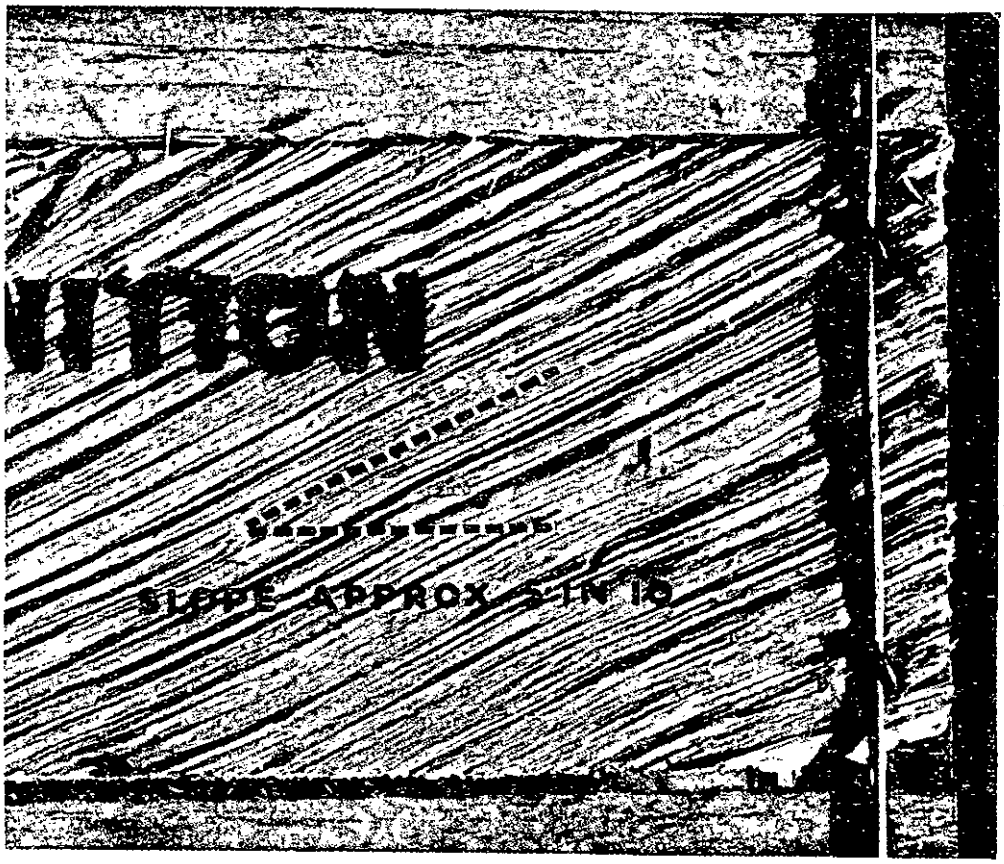


No. 7—CROSS GRAIN. Minor. (Slope greater than 1 in 6.)

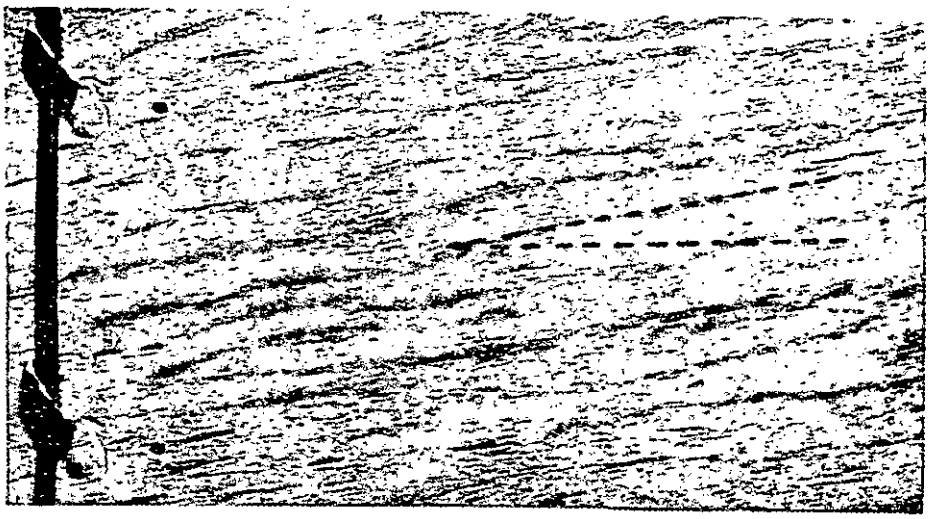


No. 7—CROSS GRAIN. Permissible. (Slope 1 in 6 or less.) Slope illustrated approximately 1 in 6.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

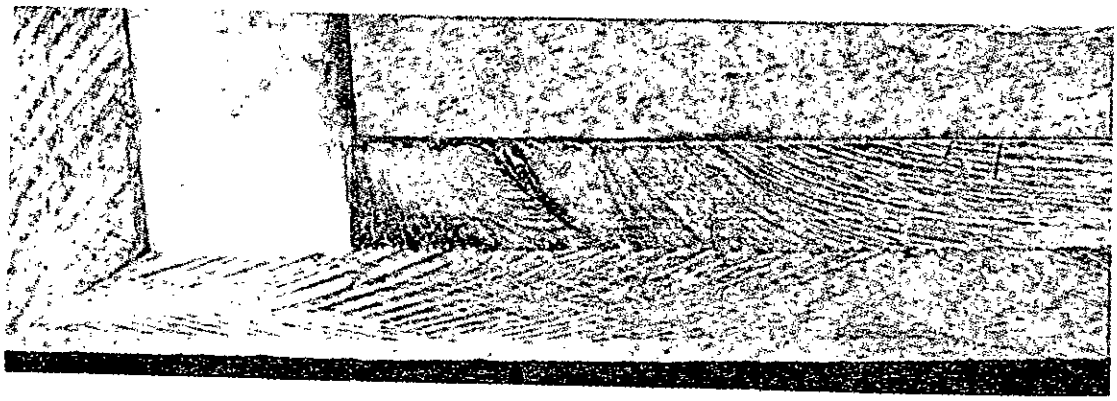


No. 8—CROSS GRAIN. Permissible. (Slope greater than 1 in 8 surrounding knot.)

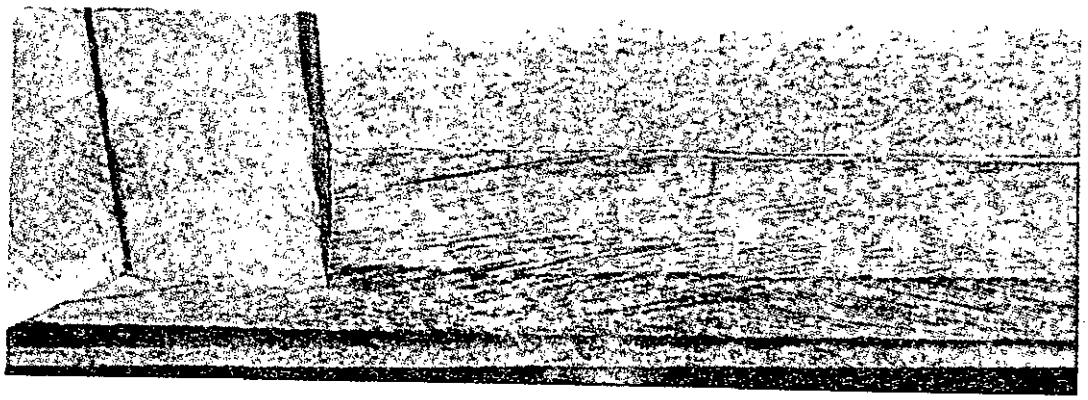

No. 8—CROSS GRAIN. Permissible. (Slope 1 in 8, or less.)

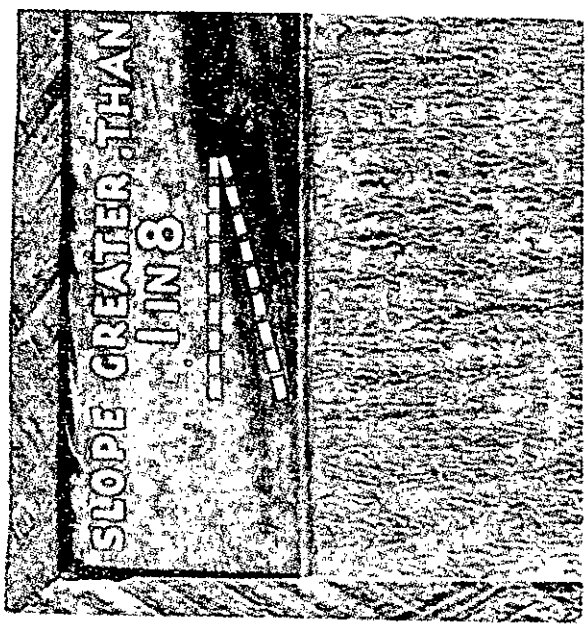

No. 8—CROSS GRAIN. Minor. (Slope greater than 1 in 8.)

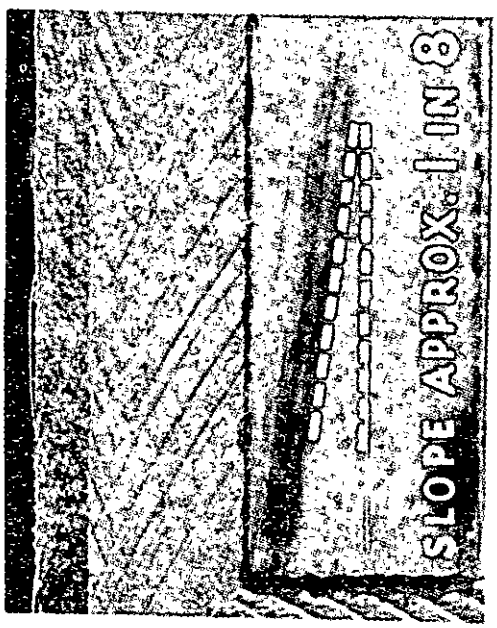


No. 8—CROSS GRAIN. Permissible. (Slope 1 in 8, or less.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.



No. 9—SPLIT. Major. (Forms sliver at outside edge.)

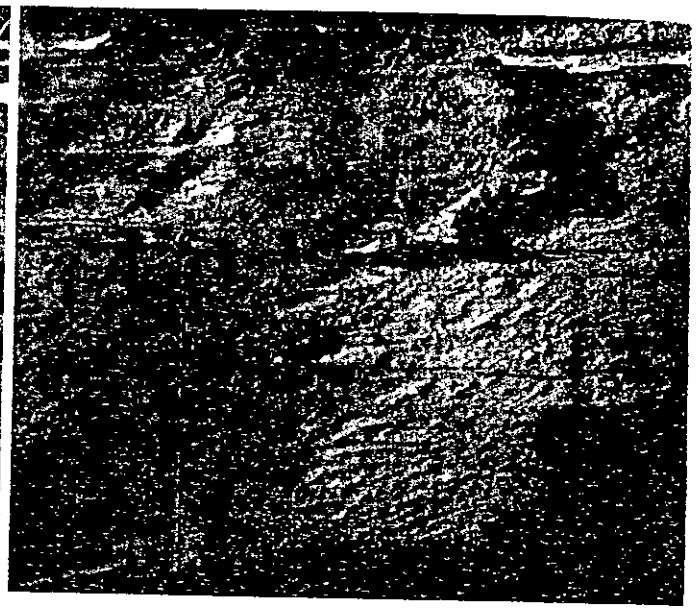

No. 10—SPLIT. Minor. (Forms a cross break at outside edge.)

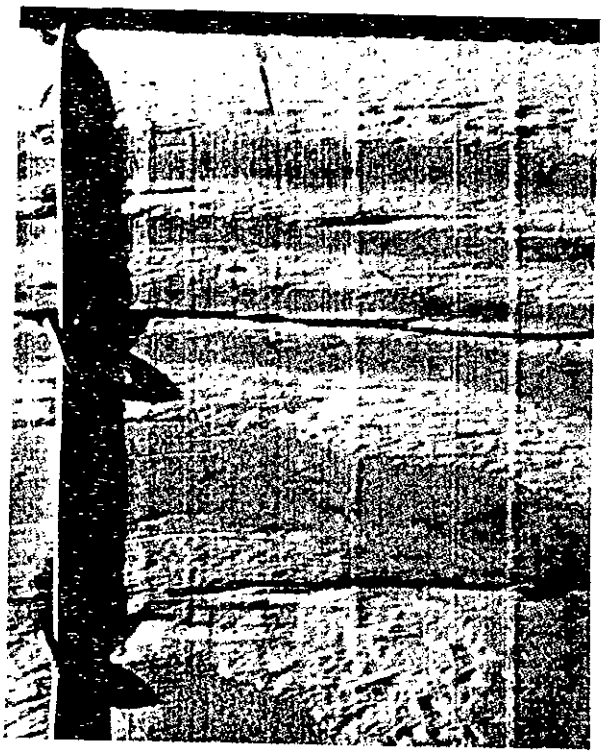


No. 11—FULL LENGTH SPLITS. Minor. (More than one in a narrow piece 4" wide or less.)




No. 11—FULL LENGTH SPLIT. Permissible. (Only one in a narrow piece 4" wide or less.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

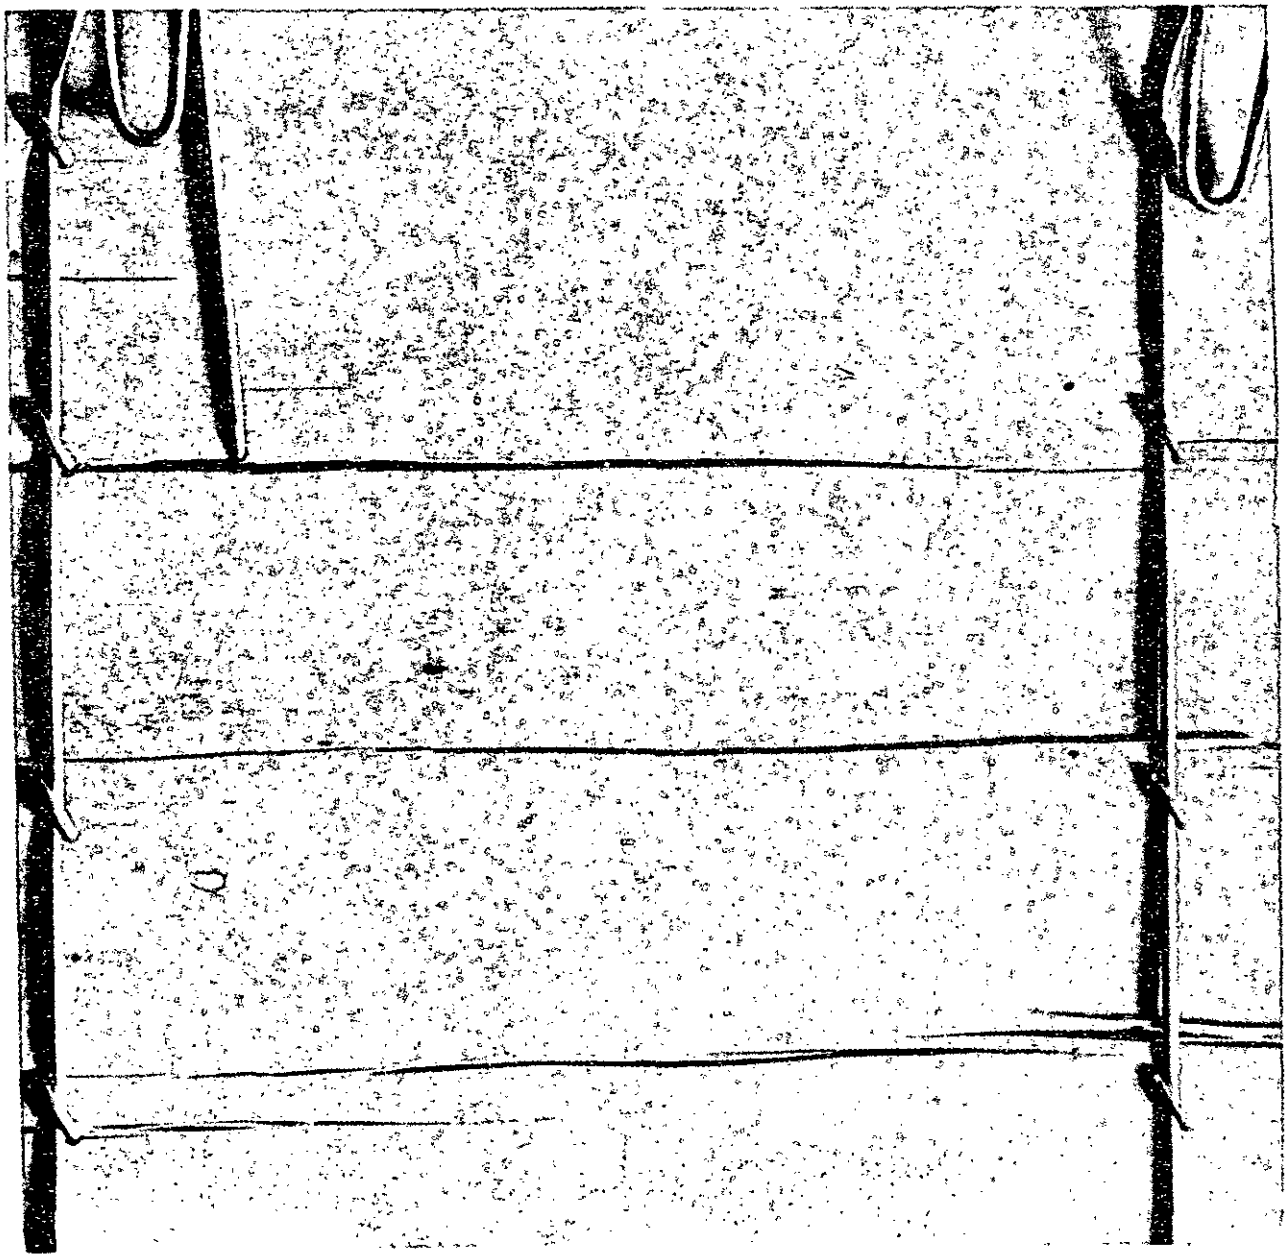


No. 12—FULL LENGTH SPLITS. Minor. (More than two in a part. *Note.*—A part assembled with narrow pieces having splits totalling more than two would also be defective.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

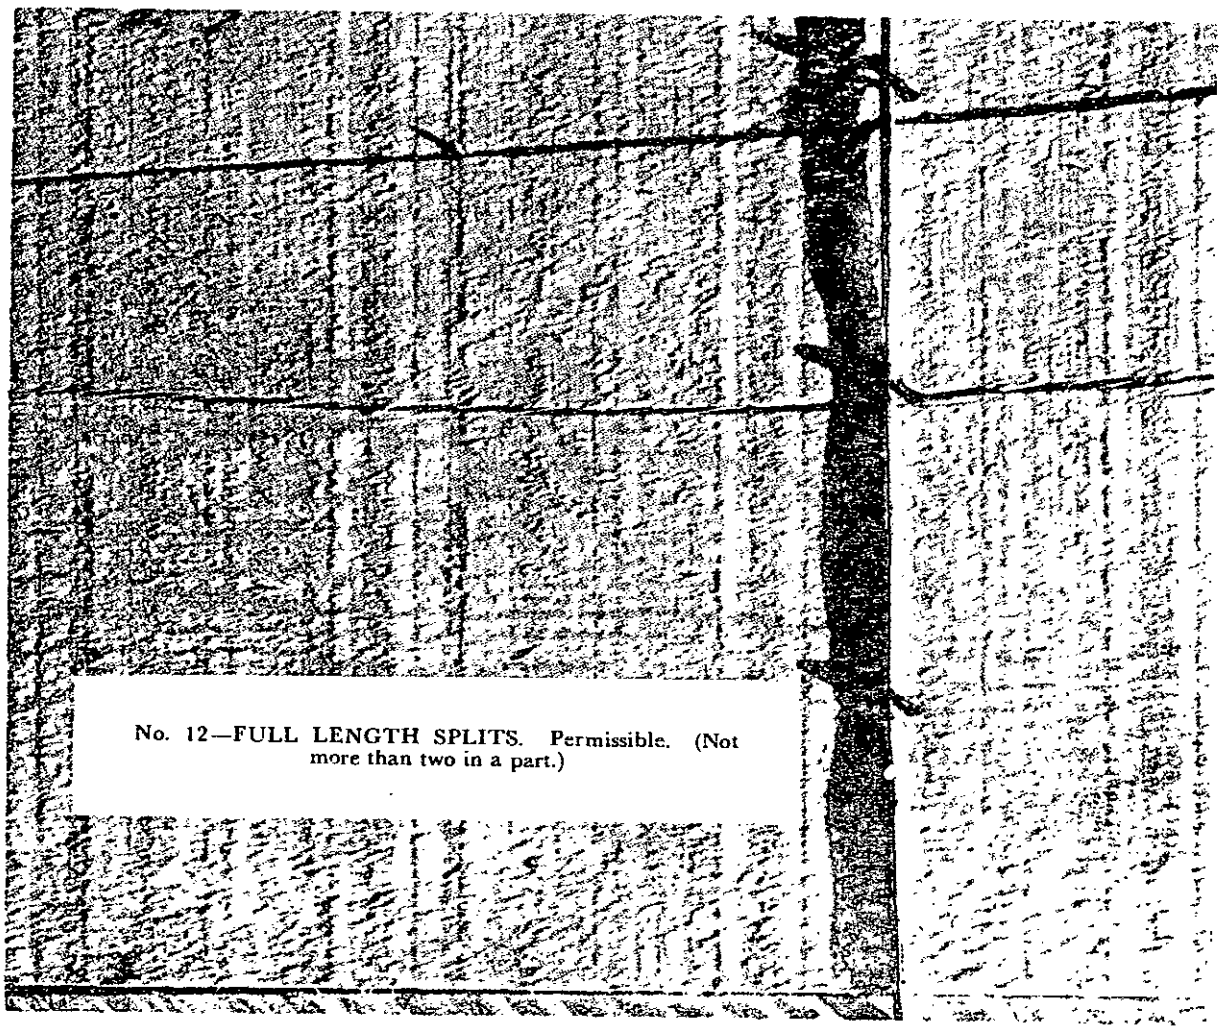


No. 12—FULL LENGTH SPLITS. Permissible. (Not more than two in a part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

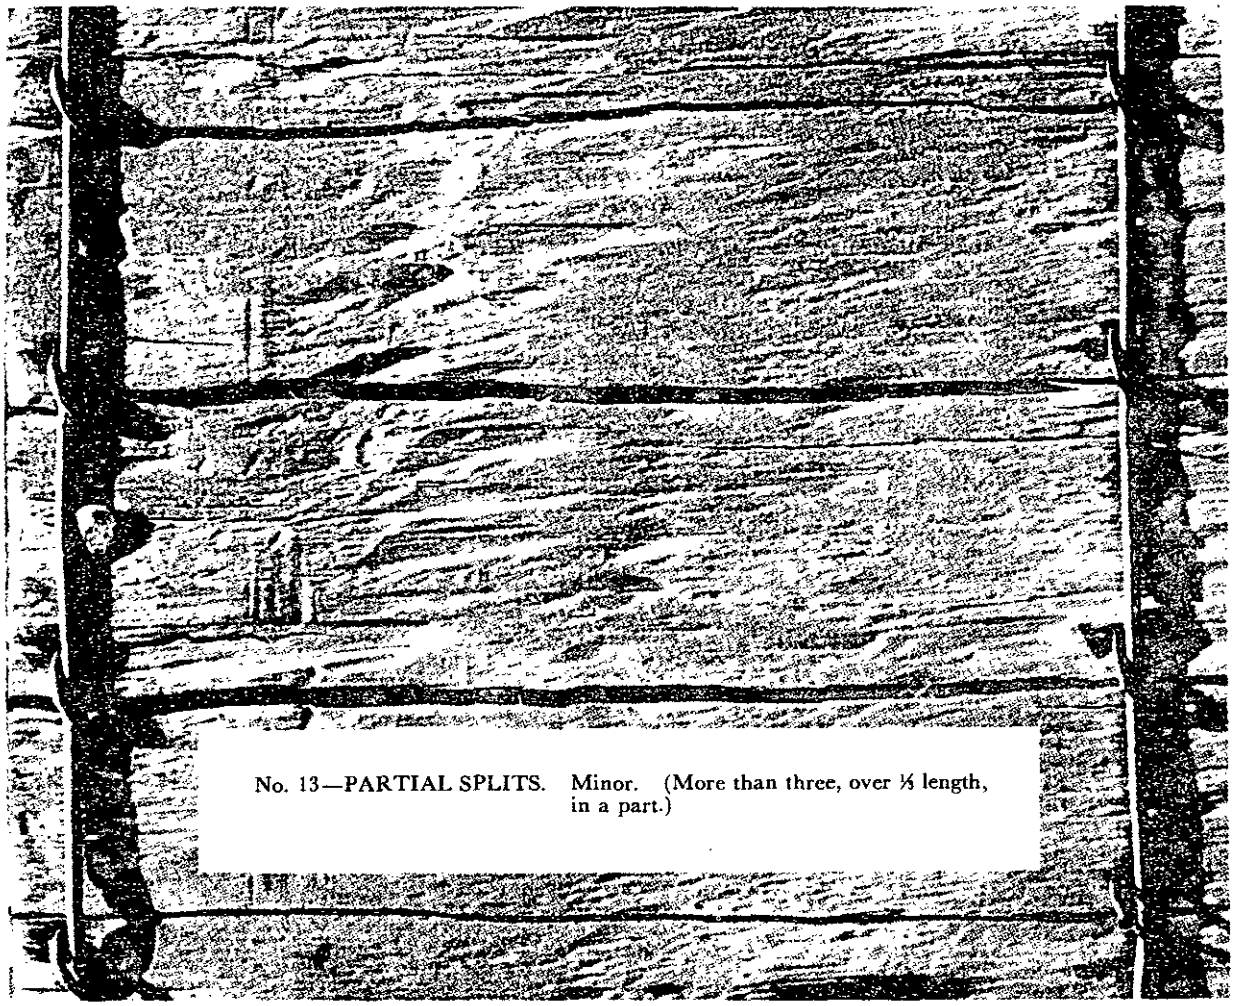


No. 13—PARTIAL SPLITS. Minor. (More than three, over ⅓ length, in a part.)

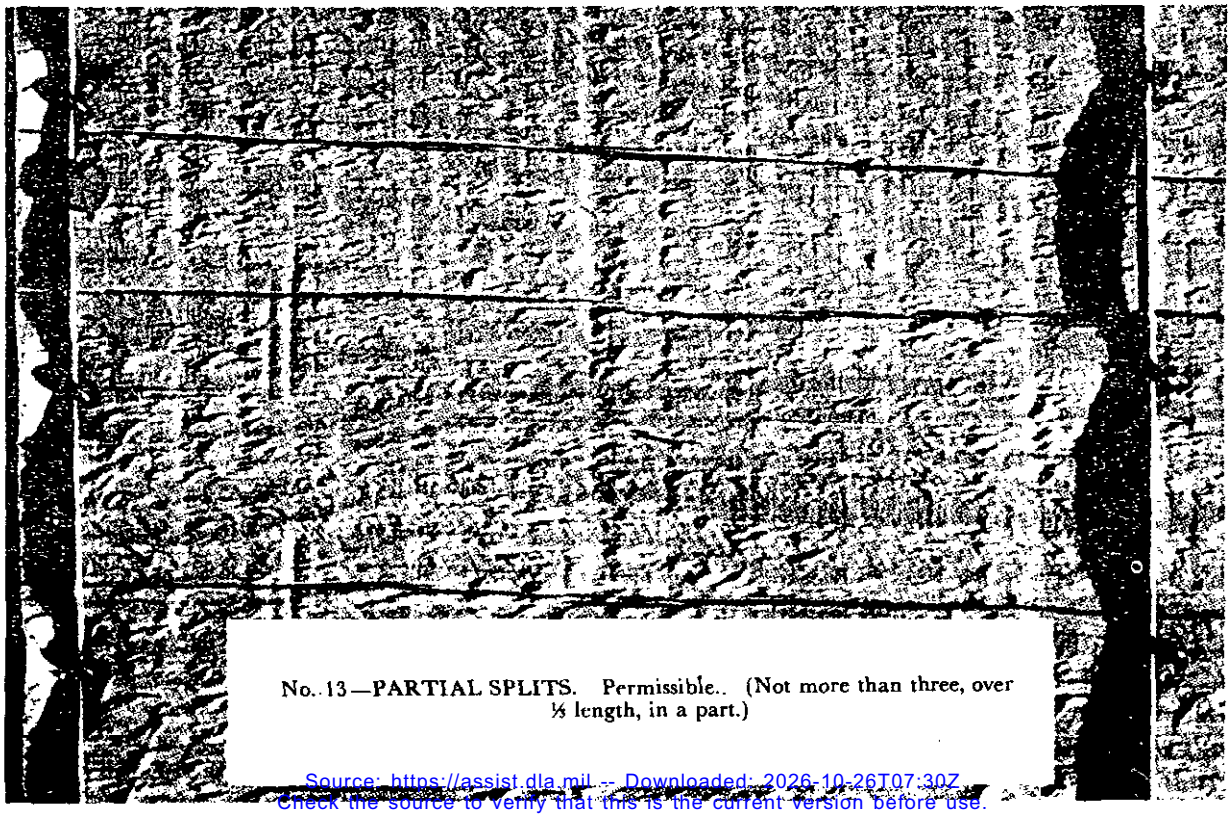


No. 13—PARTIAL SPLITS. Permissible.. (Not more than three, over ⅓ length, in a part.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

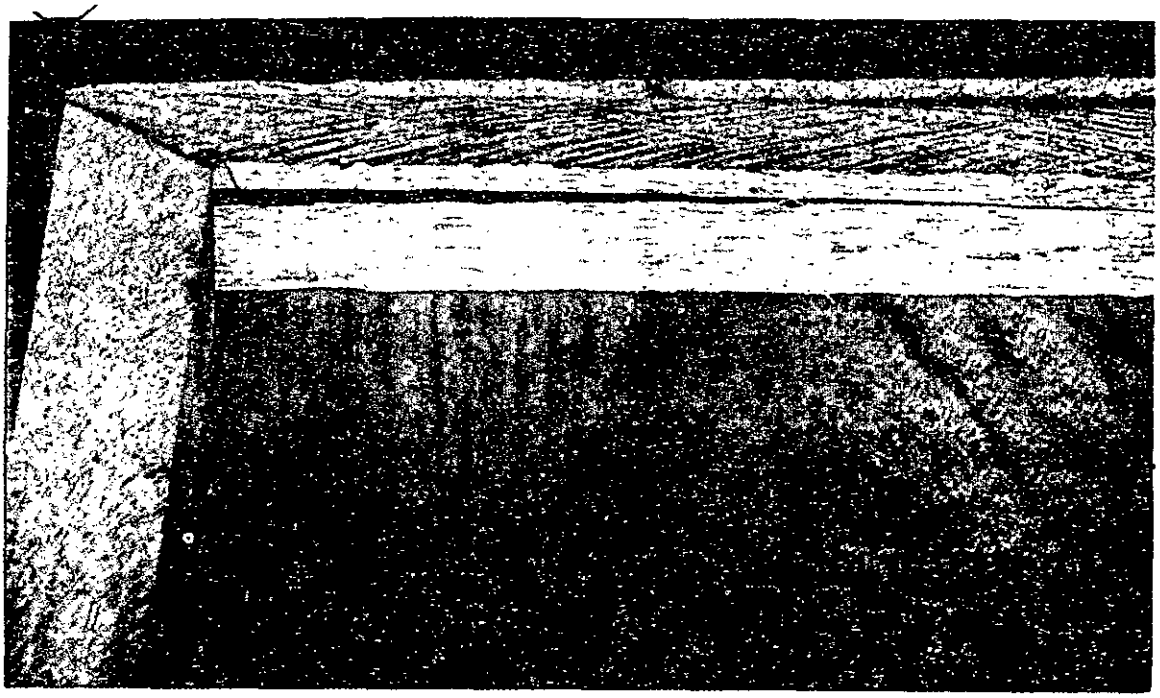


No. 14—SPLIT CLEAT. Major.

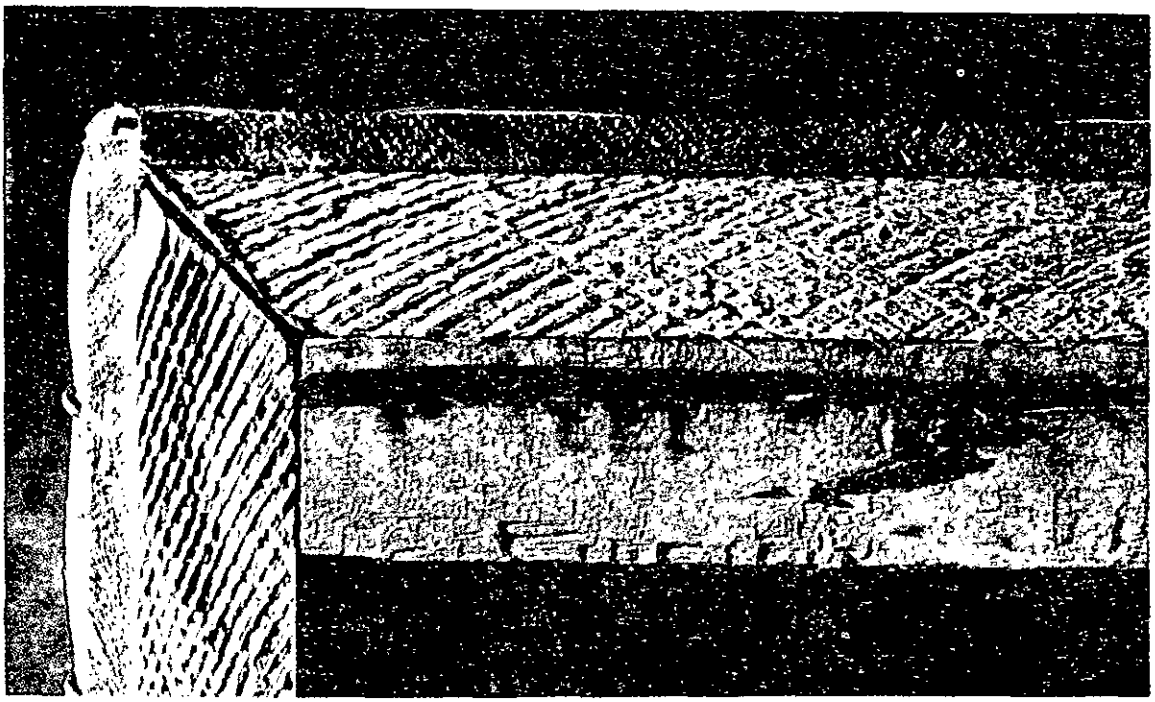


No. 14—SPLIT BATTEN. Major.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

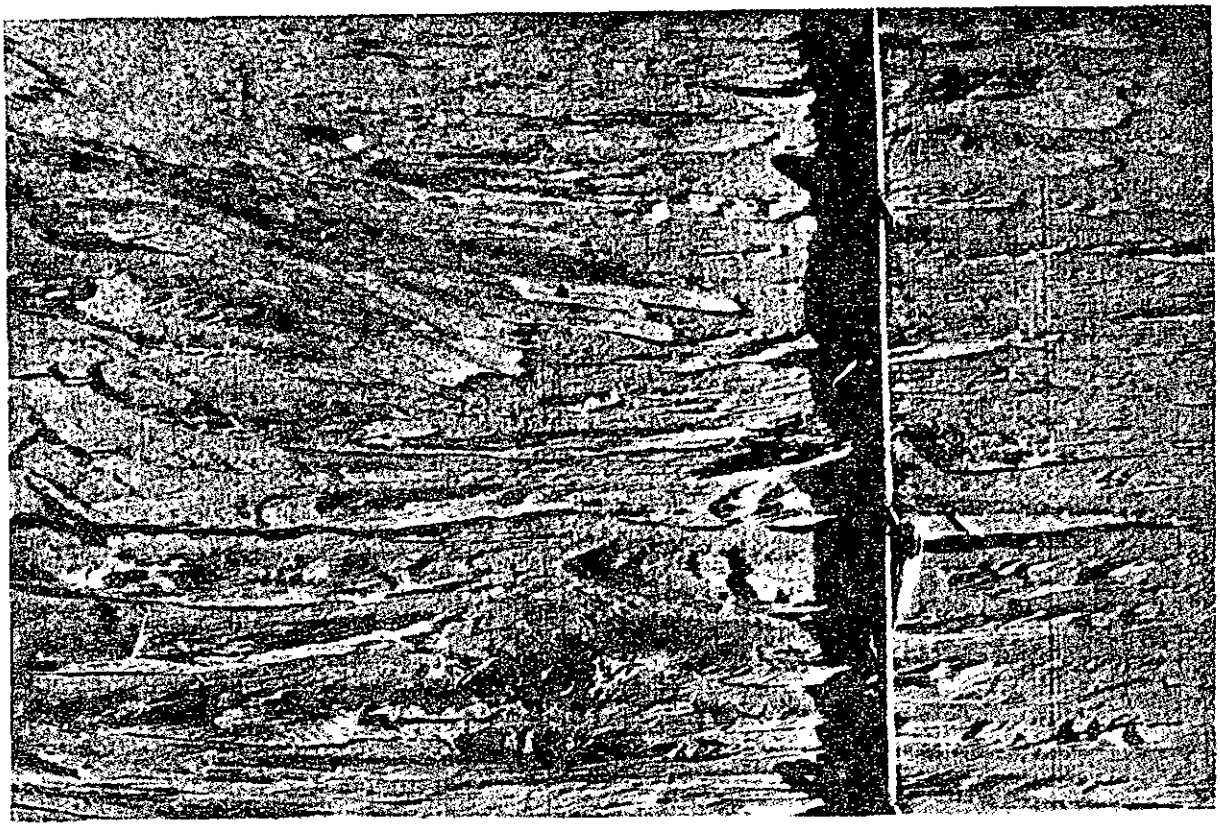


No. 15—SHAKE. Minor.

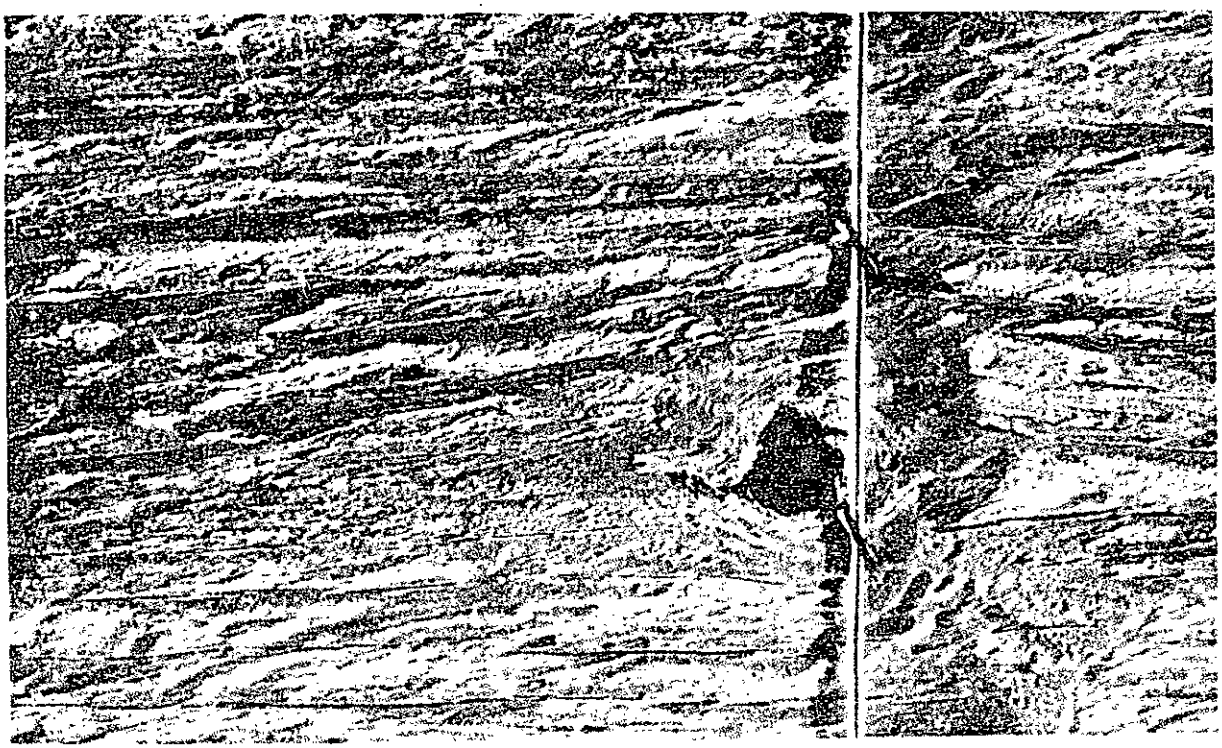


No. 15. SOFT SPOT. Minor.

Source: https://assist.dla.mil Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

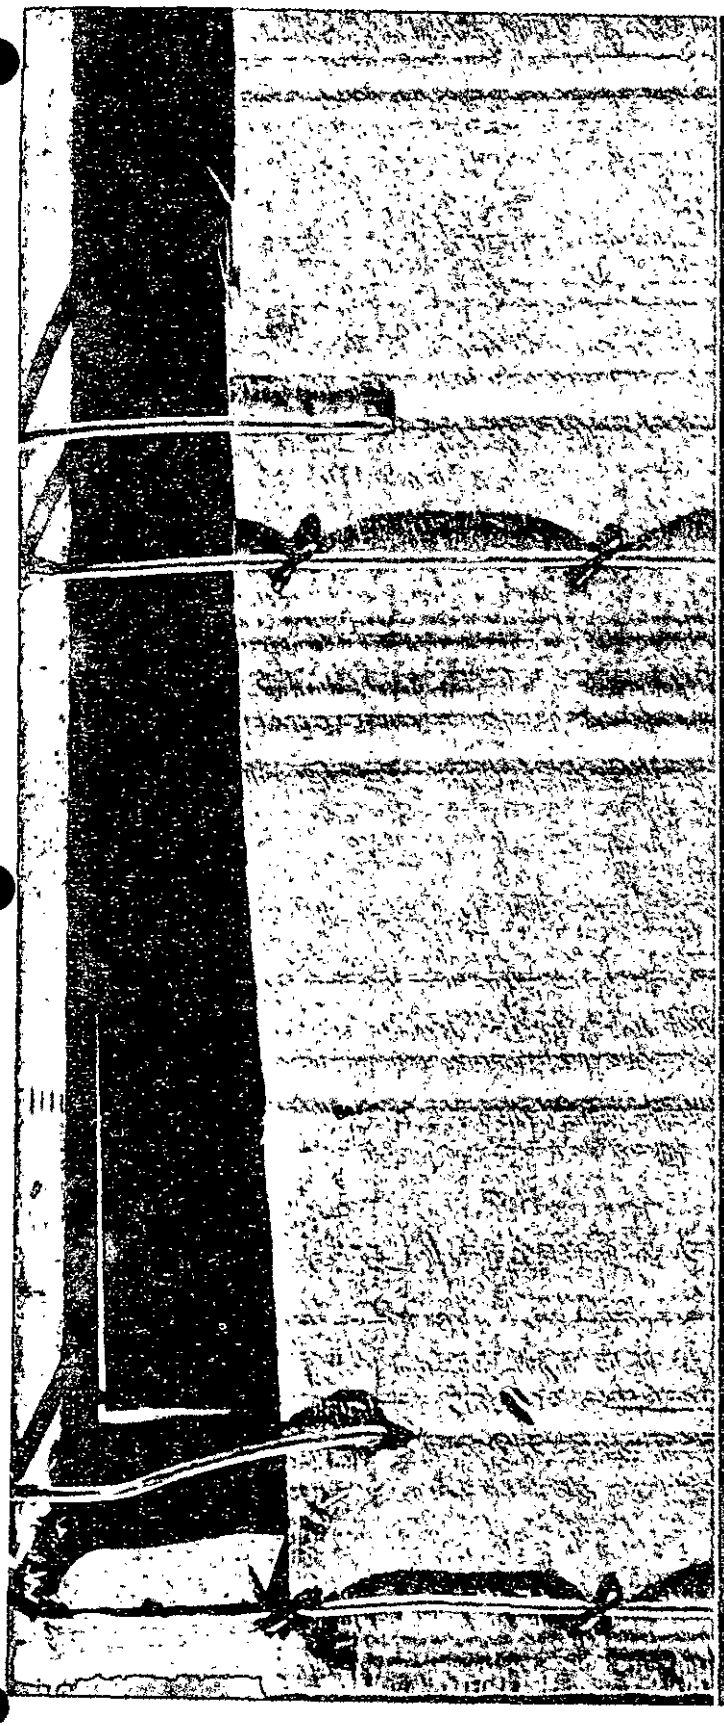


No. 16—BROKEN BOARD. Major. (Board is broken for full length of piece.)

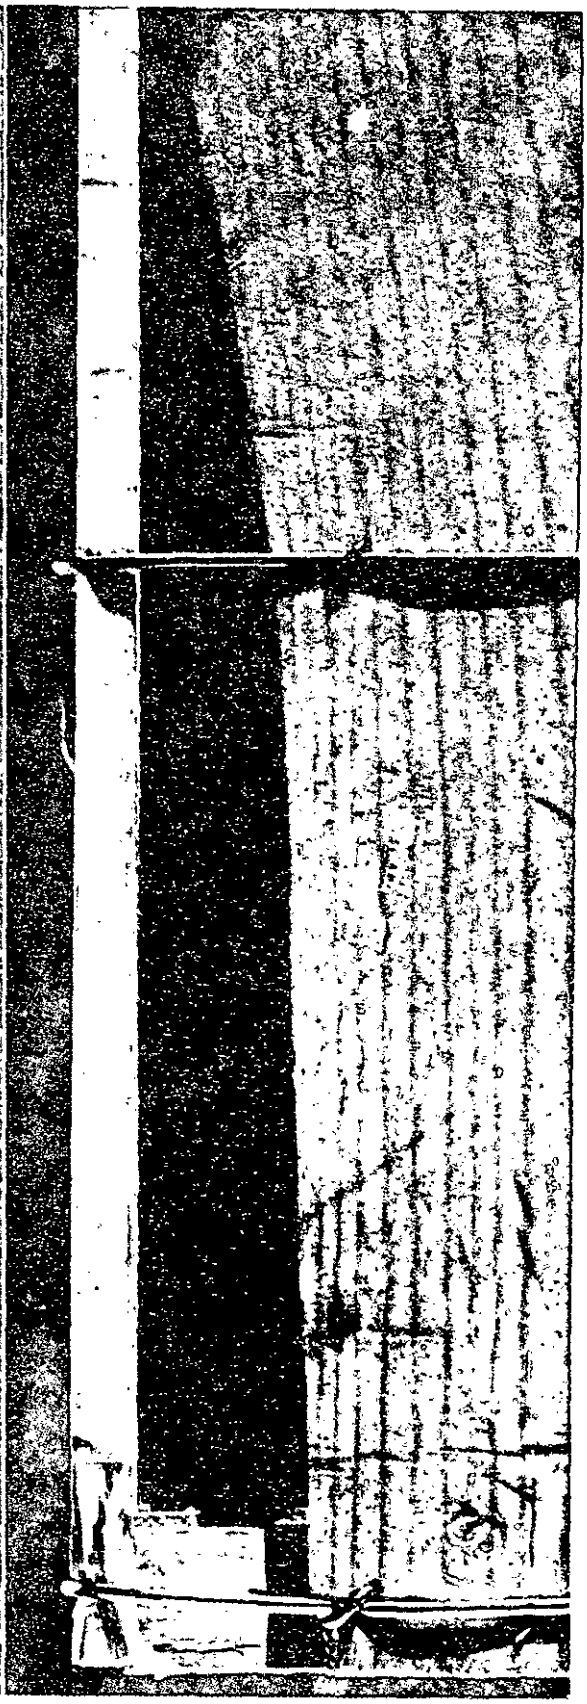


No. 17—BROKEN BOARD. Minor. (Board is broken for more than ⅛ length but less than full length of piece.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

No. 18—UNTREATED BINDING WIRE OR STAPLES. Minor. (*Not illustrated.* Galvanizing required.)

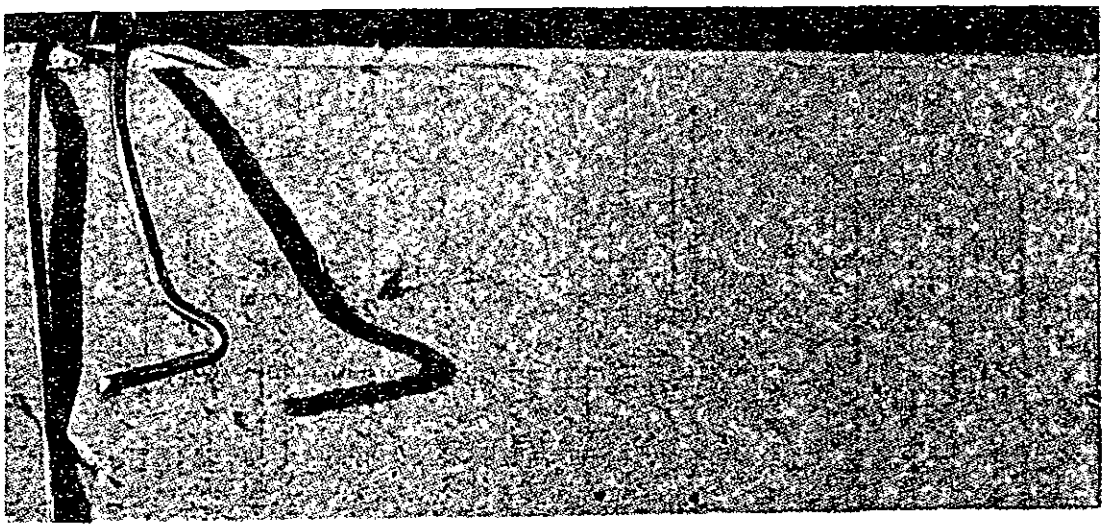


No. 19—PRONG OF LOOP FASTENER NOT DRIVEN THROUGH AND CLINCHED. Major.

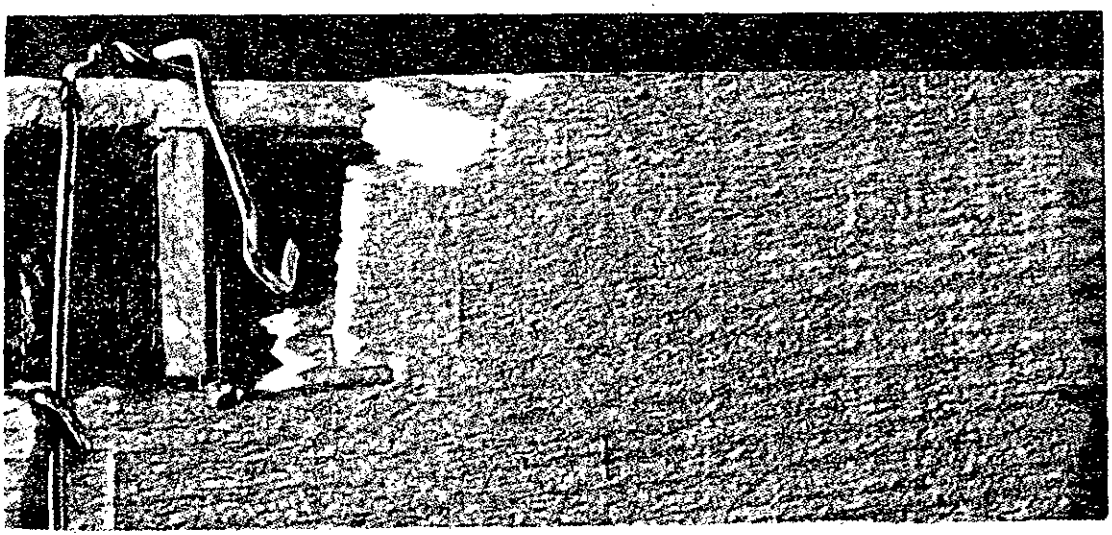


No. 19—PRONG OF LOOP FASTENER NOT DRIVEN THROUGH BOARD AND CLINCHED. Major. (Piece broken from board releases end of binding wire. This photograph applicable to packed ammunition inspection only.)

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

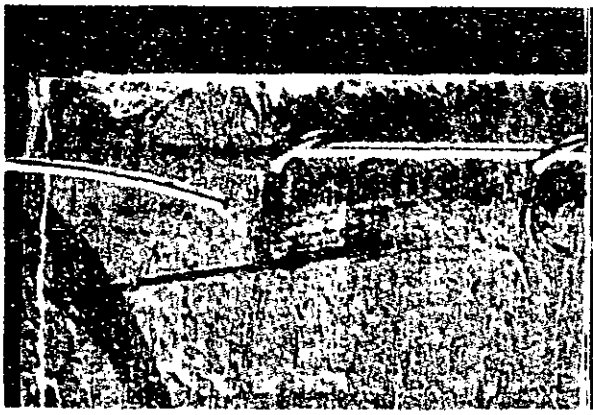

No. 20—BROKEN BINDING WIRE. Major.

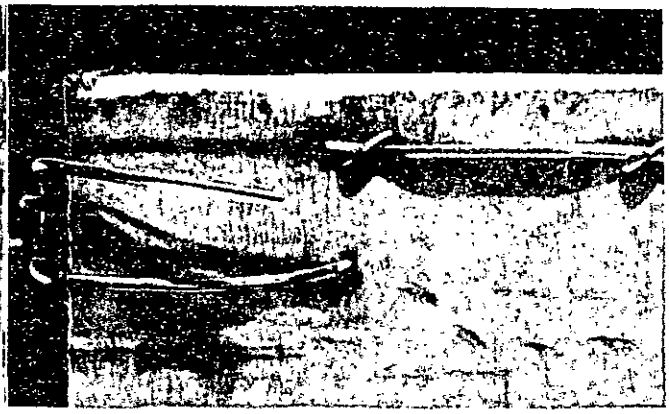

No. 20—BROKEN BINDING WIRE. Major.




No. 20—SPLICED BINDING WIRE. Permissible. (Satisfactorily repaired.)




No. 20—SPLICED BINDING WIRE. Major. (Repaired, but not satisfactorily.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

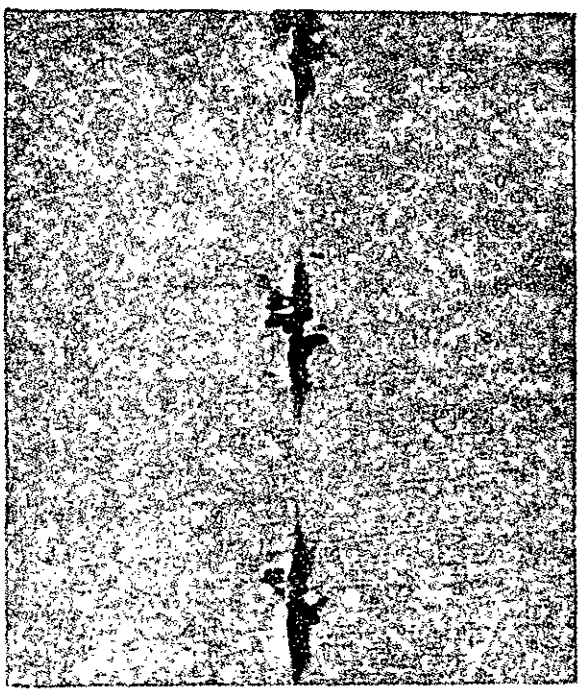


No. 20—MISSING BINDING WIRE.
Major.

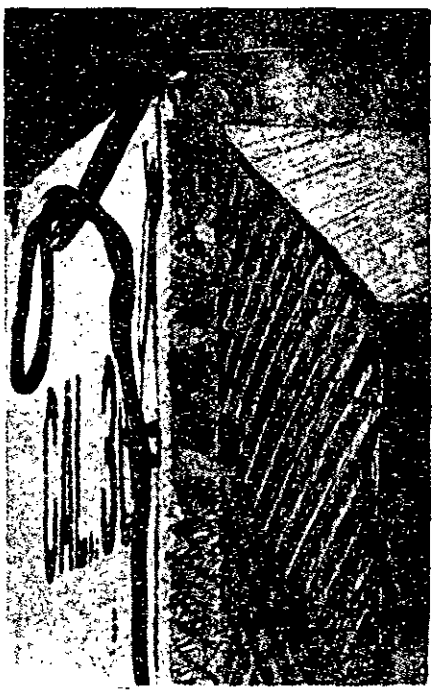

No. 21—LOOSE BINDING WIRE.
Minor. (Not fastened tightly.)

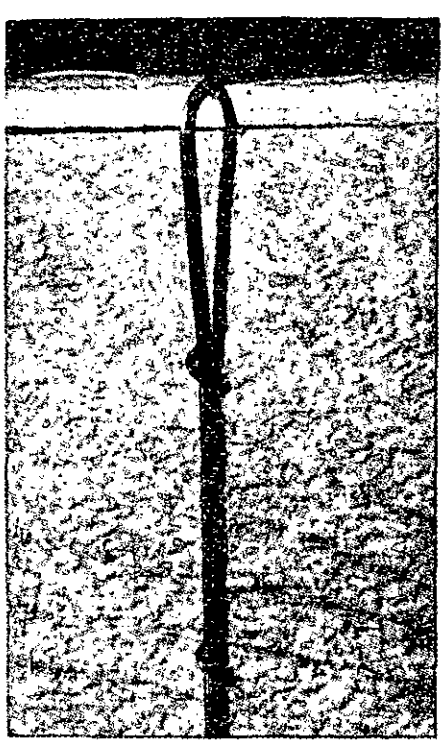


No. 21—LOOSE BINDING WIRE.
Minor. (Not drawn tightly.)

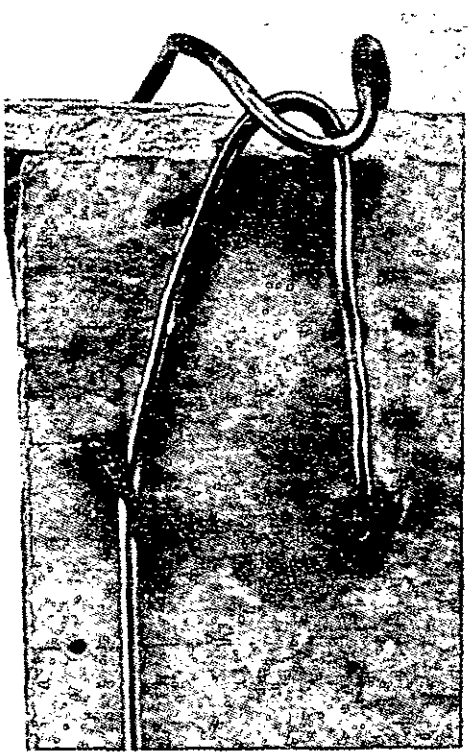


No. 22—SHORT LOOP. (Preventing closing of box.) Major.


Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

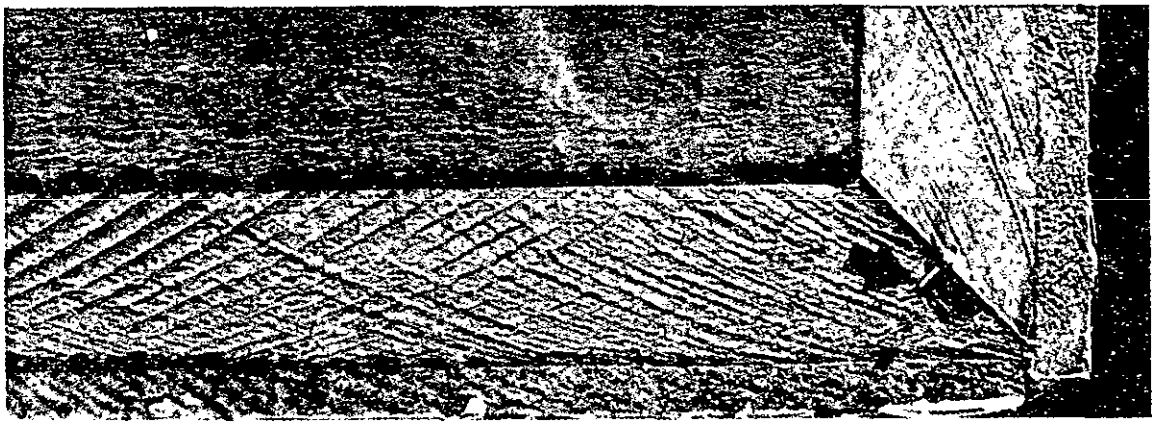

No. 23—PROTRUDING STAPLE POINT. Major.

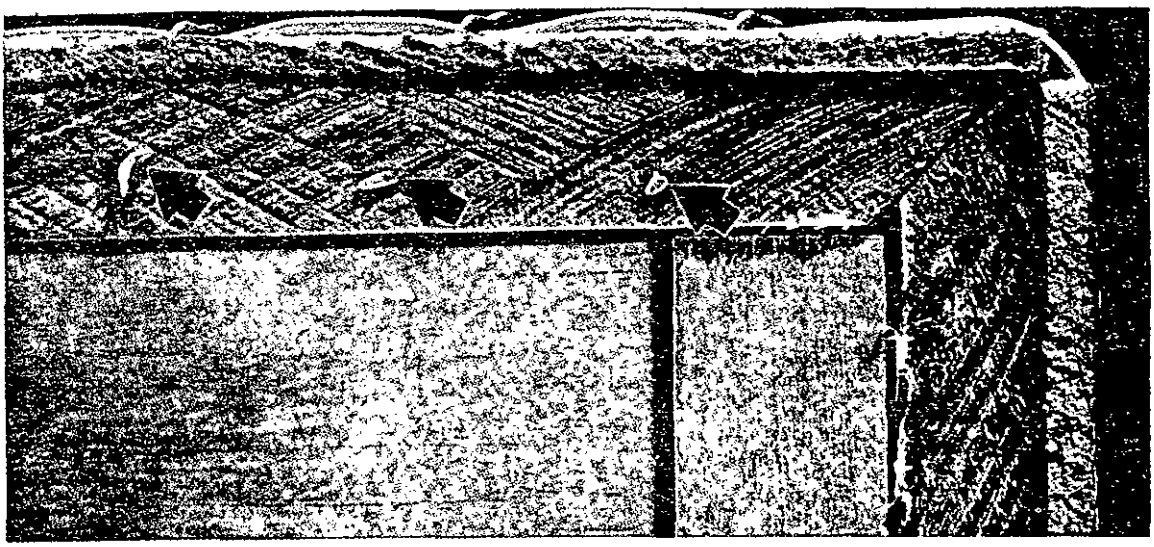


No. 23—PROTRUDING STAPLE POINTS. Major.

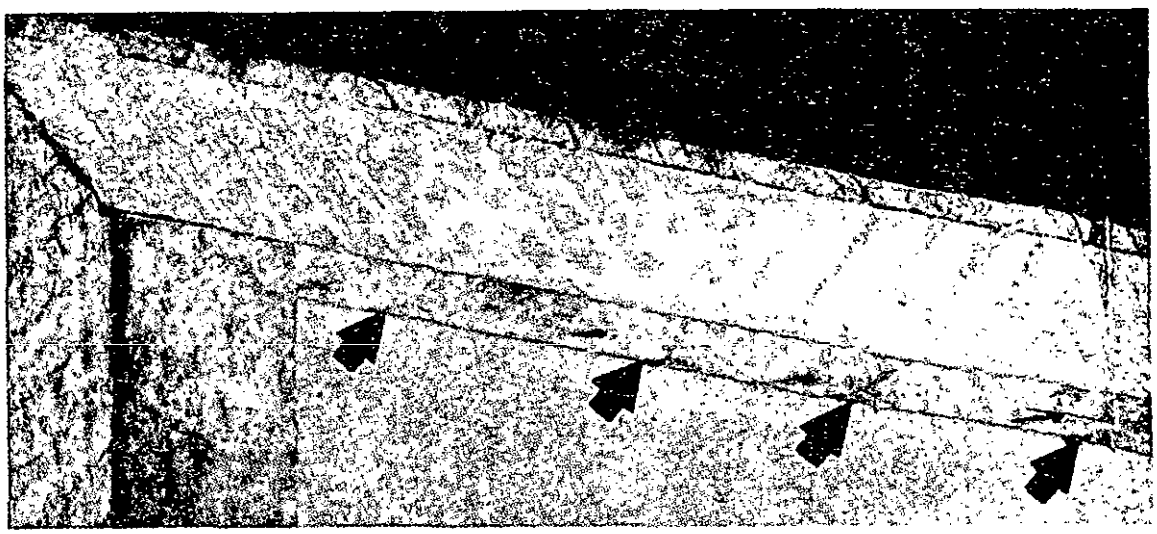


No. 23—PROTRUDING STAPLE POINTS. Major.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

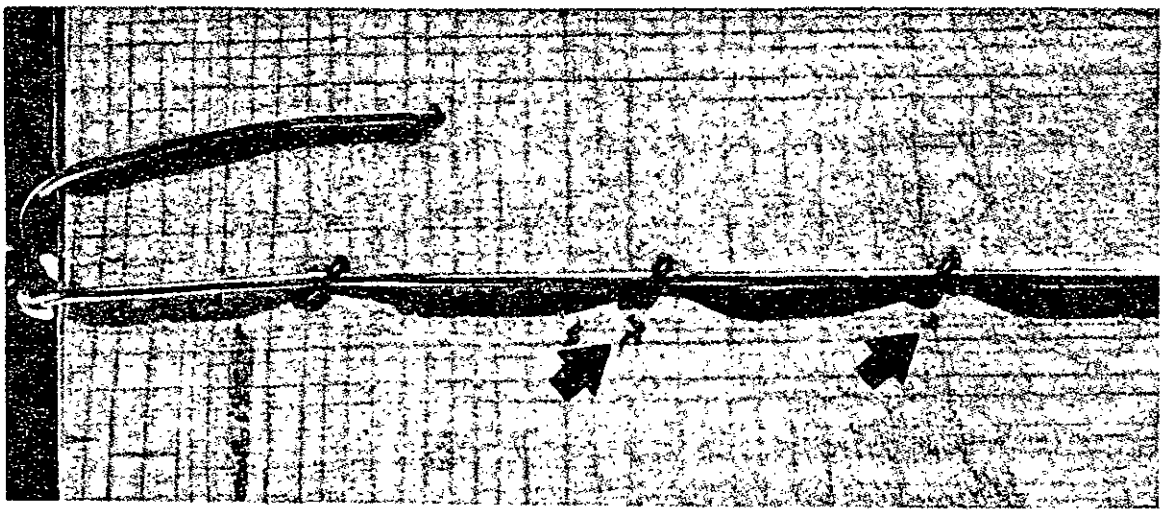

No. 23—PROTRUDING STAPLE POINTS. Major.

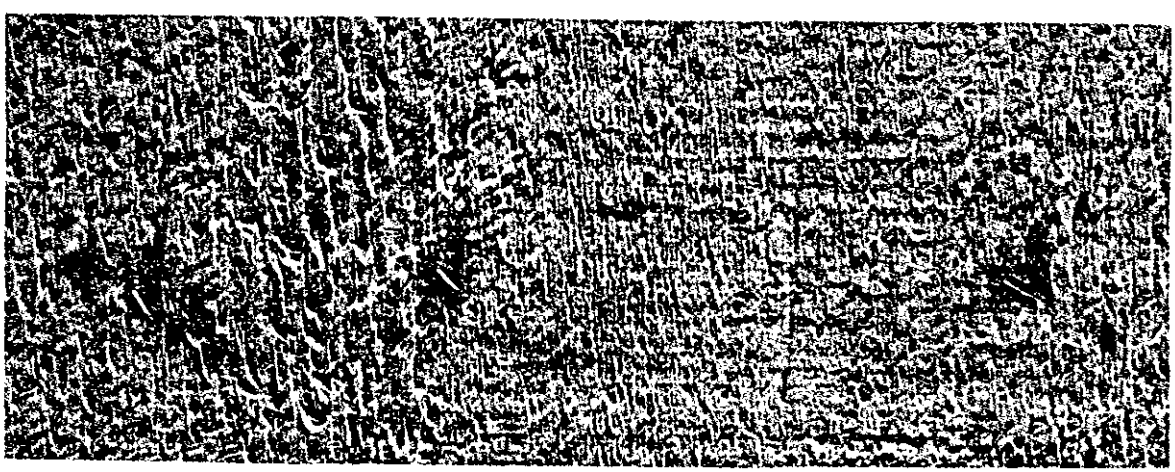


NO. 23—PROTRUDING STAPLE POINTS. Major.

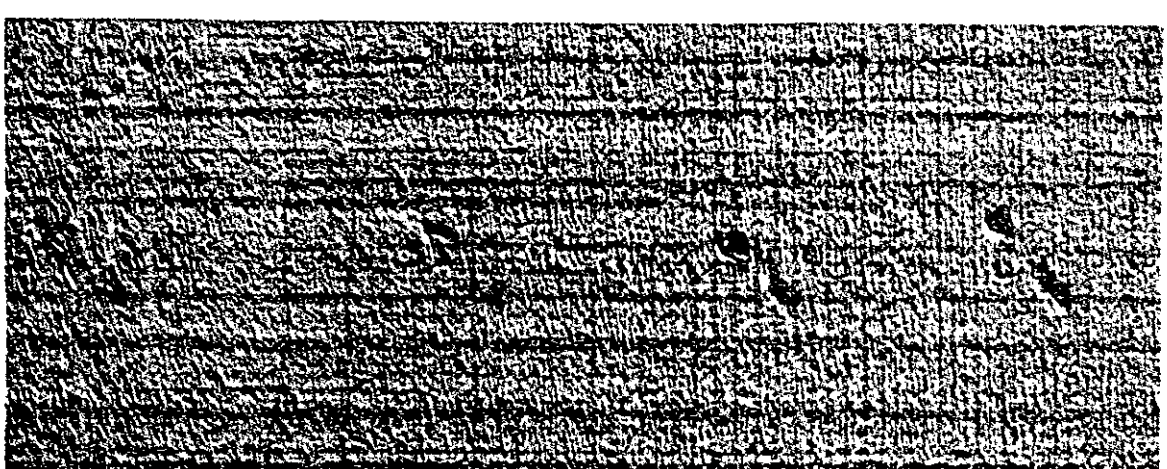


No. 23—CORRECTLY CLINCHED STAPLES. Required.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

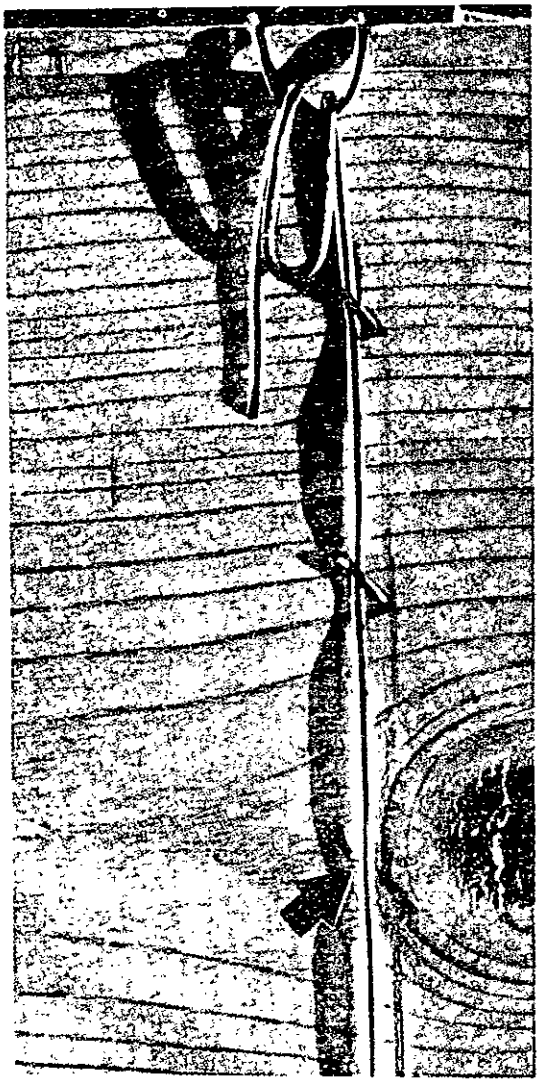

No. 24—MISSING STAPLE. Minor if more than two are missing per wire. Permissible if only two are missing per wire.

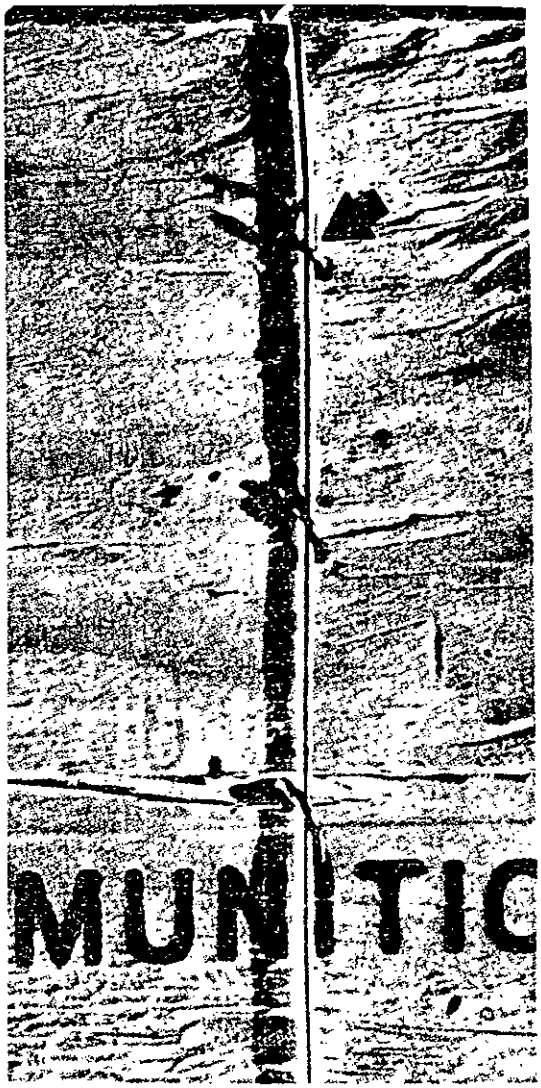


No. 24—BROKEN STAPLE. Minor if more than two are broken per wire. Permissible if only two are broken per wire.

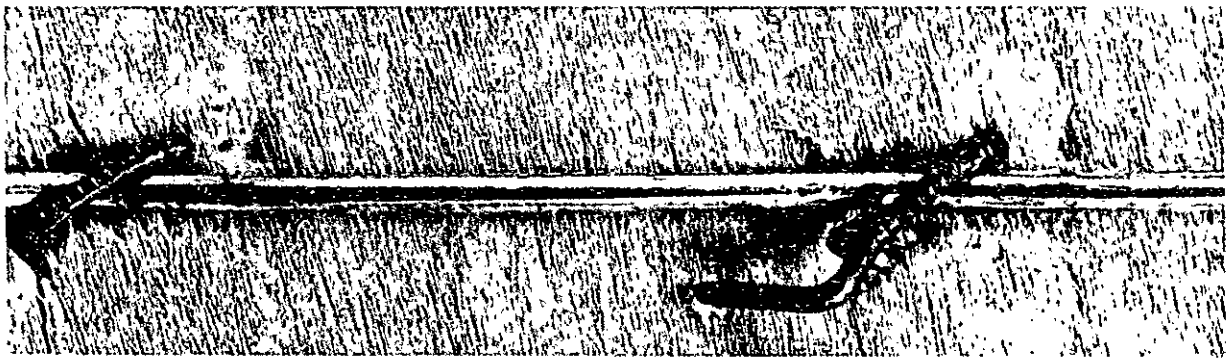


No. 24—POORLY DRIVEN STAPLE. Minor if more than two are poorly driven per wire. Permissible if only two are poorly driven per wire. (One leg of staple is not driven into wood.)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

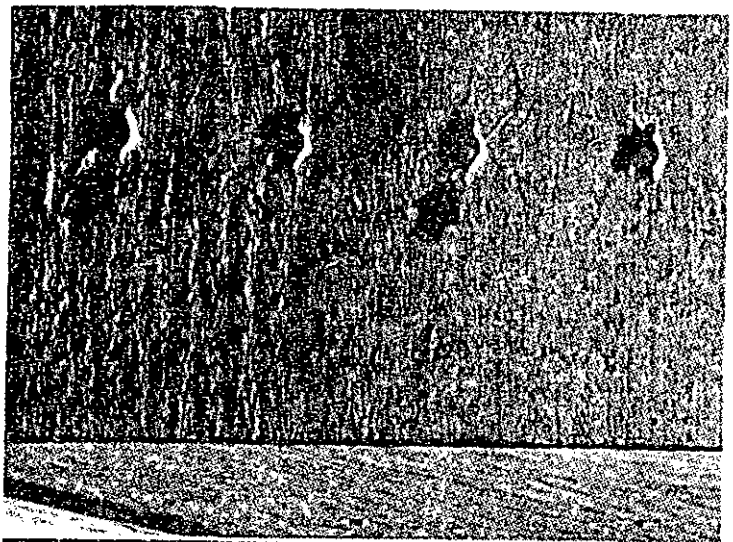

No. 25—MISSING BATTEN STAPLES. Minor.

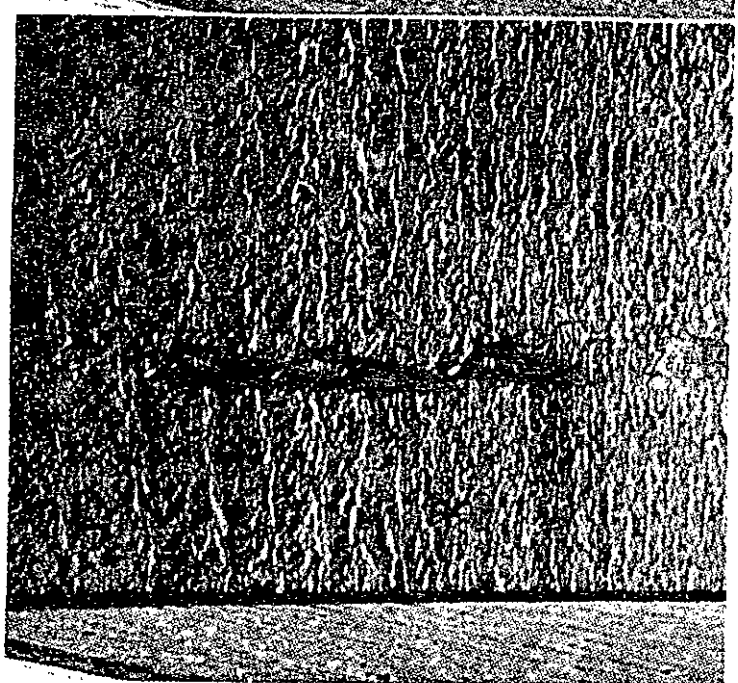


No. 25—PROTRUDING STAPLE LOOPS. Minor if more than one protrudes per batten. Permissible if only one protrudes per batten.

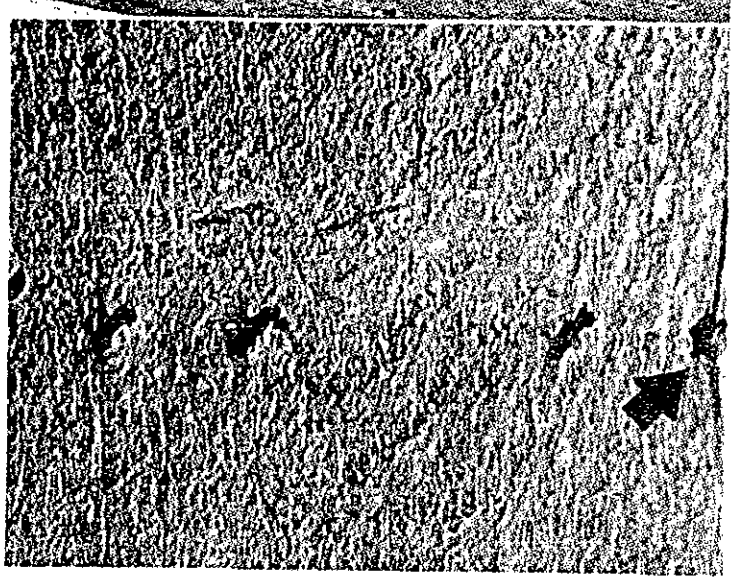

No. 25—MISSING BATTEN STAPLE. Permissible. (Only one missing per batten.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

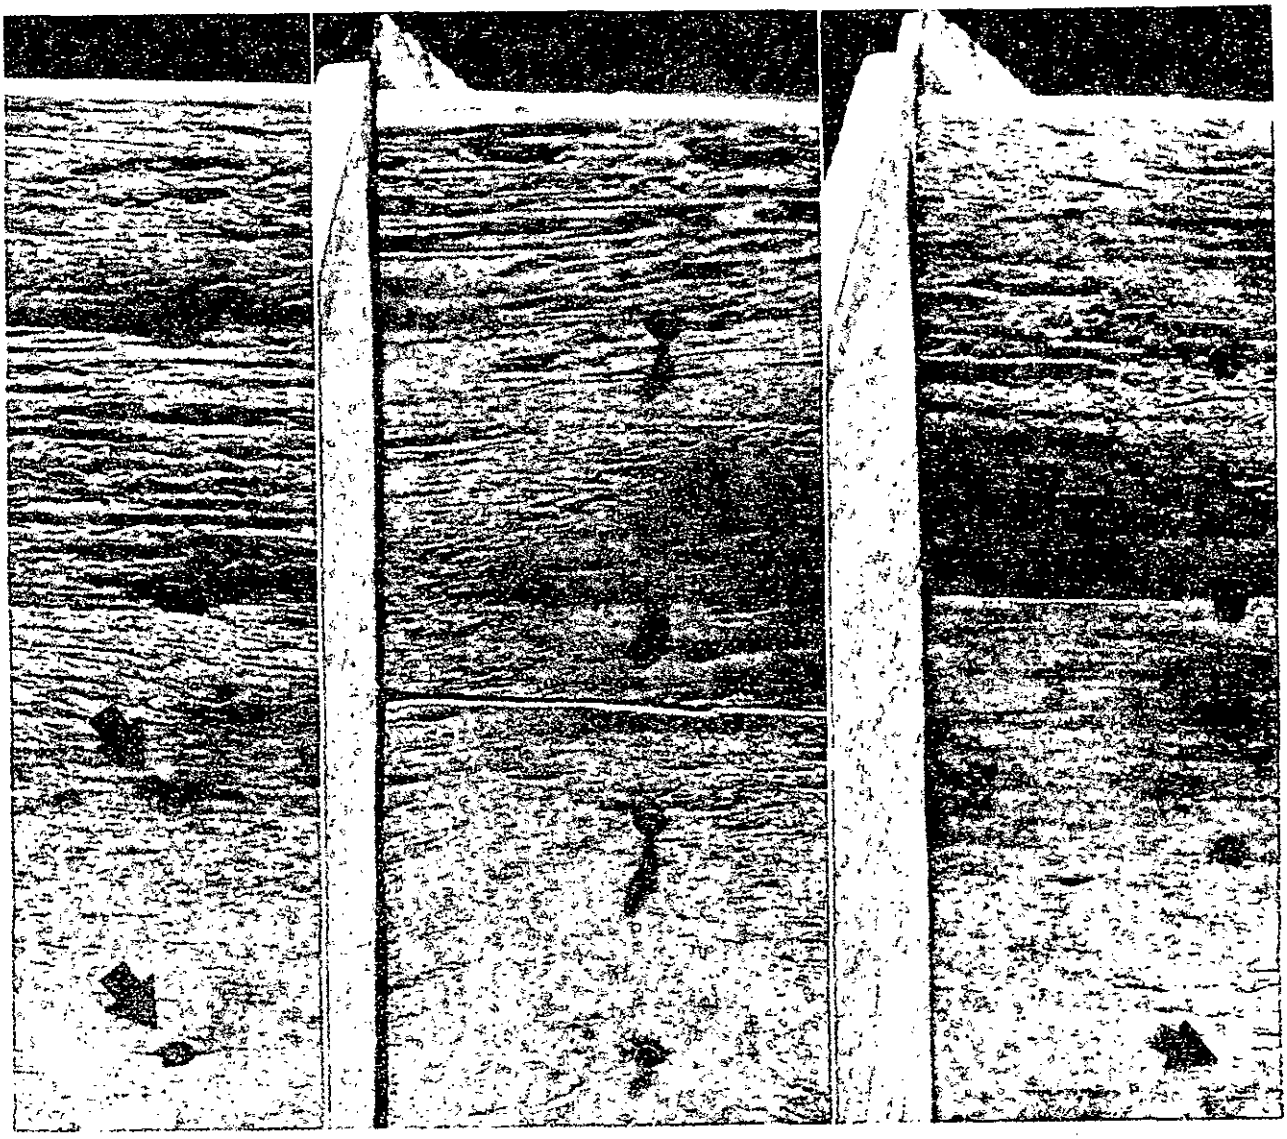


No. 26—MISSING BATTEN NAILS. Minor.


No. 26—PROTRUDING NAIL HEADS. Minor if more than one protrudes per batten. Permissible if only one protrudes per batten.

No. 26—MISSING BATTEN NAIL. Permissible. (Only one missing per batten.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

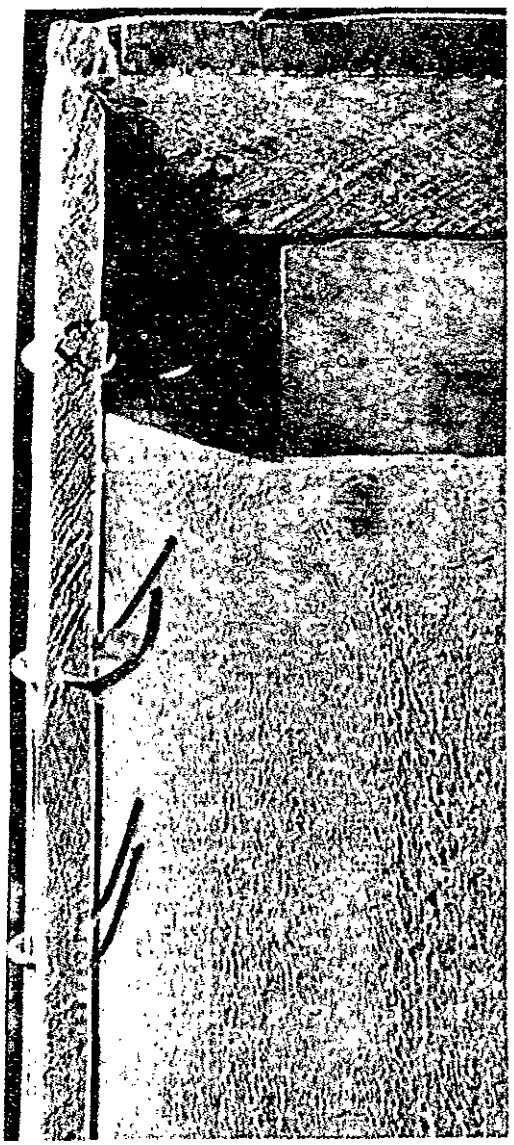

No. 27—MISSING CLEAT. Major.

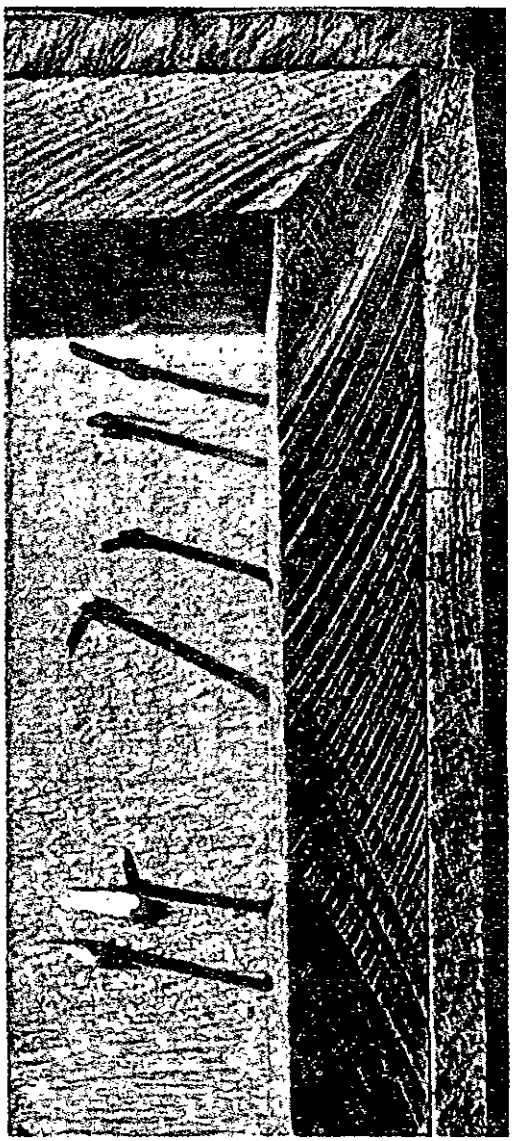


No. 27—MISSING BATTEN. Major.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 28—OVERLAPPING BOARDS. Minor.

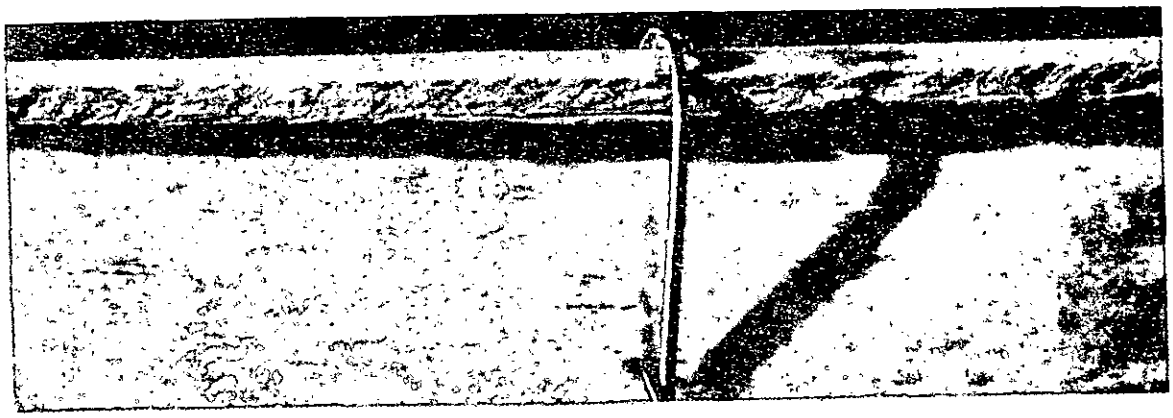


No. 28—OVERLAPPING BOARDS. Minor.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

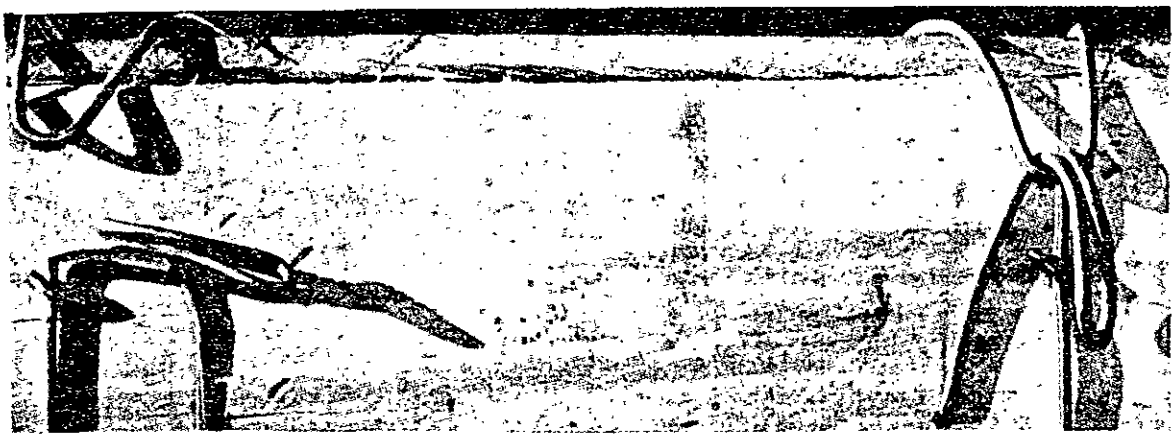

No. 29—UNFASTENED OUTSIDE BINDING WIRE. Major.

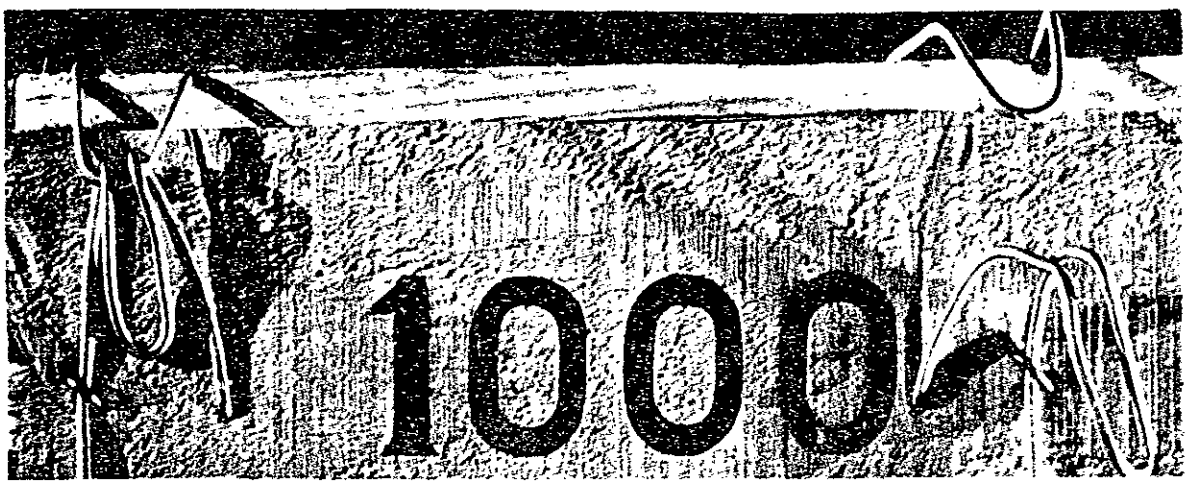

No. 30—UNFASTENED INSIDE BINDING WIRE. Minor.

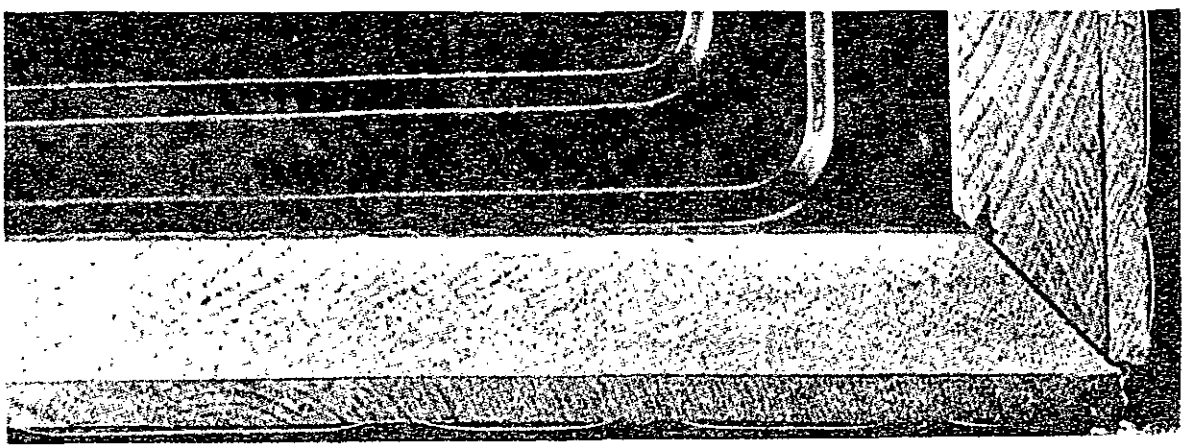


No. 31—MISSING END. Major.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.




No. 32—Side, Top or Bottom Extending Beyond End Cleat More Than ⅛'' Minor.

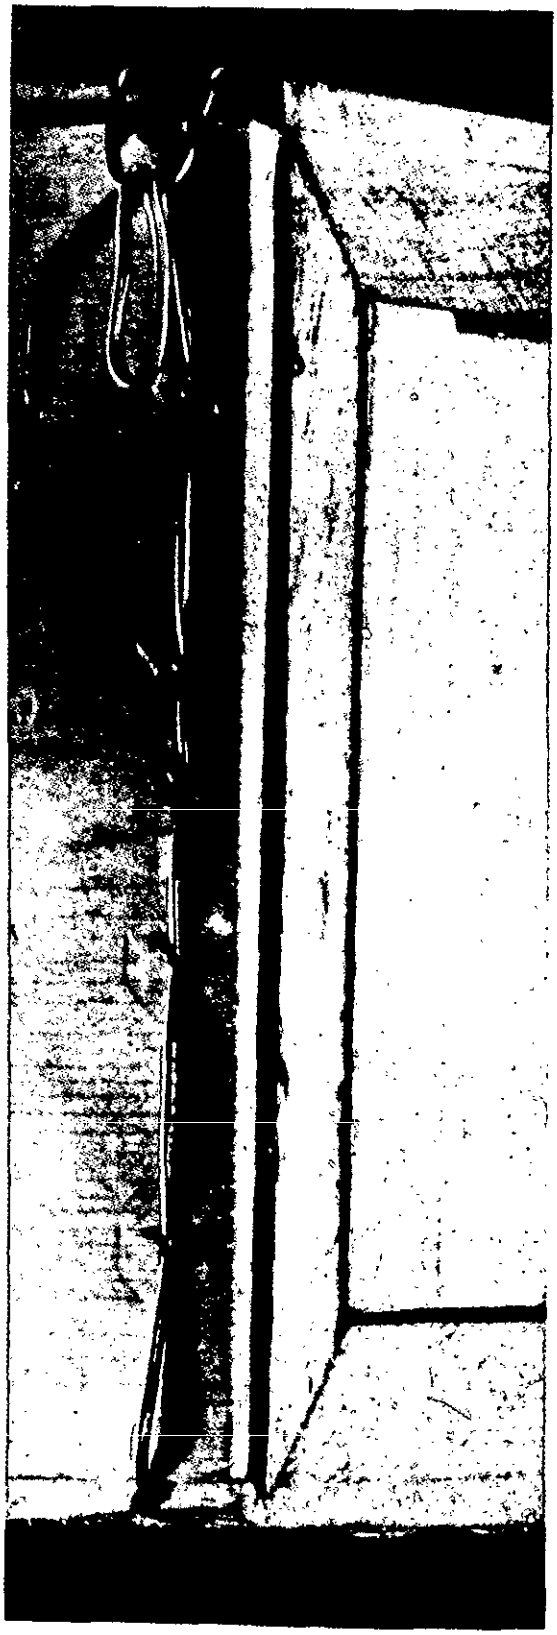


No. 33—End Cleat Extending Beyond Side, Top or Bottom More Than ¼''. Minor.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

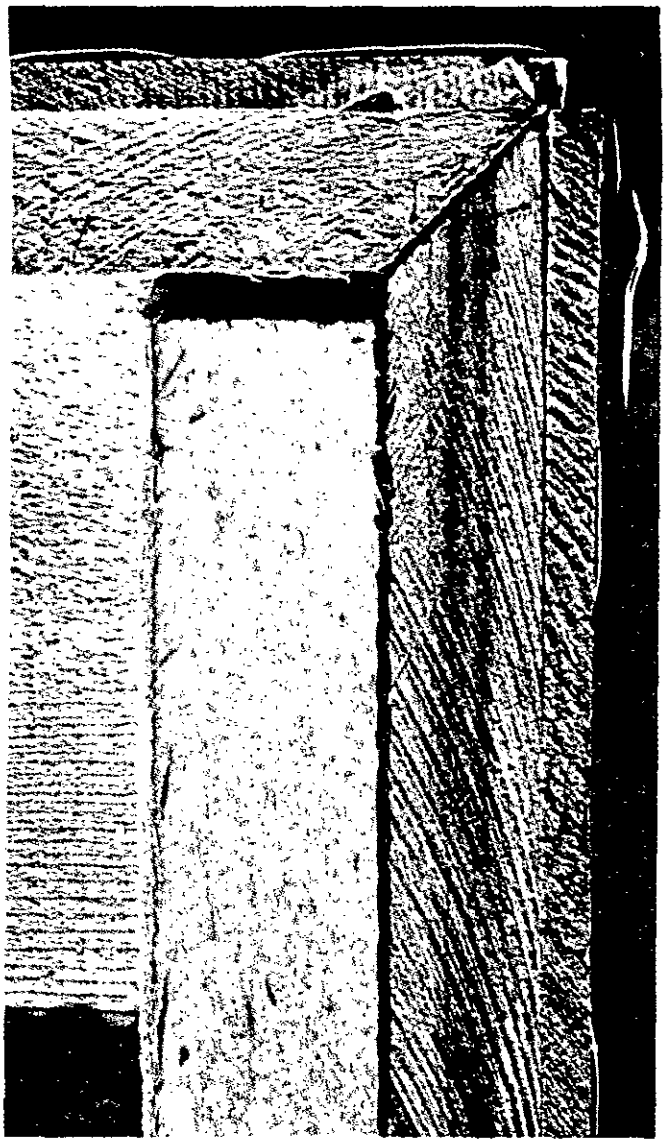


No. 34—GAP. Minor. (Space between end of batten and cleat greater than ¼".)

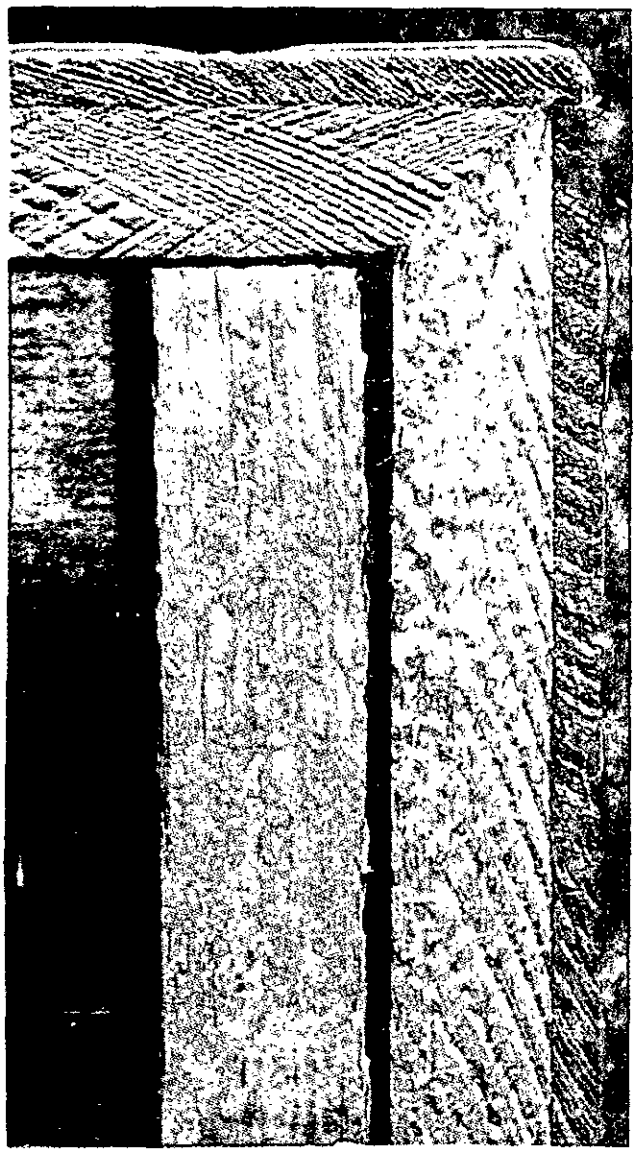

No. 35—GAP. Minor. (Space between side of batten and cleat greater than ¼".)


Source: https://assist.dla.mil Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

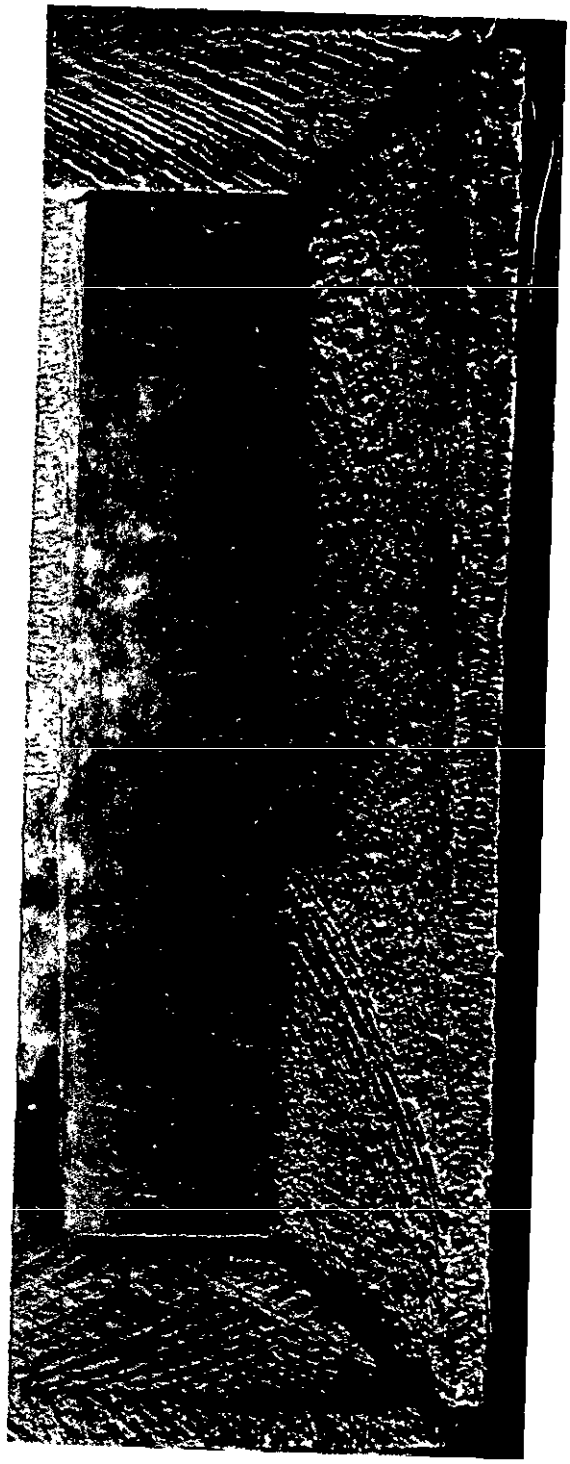


No. 36—GAP. Minor. (Space between diagonal ends of adjacent cleats greater than ¼".) Permissible if box has only one gap of this kind.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

No. 37—Reversed or Inverted End. Minor. (*Not illustrated.* Printed end shall be on right end of box and shall not be inverted.)

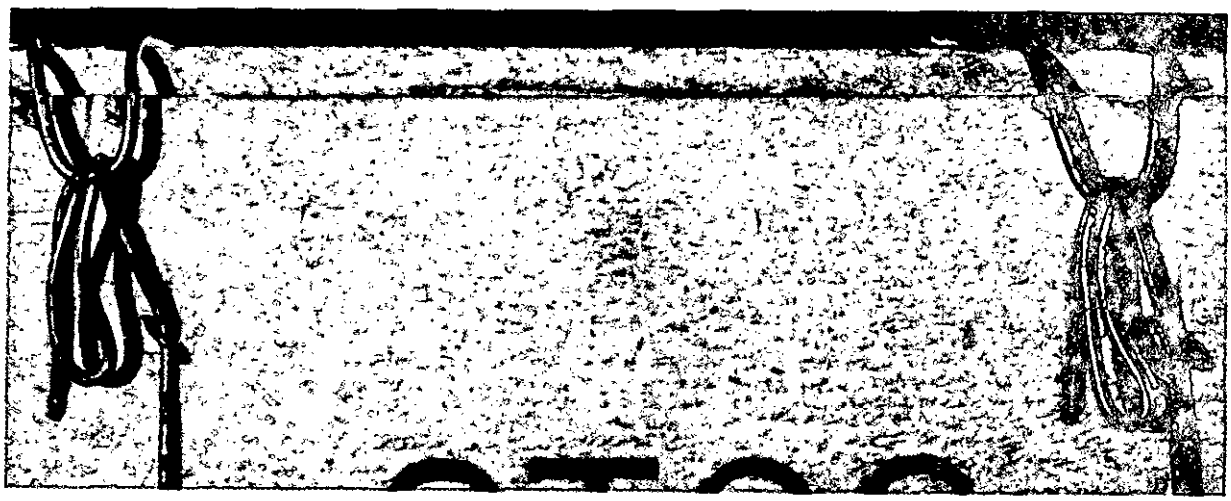

No. 38—MISSING SEAL. Major.

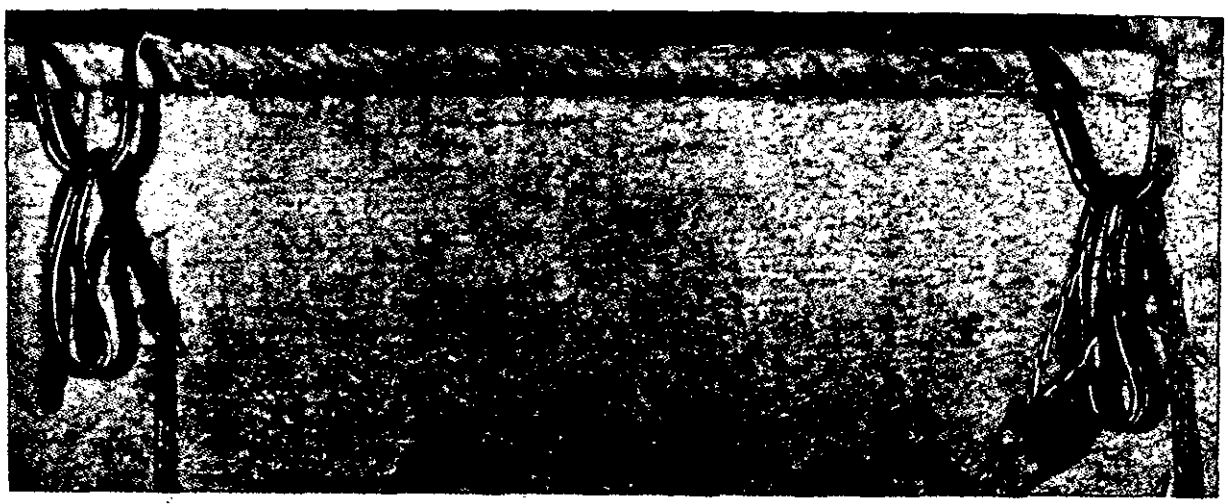

No. 39—INCORRECTLY ATTACHED SEAL. Minor. (Top can be opened without breaking seal. *Note*—Other methods of attachment which have this fault are also defective.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.

Notice. When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring agency or as directed by the contracting officer.

Copies of this standard for Military use may be obtained as indicated in the foreword to the Index of Military Specifications and Standards.

Copies of this standard may be obtained for other than official use by individuals, firms, and contractors from the Superintendent of Documents, U. S. Government Printing Office, Washington 25, D. C.

Both the title and the identifying symbol number should be stipulated when requesting copies of Military Standards.

Custodians:

Army—Ordnance Corps

Navy—Bureau of Ordnance

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T07:30Z
Check the source to verify that this is the current version before use.