INCH-POUND

MIL-C-83421B
AMENDMENT 2
4 June 1993
SUPERSEDING
AMENDMENT 1
29 October 1991

MILITARY SPECIFICATION

CAPACITORS, FIXED, METALLIZED, PLASTIC FILM DIELECTRIC,
(DC, AC, OR DC AND AC), HERMETICALLY SEALED IN METAL OR CERAMIC CASES,
ESTABLISHED RELIABILITY,
GENERAL SPECIFICATION FOR

This amendment forms a part of MIL-C-83421B, dated 31 January 1991, and is approved for use by all Departments and Agencies of the Department of Defense.

PAGE 4

3.2, delete and substitute the following:

"3.2 Qualification. Capacitors furnished under this specification shall be products which are qualified for listing on the applicable qualified products list at the time set for opening of bids (see 4.4 and 6.4). In addition, the manufacturer shall obtain certification from the qualifying activity that the reliability assurance requirements of 4.1.1 have been met and are being maintained. Authorized distributors which are approved to MIL-STD-790 distributor requirements by the qualified product list (QPL) manufacturers are listed in the QPL."

* 3.3.2.2, delete and substitute the following:

"3.3.2.2 Quality levels. The quality of lots that have been subjected to and passed the subgroup 1, 100 percent screening inspection of the group A inspection shall be established and maintained in accordance with 4.4.4.2 and EIA-554, method B. Individual PPM defect level (i.e., PPM-2 and PPM-3) and an overall PPM defect level (i.e., PPM-5) shall be established based on the tests prescribed in the subgroup 2 tests of the group A inspections. The defect level for PPM-2 shall be less than 100 PPM. The implementation of PPM verification shall be 12 months from the date of this specification."

PAGE 6

* Following 3.5.3.3, add:

"3.5.3.4 Tin plated finishes. Use of tin plating is prohibited as a final finish and as an undercoat effective six months from the date of this specification (see 6.8). Use of tin-lead (Sn-Pb) finishes are acceptable provided that the minimum lead content is three percent."

PAGE 7

* 3.16, delete and substitute:

"3.16 Vibration, high frequency and random. When capacitors are tested as specified in 4.7.12 and 4.7.12.1, there shall be no evidence of mechanical damage, no intermittent contacts of 0.5 millisecond (ms) or greater duration, or open- or short-circuiting."

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.

* 4.4.2, delete and substitute:

"4.4.2 Inspection routine. Sample units shall be subjected to the qualification inspection specified in table II, in the order shown. All sample units, including those sample units required for group X testing (when applicable), and shall be subjected to the inspections of group I (when applicable) and group II. The sample units, with the exception of the group X samples (when applicable) shall then be divided into five remaining groups as specified in table II, and subjected to the tests for their particular group.

"Sample units which have been selected to be submitted to the life test shall be divided into two groups; one group shall be subjected to the accelerated condition and the other group to the rated condition. The decision as to whether or not the product is to be included on the qualified products lists shall be made at the conclusion of the 2,000-hour test."

* 4.4.4.2, third sentence, delete "5 month" and substitute "six month".

* Table II, add footnotes 7/ and 10/ following 89 in groups I and II.

* Table II, add footnote 7/ following group VIII heading.

* Table II, add the following:

Group X (when applicable)					
Vibration, random 8/ - - - -	3.16	4.7.12.1	9/	0	

* Following footnote 7/, add:

" 8/ Unless otherwise specified, random vibration is optional (see 3.1).
9/ When applicable, an additional three sample units of the longest case length of each diameter for which qualification is sought shall be required for group X testing.
10/ This total shall be determined by the number of capacitors tested for random vibration in group X."

* 4.5, add the following:

"In the event that no production occurred during the reporting period, a report shall be submitted certifying that the manufacturer still has the capabilities and facilities necessary to produce the item. The manufacturer, however, must maintain the required number of unit hours in the specified maintenance period in order to remain qualified to the applicable failure rate levels. The manufacturer must also produce enough parts during any reporting period in order to perform all applicable group B tests."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.

* 4.6.1.1, delete and substitute:

"4.6.1.1 Inspection and production lot.

"4.6.1.1.1 Inspection lot. An inspection lot shall consist of all capacitors from the same production line or lines, of the same style, rated voltage, dielectric material, not less than the minimum number of dielectric layers 1/, and offered for inspection during a single work month. Each lot shall be kept separate from every other lot. The sample selected from the lot shall be representative of the capacitance values and case sizes in the lot. All sample units belonging to a lot shall be identified by means of a code symbol (either letters or numbers, at the option of the manufacturer).

"4.6.1.1.2 Production lot. A production lot shall consist of capacitors of the same style, voltage rating, and nominal capacitance value. Manufacture of all parts in the lot shall have been started, processed, assembled, and tested as a group. Lot identity shall be maintained throughout the manufacturing cycle."

PAGE 18

* 4.6.1.2.4.3b, delete last sentence and substitute:

"If the lot fails this solderability test, the lot may be reworked a second time and retested. If the lot fails this second rework, the lot shall be considered rejected and shall not be furnished against the requirements of this specification."

PAGE 19

* 4.6.2.1.1c, delete and substitute:

"c. Subgroup 3: Every six months, 2 sample units of each case diameter shall be inspected as shown in table V.

"d. Subgroup 4: Every six months, 18 sample units from production shall be divided and inspected as shown in table V."

* Table V, subgroup 3, delete and substitute:

"

Subgroup 3					
Vibration, high frequency - - -	3.16	4.7.12	6/	1	
Vibration, random 5/ - - - -	3.16	4.7.12.1			

"

* Add subgroup 4:

"

Subgroup 4					
Salt spray (corrosion) 4/ - - -	3.17	4.7.13	6		
Immersion 4/ - - - - - - - - - -	3.18	4.7.14			
Shock (specified pulse)- - - - -	3.20	4.7.16			
Resistance to soldering heat - - - - - - - - - - - - - -	3.21	4.7.17	6		1
Moisture resistance- - - - - - -	3.22	4.7.18			
Dielectric absorption (when specified, see 3.1) - - - - - - - - - - - - -	3.7	4.7.3	6		
Terminal strength- - - - - - - -	3.23	4.7.19			
Resistance to solvents - - - - -	3.26	4.7.22			

"

See footnotes on next page. "

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.

* Following footnote 4/, add:

"5/ Unless otherwise specified, random vibration is optional (see 3.1).
6/ Two sample units of each case diameter shall be inspected."

* 4.6.2.1.3, first sentence, delete and substitute:

"4.6.2.1.3 Noncompliance. If a sample unit fails to pass group B inspection, the manufacturer shall notify the qualifying activity and cognizant inspection activity of such failure and take corrective action on the materials or processes, or both, as warranted, and on all units of product which can be corrected and which were manufactured under essentially the same conditions, with essentially the same materials, processes, and so forth, and which are considered subject to the same failure."

* 4.7.2b, delete and substitute:

"b. DC burn-in shall be exposed to a temperature of +125°C with 140 percent of dc derated voltage for 16 hours, minimum."

* 4.7.12f, delete and substitute:

"f. Measurements after vibration: Dissipation factor shall be measured as specified in 4.7.9 and shall be within initial limits."

* Following 4.7.12, add:

"4.7.12.1 Vibration, random (see 3.16). Capacitors shall be tested in accordance with method 214 of MIL-STD-202. The following details and exceptions shall apply:

a. Mounting of specimens: Rigidly mounted by the body to the vibration-test apparatus; terminals shall be secured 0.500 ±0.125 inch from the case.

b. Electrical load conditions: Not applicable.

c. Test condition II, letter K.

d. Duration and direction of motion, 15 minutes in each of two mutually perpendicular directions (total of 30 minutes), one parallel and the other perpendicular to the cylindrical axis.

e. During the test, a signal of 1 ±0.2 kHz at a level of 1 volt minimum shall be placed across the capacitor and measured with a suitable ac recording device (a permanent record is not necessary for this test) to determine open- or short-circuits, or intermittent contacts. The accuracy of the detecting equipment shall be sufficient to detect any interruption of 0.5 ms or greater duration.

f. Measurements after vibration: Dissipation factor shall be measured as specified in 4.7.9 and shall be within initial limits."


* 4.7.16d, delete and substitute:


"d. Measurements during and after shock: During the test, a cathode-ray oscilloscope (or other comparable means) shall be used as an indicating device in determining any electrical failures and intermittent contacts of 0.5 ms or greater duration, or open- or short-circuiting. Dissipation factor shall be measured as specified in 4.7.9 and shall be within initial limits. After the test, capacitors shall be visually inspected for evidence of breakdown, arcing, fractures, and other visible mechanical damage."


Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.

* 6.6, delete and substitute:

"6.6 PIN examples.

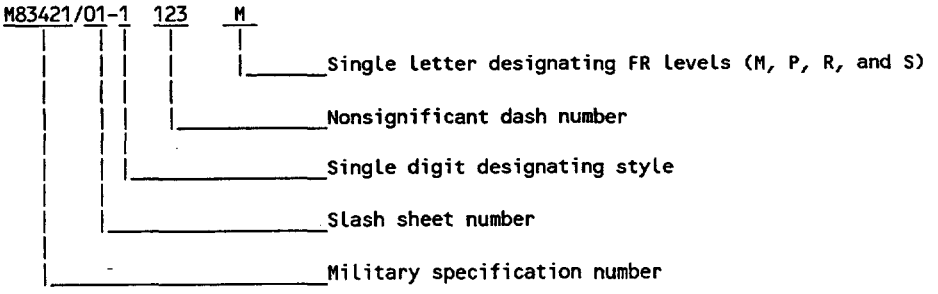

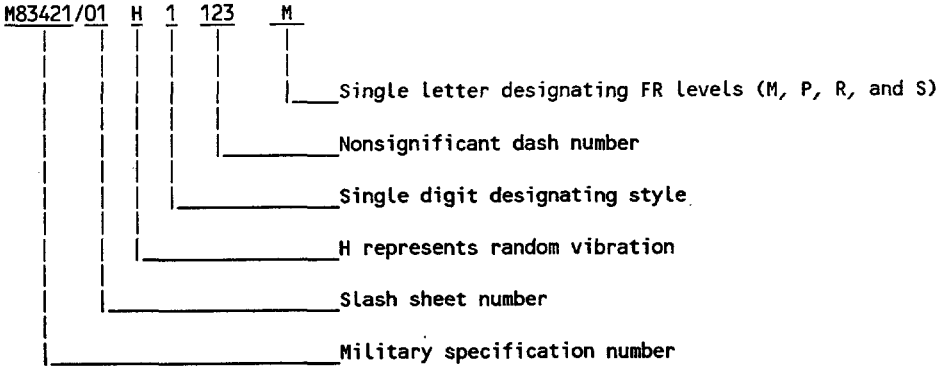

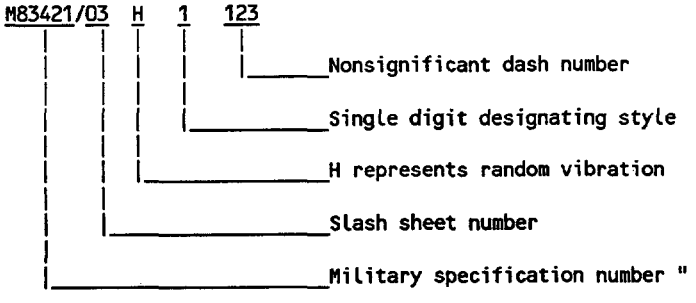

* Following 6.7, add:

"6.8 Tin plated finishes. Tin plating is prohibited (see 3.5.3.4) since it may result in tin whisker growth. Tin whisker growth could adversely affect the operation of electronic equipment systems. For additional information on this matter, refer to ASTM B545 (Standard Specification for Electrodeposited Coating of Tin)."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.

PAGE 30

* 30.1.1, following footnote 2/, add footnote 4/.

* 30.1.2, following footnote 3/, add footnote 4/.

* At bottom of page, add footnote 4/:

"4/ This total shall be determined by the number of capacitors tested for random vibration in group X."

PAGE 31

* Table VI, column 4 heading, add footnote 1/.

* After table VI, add footnote 1/:

"1/ This total shall be determined by the number of capacitors tested for random vibration in group X."

NOTE: The margins of this amendment are marked with asterisks to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notation and relationship to the previous amendment.

CONCLUDING MATERIAL

Custodians:
Army - ER
Navy - EC
Air Force - 85
NASA - NA

Review activities:
Army - AR
DLA - ES

User activities:
Navy - AS, CG, MC, OS, SH
Air Force - 19

Preparing activity:
Air Force - 85

Agent:
DLA - ES

(Project 5910-1821)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:05Z
Check the source to verify that this is the current version before use.