MIL-D-23359F
10 November 1982
SUPERSEDING
MIL-D-0023359E(ME)
11 June 1982 and
MIL-D-23359D
1 July 1974

MILITARY SPECIFICATION

DETECTING SET, MINE, PORTABLE, METALLIC

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers a portable mine detecting set for locating buried metallic antipersonnel and antitank land mines.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified (see 6.2), the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

NN-P-71	- Pallets, Material Handling Wood Stringer Construction 2-Way and 4-Way (Partial).
QQ-S-781	- Strapping, Steel, and Seals.
PPP-B-636	- Boxes, Shipping, Fiberboard.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: US Army Mobility Equipment Research and Development Command, ATTN: DRDME-DS, Fort Belvoir, VA 22060 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 6665

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-B-18	- Battery, Dry.
MIL-I-46058	- Insulating Compound, Electrical (For Coating Printed Circuit Assemblies).

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-129	- Marking for Shipment and Storage.
MIL-STD-130	- Identification Marking of U.S. Military Property.
MIL-STD-147	- Palletized Unit Loads.
MIL-STD-202	- Test Methods for Electronic and Electrical Component Parts.
MIL-STD-454	- Standard General Requirements for Electronic Equipment.
MIL-STD-781	- Reliability Tests: Exponential Distribution.
MIL-STD-1188	- Commercial Packaging of Supplies and Equipment.

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS

ME

TA13200E2680	- Detecting Set, Mine Portable, Metallic.
TA13225E8740	- Detecting Set, Mine Portable, Metallic.
13204E8857	- Test Pin.
13220E5627	- Phasing Fixture.
13220E5626	- Magnetite Tube.

(Copies of specifications, standards, and drawings required by manufacturers in connection with specific acquisition functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 First article. When specified, a sample shall be subjected to first article inspection (see 4.3 and 6.4). The contractor shall furnish to the

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

government one or more detecting sets produced by production tooling for inspection as specified in 4.4 to prove that his production methods will produce detecting sets that comply with the requirements of this specification. Examination and tests shall be as specified in Section 4; and unless otherwise specified herein, all examination and tests shall be conducted by the contractor subject to surveillance and approval by the Government (see 6.4). When specified, the Government will conduct any or all of the first article examination and tests as specified (see 6.2).

3.2 Design and construction. The detecting set shall be in accordance with Top Assembly TA13225E8740 or TA13200E2680 (see 6.2) and as specified herein. The detecting set shall consist of an audio frequency, mutual inductance, phase-selective, bridge-type metallic mine detector; a carrying case; a carrying strap; and a cold weather battery adapter. Unless otherwise specified (see 6.2), two batteries conforming to MIL-B-18, type BA-1568/U (NSN 6135-00-838-0706) shall be furnished by the Government for inclusion with each detecting set prior to shipment. The mine detector shall consist of a detecting head, handle, and control box with headset.

3.2.1 Drawings. The drawings forming a part of this specification are end product drawings. No deviation from the prescribed dimensions or tolerances is permissible without prior approval of the contracting officer. Any data (e.g., shop drawings, layouts, flow sheets, processing procedures, etc.) prepared by the contractor or obtained from a vendor to support fabrication and manufacture of the production item shall be made available, upon request, for inspection by the contracting officer or his designated representative.

3.3 Materials. Materials shall be as specified herein and as shown on the applicable drawings. Materials not specified shall be selected by the contractor and shall be subject to all provisions of this specification (see 6.10).

3.4 Parts. All parts used in fabrication shall be free of defects and imperfections that might affect safety performance or serviceability of the finished product.

3.5 Fungus and moisture resistance. The electrical circuitry, including all components and connections except as specified below shall be protected from the effects of fungus growth and moisture by an overall treatment with an electrical insulating compound conforming to MIL-I-46058.

a. Components or circuit elements that are inherently fungus and moisture resistant or which are hermetically sealed need not be treated.
b. Components or circuit elements whose functions will be adversely affected by the insulating compound coating shall not be treated.

When used, the insulating compound shall be applied by spray, brush, or a combination of both to give a dry-film thickness of not less than 1 mil to component or element surfaces previously cleaned and prepared so that the surfaces are free from all foreign matter which would interfere with the adherence or function of the compound.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

3.6 Performance characteristics.

3.6.1 Detecting-head shielding. The detecting head shall give a minimum response of 20 decibels (dB) for each receiver coil and a minimum response of 20 dB for the transmitter coil (see 4.6.2.1).

3.6.2 Electrical balance. The following output voltages (see 6.3.2), shall be obtained when the mine detector is balanced, using external control, in accordance with 4.6.2.2.

a. 15 millivolts alternating current root mean square (mVAC rms) or less in high position.
b. 5 mVAC rms or less in intermediate position.
c. 1.5 mVAC rms or less in low position.

3.6.2.1 Conditions. The above output voltages shall be obtained with the mine detector operating under each of the following conditions:

a. In nonmetallic medium as defined in 6.3.1.
b. Throughout the range of operating temperatures of minus 30° C to plus 50° C (ambient).
c. Within a battery voltage range from positive 11.25 volts to positive 14 volts.

3.6.2.2. Control position. At 25° C plus or minus 5° C, the output voltage shall be obtained with the balance control position within plus or minus two turns of the center of the range.

3.6.3 Detection capabilities. The mine detector shall detect a copper test pin conforming to drawing 13204E8857 when the pin is positioned 3 inches from the detecting head with a nonmetallic medium or any combination of nonmetallic media (see 6.3.1), between the pin and the detecting head as specified in 4.6.2.3. Detection of the copper pin shall be indicated by an increase in output voltage under each of the following switch control positions.

a. High. An increase of 325 mVAC rms plus or minus 120 mVAC rms above any balance level of less than 15 mVAC rms.
b. Intermediate. An increase of 75 mVAC rms plus or minus 28 mVAC rms above any balance level of less than 5 mVAC rms.
c. Low. An increase of 19 mVAC rms plus or minus 7 mVAC rms above any balance level of less than 1.5 mVAC rms.

3.6.4 Magnetic rejection.

3.6.4.1 Static. The mine detector shall have an output voltage of 100 plus or minus 10 mVAC rms when each side of the detecting head is exposed to the magnetite tube conforming to drawing 13220E5626. This output voltage shall be balanced for the left side and for the right side to within 10 mVAC rms (see 4.6.2.4).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

3.6.4.2 Dynamic. The mean output voltage response obtained by passing the detecting head over the wood ties shall not be greater than 1.5 times the output voltage response obtained from passing the detecting head over the copper test pin (drawing 13204E8857), when tested in accordance with 4.6.2.3 and 4.6.2.3.1a., respectively.

3.6.5 Overload recovery time. A 6-inch diameter by 1/8-inch steel disk within 3 inches from the detecting head shall create a saturating signal. The mine detector shall return to electrical balance (see 3.6.2) within 0.5 seconds after removal of the disk from the detecting head (see 4.6.2.6).

3.6.6 Current drain. The mine detector shall have a current drain of not more than 20 milliamperes direct current (dc) throughout the battery voltage range from 11.25 to 14 volts (see 4.6.2.7).

3.6.7 Low voltage aural monitor. The mine detector at 25° C plus or minus 5° C shall indicate when the battery voltage has decreased to 10.70 volts plus 0.4 or minus 0.3 volts dc by actuation of the alarm signal. Once the alarm actuates, the signal in the headset shall remain on until the battery voltage drops to 7.5 volts dc or less. The amplitude of the alarm signal shall be greater than the detection signal (see 3.6.3), at the point of actuation of the low voltage alarm. The fundamental frequency of the alarm shall be between 100 and 200 Hertz (Hz). As the battery voltage drops below 7.5 volts dc down to a completely dead battery, the mine detector shall continue to indicate warning by the presence of one of the following:

a. Continuation of the low voltage signal.
b. Presence of a saturated detection signal due to impossibility of balancing detector.
c. No signal, which indicates complete cessation of operation.

3.6.8 Vibration. The mine detector shall not be damaged by vibration when tested as specified in 4.6.2.9.

3.6.9 Bounce. The detecting set shall not be damaged when tested as specified in 4.6.2.10.

3.6.10 Immersion. The mine detector, except headset assembly, shall exhibit no leakage and shall not be damaged when tested as specified in 4.6.2.11.

3.6.11 Temperature effects. The mine detector shall not be damaged when operated or stored under the following conditions (see 4.6.2.13).

3.6.11.1 Operation. The mine detector shall be capable of operation under the following conditions:

a. Temperature shocks within the range of plus 50° C to minus 30° C (see 4.6.2.12).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

b. Ambient temperatures from plus 50° C with solar radiation of 360 British thermal units (Btu) per square foot per hour to minus 30° C without benefit of solar radiation, at all relative humidities possible at these temperatures.

3.6.11.2 Storage. The detecting set shall not be damaged by storage under the folloiwng conditions:

a. Ambient temperatures from plus 70° C to minus 55° C at all relative humidities possible at these temperatures (see 4.6.2.13 and 4.6.2.14).
b. Elevations from sea level to 40,000 feet and temperatures to minus 55° C as encountered during transportation by air.

3.6.12 Drift, temperature cycling. The mine detector shall have an output voltage of not more than 50 mVAC rms in the intermediate position during four continuous temperature cycles at the rate of 0.5° C per minute from 5° C above to 5° C below the initial ambient temperature (see 4.6.2.15a).

3.6.13 Drift, solar radiation, and shade. The mine detector shall have an output voltage of not more than 50 mVAC rms in the intermediate position during four continuous cycles of 10 minutes under 360 Btu per square foot per hour of incident solar radiation on the detecting head and 30 minutes in shade (see 4.6.2.15b).

3.6.13.1 Chamber. The test chamber or equivalent environment shall have a minimum volume of ten times that of the volume of the envelope volume of the test item. The simulated solar radiation source area shall be a minimum of 125 percent of the horizontal area projection of the test item.

3.6.13.2 Solar radiation source. For the purposes of this test, the following spectral distribution of solar radiation is acceptable: 50 to 72 watts/ft^2 of infrared (of wavelengths above 7,800 angstrom units), 4 to 7 watts/ft^2 of ultraviolet (of wavelengths below 3,800 angstrom units), and the balance visible. The radiation source shall be located at least 36 inches away from any outer surface of the test item. (Lamp vendor's spectral distribution curves may be used in establishing the spectral distribution within the above specified limits).

3.6.14 Drift, null. The mine detector output voltage shall not change more than 15 mVAC rms in the high position under an ambient temperature of 25° C plus or minus 5° C during a 30-minute period.

3.7 Reliability. The mine detector shall demonstrate an upper test Mean-Time-Between-Failure (MTBF) of 1000 hours and a lower test MTBF of 500 hours when tested in accordance with 4.6.2.17.

3.8 Treatment and painting. The portions of the detecting set normally painted shall be cleaned, treated, and painted in accordance with requirements specified on the drawings.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

3.9 Identification marking. Where specified, the detecting set shall be identified in accordance with MIL-STD-130. The marking shall be applied to plates as specified on the drawings. The plates shall be attached as specified on the drawings.

3.10 Safety. The equipment shall be free of unnecessary sharp edges, excessive length of fastening devices and shall meet applicable criteria of MIL-STD-454, Requirement 1.

3.11 Workmanship. The workmanship in the detecting set shall be in accordance with Requirement 9 of MIL-STD-454.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Disassembly inspection. Failure of any test by the first article unit shall be cause for disassembly, in the presence of a Government representative, of the first article unit to the extent necessary to determine the cause of failure. Each disassembled part shall be examined in detail for compliance with this specification and referenced drawings in regard to materials, dimensions, tolerances, and workmanship. Parts not complying with such requirements shall be rejected.

4.1.2 Component and material inspection. The contractor is responsible for insuring that components and materials used are manufactured, examined, and tested in accordance with referenced specifications and standards.

4.1.3 Parts and components inspection. Parts and components detailed on the drawings shall be inspected in accordance with the Quality Assurance Provisions (QAP) shown on the drawings. The drawings specify the characteristics requiring QAP inspection, the sampling plan, and the basis for acceptance and rejection (see 6.3.3).

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4).
b. Quality conformance inspection (see 4.5).
c. Inspection comparison (see 4.7).
d. Inspection of packaging (see 4.8).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in applicable paragraphs in the specification.

4.4 First article inspection. First article inspection shall be applied to the detecting sets as specified in 3.1. First article inspection shall consist of the examinations as specified in 4.6.1 and all tests indicated by "X" in column 2 of table II. Presence of one or more defects shall be cause for rejection. Failure of any test shall be cause for performing the disassembly inspection specified in 4.1.1.

4.4.1 Inspection failure Failure of a first article detecting set to meet any requirement specified herein during and as a result of the examination and tests specified in 4.4. shall be cause for rejection of the first article detecting set(s) and shall be cause for refusal by the Government to continue acceptance of production detecting sets until evidence has been provided by the contractor that corrective action has been taken to eliminate the deficiencies. Correction of such deficiencies shall be accomplished by the contractor at no cost to the Government on detecting sets previously accepted and produced under the contract. Any deficiencies found as a result of the first article inspection will be considered prima facie evidence that all detecting sets accepted prior to the completion of first article inspection are similarly deficient unless evidence to the contrary is furnished by the contractor and such evidence is acceptable to the contracting officer.

4.5 Quality conformance inspection.

4.5.1 Sampling. Sampling for examinations and tests shall be in accordance with MIL-STD-105. Lots shall be formulated from detecting sets which have successfully completed the individual tests specified in 4.5.3.1.

4.5.2 Examination. Each sample detecting set selected in accordance with 4.5.1 shall be examined for the major and minor characteristics as specified in 4.6.1 for possible defects. AQL shall be 1.0 percent defective for major defects and 2.5 percent defective for minor defects.

4.5.3 Tests.

4.5.3.1 Individual. Each detecting set shall be subjected to the tests indicated by "X" in column 3 of table II. Failure of any test shall be cause for rejection.

4.5.3.2 Samples. Samples selected in accordance with 4.5.1 shall be subjected to the tests indicated by "X" in column 4 of table II. No adjustment shall be made on the detecting set after completion of the individual tests. AQL shall be 1.0 percent defective.

4.6 Inspection procedure.

4.6.1 Examination. Each sample detecting set shall be examined for the major and minor characteristics listed in table I for possible defects as specified in 4.5.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

TABLE I. Examination.

Number	Characteristic	Requirement Paragraph
Major		
101.	Dimensions that affect form, fit, or function.	3.2.1
102.	Materials not as specified.	3.3
103.	Fungus and moisture resistance not as specified.	3.5
104.	Safety requirements not as specified.	3.10
Minor		
201.	Dimensions that do not affect form, fit, or function.	3.2.1
202.	Treatment and painting not as specified.	3.8
203.	Workmanship not as specified.	3.11
204.	Identification marking not as specified.	3.9

4.6.2 Tests. Tests shall be in accordance with table II. A test lane meeting the requirements of 4.6.2.5 will be available to the contractor (see 6.6). Where "damage" is referred to herein, it shall include, but not be limited to, the following:

a. Rough handling - breakage, deformation, loosening, or any condition resulting in malfunctioning of the detecting set.
b. Temperature and humidity - deterioration or corrosion of any hardware or finish, breakage, deformation, or any condition which may result in malfunctioning of the detecting set.

TABLE II. Tests.

Order of Tests Groups	First Article	Quality Conformance Ind.	Quality Conformance Samp.	Test	Test Paragraph	Requirement Paragraph
1	2	3	4	5	6	7
		Group I				
1	X	-	X	Detecting-head shielding.	4.6.2.1	3.6.1
	X	X	-	Electrical balance.	4.6.2.2	3.6.2
	X	X	-	Detection capabilities.	4.6.2.3	3.6.3
	X	X	-	Static magnetic rejection.	4.6.2.4	3.6.4.1
	X	-	X	Dynamic magnetic rejection.	4.6.2.5	3.6.4.2
	X	-	-	Overload recovery time.	4.6.2.6	3.6.5
	X	X	-	Current drain.	4.6.2.7	3.6.6
	X	X	-	Low voltage aural monitor.	4.6.2.8	3.6.7

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

TABLE II. Tests. (Cont'd)

Order of Tests Groups	First Article	Quality Conformance Ind.	Quality Conformance Samp.	Test	Test Paragraph	Requirement Paragrapn
1	2	3	4	5	6	7
		Group II				
2	X	-	X	Drift, null.	4.6.2.16	3.6.14
	X	-	-	Drift, temperature cycling.	4.6.2.15.a	3.6.12
	X	-	X	Drift, solar radiation and shade.	4.6.2.15.b	3.6.13
		Group III				
3	X	-	-	Low temperature and altitude storage.	4.6.2.14	3.6.11.2
	X	-	-	High temperature and humidity storage.	4.6.2.13	3.6.11.2
	X	-	X	Temperature operation and thermal shock.	4.6.2.12	3.6.11.1
		Group IV				
4	X	-	X	Vibration.	4.6.2.9	3.6.8
	X	-	-	Bounce.	4.6.2.10	3.6.9
		Group V				
5	X	-	X	Immersion.	4.6.2.11	3.6.10
		Group VI				
6	X	-	-	Reliability.	4.6.2.17	3.7

The test in table II shall be performed in order of group number. Order of tests may vary within individual groups.

4.6.2.1 Detecting-head shielding.

4.6.2.1.1 Test conditions. Conduct tests in a location where stray magnetic and electrostatic fields induce an open-circuit voltage less than 10 mVAC rms. Tests shall be performed on detecting heads separate from a complete detector and before cables are attached.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

4.6.2.1.2 Equipment. The following equipment shall be used:

a. Test jig in accordance with figure 1.
b. Audio oscillator capable of supplying 10 volts rms, 2500-Hz sine wave into a 600-ohm load with less than 5 percent distortion.
c. High impedance, true rms, ac voltmeter.
d. Shielded lead, including connectors for use from voltmeter to test jig.
e. Shielded lead, terminating with alligator or similar clips for use from audio oscillator to test jig.
f. Hookup wire harness and connectors used to connect all four brass disks on test jig for transmitter coil shield test.

4.6.2.1.3 Procedure.

a. Place the detecting head, terminals up, on the test fixture brass plate. The head should be equidistant from the edges of the plate.
b. Place the test fixture on the head, making sure that the plastic disks on the test fixture are correctly seated in the receiver coil recesses.
c. Connect the voltmeter and oscillator ground leads to the brass plate as shown in figure 2. Connect head terminal No. 5 to the brass plate with a jumper wire.
d. Connect the center conductor of the oscillator shielded lead to head terminal No. 6. Connect the center conductor of the voltmeter shielded lead to disk No. 1. Connect a jumper from the shield of the oscillator lead at brass plate to head terminal No. 2.
e. Adjust the oscillator for 2500 Hz and minimum output voltage. Measure and record the background stray field reading on the voltmeter. Adjust the oscillator for an output increase of 10 to 15 dB above the background stray field pickup as indicated by the voltmeter. Record the reading.
f. Remove the alligator clip from head terminal No. 2, making sure it does not make contact with any conductors, terminals, or brass disks. Record the voltmeter reading. Reattach the alligator clip to head terminal No. 2.
g. Repeat steps e and f with the voltmeter attached to brass disks 2, 3, and 4. This completes the receiver coil toroid test.
h. Connect brass disks 1, 2, 3, and 4 together and attach the center conductor of the voltmeter lead to the connecting harness. Remove jumper wires from head terminal No. 2 and No. 5 to brass plate. Connect head terminals No. 2 and No. 5 together with jumper wire. Remove oscillator center conductor from head terminal No. 6 and attach it to head terminal No. 3. Connect a jumper from head terminal No. 2 to the shield of the oscillator lead (at the brass plate). Repeat step e. Repeat step f, removing the jumper to the oscillator shield from head terminal No. 2. Record the voltmeter reading. This completes the transmitter coil toroid test.
i. Readings from steps e and f should be not less than 20 dB for the receiver coils and not less than 20 dB for the transmitter coil when calculated in the formula:

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

$$dB = 20 \log \frac{Rf}{Re},$$

where Re = reading of step e, and
Rf = reading of step f, above.

j. Due to variations in heads, it may be necessary to vary ranges on voltmeter. This does not affect validity of test as long as readings of steps e and f do not fall lower than 10 dB above background stray field pickup.

A response of less than 20 dB from any coil, receiver, or transmitter shall constitute failure of this test.

4.6.2.2 Electrical balance. Position the detecting head not less than 3 feet from metallic objects in an ambient temperature of 25° C plus or minus 5° C. Record the output voltage (see 6.3.2), with a power supply voltage of positive 11.50 volts dc plus or minus 0.25 volts dc under the following conditions:

a. Switch in high position.
b. Switch in intermediate position.
c. Switch in low position.

Repeat the above with a power supply voltage of positive 13.75 volts dc plus or minus 0.25 volts dc. Nonconformance to 3.6.2 shall constitute failure of this test.

4.6.2.2.1 Control positions. Using the external control, balance the mine detector to an output voltage of 5 millivolts rms or less with the switch in the intermediate position and a supply voltage of 13.00 volts dc ± 0.25 volts dc at ambient temperature of 25° C ± 5° C. Record the position of the external control. The external control positioned more than two turns from the center of the range shall constitute failure of this test. Record output voltages with the switch in high, intermediate, and low positions. Repeat at power supply voltages of 13.75 ± .25 volts dc and 11.50 ± .25 volts dc. Nonconformance to 3.6.2 shall contitute failure of this test.

4.6.2.3 Detection capabilities.

4.6.2.3.1 First article. Balance the mine detector in air with the detecting head not less than 3 feet from metallic objects. Place in operation under the following conditions:

a. With the switch in the intermediate position and the detecting head 3 inches above soil having a magnetic volume susceptibility of between 13,000 and 15,000 (10^{-6} cgs) with the copper test pin shown on drawing 13204E8857 buried in the vertical position so that its top surface is flush with ground level. The mine detector may be rebalanced after moving the detecting head into the area of the magnetic soil. An equivalent field simulator may be substituted for the magnetic soil and copper test pin. Record the maximum output voltage.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

b. With the detecting head 2 feet under water and 3 inches above the copper test pin buried flush with the water-ground interface and the switch in the high position. Record the maximum output voltage.
c. In air with the copper test pin 3 inches from the top and in the center of each of two electrically opposed receiver coils. Record the output voltage for each of the receiver coils and for each of the switch positions.

Nonconformance to 3.6.3 shall constitute failure of this test.

4.6.2.3.2 Individual. Balance the mine detector in air with the detecting head not less than 3 feet from metallic objects. Place the copper test pin jig in the recess of each of two electrically opposed receiver coils.

a. Record the output voltage for each of these receiver coils for each of the switch positions.
b. Repeat the test, in the intermediate position only, using the cold weather battery adapter and a battery. Nonconformance to 3.6.3 shall constitute failure of this test.

4.6.2.4 Static magnetic rejection. Place the detecting head transmitter coil into the hole on the top of the phasing fixture shown on drawing 13220E5627. Balance the mine detector in the intermediate position to a minimum output voltage not to exceed 5 mVAC rms. Place the magnetite tube shown on drawing 13220E5626 into the slots on the right-hand side of the phasing fixture and, with no adjustment to the detector, measure and record the output voltage. Repeat the measurement with the magnetite tube in the slots on the left-hand side of the phasing fixture. An equivalent test fixture may be used for this test. Nonconformance to 3.6.4 shall constitute failure of this test.

4.6.2.5 Dynamic magnetic rejection. Mount the mine detector on a fixture and balance to a minimum output voltage not to exceed 5 mVAC rms when the switch is in the intermediate position. Sweep the detecting head at a constant rate of 2 feet per second at a height of 3 inches above a test lane. This lane shall be 30 feet long by 4 feet wide by 3 feet deep and shall be filled with soil having a magnetic volume susceptibility of between 13,000 and 15,000 (10^{-6} cgs). The lane shall contain five wood ties 4 inches by 4 inches by 4 feet long, spaced 5 feet apart and oriented perpendicular to the direction of motion, buried so that the top surface is flush with ground level. Record continuously the output voltage during the sweeping operation. An average of the rms output voltage responses obtained from the wood ties of more than 1.5 times the rms output voltage obtained from the copper test pin (see 4.6.2.3.1.a) shall constitute failure of this test. An equivalent field simulator may be substituted for the test lane.

4.6.2.6 Overload recovery time. Position the mine detector in a ambient temperature of 25° C or minus 5° C and no less than 3 feet from metallic objects. Place the switch in the high position and balance the detector to an output voltage less than 15 mVAC rms. Place a 6-inch diameter by 1/8-inch steel disk to within 3 inches of the top side of the detecting head for not less than

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

5 seconds. Remove the steel disk from the detecting head. Record the time required for the output voltage to traverse from a saturated state to balance (less than 15 mVAC rms) on an oscilloscope or oscillograph. Inability of the mine detector to return to balance within 0.5 seconds shall constitute failure of this test.

4.6.2.7 Current drain. With the switch in the high position, place the mine detector in operation in an ambient temperature of 25° C plus or minus 5° C. Use a power supply voltage of positive 13.75 volts dc plus or minus 0.25 volt dc. Measure and record the current drain. A current drain of more than 20 milliamperes shall constitute failure of this test.

4.6.2.8 Low voltage aural monitor. Place the mine detector in an ambient temperature of 25° C plus or minus 5° C. Adjust the power source voltage to 11.25 volts dc, balance the detector in air and reduce the power supply voltage until the low voltage aural alarm is actuated. Measure the power source voltage (see 6.3.2). Nonconformance to 3.6.7 shall constitute failure of this test.

4.6.2.9 Vibration. Test the mine detector, securely fastened to the vibration table to prevent slippage, in accordance with MIL-STD-202, method 201. The mine detector shall have a battery installed and the switch in the off position for the duration of the vibration test. After vibration, examine the mine detector for damage; test in accordance with 4.6.2.2.1. Any damage to the mine detector or failure of 4.6.2.2.1 shall constitute failure of this test.

4.6.2.10 Bounce. Test the detecting set on a package-testing machine capable of maintaining a constant speed of 260 rpm (4-1/3 cycles per second) with an amplitude of 1/2 inch (1 inch total excursion). Place the detecting set between the "fence" with 1-inch spare or "throw." Bounce the detecting set in the three mutually perpendicular directions; that is, the ends, the sides, and the top and bottom of the detecting set case shall be subjected to the bumping, each for a period of 15 minutes (total time 45 minutes). Examine the detecting set for damage; test in accordance with 4.6.2.2.1. Any damage to the detecting set or failure of 4.6.2.2.1 shall constitute failure of this test.

4.6.2.11 Immersion. The detection head assembly and control box assembly, except headset, shall be completely immersed in water such that the uppermost parts of the assemblies are 2 ± 1 inches below the surface of the water. The temperature of the water shall be 25° ± 15° C. The absolute pressure of the air above the water shall be reduced to 24 inches of mercury (absolute) and maintained for 2 minutes. The absolute pressure above the water shall then be increased to 25 inches of mercury and maintained for 15 minutes. Bubbles emanating from within the mine detector shall be considered a leakage; however, bubbles which result from trapped air on the various exterior surfaces of the mine detector shall not be considered a leak. If a leakage occures, the test shall be discontinued and the detector shall be removed from the tank. Examine the mine detector for damage; test in accordance with 4.6.2.2.1. Any leakage, damage to the mine detector, or failure of 4.6.2.2.1 shall constitute failure of this test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

4.6.2.12 Temperature operation and thermal shock. Place the mine detector in the temperature chamber and reduce the temperature to minus 30° C plus or minus 2° C. Maintain this temperature for 3 hours, then remove the mine detector from tne chamber. Test in accordance with 4.6.2.3.2b, starting within 10 minutes and completing within 30 minutes after removal from the chamber, using the cold weather battery adapter assembly from the carrying case, and the sensitivity switch in the intermediate position. This test shall be duplicated for six continuous test cycles. Failure of 4.6.2.3.2b shall constitute failure of the low temperature operation test. Place the mine detector (removed from its carrying case and without the cold weather battery adapter assembly) in the chamber and increase the temperature to 50° C plus or minus 2° C. Maintain this temperature for 3 hours, then remove the mine detector from the chamber. Test in accordance with 4.6.2.3.2a, starting within 10 minutes and completing within 30 minutes after removal from the chamber. This test shall be duplicated for six continuous test cycles. Failure of 4.6.2.3.2a shall constitute failure of the high-temperature operation test. For conformance sample testing, under this paragraph, only one test cycle is required.

4.6.2.13 High-temperature and humidity storage. Test the detecting set in accordance with MIL-STD-202, method 106, except the upper temperature limit shall be plus 70° C plus or minus 2° C and step 7 shall not be performed. Polarization and loading voltages are not applicable. Upon completion of step 6 (see MIL-STD-202, method 106) of the final cycle, the detecting set shall be removed from the chamber to an ambient temperature of 25° C plus or minus 5° C. Remove the mine detector from its carrying case, examine for damage, and test in accordance with 4.6.2.2.1. Any damage to the mine detector or failure of 4.6.2.2.1 shall constitute failure of this test.

4.6.2.14 Low temperature and altitude storage. Place the detecting set in the altitude test chamber. Reduce the internal absolute pressure to 5.5 inches of mercury (corresponding to an altitude of 40,000 feet above sea level) and reduce the temperature to minus 55° C plus or minus 2° C. Maintain this pressure and temperature for 72 hours. The pressure in the chamber shall then be increased at a rate of not less than 3.0 inches of mercury per minute until atmospheric pressure has been reached. Remove the mine detector from its carrying case and at least 2 hours later, examine for damage and test in accordance with 4.6.2.2.1. Any damage to the mine detector or failure of 4.6.2.2.1 shall constitute failure of this test.

4.6.2.15 Drift temperature cycling, solar radiation and shade.

a. Temperature cycling. Place the mine detector in a temperature chamber (see 3.6.13) with the detecting head not less than 3 feet from metallic objects at an ambient temperature of 25° C plus or minus 5° C. With the switch in the intermediate position, balance the mine detector to an output voltage of 5 mVAC rms or less. Change the chamber temperature at a rate not to exceed 0.5° C per minute first to 5° C below the initial temperature, then to 5° C above the initial temperature and then back to the initial ambient temperature. Subject the mine detector to four continuous cycles as specified above within

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

a time of 48 minutes plus or minus 8 minutes per cycle. Measure the output voltage. An output voltage of more than 50 mVAC rms shall constitute failure of the temperature cycling drift test.

b. Solar radiation and shade. Position the mine detector in a chamber (or equivalent environment) with the detecting head not less than 3 feet from metallic objects at an ambient temperature of 25° C plus or minus 5° C. With the switch in the intermediate position, balance the mine detector to an output voltage of 5 mVAC rms or less. Using lamps (see 3.6.13.2), whose radiation approximates the spectral characteristics of sun radiation, apply radiation of not less than 360 Btu per square foot per hour to the top of the detecting head for a period of 10 minutes (see 3.6.13). Turn off the lamps for a period of 30 minutes. Subject the mine detector to four continuous cycles as specified above. Measure the output voltage at the end of each 30-minute off period. An output voltage of more than 50 mVAC rms shall constitute failure of this solar radiation and shade drift test. After successful completion of the above tests, test in accordance with 4.6.2.3.2a. Failure of 4.6.2.3.2a shall constitute failure of this test.

4.6.2.16 Drift, null. Place the mine detector in an ambient temperature of 25° C plus or minus 5° C and no less than 3 feet from metallic objects. Place the switch in the high position and balance the detector to an output voltage less than 15 mVAC rms. Remeasure this output voltage after 30 minutes. A voltage change of greater than 15 mvac shall constitute failure of this test.

4.6.2.17 Reliability. Turn each mine detector on and leave it on to determine acceptance or rejection in accordance with MIL-STD-781, Test Plan IIIC (see 3.7). Each mine detector tested shall operate at least one-half the average of all mine detectors on the test. An external power supply may be used. Test the mine detector after each 24 hours of operation in accordance with 4.6.2.2.1 and 4.6.2.3.2. At completion of reliability test, each detector shall be subjected to tests in paragraphs 4.6.2.1 through 4.6.2.8, except that 4.6.2.3.1 and 4.6.2.5 shall not be performed. For purposes of determining the MTBF, a failure is defined as any malfunction, degradation, or performance outside specified limits, or personnel and equipment hazard. Nonconformance to 3.7 or inability to pass the above tests specified in this paragraph shall constitute failure of this test.

4.6.2.18 Safety. The mine detector shall be examined initially and observed throughout testing to determine compliance with 3.10. Nonconformance shall constitute failure of the safety requirement.

4.7 Inspection comparison. The Government may select detecting sets at any time during the contract production period and subject these detecting sets to the examination and tests specified in 4.4 to determine conformance to the requirements of this specification. The inspection will be performed by the Government, at a site selected by the Government, on units selected at random from those which have been accepted by the Government and will not include the previously inspected first article detecting sets. In addition to any test

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

specified as part of the inspection comparison, the Government reserves the right to conduct any and all other tests contained in this specification as part of the inspection comparison and failure of such additional tests shall have the same effect as failure of those tests specified as inspection comparison.

4.7.1 Inspection failure. Failure of an inspection comparison detecting set to meet any requirement specified herein and as a result of the examination and tests specified in 4.7 shall be cause for rejection of the inspection comparision detecting set(s) and shall be cause for refusal by the Government to continue acceptance of production detection sets until evidence has been provided by the contractor that corrective action has been taken to eliminate the deficiencies. Correction of such deficiencies shall be accomplished by the contractor at no cost to the Government on detecting sets previously accepted and produced under the contract. Any deficiencies found as a result of the inspection comparison will be considered prima facie evidence that all detecting sets accepted prior to the completion of inspection comparison are similarly deficient unless evidence to the contrary is furnished by the contractor and such evidence is acceptable to the contracting officer.

4.8 Inspection of packaging.

4.8.1 Quality conformance inspection of pack.

4.8.1.1 Unit of product. For the purpose of inspection, a complete pack prepared for shipment shall be considered a unit of product.

4.8.1.2 Sampling. Sampling for examination shall be in accordance with MIL-STD-105.

4.8.1.3 Examination. Samples selected in accordance with 4.8.1.2 shall be examined for the following defects. AQL shall be 2.5 percent defective.

106.	Case not closed, secured, and tamperproof seals attached as specified.
107.	Box not as specified for level A.
108.	Pallet not as specified for level A.
109.	Load arrangement not as specified for level A.
110.	Height greater than specified for level A.
111.	Strapping not as specified for level A.
112.	Battens not positioned and secured as specified for level A.
113.	Packing not in accordance with the referenced document for commercial.
114.	Marking missing, illegible, incorrect, or incomplete for level A or commercial.

5. PACKAGING

5.1 Preservation (see 6.7). Components comprising a complete detecting set shall be placed within the case as provided for. The case shall be closed and secured by the attached clasps. A minimum of two tamperproof seals shall be attached to the clasps in a manner that the case cannot be opened without destroying the seals.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

5.2 Packing. Packing shall be level A or commercial, as specified (see 6.2).

5.2.1 Level A. Each detecting set shall be individually packed in a close-fitting box conforming to PPP-B-636, Grade V3c. Closure shall be in accordance with the appendix to the box specification. Unless otherwise specified (see 6.2), the packed detecting sets shall be palletized. The pallets shall conform to NN-P-71, Type IV. Load arrangement shall conform to load pattern 3, Appendix D, of MIL-STD-147. The height of the pallet including the load shall not exceed 43 inches. The detecting sets shall be secured to the pallet with a total of five primary and secondary straps. Straps shall conform to QQ-S-781, Type I or IV, Finish A. Wood battens of not less than 1/2-inch thickness and not less than 2 inches wide shall be positioned under the vertical portions of the straps and straps held in place by staples.

5.2.2 Commercial. Detecting sets shall be packed in accordance with MIL-STD-1188.

5.3 Marking (see 6.7).

5.3.1 Military. Marking for military levels of protection shall be in accordance with MIL-STD-129.

5.3.2 Commercial. Marking for commercial packaging shall be in accordance with MIL-STD-1188.

6. NOTES

6.1 Intended use. This specification covers a detecting set intended for use over all types of terrain for the location of buried metallic antipersonnel and antitank mines.

6.2 Ordering data. Acquisition documents should specify the following:

a. Title, number and date of this specification.
b. Date of issue of DoDISS applicable and exceptions thereto (see 2.1.1).
c. The relevant top assembly will be specified by the contracting officer.
d. Whether batteries are to be furnished (see 3.2).
e. Time frame required for submission of the first article and number of detecting sets to be furnished (see 3.1).
f. Whether the Government will conduct any or all of the first article examination and tests. When the Government will conduct some but not all of the first article examination and tests, the contracting officer should specify which examination and tests will be conducted by the Government and which examination and tests shall be conducted by the contractor (see 3.1).
g. Degree of packing required (see 5.2).
h. Whether palletization is required (see 5.2.1).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

6.3 Definitions.

6.3.1 Nonmetallic medium. Air, all types of soils including those having a magnetic volume susceptibility of between 13,000 and 15,000 (10^{-6} cgs), fresh or sea water, ocean beaches, wood, and all surfacings except those with metal reinforcing.

6.3.2 Output voltage. The rms voltage at a frequency of 625 ± 10 Hz developed across the headset.

6.3.3 Definition of QAP. A QAP is a contractual requirment that supplements Section 4 of the specification. QAP indicates the minimum requirements which must be inspected on the product drawings to verify the design objectives of the product and assure interchangeability of repair parts.

6.4 First article. Any changes or deviations of production detecting sets from the approved first article unit(s) during production will be subject to the approval of the contracting officer. Approval of the first article unit(s) will not relieve the contractor of his obligation to furnish detecting sets conforming to this specification.

6.5 Quality assurance provisions (QAP). The contracting officer should require the contractor to maintain records of all QAP inspections. A suggested paragraph is as follows:

> "The contractor shall maintain complete records of all examinations and tests performed to verify the requirements of classified QAP characteristics. The records shall include as a minimum, lot size, sample size, drawing requirement, actual measurement, number, and type of deficiencies found, quantity approved, quantity rejected, and corrective action taken when applicable."

6.6 Government-furnished facilities. When requested by the contractor, the contracting officer should contact the U.S Army Mobility Equipment Research and Development Command, ATTN: DRDME-NE, Fort Belvoir, VA 22060, to determine the availability of the Magnetic Test Lane at Fort Belvoir, VA, for use by the contractor in performance of the test required in 4.6.2.5 (see 4.6.2).

6.7 Preservation. Degrees of preservation have not been included as the preservation specified is the minimum acceptable for any degree of protection. For purposes of preservation/packing level marking, the preservation shall be considered level A.

6.8 Data requirements. The contracting officer should include requirements for such data as technical publications, instructional materials, illustrated parts lists, and contractor's maintenance and operation manual to be furnished with each detecting set.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

6.9 Provisioning. The contracting officer should include provisioning requirements for repair parts and maintenance tools as necessary (including any special tools), and instructions on shipment of detecting sets.

6.10 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of the specification (see 3.3).

Custodian:
Army - ME
Navy - MC
Air Force - 99

Preparing activity:
Army - ME

Project 6665-0432

Review activity:
Air Force - 82

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

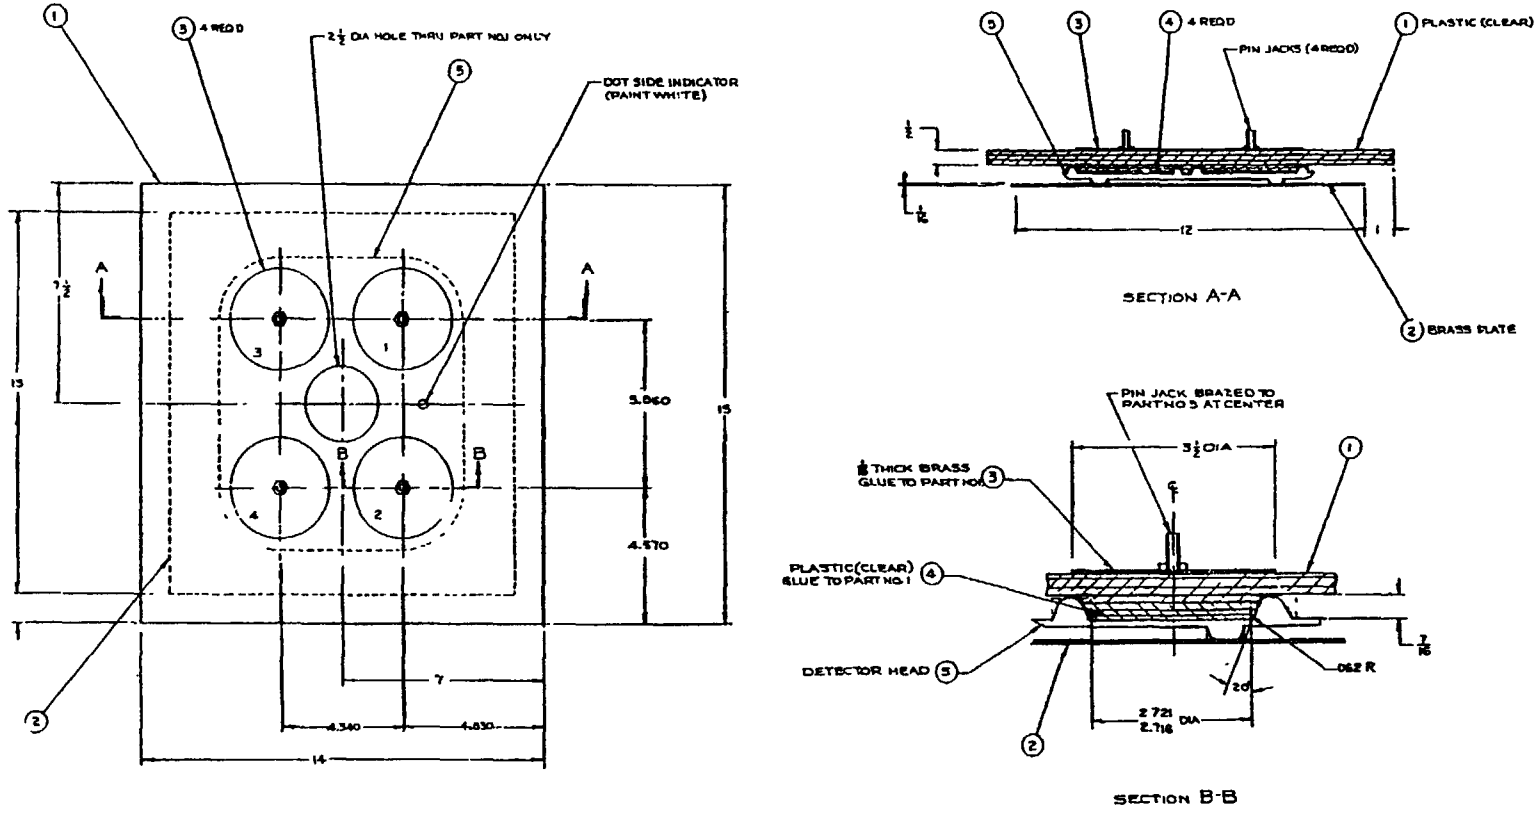


FIGURE 1. SEARCH HEAD TEST JIG (TRANSISTORIZED MINE DETECTOR)

NOTES:

1. Unless otherwise specified, all dimensions are in inches.
2. Unless otherwise specified, tolerance on inch-dimensions shall be ± 0.062.

X-2629

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

X-2630A

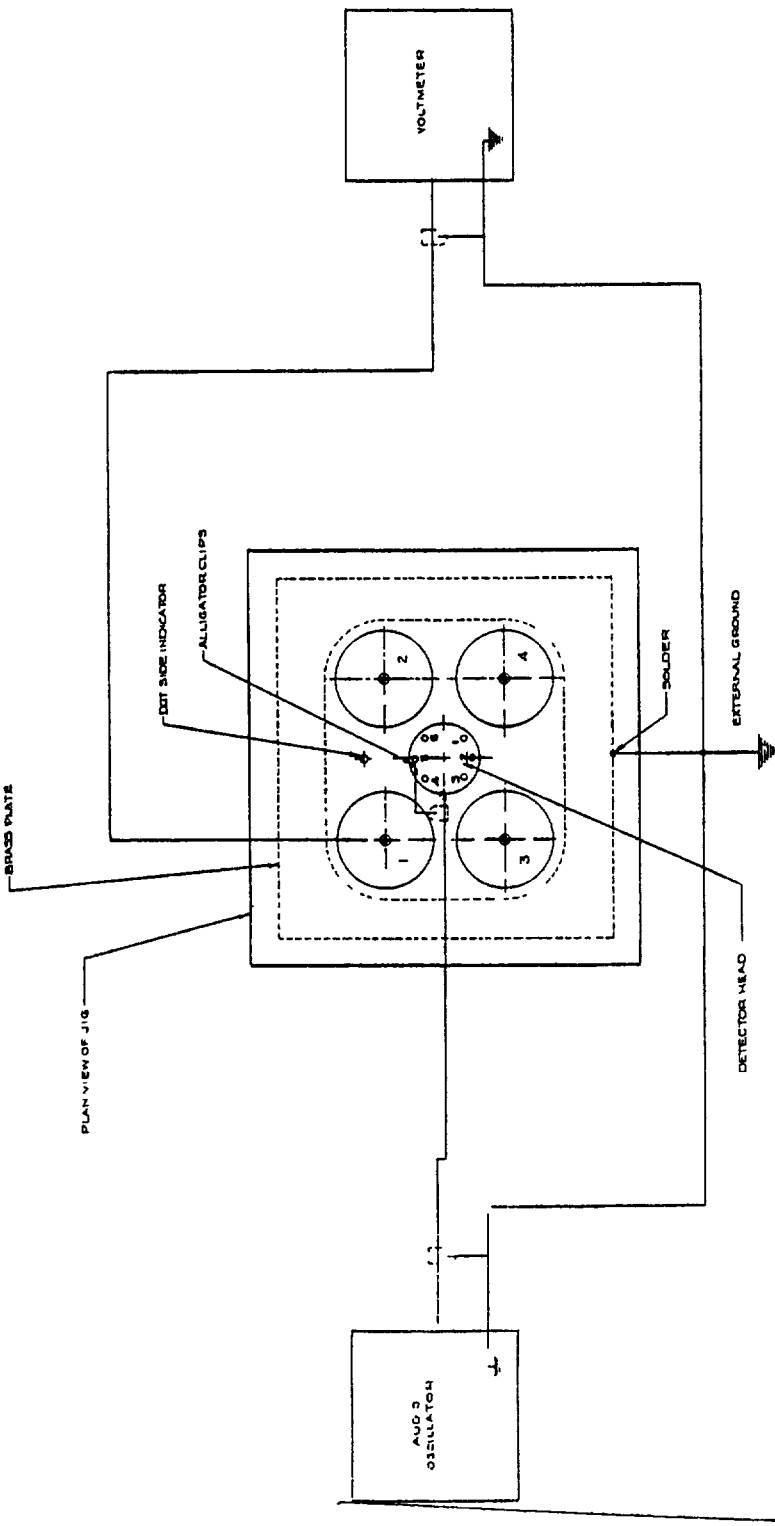


FIGURE 2. SEARCH HEAD TOROIDAL WINDING TEST CIRCUIT (TRANSISTORIZED MINE DETECTOR)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS This form is provided to solicit beneficial comments which may improve this document and enhance its use DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-D-23359F Detecting Set, Mine, Portable, Metallic

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1 ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO

DATE

DD FORM 1 OCT 76 1426 EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

BUSINESS REPLY CARD

FIRST CLASS PERMIT NO 12062 WASHINGTON D C

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
USA Mobility Equipment R & D Command
Attn: DRDME-DS
Ft. Belvoir, VA 22060

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T16:30Z
Check the source to verify that this is the current version before use.