MIL-B-60426A(MU)
16 January 1969
SUPERSEDING
MIL-B-60426(MU)
16 June 1967

MILITARY SPECIFICATION

BURSTER, PROJECTILE, XM54, LOADING, ASSEMBLING AND PACKING

1. SCOPE

1.1 This specification covers the loading, assembling and packing of one burster designated as Burster, Projectile, XM54E1.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-2550 - Ammunition and Special Weapons, General Specification for
MIL-I-45607 - Inspection Equipment, Supply and Maintenance of

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)
MIL-STD-109 - Quality Assurance Terms and Definitions
MIL-STD-453 - Inspection, Radiograph
MIL-STD-1168 - Lot Numbering of Ammunition
MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes

FSC: 1320

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

DRAWINGS

ARMY

8799210 - Carton, Packing, Ammunition, for Charge, Burster, XM54E1
8799211 - Box, Packing, Ammunition for Charge, Burster, XM54E1
9212564 - Elastomer (Liquid Urethane Rubber)
9238839 - Projectile, Burster, XM54E1 Assembly

PUBLICATIONS

ARMY

ET-9238839 - Equipment Tabulation

(Copies of specifications, standards, drawings and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Material.-Materials shall be in accordance with applicable drawings and specifications, (see 6.5).

3.1.1 Clean explosive scrap.-Clean explosive scrap produced in regular operations may be remelted and reused. Scrap from floor sweeping, ventilation and suction apparatus (other than from drilling operations specifically controlled to prevent contamination of explosive) shall not be used, (see 6.5).

3.2 Burster.-The burster shall comply with all requirements specified on Drawing (dwg.) 9238839 and with all requirements specified in applicable specifications.

3.3 Cavitation

3.3.1 Area from the top of the base plug to one inch above the top of the plug. There shall be no single cavity having a projected length of more than 1/8 inch or a sum total of cavities of more than 1/64 square inch. There shall be no cracks or annular rings in the charge in this area except that cracks less than 1/32 inch wide shall be disregarded.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

3.3.2 Area from top of charge to one inch from top of base plug.-There shall be no single cavity having a projected length of more than 3/8 inch or a sum total of cavities of more than 3/8 square inch and there shall be no more than three transverse cracks over 1/32 inch wide, in this area cracks less than 1/32 inches wide shall be disregarded.

3.3.3 Porosity.-Porous areas shall be treated as cavities, and shall be subjected to restrictions placed upon cavities, except that 80 percent of the projected length and 80 percent of the projected area shall be considered for acceptance purposes.

3.3.4 Void between charge and base.-There shall be no void greater than 1/32 of an inch between the charge face and the face of the base.

3.4 Resin.-The resin content shall be 2 percent minimum when tested as specified in 4.3.2.1.

3.5 Workmanship

3.5.1 All parts shall be fabricated and finished in a thorough, workmanlike manner. They shall be clean and free of burrs, sharp edges, unblended radii, cracks, surface defects, chips, dirt, grease, rust and other foreign matter. The cleaning method used shall not be injurious to any parts nor shall the parts be contaminated by the cleaning agent. All required markings shall be neat and sharply defined.

3.5.2 Loading of high explosive.-The interior surface of the burster shall be dry when the high explosive is poured into the burster. Solid explosives shall not be present in the burster before loading or be added to the burster during pouring or cooling.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.-Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to Standard MIL-STD-109 in order to define terms used herein. The provisions of Specification MIL-A-2550 shall apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

4.1.1 Submission of product.-At the time the completed lot of product is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the quality assurance provisions specified within this specification.

b. Number of units of product inspected.

c. Results obtained, by defect code, for all inspections performed.

d. Drawing, specification number and date, together with an identification and date of changes.

e. Certificates of conformance on all material purchased by the contractor when such material is controlled by Government or commercial specification referenced in any of the contractual documents.

f. Number of items in the lot.

g. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.2 Inspection provisions

4.2.1 Lot formation.-The term "lot" as used throughout this specification refers to an inspection lot, which is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance of the lot with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the lot has been produced by one manufacturer, in one unchanged process using the same materials and methods, in accordance with the same drawings, same drawing revisions, same specifications and same specification revisions. Changes to the process, specifications, or drawings, not affecting safety, performance interchangeability, or storage, as determined by the Government, shall not be deemed to alter the homogeneity of the lot. Inspection lots shall comply with MIL-STD-105. Unless otherwise approved by the contracting officer, the inspection lot size of

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

end items deliverable under the contract shall be not less than the smallest weekly estimate of quantities contractually scheduled for production during the contract period nor more than the largest monthly quantity contractually scheduled for delivery during the contract period. Inspection lots of components or subassemblies, other than the items of delivery, shall be homogeneous and of a size mutually convenient to both the contractor and the Government inspector. Lot numbering, as required, shall be in accordance with MIL-STD-1168. Each lot shall contain:

a. Cyclotol of one type from one manufacturer.
b. TNT of one grade from one manufacturer.
c. Polyurethane elastomer prepolymer from one manufacturer.
d. Glyceride of 12 - Hydroxy Stearic acid from one manufacturer.
e. Parts produced by one manufacturer in accordance with same drawing and same drawing revision.

4.2.2 Examination.-Inspection for Critical defects (and Major defects, when so specified) shall be 100 percent. Sampling plans and procedures for Major and Minor defects shall be in accordance with MIL-STD-105 except that continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the procuring activity. Also, at the option of the procuring activity, AQL's and sampling plans may be applied to individual characteristics listed using an AQL of 0.65 percent for each Minor defect and an AQL of 0.40 percent for each Major defect, except where 100 percent inspection is specified. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.2.4.

4.2.2.1 Plug, base (see dwg. 9238843 covering a detail of dwg. 9238839).

Categories	Defects	Method of Inspection	Code No. (see 6.2)
Critical: None defined.			
Major: None defined.			
Minor:	AQL 2.50 percent		
201.	Large diameter, minimum (min) .	Gage	01001
202.	Small diameter, min.	Gage	01002
203.	Total length	Gage	01003
204.	Distance to shoulder of large diameter	Gage	01004
205.	Chamfer missing	Visual	01005
206.	Evidence of poor workmanship (see 3.5)	Visual	01006

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

4.2.2.2 Tube, burster, prior to coating (see dwg. 9238842 covering a detail of dwg. 9238839)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	None defined.		
Minor:	AQL 1.5 percent		
201.	Total length, min.	Gage	02001
202.	Diameter, min.	Gage	02002
203.	Wall thickness	Gage	02003
204.	Evidence of poor workmanship (see 3.4)	Visual	02004

4.2.2.3 Tube, burster (see dwg. 9238842 covering a detail of dwg. 9238839)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Interior or exterior surface not completely painted	Visual	03001
102.	Foreign matter in interior	Visual	03002
Minor:	None defined.		

4.2.2.4 Assembly (see dwg. 9238839)

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Base plug missing	Visual	04001
2.	Burster tube cracked	Visual	04002
3.	Explosive charge loose in container	Manual	04003
4.	"Up" arrow points in wrong direction	Visual	04004
5.	Closure missing	Visual	04005
Major:	AQL 0.40 percent		
101.	Total length	Gage	04006
102.	Chamber gage	Gage	04007

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

Minor:	AQL 1.50 percent		
201.	Closing disc ruptured	Visual	04008
202.	Closing disc or base plug incompletely sealed	Visual	04009
203.	Evidence of poor workmanship (see 3.4)	Visual	04010

4.2.2.5 Carton prior to sealing (see dwg. 8799210)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Burster projectile missing ...	Visual	05001
Minor:	AQL 0.65 percent		
201.	Any packing component missing.	Visual	05002

4.2.2.6 Sealed carton (see dwg. 8799210)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Tape improperly applied	Visual	06001
Minor:	AQL 1.00 percent		
201.	Marking misleading or unidentifiable	Visual	06002
202.	Contents loose upon shaking ..	Manual	06003

4.2.2.7 Carton in bag, sealed (see dwg. 8799210)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Bag improperly sealed, torn or cut	Visual	07001
Minor:	None defined.		

4.2.2.8 Sealed wood packing box (see dwg. 8799211)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

Major:	AQL 0.40 percent		
101.	Box damaged	Visual	08001
102.	Strapping missing, broken or loose	Visual-Manual	08002
Minor:	AQL 1.50 percent		
201.	Strapping improperly assembled	Visual	08003
202.	Lid improperly assembled	Visual	08004
203.	Markings misleading or unidentifiable	Visual	08005
204.	Contents loose in box	Manual	08006

4.2.3 Testing

4.2.3.1 Cavitation (see 3.3).-Cavitations defects are classified as follows:

Critical Code No. 04012

Any cavity, crack or annular ring in the area from the top of the base plug to one inch above the top of the plug except cracks less than 1/32 inch (see 3.3.1). Any void between charge and base plug in excess of 1/32 inch (see 3.3.4).

Major Code No. 04013

Cavitation or cracks in excess of that permitted by 3.3.2 and 3.3.3.

The sampling plan and procedure for this test for both critical and major defects shall be in accordance with Standard MIL-STD-1235 using a CSP-2 plan having an AQL of 0.25 percent except that when a critical defects is found, 100 percent inspection for i successive defect free units (for both criticals and majors) shall be required immediately instead of continuing f phase of the plan; inspection shall continue at the same frequency until the homogeneity requirement is fulfilled or 100 percent inspection by the procuring activity. The test shall be performed as specified in 4.3.1.

4.2.3.2 Composition (see dwg. 9212564) Major defect, Code No. 09001.-Ten bursters shall be randomly selected from each lot. A sample of composition B-5 shall be taken from an area located one inch from the bottom of each tube, and combined with a sample taken from an area located one inch from the top of the same tube. This procedure shall yield ten composite samples, one from each burster. If any one sample fails to comply with any of the requirements specified, the burster lot shall be rejected. The tests shall be performed as specified in 4.3.2.

4.2.4 Inspection Equipment.-Equipment Tabulation Number ET-9238839 identifies the inspection equipment required to perform the examinations and tests prescribed in this section. The contractor shall design inspection equipment in accordance with the instructions in paragraph 6.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

4.2.4.1 Government rights to documentation.-Inspection equipment drawings and lists provided and revised in accordance with the requirements of the ET may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

4.2.4.2 Supply and maintenance.-Supply and maintenance of the equipment listed on the ET shall be in accordance with Specification MIL-I-45607.

4.2.4.3 Government use of contractor's inspection equipment. The contractor shall make available to the Government all inspection equipment necessary for determining conformance with contract requirements. Personnel for operating the equipment and verification of its accuracy shall be supplied by the contractor for the performance of examination or test by the Government.

4.3 Test methods and procedures

4.3.1 Determination of cavities.-The sample bursters shall be subjected to x-ray examination. In all explosures the x-ray beam shall form a 90 degree angle with the longitudinal axis of the projectile. Examination of the x-ray negative shall be made to determine compliance with applicable requirements.

Note.-Radiographic equipment, operations and procedures shall be qualified in accordance with MIL-STD-453. In addition, the sensitivity of x-ray technique shall be 2.0 percent, and the photographic density of the film used shall be no less than 1.25 as determined in accordance with 4.3.1.1 and 4.3.1.2. In the event an original x-ray picture leaves doubt as to acceptability, the burst shall be re-x-rayed at an angle 90 degrees from that of the original exposure and in the same plane.

4.3.1.1 Check of sensitivity of x-ray technique.-The sensitivity of x-ray technique shall be determined by means of a penetrameter fabricated as specified herein. The penetrameter shall be placed on the side of the burster away from the film (source side). Observation shall be made of the image of the penetrameter on the x-ray film. The sensitivity of x-ray technique shall be considered satisfactory when the image of the penetrameter, including the T2 hole, is sharply defined on the x-ray film. Unless otherwise specified, the penetrameter shall be made of steel having an approximate specific gravity of 7.8.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

The thickness of the penetrameter shall be based on a combination of both charge and steel thickness and shall be equal to 2.0 percent of the maximum equivalent thickness. The penetrameter shall have a hole, the diameter of which is twice the thickness of the penetrameter. For further details on construction of the penetrameter see MIL-STD-453. The actual thicknesses may be determined from a radiograph of the metal parts. The penetrameter thickness shall be determined as illustrated in Figure 1 of this specification.

4.3.1.2 Check of photographic density of film.-The photographic density of the film shall be determined on the film in a region of sound charge plus metal corresponding to that portion of the material which is of the greatest combined thickness to be examined on the negative. To judge densities, it is recommended that standards of radiographic densities be used (see 6.4). Comparison of film with standards may be made visually however, the use of a densitometer is recommended.

4.3.2 Composition (see 6.6).

4.3.2.1 Resin.-To an accurately weighed 1 gram (gm.) specimen contained in 250 milliliter (ml.) Erlenmeyer flash 100 ml. of 70 percent by volume acetic acid shall be added. The flask shall be fitted with an air condenser placed on a steam bath and heated for two hours with frequent shaking. While still warm the insoluble residue of the flask shall be transferred to a tared medium or coarse porosity fritted glass crucible. The residue shall be washed with 50 ml. of 70 percent acetic acid, then with 25 ml. of water. The crucible shall be dried to constant weight in a vacuum desiccator or shall be dried in oven at 70 degrees Centigrade for 2 hours. The insoluble residue shall be calculated as the percent resin.

4.3.2.2 TNT content.-An accurately weighed portion of exactly 1.000 gm. of the sample shall be placed in a 100 ml. volumetric flask. About 60 ml. of benzene saturated with RDX shall be added The flask shall be loosely stoppered and placed on a steam bath for 5 to 10 minutes and occasionally swirled. The flash shall be removed from the steam bath and cooled to room temperature. The flask shall be filled to the mark with saturated benzene and shaken well. The undissolved RDX shall be allowed to settle to the bottom. Using a pipet, 20 ml. of the clear supernatent solution shall be transferred to a 500 ml. carbon dioxide (CO sub 2) titration flask. The air shall be swept out using a stream of CO sub 2. The flow of CO sub 2 shall be continued throughout the determination. Twenty five ml. of acetic acid and 25 ml. of concentrated hydrochloric acid shall be stirred by means of a magnetic stirrer for 10 minutes. Exactly 100 ml. of 0.2 normal (N)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

chromous chloride solution shall be added to the flask and again stirred for 10 minutes. Then 15 drops of a 2 percent aqueous solution of phenosafranin indicator shall be added. The solution shall be titrated with 0.15 N ferric ammonium sulfate solution to a sharp color change from green to deep red. A blank determination shall be run. The percent TNT shall be calculated as follows:

$$\text{Percent TNT} = \frac{6.310\ (N)\ (A - B)}{W}$$

where:

B = ml. of ferric ammonium sulfate used to titrate the sample

A = ml. of ferric ammonium sulfate used to titrate the blank

N = Normality of the ferric ammonium sulfate solution

W = Weight of the sample

4.3.2.3 RDX content.-An accurately weighed portion of exactly 0.5000 gm. of sample shall be placed in a 100 ml volumetric flask. About 60 ml of acetic acid shall be added. The flask shall be heated on a hot plate until the sample is completely dissolved. The flask shall be removed from the hot plate and allowed to cool to room temperature. The flask shall be filled to the mark with acetic acid and shaken well. Using a pipet 20 ml. of contents shall be transferred to a 500 ml. CO sub 2 titration flask. The air shall be swept out using a stream of CO sub 2. The flow of CO sub 2 shall be continued through out the determination. Twenty five ml. of concentrated hydrochloric acid shall be added to the titration flask. The contents shall be stirred by means of a magnetic stirrer for 10 minutes. Exactly 100 ml. of 0.2 N chromous chloride solution shall be added to the flask and again stirred for 10 minutes. Then 15 drops of a 2 percent aqueous solution of phenosafranin indicator shall be added. The solution shall be titrated with 0.15 N ferric ammonium sulfate solution to a sharp color change from green to deep red. A blank determination shall be run. The percent RDX shall be calculated as follows:

$$\text{Percent RDX} = \frac{6.165\ (N)\ (2\ (C - D) - (A - B)}{W}$$

where:

C = ml. of ferric ammonium sulfate used to titrate the blank

D = ml. of ferric ammonium sulfate used to titrate the sample

A = ml. of ferric ammonium sulfate used to titrate the blank in the TNT determination

B = ml. of ferric ammonium sulfate used to titrate the sample in the TNT determination

N = normality of ferric ammonium sulfate solution

W = weight of sample used in TNT

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging

5.1.1 Level C.-The XM54E1 projectile burster shall be preserved and packaged in accordance with dwg. 8799211.

5.2 Packing

5.2.1 Level C.-The cartons shall be packed in accordance with dwg. 8799210.

5.3 Marking.-The cartons and boxes shall be marked in accordance with dwg. 8799210 and 8799211 as applicable.

6. NOTES

6.1 Ordering data.-Procurement documents shall specify the following:

a. Title, number and date of this specification.

b. Data cards.-Data cards shall be prepared for each lot in accordance with the information specified in Standard MIL-STD-1167.

6.2 Inspection code numbers.-The five digit code numbers assigned to the inspections herein are to facilitate future data collection and analysis by the Government.

6.3 Inspection equipment.-The contractor shall design inspection equipment as required by the inspection Equipment Lists (EL) referenced on the applicable ET in accordance with the instructions of paragraphs 6.3.1 through 6.3.5.

6.3.1 Inspection equipment lists (EL).-Inspection equipment lists indicate the availability of inspection equipment designs by showing in the "number" column of the list of inspection equipment (Form SMUPA 1010) the numbers of drawings or Federal Stock numbers of existing equipment designs, or codes as indicated in paragraph 6.3.2. Design action required of the contractor is described in paragraphs 6.3.3 and 6.3.4. The contractor will be required to prepare detailed drawings in accordance with 6.3.4 for all the equipment coded as "Contractor Design" in the number column. These contractor designs must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

6.3.2 Inspection equipment list codes.-The inspection equipment as defined in 6.3.3 and 6.3.4 will be designated in the EL by the following codes:

CD - Contractor design on controlled contractor format and/or commercial equipment.
MU - Army design, mandatory for use.

6.3.3 Army designs.-Army designs are reflected on detailed drawings which completely depict all the information necessary for the fabrication of the item of inspection equipment. The contractor need provide no design when an Army design is listed for an item of inspection equipment. Army designs fall into two basic classifications; mandatory (designated "MU") and non-mandatory (indicated by drawing or Federal Stock Number). When an inspection equipment list references mandatory Army designs, the contractor shall comply with, and use these designs accordingly. The contractor may, however, in connection with non-mandatory designs, and with the approval of the Government, design alternate inspection equipment or use comparable commercial equipment to facilitate his operations. Such contractor prepared designs or commercial equipment selections must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

6.3.4 Contractor designs.-Contractor designs are designs of inspection equipment for which the Government has assigned design responsibility to the contractor. Contractor designs shall be supported by detailed drawings which depict all information necessary to completely fabricate, calibrate and operate an item of inspection equipment. This requires that the necessary views, dimensions, materials, finish, notes, operating and calibration instructions be properly depicted in accordance with approved practices to the extent that further calculation or clarification will not be required. Unless otherwise specified, contractor designs may be developed on the format the contractor normally employs in his equipment design procedure provided such format reflects the detail and information specified above, subject to the following controls: All submitted contractor designs shall conform to MIL-D-1000, Category E, Form 2. Legibility and reproducibility shall permit conventional making of clearly understandable, high contrast reproductions. Contractors shall submit three copies of final designs as a flat set. Designs shall be submitted for approval as specified in 6.3.5.

6.3.5 Submission of contractor designs.-All submitted designs shall contain a reference to the applicable five digit Code Number contained in Section 4 of this specification and the appropriate component or assembly drawing number and revision

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

letter to which the specific design applies. Unless otherwise specified on the EL, all designs of equipment for inspection of defects classified as critical and major shall be submitted for approval to the Commanding Officer, Picatinny Arsenal, ATTN: SMUPA-ND. All other designs of inspection equipment shall be approved by the inspection element of the agency administering the contract; submission shall be as directed by the contracting officer. Partial submission of inspection equipment designs is permissible and encouraged. However, the Arsenal completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will be accomplished normally within one month after receipt.

6.4 Film density.-"American Standard for Diffuse Transmission Density" published by American Standards Association, 70 East 40th Street, New York, N. Y., has been found satisfactory as a source of information of film densities.

6.5 Clean explosive scrap.-Clean explosive scrap is defined as scrap formed in kettles, pails, risers and loading machines used in the pouring and cooling operations, and scrap formed during the drilling operations.


6.6 Chromous chloride solution.-Method for the preparation of 0.2 N chromous chloride solution may be found in Picatinny Arsenal Technical Memorandum No. ACS-360, "Determination of Nitrogeneous Compounds of Ordnance Interest by Chromous Chloride Reduction (1) Compounds Containing Nitro and Nitramine Groups" by Charles C. Jamison dated May 1960 which may be obtained from Picatinny Arsenal, Dover, New Jersey.

Custodian:
Army-MU

Preparing activity:
Army-MU

Project Number: 1320-A-150

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.

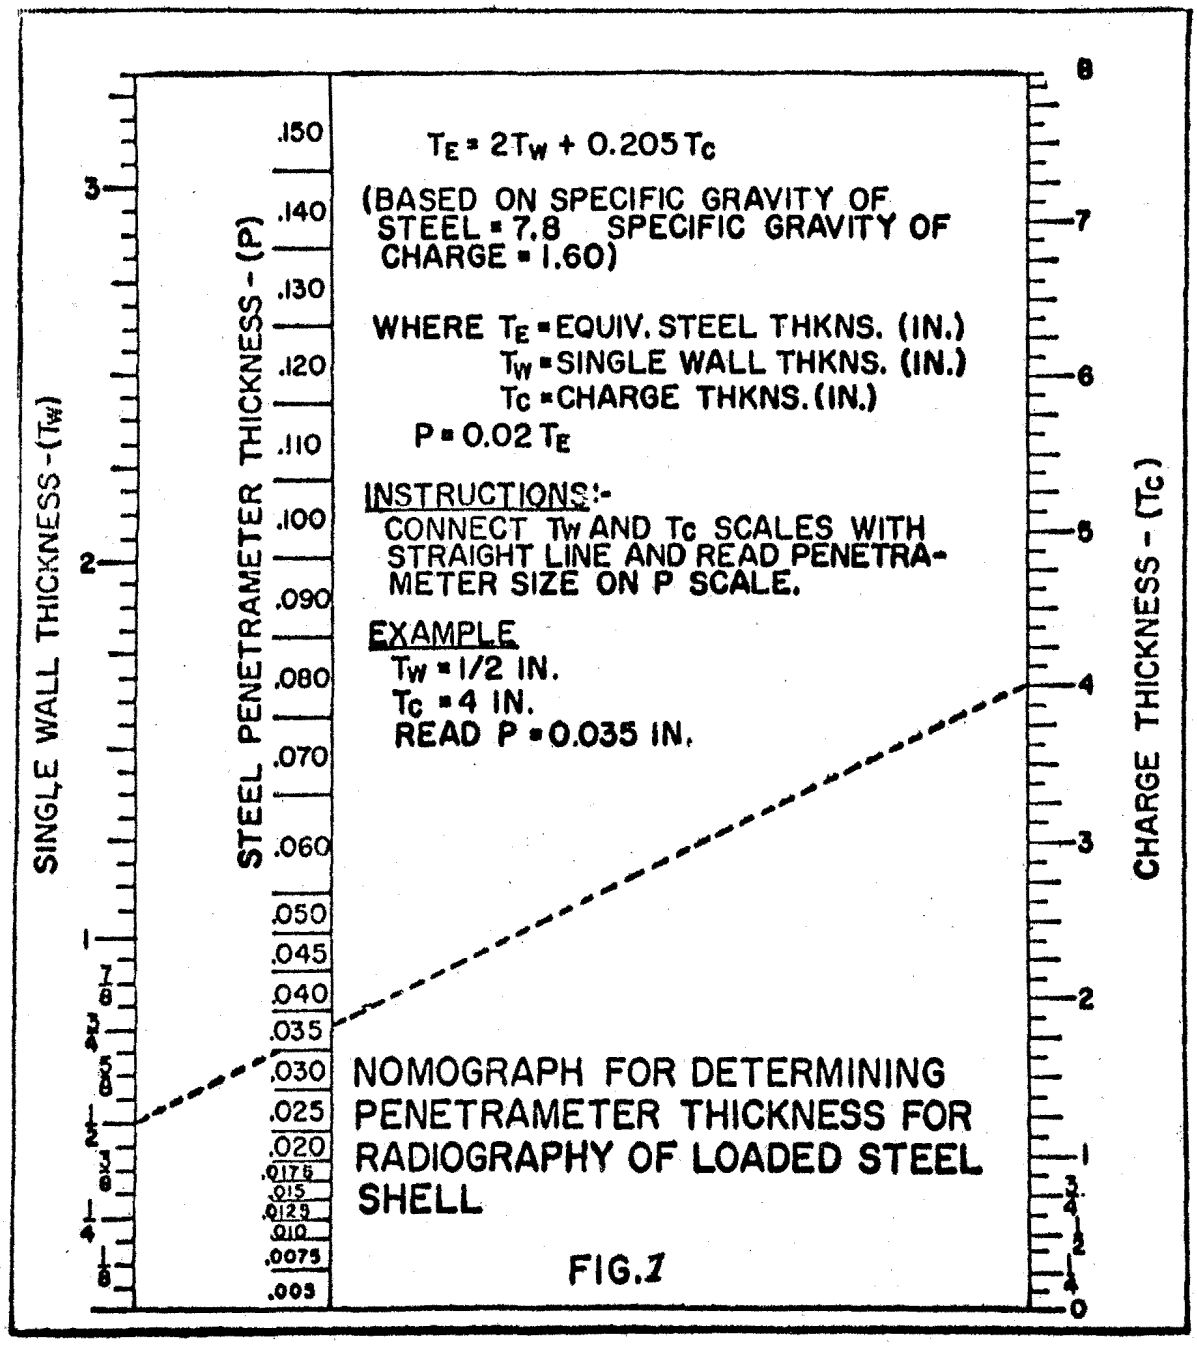

NOMOGRAPH FOR DETERMINING PENETRAMETER THICKNESS FOR RADIOGRAPHY OF LOADED STEEL SHELL

FIG. 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:36Z
Check the source to verify that this is the current version before use.