14 January 1985
SUPERSEDING
MIL-E-63124A(AR)
17 December 1979

MILITARY SPECIFICATION

ELECTRONICS MODULE ASSEMBLY

This Specification is approved for use by the U.S. Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This Specification covers the performance and acceptance inspection requirements for the Electronics Module Assembly associated with the M130 Aircraft General purpose Dispenser.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified (see 6.2), the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-S-45743	- Soldering, Manual Type, High Reliability, Electrical and Electronic Equipment
MIL-S46844	- Solder Bath Soldering of Printed Wiring Assemblies
MIL-A-48078	- Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables For Inspection by Attributes

FSC 1095

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Center, Attn. DRSMC-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

MIL-STD-810C - Environmental Test Methods

2.1.2 Other Government documents, drawings, and publications. The following other Government documents drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS (See 6.5)

U.S. ARMY ARMAMENT RESEARCH AND DEVELOPMENT CENTER (ARDC)

9311429	- Programmer Module
9311431	Electronics Module Assembly
9321259	Packing and Marking for Box, Exterior For Electronics Module Assembly
9313708	- Packing and Marking for Drum, Metal, Shipping for M130 Aircraft General Purpose Dispenser

INSPECTION EQUIPMENT DRAWINGS

9280365	- Test Set-Up For Burn-In Test (Electronic Module)
9280369	- Test Set-Up For Functional Test (Electronic Module)
9354498	- Inert Flare For The M130 Aircraft General Purpose Dispenser

U. S. ARMY ARNANENT, MUNITIONS AND CHEMICAL COMMAND

1948-4138/109-20 PA1000	Unitization Procedures for Boxed Ammunition and Components on Skidded Bases

(Copies of specifications, standards, Handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer).

2.1.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with the applicable drawings, specifications and standards.

3.2 Components and assemblies. The components and assemblies shall comply with all requirements specified on drawing 9311431 and associated drawings and with all requirements specified in applicable specifications and standards.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

3.3 Functioning. The electronics module, having successfully completed burn-in (See 4.5.7), shall perform as specified herein.

3.3.1 Power up. The electronics module shall perform as specified herein when powered up to a voltage of 22.5-30 VDC.

3.3.2 Output. The electronics module upon input of dispense signals of 22.5-30 VDC on any of four inputs shall output 20.0 to 30.0 volt direct current pulses conforming to Figure 1.

3.3.2.1 Single chaff dispense. In response to the single chaff dispense input, the EM shall output only one chaff dispense pulse.

3.3.2.2 Chaff program. In response to the chaff program input, the electronics module shall provide chaff dispense signals in accordance with the settings or the position of the chaff program select switches (see Table A).

3.3.2.3 Single flare dispense. In response to the single flare dispense input, the EM shall output only one flare dispense pulse (see para. 3.3.3).

3.3.2.4 Flare ripple fire. In response to the flare ripple fire command, the electronics module shall generate flare dispense signals in sequential order sufficient to dispense all remaining flares within four seconds max.

3.3.3 Dispense output. The electronics module shall provide two outputs of 20.0 to 30.0 volt direct current (DC), a chaff dispense ignal and a flare dispense signal,with characteristics conforming to Figure 1. These outputs shall be initiated by the respective input signals.

3.3.3.1 Signal dispense output. In the case of chaff dispense input, the electronics module shall provide only one dispense output signal.

3.3.3.2 Chaff program. In response to the chaff program input, the electronics module shall provide chaff dispense output signals in accordance with the setting or the position of the chaff program select switches (see Table A).

3.3.3.3 Single flare dispense. In response to the single flare dispense input, the EM shall output only one flare dispense pulse (see para. 3.3.3).

3.3.3.4 Ripple Fire. In response to the flare ripple fire command, the electronics module shall generate flare dispense output signals in sequential order sufficient to dispense all remaining flares within four seconds maximum (max.).

Source: https://assist.dla.mil -- Downloaded: 2026l0-23T02:16Z
Check the source to verify that this is the currenversion before use.

3.3.4 Flare misfire detection logic. If the electronics module does not receive a flare detection signal from the dispenser assembly, it shall provide another flare dispense signal within 85 milliseconds (ins). The electronics module shall be limited to three flare dispense actions only for each flare dispense input signal. If the electronics module does receive a flare detection signal, it shall not generate additional dispense signals.

3.3.5 Chaff/flare count signal. A chaff count signal or a flare count signal shall be generated each time a chaff or flare is dispensed. Both count signals shall conform to Figure 1.

3.4 Environmental requirements. The electronics module shall perform as specified in 3.3 after exposure to the environments specified herein.

3.4.1 Helicopter vibration. The electronics module shall perform all functions satisfactorily after being subjected to the vibration requirements of MIL-STD-810C, Test Method 514.2, Procedure IIc. The electronics module shall be vibrated along three mutually perpendicular axes as shown in Figure 2. The payload module shall be loaded with 30 inert flares for this test. (First article only)

3.4.2 Transportation vibration. The electronics module shall perform all functions satisfactorily after being subjected to the transportation vibration requirements of MIL-STD-810C, when tested as specified in 4.5.5. (First Article Only)

3.4.3 Humidity. The electronics module shall perform all functions satisfactorily after being subjected to the humidity test of MIL-STD-810C. (First Article Only)

3.4.4 High temperature. The electronics module shall perform all functions satisfactorily at +54°C according to MIL-STD-810C, Test Method 501.1. (First Article Only)

3.4.5 Low temperature. The electronics module shall perform all functions satisfactorily at -54°C according to MIL-STD-810C, Test Methof 502.1. (First Article Only)

3.4.6 Seal integrity . The programmer module assembly, Dwg. 9311429, of the electronic module assembly shall show no evidence of leakage when tested as specified in with 4.5.8.

3.5. Wiring and soldering, Soldering of electrical wires, cables, connectors, components and assemblies shall be performed in a thorough, workmanlike manner in accordance with MIL-S-45743 and MIL-S-46844. (Also See 3.7)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

TABLE A. Chaff ejection modes

SELECTOR SWITCH	FUNCTION	SETTING AVAILABLE TOLERANCE = ± 20%
BURST COUNT	Sets number of payloads fired per salvo.	1, 2, 3, 4, 6, or 8
BURST INTERVAL	Sets time interval in seconds between payloed firing for Salvos in which more than one payload is fixed.	0.1, 0.2, 0.3, or 0.4 seconds
SALVO COUNT	Sets number of salvos fired per program. The “C” setting causes a continuous number of salvos to be fired until the chaff payload is emptied.	1, 2, 4, 8, or C
SALVO INTERVAL	Sets time interval in seconds between the last payload fired in the previous salvo and the first payload fired in the following salvo. The "R" setting causes the salvo interval to vary from salvo to salvo in a pseudo random manner based upon a factory set sequence.	1, 2, 3, 4, 5, 8, or R

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

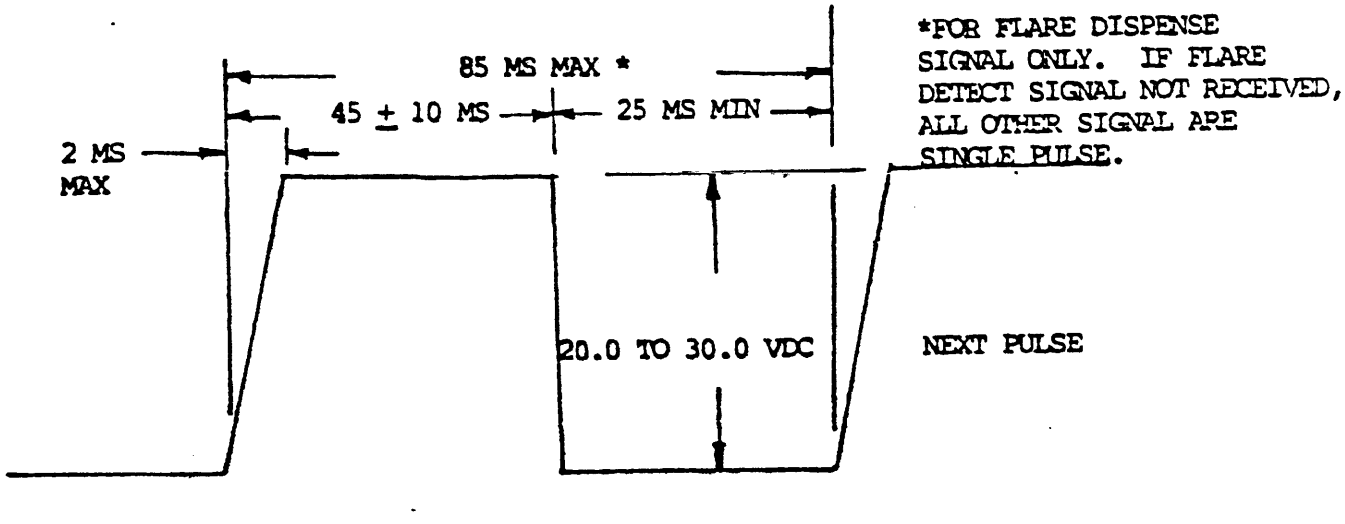


Figure 1 Dispense signal

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

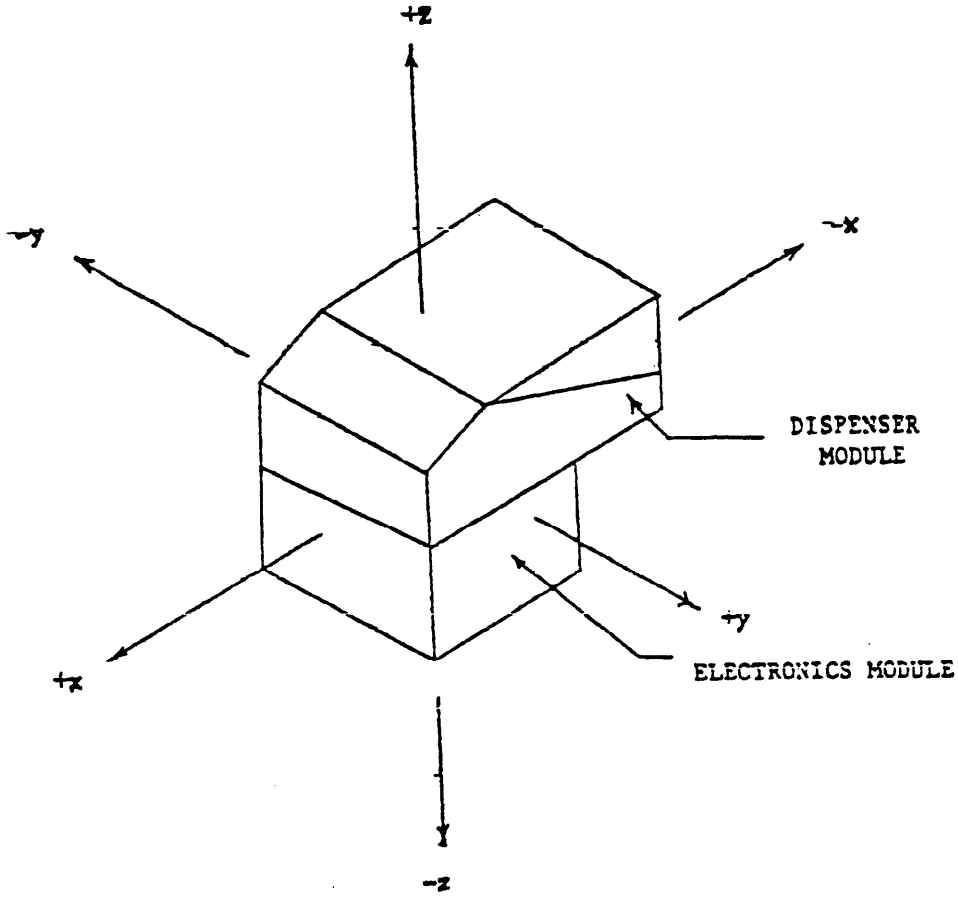


Figure 2 Dispenser system test axis orientation

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

3.6 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.7 Cleanliness. Work areas and tools shall be maintained in a clean and orderly condition. All dirt, grease, oil, solder splatter, chips and other contaminating foreign matter shall be promptly removed. Thermal shunts and anti-wicking tools should be cleaned frequently. Cleaned component leads, terminals, etc., shall not be handled with bare hands. The use of white lint free gloves is recommended. Smoking, eating or drinking shall not be permitted at any soldering bench or station.

3.8 Workmanship. All parts and assemblies shall be fabricated and finished in a thorough workmanlike manner, and all manufacturing, processing, and assembling operations shall be ccrrectly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly, nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The following types of inspections shall be conducted on this item.

First Article Inspection
b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with the provisions of 4.3.2 and 4.3.3. The first article sample shall consist of the following items in sample quantities as indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

Part Description	Drawings	Quantity
Electronics Module	9311431	2

4.3.2 Inspections to be performed. See MIL-A-48078 and paragraphs 4.4.2.1 through 4.4.2.18 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

Table I. First article inspection

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B (AR)

PARAGRAPH	TITLE: Electronics Module Assembly		SHEET 1 OF 1		DRAWING NUMBER: See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Programmer Assembly (Dwg. 9311429)				
	Seal integrity	2		3.4.6	4.5.8
	Electronics Module Assembly (Dwg. 9311431)				
	Examination for defects	2		3.2	4.4.2.14(a)
	Burn-in	2		3.3	4.5.7
	Functioning test	2		3.3	4.5.1
	Transportation vibration test	2		3.4.2	4.5.5
	Helicopter vibration test	2		3.4.1	4.5.4
	Humidity test	2		3.4.3	4.5.6
	Performance at low temperature test	2		3.4.5	4.5.3
	Performance at high temperature test	2		3.4.4	4.5.2
	Examination for defects	2		3.2	4.4.2.14(a)
	NOTE: The above tests shall be performed in the order indicated. The two units submitted to environmental testing shall not be returned to the deliverable lot.				
NOTES:	(a) Omit Major 101 from 4.4.2.14 for First Article Inspection.				

10

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078.

4.4.2 Examination. (See MIL-A-48078). Unless otherwise specified in the Classification of Defeats and Tests Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.1	Housing Assembly, Electronics		9311565
			NEXT HIGHER ASSEMBLY 9311477

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of mounting holes improper		0.40%	3.2	Gage
102	Brazing incomplete or inadequate		0.40%	3.2	Visual
103	Any part missing, damaged or improperly assembled		0.40%	3.2	Visual
Minor					
201	Protective finish missing or scratched		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Printed Wiring Board Assembly, IC, Salvo, Chaff				9311527
					NEXT HIGHER ASSEMBLY 9311473
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or inadequate		0.40%	3.2	Visual
103	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(ARI

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.3	Printed Wiring Board Assembly, Discrete, Salvo, Chaff				9311524
					NEXT HIGHER ASSEMBLY 9311473
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Printed Wiring Board Assembly, Discrete, Burst, C/F				9311521
					NEXT HIGHER ASSEMBLY 9311473
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Printed Wiring Board Assembly, IC, Burst, Chaff				9311518
					NEXT HIGHER ASSEMBLY 9311473
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.6	Housing Assembly, Electronics Module	1 OF 1	9311477
			NEXT HIGHER ASSEMBLY 9311431

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Paint missing or improper		0.40%	3.2	Visual
102	Marking missing or improper		0.40%	3.2	Visual
103	Rubber adhesive missing, inadequate or improperly applied		0.40%	3.2	Visual
104	Grommet missing or improperly assembled		0.40%	3.2	Visual
Minor					
201	Protective finish missing or scratched		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

DPSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9311473
4.4.2.7	Module Assembly, Programmer, Chaff				NEXT HIGHER ASSEMBLY 9311429
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Alignment of knobs improper		0.40%	3.2	Visual
103	Sealant missing from threaded surfaces		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.8	Printed Wiring Board Assembly, Front Plane	1 OF 1	9311467
			NEXT HIGHER ASSEMBLY 9311473

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Switch stop pins missing or improperly installed		0.40%	3.2	Visual
104	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DPSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.9	Printed Wiring Board Assembly, Interconnect				9311461
					NEXT HIGHER ASSEMBLY
					9311429
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Pins not trimmed in accordance with drawing		0.40%	3.2	Visual
104	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.10	Printed Wiring Board Assembly, Flare Detector				9311458
					NEXT HIGHER ASSEMBLY 9311429
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged, or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Polarizing plug missing or improperly located		0.40%	3.2	Visual
104	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DPSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.
Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.11	Printed Wiring Board Assembly, Power Supply Number 2				9311455
					NEXT HIGHER ASSEMBLY 9311429
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Polarizing plug missing or improperly located		0.40%	3.2	Visual
104	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9311452
4.4.2.12	Printed Wiring Board Assembly, Power Supply #1				NEXT HIGHER ASSEMBLY 9311429
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Insulating compound missing or improper		0.40%	3.2	Visual
103	Sealing compound missing from threaded surface		0.40%	3.2	Visual
104	Soldering improper or inadequate		100%	3.5	4.4.3.7/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-E-63124B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.13	Programmer, Module	1 OF 1	9311429
			NEXT HIGHER ASSEMBLY 9311431

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Sealing compound missing from threaded surfaces		0.40%	3.2	Visual
103	Seal integrity		0.40%	3.4.6	4.5.8
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Module, Electronics				9311431
					NEXT HIGHER ASSEMBLY 9311430
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Burn-in		100%	3.3	4.5.7
102	Functioning test		100%	3.3	4.5.1
103	Any part missing, damaged or improperly assembled		0.40%	3.2	Visual
104	Identification plate missing, improperly annotated or improperly attached		0.40%	3.2	Visual
105	Sealing compound missing from threaded surfaces		0.40%	3.2	Visual
Minor					
201	Protective finish scratched		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-OA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-E-63124B(AR)

PARAGRAPH 4.4.2.15	TITLE Packing and Marking for Drum, Metal Shipping for M130 Aircraft General Purpose Dispenser		SHEET 1 OF 1		DRAWING NUMBER 9313708 NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cushions missing or not secured		0.40%	3.2	Visual
102	Contents not thoroughly dry		0.40%	3.2	Visual
103	Any component missing or damaged		0.40%	3.2	Visual
Minor					
201	Markings missing, misleading or unidentifiable		0.65%	3.2	Visual
202	Fillers insufficient, loose contents		0.65%	3.2	Visual
203	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-QA (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION IOF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.16	Sealed Barrier Bag, Prior to Packing in Box				9321959
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Waterproofness of barrier bag destroyed by puncture or separation of heat seal		0.40%	3.2	Visual
102	All excess air not exhausted from bag prior to sealing		0.40%	3.2	Visual
103	Evidence of crushed box		0.40%	3.2	Visual
	NOTE: Packing should be opened if there is evidence of crushing.				
Minor					
201	Heat seal of barrier bag located so that one or more subsequent seals cannot be applied		0.65%	3.2	Visual
202	Marking of bag misleading or unidenti-fiable		0.65%	3.2	Visual
203	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS TESTS MIL-E-63124B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.17	Packing and Marking for Box, Fiberboard for Electronics Module Assembly				9321260
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any packing component missing		0.40%	3.2	Visual
102	Markings missing, incomplete or illegible		0.40%	3.2	Visual
Minor					
201	Box not securely closed		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC [redacted] (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION 0F DEFECTS & TESTS

MIL-E-63124B(AR).

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.18	Packing and Marking for Box, Exterior for Electronics Module Assembly				9321259
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any barrier bag or filler missing		0.40%	3.2	Visual
102	Exterior markings missing, incomplete or illegible		0.40%	3.2	Visual
Minor					
201	Box not securely closed		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

DRSMC-0A (D) Form 160, 1 Aug 83 replaces edition of 1 Jul 77 which may be used until exhausted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Functioning. Each electronics module, after compliance with 4.5.7, shall be subjected to this test. The test shall be performed as specified in 4.5.1 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.3, it shall be classified defective and removed from the lot.

4.4.3.2 High temperature. Each electronics module submitted for first article testing shall be subjected to functioning at high temperature. The test shall be performed after Humidity testing (see 4.4.3.6) as specified in 4.5.2 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.4, the first article sample shall be rejected.

4.4.3.3 Low temperature. Each electronics module submitted for first article shall be subjected to functioning at low temperature. The test shall be performed as specified in 4.5.3 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.5, the first article sample shall be rejected.

4.4.3.4 Helicopter vibration. Each electronics module submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.4 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.1, the first article sample shall be rejected.

4.4.3.5 Transportation vibration. Each electronics module submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.5 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.2, the first article sample shall be rejected.

4.4.3.6 Humidity Each electronics module submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.6 using equipment in accordance with 4.4.4. If any unit fails to comply with the requirements of 3.4.3 the first article sample shall be rejected. Following this test, the electronics assembly shall be subjected to functioning at high and low temperature (See 4.4.3.2 and 4.4.3.3).

4.4.3.7 Soldering. Each electronics module shall be inspected for soldering in accordance with 3.5. If any wiring or printed circuit card assembly fails to comply with the requirements of 3.5, the unit shall be classified defective and removed from the lot.

4.4.3.8 Seal integrity. (Dwg. 9311429) This test shall be performed as specified in 4.5.8. If any unit fails to comply with the requirements of 3.6, it shall be classed defective and removed from the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.4.4 Inspection equipment. The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the "Paragraph Reference/Inspection Method" column of the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and section 6.3 herein.

4.5 Methods of inspection.

4.5.1 Functioning. Each Electronic Module shall be subjected to testing utilizing the functioning test system, and procedure described in Dwg. 9280369. The dispenser, excluding those conditioned at high or low temperature, shall be conditioned for four (4) hours minimum at 25 ± 5°C (ambient). Observation shall be made for compliance with the applicable requirements. (Non-Destructive Test)

4.5.2 High temperature. After conditioning at 54° ± 2°C according to MIL-STD-810C, Test Method 501.1, the electronics module shall be subjected to the functioning test of 4.5.1 at high temperature. Observation shall be made for compliance with the applicable requirements. (Non-Destructive Test)

4.5.3 Low temperature. - After conditioning at -54° ± 2°C according to MIL-STD-810C, Test Method 502.1, the electronics module shall be subjected to the functioning test of 4.5.1 at low temperature. Observation shall be made for compliance with the applicable requirements. (Non-Destructive Test)

4.5.4 Helicopter vibration. This test shall be performed as specified in MIL-STD-810C, Test Method 514.2, Procedure IIc assuming the number of missions to be greater than 100. The electronics module shall be vibrated along three mutually perpendicular axes as shown in Figure 1. The payload module shall be loaded with 30 inert flares for this test. Following this test, examine each electronics module for evidence of damage and submit each item to the functioning test of 4.5.1. Observation shall be made for compliance with the applicable requirements. (Non-Destructive Test)

4.5.5 Transportation vibration. This test shall be performed as specified in MIL-STD-810C, Method 514.2, Procedure X using curve AW of Figure 514.2-7 (change curve to 0.8" displacement (double amplitude) between 5&6 Hz). The electronics module shall be vibrated along three mutually perpendicular axes in Figure 2. Following this test, examine each electronics module for evidence of damage and submit each item to the functioning test of 4.5.1. Observation shall be made for compliance with the applicable requirments. (Non-Destructive Test)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.5.6 Humidity. This test shall be performed as specified in MIL-STD-810C, Test Method 507.1, procedure I. (10 days) Observation shall be made for compliance with the applicable requirements. (Non-Destructive Test)

4.5.7 Burn-in. Each Electronic Module shall be subjected to testing utizing the functioning test system and procedures described in Dwg. 9280365.

4.5.8 Seal integrity. Each programmer module (Dwg. 9311429) shall be placed in a cylindrical air tight chamber with the free space minimized. The air pressure (moisture free) within the chamber shall be raised to a minimum of 5 psig by means of a fixed volume of air. With the air supply shut off the pressure shall be maintained for 15 seconds min. Any programmer module which fails to attain the minimum pressure specified or exhibits any leakage in excess of 0.05 psig shall be rejected.

5. PACKAGING

5.1 Preservation and packaging.

5.1.1 Level A. Preservation and packaging shall be as specified on Drawing 9313708 when shipped as part of the M130 Aircraft General Purpose Dispenser, or Drawing 9321259 when shipped as a repair part.

5.2 Packing.

5.2.1 Level A. packing shall be as specified on Drawing 9313708 when shipped as part of the M130 Aircraft General Purpose Dispenser, or Drawing 9321259 when shipped as a repair part.

5.3 Marking.

5.3.1 Level A. Marking shall be as specified on Drawing 9313708 when shipped as part of the M130 Dispenser, or Drawing 9321259 when shipped as a repair part.

5.4 Unitization.

5.4.1 Level A. Only when shipped as part of the M130 Dispenser System, the electronics module assembly in the drum shall be unitized in accordance with Dwg. 19-48-4138/109-20 PA1000 (DARCOM Ammo Center).

6. NOTES

6.1 Intended use. This electronics module is part of the Aircraft General purpose Dispenser, M130.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

6.2 Ordering data. Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.

6.3 Submission of inspection equipment designs for approval. (See MIL-A-48078) Submit equipment designs as required to Commander, U.S Army Armament Research and Development Center, AMSMC-QAT-I(D), Dover, New Jersey 07801.

6.4 Distribution of ammunition data cards. Distribution of data cards shall include the followlng: Commander, U.S Army Armament Research and Development Center, Attn: AMSMC-QAT-M(D), Dover, New Jersey 07801.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament Research and Development Command (ARDC) may also include drawings prepared by, and identified asl Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, Picatinny Arsenal or ARRADCOM drawings. Technical data originally prepared by these activities is now under cognizance of ARDC .

6.6 Changes from previous issue. Asterisks are not used in this revision with respect to the previous issue, due to the extensiveness of the changes.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1095-A143)

U.S. GOVERNMENT PRINTING OFFICE: 1985 - 505-030/21357

Source: https://assist.dla.mil -- Downloaded: 2026l0-23T02:16Z
Check the source to verify that this is the currentversion before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
US Army Armament Munitions &
Chemical Command
ATTN: AMSMC-QA
Dover, NJ 07801-5001

Source: https://assist.dla.mil -- Downloaded: 202610-23T02:16Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-E-63124B (AR)	Electronics Module Assembly

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

INCH-POUND

MIL-E-63124B(AR)
AMENDMENT 2
04 January 1994
SUPERSEDING
AMENDMENT 1
22 October 1990

MILITARY SPECIFICATION

ELECTRONIC MODULE ASSEMBLY

This amendment forms a part of Military Specification MIL-D-63124B(AR), dated 14 January 1985, and is approved for use by the US Army Armament, Munitions and Chemical Command, and is available for use by all Department and Agencies of the Department of Defense.

PAGE 1

2.1.1 Standards, Military: Delete "MIL-STD-810C and
* substitute "MIL-STD-810" .

PAGE 2

2.1.2: Add the following drawing under INSPECTION EQUIPMENT
* DRAWINGS:

"12589959 - BALLAST, FLARE"

PAGE 4

*

3.4.1 Helicopter vibration.

Line 3: Delete "MIL-STD-810C, Test Method 514.2, Procedure IIC" and substitute "MIL-STD-810, Method 514.4, Category 7C".

Line 3: Delete "... Procedure IIC. The electronics . . . (First article only)" and substitute "... Procedure IIC When tested as specified in 4.5.4 (First article only)".

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

* 3.4.2 Transportation vibration, line 3: Delete “M1L-STD-810C" and substitute "MIL-STD-810, Method 514.4, Basic Transportation, Category 7C”.

* 3.4.3 Humidity, line 3: Delete “MIL-STD-810C” and substitute "MIL-STD-810, Method 507.3, Procedure III”.

* 3.4.4 High temperature, line 2: Delete “MIL-STD-810C, Test Method 501.1" and substitute MIL-STD-810, Test Method 501.3, Procedure II, Induced”.

* 3.4.5 Low temperature, line 2: Delete "MIL-STD-810C, Test Method 502.1" and substitute“MIL-STD-810, Test Method 502.3, Procedure II, Severe cold”.

* 3.4.6 Seal integrity, Delete in its entirety and substitute the following:

3.4.6 Seal integrity. The electronics module assembly, Dwg 9311431, shall show no evidence of leakage when tested as specified in with 4.5.8”.

PAGE 10

* TABLE 1. First article inspection:

Programmer Assembly: Delete in its entirety.

Electronics Module Assembly (Dwg. 9311431): Add the following after Humidity Test, ”Seal integrity 2 3.4.6 4.5.8".

PAGE 12

4.4.2.1, Housing Assembly, Electronics: Add alternate drawing 12598357 with drawing 9311565

PAGE 24

* 4.4.2.13 Programmer module, Major 103: Delete in its entirety.

* 4.4.2.14 Module electronics, Major 106: Add the following “Seal integrity .40% 3.4.6 4.5.8”.

PAGE 31

* 4.5.2 High temperature, line 2: Delete “MIL-STD-810C, Test Method 501.1" and substitute “MIL-STD-810, Test Method 501.3, Procedure II, Induced”.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

4.5.3 Low temperature, line 2: Delete “MIL-STD-810C, Test Method 502,1" and substitute ‘MIL-STD-810, Test Method 502.3, procedure II, Severe Cold”,

4.5.4 Helicopter vibration.

Line 2: Delete “MIL-STD-810C, Test Method 514.2, procedure IIC, . ..” and substitute ‘MIL-STD-810, Method 514.4, Category 7C, ..*”*

Line 5: Delete "... in Figure 1. The payload . . . for this test” and substitute “... in Figure 2. The payload module shall be loaded with thirty (30) ballast flares, dwg. 12589959, (preferred) or with thirty (30) inert flares for this test".

* 4.5.5 Transportation vibration, line 2: Delete MIL-STD-810C 5 and 6 HZ)” and substitute ‘MIL-STD-810, Method 514.4, Basic Transportation, Category I“.

PAGE 32

* 4.5.6 Humidity, line 2: Delete “MIL-STD-810C . . . .(10 days)” and substitute “MIL_STD_810, Method 507.3, Procedure III”.

* 4.5.8 Seal integrity:

First sentence: Delete “ . ..programmer module (Dwg. 9311429) ... “ and substitute “ . ..electronics module assembly (Dwg. 9311431) ..*”.

Last sentence: Delete “ . ..program module . ..” and substitute “ . ..electronics module assembly . ..”.

The margins of this amendment are marked with an asterisk or vertical lines to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1095-A269)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

NOTICE OF INACTIVATION
FOR NEW DESIGN

INCH POUND

MIL–E-63124B(AR)
NOTICE 1
11 December 1995

MILITARY SPECIFICATION

ELECTRONICS MODULE ASSEMBLY

This notice should be filed in front of MIL–E-63124B (AR) dated 14 January 1985

MIL-E–63124B (AR) dated 14 January 1985. with Amendment 2, dated 4 January 1994 is inactive for new design and is no longer used. except for replacement purposes.

Preparing Activity:
Army – AR

AMSC N/A FSC 1095

D1STRIBUTION STATEMENT A. Approved for public release: distribution is unlimited

Source: https://assist.dla.mil -- Downloaded: 2026l0-23T02:16Z
Check the source to verify that this is the currentversion before use.