INCH POUND

MIL-C-21083D(MC)

[illegible]

SUPERSEDING
MIL-C-21083C(MC)
13 July 1990

MILITARY SPECIFICATION

COAT, MAN'S: SERVICE, OFFICER'S, USMC

This specification is approved for use by the U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for officer's service coats, with belt.

1.2 Classification. The coats shall be of one type in the following sizes, as specified (see 6.2):

Schedule of Sizes

Short	Regular	Long	Extra Long
36	36	36	36
38	38	38	38
40	40	40	40
42	42	42	42
	44	44	44
	46	46	

1.3 Individual orders. When coats are custom tailored to an individual order, this specification shall govern, except the detail requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practice.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A Approved for public release; distribution is unlimited

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issue of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-50067	- Cloth, Flannel, Wool, Undercollar Cloth
A-A-50186	- Cloth, Buckram, Woven and Non-woven
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton, Buttonhole
A-A-50199	- Thread, Polyester, Core, Cotton or Polyester Covered
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill, or Plain Weave Polyester, Polyester or, Polyester Blend
V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic)
V-T-295	- Thread, Nylon
UU-P-268	- Paper, Kraft, Wrapping
DDD-L-20	- Label, For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile; Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-F-495	- Finish, Chemical, Black, For Copper Alloys
MIL-B-3461	- Button, Insignia, Metal Uniform and Cap
MIL-C-10176	- Cloth, Gabardine, Wool, Polyester/Wool
MIL-P-15064	- Pad, Shoulder and Sleevehead
MIL-C-15065	- Coat, Fronts
MIL-B-17757	- Box, Shipping, Fiberboard, (Modular Sizes)
MIL-B-20289	- Button, Insignia, Plastic
MIL-C-44192	- Container, Shipping and Storage Coat (Hanger Pack)

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the currentversion before use.

STANDARDS

FEDERAL

FED-STD-191 - Textile, Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

MILITARY

MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-1490 - Provisions for Evaluating Quality of Coats, Men's Dress

(Unless otherwise indicated, copies of federal and military specifications, standards and handbooks are available from the Standardization Documents Order Desk, Bldg 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094).

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless other specified, the issues of documents not listed in the DODISS are the issue of the documents cited in the solicitation.

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense (DoD) Standard Color Card of Standardized Shades for Serving Threads 1968

Department of Defense (DoD) Standard Shades for Button 1966

(Application for copies should be address to the Color Association of the United States, 343 Lexington Avenue, New York, NY 10016.)

(Nongovernment standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal Agencies.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, polyester/wool gabardine, green shade 2212 (see 6.3), conforming to type II, class 12 of MIL-C-10176.

3.3.2 Lining. The material for lining fronts, sleeves, yoke, and vent, making the belt fastener, and facing the inside breast pocket shall be cloth, rayon, twill, green shade 2209 (see 6.3), 3.7 ounce, conforming to class I of MIL-C-368.

3.3.3 Twill, polyester and cotton. The material for lining the upper and lower patch pockets, inside breast pocket, pocket stays, shoulder straps and stays for shoulder and armhole seams shall be cloth, twill, polyester and cotton conforming to class I of A-A-52106, except the requirements for non-fibrous material and seam efficiency shall not apply. The color shall be black. See 3.3.3.1 for alternate fusible interlining.

3.3.3.1 Fusible interlining. As an alternate, fusible interlining may be used for the facings, collar, flaps, pockets, and shoulder straps. The fusible shall be non-woven cloth, 20% nylon and 80% polyester, polyamide paste dot, 1.25 to 1.75 ounce per square yard. The color shall be black or charcoal. The Pellon style 8313 or equal may be used. Fusing conditions shall be as follows or as directed by the supplier:

Temperature	- 280-290°F, 140-145°C
Time	- 12-15 seconds
Pressure	- 4-6 pounds per square inch

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

3.3.4 Undercollar cloth. The undercollar cloth shall be wool flannel conforming to A-A-50067. The color of the cloth shall be green of an approved shade to closely match the basic material. The acidity (ph) requirement and colorfastness to perspiration and crocking requirements shall not apply.

3.3.5 Sword slit patch. The sword slit patch shall be made of the material specified in 3.3.4.

3.3.6 Sword slit buttonhole tab. The sword slit buttonhole tab shall be made of one ply of the basic material and one ply of the rayon lining material.

3.3.7 Bias binding. The binding for the upper edge of pockets, back edge of facing, armhole shield, bottom turnup and the raw edge of seam allowances shall be bias cut out of the lining material specified in 3.3.2. The binding shall be 5/8 to 7/8 inch wide and shall have sized edges.

3.3.8 Collar and belt interlining. The material for interlining the collar and belt shall be cloth, buckram, cotton, natural color, conforming to type I, of A-A-50186 except that the test for shrinkage shall be in accordance with method 5580 of FED-STD-191.

3.3.9 Shoulder pads. The shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.10 Sleeve head pad. The sleeve head pad shall conform to type IV of MIL-P-15064.

3.3.11 Coat fronts. The coat fronts shall conform to type IX of MIL-C-15065, except that the cotton warp, hair-wool filling cloth and stays shall be dyed black. The dyed cloth shall show fair fastness to wet (dry) cleaning only. The dyeing of the cotton warp, hair-wool filling cloth shall be accomplished with a selected direct dye and the dyed cloth shall be after treated, preferably with copper sulfate to meet the requirements specified herein. The dyed cotton warp, hair-wool filling cloth shall show fastness to wet (dry) cleaning, perspiration and steam pressing equal to or better than the standard sample. When no standard is available or has not been established, the dyed cotton warp, hair-wool filling cloth shall show good fastness to wet (dry) cleaning, perspiration and steam pressing. The coat fronts when tested as specified in Section 4, Table IV shall comply with the requirements specified herein. As an alternate, the coat front and center back vent may be fused using a woven cloth fusible conforming to the following requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

Description - Twill weave woven front fusible interlining
Warp - 100% cotton
Filling - 75-90% rayon; 10-25% wool
Weight - Min 3.5 to 4 oz max
Color - Black or charcoal gray
Coating - Polyamide Dot

The fusible shall be Kufner style G35, National style 200FL or Crown Textile Style 241 or equal.

Fusible Condition

Temperature - 300-310°F
- 150-155°CE
Time - 12-15 Sec
Pressure - 4-5 PSI

Chest Canvas of the Floating Chest Piece

Description - Twill weave woven chest canvas
Warp - 100% cotton
Fill - 20-35% animal hair; 65-80% rayon
Weight - Min 6 oz; max 8.5 oz

Hair Cloth

Description - Haircloth shoulder piece

Same as in MIL-C-15065H (29 December 1986) para. 3.2.2

Flannel or Felt

Description - Flannel/felt chest piece

Same as in MIL-C-15065H (29 December 1986) para 3.2.4 (1) and (2)

3.3.12 Tape. The tapes shall be cotton conforming to DDD-T-86 as follows. The requirement for non-fibrous material shall not apply.

3.3.12.1 Stay Tape. The stay tape shall conform to type III, class 2 of DDD-T-86, 3/8 inch side for the front edges of coats and 1/4 inch wide for the armholes, back vent and waist seam.

3.3.12.2 Bridle tape. The bridle tape for the breakline of lapel shall be 5/8 inch wide, conforming to type II, class 1 of DDD-T-86.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3.3.13 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

3.3.14 Thread

3.3.14.1 Cotton thread. The cotton thread shall conform to A-A-52094 in the following types and sizes:

Use	Type	Ticket No.	Ply
Seaming of coat; making buttonhole in belt and belt fastener; making belt loops; bartacking ends of belt keeper	III	A	3
Tacking armholes and attaching sleeve head pads	I	30	3
Button sewing	I or II	24	4

As an alternate to the cotton thread, a polyester, cotton-covered thread conforming to A-A-50199 No. 70, 2 ply may be used. The thread for basting shall be good commercial grade cotton. Nylon or cotton 0/2 may be used for blindstitching/felling operation as an alternate.

3.3.14.2 Silk thread. The silk thread for machine sewing shall conform to A-A-50196 as follows, except that the requirements for extractable matter shall not apply for the type III thread.

Use	Type	Ticket No.	Ply
Topstitching of coat and belt, and bartacking belt fastener to belt	I	A	3
Making buttonholes in coat	I	B and F	3
Bartacking	I	B	3
Hand felling	III	C	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

Use	Type	Ticket No.	Ply
Hand or duplicated felling of lining (armhole sleeve lining)	III	C	2
Machine felling	I	0	3

3.3.14.3 Nylon thread. The nylon thread for padding lapels shall conform to type III, size 000 of V-T-295.

3.3.14.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.14.5 Color and colorfastness. The thread shall be dyed shade T-1, cable No. 66023, except cotton thread for basting and for machine tacking armholes may be white. The dyed thread shall show fastness to light and wet (dry) cleaning, equal to or better than the standard sample. When no sample is available, the dyed thread shall show good fastness to light and wet (dry) cleaning. The thread for seaming lining need show fastness to wet (dry) cleaning only. (See DoD Standard Color Card of Official Standardized Shades for Sewing Threads 1968).

3.3.15 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to A-A-50198. The color of the gimp shall be shade T-1, cable No. 66023. The dyed gimp shall show fastness to wet (dry) cleaning equal to or better than the standard sample. When no standard sample is available, the dyed gimp shall show fastness to wet (dry) cleaning equal to or better than the standard sample. When no sample is available, the dyed gimp shall show good fastness to wet (dry) cleaning.

3.3.16 Buttons

3.3.16.1 Insignia buttons. The insignia buttons shall conform to type I, 40-line, and type II, 27-line, black finish, conforming to MIL-B-20289. As an alternate, insignia buttons conforming to type I, style 3, class B, subclass 1 of MIL-B-3461 may be used. A dull black epoxy finish in lieu of dull black enamel finish is acceptable with prior approval.

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

3.3.16.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish conforming to type II, class D, style 20, 34-line, and style 4, 22-line of V-B-871. The color of the buttons shall be green, cable No. 62017. (See DoD Standard Shades for Buttons 1966).

3.3.17 Fastener, snap. The snap fastener for the belt shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, round or square style, rolled edge, size 1/0 sew-on type. The snap fastener, when tested as specified in Section 4, Table IV, shall comply with the requirements specified herein.

3.3.18 Labels. Each coat shall have an identification label, a size label and an instruction label as follows. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.18.1 Identification label. The identification label shall conform to type VI, class 1, of DDD-L-20 and shall measure not less than 2-1/2 inches wide by 1-1/2 inches long. The content and format shall be as follows:

Nomenclature (item description)
Contract Number
Name of contractor
Wool Products Act information
Dry Clean Only

NOTE: Size of characters for "Name of contractor" shall be minimum 8 points (Approximately 3/32 inch).

3.3.18.2 Size label. The size label shall be type VI, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L or XL for Short, Regular, Long and Extra Long, and the stock number as shown by the following example:

40R
Stock Number

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 1 through 4, a four-button, single-breasted, quarter-lined coat with separate belt, having a skirt type front with side body pieces, waist seam and waist darts, upper patch pockets and lower bellow pockets with worked eyelets for detachable insignia buttons and with flaps to button, a two-piece back with lined vent, ornamental sleeve cuffs, one inside breast pocket with horizontal piped opening, shoulder straps to button, and a roll collar with worked eyelets and notched lapels. Coats shall have a sword slit in waist seam at left side with a lined tab on inside to button.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns provide 3/16 inch allowance for seams at the edges of the lapels, front edges of coat, and for pocket flap and shoulder strap seams; 3/4-inch allowance for side seam; 5/8-inch allowance for center back seam; and 3/8-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Item	Pattern Nomenclature	No. of cut parts
	Material: Basic	
1.	Front (upper)	2
2.	Skirt (lower front)	2
3.	Side body	2
4.	Right facing	1
5.	Left facing	1
6.	Back	2
7.	Top sleeve	2
8.	Under sleeve	2
9.	Sleeve cuff	2
10.	Top collar	1
11.	Shoulder strap	2
12.	Pocket, upper	2
13.	Pocket, lower	2
14.	Pocket flap, upper	2
15.	Pocket flap, lower	2
16.	Belt	2
17.	Sword slit Tab	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of cut parts
	Material: Cloth, Rayon Lining	
18.	Front	2
19.	Yoke	1
20.	Top sleeve	2
21.	Under sleeve	2
22.	Pocket flap, upper	2
23.	Pocket flap, lower	2
24.	Vent lining	1
25.	Sword slit tab lining	1
26.	Inside breast pocket facing	1
	Material: Polyester/Cotton Twill	
27.	Inside breast pocket	1
28.	Inside breast pocket stay	1
29.	Stay, upper pocket	2
30.	Stay, lower pocket	2
31.	Lining, upper pocket	2
32.	Lining, lower pocket	2
	Material: Cloth, Cotton Interlining	
33.	Collar interlining	1 or 2
34.	Belt interlining	1
	Material: Cloth, Wool, Flannel	
35.	Undercollar	1 or 2
36.	Sword slit patch	1
	Shapers	
	Working lapel shaper	
	Finished color and lapel shaper	
	Undercollar shaper	
	Finished pocket shaper, upper	
	Finished pocket shaper, lower	
	Finished pocket flap shaper, upper	
	Finished pocket flap shaper, lower	
	Left vent shaper	
	Markers	
	Sleeve cuff marker	
	Undercollar stand marker	
	Inside breast pocket marker	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table 1. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.1 Thread breaks and ends of seams. The ends of all seams and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backstitched not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches may be repaired by using 301 stitch type. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread ends of darts shall be trimmed to a length of 1/2 inch. When an automatic dart machine is used, the ends shall be backstitched not less than 3 stitches.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, and the two parts of the undercollar cut from undercollar cloth shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

(c) Sew-on shade tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction indicated by the directional lines on the pattern. c. Cut all polyester/wool parts of the coat, including the belt, from one piece of basic material, except the following parts may be cut from ends: armhole shields, belt lining, belt loops and belt keeper; but when so cut, the parts shall harmonize with the shade of the coat. Belt loops and belt keeper may be banded 1 inch wide, and belt lining may be cut from a banding machine 2-1/4 inches wide. When armhole shields are cut from ends, the shields shall match each other. d. Cut fronts, yoke and vent lining parts of the coat and facing for inside pocket from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. The belt					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) fastener shall be cut 1-5/8 inches wide. Bias binding shall be cut 5/8 to 7/8 inch wide. e. The two parts of the undercollar cut from undercollar material shall match each other, or cut the undercollar material in one piece in lieu of two parts. f. Cut polyester and cotton twill cloth stays for armhole and shoulder seams on the bias, 3/4 inch wide, 4 ± 1/4 inches long for front shoulder and armhole edge. Cut polyester and cotton twill cloth for inside pocket and the stays for upper and lower pockets and inside pocket on the straight in accordance with the patterns furnished. Cut polyester and cotton twill cloth for upper and lower pockets in accordance with the patterns furnished. g. Cut the cotton interlining cloth for collar on the bias in accordance with the pattern furnished. Cut the cotton interlining cloth for the belt on the straight, 1-5/8 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) h. Dress the left vent in accordance with the shaper furnished. i. The use of drill holes is prohibited. j. The left front shall be dressed in the front shaping operation only (see operation 52).					
2	Replacement of damaged parts. a. Replace at time of cutting any parts of the coat containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, other material defects listed in MIL-STD-1490 expected to develop into holes, shade bars and dye streaks or unsightly slubs affecting appearance. b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material affecting appearance.					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
3	Shade marking. a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled or ticketed to insure uniform shade and size throughout the garment. b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4	Make belt loops and keeper. Finished appearance. The belt loops and keeper shall be uniformly stitched, uniform in width and shall finish smooth and flat without pleats, gathers, puckers or other distortion. a. The belt loops and keeper shall be made from a 1-inch wide strip of basic material. b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges, and join the raw edges together with a covering stitch, to finish	406	EFb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make belt loops and keeper. (cont'd) 1/2 inch wide. The stitching shall be uniformly 1/8 inch from finished edges of the loops and keeper. c. Cut the loop for the left and right sides of the coat 5-1/2 inches and 3-1/2 inches long, respectively. d. Cut the keeper 4-1/2 inches long, fold in half end to end, and join the ends with a bartack across the width of the keeper. The finished keeper shall measure 2-1/8 ± 1/8 inches from bartack to folded end.	Bartack		28 per bartack (minimum)	A	A
5	Make belt fastener (see Figure 5). Finished appearance. The belt fastener shall be uniformly stitched, uniform in width and shall finish smooth and flat and without pleats, gathers, puckers or other distortion. The buttonhole shall be clean cut, well made and correctly positioned. The buttonhole shall be the straight type and shall be made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make belt fastener (see Figure 5). (cont'd)					
	the fastener and ends of the buttonhole shall be securely tacked.					
	a. The belt fastener shall be made from 1-5/8 inch-wide strip of rayon lining material.					
	b. Fold the strip in half lengthwise, turn in raw edges, and stitch 1/8 inch from each side, catching the turned edges in the stitching, to form a 1/2 to 5/8 inch wide band. Cut the fastener 6-1/2 inches long.	301	EFp-2	10-14	A (Silk)	A
	c. Turn under one end of fastener 1-1/2 inches and make a horizontal straight type buttonhole, cut 5/8 inch long, through all plies in the center of the turned under portion, securely tacking each end of buttonhole.	Buttonhole		42-48 per Buttonhole (minimum) (including tack)	A	A
6	Seam belt (see Figure 5).					
	Finished appearance. The belt shall be uniformly stitched and shall finish smooth and flat without twists, pleats, gathers, puckers, or raw edges.					
	a. The belt shall be made of two plies of basic material, interlined with					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Seam belt (see Figure 5). (cont'd) cotton buckram interlining.					
	b. Place the interlining material between the basic materials and seam together uniformly 1/8 inch from upper and lower edges, with the raw side edges of basic materials turned in and caught in the stitching. The stitching shall extend from one end of belt to approximately 1-1/4 inches from the opposite end.	301	EFn-2	10-14	A (Silk)	A
7	Close ends of belt (see Figure 5). Finished appearance. The pointed end of the belt shall be well formed with turned-in edges securely caught in the stitching.					
	a. Turn back the under and top ply of basic material at the top and bottom unseamed edges of the belt and trim the interlining approximately 1 inch back from the end.					
	b. Fold the top and under ply of the unseamed end of the belt in half lengthwise face to face, and stitch each ply respectively 1/8 inch from the end.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Close ends of belt (see Figure 5). (cont'd)					
	c. Turn the ends of the top and underply, working out the points. Position the two points even and stitch together 1/8 inch from folded and turned edges, closing the ends and forming a point at the center of the finished end.	301	SSc-1	10-14	A (Silk)	A
	d. Close the opposite end of the belt with overedge stitching.	502 or 503	EFd-1	10-14	A	A
			EFd-1	10-14	A	A
	e. Finished width of the belt shall be 1-3/4 + 1/16, -1/8 inches. The finished length of the belt for each size coat shall be as shown in Table II.					
8	Make buttonhole in belt (see Figure 5).					
	Finished appearance. The buttonhole shall be clean cut, well made and correctly positioned. The buttonhole shall be the straight type and shall be made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the belt and the ends of the buttonhole shall be securely tacked.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Make buttonhole in belt (see Figure 5). (cont'd)					
	a. Make a horizontal, straight type buttonhole, cut 5/8 inch long, midway between upper and lower finished edges of the belt, with the center of the buttonhole 1 ± 1/8 inch from the overedge stitched end and with the ends of buttonhole securely tacked.	Buttonhole		50 per buttonhole (minimum) (including tack)	A	A
9	Sew on belt buttons (see Figure 5).					
	Finished appearance. The button shall be positioned and securely sewn to the belt with the ends of the stitching securely tacked.					
	a. Mark the under side of the belt for the location of two 22-line sewing hole buttons. The center of the button for the buckle end shall be 3-5/8 ± 1/8 inches from the overedge stitched end of the belt. The button for the belt fastener shall be positioned in accordance with mark on pattern for each size belt.					
	b. Securely sew one button at each mark. The button for the buckle end shall properly engage buttonhole in buckle end and shall be sewn through all plies of material so	101 or Hand		21 per button (minimum) 3-4 (double thread)	20/4	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Sew on belt buttons (see Figure 5). (cont'd) that the edge of turn back will not show when button is engaged with buttonhole. The button for the belt fastener shall be sewn through the underside and interlining only.					
10	Bartack fastener to belt (see Figure 5). Finished appearance. The belt fastener shall be smooth and flat without twisting or bulging when buttoned. The bartack shall extend across the entire width of the fastener and the stitch shall be formed with balanced thread tension. a. Mark the underside of the belt in accordance with the mark on pattern for each size belt, for the location of belt fastener. b. Turn under the raw end of the fastener 1/2 inch and bartack the fastener to the belt through all plies 1/8 to 3/16 inch from the folded edge.	Bartack		28 per bartack (minimum)	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11	Clean and press belt. Finished appearance. The belt and belt keeper shall be clean and well pressed with the keeper attached and secured to the belt. a. Trim all ends of stitching and remove all loose ends of thread from the belt. Remove all spots and stains from the belt without injury to the material. b. Place the keeper on the belt at the square end and secure by buttoning the end. Press the belt and keeper smooth and flat with a heated pressing iron or pressing machine.					
12	Attach snap fasteners (see Figure 5). Finished appearance. The snap fasteners shall be securely attached to the belt. On the finished coat, the belt ends shall be fastened without misalignment or gap. The stitching on the socket part of the snap shall not catch the outer part of the belt.					
	a. Sew the socket part of the snap fastener to the inside point of the belt 1/2 to 5/8 inch from the point. The stitching shall be tacked off with	Hand or 101		3-4 (double thread) 21 per fastener	C (Silk) O (Silk or Nylon)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Attach snap fasteners (see Figure 5). (cont'd) not less than two stitches. b. The stud portion of the fastener shall be engaged in the socket portion for ultimate attachment by user.					
13	Make upper and lower pocket flaps. Finished appearance. The pocket flaps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The seamed edges, the corners and point of the flaps shall be well worked out and the rayon lining shall not be visible on the outside of the flaps. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonholes and the purling of the buttonholes					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Make upper and lower pocket flaps. (cont'd)					
	shall be on the outside of the flaps.					
	a. Pocket flaps shall be made of one ply of basic fabric and lined with one ply of rayon lining.					
	b. Seam the two plies together face to face, 3/16 inch from the side and bottom edges, evenly trimming the edges for proper turning.	301	SSe-1	10-14	A	A
	c. Turn the flaps, working the edges, corners and point out completely. Edgestitch the flaps uniformly 1/8 inch from seamed edges.	301	SSe-2 (b)	10-14	A (Silk)	A
	d. Mark and trim the top edge of flaps with the finished shaper so that in the finished coats, the length of the flaps at center point and sides shall conform to measurements shown in Table III.					
	e. Overedge stitch together the top raw edges of flaps.	502 or 503	SSa-1 SSa-1	8-10 8-10	A A	A A
	f. Make a vertical, cut first, eyelet end, square bar type buttonhole with a 3/4-inch-long cut, through the center of each breast patch pocket flap with the	Buttonhole		38 per button-hole (not including tack)	B (Silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Make upper and lower pocket flaps. (cont'd)					
	edge of the eyelet 5/8 inch above the center point.					
	g. Make a vertical, cut first, eyelet end, square bar type buttonhole with a 3/4 inch long cut through the center of each lower patch pocket flap with the inside edge of the eyelet 5/8 inch above the center point of the flap.	Buttonhole		38 per button-hole (not including tack)	B (Silk)	F
	h. Securely bartack the ends of the buttonholes, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bartack		21 per bartack (minimum)	B (Silk)	B
	NOTE: Combination cut first buttonhole and bartacking automatic machine is authorized. Care shall be exercised in trimming excess gimp at end of buttonhole.					
	i. Press upper and lower pocket flaps smooth and flat.					
14	Make upper pockets (creasing machine construction).					
	Finished appearance. The binding shall be uniformly stitched; shall not be tight or full causing puckers, gathers, or pleats; and the basic					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Make upper pockets (creasing machine construction). (cont'd) material shall be securely caught in the stitching. The pleats shall be vertically centered and the folded side edges of the pleats shall be parallel. The pockets shall be uniform in shape and size in accordance with the pattern. The pockets shall be lined with polyester/cotton cloth twill and the pleats shall be stitched. a. Form a vertical box pleat on the outside center of upper pockets with a heated creasing machine. The pleat shall be 1-1/2 inches wide.					
	b. Secure the pleat with a row of stitches 1/8 inch from the top and bottom edges, respectively.	301	SSa-1	10-14	A	A
	c. Stitch the abutted edges of the pleat together on the inside of the pocket with blindstitching.	103	SSm-1	4-8	A	A
	d. Place the polyester and cotton twill lining on the underside of pocket after the pleat is formed and stitched and seamed together along the top, sides and bottom 1/8 to 3/16 inch from the raw	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Make upper pockets (creasing machine construction. (cont'd)					
	edges.					
	e. Bind the upper edge of the pockets, including the lining, with 7/8 inch wide bias binding, with the pleat closed and the outside edge of the binding only turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSb-1	10-14	A	A
	f. Turn under and crease the side and bottom edges of the pockets in a heated edge creasing machine. Trim the lower corners of pockets.					
	-or-					
	g. Fold the pocket in half lengthwise and stitch 1-1/2 inches from the edge.	301	OSf-1	10-14	A	A
	h. Form the pleat and seam across the top and bottom edges, respectively, 1/8 inch from raw edge.	301	SSa-1	10-14	A	A
	i. Press pleat in center of pocket flat and smooth.					
	j. Trim the pocket to conform to upper finished pocket shaper with a 3/16 inch seam allowance added.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Make upper pockets (creasing machine construction). (cont'd)					
	Sew the polyester/cotton twill lining and pocket face to face, after the pleat is formed and seam around the sides and bottom 3/16 inch from the raw edges.					
	k. Turn the pocket so that the face side is on the outside and baste edges with the twill lining slightly back from pocket edges. Finished pocket must conform to finished shaper.	101 or Hand			Commercial Thread	
	l. Stitch across top of pocket.	301	SSa-1	10-14	A	A
	m. Bind the upper edge of the pockets, including the lining, with 7/8 inch wide bias binding, with the pleat closed and outside edge of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
15	Make lower pocket.					
	Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats; the basic material and both edges of binding shall be securely caught					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Make lower pocket. (cont'd)					
	in the stitching. The pockets shall be uniform in shape and size in accordance with finished pocket shaper. The pockets shall be lined with polyester/cotton twill cloth (see 3.3.3).					
	a. Place the polyester/ cotton twill lining on the underside of pocket and seam together along the top, sides, and bottom 1/8 to 1/4 inch from raw edges.	301	SSa-1	10-14	A	A
	b. Bind the upper edge of the pockets, including the lining, with 7/8 inch wide bias binding. Top edge of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding.	301	BSc-1	10-14	A	A
	c. Mark the pockets in accordance with finished shaper.					
	d. Seam lower corners of pockets 3/8 inch from the edges.	301	SSa-1	10-14	A	A
	e. Spread open the corner seams of pockets and press smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Make lower pocket. (cont'd)					
	f. Trim corners and turn pocket working out the corners completely. Turn under side and bottom edges of pockets at the mark to form bellows and baste along the folded edges. Edgestitch uniformly 1/8 inch from folded edges.	301 or 101 or Hand	OSf-1	12-16	A (Silk) (Commercial)	A
	g. Press entire pocket smooth and flat with heated pressing iron or pressing machine, evenly increasing the edges.					
	h. The pockets shall be uniform in shape and size in accordance with the finished pocket shaper.					
16	Make shoulder straps.					
	Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges. The buttonholes shall be cut-first type, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole, and purling of					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Make shoulder straps. (cont'd) the buttonholes shall be on the outside of the shoulder straps. a. The shoulder straps shall be made of one ply of basic material and one ply of interlining.					
	b. Fold side edges face to face enclosing the interlining and seam together with 1/4 inch seam.	301	SSe-2 (a)	10-14	A	A
	c. Press seam open with a heated iron.					
	d. Stitch pointed end of strap with a 1/4 inch seam.	301	SSe-2 (a)	10-14	A	A
	e. Trim points and turn the straps, working the seams out to the edges. Fold straps according to notches and topstitch the strap uniformly 1/8 inch from the edges.	301	SSe-2 (b)	10-14	A	A
	f. Make a horizontal eyelet-end, square bar type, cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges, with the inside edge of the eyelet placed so that in the finished coat, the edges of the shoulder strap button will be 1/4 to 1/2 inch from	Buttonhole		38 per button-hole (minimum) (not including bartack)	B (Silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Make shoulder straps. (cont'd) the edge of the collar. The purling shall finish on the outside of the strap. g. On the finished coat, the straps shall measure 2-3/8 ± 1/8 inches at the eyelet end of the buttonhole. h. Press the straps smooth and flat with a heated pressing iron or pressing machine. The strap shall be uniform in shape and size in accordance with the pattern.					
17	Make undercollar. a. The undercollar assembly may consist of one or two pieces of undercollar cloth and a single piece of cotton buckram interlining material, or the interlining may be two pieces.					
	b. Join the two halves of the undercollar with a 3/8 inch seam (when two-piece construction is used).	301	SSa-1	10-14	A	A
	c. Spread the seam open and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Make undercollar. (cont'd)					
	d. Join the two halves of the interlining together with a 3/8 inch lap seam (when two-piece construction is used).	301	LSa-1	10-14	A	A
	e. Mark the breakline of undercollar with the undercollar stand marker.					
	f. Stitch undercollar to interlining at breakline; stand shall be 1-1/4 ± 1/8 inches at center.	301	SSa-1	10-14	A	A
	g. Quilt the interlining to the undercollar with 4 to 5 rows of blindstitching.	103	SSm-1	4-6	A	A
	h. Press undercollar smooth and flat with a heated pressing iron or pressing machine.					
	i. Stitch undercollar to interlining 1/2 ± 1/8 inch from top and side edges.	301	SSa-1	10-14	A	A
18	Assemble topcollar and undercollar.					
	Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges (top and sides). The felling shall not be too tight or loose and the collar material shall be					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Assemble topcollar and undercollar. (cont'd) securely caught in the stitching. The eyelets shall be well worked with the purling on outside of the collar and shall finish with a 1/8 inch diameter opening. a. Position topcollar between undercollar and interlining with the upper edge abutting the undercollar-interlining seam and with notches aligned.					
	b. Join topcollar to undercollar at top edge with zig-zag stitching, properly distributing the fullness between the notches. The zig-zag stitching shall extend to the end of the collar.	304	LSa-1	8-10	A	A
	c. Turn the undercollar inside on the topcollar and stitch the ends with a 1/8 inch seam.	301	SSa-1	10-14	A	A
	d. Trim and turn the topcollar to the outside, forcing out the ends.					
	e. Baste the ends and upper edge and along the breakline, with the fullness placed between the two rows of basting stitches.	101			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Assemble topcollar and undercollar. (cont'd)					
	f. If ends of collar are felled by hand, 1/8 inch must be cut off the ends of the collar.	Hand		8-10	C (Silk)	
	NOTE: When collar ends are hand felled, the ends of undercollar will not be turned under.					
	g. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat and uniformly even.					
	h. Trim the lower edge of the topcollar to provide seam allowance for seaming to the coat. Cut a guide notch in the lower edge of the topcollar at the center.					
	i. Make one eyelet at each end of the collar 1 inch from the side and upper edges, respectively. The eyelets shall be well worked with the purling on the outside of the collar, and shall finish with a 1/8 inch diameter opening.	Eyelet		20 per eyelet (minimum)	A (Silk)	A
19	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start					

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
19	Seam sleeves at forearm. (cont'd)					
	and finish evenly.					
	a. Position the top and undersleeves with notches matching and join at the forearm with a 3/8 inch seam.	301 or 401	SSa-1 SSa-1	10-14 10-14	A A	A A
	b. Spread open the seam and press flat with a heated pressing iron, holding seam short.					
20	Join cuffs to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs shall be uniformly stitched to sleeves. The point of the cuff shall be centered between the lower front creased edge and the creased backarm seam of sleeve.					
	a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges. Turn cuffs, completely working out the point.	301	SSa-1	10-14	A	A
	b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Join cuffs to sleeve. (cont'd) pressing machine, creasing the edge.					
	c. In lieu of pressing, the turn under at upper edge of cuffs may be basted.	101 or Hand			(Commercial)	
	d. Mark the sleeves in accordance with the sleeve cuff marker for positioning the cuffs, with notch on the pattern matching the forearm seam line and with the lower edge of the sleeve and marker even.					
	e. Position the cuffs at the mark on the sleeve and seam uniformly 1/8 inch from the upper folded edge of cuff.	301	LSd-1	10-14	A (Silk)	A
21	Seam sleeve at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top sleeve to the undersleeve at the backarm with a 3/8 inch seam, catching the ends of the cuff in the seam.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A
	b. Spread open the sleeve and cuff seams and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Tack cuff to sleeve.					
	a. Turn the cuff outlet to the inside, in accordance with notches, against the bottom end of the sleeves and baste along the turned edge of cuff.	Hand or 101			(Commercial) (Commercial)	
	b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching.	103	SSm-1	4-6	A	A
	c. On the finished coat, the length of the cuff shall be 3-1/4 ± 1/4 inches at the front and back creased edges and 6 ± 1/4 inches at the point.					
23	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position the top and undersleeve lining pieces in accordance with notches on pattern and join the forearm and backarm respectively, with a 3/8 inch seam, continuously from top to bottom on each seam.	301 or 401	SSa-1 SSa-1	10-14 10-14	A A	A A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23	Seam sleeve linings. (cont'd) NOTE: The seams of the sleeve lining shall be finished on the inside of sleeve linings.					
24	Assemble sleeve and sleeve lining. Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers or pleats. a. Position the sleeve lining on the sleeve with the notch on the lining even with the armhole edge of sleeve and extending the same width around the armhole edge of sleeve. b. Seam or tack lining to sleeve backarm and forearm seam allowance, respectively, approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches below armhole edge at the backarm and approximately 4-1/2 inches below armhole edge at the forearm.	301 or Hand	SSa-1	6-8	A (Commercial)	A
25	Fell turnup of sleeve lining: press sleeves. Finished appearance. The sleeve linings shall not be short, tight or twisted					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Fell turnup of sleeve lining: press sleeves. (cont'd)					
	at bottom of sleeves, and shall extend to within 1 to 1-1/4 inches from finished end of sleeve. The sleeves shall be properly pressed.					
	a. Pull sleeves through lining and turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished end of the cuff. The sleeve lining may be felled to bottom of sleeve without basting.	Hand or 101			(Commercial)	
	b. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching.	103 or Hand	EFc-1 (b)	6-8 8-10	O (Silk or Nylon)	O
	c. Turn sleeves and assemble in pairs. The sleeves may be pressed prior to setting. The backarm crease shall be on the backarm seam.				(Silk or Nylon)	
26	Hem yoke and front lining.					
	Finished appearance. The hem shall be uniformly stitched, uniform in width, and shall finish smooth and flat without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Hem yoke and front lining. (cont'd)					
	a. Hem the bottom edge of the yoke and front linings, respectively, with the raw edge turned under. Stitch 1/16 inch from the folded upper edge of hem.	301	EFb-1	10-14	A	A
	b. The hem shall measure 3/8 ± 1/8 inch wide.					
27	Make armhole shields.					
	Finished appearance. The armhole shields, of one ply of basic material, shall finish without puckers, gathers, or raw edges.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only and catching the turned under portion in the stitching 1/16 inch from folded edge.	301	BSb-1	10-14	A	A
28	Make center pleat in back yoke lining.					
	Finished appearance. The pleat shall be uniform in width and shall finish smooth and flat without puckers or pleats.					
	a. Fold the back yoke lining, in accordance with the notches on the pattern, to form a 5/8 to	301	OSf-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Make center pleat in back yoke lining. (cont'd) 3/4 inch wide pleat at the center back. Tack lengthwise along the pleat in line with the notches for a distance of 1 to 1-1/2 inches from the top end. -or-					
	b. Form the pleat by stitching across top of pleat at neckline. Press the pleat smooth and flat from the top to the bottom edges of the back yoke lining with a heated pressing iron. The folded edge of the pleat on the outside of the back yoke shall be towards the left side.	301	SSa-1	10-14	A	A
29	Stitch dart in front lining. Finished appearance. The dart shall be tapered to a point at the lower end and shall finish without gathers, puckers, or pleats.					
	a. Fold the front lining, matching the cut edge of the underarm dart. Stitch lengthwise along the dart, tapering from 3/8 inch at the armhole to a point at the lower end not more than 1 inch below the cut of dart.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Seam facing to front lining. Finished appearance. The lining shall be carefully and properly aligned, and seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion. a. Position the lining on the facing with the top edges even, matching the notches to form chest pleat across the chest. Bottom finished edge of the lining shall be matched with the notch in the back edge of the facing to insure proper seaming.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge, matching the notches in the lining to form a horizontal pleat. The pleat shall face down.	301	SSa-1	10-14	A	A
	c. Press the facing lining seam, the pleat, the underarm dart, and the bottom edge of the lining smooth and flat with a heated pressing iron, with the raw edges of the underarm dart toward the side.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Assemble inside pocket on lining and facing. a. The inside pocket shall be made of one piece of polyester/cotton twill cloth with a facing of rayon lining at the horizontal piped pocket opening.					
	b. Position the rayon facing on the pocket material with notches matching. Turn under the top and bottom edges, respectively, of the facing and seam the facing to the pocket 1/16 to 1/8 inch from the folded edges with the top edge of identification label centered and caught in the stitching at the top edge of facing. Selvage edge need not be turned under.	301	LSd-1 (each turned edge) SSa-1 (each selvage edge)	10-14	A	A
	c. Stitch the remaining three sides of label to pocket 1/16 inch from each edge.	301	SSa-1	10-14	A	A
	d. Mark the right facing and the front lining, with the pocket marker furnished, for the position of the pocket opening.					
	e. Position the pocket at the mark with the pocket facing next to the lining material. Place the polyester/cotton twill stay piece on the					

Source: https://assist.dla.mil -- Downloaded: 20261O-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Assemble inside pocket on lining and facing. (cont'd)					
	underside of the lining, with the diagonal extension of the stay extending to the armhole edge of the lining.					
	f. Stitch the pocket to the lining and facing through the stay piece with one row of stitches 3/16 to 1/4 inch on each side of the mark for the pocket opening.	301	SSv-2	10-14	A	A
	g. Cut the opening for the pocket midway between the two rows of stitches joining the pocket and pocket stay to the lining and facing, tongue notching each end of the opening.					
	h. Turn the pocket through the opening to the inside with the front and the backs of the pocket toward the bottom and top edges, respectively, of the lining. Form the piping at the top and bottom edge of the opening. Topstitch the upper and lower edges of the pocket opening adjacent to the seamed outer edge of the piping.	301	BSp-2	10-14	A	A
	-or-					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Assemble inside pocket on lining and facing. (cont'd)					
	i. Accomplish the pocket opening with a double piped pocket machine which stitches, cuts and turns in one operation. When this machine is used, the piping piece may be trimmed to permit insertion into the machine. The joining seam of the top and bottom piped edges shall be raise stitched through lining and coat facing prior to pocket closing and top edgestitched through all plies. Tack ends of pockets opening.	101 or 301			A A	A A
	j. Turn down the back part of the pocket and seam the front and back together approximately 1/2 inch from raw side and bottom edges, catching the tongue notch at each end of the pocket opening in the stitching and securely backtacking each end of the tongue notch. Continue to stitch across top of pocket adjacent to top piping seam, catching twill stay in the stitching and closing top of pocket.	301	SSa-1	10-14	A	A
	k. Stitch the lining, on the outside, to the diagonal extension of the pocket stay from the	301	SSv-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Assemble inside pocket on lining and facing. (cont'd)					
	armhole end of the pocket opening to the armhole. Tacking of the pocket stay to the canvas only is permitted.					
	1. Notch top of polyester and cotton pocket at front edge of the full width of seam allowance and blindstitch inner ply of pocket to facing (see 80.c for alternate operation).	103 or 306	SSm-1 SSm-1	4-6 4-6	A A	A
	m. In the finished coat, the width of the pocket opening shall be 5 ± 1/4 inches for all sizes and shall not extend into the facing more than 1 inch nor extend into the armhole. The depth of the pocket shall be not less than 6 inches.					
	n. Sew the instruction label to the outside of the right pocket facing, centered, 1/2 inch below pocket opening, with a single row of stitching 1/16 inch from each edge.	301	SSa-1	10-14	A	A
32	Bind backs.					
	Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats and the basic material and					

Source: https://assist.dla.mil -- Downloaded: 20261O-19T08:40Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Bind backs. (cont'd) edges of binding shall be caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw side edge of the left and right backparts, respectively, with bias binding, from the top edge of backparts to the top end of the vent. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. When binding the left backpart, continue to bind the raw edge of the vent for the left back part from the top to the bottom end. The binding is not required along the top edge of the vent.	301	BSb-1	10-14	A	A
	b. Bind the raw side edge of the left and right backpart, respectively, with bias binding from the top to the bottom edge of the coat. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge.	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
33	Bind facings. Finished appearance. The binding shall be uniformly stitched, and shall not be tight or full causing puckers, gathers, or pleats. The basic material shall be securely caught in the stitching. The binding shall extend from the bottom edge of facing to not less than 1 inch above bottom finished edge of lining.					
	a. Bind the raw back edge of the facing with the 3/4 inch wide bias cut binding, with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge.	301	BSb-1	10-14	A	A
34	Seam lining to right vent. Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Fold vent lining in half lengthwise face to face and stitch along the top, from the notches to the folded edge, with a 5/16 to 3/8 inch seam. Turn vent lining to the right side, forcing out corner and seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Seam lining to right vent. (cont'd)					
	b. Press vent lining smooth and flat with a heated pressing iron or pressing machine. Position the raw edge of lining on the outside of right vent, with notches on the lining in line with the top end of vent; then seam together 3/8 inch from back edge. The linin shall extend from the notches to the bottom finished edge of coat.	301	SSe-2 (a)	10-14	A (Silk)	A
	c. Turn the lining to the inside with seam 1/16 to 1/8 inch back of folded edge. Stitch the entire length of vent 1/8 inch from the folded edge.	301	SSe-2 (b)	10-14	A (Silk)	A
35	Join backparts and tape neck.					
	Finished appearance. The backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in line with the center back seam. In the finished coat, the left backpart shall overlap the right backpart not less than 3-1/2 ± 1/4 inches, measured at the bottom edge of the coat, and left vent shall be 1-1/2 ± 1/8 inches wide measured at the bottom bound edge. Stitch the 1/4 inch wide					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Join backparts and tape neck. (cont'd)					
	stay tape to the inside of left center back along the vent, with the edge of tape positioned approximately 1/8 inch in front of the fold notch of the vent.					
	a. Position the backparts with edges even and join at the center with a 5/8 inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent. From that point, continue to stitch diagonally across the top end of the left and right vents to the bound edge of the backs.	301	SSa-1	10-14	A	A
	b. Turn the left vent to the inside of the left backpart in accordance with the notches and edgestitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam.	301	OSf-1	10-14	A (Silk)	A
	c. Sew a 1/4 inch wide tape to the inside neck of the back, 1/4 inch from the top raw edge and 5/8 inch from each shoulder edge. The tape shall be sewn flat and the center back seam shall be open.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Press center back seam and vent lining. a. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right back part to lower end of the stitching for the center back seam. b. Spread the center back seam open and press flat with a heated pressing iron.					
37	Baste and stitch vent lining. Finished appearance. The folded edge of the lining shall extend beyond the center seam allowance of the right backpart.					
	a. Baste vent lining to coat.	101 or Hand				
	b. Stitch the upper part of vent lining to center back on each side of the seam allowance 1/8 inch from seamed edge of lining. Turn coat on the outside.	301	SSa-1	10-14	A (Silk)	A
	c. Stitch and backstitch through all plies, across the top end of vent, through the vent lining, from the back center seam to the edge of the vent.	301	SSa-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
38	Seam reinforcement stay to armhole and shoulder. Finished appearance. The cotton and polyester twill reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers or pleats.					
	a. Seam the 3/4 inch wide polyester cotton stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The top end of the armhole stay shall form a right angle at the armhole without the stays overlapping each other.	301	SSaa-1	10-14	A	A
39	Bind lower fronts. Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats and the basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching.					
	a. Bind the raw back edge of the lower fronts with bias binding, turning under the outside raw edge	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Bind lower fronts. (cont'd) of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the waist seam to the bottom edge of fronts.					
40	Assemble fronts. Finished appearance. The waist darts shall be properly tapered and shall finish without gathers, puckers or pleats. The upper and lower front and side body panel shall be joined without gathers, puckers or pleats. a. The fronts shall consist of an upper front, a side body panel, and a lower front (skirt).					
	b. Fold the upper fronts, matching the cut edges of the waist dart, and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point 1 inch from the end of cut at the upper end.	301	SSa-1	10-14	A	A
	c. Position the upper front and side-body panel with edges even and join with a 3/8 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Assemble fronts. (cont'd)					
	d. Spread open the waist dart and the underarm seam and press flat with a heated pressing iron.					
	e. Position the upper and the lower fronts with edges even and join together at the waist with a 3/8 inch seam and with the 1/4 inch wide stay tape positioned on the upper fronts 1/4 inch from the edge and caught in the stitching. Backtack the front end of seam on the left front for a distance of not less than 1-1/2 inches.	301	SSab-1	10-14	A	A
	NOTE: The tape may be sewn simultaneously in the joining seam of the waist; or the tape may be sewn to the upper fronts prior to joining the skirt to the upper front.					
	f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the front edge of the fronts.					
	g. Spread open the waist seam and press flat with a heated pressing iron.					
	h. Press and shape the fronts, from the waist to the top edge, on a suitable type heated pressing machine,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Assemble fronts. (cont'd) shrinking the fronts to eliminate the excess fullness of the chest.					
41	Set pockets and pocket flaps. Finished appearance. The pockets and pocket flaps shall be set without twists, gathers, puckers, pleats or raw edges. The stitching for the raised edge of the flaps shall conform to stitching for setting the pockets. The side edges of the pockets shall not be exposed beyond the sides of the flaps. The pocket and pocket flaps on the left and right side, respectively, shall be in horizontal alignment with each other. The front edge of the upper pockets, pocket flaps, and pleats shall be in parallel alignment with front edge of coat when buttoned. The top of the breast pocket flaps shall be perpendicular to the front edge of coat when buttoned. The point of the upper pocket flap shall be at the center of the pleat on the upper pockets. The center of the pleat on the upper pockets shall be aligned as accurately as possible with the waist darts in					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Set pockets and pocket flaps. (cont'd) the fronts. The top edge of the bottom pocket flap shall be parallel with the waist seam line, and front edge of the flap shall be in line with the front edge of the upper pocket. The lower front corners of the bottom pocket shall be 3/8 inch further back towards the side seam. Pockets and pocket flaps shall conform to the measurements in Table III. NOTE: The breast pocket and flap marker (template) constructed by the manufacturer shall be made to ensure that the top of the breast pocket flaps finish perpendicular to front edge of coat and the front edge of the breast patch pocket shall finish in vertical alignment with the front edge of the lower flap. a. Mark the fronts in accordance with the marks on the pattern or template when used for position of upper and lower pockets and pocket flaps ensuring adherence to the finished appearance requirements. b. Position the pocket flaps on the outside of the fronts in accordance					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Set pockets and pocket flaps. (cont'd) with the marks for the upper and lower pocket flaps, respectively. Position the polyester and cotton twill stay piece for the flaps and top corners of the pocket on the underside of the fronts.					
	c. Seam the pocket flaps to the front, through the polyester and cotton twill stay, uniformly 1/8 inch from the serged edge of the flap.	301	LSq-2 (a)	10-14	A (Silk)	A
	d. Turn down the flaps and topstitch the flaps 1/8 inch from the raised edge.	301	LSq-2 (b)	10-14	A (Silk)	A
	e. Position the upper pockets in accordance with the marks and seam to the fronts uniformly 1/8 inch from the side and bottom edges. The top corners of the pockets shall be securely tacked through the twill stay pieces.	301	LSd-1	10-14	A (Silk)	A
	f. Position the lower pockets in accordance with the marks on the pattern and with lower edge 1-1/4 inches above bottom edge of finished coat. Seam bellows of pockets from the inside to fronts 3/8 inch from side and bottom serged edges. Securely	301	LSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Set pockets and pocket flaps. (cont'd) tack upper corners of pockets through silesia stay pieces.					
42	Make buttonhole tab. Finished appearance. The sword slit buttonhole tab shall finish smooth and flat without distortion. The stitching shall be uniform and the buttonhole shall be properly positioned. The tab shall finish 2-3/8 ± 1/8 inches long and 2 ± 1/8 inches wide. a. Buttonhole tab for sword slit shall be made of one ply of basic material and one ply of rayon lining material.					
	b. Seam together the lining piece and basic material at side and bottom edges of tab 3/16 inch and turn and topstitch 1/8 inch from seamed edge.	301	SSe-2 (shows finished seam)	12-16	A (Silk)	A
	c. Seam the pieces together 1/8 inch from raw edges at top end of tab.	301	SSa-1	12-16	A (Silk)	A
	d. Make a vertical eyelet -end taper-bar type buttonhole, cut 5/8 inch long, in center of tab with the inside edge of the buttonhole eyelet	Buttonhole		60 per button-hole (including tack)	B (Silk)	F

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
42	Make buttonhole tab. (cont'd) placed 5/8 inch above bottom edge of tab. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the lining side of the tab.					
43	Make sword slit and attach buttonhole tab (see Figures 7 and 8). Finished appearance. The sword slit shall finish without bulges or excessive bulkiness. All parts shall be securely fastened and properly positioned. The flap shall be securely attached and properly positioned to cover slit properly. a. Mark left front for 2 inch long sword slit in waist seam. The back end of the sword slit shall be 1/2 to 5/8 inch in front of underarm seam. b. Topstitch the front for 2 inches at the marks for the sword slit 1/16 inch below waist seam. The stitching shall be through the allowance of the waist seam but not through the pocket stay. The lower pocket stay material shall be trimmed	301	OSf-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43	Make sword slit and attach buttonhole tab (see Figures 7 and 8). (cont'd)					
	away from the sword slit opening.					
	c. Tack across waist seam at each end of the topstitching to prevent seam from opening when sword slit is cut. The tacks shall be 1/8 inch long, 1/16 inch on each side of seam.	301	SSa-1	12-16	A (Silk)	A
	d. Mark tab 1-3/4 inches from bottom edge. Cut waist seam open for sword slit and position tab on outside of front with top end inserted through slit. Align mark on tab with upper folded edge of slit. Topstitch front 2 inches along waist seam 1/16 inch above opening, stitching through seam allowance and tab, and securely tacking each side of the tab to the front at the opening. The basic fabric side of the tab shall be towards the outside of the coat.	301	LSd-1	12-16	A (Silk)	A
44	Set belt loops (see Figure 7).					
	Finished appearance. The belt loops shall finish vertically straight and shall be positioned 1/4 inch in from the back end of the lower flap and					

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Set belt loops (see Figure 7). (cont'd) perpendicular to the lower flap. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to bottom folded edges. The underloop for the belt fastener shall have an opening of not less than 1-3/4 inches.					
	a. Position the 5-1/2 inch long belt loop on the left front, 1/4 inch in from back end of the lower pocket flap, with one end approximately 1 inch above the waistseam. Bartack the loop to the front 1/8 inch from the end of the loop. Bartack the loop to the front at the top edge of the lower pocket flap, 1/4 inch from the backend of the flap to form the underloop for the belt fastener. Turn under the top end of the loop to the front 1/8 inch from the folded edge, catching the turned under portion of the loop in the stitching (see Figure 7).	Bartack		28 per bartack (minimum)	B (Silk)	B
	b. Position one end of the 3-1/2 inch long belt loop on the right front and bartack the loop to the front at the top edge of the lower pocket flap 1/4 inch from the back end of the lower pocket flap.	Bartack		28 per bartack (minimum)	B (Silk)	B

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Set belt loops (see Figure 7). (cont'd) Turn under the top end of the loop and bartack the loop to the fronts 1/8 inch from the folded edge with loop caught in the stitching.					
45	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste along the top edge of the upper pocket flap on the outside.	301 or Hand			(Commercial)	
	b. Tack the top edge of upper pocket stay and the front end of the upper and lower pocket stay to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible.	301 or Hand			(Commercial)	
	c. Baste the interlining and fronts together starting approximately 1-1/2 inches above the top edge of upper pocket flap and baste along the center of the upper pocket flap and pocket, along the waist dart to the top edge of the lower pocket flap, and then diagonally across the front corner of the lower pocket flap to the front edge of the lower	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45	Interline fronts. (cont'd)					
	pocket. From that point, continue to baste along the front edge of the pocket to the bottom of the coat.					
	d. Baste along the breakline of lapel and along the front edge down to the bottom of the coat.	301 or Hand			(Commercial)	
	e. Baste across the shoulder, allowing room for setting the shoulder pad, and working the fullness towards the armhole. Baste along front of armhole and down the back edge of the interlining.	301 or Hand			(Commercial)	
46	Baste bridle tape to lapel.					
	a. Position the 5/8 inch bridle tape adjacent to and behind the breakline from the gorge to 1 to 1-1/2 inches from lower end of lapel.					
	b. Baste the tape evenly and smoothly for a distance of 1-1/2 to 2 inches down from the gorge; continue basting for a distance of 4 to 5 inches, holding the tape taut and working in 3/8 to 1/2 inch breast fullness. Baste the remainder of the tape evenly, smoothly and	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Baste bridal tape to lapel. (cont'd) without tension or fullness. Tape and interlining shall be stamp marked to assure proper fullness.					
47	Pad lapels.					
	a. Pad each lapel from approximately 1 inch from the front edge to the breakline with six rows of blindstitching, properly distributing the fullness in the interlining between the rows of stitches to roll the lapels.	103 or 306	SSm-1	4-8	000 000	 000
	b. Blindstitch both edges of bridle tape to interlining.	103 or 306	SSm-1	4-8	000 000	 000
	c. Press the left and right fronts on a suitable type heated pressing machine, with the chest to conform to shape of the body.					
48	Join back and fronts at sides. Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 20261O-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48	Join back and fronts at sides. (cont'd)					
	a. Position the back and fronts with edges even and join together at the sides with a 3/4 inch seam.	301 or 401	SSa-1	10-14	A	A
			SSa-1	10-14	A	A
	b. Spread open the side seams and press flat with a heated pressing iron.					
49	Tape armholes.					
	a. Sew 1/4 inch wide tape around the armhole from a point 1 to 1-1/2 inches to 3/4 to 1 inch above notch on the fronts from shoulder edge on the back.	301 or 401	SSaa-1	10-14	A	A
	b. From the front notch to 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness.	301 or 401	SSaa-1	10-14	A	A
50	Sew snap fastener to upper pockets.					
	Finished appearance. The pockets shall lie smooth and flat without distortion when closed.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50	Sew snap fastener to upper pockets. (cont'd)					
	a. Securely sew one socket snap fastener part to each side edge of the upper pockets to engage stud part of flaps. When socket part is sewn by hand, the stitching shall be tacked off with not less than two stitches.	101 or		21 per fastener (minimum)	A	
		301 or		16 per fastener (minimum)	A	A
		Hand		3-4 double thread (not including tack)	C (Silk)	
51	Press armholes, shoulder blades and lapels.					
	a. Press the armhole tapes, the shoulder blades and the lapels smooth and flat with a heated pressing iron or suitable type pressing machine.					
52	Shape fronts.					
	a. Mark and shape the front edge of the coat; and mark and shape the lapels in accordance with shaper furnished. The left front edge shall be dressed from bottom notch of coat to base of lapel.					
	b. Mark the fronts 1-1/4 inches below the bottom edge of the lower pockets for the bottom turnup. Trim the excess material if necessary. In the finished coat, the bottom turnup shall be 1 ±1/8 inches wide. Side seams					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52	Shape fronts. (cont'd) and left vent shall not be mitered at the bottom. c. Trim coat front interlining 1/4 to 3/8 inch back from top and front edges of lapel and front edge of coat. Trim the bottom of the interlining 1/4 to 3/8 inch above the mark for the bottom turnup and the bottom edge of coat, matching the length of right and left backparts at the vent. -or- d. Marking and shaping the front edges and lapels, and trimming the bottom edge of the coat may be accomplished with a clicker machine using dies conforming to pattern furnished. e. In the finished coat, the left front shall overlap the right front 3-1/2 to 4 inches at the bottom edge, and the lapels shall be 3 ± 1/8 inches wide for all sizes.					
53	Bind bottom turnup. Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Bind bottom turnup. (cont'd) pleats. The basic material and edges of binding shall be securely caught in the stitching.					
	a. Bind the raw edge of the bottom turnup with bias binding, turning under the outside raw edge of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the back edge of the front cutout to the edge of the vent at the center back.	301	BSb-1	10-14	A	A
54	Baste facing-lining assemblies to fronts.					
	a. Position the right and left facing lining assemblies on the outside of the respective fronts and baste along the breakline, distributing the fullness in the breast area. Continue to baste along the front and bottom edges. Baste from the top and front edge of lapel down to the lower end of lapel, working the fullness towards the center of lapel.	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Join facings and fronts with polyester/cotton tape.					
	a. Join the facings to front 3/16 inch from top and front edges of lapels and front and bottom edges of coat, with the 1/2 inch wide polyester/cotton tape positioned on the interlining side of fronts and caught in the stitching.	301	SSab-1	10-14	A	A
	b. The polyester/cotton tape shall extend from 1/2 inch to the back of the lapel notch to 1-1/2 to 2 inches beyond back edge of facing, except the tape is not required along the step of the right front. The tape shall be sewn with normal tension along the top and front edges of the lapel and with slight tension along the front edge of the coat.					
	c. Fell inside edge of 1/2 inch wide stay tape to the coat front interlining from top end of tape to the bottom edge of interlining.	103	SSm-1	4-6	A	A
	d. Remove all basting stitches, trim lower front corner of the facings and corner of lapels, and notch the lapels for proper turning.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Join facings and fronts with polyester/cotton tape. (cont'd)					
	e. Press edges flat and smooth with a heated pressing iron. Edge seam is to be pressed open.					
56	Baste front and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, completely working out the corners of the lapel. Turn up the bottom of the coat, lapping the facing on the bottom turnup and completely working out the front corner.					
	b. Baste along the top and front edges of the lapels, the front (including the step of the right front) and finished bottom edges of the coat, working the seams to the edge of the coat.	101 or Hand			(Commercial)	
57	Fell bottom turnup.					
	a. Fell the bound edge of the bottom turnup to the fronts and backs blindstitching.	103 or 306 or Hand		6-8 6-8 6-8	O (Silk) O (Silk) O (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
58	Baste facings (second time).					
	a. Baste the facings to the front approximately 1-1/4 inches from the top and front edges of the lapel and front and bottom edge of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward.	301 or Hand			(Commercial)	
	b. Baste the lapels diagonally from the corner to the breakline, properly placing the fullness to allow the lapels to roll.	301 or Hand			(Commercial)	
	c. Baste along the breakline of the lapel, properly placing the fullness to allow the lapels to roll.	301 or Hand			(Commercial)	
	d. Baste as close to the facing-lining seam line as possible, placing the fullness over the chest and continue basting along the bound edge of the facing to the bottom turnup of the coat.	301 or Hand			(Commercial)	
59	Fell facings to fronts and tack to interlining.					
	a. Fell the bound edge of the left facing to left front with blind stitching from the bound edge of the bottom turnup to the lower	103 or Hand	EFc-1 (b)	6-8	O (Silk) C (Silk)	O

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Fell facings to fronts and tack to interlining. (cont'd)					
	edge of the front interlining at the waist.					
	b. Tack the back edge of the left facing to the interlining only, to not more than 3 inches below the shoulder edge.	301 or 103 or Hand	SSm-1	4-6 4-6 8-10	A A C (Silk)	A
	c. Fell the bound edge of the right facing to the right front with blindstitching from the bound edge of the bottom turnup to not less than 2 inches above the bottom finished edge of the front lining.	103 or Hand	EFc-1 (b)	6-8	O (Silk) C (Silk)	O
	d. Tack the back edge of the right facing to the front interlining only, with one row of blindstitching from not more than 3 inches from shoulder edge to not more than 1 inch above inside pocket opening. Continue the tacking along the outer ply of inside pocket seam allowance the length of the pocket (see 80.c for alternate operation).	103 or Hand	SSm-1	4-6 8-10	A C (Silk)	A
60	Baste yoke lining to back.					
	a. Position and baste the one-piece rayon yoke lining to the inside of the back along the center	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60	Baste yoke lining to back. (cont'd) pleat, armholes, shoulder (allowing room for shoulder pad) and bottom edge of the yoke.					
61	Baste and fell front lining. a. When necessary, trim the back end of lower pocket stays away from the side seam.					
	b. Tack the upper back corner of inside pocket to coat front interlining.	Hand or Machine		4 per (minimum)	(Commercial)	
	c. Fold the front lining, forming the chest pleat at the armhole. Continue to baste across the pleat and toward the lower edge of armhole, along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be towards the bottom.					
	d. Turn under the back edge of front lining and baste to coat, lapping the folded edge over the side seam and yoke lining and basting to allow room for felling of side seam lining.	Hand or 301			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61	Baste and fell front lining. (cont'd)					
	e. Fell the turned-under portion of the front lining to side seam allowance of the fronts and to the yoke lining with blindstitching 1/4 to 3/8 inch from folded edge. Stitching shall extend from bottom finished edge of front lining to the lower edge of armhole. The blindstitching shall not be exposed on the face side of the lining nor shall the blindstitching be exposed on the outside of front (basic material).	103 or Hand	EFc-1 (b)	6-8 8-10	O (Silk) C (Silk)	O
62	Trim front lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the yoke lining even with the back at the neck.					
63	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and chest padding of coat front interlining in line with the armhole edge and securely tack pad to the interlining and chest padding only.	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64	Seam shoulders. Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulder may be properly shaped. The shoulder seam shall finish without a distorted appearance.					
	a. Join the fronts and back together at the shoulders with a 3/8 inch seam, working in the proper fullness on the backs in accordance with good manufacturing practice.	301 or 401	SSa-1 SSa-1	10-14 10-14	A A	A A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
65	Set shoulder straps (see Figure 4). Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the coat without twists, puckers, pleats or other					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65	Set shoulder straps (see Figure 4). (cont'd)					
	distortion. On the finished coat, the straps shall be 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at buttonhole eyelet end.					
	a. Position the shoulder straps with the pointed end of the strap even with the edge of the neck, and with the seam of shoulder strap matching the shoulder seam at the armhole edge.					
	b. Seam the shoulder straps to the coat 1/8 to 1/4 inch from the armhole edge. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	10-14	A	A
66	Baste shoulder.					
	a. Position shoulder interlining and lining in place, baste upper part of each shoulder on the outside and turn the coat on the inside.	Hand or 301			(Commercial)	
	b. Turn raw edge of yoke lining at the shoulders. Baste the upper part of each shoulder over the front lining and continue to baste across neck at back with the end of the back pleat caught in the basting.	Hand or 301			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66	Baste shoulder. (cont'd)					
	c. In lieu of basting the lining at the shoulder as required in 66.a and b, and hand felling as required in 79.g, trim the shoulder edge of the front lining and yoke lining to approximately 3/8 inch from shoulder at the armhole edge and tapering to 1/8 inch at the neck. Join the yoke lining to the facing-lining assembly at the shoulder with a 3/8 inch seam, working in the proper fullness on the back. In the finished coat, the yoke lining shall be lapped on the facing-lining assembly at the shoulder.	301	SSa-1	10-14	A	A
67	Stitch hanger and size label.					
	Finished appearance. The size label and the ends of the coat hanger shall be centered and sewn to the inside center back of the coat at the neck.					
	a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of the coat at the neck.	301	SSa-1	10-14	A	A
	b. The hanger opening in the finished coat shall be 2 ± 1/8 inches long when measured along the lower edge of the collar.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68	Set collar. Finished appearance. The collar shall finish centered on the back seam with the fullness distributed over the shoulder to conform to and hug the neck. a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam 5/8 inch from top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch. b. Join the top collar to the facing at the gorge from the lapel notch to a point not less than 1 inch in back of the lapel breakline. c. Notch the facing at the end of the gorge seam, in back of the lapel breakline, the width of the seam without cutting the stitching of the seam.	301	SSa-1	10-14	A	A
69	Tack topcollar to fronts at gorge. a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge from the lapel notch to the end of the seam,	Hand or 301	SSa-1	2-4 10-14	C (Silk) A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
69	Tack topcollar to fronts at gorge. (cont'd) catching top end of bridle tape in the tacking.					
70	Baste undercollar to coat. Finished appearance. The center seam of the undercollar shall be in line with center back seam of coat. Fullness in the collar shall be properly placed over the shoulders to permit the collar to lie flat. a. Turn the collar to the outside with the lower neck of the undercollar lapped on the outside of the coat at the mark. b. Securely tack the corners of the collar across the juncture point of the collar and the lapel. c. Baste the undercollar to the front and back, placing proper fullness over shoulder. d. In the finished coat, the ends of the collar and top edge of lapels shall each be 1-5/8 ± 1/8 inches when measured from the tacked corners to the finished edges of collar and lapel, respectively.	Hand or Machine Hand or Machine		5-8 per tack	C (Silk) (Commercial)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71	Tack collar interlining to coat.					
	a. Raise the lower edge of the top collar and tack the collar interlining to upper edge of the coat and the yoke lining with overcast stitching from shoulder seam to shoulder seam.	Hand or 103		2-3	C (Silk)	
			SSm-1	3-4	O (Silk)	
		or 301	SSm-1	3-4	O (Silk)	O
72	Baste top collar to coat.					
	a. Turn under the lower edge of the top collar and baste across neck.	Hand or 301			(Commercial)	
	-or-					
	b. In lieu of operations 71a and 72a, join lower edge of top collar from gorge seam to gorge seam across neck.	301	SSa-1	10-14	A	A
73	Edgestitch coat and collar.					
	Finished appearance. The coat shall be uniformly edgestitched the same gage as used on flaps and pockets.					
	a. Stitch the side and top edge of collar, top and front edge of the lapels, front edges of the coat (including the step of the right front), and continue the stitching along the bottom edge of the coat the width of the facings.	301	SSb-1 (Collar)	10-14	A (Silk)	A
			SSe-2 (Lapels front and bottom edge of coat (shows finished seam)			

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73	Edgestitch coat and collar. (cont'd)					
	b. The stitching shall be uniformly 1/8 inch from the edge.					
74	Set sleeves.					
	Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole sleeve seam shall finish smooth and flat without twists, puckers or pleats. The armhole shall not be stretched or distorted due to pressing.					
	a. Position sleeves on outside of coat at the armholes, with back arm seam of sleeve matching notch in the back, and with notch in top sleeve and fronts matching.					
	b. Join the sleeves to the coat with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching.	301 or 401	SSa-1 SSa-1	10-14 10-14	A A	A A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness. Press and remove the fullness using					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
74	Set sleeves. (cont'd) a heated iron from the upper part of the armhole sleeve seam from backarm sleeve seam over the shoulder area to approximately midway between shoulder and the notch at front edge of armhole, so that the sleeve seam finishes smooth and flat.					
75	Baste armhole.					
	a. Position shoulder pad to armhole and baste around outside of armhole, with the stitches adjacent to and no more than 1/8 inch away from armhole seam, forcing out the armhole in the basting so that all fullness is removed from basic material between the lapel and armhole. Care shall be taken not to catch yoke or front lining in the basting on the inside of armhole. The basting stitches shall extend from the backarm seam of the sleeves to the front notch of the coat. Turn coat to inside.	301 or Hand			(Commercial)	
	b. Baste around inside armhole, positioning yoke lining and front lining in place to inside of coat front interlining and shoulder pad around armhole, distributing	301 or Hand			(Commercial)	

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Baste armholes. (cont'd) fullness evenly so that armhole finishes smooth and without fullness, puckers, twists or pleats.					
76	Baste underarm shield to coat. a. Position the underarm shield on lining side of coat with raw edges even with lower edge of armhole.					
	b. Baste or tack underarm shield at the base of armhole. The shield shall not cover the opening of the inside pocket.	301 or Hand			(Commercial)	
77	Tack armhole and stitch sleeve head pads. Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole. a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam, and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end through the armhole	301	SSa-1	4-6	30/3	30/3

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Tack armhole and stitch sleeve head pads. (cont'd)					
	sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the armhole end of the stay for the upper pockets, the front and yoke linings, shields at base of armhole and shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.					
78	Fell collar to coat.					
	a. Fell the lower edge of the entire length of undercollar to the fronts and backs.	Hand or Machine or Hand type felling or	LSa-1	8-12	C (Silk)	
		306	LSa-1	8-12	O (Silk)	O
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand		8-10	C (Silk)	
79	Fell linings.					
	a. Position the sleeve lining at the armhole with back and forearm seams of sleeves and linings matched. Turn under the	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 20260-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
79	Fell linings. (cont'd) armhole edge of the sleeve lining and lap the lining on the outside of the front and yoke linings at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness along the bias front of the armhole and back of armhole from shoulder seam area to 1 to 2 inches below backarm seam and back stitching the lower armhole edge from approximately 1 1/2 inches to the front of forearm sleeve lining seam to the side seam of body lining. -or- As an alternate, the armhole lining may be felled utilizing a sleeve lining felling machine that consists of a feed off the arm machine equipped with a lower and upper feed (review specification requirements for felling of sleeve lining in relation to appropriate turn under).					
	(1) Stitch sleeve lining to armhole on inside from front sleeve notch to backarm seam across undersleeve.	301	SSa-1	10-14	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
79	Fell linings. (cont'd)					
	(2) Stitch the top lining to armhole on inside from the front armhole notch to top back arm lining seam across the crown of the top sleeve lining.	306	SSa-1	10-14	50 or mercerized cotton 50/2 or 3 or Nylon A	50 or 50/2 or 3 or A
	(3) Close the previous left opened forearm seam 1/16 to 3/32 inch from edge.	301	SSc-1	10-14	50	50
	NOTE: Alternate construction: When the alternate construction to fell the armhole lining by machine is used it consists of leaving an opening between the notches of the forearm sleeve lining seam. Stitching the lining to the armhole on the inside from front sleeve notch of sleeve to back arm seam across undersleeve (301 stitch) utilizing the forearm sleeve opening stitching the top sleeve lining to the armhole on inside by felling machine from front sleeve notch to back arm seam across the crown of top sleeve lining. Close the previously left open forearm seam.					
	b. Stitch the sleeve lining by machine to the armhole on the inside from forearm seam to backarm	301 and Hand	SSa-1	10-14 8-10	A C (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
79	Fell linings. (cont'd) seam across undersleeve, and fell the balance of the sleeve lining to the armhole by hand. The forearm and backarm seams of sleeve linings shall be matched. -or- c. Machine stitch the lower portion of the armhole as required in 79.b. The remaining upper portion of the armhole shall be felled using machine duplicated hand felling with stitching placed over the folded edge of sleeve lining with the fullness distributed along the bias front of armhole and back of armhole from shoulder seam area to 1 to 2 inches below backarm seam. NOTE: It is required that the machine duplicated hand stitching shall be equal to or better than felling stitches made by hand. d. Fell the lower corners of the front lining to the facings and the front seam allowance. As an alternate, operation 76.d and 76.e may be performed by machine with one blind tack on each corner.	Machine Duplicated Hand		8-10 8-10 12 per tack	C (Silk) C (Silk) C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
79	Fell linings. (cont'd)					
	e. Fell the upper back edge of the front lining to the yoke lining, placing the stitching over the folded edge of the front lining. Fell the lower finished edge of the yoke lining to the side seam allowance. As an alternate, this operation may be performed by machine with two blind tacks on each side.	Hand		8-10 12 per tack	C (Silk)	
	f. Tack bottom edge of armhole shields on the underside to lining.	Hand		4 per tack (minimum)	C (Silk)	
	g. Fell the back lining and facing lining assembly together at the shoulders, placing the stitching over the folded edge of back lining.	Hand or Machine 301		8-10 10-12	C (Silk)	
80	Tack facing and bottom turnup.					
	a. Fell the ends of the bottom. Turnup to the body of the coat at the vent.	Hand		8-10	C (Silk)	
	b. Fell the back edge of the facings to the coat from the bottom to the top edge of the bottom turnup. As an alternate, operations 80.a and 80.b may be performed by machine with two blind tacks on each vent.	Hand		8-10 12 per tack	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
80	Tack facing and bottom turnup. (cont'd)					
	c. Tack the facings on the outside to the front edge of the inside pocket through the interlining with a hidden backstitch, extending for a distance of 5 inches down from, and in line with, the front end of the pocket opening.	Hand		4-6	C (Silk)	
81	Finish sword slit.					
	Finished appearance. The sword slit shall finish flat and smooth, firmly stitched and properly positioned with no puckers, bulges, or raw edges.					
	a. Properly position left front lining and baste to front around the top to hold in position for cutting of opening for sword slit tab.	Hand				
	b. Cut opening for sword slit tab in lining to correspond with opening in front.					
	c. Fell raw edges of lining at cut opening to front in order to hold lining in place.	Hand		6-8	C (Silk)	
	d. Cut 2 inch long opening in sword slit patch, 1/2 to 5/8 inch from top edge. The opening shall be 1 inch on					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
81	Finish sword slit. (cont'd) each side of vertical center of patch. e. Pull tab through opening to inside and insert the tab through the patch opening, aligned with the opening in the lining. f. Fell patch to lining on all outer edges and around the raw edges at the opening to front waist seam allowance and the upper edge of tab.	Hand		6-8	C (Silk)	
82	Press left front. a. Press left front smooth and flat, removing any fullness prior to marking and making buttonholes.					
83	Make buttonholes. Finished appearance. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 40-line insignia button and the 34-line sewing hole button. The stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front and the purling of the buttonholes shall be on the outside.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
83	Make buttonholes. (cont'd) The waist seam shall not be open beyond the end of the waist buttonhole. a. Mark the left front in accordance with the marks on the pattern for the location of four buttonholes. The mark for the bottom buttonhole shall be on the waistseam, the top buttonhole shall be on horizontal line with the eyelet of the buttonhole in the upper pocket flap, and remaining two buttonholes shall be evenly spaced.					
	b. Make one horizontal eyelet-end square bar type, cut-first buttonhole, 1 1/8 inches long, at each of the marks, with the purling of the buttonhole to finish on the outside of the front. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from front edge. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.	Buttonhole		50 per button-hole (minimum) not including tack	B (Silk)	F
	c. Care should be exercised when making the buttonhole in the waistseam, so that the seam does not come open					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
83	Make buttonholes. (cont'd) beyond the ends of the buttonhole. d. Securely bartack the ends of each buttonhole and trim the ends of the gimp and thread. e. An automatic one-cycle buttonhole/bartack machine with cut-first attachment may be used to make the required eyelet end, square bar type buttonholes. Stitches and thread requirements remain the same.	Bartack		21 per bartack (minimum)	B (Silk)	F
84	Make eyelets in pockets. Finished appearance. The eyelets shall be worked with the purling on the outside of the pocket and shall finish 1/8 inch in diameter opening. All stitches shall be securely caught in fabric. a. Make one eyelet in each pocket for removable insignia button, to correspond with eyelet-end of buttonhole in flaps so that when buttoned on the finished coat, flaps shall be smooth and flat without twists or bulges.	Eyelet		21 per eyelet	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
85	Clean coat. a. Pull and remove all basting threads. Trim and remove all loose ends of thread and remove all spots, stains and shade tickets and markings without injury to the material.					
86	Press coat. Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. b. Press the entire collar smooth and flat, smooth stretching where necessary to obtain the proper shape and to straighten the edges, working any fullness towards the center of the collar and removing the fullness by shrinking.					

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
86	Press coat. (cont'd) c. Press the upper front on a body machine, shrinking in and properly shaping the chest. d. Press the lower front and pockets smooth and flat. e. Press the sides, working fullness towards the back. f. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent. g. Press the sleeves smooth and flat, creasing at the backarm and the forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the bottom edge of the breast pockets. The backarm crease shall be in line with the forearm crease. h. Block the shoulders to remove the fullness. Press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
86	Press coat. (cont'd) i. Press the armholes solid from the inside, creasing the armholes on the front, back, and armpit. The armpit and the back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking in the top sleeves. k. Press the lapels smooth and flat, straightening the edges and working any fullness towards the center of the lapel and removing the fullness by shrinking. l. Press the lapels, uniformly creasing on the lapel breakline from the gorge seam to approximately 3 inches above the top buttonhole. Then roll press the lapel to the front edge of the coat. m. Press the collar on a collar machine, creasing on the breakline and shaping to obtain the proper contour while pressing. n. Press lower edge of coat smooth, flat and even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
86	Press coat. (cont'd) o. Remove all wrinkles and impressions from under the lapels, collar, shoulder straps and pocket flaps. Press lining throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat. Remove all gloss marks.					
87	Mark for buttons. a. Mark the right front for the location of three 40-line insignia buttons and one 34-line sewing hole button to properly engage with the buttonholes in the left front. b. Mark each shoulder for the location of one 27-line insignia button to properly engage with the buttonhole in the shoulder straps in order that the straps shall lie smooth and flat without twisting or bulging on the finished coat. c. Mark the sword slit patch for the location of one 22-line sewing hole button to properly engage with buttonhole in tab.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
88	Sew on buttons. Finished appearance. The buttons shall be securely sewn to the coat and shall properly engage buttonholes in left front, shoulder straps and upper and lower pocket flaps. The insignia buttons on the front and pockets shall finish with the head of the eagle in an upright position. The shoulder buttons shall finish with the head of the eagle towards the edge of the collar. When the coat is buttoned, the center of those buttons between the upper pockets shall be midway between the front edge of the pockets.					
	a. Sew one 40-line insignia button at each of the marks on the right front, except at the waist. The button shall be sewn through all plies of material with the head of the eagle in an upright position.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double	20/4 20/4 20/4 thread)	
	b. Sew one 34-line sewing hole button at the waist mark on the right front through all plies, necking the button for shank wrapping.	101 or 301 or Hand		21 per button 21 per button 6-8 per button (double	20/4 20/4 20/4 thread)	 20/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
88	Sew on buttons. (cont'd)					
	c. Shank wrap the 34-line sewing hole button.	Hand or Machine		4 wraps (double thread) 32 stitches per shank	20/4 20/4	
	d. Attach one 27-line insignia button to each pocket with shank of buttons inserted through eyelets and secured by ring toggles.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double thread)	24/4 24/4 24/4	24/4
	e. Sew a 27-line insignia button at the mark on each shoulder. The button shall be sewn through all plies of material. The head of the eagle shall be towards the edge of the collar.	101 or 301 or Hand		24 per button 21 per button 4-6 per button (double thread)	20/4 20/4 20/4	
	f. Sew one 22-line sewing hole button at mark on sword slit patch and wrap not less than four times. Stitching shall catch the pocket stay material.	101 or 301 or Hand		24 per button 21 per button 4-6 per button (double thread)	20/4 20/4 20/4	20/4
89	Attach belt to coat.					
	a. Match belt to coat. Place the belt in the loops, thread the belt fastener through the underloop, and button.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Tables II and III.

TABLE II - Coat Measurement 1/

Size	Breast 2/ inches	Back Length 3/ inches	Sleeve Length 4/ inches	Belt Length 5/ inches
		Short		
36	38	29-1/4	17	39-1/2
38	40	29-1/2	17	41-1/2
40	42	29-3/4	17	43-1/2
42	44	30	17	45-1/2
		Regular		
36	38	30-1/4	18	39-1/2
38	40	30-1/2	18	41-1/2
40	42	30-3/4	18	43-1/2
42	44	31	18	45-1/2
44	46	31-1/4	18	47-1/2
46	48	31-1/2	18	49-1/2
		Long		
36	38	31-1/4	19	39-1/2
38	40	31-1/2	19	41-1/2
40	42	31-3/4	19	43-1/2
42	44	32	19	45-1/2
44	46	32-1/4	19	47-1/2
46	48	32-1/2	19	49-1/2
		Extra long		
36	38	32-3/4	20	39-1/2
38	40	33	20	41-1/2
40	42	33-1/4	20	43-1/2
42	44	33-1/2	20	45-1/2
44	46	33-3/4	20	47-1/2

1/ Tolerance on all measurements: ± 3/8 inch except tolerance on back length measurement only shall be + 3/4 and - 3/8 inch. Tolerance is on 1/2 breast measurement.

2/ Breast measurement shall be taken with coat buttoned from folded edge to folded edge 1 inch below pit of armhole and multiply by 2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3/ Back length measurement shall be taken along center back seam from lower edge of undercollar to bottom edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of cuff.

5/ Belt length measurement shall be taken along the center from end to end.

TABLE III - Pocket and flap measurements 1/

UPPER POCKETS AND FLAPS			
Size	(Short, Regular, Long, X-Long)		
	36-38	40-42	44-46
	inches	inches	inches
Length of flap at center point.	2-7/8	2-7/8	2-7/8
Length of flap at sides.	2-1/8	2-1/8	2-1/8
Width of flap at top edge.	5	5-1/2	6
Width of pocket at top edge, side edge to side edge.	4-3/4	5-1/4	5-3/4
Width of pocket at bottom edge, side edge to side edge.	5-1/8	5-5/8	6-1/8
Length of pocket, top edge to bottom edge.	6-1/2	6-1/2	6-1/2

LOWER POCKETS AND FLAPS			
Size	(Short, Regular, Long, X-Long		
	36-38	40-42	44-46
	inches	inches	inches
Length of flap at center point.	3-3/4	3-3/4	3-3/4
Length of flap at sides.	2-1/4	2-1/4	2-1/4
Width of flap at top edge.	7-3/4	8-1/4	8-3/4
Width of pocket at top edge, side edge to side edge.	7-1/2	8	8-1/2
Width of pocket at bottom edge, side edge to side edge.	10	10-1/2	11
Length of pocket top to bottom edge			
Short	10-1/2	10-1/2	10-1/2
Regular	10-3/4	10-3/4	10-3/4
Long	11	11	11
X-Long	11-3/4	11-3/4	11-3/4

1/ Tolerance on all measurements ± 1/8 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Certification of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).
3. In-process inspection (see 4.5.3)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-1490.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table IV for characteristics noted.

TABLE IV - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. deter. per sample Unit	Results reported as
Cotton warp, hair wool filling cloth	Colorfastness to: Wet(dry) cleaning	3.3.11	5622		
	Perspiration	3.3.11	5680		
	Steam pressing	3.3.11	5640		
Fasteners	Material identification 1/	3.3.17	Std. comml.	1	Pass or fail
Fasteners	Finish	3.3.17	Std. comml.	1	Pass or fail
	Size and type	3.3.17	Std. comml.	1	Pass or fail

1/ Accept a certificate of compliance for this requirement.

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1490. If one or more sample units fail to meet any test requirements listed below, the lot represented shall not be acceptable.

Components	Lot size expressed as	Sample unit for testing
Cotton warp, hair wool filling cloth	yards	1/2 yard
Fastener, snap	100	15 complete sets

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

4.5.2 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an asterisk (*) and listed as selected defects in MIL-STD-1490. Any coat containing a selected defect shall not be included in the end item lot. The model forms used for the separate sizes of coat shall be as shown in Table V. The sample unit shall be one coat.

Table V - Form Measurements (1)

Coat Size(s)	Form Size	Chest	Waist	Seat
36	34	36	30	36
38	36	38	32	38
40	38	40	34	40
42	40	42	36	42
44	42	44	38	44
46	44	46	40	46

(NOTE 1: Tolerance of 1/2 inch in all form measurements.)

4.5.3 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1490 and Tables II and III of this specification.

4.5.4 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1490. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1490.

4.5.5 Examination of Palletization. An examination shall be made to determine that the palletization complies with Section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully prepared for delivery. The lot size shall be the number of palletized unit loads in the end item inspection lot.

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

Examine	Defect
Finished dimension	Length, width of height exceeds specified maximum requirement.
Palletization	Not as specified.
	Container pattern not as specified.
	Interlocking of loads not as specified.
	Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence or method of application.

5. PACKAGING

5.1 Preservation and packaging. Preservation and packaging shall be level A or hanger pack.

5.1.1 Level A. Each coat with belt attached, shall be laid on a flat surface, with the front of coat facing up. A bending or non-bending paper-board shoulder form conforming to Figure 9 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length so that sleeve ends rest over the lower pockets. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

5.1.2 Hanger pack. Coats shall be hung with fronts lapped and unbuttoned on a 17 inch hanger and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, commercial or hanger pack as specified (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

5.2.1 Level A. Fifteen (15) coats, of one size only, shall be packed with the collar of every other coat in a reverse position, in a fiberboard shipping container conforming to type SF, class weather resistant, grade V2s, size 3A of MIL-B-17757. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled closed, and reinforced as specified in the appendix to the box specification.

5.2.2 Commercial. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination.

5.2.3 Hanger Pack. When specified (see 6.2), 12 coats of one size and length only, packaged as specified in 5.1.2, shall be packed in a type I container, using style A or B hanger bar in accordance with MIL-C-44192. No mixed sizes are permitted within the same container.

5.3 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129. In addition to required markings, hanger pack containers shall have an arrow on at least two sides pointing to the top of the container.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory).

6.1 Intended use. The coat covered by this specification is intended to be worn by male officer personnel of the U. S. Marine Corps.

6.2 Ordering data.

6.2.1 Acquisition requirements. Acquisition documents should specify the following:

(a) Title, number, and date of this specification.
(b) Size required (see 1.2)
(c) When first article is required (see 3.2).
(d) Level of packing required (see 5.2).
(e) When hanger packs are required (see 5.2.3)

6.3 Standard sample. The standard sample and color sample may be obtained from the acquiring activity or as directed by the contracting officer.

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a pre-production sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should also include specific instructions in acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.5 Figures. Figures 1 through 8 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.


6.6 Subject term (key word) listing.

Green
Officer's
Polyester/Wool

6.7 Changes from previous issues. Asterisks are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.


Preparing Activity:
Navy-MC
Project No. 8405-N259

Source: https://assist.dla.mil -- Downloaded: 202640-19T08:40Z
Check the source to verify that this is the currenversion before use.

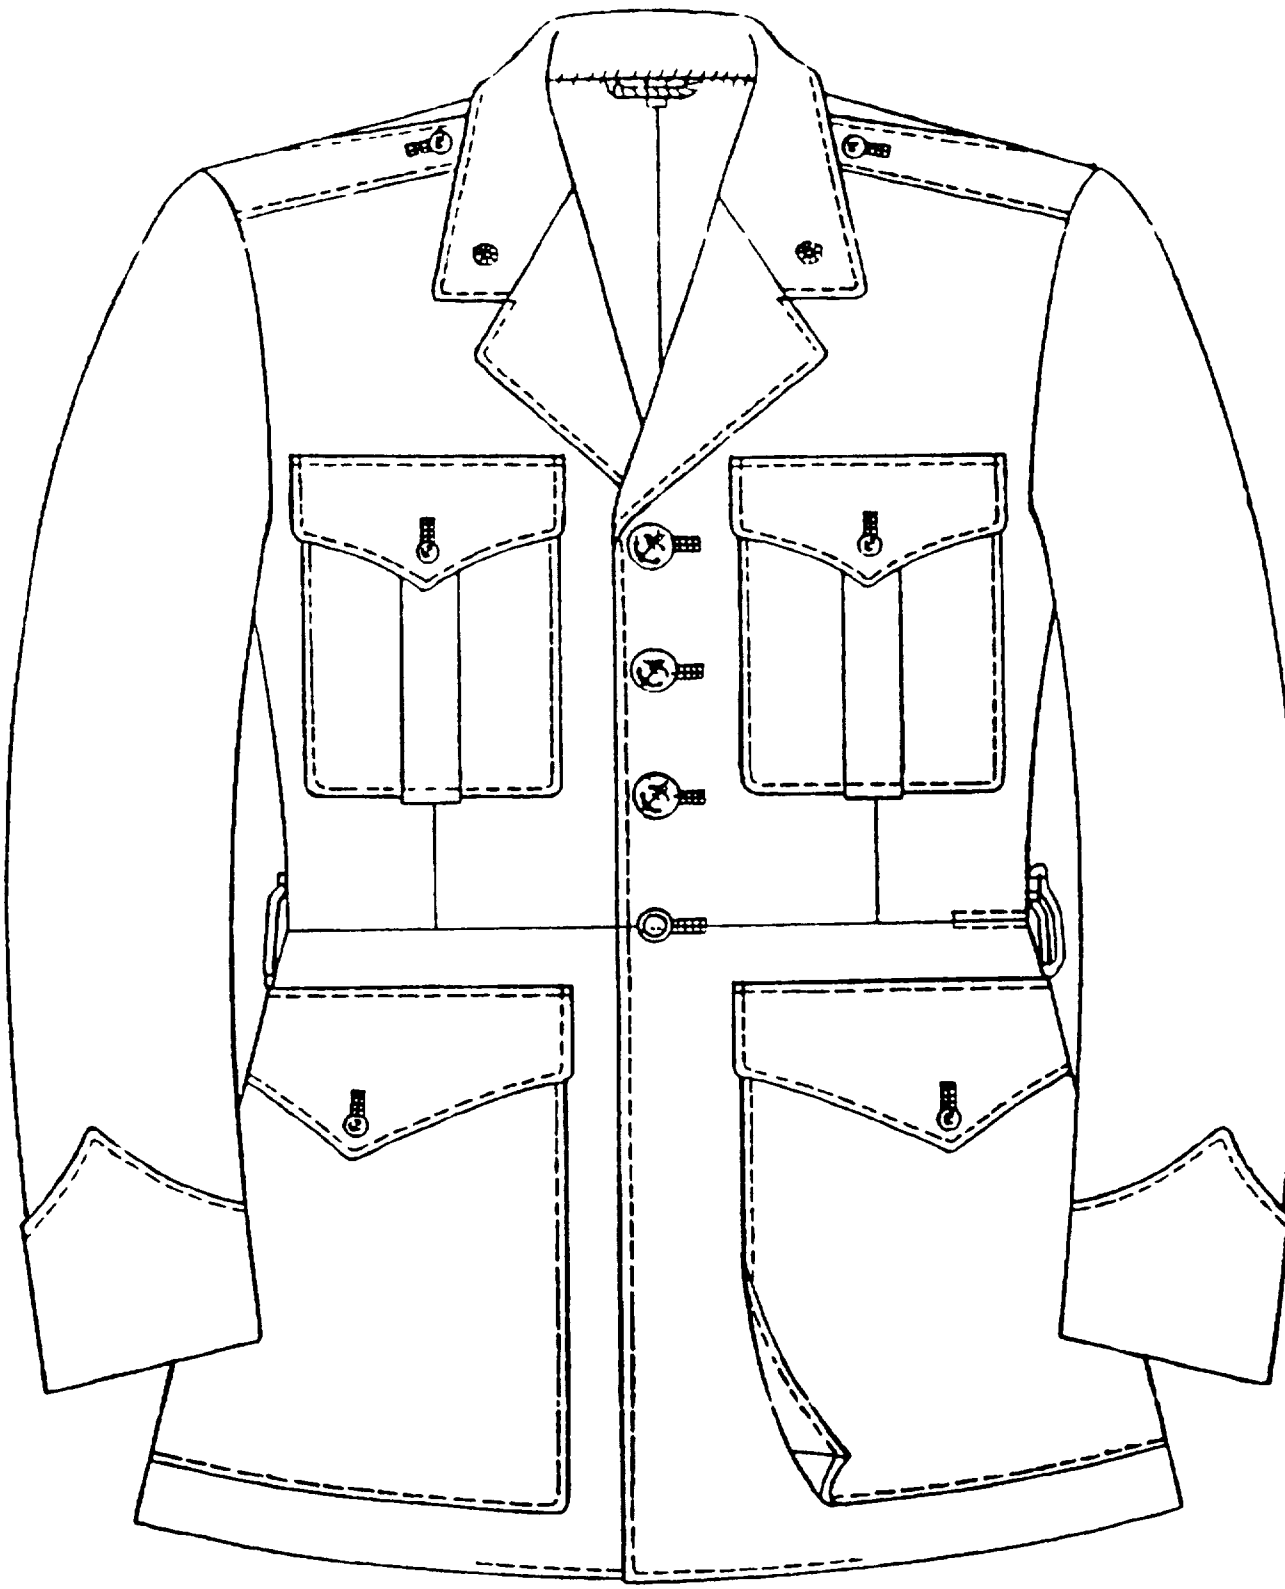


COAT, MAN'S, SERVICE, OFFICER'S, USMC

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

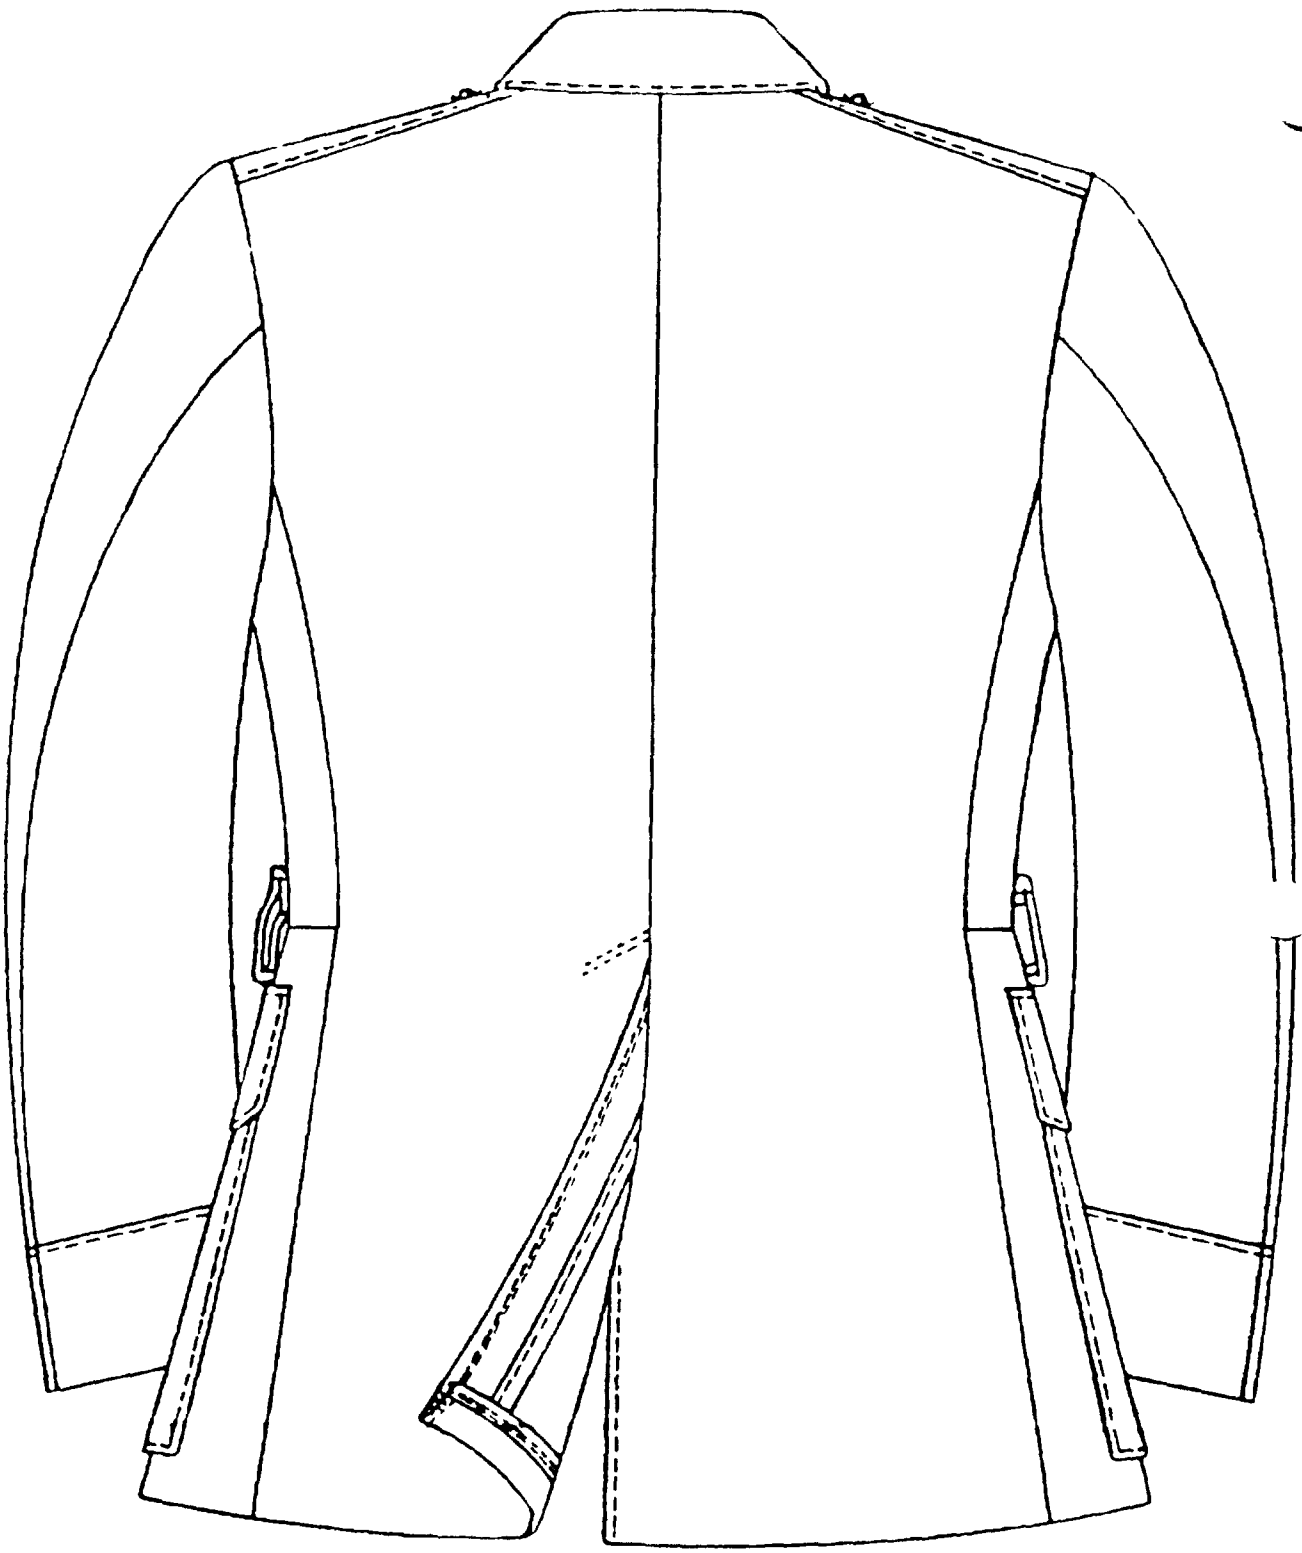


COAT, MAN'S, SERVICE, OFFICER'S, USMC

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

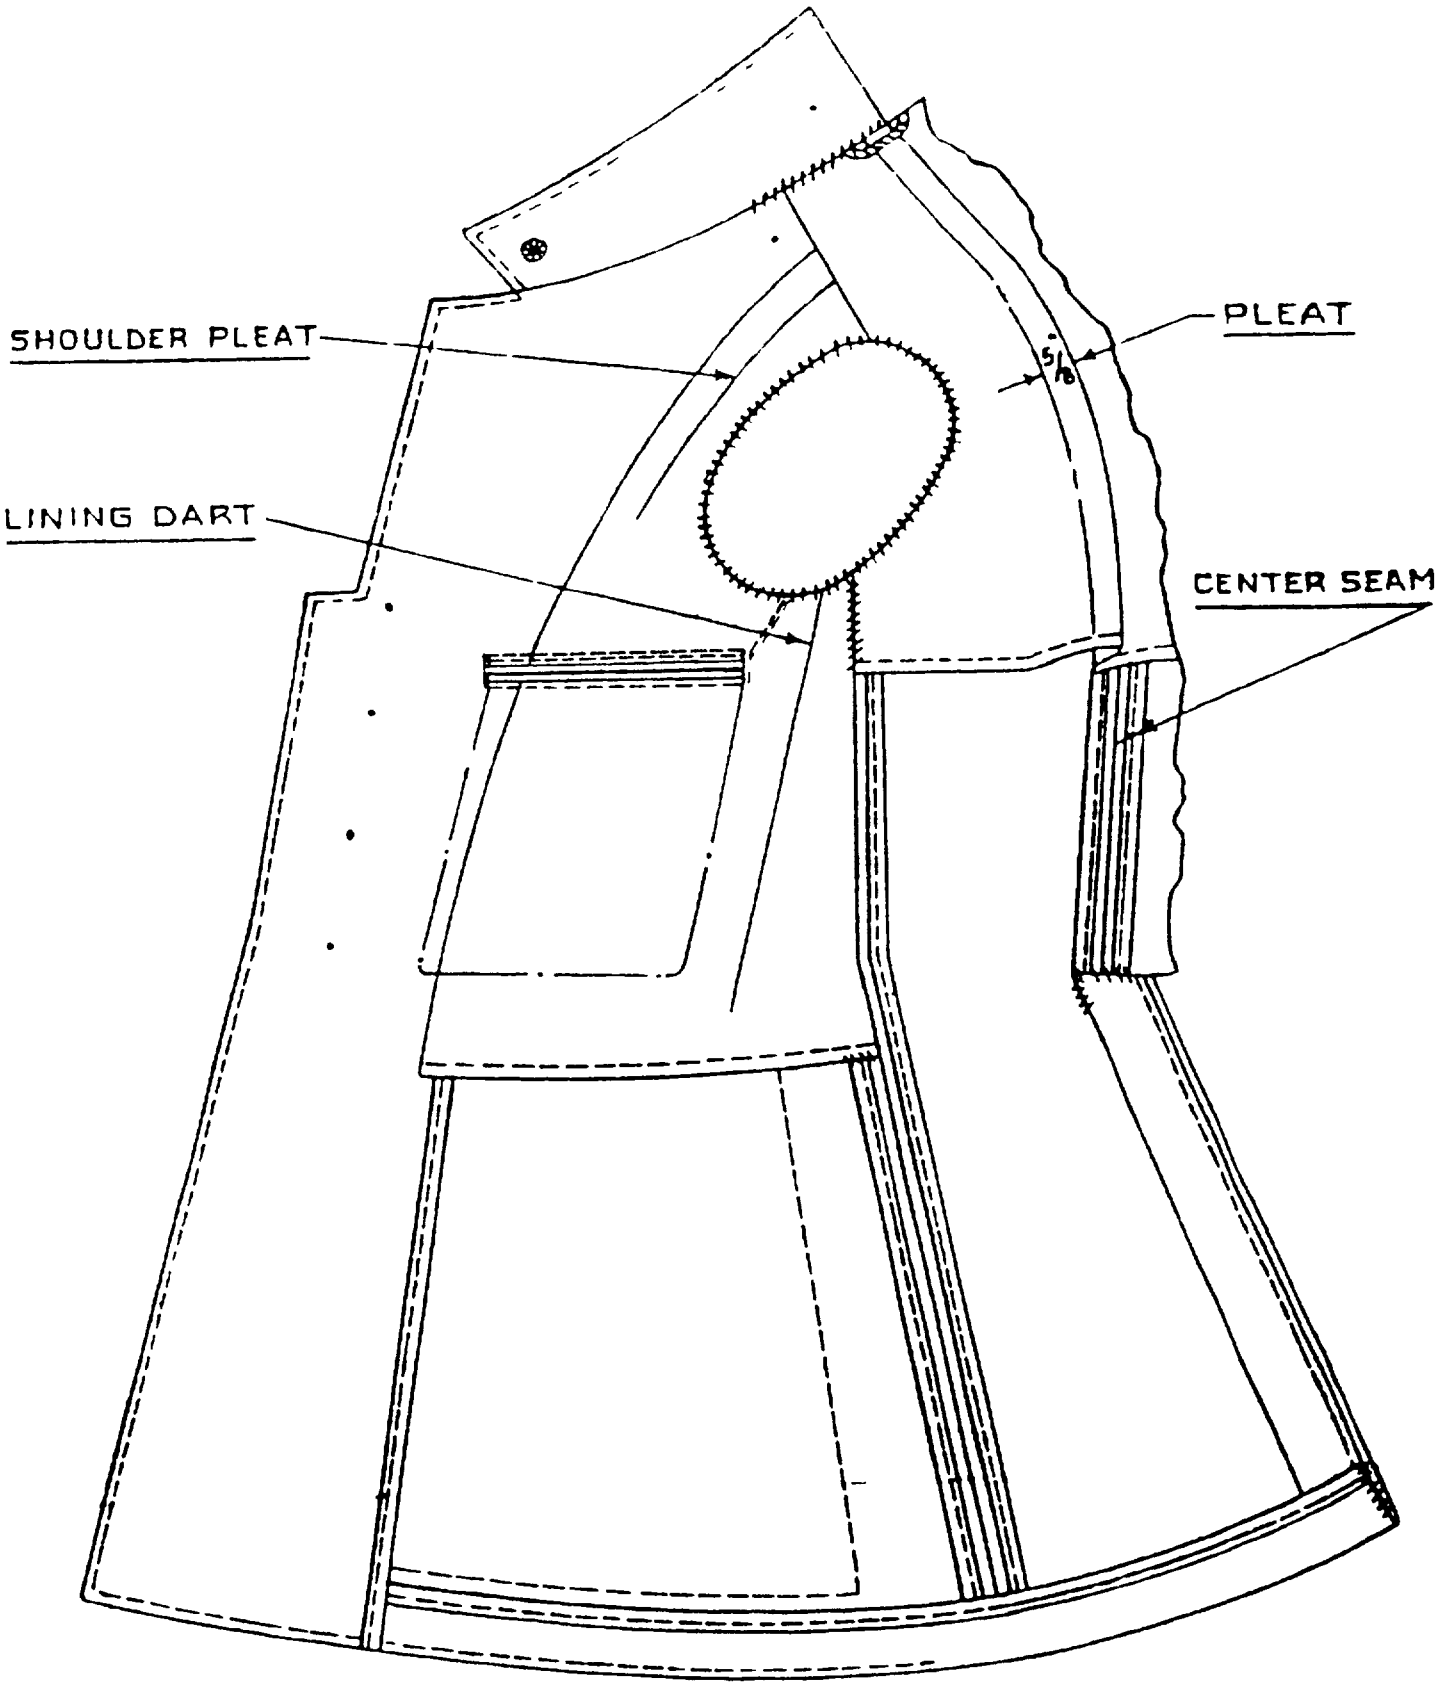


COAT, MAN'S: SERVICE, OFFICER'S, USMC

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.

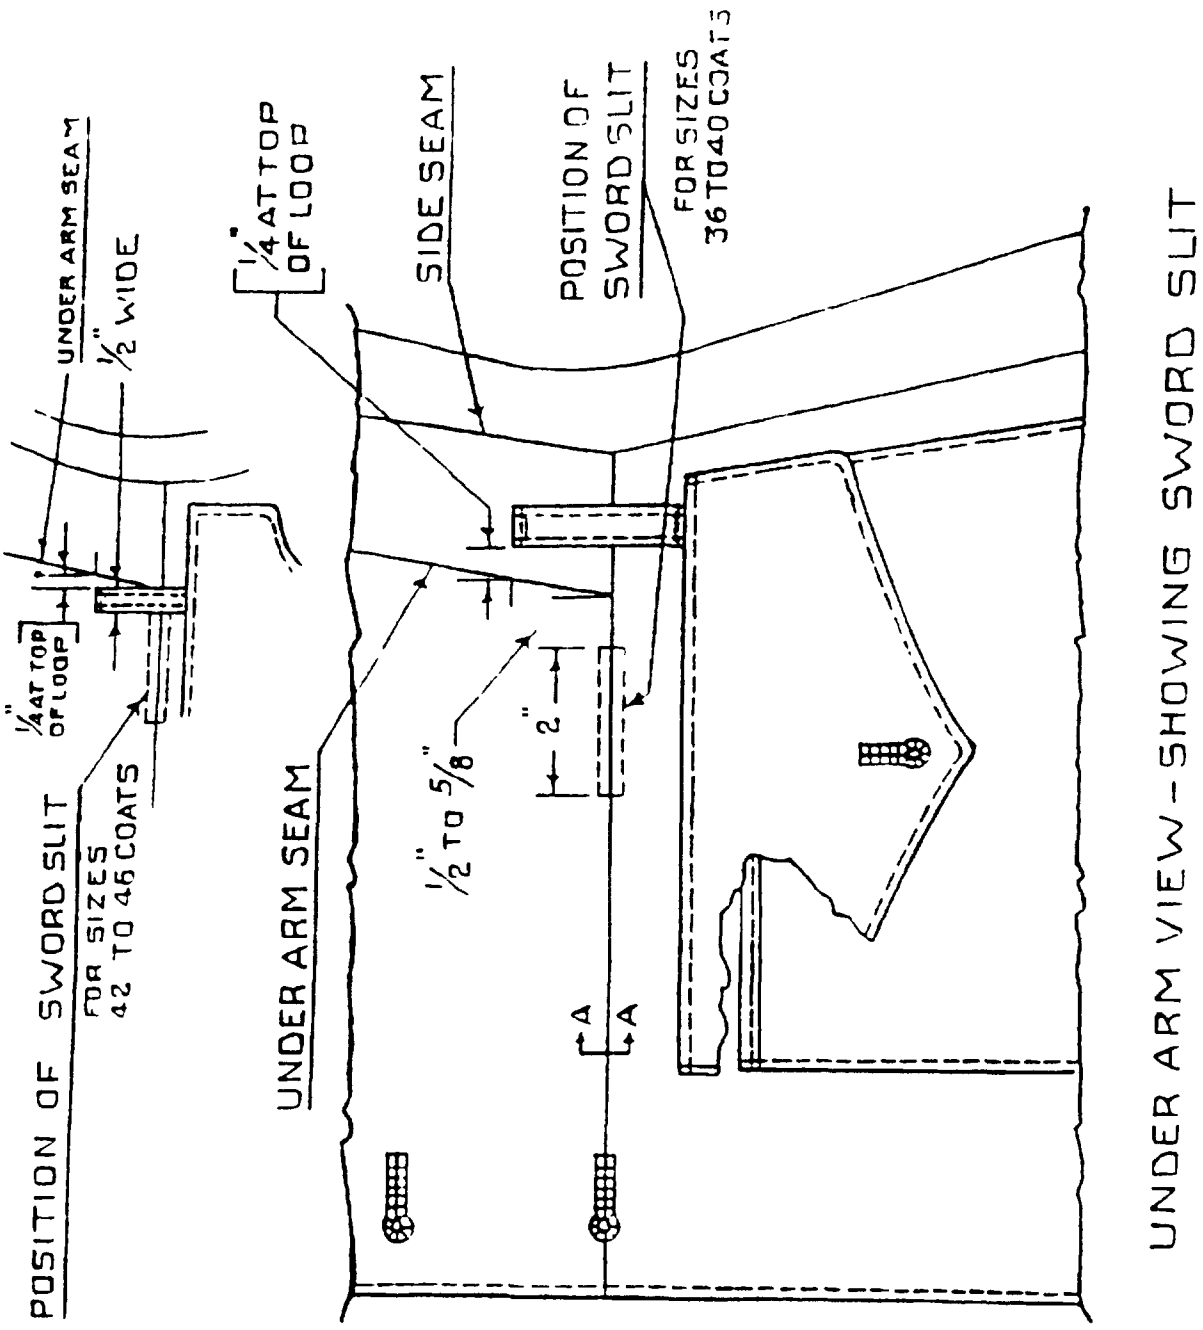


UNDER ARM VIEW - SHOWING SWORD SLIT

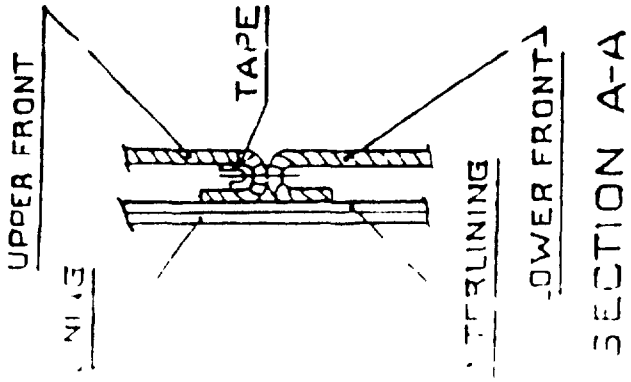


SECTION A-A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

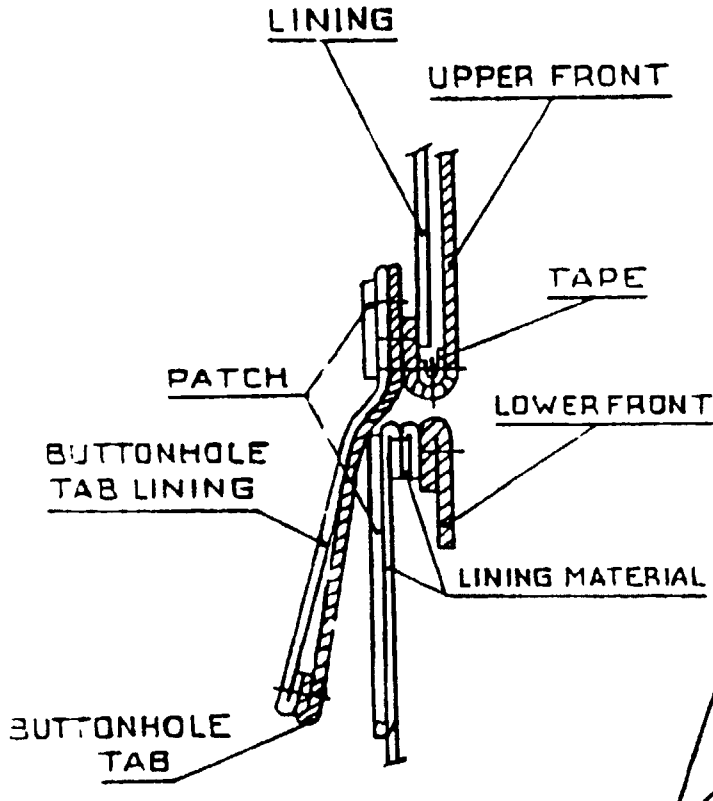

SECTION A-A

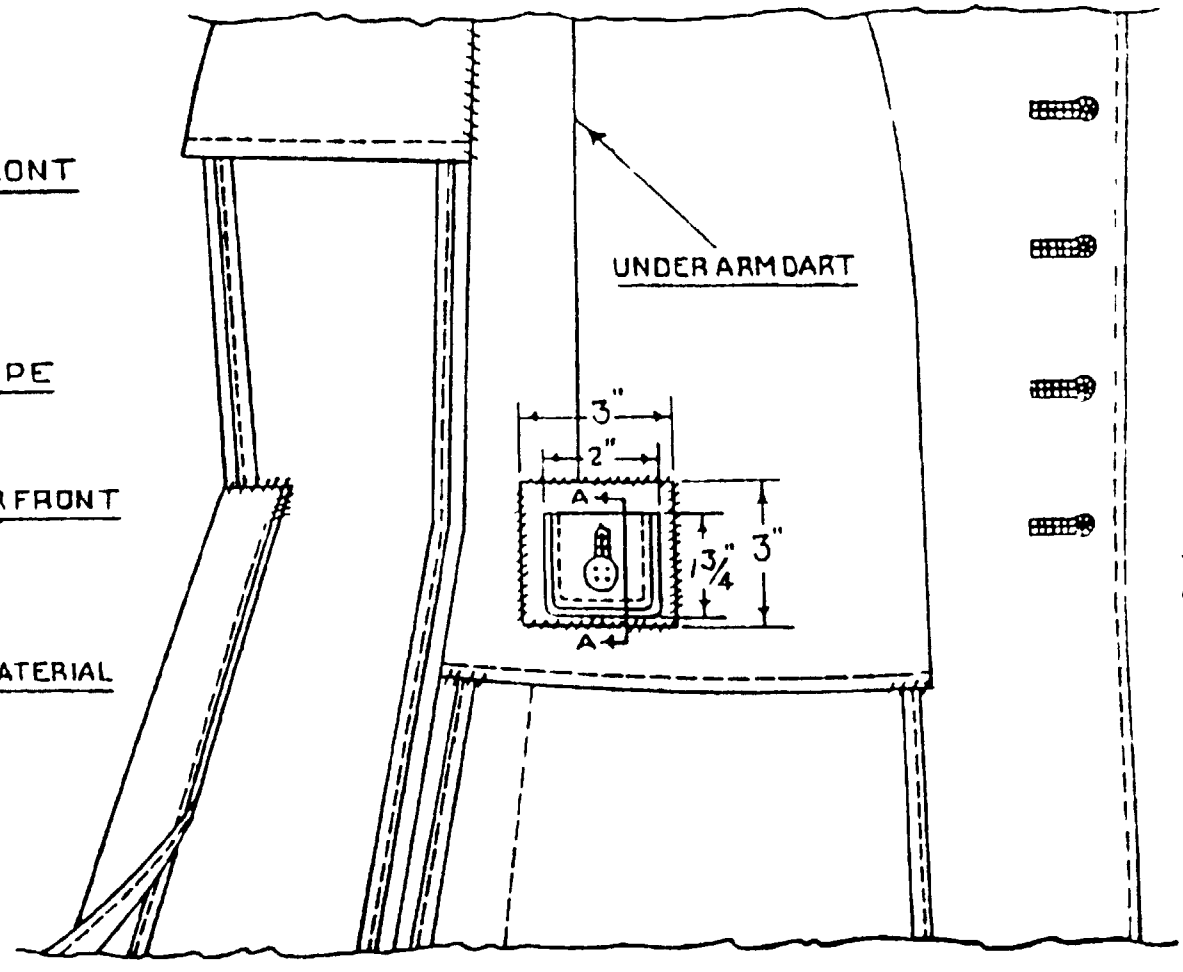



SIDE VIEW, LEFT-INSIDE
SHOWING SWORD SLIT, TAB AND PATCH

COAT, MAN'S SERVICE, OFFICER'S, USMC


113

Source: https://assist.dla.mil -- Downloaded: 20240-19T08:40Z
Check the source to verify that this is the current version before use.

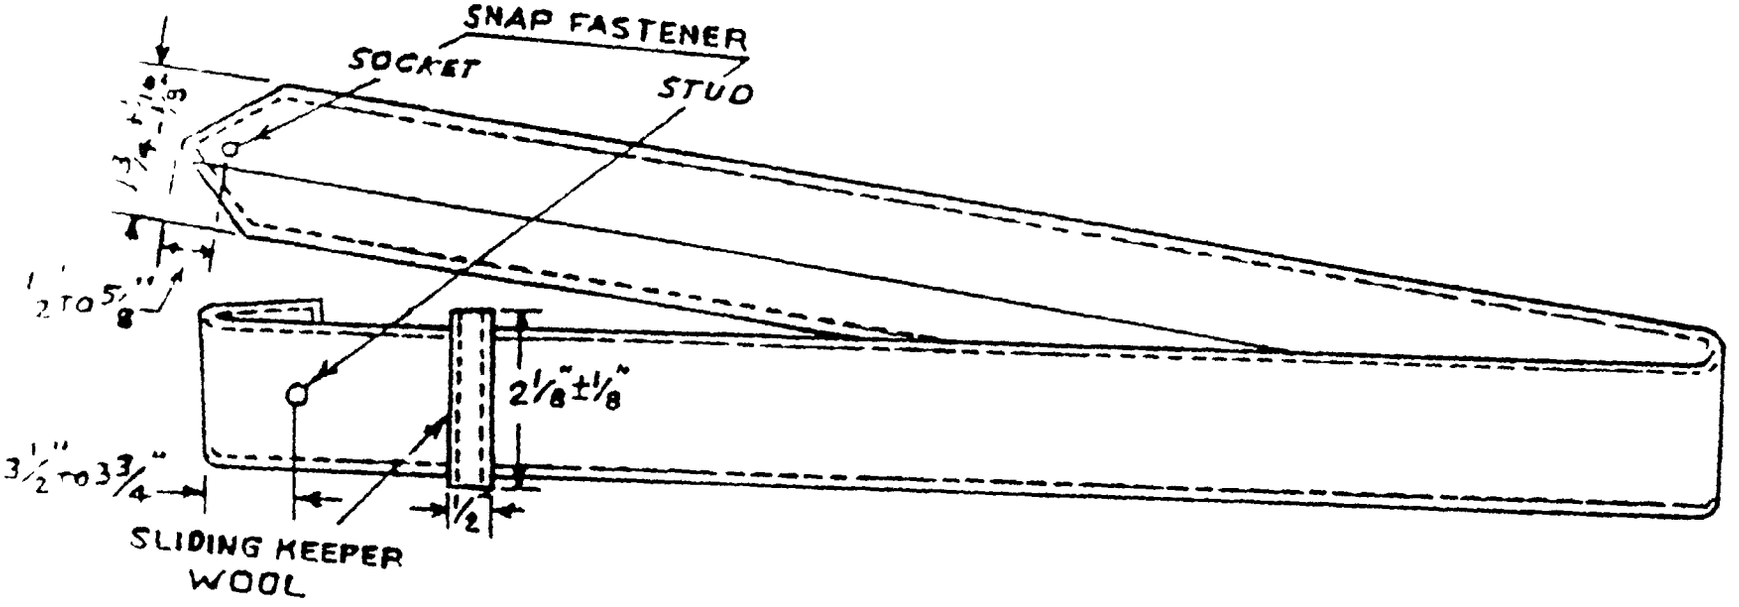

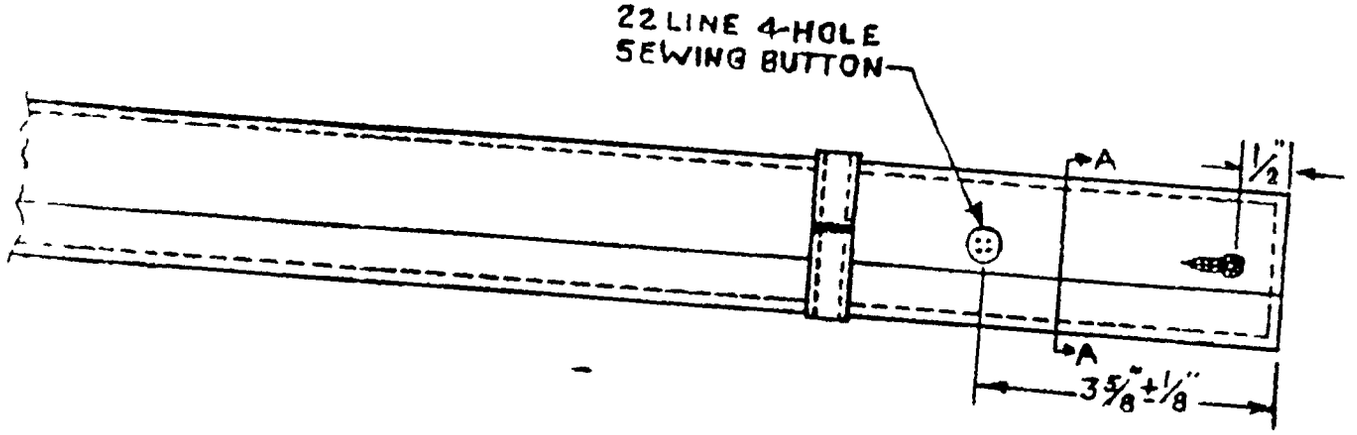


BELT DETAIL

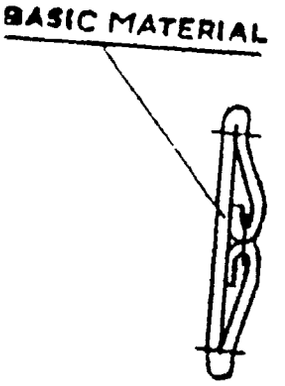

SECTION A-A

MIL-C-21088D(MC)

Source: https://assist.dla.mil -- Downloaded: 20260-19T08:40Z
Check the source to verify that this is the current version before use.

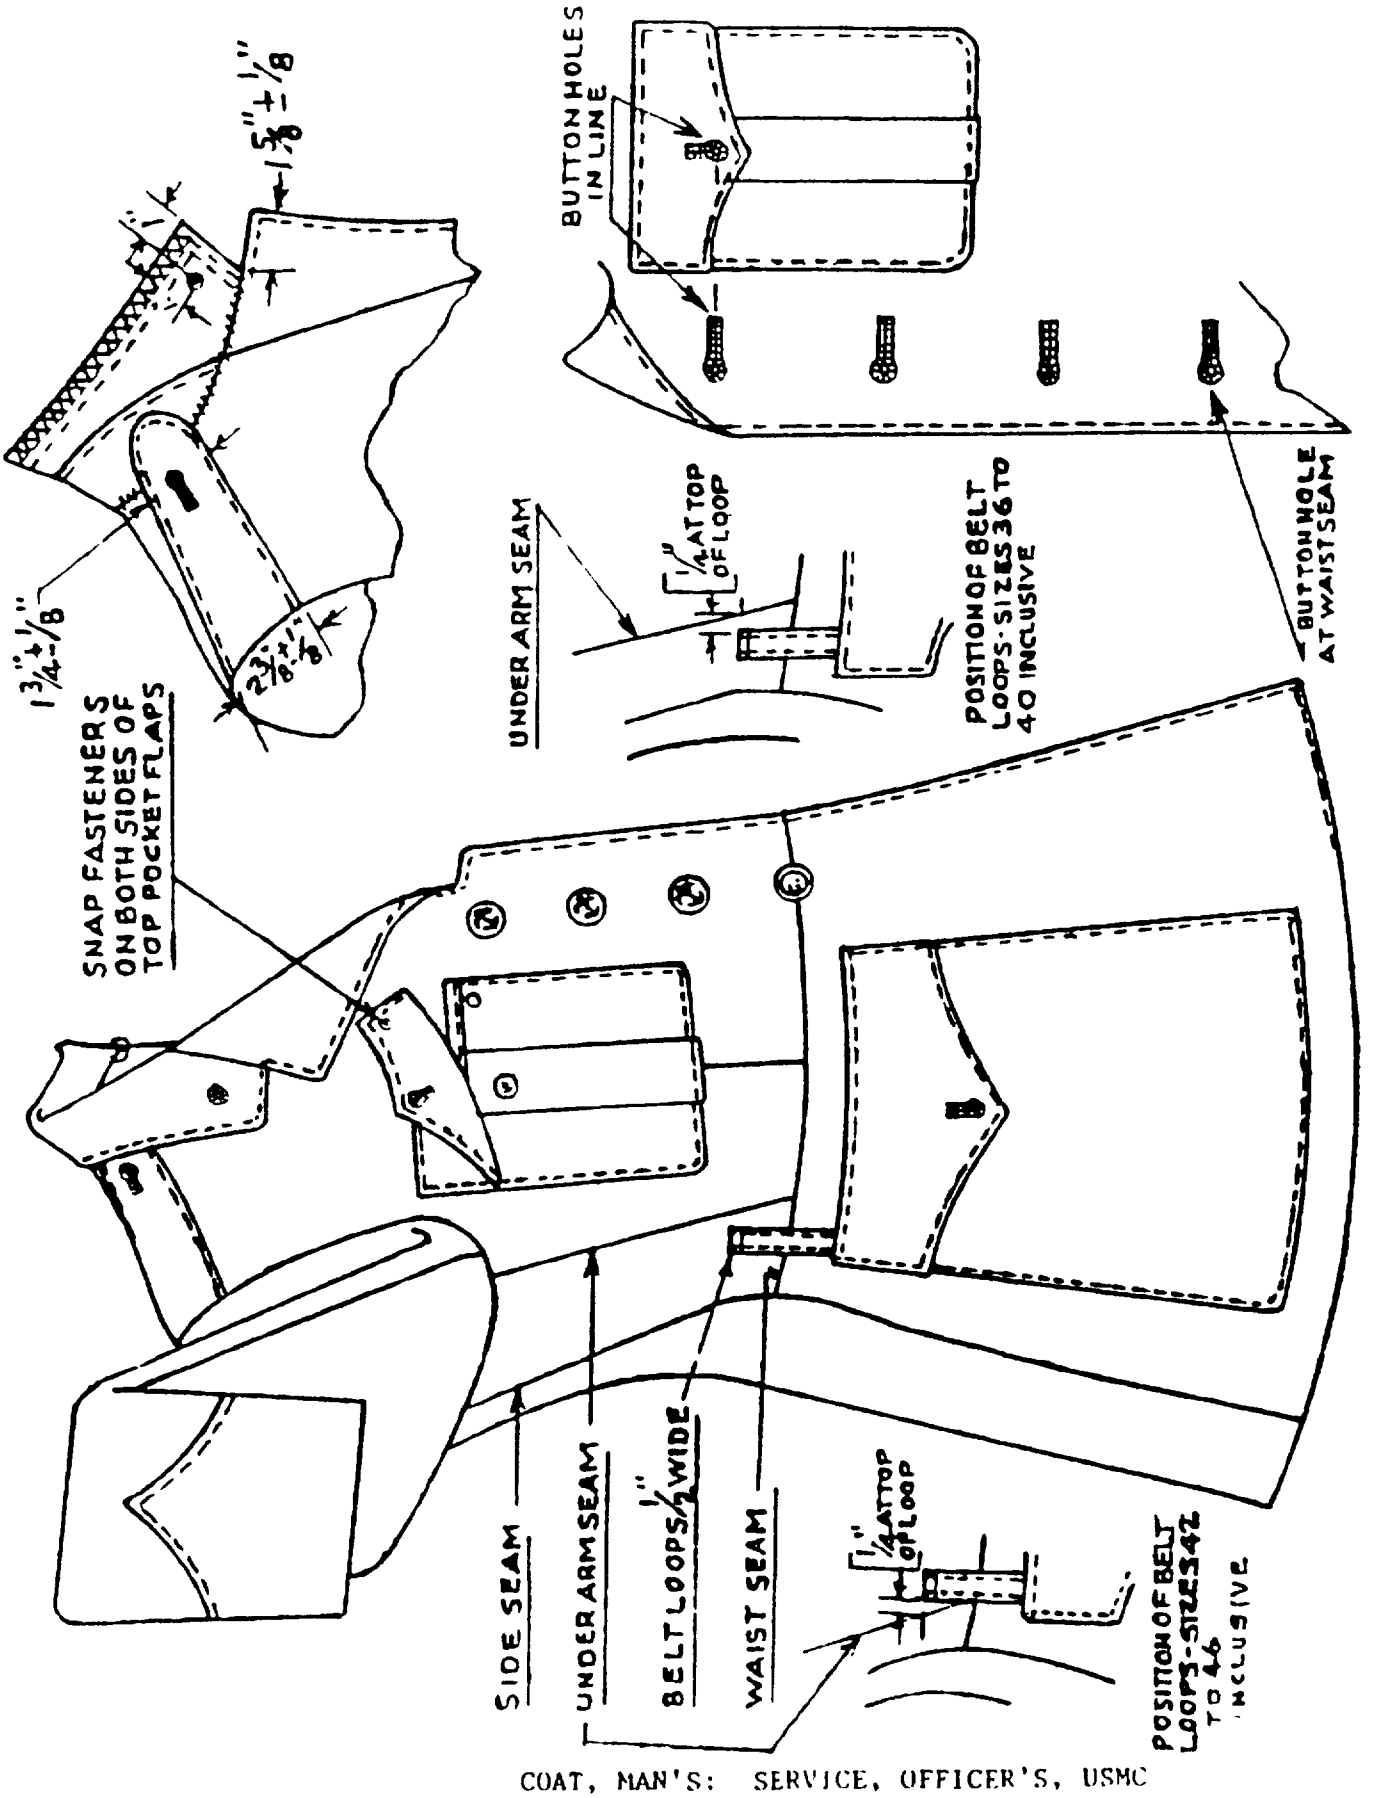

COAT, MAN'S: SERVICE, OFFICER'S, USMC

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:40Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1 The preparing activity must complete blocks 1 2 3 and 8 In block 1, both the document number and revision letter should be given

2 The submitter of this form must complete blocks 4, 5, 6, and 7

3 The preparing activity must provide a reply within 30 days from receipt of the form

NOTE This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER	2 DOCUMENT DATE (YYMMDD)
	MIL-C-21083D(MC)	22 Feb 95

3. DOCUMENT TITLE
COAT, MAN'S: SERVICE, OFFICER'S, USMC

4 NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed)*

5 REASON FOR RECOMMENDATION

6. SUBMITTER

a NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8 PREPARING ACTIVITY

a NAME	b TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER	(703) 640 4584	278-4584
c ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE MARCORSYSCOM, 2033 BARNETT AVE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike Suite 1403 Falls Church VA 22041-3466 Telephone (703) 756 2340 AUTOVON 289 2340	

DD Form 1426, OCT 89 *Previous editions are obsolete* 198-290

Source: https://assist.dla.mil -- Downloaded: 202610-19T08:40Z
Check the source to verify that this is the current version before use.