MILITARY SPECIFICATION SHEET

CONTACTS, ELECTRICAL CONNECTOR, SOCKET, CRIMP REMOVABLE, SHIELDED, (FOR MIL-C-26500(USAF) AND MIL-C-26518(USAF) CONNECTORS)

This specification sheet is approved for use by the Air Force Acquisition Logistics Division, Electronic Support Division (AFALD/PTES), Wright Patterson AFB, Ohio 45433, Department of the Air Force, and is available for use by all Departments and Agencies of the Department of Defense.

The complete requirements for procuring the contacts described herein shall consist of this document and the latest issue of Specification MIL-C-39029.

INACTIVE FOR NEW DESIGN

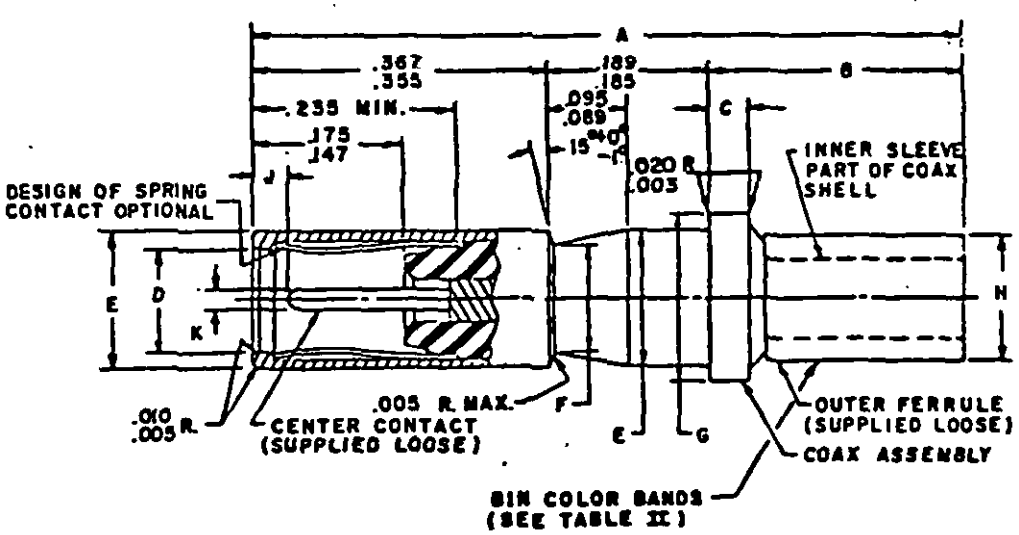


FIGURE 1. Connector contact.

(B) denotes changes

FSC 5935

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

Ⓑ TABLE I. Dimensions

BIN code	A (REF)	B MAX	C	D	E DIA	F DIA	G DIA	H MAX DIA	J	K
344	.859 (21.81)	.298	.062 .044	.128 .126	.161 .158	.135 .131	.199 (5.05) .196 (4.98)	.154	.035 .000	.024 .022
345	.859 (21.81)	.298	.050 .044	.220 .217	.252 .249	.226 .221	.313 (7.95) .309 (7.85)	.195	.035 .000	.041 .039

NOTES:
1. Dimensions are in inches.
2. Metric equivalents are given for general information only and are based upon 1.00 inch = 25.4 mm.
3. Metric equivalents are in parentheses for overall length and diameter only.
4. Dimensions shown apply after plating.
5. Boot sealing: All dimensions are after curing, all diameters shall be concentric within .004 T.I.R. radii shall be .008 maximum unless otherwise specified.
6. Sleeve sealing: Color, white.

FIGURE 1. Connector contact - Continued.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

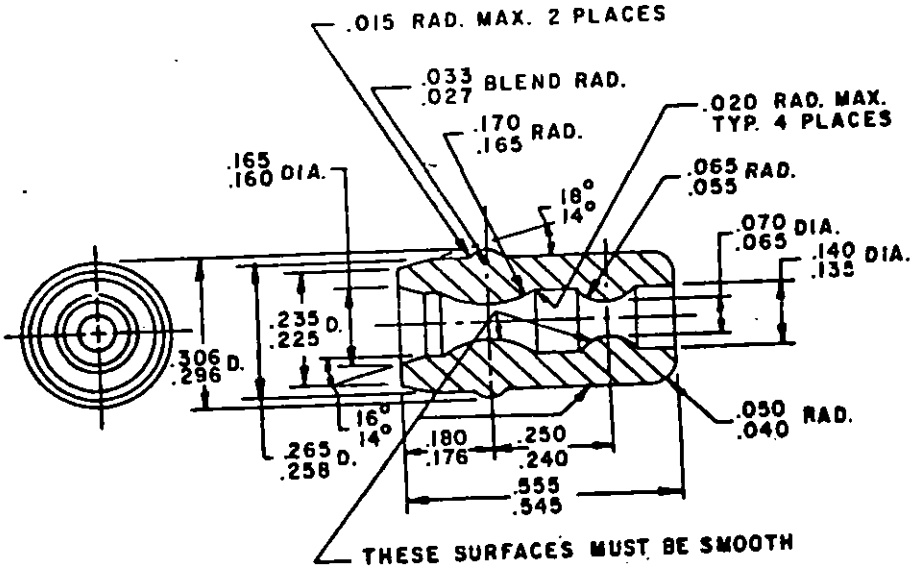


FIGURE 2. Boot, sealing.

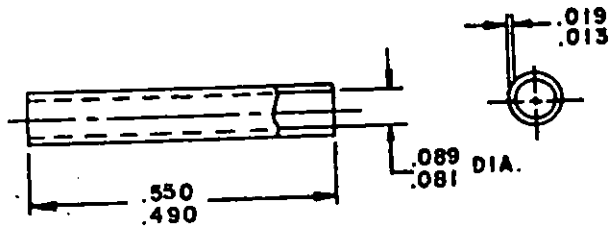


FIGURE 3. Sleeve, sealing, coaxial cable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

BIN CODE 344 ASSEMBLY PROCEDURE (REF)

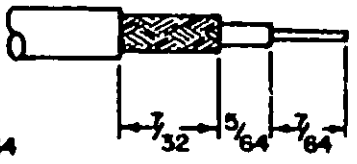
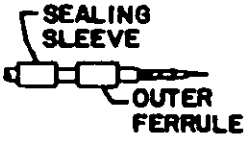
STEP 1 Strip cable jacket, braid and dielectric, to the dimensions shown. Make all cuts square and sharp, being careful not to nick braid, dielectric or center conductor when cutting. If conductor ends fray, twist them to their normal lay.	
STEP 2 After stripping, slide sealing sleeve and outer ferrule onto cable.	
STEP 3 Insert stripped center conductor into contact until wire shows through inspection hole and dielectric butts against contact. Fully seat contact in nest bushing of crimp tool and crimp in one full stroke.	
STEP 4 Slightly flare out ends of wire braid to facilitate insertion of inner ferrule of body assembly. (Do not comb braid.)	
STEP 5 Install center contact in body assembly and slide inner ferrule underneath wire braid as shown. Push center contact until it is locked in place in the body assembly. Pull lightly on cable to make sure that contact is securely locked in place.	
STEP 6 Slide outer ferrule over braid and up against body as shown. There should be no slack in the wire braid. Crimp the outer ferrule with proper tools, then slide sealing sleeve toward contact until sleeve touches outer ferrule.	
STEP 7 Insert the assembled shielded contact into the connector in the same way as the standard contact, with applicable insertion tool. This completes assembly.	

FIGURE 4. Assembly procedure.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

BIN CODE 345, ASSEMBLY PROCEDURE (REF)

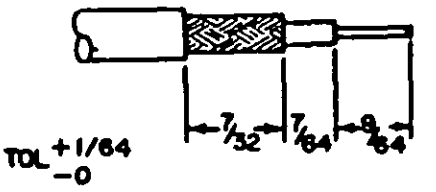
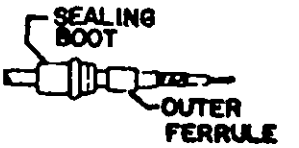

STEP 1 Strip cable jacket, braid and dielectric, to the dimensions shown. Make all cuts square and sharp, being careful not to nick braid, dielectric, or center conductor when cutting. If conductor ends fray, twist then to their normal lay.	
STEP 2 After stripping, slide sealing boot and outer ferrule onto cable.	
STEP 3 Insert stripped center conductor into contact until wire shows through inspection hole and dielectric butts against contact. Fully seat contact in nest bushing of crimp tool and crimp in one full stroke.	
STEP 4 Slightly flare out ends of wire braid to facilitate insertion of inner ferrule of body assembly. (Do not comb braid)	
STEP 5 Install center contact in body assembly and slide inner ferrule underneath wire braid as shown. Push center contact until it is locked in place in the body assembly. Pull lightly on cable to make sure that contact is securely locked in place.	
STEP 6 Slide outer ferrule over braid and up against body as shown. There should be no slack in the wire braid. Crimp the outer ferrule with proper tool.	
STEP 7 Insert the assembled shielded contact into the connector in the same way as the standard contact, with applicable insertion tool.	
STEP 8 To complete assembly, push sealing boot into connector grommet until O-ring riser of boot snaps into place and seals the assembly.	

FIGURE 4. Assembly procedure - Continued.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

TABLE II. Design characteristics.

BIN code	Color bands 1st	2nd	3rd	Contact cavity size	Ⓑ Cables accommodated	Type	Class
344	Orange	Yellow	Yellow	12	M27500-22RE1N06	D	A
345	Orange	Yellow	Green	8	M27500-20RE1N06		

TABLE III. Tools.

BIN code	Inner contact: Basic crimping tool	Inner contact: Positioner	Outer contact: Basic crimping tool	Outer contact: Crimping die	Installing tool	Removal tool
344	M22520/2-01	M22520/2-33	M22520/5-01 M22520/10-01	M22520/5-08 M22520/10-05(A)	M81969/17-05	M81969/19-09
345	M22520/2-01	M22520/2-24	M22520/5-01 M22520/10-01	M22520/5-10 M22520/10-06	M81969/17-06	M81969/19-03

REQUIREMENTS:

Design and construction:

Dimensions and configuration: See figures 1 thru 3 and table I.

Ⓑ Vibration: Method 2005 of MIL-STD-1344, test condition IV.

Ⓑ Shock (specified pulse): Method 2004 of MIL-STD-1344, test condition C.

Tools: See table III.

Boots and sleeve sealing: Parts must be free of flash, cracks or cavities (see figure 2).

Boots sealing: Immediately after molding, cure boots.

Sleeve sealing material: Flexite SR200 silicone rubber extruded tubing, or equivalent standard wall (see figure 3).

Ⓑ Mating contact: MIL-C-39029/54.

Assembly procedure: See figure 4.

Boots and sleeve sealing shall be shipped with unit package.

Manufacturer's recommended assembly instructions to be shipped with unit package.

QPL evaluating activity: Defense Electronics Supply Center, (DESC-E), Dayton, OH 45444.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

Military part number: See table IV.

TABLE IV. Military part number.

Ⓑ

BIN code	Military part number	Superseded part number
344	M39029/55-344	MS27185-22S
345	M39029/55-345	MS27185-20S

Custodian:
Air Force - 85

Review activities:
Air Force - 11, 17, 99

Preparing activity:
Air Force - 85

(Project 5935-F160-2)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE AIR FORCE

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 73236 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE AIR FORCE

AFALD/PTES Stdn
Gentile AFS OH 45444

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
	☐ USER
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ MANUFACTURER
	☐ OTHER *(Specify)*:

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T18:38Z
Check the source to verify that this is the current version before use.