MILITARY SPECIFICATION

FUZE, GRENADE: HAND, PRACTICE, M228 CONVERTED LOADING, ASSEMBLING AND PACKING

This specification is approved for use by Picatinny Arsenal, Department of the Army and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the conversion of inprocess M213 Hand Grenade Fuzes, and the loading, assembling and packing for one type of fuze designated as Fuze, Grenade: Hand, Practice, M228.

2. APPLICABLE DOCUMENT:

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-P-116 - Preservation, Method of
MIL-P-223 - Powder, Black
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)

FSC: 1330

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

MIL-STD-414 - Sampling Procedures and Tables for Inspection by Variables for Percent Defective
MIL-STD-1235- Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes

DRAWINGS

U.S. ARMY PICATINNY ARSENAL

PRODUCT AND PACKAGING DRAWINGS

9235210 - Fuze, Grenade: Hand, Practice, M228
9251665 - Box, Wirebound, Packing, Ammunition, for Fuze, Hand Grenade, M213, M215 or Practice, Delay, M228
9251666 - Carton, Packing, Ammunition, for Fuze, Hand Grenade, M213, M215 or Practice, Delay, M228

INSPECTION EQUIPMENT DRAWINGS

8816636 - Adapter Drop Test
9278658 - Training Manual For Radioisotopic Automatic Hand Grenade Fuze Checker

(Copies of specifications, standards and drawings required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with the applicable drawings and specifications.

3.2 Fuze. - The fuze shall comply with all requirements specified on Drawing (dwg.) 9235210, all associated drawings, and with all requirements specified in applicable specifications.

3.3 Fuze Body. - There shall be no evidence of cracks or porosity in the fuze body after consolidation of the delay column when inspected as specified.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

3.4 Functioning. - The fuze shall not dud (see 6.5) nor fail to function because of a "hung" striker (see 6.6). It shall function high order (see 6.7), and shall comply with the following delay time requirements:

3.4.1 Premature. - The fuze shall not function in less than three (3) seconds.

3.4.2 Normal Delay. - The fuze shall function in not less than four (4) nor more than five (5) seconds.

3.4.3 Excessive Delay. - No fuze shall have a functioning delay time greater than ten (10) seconds.

3.5 Release Resistance. - The safety clip shall not be disengaged from its assembled position over the lever by a load of twenty-five (25) ounces but shall be completely disengaged from the lever by a load of eighty (80) ounces, when tested as specified. The safety clip shall be considered disengaged from its assembled position over the lever when the square end of the safety clip moves upon the flat surface of the lever to the extent that the clip does not return to its original assembled position when the load is removed.

3.6 Workmanship. - All parts and assemblies shall be fabricated and loaded in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

3.7 First Article Inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

4. QUALITY ASSURANCE PROVISIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

*4.1 Responsibility for Inspection and Standard Quality Assurance Provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

*4.2 Classification of inspections. - The following types of inspection shall be conducted on this item.

a. First Article Inspection
b. Quality Conformance Inspection

4.3.1 Submission. - The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2 and 4.3.3. The first article sample shall consist of: sets of parts, every subassembly, completely loaded fuze assemblies and loaded fuze assemblies less igniter case assembly as specified in Table 1.

4.3.2 Inspections to be performed. - See MIL-A-48078 and paras 4.4.2.1 thru 4.4.2.7 testing per para. 4.4.3, and Table I specified herein.

4.3.3 Rejection. - See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

TABLE 1 - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE			SHEET 1 OF 1	DRAWING NUMBER
	Fuze, Grenade; Hand Practice, M228				SEE BELOW
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
5	Igniter Case Assembly, (Dwg. 9235948) Examination for Defects	25	100%	3.2	4.4.2.1
	Fuze Assembly (Dwg. 9235210) Examination for Defects	25	100%	3.2	4.4.2.4
	Functioning	500	d	3.4	4.4.3.2
	Automatic Inspection of Delay Column (a)	500	100%	3.2	4.4.3.3
	Safety Pin Withdrawal (Lower Limit)	500	100%	3.2	4.4.3.4.2
	(Upper Limit) (b)	500	100%	3.2	4.4.3.4.1
	Primer Holder Assembly Push Out Resistance	100	d	3.2	4.4.3.6
	Security of Primer & Primer Holder after Environmental Test (Fuze assembly less igniter case assembly)	50	d	3.2	4.4.3.7
	Release Resistance (c)	50	100%	3.5	4.4.3.9

NOTES:

(a) Prior to performing the functioning test, the five-hundred samples shall be subjected to the testing prescribed in 4.4.3.3, 4.4.3.4.1 and 4.4.3.4.2.

(b) Upper limit to be performed in conjunction with the functioning test specified in 4.4.3.2.

(c) Prior to performing the security of primer and primer holder after environmental test, the samples shall be subject to the testing prescribed in 4.4.3.9.

(d) Acceptance criteria shall be as specified in applicable test paragraph.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

*4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078, and shall consist of one hybrid lot. In addition, this inspection lot of fuzes shall contain:

a. Metal parts or metal parts assemblies of one lot interfix number from one manufacturer.
b. Black powder of one lot number from one manufacturer.
c. In process partially assembled M213 fuzes Government furnished from one manufacturer and combined into one hybrid lot of approximately 260,000 fuzes.

4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.1	Igniter Case Assembly		9235948
			NEXT HIGHER ASSEMBLY 9235210

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Weight of black powder		0.40%	3.2	Balance
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

7

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.2	Lever	1 OF 1	8822378
			NEXT HIGHER ASSEMBLY: 9235210

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B	None defined				
Minor					
201	Protective coating missing or base metal exposed		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

8

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.3	Fuze Assembly, Prior to Assembly of Igniter Case Assembly				9235210
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Location of delay charge from bottom of delay cavity		100%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.4	Fuze Assembly				9235210
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Crack in igniter case assembly		100%	3.2	Visual
2	Safety pin ends incorrectly formed or cracked		100%	3.2	Visual
3	Automatic inspection mark missing		100%	3.2	Visual
4	Igniter crimp incomplete, nonuniform or contains cusps		100%	3.2	Visual
5	Safety clip missing or incorrectly assembled		100%	3.2	Visual
6	Either or both lever hinge ears missing		100%	3.2	Visual
7	Both lever hinge ears not bent away from the body past the vertical centerline of the body hinge bosses		100%	3.2	Visual/Figure 1B
8	Ends of both lever hinge ears not bent upwards		100%	3.2	Visual/Figure 1A
Major A					
101	Either lever hinge ear not bent away from the body past the vertical centerline of the body hinge bossess		0.40%	3.2	Visual/Figure 1B
102	End of either lever hinge ear not bent upwards		0.40%	3.2	Visual/Figure 1A
Major B					
131	Functional concentricity of igniter case assembly with thread		0.40%	3.2	Gage
132	Distance from flat on body to bottom of igniter case assembly crimps		0.40%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS


MIL-F-63070(PA)


PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.4	Fuze Assembly				9235210
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
133	Diameter of igniter case assembly crimps		0.40%	3.2	Gage
134	Sealing compound missing or incomplete		0.40%	3.2	Visual
Minor					
201	Protective coating damaged to extent that base metal is exposed		0.65%	3.2	Visual
202	Marking missing, incorrect or illegible		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

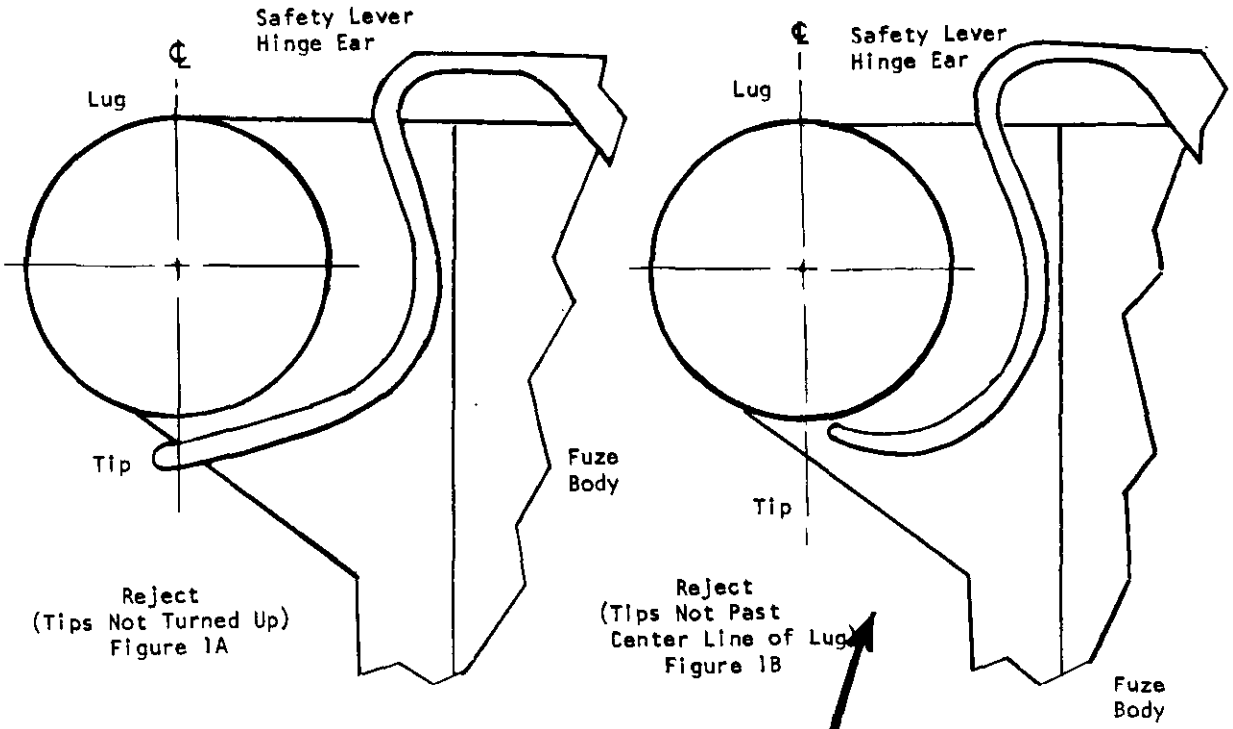

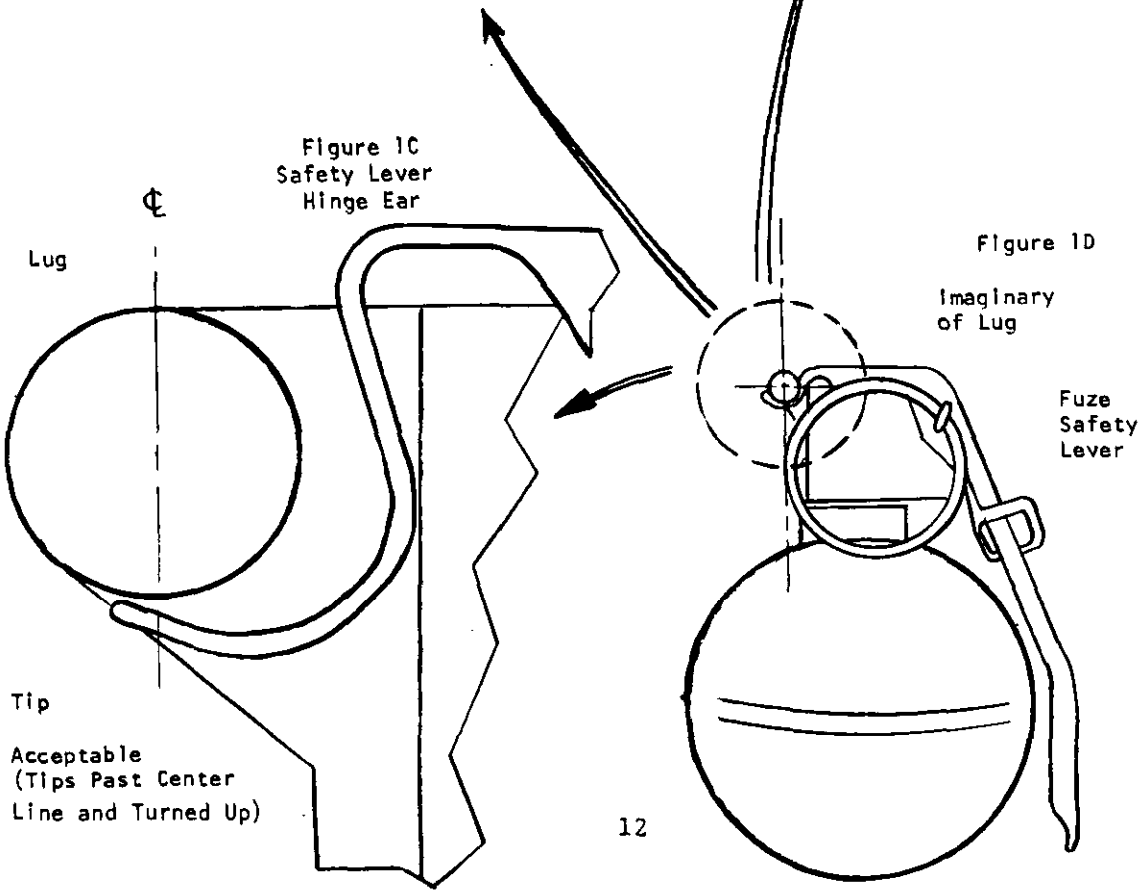

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Sealed Carton				9251666
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Carton punctured, cut or torn		0.40%	3.2	Visual
132	Sealing strip incomplete or badly wrinkled		0.40%	3.2	Visual
Minor					
201	Contents move when shaken		0.65%	3.2	Manual
202	Marking missing, misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.6	Sealed Barrier Bag	1	1	9251666
				NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Seal improper or incomplete		0.40%	3.2	Visual
132	Bag punctured, torn or cut		0.40%	3.2	Visual
Minor					
201	Marking missing, misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63070(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.7	Sealed Wooden Packing Box				9251666
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Box damaged exposing contents		0.40%	3.2	Visual
132	DOD symbol misleading or unidentifiable		0.40%	3.2	Visual
133	Wire missing, broken or loose		0.40%	3.2	Visual/Manual
Minor					
201	Metallic seal missing, unsealed or improperly positioned (Level A shipments only)		0.65%	3.2	Visual
202	Marking misleading or unidentifiable		0.65%	3.2	Visual
203	Wire loops improperly engaged		0.65%	3.2	Visual
204	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Fuze body (see 3.3). - Critical Defect. - Each fuze body prior to assembly with igniter case assembly shall be examined as specified in 4.5.1 for evidence of a crack or porosity. Any fuze body that fails to comply with the requirement shall be classed defective and removed from the lot.

4.4.3.2 Functioning (see 3.4). - The fuzes shall be observed for any failure to comply with the requirements as classified in Table II when tested as specified in 4.5.2, using equipment in accordance with 4.4.4.

TABLE II

Defect		Classification
Premature delay failure	(see 3.4.1)	Critical
Excessive delay failure	(see 3.4.3)	Critical
"Hung" striker failure	(see 3.4)	Critical
Normal delay failure	(see 3.4.2)	Major A
Dud	(see 3.4)	Major A

A sample of 1,000 fuze assemblies shall be taken from the lot and divided into two equally sized groups. One gorup shall be subjected to the static functioning test as specified in 4.5.2.1 and the other group to the dynamic functioning test as specified in 4.5.2.2. The lot shall be rejected if any of the following test results occur:

a. A critical defective is found (see Table II).
b. If twenty-two (22) or more fuzes dud or function lot order (see 6.7). If fourteen but not more than twenty-one (21) fuzes dud or function low order, a second sample of two-thousand fuzes shall be fired statistically. If the combined samples results in less than forty-nine duds, the lot shall be accepted.
c. If thirteen (13) or more normal delay failures occur in either group, or if the combined number of normal delay failures in both groups equals or exceeds twenty-four (24).

4.4.3.3 Automatic inspection of delay column (see dwg. 9235210 and 9278658).

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

TABLE III

Characteristics	Classification
Delay column missing, less than 0.7 inch in height, or inadequately consolidated	Critical

This inspection shall be conducted 100 percent using the specified automatic radioisotopic inspection equipment as per dwg. 9278658 to assure that the fuze assembly does not contain the defects listed in Table III. The inspection shall be performed in accordance with the procedures specified in 4.5.3 (see 6.8). Fuzes rejected by the equipment may be re-inspected one time. Fuzes which are not accepted by the equipment on re-inspection shall be classed defective and removed from the lot.

4.4.3.3.1 Verification inspection of delay column (see dwg. 9235210). - A sample of three-hundred (300) fuze assemblies shall be selected from each four hours of production and subjected to reinspection with the automatic radioisotopic inspection equipment for the defect listed in 4.4.3.3, Table III. The sample fuzes shall be selected from production just prior to insertion into the packing container. If any fuzes are found to be defective, all production represented by the sample shall be rejected.

4.4.3.4 Safety pin withdrawal (see dwg. 9235210) - Major A defects.

4.4.3.4.1 Lower limit. - The sampling plan for this test shall be in accordance with MIL-STD-1235, CSP-1 and an AQL of 0.25 percent, wherein i = 790 and F = 1/100. Any fuze assembly with a safety pin that is withdrawn with a pull force less than specified shall be classed defective and removed from the lot. The test shall be as specified in 4.5.4 using equipment in accordance with 4.4.4.

4.4.3.4.2 Upper limit. - (Pins subjected to this test shall not be returned to the lot). The sampling plan for this test shall be in accordance with MIL-STD-105 using code letter M and an AQL of 2.50 percent. Any fuze assembly that fails to withdraw when the specified force is applied, shall be classed defective and removed from the lot. The test shall be performed as specified in 4.5.4 using equipment in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

4.4.3.5 Moisture Content of Black Powder (see dwg. 9235948) Major A Defect. - The contractor shall provide adequate controls to assure compliance with the requirements and shall test for verification a minimum of one sample of black powder selected at the loading station at the time of loading from each eight hours production of igniter case assemblies. A composite sample shall not be used. Failure of the sample to comply with the requirement shall cause the black powder represented by the sample, including any igniter case assemblies loaded with the non-conforming powder to be rejected. The contractor shall maintain adequate records to provide identification of the powder used in the loaded igniter case assemblies. Test shall be performed as specified in 4.5.5 using equipment in accordance with 4.4.4.

4.4.3.6 Primer Holder Assembly Push out Resistance (see dwg. 9235210) - Major A Defect. - A sample of 100 fuzes with primer holder assemblies and delay columns, but less igniter case assemblies and striker assemblies, shall be selected at random from each lot for this test. The lot shall be rejected if two or more primer holder assemblies are pushed out with a force of less than specified or if the pushout force sample average fails to comply with the requirement. The test shall be performed as specified in 4.5.6 using test equipment specified in 4.4.4. (Destructive test)

4.4.3.7 Security of primer and primer holder after environmental tests (see dwg. 9235210) - Major defect. - A sample of 50 fuzes less igniters shall be selected at random from each lot. The test shall be performed as specified in 4.5.7 using test equipment as specified in 4.4.4. The lot shall be rejected if any of the following test results occur:

a. A critical defect is found (see Table II)
b. One (1) or more fuzes dud due to primer popout or primer holder popout

4.4.3.8 Heat seal test of sealed bag (see dwg. 9251666) - Major A defect. - Sampling and rejection shall be in accordance with MIL-P-116. The test shall be performed as specified in 4.5.8.

4.4.3.9 Release resistance (see 3.5) - Major A Defect. - The sampling plan for this test shall be in accordance with Table B-1, Code Letter O of MIL-STD-414 using an AQL for the

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

non-disengagement (lower limit) load test of 0.065 percent and an AQL of 1.00 percent for the disengagement (upper limit) load test. The fuze lot shall be rejected if the acceptance criteria of the sampling plan are not met. The test shall be performed as specified in 4.5.9 using test equipment in accordance with 4.4.4. (non-destructive test).

4.4.4 Inspection Equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the 'Paragraph Reference/ Inspection Method' column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and 6.3 herein.

4.5 Test Methods and Procedures.

4.5.1 Fuze Body. - The fuze body after the delay column is consolidated shall be visually examined with four power magnification to determine compliance with the requirement.

4.5.2 Functioning and Delay Time. - The fuzes shall be immersed in water maintained at a temperature of seventy (70) degrees Fahrenheit (F.) plus or minus ten (10) degrees Fahrenheit (F.) for a period of twenty-five (25) plus or minus five (5) minutes. The water shall contain a wetting agent. The fuzes shall be positioned vertically with the top of the fuze approximately six (6) inches below the surface of the water. After removal from the water, the fuzes shall be maintained at a temperature of seventy (70) degrees F. plus or minus ten (10) degrees F. and tested within fifteen (15) minutes by each of the following methods:

4.5.2.1 Static. - The fuze assembly shall be assembled in a fixture. The safety pin shall be pulled and the fuze allowed to function. The functioning order and the recorded delay time shall be observed to determine compliance with the requirements.

4.5.2.2 Dynamic. - The fuze assembly shall be assembled in a fixture as required per dwg. 8816636. The safety pin shall be pulled out and the fuze released to fall four (4) feet to impact on a two (2) inch min. thick steel plate placed with the impact surface perpendicular to the drop axis. The functioning order and delay time shall be observed to determine compliance with the requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

4.5.3 Automatic inspection of delay column. - The automatic radioisotopic inspection equipment, its operation, calibration, and maintenance shall be in accordance with dwg. 9278658. As a minimum, the inspection equipment shall be checked at each inspection station with the specially designated accept-reject standards, for each hour of production, immediately after each down period, and prior to starting daily production. In addition, whenever a power failure occurs the criteria for calibrating and stabilizing the inspection equipment shall be in accordance with dwg. 9278658. If, at any time the testing operation is found to be improper, the testing device shall be declared inoperative until repaired and all assemblies tested since the last satisfactory check shall be rejected subject to retest. Whenever a defective assembly is found, positive action shall be taken to determine the specific cause of the defect and corrective measures instituted to prevent recurrence. The action taken shall be stated on the Critical Defect Report. The Government representative will examine the testing device, test method, records of inspection and handling, and identification of material undergoing test at regular but unscheduled intervals to determine that the test is being carried out in accordance with these provisions.

4.5.4 Safety pin withdrawal (upper and lower limits). - The fuze assembly shall be assembled in a fixture, and the required withdrawal force applied to the safety pin.

4.5.5 Moisture content of black powder - The moisture content of the black powder shall be determined in accordance with the procedure specified in MIL-P-223.

4.5.6 Primer holder assembly push out resistance. - The sample fuze bodies shall be cut at the intersection of the bouchon and the threaded portion of the fuze body and the delay cavity hole reamed to 5/16 inch diameter, min. The bouchon shall be placed in a holding fixture and a punch inserted through the delay cavity hole to make contact with the primer holder assembly. A force shall be applied at a rate not to exceed 1/4 inch per minute until the primer holder assembly shows evidence of moving. The force required to move the primer holder assembly shall be recorded to determine compliance with the applicable requirement.

4.5.7 Security of primer and primer holder after environmental tests. - Prior to performing any test, the sample fuzes shall have the lever, hinge pin, striker assembly, and spring

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

removed. Care shall be exercised to prevent accidental firing of the primer. In the event a primer is accidentally fired, the fired sample shall be replaced. A maximum of seven sample fuzes may be tested in one jumble box providing adequate protection is provided to prevent primer firing or damage to the sample fuze. Upon completion of all tests, the fuze samples shall be completely reassembled with those parts previously removed together with a black powder igniter, and then be functioned in accordance with 4.5.2.2. All functioning times shall be recorded and made a part of the inspection record.

4.5.8 Heat seal test of sealed bag. - This test shall be performed as specified in MIL-P-116.

4.5.9 Release resistance. - The sample fuzes shall be assembled to the inspection equipment. The load shall be applied slowly and steadily in the clip releasing direction until the clip disengages from its assembled position. The applied load that caused disengagement shall be recorded for determination of lot disposition. The test samples may be returned to the lot after safety clips have been reattached if test results are satisfactory.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging

5.1.1 Level A. - The fuzes shall be preserved and packaged in accordance with dwg. 9251666.

5.2 Packing

5.2.1 Level A. - The cartons shall be packed in accordance with dwg. 9251665.

5.3 Marking. - Marking shall be in accordance with dwg. 9251665 and 9251666.

6. NOTES

6.1 Intended Use. - This fuze is intended to be used with the M69, practice hand grenade.

6.2 Ordering Data. - Procurement documents shall specify the following:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

a. Title, number and date of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.

6.3 Submission of Inspection Equipment Designs for Approval (See MIL-A-48078). - Submit equipment designs as required, to Commander: Picatinny Arsenal, ATTN: SARPA-QA-T-T, Dover, New Jersey 07801.

6.4 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander, Picatinny Arsenal, ATTN: SARPA-QA-A-M, Dover, New Jersey 07801.

6.5 Dud. - A dud is defined as a fuze failure caused by non-initiation of the primer assembly when impacted by the striker assembly on the first attempt.

6.6 "Hung" striker. - A hung striker is defined as a striker assembly that fails to rotate and impact the primer assembly due to a burr (including flash) or other cause which results in sufficient restraint to prevent rotation of the striker assembly upon release of the lever.

6.7 High and low order functioning. - High order functions are characterized by a complete and instantaneous explosion accompanied by a loud sharp report. Low order functions are characterized by an abnormally low level of explosive sound.

6.8 The automatic equipment designated for the delay column inspection is specifically designed to positively screen out fuzes with delay columns less than 0.7 inch in height or delay columns which have not been consolidated at the required minimum pressure. Fuzes with properly consolidated delay columns having the required height of 0.8 inch, minimum, will be accepted. The equipment may occasionally accept fuzes with delay columns between 0.7 inch and 0.8 inch depending on the specific combination of column length and column density contained in a particular fuze.

Custodian:
Army-PA

Preparing Activity:
Army-PA

Project Number: 1330-A-092

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDER
Picatinny Arsenal
ATTN: SARPA-QA-A
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:09Z
Check the source to verify that this is the current version before use.